Agilent 16334A Test Fixture

Operation and Service Manual

Second Edition



Agilent Part No. 16334-90000 December 1999

Printed in Japan

Notices

The information contained in this document is subject to change without notice.

This document contains proprietary information that is protected by copyright.All rights are reserved. No part of this document may be photocopied, reproduced, or translated to another language without the prior written consent of the Agilent Technologies.

Agilent Technologies Japan, Ltd.

Component Test PGU-Kobe

1-3-2, Murotani, Nishi-Ku, Kobe-shi, Hyogo, 651-2241 Japan

© Copyright Agilent Technologies Japan, Ltd. 1990, 1999

Manual Printing History

The manual's printing date and part number indicate its current edition. The printing date changes when a new edition is printed. (Minor corrections and updates that are incorporated at reprint do not cause the date to change.) The manual part number changes when extensive technical changes are incorporated.

January 1990 First Edition (part number: 16334-90000)

December 1999 Second Edition (part number: 16334-90000)

Safety Summary

The following general safety precautions must be observed during all phases of operation, service, and repair of this instrument. Failure to comply with these precautions or with specific WARNINGS elsewhere in this manual may impair the protection provided by the equipment. In addition it violates safety standards of design, manufacture, and intended use of the instrument.

The Agilent Technologies assumes no liability for the customer's failure to comply with these requirements.

Ground The Instrument

To avoid electric shock hazard, the instrument chassis and cabinet must be connected to a safety earth ground by the supplied power cable with earth blade.

DO NOT Operate In An Explosive Atmosphere

Do not operate the instrument in the presence of flammable gasses or fumes. Operation of any electrical instrument in such an environment constitutes a definite safety hazard.

Keep Away From Live Circuits

2

WARNING	Dangerous voltages, capable of causing death, are presenting this instrument. Use extreme caution when handling, testing, and adjusting this instrument.
	Warnings, such as the example below, precede potentially dangerous procedures throughout this manual. Instructions contained in the warnings must be followed.
	Dangerous Procedure Warnings
	Because of the danger of introducing additional hazards, do not install substitute parts or perform unauthorized modifications to the instrument. Return the instrument to a Agilent Technologies Sales and Service Office for service and repair to ensure that safety features are maintained.
	DO NOT Substitute Parts Or Modify Instrument
	Do not attempt internal service or adjustment unless another person, capable of rendering first aid and resuscitation, is present.
	DO NOT Service Or Adjust Alone
	Operating personnel must not remove instrument covers. Component replacement and internal adjustments must be made by qualified maintenance personnel. Do not replace components with the power cable connected. Under certain conditions, dangerous voltages may exist even with the power cable removed. To avoid injuries, always disconnect power and discharge circuits before touching them.

Safety Symbol

General definitions of safety symbols used on the instrument or in manuals are listed below.



Instruction Manual symbol: the product is marked with this symbol when it is necessary for the user to refer to the instrument manual.

- \sim Alternating current.
- **___** Direct current.
- On (Supply).
- **O** Off (Supply).

In position of push-button switch.

Out position of push-button switch.

Frame (or chassis) terminal. A connection to the frame (chassis) of the equipment which normally include all exposed metal structure.

WARNING

This warning sign denotes a hazard. It calls attention to a procedure, practice, condition or the like, which, if not correctly performed or adhered to, could result in injury or death to personnel.

	This Caution sign denotes a hazard. It calls attention to a procedure, practice, condition or the like, which, if not correctly performed or adhered to, could result in damage to or destruction of part or all of the product.	
NOTE	Note denotes important information. It calls attention to a procedure, practice, condition or the like, which is essential to highlight.	

Certification

Agilent Technologies certifies that this product met its published specifications at the time of shipment from the factory. Agilent Technologies further certifies that its calibration measurements are traceable to the United States National Institute of Standards and Technology, to the extent allowed by the Institution's calibration facility, or to the calibration facilities of other International Standards Organization members.

Warranty

This Agilent Technologies instrument product is warranted against defects in material and workmanship for a period corresponding to the individual warranty periods of its component products. Instruments are warranted for a period of one year. Fixtures and adapters are warranted for a period of 90 days. During the warranty period, Agilent Technologies will, at its option, either repair or replace products that prove to be defective.

For warranty service or repair, this product must be returned to a service facility designated by Agilent Technologies. Buyer shall prepay shipping charges to Agilent Technologies and Agilent Technologies shall pay shipping charges to return the product to Buyer. However, Buyer shall pay all shipping charges, duties, and taxes for products returned to Agilent Technologies from another country.

Agilent Technologies warrants that its software and firmware designated by Agilent Technologies for use with an instrument will execute its programming instruction when property installed on that instrument. Agilent Technologies does not warrant that the operation of the instrument, or software, or firmware will be uninterrupted or error free.

Limitation of Warranty

The foregoing warranty shall not apply to defects resulting from improper or inadequate maintenance by Buyer, Buyer-supplied software or interfacing, unauthorized modification or misuse, operation outside the environmental specifications for the product, or improper site preparation or maintenance.

No other warranty is expressed or implied. Agilent Technologies specifically disclaims the implied warranties of merchantability and fitness for a particular purpose.

Exclusive Remedies

The remedies provided herein are buyer's sole and exclusive remedies. Agilent Technologies shall not be liable for any direct, indirect, special, incidental, or consequential damages, whether based on contract, tort, or any other legal theory.

Assistance

Product maintenance agreements and other customer assistance agreements are available for Agilent Technologies products.

For any assistance, contact your nearest Agilent Technologies Sales and Service Office. Addresses are provided at the back of this manual.

Typeface Conventions

Bold	Boldface type is used when a term is defined. For example: icons are symbols.
Italic	Italic type is used for emphasis and for titles of manuals and other publications.
[Hardkey]	Indicates a hardkey labeled "Hardkey."
Softkey	Indicates a softkey labeled "Softkey."
[Hardkey] - Softkey1 - Softkey2	Indicates keystrokes [Hardkey] - Softkey1 -
	Softkey2.

1.	Operation	
	DESCRIPTION.	10
	Specifications	12
	Typical Characteristics	13
	ZERO OFFSET ADJUSTMENT	14
	OPERATION	15
2.	Service	
	Maintenance	18

Contents

1 Operation

This operation note provides complete information on the 16334A Test Fixture.

DESCRIPTION

The 16334A Testfixture was designed for use with the following instruments:

4192A LF Impedance Analyzer 4194A Impedanoe/Gain-Phase Analyzer 4274A Mu-ti-Frequency LCR Meter 4275A Multi-Frequency LCR Meter 4276A LCZ Meter 4277A LCZ Meter 4278A 1kHz/1MHz Capacitance Meter

The 16334A is a direct attachment, 4-terminal pair type fixture which is equipped with a tweezer type probe for measurement of leadless components such as chip capacitors.

The tweezer tips are replaceable. The distance between the tweezer tips is continuously adjustable according to the distance between the DUT terminals. A compensation block is furnished for compensation to be minimize the effects of residual impedance and the stray admittance.

The specifications of the 16334A are given in Table 1-2, and the typical characteristics are shown in Figure 1-2, and listed in Table 1-3.





Table 1-1

Accessories

Description	Agilent Part No
Compensation Block	16334-60001

Table 1-1Accessories

Description	Agilent Part No
Tweezer Tip	16334•09002 (1ea.)
Bumishing Tool	8830-0002

Chapter 1

Operation Specifications

Specifications

Table 1-2

Function:	For use with 4192A, 4194A, 4274A, 4275A, 4276A, 4277A and 4278A instruments. Permits connecting miniature leadless components to the UNKNOWN terminals (4-terminal pair configuration) of the 4192A, 4194A, 4274A, 4275A, 4276A, 4277A, or 4278A.
Measurable Components:	Miniature components with terminals on opposite faces (Distance between component terminals \leq 10mm).
Terminal Configuration:	4-terminal pair configuration from BNC connectors to the top of the tweezers (excluding the tweezer tips).
Cable Length:	Approximately 1m
Maximum Voltage:	\pm 42V peak max. (AC+DC)
Measurement Frequency Range:	5 Hz to 15 MHz
Cable Length:	Approximately 1m (from BNC connector to the top of the tweezers)
Weight:	Approximately 0.29 kg

Typical Characteristics

Table 1-3	Typical Characteristics
	I preur characteristics

Model	Applicable Measurement Range		Incremental error (1 MHz≤f)	
Widder	Parameter Value	Measurement Frequency	Parameter reading error (%)	Offset value for D
4192A	Full range	Full range	$\pm 2 \times (f/10)^2 \%^{*1}$	$\pm 0.02 \times (f/10)^2 \%^{*1}$
4194A		below 15 MHz		
4274A			-	-
4275A			$\pm 2 \times (f/10)^2 \%^{*1}$	±0.02×(f/10) ² % ^{*1}
4276A		Full range	-	-
4277A ^{*2}				
4278A ^{*2}			±0.02%	±0.0002%

*1. There are some cases where the actual incremental error exceeds this limit when this fixture is used with an 4192A or 4275A.


*2. The maximum measurement frequency of the 4277A and 4278A is 1 MHz, so the incremental error is available only for 1 MHz measurements.

NOTE

f is the measurement frequency in MHz. The incremental error is available at the frequency range 1 MHz to 15 MHz, and incremental error applies after the completion of ZERO-OPEN/SHORT compensation.

Figure 1-2

Incremental Error

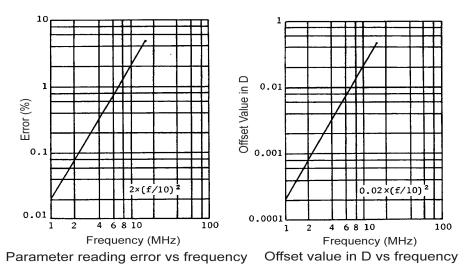


ZERO OFFSET ADJUSTMENT

The 16334A has inherent residual impedance and stray admittance that affects the accuracy of the measurements. To compensate for, or negate, these residuals in order to minimize measurement error, the instrument's zero offset adjustment procedure should be performed. The zero offset adjustment procedure is described in the instrument's manual. When performing the zero offset adjustment, use compensation block Agilent PN 16334-60001 (furnished with probe). An illustration showing how to use the compensation block is shown in Figure 1-3.

Figure 1-3

Zero Offset Adjustment

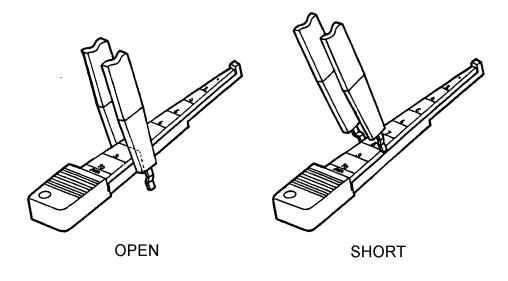

OPERATION

Setup and measurement procedure is as follows:

- 1. Set the instrument's cable LENGTH to 1m.
- 2. Connect the 16334A directly to the UNKNOUN terminals of the instrument.
- 3. Perform the ZERO offset adjustment described in the instrument's operation manual.
- 4. Connect the DUT to the 16334A test fixture.


WARNING DO NOT APPLY MORE THAN ±42V OF DC BIAS VOLTAGE TO THE UNKNOWN TERMINALS. AN ELECTRICAL SHOCK HAZARD WILL EXIST DURING OPERATION WHEN THE DC BIAS VOLTAGE IS GREATER THAN ±42V DC.

Operation OPERATION

2 Service

Maintenance

An exploded view of the 16334A (for parts identification) is shown in Figure 2-1. Do not disassemble any further than shown. Maintenance consists principally of cleaning contacts and replacing worn or damaged parts. Take special care when cleaning contacts. To order parts, use the Agilent Technologies part numbers listed in Table 2-12-1. If a faulty part is located in an assembly that cannot be disassembled, order the next higher assembly or return the whole device to the nearest Agilent Technologies Sales/Service Office for repair or replacement.

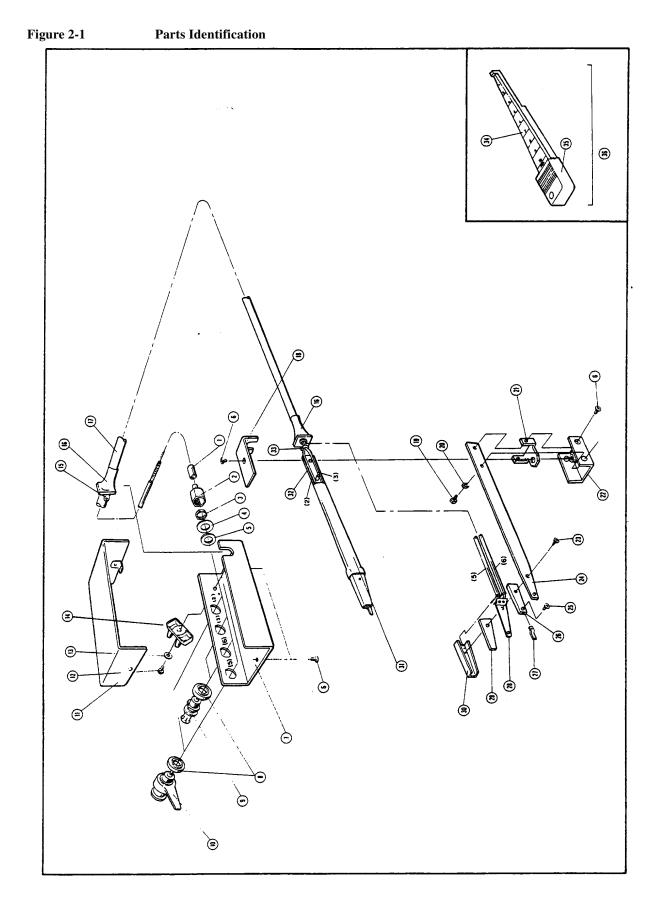

Service Maintenance

Table 2-1Parts Identification

Reference	Agilent Part No.	Qty.	Description	Note
1	*	4	SLEEVE-METAL	1
2	*	4	NUT	1
3	*	4	NUT	1
4	*	4	WASHER	1
5	*	4	WASHER	1
6	0515-0914	7	SCREW	1
7	*	1	COVER-BOTTOM	1
8	*	4	INSULATOR	1
9	*	2	CONNECTOR-BNC	1
10	*	2	BNC-ASSY	1
11	16334-04001	1	COVER-TOP	
12	0515-1550	1	SCREW	
13	2190-0206	1	WASHER	
14	16047-40000	1	STOPPER	
15	1400-0719	2	CABLE-TIE	
16	16334-40003	2	CABLE BUSHING	
17	*	105.5 cm	CABLE	1
18	16334-01202	1	ANGLE	
19	16334-24002	1	SCREW	
20	2190-0584	1	WASHER	
21	16334-01213	1	BRACKET	2
22	16334-01211	1	BRACKET	2
23	0515-1873	2	SCREW	
24	16334-00612	1	ARM PLATE (marked "L")	
25	0515-1872	2	MACHINE SCREW	
26	16334-40001	2	INSULATOR	
27	16334-09002	2	CONTACT (TWEEZER TIP)	
28	16334-09001	2	CONTACT	

Table 2-1Parts Identification

Reference	Agilent Part No.	Qty.	Description	Note
29	16334-09003	2	SPACER	
30	16334-00601	2	SHIELD	
31	0890-0273	2x8.5cm	TUBE, HEAT SHRINKABLE	
32	16334-00613	1	ARM PLATE (marked "H")	
33	1400-0249	2	CABLE TIE	
1thru33	16334-60010	1	TEST FIXTURE	
34	16334-00604	1	PLATE	
35	16334-40002	1	BASE	
36	16334-60001	1	COMPENSATION BLOCK ASSY	
21 (OLD)	16334-01203	1	BRACKET	2
22 (OLD)	16334-01201	1	BRACKET	2

Note 1 : Not separately replaceable. Order 16334-60010.

Note 2: For old designed (one screw) part, order the (OLD) part.