

1260

Impedance/Gain-Phase

Analyzer

OPERATING MANUAL

12600012_Gmacd/CB

Solartron is a division of Solartron Group Ltd. Any reference to Schlumberger or Schlumberger Instruments (the name of the company until November 1993) implies no liability on the part of Schlumberger.

Solartron
a division of Solartron Group Ltd

Victoria Road, Farnborough,
Hampshire GU14 7PW, UK.

19©96

Issue CB: January 1996
Solartron Part No. :12600

Solartron
Victoria Road, Farnborough
Hampshire, GU14 7PW England
Telephone: +44 (0)1252 376666
Fax: +44 (0)1252 544981

Solartron
37 Rue du Saule Trapu
91882 MASSY, Cedex
France
Telephone: +33 (0)1 69 53 63 53
Fax: +33 (0)1 60 13 37 06

Solartron
964 Marcon Blvd., Suite 200
Allentown, PA 18103, USA
Telephone: +1 610-264-5034
Fax: +1 610-264-5329

Solartron
Beijing Liasion Office
Room 327 Ya Mao Building
No. 16, Bei Tu Chen Xi Road
Beijing 100101, PR China
Telephone: +86 10-6238 4687
Fax: +86 10-6202-8617

E-mail: solartron@solartron.com
Web: <http://www.solartron.com>

For details of our agents in other countries, please contact our Farnborough, UK, office.

*Solartron pursues a policy of continuous development and product improvement.
The specification in this document may therefore be changed without notice.*

Solartron

a division of Solartron Group Ltd
Victoria Road, Farnborough
Hampshire GU14 7PW England
Tel +44 (0) 1252 376666
Fax +44 (0) 1252 543854

DECLARATION OF CONFORMITY

The directives covered by this declaration



73123/EEC Low voltage Equipment Directive, amended by 93/68/EEC

89/336/EEC Electromagnetic Compatibility Directive, amended by 92/31/EEC &
93/68/EEC

Product(s)

1260A Impedance Analyzer

Basis on which conformity is being declared


The product(s) identified above comply with the requirements of the EU directives by meeting the following standards:

BS EN50081-1:1992 Electromagnetic Compatibility - Generic Emission Standard
Part 1: Residential, commercial and light industry.

BS EN50082-1:1992 Electromagnetic Compatibility - Generic Immunity Standard
Part 1: Residential, commercial and light industry.

EN61010-1:1993 Safety requirements for electrical equipment for
measurement, control and laboratory use. Accordingly the
CE mark has been applied to this product.

 Signed



For and behalf of Solartron, a division of Solartron
Group Limited

Authority:

Engineering Manager

Date:

December 1995



REGISTERED IN ENGLAND No.2852989. REGISTERED OFFICE: BYRON HOUSE,
CAMBRIDGE BUSINESS PARK, CAMBRIDGE, CB4 4WZ
Approved to BS EN ISO 9001:1994 and BS EN 123000, MOD Registered Company
A Roxboro Group company



GENERAL SAFETY PRECAUTIONS

The equipment described in this manual has been designed in accordance with EN6 1010 'Safety requirements for electrical equipment for measurement, control and laboratory use', and has been supplied in a safe condition. To avoid injury to an operator or service technician the safety precautions given below, and throughout the manual, must be strictly adhered to, whenever the equipment is operated, serviced or repaired. For specific safety details, please refer to the relevant sections within the manual.

The equipment is designed solely for electronic measurement and should be used for no other purpose. Solartron Instruments accept no responsibility for accidents or damage resulting from any failure to comply with these precautions.

GROUNDING

To minimize the hazard of electrical shock it is essential that the equipment is connected to a protective ground whenever the power supply, measurement or control circuits are connected, even if the equipment is switched off. The protective ground for ac and dc supplies is connected separately.

AC GROUND is connected via the ac supply cord. The cord must be plugged into an ac line outlet with a protective ground contact. When an extension lead is used, this must also contain a ground conductor. Always connect the ac supply cord to the supply outlet before connecting the control and signal cables; and, conversely, always disconnect control and signal cables before disconnecting the ac supply cord. The ac ground connection must have a continuous current rating of 6A, and be capable of taking 25A for a minimum of one minute.

AC SUPPLY VOLTAGE

Never operate the equipment from a line voltage or frequency in excess of that specified. Otherwise, the insulation of internal components may break down and cause excessive leakage currents.

FUSES

Before switching on the equipment check that the fuses accessible from the exterior of the equipment are of the correct rating. The rating of the ac line fuse must be in accordance with the voltage of the ac supply.

Should any fuse continually blow, do not insert a fuse of a higher rating. Switch the equipment off, clearly label it "unserviceable" and inform a service technician.

EXPLOSIVE ATMOSPHERES

NEVER OPERATE the equipment, or any sensors connected to the equipment, in a potentially explosive atmosphere. It is NOT intrinsically safe and could possibly cause an explosion.

Continued overleaf.

SAFETY PRECAUTIONS *(continued from previous page)*

SAFETY SYMBOLS

For the guidance and protection of the user, the following safety symbols appear on the equipment:

SYMBOL	MEANING
	Refer to operating manual for detailed instructions of use.
	Hazardous voltages.

NOTES, CAUTIONS AND WARNINGS

For the guidance and protection of the user, Notes, Cautions and Warnings appear throughout the manual. The significance of these is as follows:

NOTES	highlight important information for the reader's special attention.
CAUTIONS	guide the reader in avoiding damage to the equipment.
WARNINGS	guide the reader in avoiding a hazard that could cause injury or death.

AVOID UNSAFE EQUIPMENT

The equipment may be unsafe if any of the following statements apply:

- Equipment shows visible damage.
- Equipment has failed to perform an intended operation.
- Equipment has been subjected to prolonged storage under unfavorable conditions.
- Equipment has been subjected to severe physical stress.

If in any doubt as to the serviceability of the equipment, don't use it. Get it properly checked out by a qualified service technician.

LIVE CONDUCTORS

When the equipment is connected to its measurement inputs or supply, the opening of covers or removal of parts could expose live conductors. The equipment must be disconnected from all power and signal sources before it is opened for any adjustment, replacement, maintenance or repair. Adjustments, maintenance or repair, must be done only by qualified personnel, who should refer to the Maintenance Manual.

EQUIPMENT MODIFICATION To avoid introducing safety hazards, never install non-standard parts in the equipment, or make any unauthorized modification. To maintain safety, always return the equipment to Solartron for service and repair.

1260 OPERATING MANUAL

CONTENTS

Chapter 1: Introduction

1.1 Key Features	1.3
1.2 Use of the Manual	1.4
1.3 Specification	1.5

Chapter 2: Installation

2.1 Accessories	2.3
2.2 Safety	2.3
2.2.1 General Safety Precautions	2.3
2.2.2 Grounding	2.4
2.3 Power Supply	2.5
2.3.1 Power Voltage Selector	2.5
2.3.2 Line Fuse	2.5
2.3.3 Power Cable	2.6
2.3.4 Connection Procedure	2.6
2.4 Rack Mounting	2.7
2.4.1 Telescopic Slide Kit (Accuride)	2.7
2.4.2 Rack Dimensions	2.7
2.4.3 Ventilation	2.7
2.4.4 Fitting Telescopic Slide (Accuride)	2.8
2.4.5 Fitting Telescopic Slide	2.14

Chapter 3: Getting Started

3.1 Introduction	3.3
3.2 Instrument Keyboard	3.4
3.3 Power-up Status	3.6
3.4 Display	3.6
3.5 Using a Control Menu	3.7
3.6 Making a Simple Measurement	3.9
3.6.1 Preliminaries	3.9
3.6.2 Connecting the Item Under Test	3.10
3.6.3 Setting the Analyzer	3.10
3.6.4 Setting the Generator	3.12
3.6.5 Commanding a Measurement	3.14
3.6.6 Setting the Display	3.14
3.7 Using the Sweep Facility	3.16
3.7.1 Setting the Sweep	3.16
3.7.2 Preparing the History File	3.18
3.7.3 Commanding a Series of Measurements	3.18
3.7.4 Reading the History File	3.19
3.8 Using the Plot Facility	3.21
3.8.1 Making a Bode Plot of File Data	3.2
3.8.2 Making a Nyquist Plot of File Data	3.22

Chapter 4: Menu Summary

Menu Summary of:

GENERATOR	4.3
ANALYZER	4.3
SWEEP	4.4
DISPLAY	4.5
PLOTTER	4.5
PLOTTER AXES	4.6
DATA OUTPUT	4.6
SCALE/LIMITS	4.7
VIEW FILE	4.8
VERNIER	4.8
STATUS	4.8
STORE/RECALL	4.9
LEARN PROGRAM	4.9
SELFTEST	4.9

Chapter 5: Menu Terms

Menu Terms of:

GENERATOR	5.3
ANALYZER	5.6
SWEEP	5.12
DISPLAY	5.15
PLOTTER	5.18
PLOT	5.23
PLOTTER AXES	5.24
DATA OUTPUT	5.27
SCALE/LIMITS	5.31
VIEW FILE	5.37
VERNIER	5.38
STATUS	5.41
STORE/RECALL	5.47
LEARN PROGRAM	5.48
SELFTEST	5.50

Chapter 6: Measurement connections

6.1 Introduction	6.3
6.2 Analyzer Input Configurations	6.3
6.2.1 Single-ended Inputs	6.3
6.2.2 Differential Inputs	6.4
6.3 High Frequency Measurements	6.5
6.4 Equivalent Circuits	6.6
6.5 Basic Connections for In-circuit Impedance Measurements	6.7
6.5.1 Cable Lengths	6.7
6.6 The Test Modules	6.8
6.6.1 12601A Component Test Module	6.8
6.6.2 12603A In-Circuit Test Module	6.10

Chapter 7: Remote Control

7.1	Introduction	7.3
7.2	GPIB Interface	7.3
7.2.1	GPIB Capability Code	7.3
7.2.2	GPIB Connector	7.3
7.2.3	GPIB Switches	7.4
7.2.4	Output to the GPIB	7.5
7.2.5	Serial Poll/ Parallel Poll: GPIB	7.7
7.2.6	Parallel Poll	7.10
7.2.7	Commands for IEEE 488 Protocol	7.10
7.3	Serial Interface	7.11
7.3.1	Data Handshake	7.11
7.3.2	Echo	7.11
7.3.3	Input Command Terminator and Character Frame	7.11
7.3.4	Serial Interface Connector	7.11
7.3.5	Baud Rate Switches	7.11
7.3.6	Output to Serial Interface	7.12
7.4	Dump Output Format, for RS423 and GPIB	7.14
7.4.1	"Dump" Output	7.14
7.4.2	"Dump All" Output	7.14
7.4.3	Floating Point Format ("Dump" and "Dump All" Data)	7.15
7.5	Remote/Local Control	7.16
7.5.1	Local Lock-out	7.17
7.5.2	Combined Use of RS423 and GPIB Devices	7.18
7.6	Control Program Examples	7.19
7.6.1	Language Used in Program Examples	7.19
7.6.2	Example: Outputting Readings to the GPI B	7.19
7.6.7	Example: Plotting Results from the History File, Using a Controller	7.20
7.6.4	Example: Outputting the History file to the GPIB	7.20

Chapter 8: Remote Commands

7.1	Introduction	8.2
7.2	Command Syntax	8.2
7.3	Command Summary	8.3
	Command Index	8.14

Chapter 9: Error Messages

9.1	Introduction	9.2
9.2	Error Code Summary	
9.2.1	Group 0: Command Structure	9.3
9.2.2	Group 1: Learnt Program	9.3
9.2.3	Group 2: Combined Parameters	9.4
9.2.4	Group 3: Generator	9.5

9.2.5	Group 4: Learnt Program; History File; Vernier	9.5
9.2.6	Group 5: Missing Modules	9.6
9.2.7	Group 6: Illegal Input/Output	9.6
9.2.8	Group 7: System/Calibration	9.6
9.2.9	Group 8: Measurement Validity	9.7
9.2.10	Group 9: Store/recall	9.8

Chapter 10: Scaling and Limits Checking

10.1	Scaling Facilities	10.3
10.2	Normalising Sweep Measurements	10.3
10.3	Scaling a Measurement	10.5
10.3.1	Checking the Constants Store	10.5
10.3.2	Entering a Scaling Constant	10.6
10.3.3	Checking the Function Store	10.8
10.3.4	Clearing a Scaling Function	10.10
10.3.5	Entering a Scaling Function	10.11
10.3.6	Scaling Function Example	10.12
10.3.7	Applying a Scaling Function	10.19
10.4	The Limits Facility	10.21
10.4.1	Setting the Limits	10.21

Chapter 11: Learnt Programs

11.1	Learnt Program Facilities	11.3
11.1.1	Program Swrage	11.3
11.1.2	Program Keyswitch	11.3
11.2	Checking the Program Memory Space	11.4
11.3	Clearing a Learnt Program	11.5
11.4	Creating a Learnt Program	11.6
11.4.1	Entering the Learn Mode	11.6
11.4.2	Learnt Program Example	11.7
11.5	Executing a Learnt Program	11.11
11.6	Editing a Learnt Program	11.12
11.6.7	Entering the Edit Mode	11.12
11.6.8	Listing of Example Program	11.13
11.6.9	Using the Edit Functions	11.14
11.10	Copying a Learnt Program	11.16
11.7.1	Copy procedure	11.16

1

Introduction

<i>Section</i>	<i>Page</i>
1.1 Key Features	1.3
1.2 Use of the Manual	1.4
1.3 Specification	1.5

1.1 KEY FEATURES

The 1260 Impedance/Gain-Phase Analyzer uses powerful microprocessor-controlled digital and analog techniques to provide a comprehensive range of impedance and frequency response measuring facilities. These include:

- Single sine drive and analysis of the system or component under test over the frequency range 10 μ Hz to 32MHz.
- Measurement integration, and auto-integration, of the analyzer input, for harmonic and noise rejection.
- Sweep facility, for any one of three measurement variables, *frequency*, *amplitude*, or *bias*.
- A comprehensive range of voltage and current transfer characteristics, each one available from the original base data, which includes:
 - polar, log polar, and Cartesian co-ordinates of the voltage measurement result,
 - polar and cartesian co-ordinates of current transfer characteristics,
 - polar and cartesian co-ordinates of impedance and admittance,
 - inductance or capacitance values, with resistance, quality factor, or dissipation factor, for series or parallel circuits.
- Plotter output, of immediate or filed data, to a digital plotter on the GPIB.
- Limit check and data reduction facility. Data output can be confined to those results that fall within, or outside, user-defined values.
- Output ports selectable from: RS 423, GPIB, and the History File.
- Result scaling, that includes: a *normalization* facility that separates the desired results from confusing background data; and, for impedance measurements, a *nulling* facility that compensates for stray capacitance and inductance.
- Vernier facility, which allows the drive to be adjusted whilst measurements are being made.
- Learn program facility, which allows the instrument to learn a series of control settings and commands.
- Component sorting, manual or automatic.
- Self test facility.
- Local control from a simplified key panel, or remote control from the GPIB.

1.2 USE OF THE MANUAL

- | | |
|-------------------|--|
| Chapter 2 | Describes how to install the instrument. This procedure should be followed implicitly, to ensure safe and reliable operation of the instrument. |
| Chapter 3 | Introduces the front panel controls and, by means of simple examples, shows you how to start using the instrument. |
| Chapter 4 | Summarises the control menus. This information, which also appears on a blue pull-out card at the front of the manual, is intended as a memory aid for experienced users. |
| Chapter 5 | Is an encyclopaedia of menu terms and explains the meaning and background of each individual control setting. |
| Chapter 6 | Explains how to connect the instrument to the item under test. |
| Chapter 7 | Gives detailed information on how to control the instrument remotely, from the GPIB. Guidance in the use of RS 423 is given also. |
| Chapter 8 | Remote Commands |
| Chapter 9 | Lists the error messages. Error messages are displayed (and an error code is output to a remote device) when a bad command has been given to the instrument or an unacceptable control condition exists. |
| Chapter 10 | Shows how the measurement results may be scaled and/or limits checked. |
| Chapter 11 | Shows how the instrument may be made to store a series of commands, to be executed later as a <i>learned program</i> . |

1.3 1260 SPECIFICATION

These specifications will apply under any combination of stated operating conditions, such as temperature, humidity and signal type. They are guaranteed (not typical) and valid for one year after calibration.

As part of the production procedure every instrument is thoroughly soak-tested, then autocalibrated to a tolerance better than that specified. Solartron designs and manufactures to BS EN 9001.

Generator

Frequency,

Range:	10μHz to 32MHz	
Resolution:	10μHz to 655.36Hz:	10μHz
	655.36Hz to 6.5536kHz:	100μHz
	6.5536kHz to 65.536kHz:	1mHz
	65.536kHz to 655.36kHz:	10mHz
	655.36kHz to 6.5536MHz:	100mHz
	6.5536MHz to 32MHz:	1Hz
Error:		±100ppm
Stability, 24hrs ±1°C		±10ppm

Amplitude,

	Voltage	Current
<10MHz:	0 to 3V	0 to 60mA
>10MHz:	0 to 1V	0 to 20mA
Resolution:	5mV	100μA
Error o/c:	±[5% + 1%/MHz + 5mV]	-
s/c:	-	±[5% + 1%/MHz + 100μA]
Distortion:	<2%	<2%

DC Bias,

Range:	±40.95V	±100mA
Resolution:	10mV	200μA
Error o/c:	±[1% + 10mV]	
s/c:	-	±[1% + 200μA]

Sweep,

Types:	frequency (logarithmic or linear) amplitude (linear) dc bias (linear)
Resolution:	>10000 points frequency >200 points amplitude or bias
Control:	up, down, step, hold

Maximum current:	±100mA
Maximum voltage, Hi to Lo:	±46V
Lo to ground:	0.4V

Output impedance, voltage:	50Ω ±1%
current, at <1kHz:	>200kΩ
Lo to ground:	100kΩ <10nF
Connection:	floating, single BNC
Output disable:	contact closure or TTL logic 0
Output is short-circuit proof	

Analysis

Three independent analyzers operating in parallel.

Voltage measurement

Range (rms)	Resolution	Full scale peak input	Common mode rejected
30mV	1μV	45mV	5V
300mV	10μV	500mV	5V
3V	100μV	5V	5V

Input protected to: ±46V

Input configuration

Connection:	Differential, BNC outers floating Differential, BNC outers grounded Single-ended, BNC outers floating Single-ended, BNC outers grounded
Coupling:	dc or ac (-3dB at 1Hz)
Impedance, Hi to outer:	1MΩ ±2%, <35pF
Outer to ground:	10kΩ, 330pF
Common mode rejection (at 1MHz):	>50dB
Cross-channel isolation (at 1MHz)	>100dB
Noise floor (at 1MHz)	-100dBV

Current measurement

Range (rms)	Resolution	Full scale peak input	Input resistance
6μA*	200pA	9μA	50Ω
60μA*	2nA	90μA	50Ω
600μA	20nA	900μA	50Ω
6mA	200nA	10mA	1Ω
60mA**	2A	100mA	1Ω

*For frequencies <1MHz only

**For frequencies >10MHz maximum current 20mA rms

Input protected to: ±250mA

Connnection:	floating, single BNC
Coupling:	dc or ac (-3dB at 1Hz)
Impedance, Outer to ground:	100kΩ, <200pF
Outer floating to:	±0.4V

Integration time:	10ms to 10 ⁵ s or auto
Measurement delay:	0 to 10 ⁵

DATA PROCESSING

Scaling: normalization by measured spectrum
 scaling by measured point
 scaling by a complex constant
 integration, differentiation
 inclusion of result in a polynomial expansion
 deviation from measured point, absolute value or percentage

Math, operators: +, -, *, /, j ω , powers, nested brackets
 operands: V1, V2, I, complex constants

Statistical analysis: σ , σ^2 , count, max., min., mean

PLOTTING

Type: digital,
 complies with Hewlett Packard Graphics Language
 and Enertec Schlumberger Graphics Language

Interface: IEEE488 in talk only mode

Parameters, independent variable: frequency, amplitude, dc bias
 dependent variables: r θ :r(dB) θ :r τ :r(dB) τ ;
 a j b;Z θ :Y θ :L/C R;R Q/D

X axis item: independent or dependent variable
 Y axis item: one, or two, related dependent variables

Axis limits: auto or user defined, logarithmic or linear
 Plot size: A3 or A4, or variable in 0.025mm steps
 Annotation: full grid or axis markers
 parameters description
 user entered text (up to 25 characters)

DATA STORE

Type: battery backed random access memory

Size, group delay mode: >280 results
 other modes: >400 results

Stored information: frequency, V1, V2, I
 generator amplitude and dc bias
 error and input range codes

Recall: any display combination,
 with processing if required

Storage duration, power off: typically > 1 month

PROGRAM STORAGE

Battery backed random access memory: 9 programs
 >300 instructions
 9 keyboard set-ups
 9 constants

Write protectable permanent memory: 9 programs
 >100 instructions
 6 keyboard set-ups
 9 constants

INTERFACES

Serial output: complies with RS 232 and RS 423
 baud rates: 110, 150, 300, 600
 1200, 2400, 4800, 9600

Parallel: complies with IEEE488 (1978)

fully programmable talker/listener
 switch selectable talk only for plotting/printing

Maximum data rate: 1000bytes/s

Functions implemented: SH1, AH1, T5, TE0, L4
 LE0, SR1, RL1, PP2, DC1, C0, DT0

Data format: complies with IEEE754 for
 4 byte wide transfers

GENERAL

Line voltage, switch selectable: 90 to 126V, 198 to 252V
 ac, 48 to 65Hz

Consumption: 230VA

Environment,
 temperature, operating: 0 to 50°C
 storage: -40 to 70°C
 specification limits: 10 to 30°C

humidity, non-condensing: 95% at 40°C

vibration: tested in accordance with BS EN 60068

Safety: complies with IEC 1010-1 (EN61010-1)

Electromagnetic Compatibility
 complies with EN50081-1 and EN50082-1

Dimensions, height: 176mm (6.93ins)
 width: 432mm (17ins)
 depth: 573mm (22.56ins)
 rack size: 4U, 19ins

Weight: 18kg (40lbs)

2

Installation

Section	Page
2.1 Accessories	2.3
2.2 Safety	2.3
2.2.1 General <i>Safety</i> Precautions	2.3
2.2.2 Grounding	2.4
2.3 Electromagnetic Compatibility	2.4
2.4 Power Supply	2.5
2.4.1 Power Voltage Selector	2.5
2.4.2 Line Fuse	2.5
2.4.3 Power Cable	2.6
2.4.4 Connection Procedure	2.6
2.5 Rack Mounting	2.7
2.5.1 Telescopic Slide Mounting Kit (Accuride)	2.7
2.5.2 Rack Dimensions	2.7
2.5.3 Ventilation	2.7
2.5.4 Fitting Telescopic Slide Mounting Kit (Accuride)	2.8
2.5.5 Fitting Telescopic Slide Mounting Kit (Jonathan)	2.14

CAUTION SAFETY BONDING TESTS (EN61010, clause 6.5.1.2)

The analyzer input connectors and the generator output connector have driven screens (low terminal), **which should not be subjected to a safety bonding test.** Damage to the internal circuitry may be caused by the 25A test current, even when *low terminal grounded* is selected for single-ended operation.

2.1 ACCESSORIES

The accessories supplied with the instrument are listed in Table 2.1.

Item	Use	Qty
Fuse, 1A, Slo-blo, 20mmX 5mm	Line fuse for 230V power supply	2
Fuse, 2A, Slo-blo, 20mmX5mm	Line fuse for 115V power supply	2
Fuse, 750mA, Slo-blo, 8mmX6mm	Generator (board 15)	2
Fuse, 2A, Slo-blo, 8mm X6mm	Generator (board 14) and front panel	2
Bracket (rack 'ear')	Rack mounting	2
Slide mounting bar	Rack mounting	1
Screw, M4x 12, countersunk	Rack mounting (slide bar fixing)	4
Key	Keyswitch on rear panel	2
50Ω coaxial cable with BNC connectors, length 1 metre.		3

Table 2.1 - Accessories

An ac power cable, appropriate to the country of destination, is packed with the instrument. If ordered with the instrument, a telescopic rack slide mounting kit (Option 12505B) is also packed.

2.2 SAFETY

The instrument design accords with the EN61010, 'Safety requirements for electrical equipment for measurement, control and laboratory use'.

This operating manual contains information and warnings, which must be followed:

- a) to maintain the safe condition of the instrument, and
- b) to ensure the safety of the operator.

The principal safety precautions are listed in Section 2.1. Safety precautions are also included, where appropriate, in the operating instructions.

2.2.1 GENERAL SAFETY PRECAUTIONS

1. Before switching on:
 - a) Ensure that the power voltage selector is correctly set. (See Section 3.1.)
 - b) Ensure that the power cable is connected to the supply in accordance with the colour code. (See Section 3.3.)
 - c) Ensure that the power cable plug is connected only to a power outlet that has a protective earth contact. This applies equally if an extension cable is used: **the cable must contain an earth conductor.**
2. To effect grounding at the instrument front panel, the power plug must be inserted before connections are made to measuring and control circuits. The

power plug or external ground (as appropriate) must remain connected until all measuring and control circuits have been disconnected.

3. Any interruption of the ground connection (inside or outside the instrument) is prohibited.
4. When the instrument is connected to its supply the opening of covers or removal of parts could expose live conductors. The instrument should be disconnected from all voltage sources before it is opened for any adjustment, replacement, maintenance or repair. Adjustments, maintenance or repair of the instrument when it is powered should not be attempted by the user. Consult a Solartron service center if repairs are necessary.
5. Ensure that fuses of the correct rating and type are fitted. The use of makeshift fuses, and short-circuiting of fuse holders, is prohibited.
6. Whenever it is likely that the safety of the instrument has been impaired, it should be made inoperative and secured against any unintended operation. Safety could be impaired if the instrument:
 - a) shows visible damage,
 - b) fails to perform intended measurements,
 - c) has been subjected to prolonged storage under unfavourable conditions,
 - d) has been subjected to severe transport stress.



This symbol on the instrument means, "Refer to the operating manual for detailed instructions or safety precautions".

2.2.2 GROUNDING

For safety, a ground connection is essential whenever measurement and control circuits are connected, even when the instrument is switched off. The instrument is grounded by connecting it to a power outlet or other suitable earthing point. The ground connection should be capable of carrying 25A.

2.3 ELECTROMAGNETIC COMPATIBILITY

When used as described in this manual the instrument meets the requirements of the EMC Directive. (See Specification in Chapter 1.) It must not be operated with the inner metal screens removed and any replacement components must be of the correct type (see Maintenance Manual.)

When conducting tests at high frequencies the equipment being tested and any unscreened test leads may radiate sufficiently to disturb nearby radio receivers. Since the test signal is sinusoidal, any interference is confined to a very narrow band and problems are unlikely to occur. If, however, interference does become a problem then it is the user's responsibility to reduce emission by the use of suitable screening arrangements.

2.4 POWER SUPPLY

2.4.1 POWER VOLTAGE SELECTOR

The instrument can be powered from either a 115V or a 230V ac supply. Before connecting the instrument to the supply, proceed as follows:

1. Set the selector switch on the rear panel to correspond with the voltage of the local ac supply, i.e.
 '115V' for supply voltages between 90V and 126V, or
 '230V' for supply voltages between 198V and 252V.
2. Insert a fuse of the correct value into the LINE fuse holder.

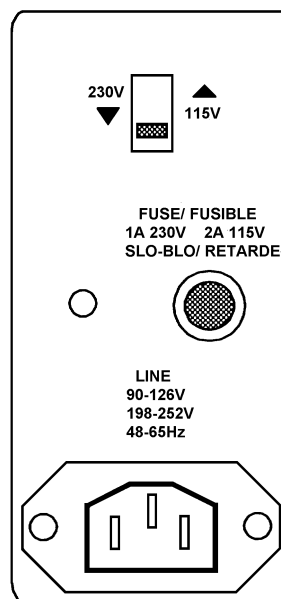


Figure 2.1 - Mains selector panel

2.4.2 LINE FUSE

Only LINE is fused in the instrument. The fuse values for the alternative power voltage settings are:

- a) 1A, 'Slo-blo', for the '230V' setting, or
- b) 2A, 'Slo-blo', for the '115V' setting.

Replacement fuses must be 20mm X 5mm cartridge type.

2.4.3 POWER CABLE

The power cable supplied has an IEC socket on one end (which mates with the power input plug on the instrument) and a power plug, compatible with power sockets in the country of destination, on the other end.

This cable should be connected to the user's ac power supply according to the following colour code:

BROWN	=	LINE
BLUE	=	NEUTRAL
GREEN/YELLOW	=	GROUND

An IEC socket and cable other than the one supplied may be used, but it must be correctly wired as shown in Figure 2.2.

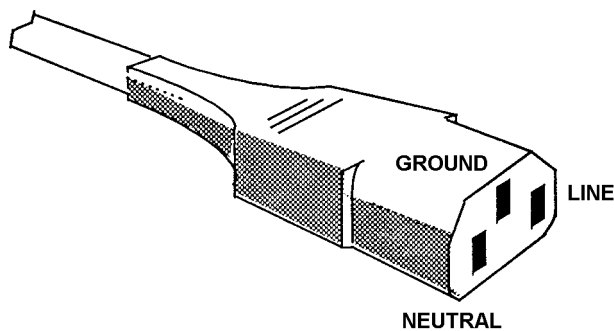


Figure 2.2 - IEC power socket connections

2.4.4 CONNECTION PROCEDURE

1. Before connecting the supply, ensure that the power voltage selector on the rear panel is correctly set (see Section 3.1), and that the LINE fuse is correctly rated (see Section 3.2).
2. Ensure that the POWER switch on the front panel is set to OFF.
3. Connect the power cable.
4. Set the instrument POWER switch to ON.

2.5 RACK MOUNTING

The instrument can be rack mounted in two ways:

- a) on fixed rails, that support the instrument from the underside of the case,
- b) on telescopic slides.

Method b) allows easy withdrawal of the instrument for servicing.

With either method, the rack mounting ears included in the accessory kit are substituted for the instrument finisher trims. Screws inserted through the ears and into the rack keep the instrument in place.

Caution

The rack mounting ears must be used only to prevent the instrument sliding out of the rack. They are not designed to support the whole weight of the instrument.

Warning

When the instrument is rack mounted on telescopic slides, ensure that the rack will not tip over when the slides are fully extended.

2.5.1 TELESCOPIC SLIDE MOUNTING KIT (ACCURIDE)

This slide mounting kit is available from Solartron as an optional accessory, and contains:

- a) telescopic slide kit, plus fixings (1 off)
- b) screws, M4x6 panhead, to fix slide inner members to the mounting bars (12 off)
- c) washers, M4 crinkle (12 off)
- d) screws, M6 satin chrome, to fix front panel to rack (2 off)
- e) washers, M6 plain (2 off)
- f) caged nuts, M6, to fix front panel to rack (2 off)

The kit is suitable only for 760mm (30 ins) deep IMHOF IMRAK Series 80 or dimensionally similar cabinets.

2.5.2 RACK DIMENSIONS

The internal rack dimensions required for fitting the instrument are:

- a) 610mm (24ins) deep x 485mm (19 ins) wide, for fixed rail mounting, and
- b) 760mm (30 ins) deep x 485mm (19 ins) wide, for telescopic slide mounting.

2.5.3 VENTILATION

The instrument has fan-assisted cooling. Air is drawn in through slots under the front panel and expelled from the rear panel.

Ensure a free flow of air by allowing adequate clearance between the instrument, the rack in which it is mounted, and any adjacent racked instruments. If the rack is fitted with front doors, these must have vent holes.

2.5.4 FITTING TELESCOPIC SLIDE MOUNTING KIT (ACCURIDE)

1. As shown in Figure 2.3, remove the following items from the instrument:
 - a) *Finisher Trim*,
Keep the four M4 X 16 panhead screws and M4 crinkle washers for securing the rack ears.
 - b) *Handle and Handle Trim*,
 - c) *Side Trim*,
The side trim is located on the opposite side to the handle. It is normally secured by a pin on the finisher trim and slides out backwards.
 - d) *Feet and Tilt Bar*.
The tilt bar is secured by the two front feet.

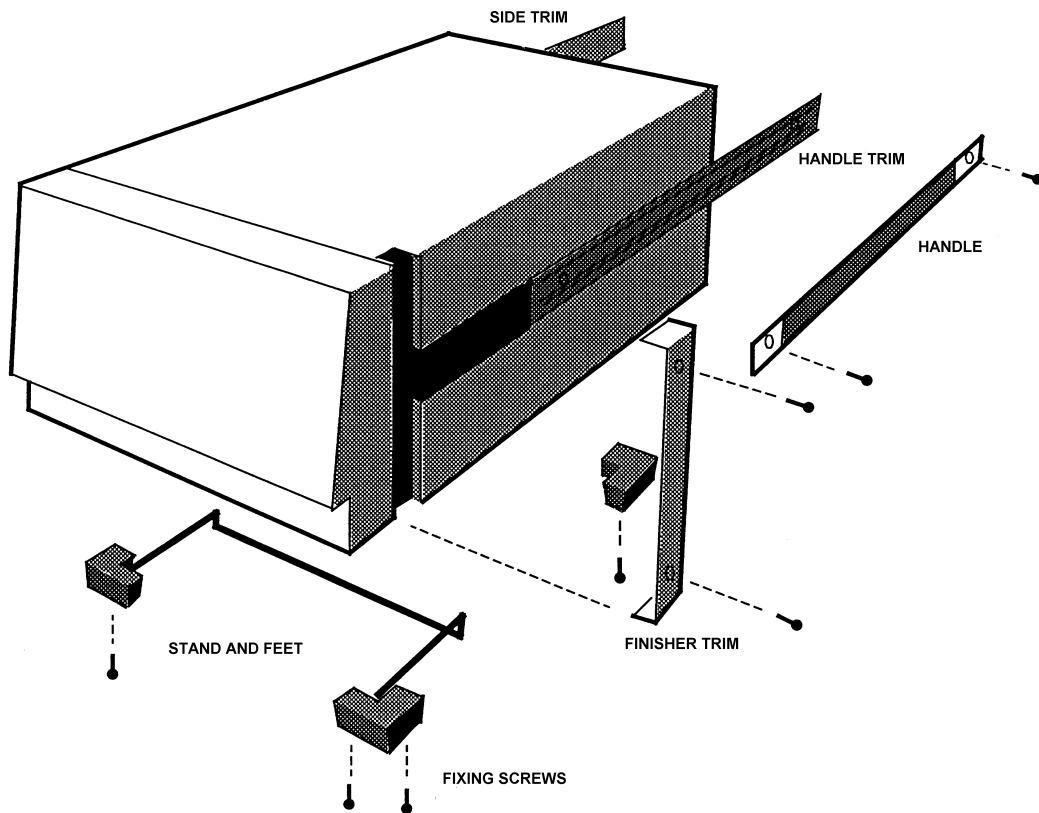


Figure 2.3 - Removal of trims, handle, feet, and tilt bar

2. As shown in Figure 2.4, fit the following items to the instrument:

a) *Rack Ears*,

Fit rack ears in place of the finisher trim, using the same fixings. The ears may be fitted in two ways:

1. As shown in Figure 2.4.
2. With their flanges facing the rear of the instrument. This causes the instrument to stand out further in the rack. 'Blind' units (remote control only) can thus be aligned with locally controllable units.

b) *Slide Mounting Bar*

The slide mounting bar and fittings are included with the instrument accessories. Screw the mounting bar to the chassis in place of the handle, using the four M4x12 countersunk screws provided. The bar fits correctly only one way round; with the threaded holes nearest the front.

The corresponding mounting bar on the left-hand side of the instrument is supplied already fitted behind the side trim; it is slightly narrower than the right-hand bar.

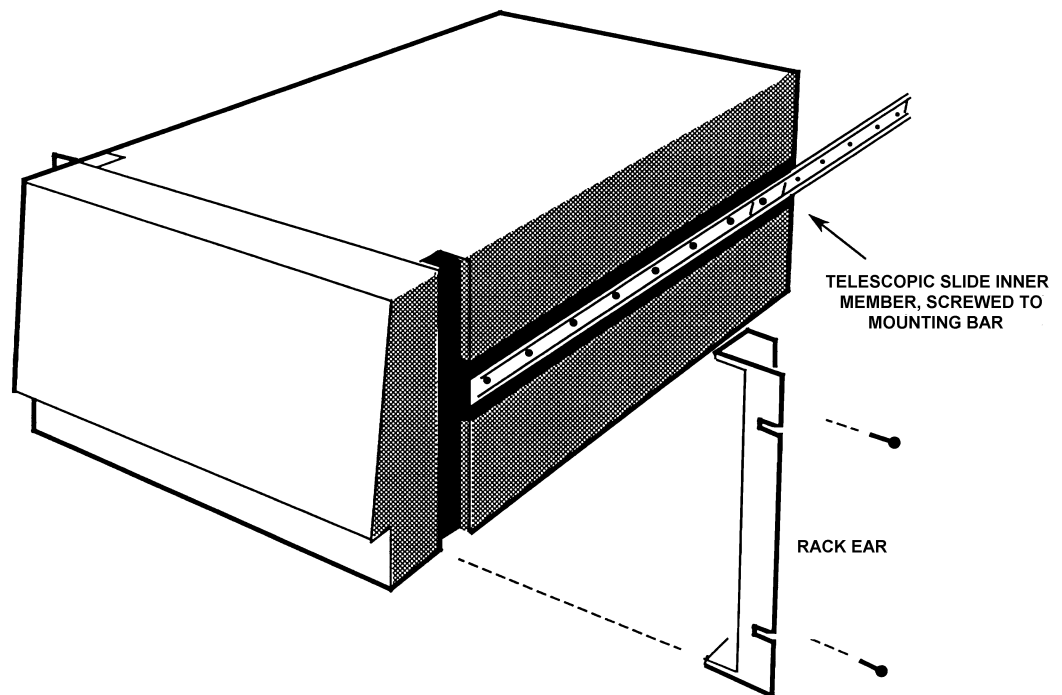


Figure 2.4 - Fitting rack ears and telescopic slide inner members

c) *Telescopic Slide Inner Members*

The telescopic slides are supplied with inner and outer members slotted together. Slide out the inner member as shown in Figure 2.5, depressing the locking catch at the halfway point.

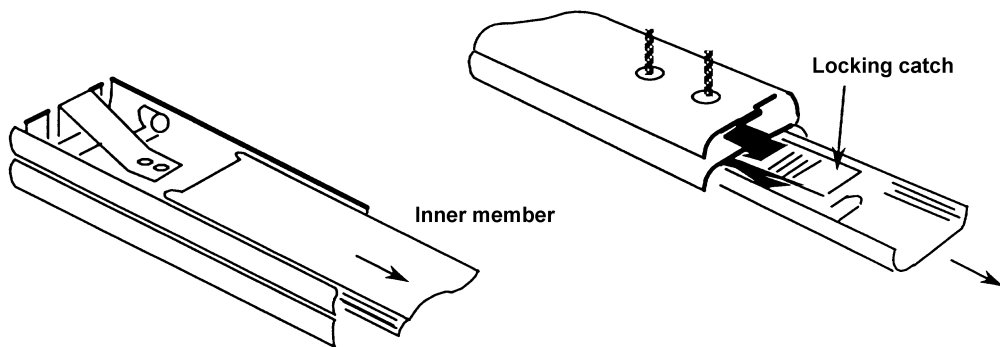


Figure 2.5 - Separating the inner and outer slide members, prior to fixing

Screw the slide inner members to the mounting bars, using the 12 M4x6 panhead screws supplied, 6 each side.

3. Fit the following items to the telescopic slide outer members, as shown in Figures 2.6 and 2.7:

a) *Adjustable Rear Brackets*

Fit one rear bracket to each outer member, but do not fully tighten the screws until the instrument is fitted into the rack (Step 6).

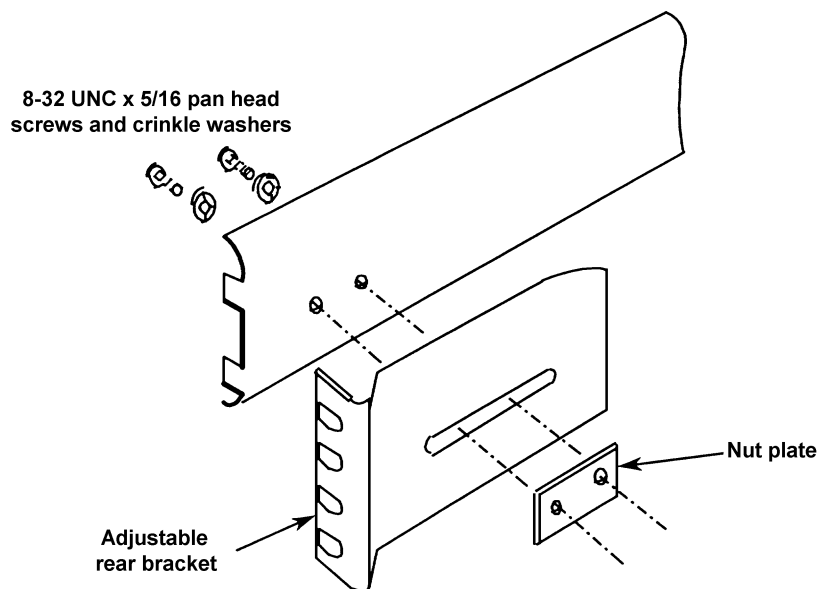
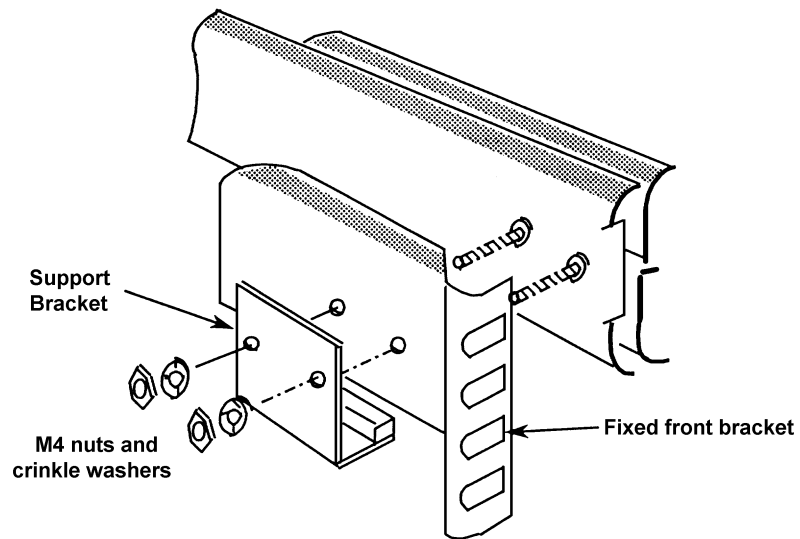
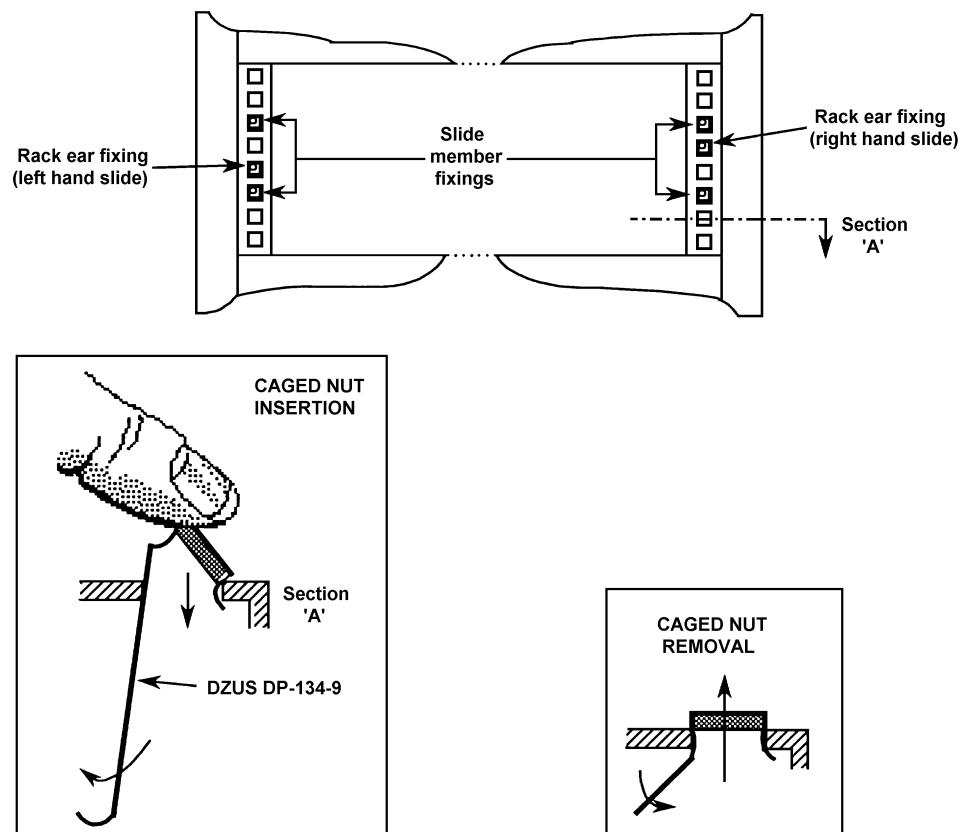


Figure 2.6 - Fitting a rear bracket

b) Fixed Front Brackets and Support Brackets.

**Figure 2.7 - Fitting a front bracket and support bracket**

4. Fit the M6 caged nuts for outer slide member and rack ear fixing into the rack, in the positions shown in Figure 2.8. The way to insert and remove caged nuts is shown in the figure detail.

**Figure 2.8 - Caged nut insertion in Imrak Series 80 (and similar) cabinets.**

5. Fit the outer slide members to the rack, as shown in Figure 2.9.

Note that the tapped holes in the nut plate are positioned off-centre to provide maximum lateral adjustment. Fit the plates, as shown, with the holes offset towards the rack exterior.

Fitting one end of an outer member is made easier if the other end is supported. Hook the bracket at the other end over an M5 screw pushed into the top caged nut.

Tighten the M5 screws securing the outside slide members until each member is held moderately firmly in the rack, approximately in the centre of its travel. The members must, however, be free to take up any adjustment when the instrument is first fitted into the rack.

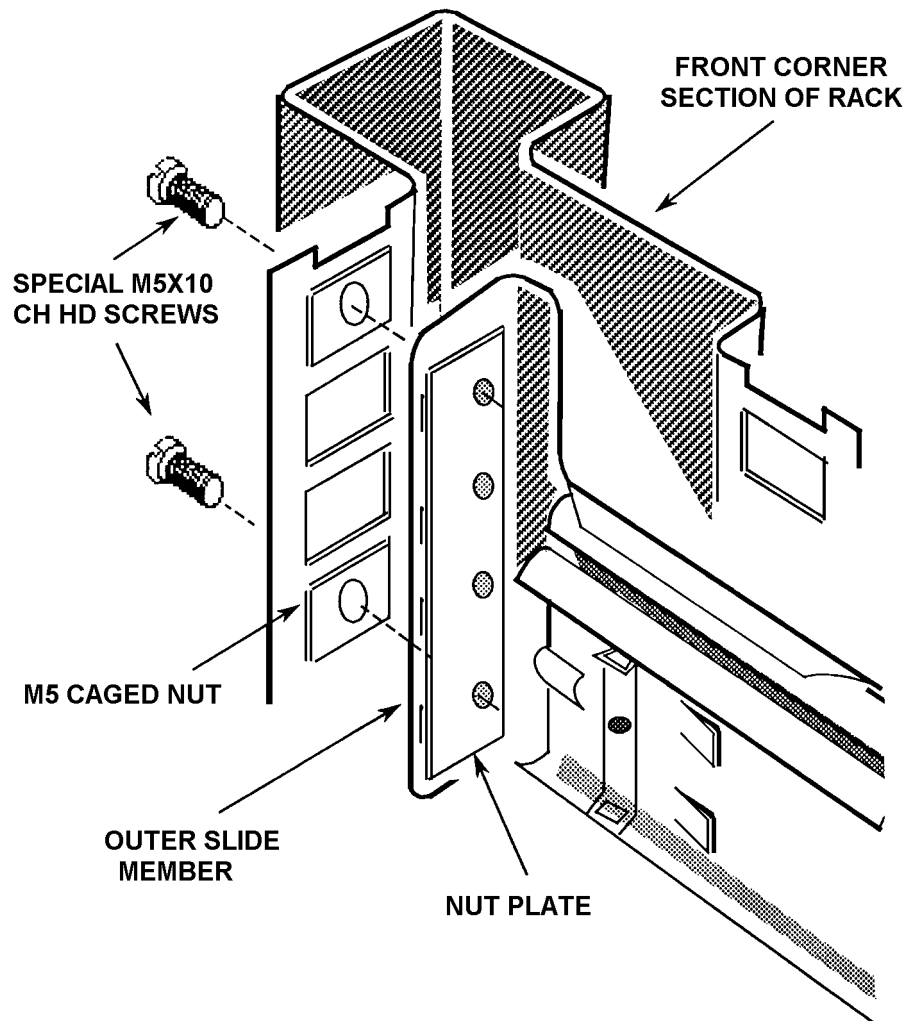


Figure 2.9 - Fitting the outer slide members into the rack

6. Finally, fit the instrument into the rack, as follows:
 - a) Offer the instrument up to the rack and feed the inner telescopic slide members into the outer members, pushing the instrument into the rack until the locking catches engage and lock.
 - b) Depress both catches and push the instrument fully into the rack, ensuring that no cables are trapped.
 - c) Tighten the screws on the outer slide members in the following order:
 - i) the M5 screws securing the rear bracket to the rack,
 - ii) the M5 screws securing the front bracket to the rack,
 - iii) the 8-32 UNC screws securing the rear bracket to the outer slide member.

2.5.5 FITTING TELESCOPIC SLIDE MOUNTING KIT (JONATHAN)

1. As shown in Figure 2.10, remove the following items from the unit:

a) *Finisher Trim*

Retain the four M4 x 16 panhead screws and M4 crinkle washers for securing the rack ears.

b) *Handle and Handle Trim*

c) *Side Trim*

Located on the opposite side to the handle, the side trim is normally secured by a pip on the finisher trim. The side trim slides out backwards.

Check that the mounting bar already fitted behind the side trim has the part number 12502019B.

d) *Case Top and Case Bottom*

Retain the five screws and washers for securing the replacement case sections.

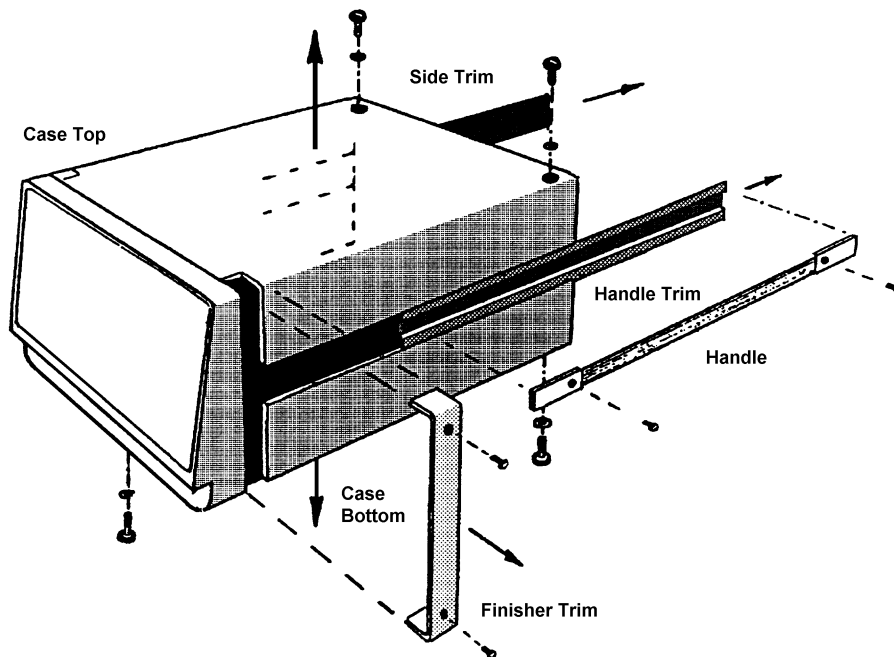


Figure 2.10 - Removal of trims, handle, and top and bottom cases

2. Fit the self-adhesive feet (four off) to the inside of the replacement case bottom, in the same positions as those in the original case bottom.
3. As shown in Figure 2.11, fit the following items to the instrument:
 - a) *Rack Ears*
Fit the rack ears in place of the finisher trim, using the same fixings. The flanges must face the rear of the instrument.
 - b) *Slide Mounting Bar*
Screw the bar to the chassis, in the position previously occupied by the handle, using the four M4 x 12 countersunk screws provided. The bar fits correctly one way round only, with the threaded holes nearest the front of the instrument.
 - c) *Replacement Case Top and Case Bottom*
Use the original five screws and washers.
4. Fit the Jonathan Telescopic Slide (e.g. the Tru-Glide 110QD-2) and mounting brackets to the instrument, and fit the instrument into the rack. Jonathan slides are not supplied with the instrument. See the manufacturers slide specification sheets for details of fixings, brackets and mounting accessories.

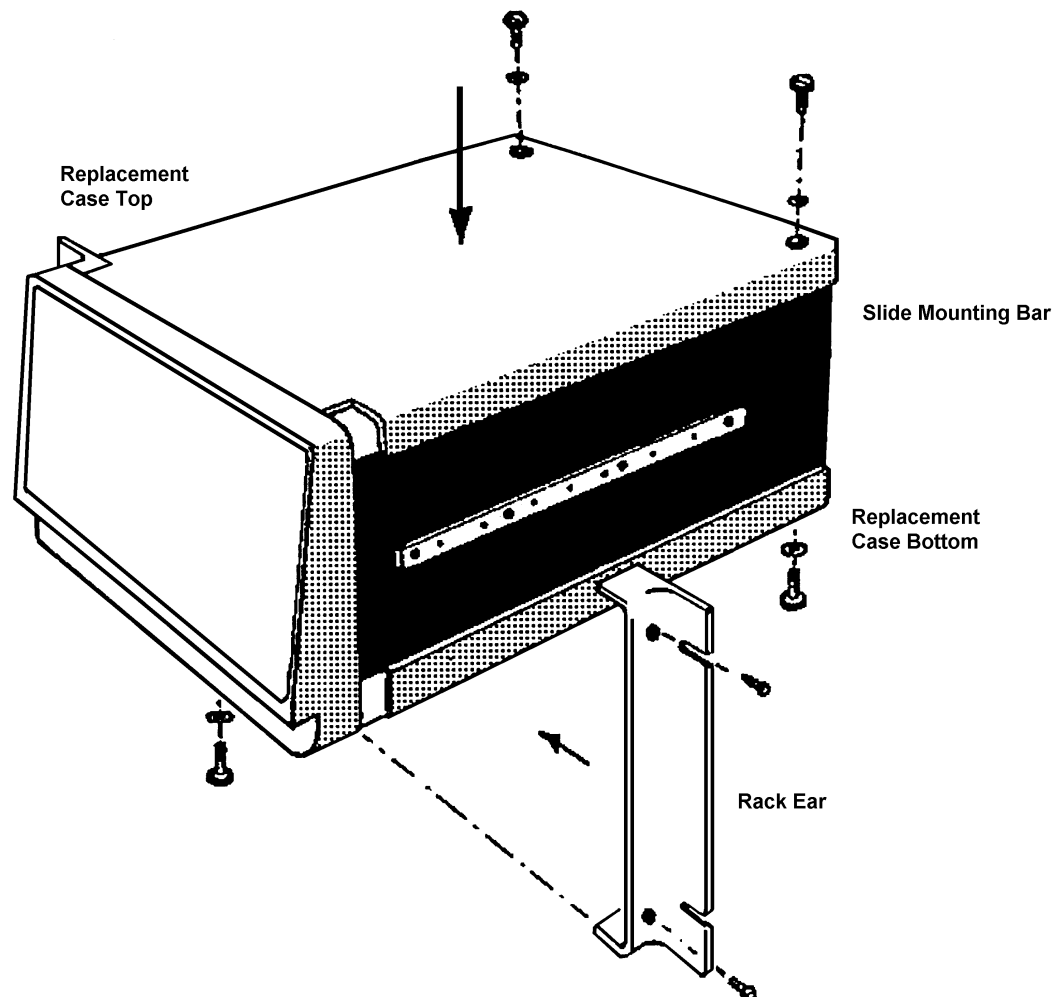


Figure 2.11 - Fitting the rack ears, slide mounting bar, and replacement cases

3

Getting Started

Section	Page
3.1 Introduction	3.3
3.2 Instrument Keyboard	3.4
3.3 Power-up Status	3.6
3.4 Display	3.6
3.5 Using a Control Menu	3.7
3.6 Making a Simple Measurement	3.9
3.6.1 Preliminaries	3.9
3.6.2 Connecting the Item Under Test	3.10
3.6.3 Setting the Analyzer	3.10
3.6.4 Setting the Generator	3.12
3.6.5 Commanding a Measurement	3.14
3.6.6 Setting the Display	3.14
3.7 Using the Sweep Facility	3.16
3.7.1 Setting the Sweep	3.16
3.7.1.1 Effect of Sweep on Generator Loading	3.18
3.7.2 Preparing the History File	3.19
3.7.3 Commanding a Series of Measurements	3.19
3.7.4 Reading the History File	3.19
3.8 Using the Plot Facility	3 21
3.8.1 Making a Bode Plot of History File Data	3.21
3.8.1.1 Installing the GPIB Plotter	3.21
3.8.1.2 Commanding the Bode Plot	3.22
3.8.2 Making a Nyquist Plot of History File Data	3.22
3.8.2.1 Setting the Display Coordinates	3.22
3.8.2.2 Setting the Plotter Axes	3,23
3.8.2.3 Commanding the Nyquist Plot	3.26

3.1 INTRODUCTION

This chapter introduces the local control features of the instrument and shows you how to use them.

The features of the front panel keyboard are described generally in Sections 2 through 5.

Then, three simple examples in Sections 6, 7, and 8 show:

- how to make a simple measurement,
- how to make a sweep, and
- how to plot measurement results.


Whilst following the examples, you may find it useful to refer occasionally to Chapter 5, “Menu Terms”. Pointers to various sections in this chapter are given in Table 3 1, on page 3.5.

Some of the more advanced uses of the instrument are demonstrated in:

- Chapter 10 Measurement scaling and limits checking.
- Chapter 11 Learnt programs.

3.2 Instrument Keyboard

A logically arranged keyboard and a simple menu structure make the instrument very easy to use.

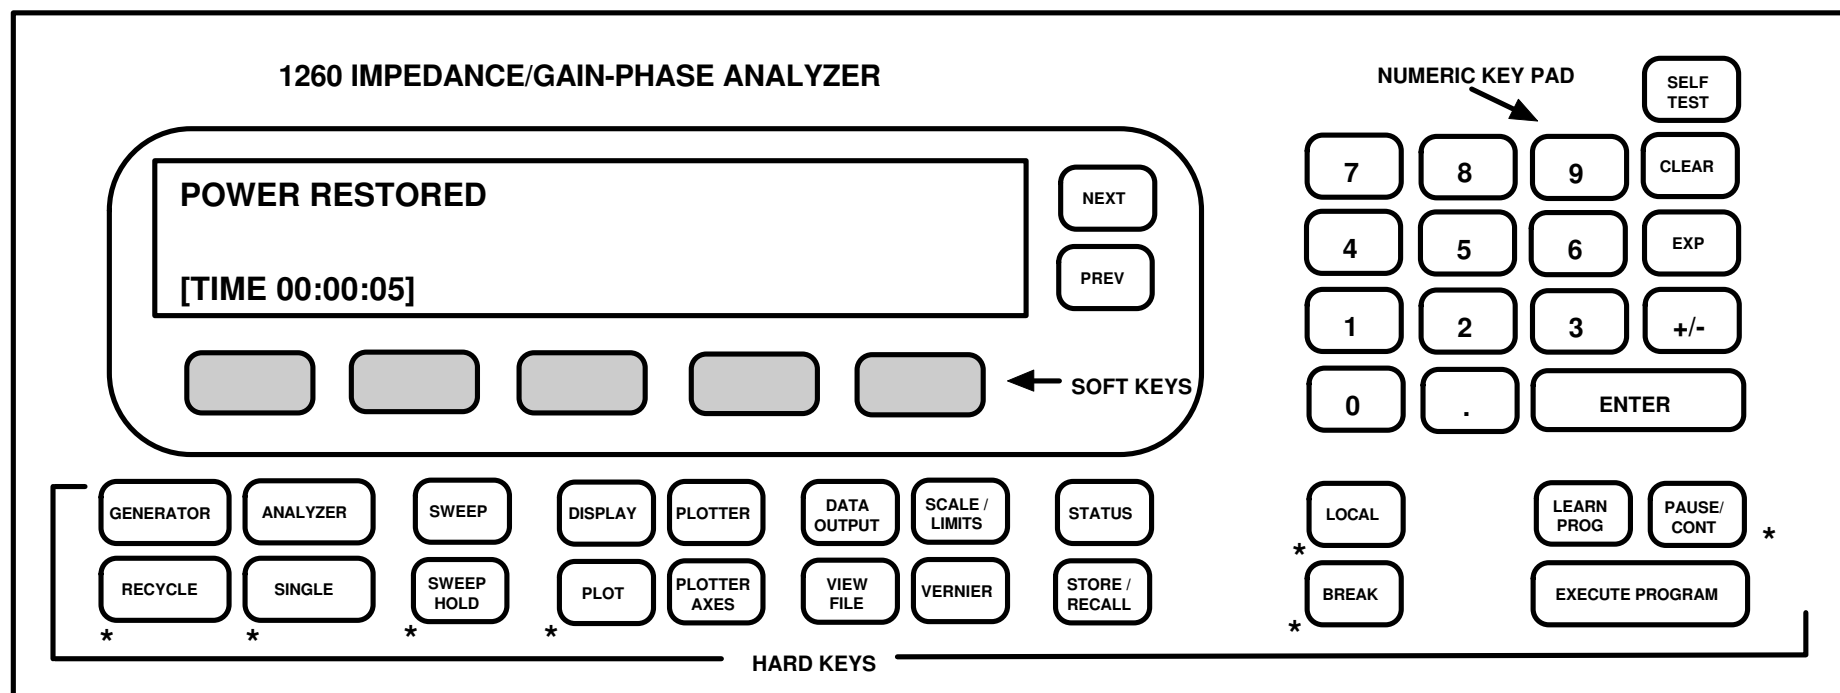

Hard keys guide the user straight to the operation of interest and are used

- a) to command an instant action, e.g. SINGLE (make a single measurement) or
- b) to select a menu of control functions, from which actions may be commanded or control parameters set.

Instant action keys are indicated with an asterisk

A brief summary of each hard key function is given in Table 3.1, with a reference to the relevant section in Chapter 5 "Menu Terms".

Soft keys, whose functions are assigned in accordance with a hard key selected menu, allow individual control parameters to be examined and set.

Numeric parameters are entered from the numeric keypad, whilst listed-choice parameters are selected with the NEXT or PREV key.

CLEAR deletes mis-keyed numeric entries, one character at a time, and allows the correct value to be keyed in.


ENTER activates the selected parameter setting.

Table 3.1 - Hard key assignments

GENERATOR (Chap. 5, Sect. 1)	Selects the Generator menu. This menu defines the drive signal applied to the item under test: constant voltage/current; frequency, amplitude, and bias; amplitude held constant at generator output or at a selected analyzer input (MONITOR).
ANALYZER (Chap. 5 Sect. 2)	Selects the Analysis menu. This menu defines the input parameters of the analyzer, e.g. measurement integration time, delay and mode; input range and coupling.
RECYCLE	Commands repetitive measurements.
SINGLE	Commands a single measurement.
SWEEP (Chap. 5, Sect.3)	Selects the Sweep menu. This menu defines a range of settings through which a selected generator output parameter may be stepped, a new setting being used for each measurement.
SWEEP HOLD	Suspends a sweep. The stepped parameter is held at its present setting, whilst measurements continue. To continue the sweep, press SWEEP HOLD again.
DISPLAY (Chap. 5, Sect. 4)	Selects the Display menu. This menu defines the measurement results to be displayed. (These results are also sent to the output port(s) enabled from the DATA OUTPUT menu).
PLOTTER (Chap. 5 Sect. 5)	Plotter menu. This menu selects: a) the graphics language; b) plot size; c) type of trace, point or vector; d) plot title definition; e) text, grid, axes, on/off.
PLOT (Chap. 5, Sect. 6)	Commands data to be output from the history file to the GPIB plotter.
PLOTTER AXES (Chap. 5, Sect. 7)	Selects the Plotter Axes menu. This menu assigns the displayed data ordinates to the plotter X and Y axes.
DATA OUTPUT (Chap.5, Sect. 8)	Selects the Data Output menu. This menu defines: a) the measurement data output port(s); b) the data to be output, all, fail or pass (ASCII) data, or dump (binary) data; c) port configuration parameters

SCALE/LIMITS (Chap. 5, Sect. 9)	Selects the Scale/limits menu. This menu contains: a) a measurement normalization facility; b) a null function, which compensates for stray inductance and capacitance in the input leads; c) mathematical functions and component sort; d) a measurement limits check.
VIEW FILE (Chap. 5, Sect. 10)	Opens the View File menu. This gives access to the History File.
VERNIER (Chap. 5, Sect. 11)	Opens the Vernier menu. The vernier facility allows the generator output (or plotter scaling) to be adjusted, whether measurements are being made or not.
STATUS (Chap. 5, Sect. 12)	Selects the Status pages. These pages display control information not available under other hard keys.
STORE/RECALL (Chap. 5, Sect. 13)	Selects the Store/recall menu. This provides for storage and subsequent recall of control settings and measurement results.
LOCAL	Returns the instrument to local control (when it is not in local lockout mode).
BREAK	Switches the generator output off, and suspends any present activities (program, sweep, plot etc.)
LEARN PROGRAM (Chap. 5, Sect. 14)	Opens the Learn Program menu. A learnt program is a series of commands and control set-ups that is memorized by the instrument and executed, in order of entry, when an EXECUTE PROGRAM command is given.
PAUSE/CONT	Pause/continue facility for learnt programs, and control of null compensation.
EXEC. PROGRAM	Starts the execution of a selected learnt program
SELF TEST (Chap. 5, Sect. 15)	Selects the Self Test menu. This offers: a) a self-test facility; b) initialization and reset facilities; c) time set facility; d) error beep on/off

3.3 POWER-UP STATUS

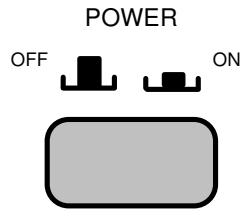

On power-up the instrument is tested automatically and the resulting control status is indicated in a power-up message. This message is important and should be understood before using the instrument. The various messages which may be displayed are:

POWER RESTORED The normal power-up message. This shows that the instrument has correctly remembered the control and measurement data that were in its memory when power was interrupted. The generator output is switched off.

RESET This message may be displayed if a board has been removed from the instrument. All control settings are set to the default state. Stored parameters, learn programs, and history file data are available for recall.

INITIALIZED This message may be displayed if power has been down for a considerable time. All control settings are reset to the default state, and stored parameters, learn programs, and history file data are erased.

A further message may appear with any of the above messages if the instrument needs recalibration:

“75. CAL DATA CORRUPT” is displayed if one copy of the calibration data has been corrupted. The instrument is usable, but should be recalibrated as soon as possible.

“76. RECALIBRATE” is displayed if both copies of calibration data have been corrupted. The instrument should be recalibrated before further use.

3.4 DISPLAY


Control information or measurement results are displayed, in accordance with the operating state of the instrument. Examples of the display format are shown in Section 5 of this chapter and in Chapter 5 “Menu Terms”.

If a bad command is given an error message is displayed also. The meaning of each error message is explained in Chapter 9.

3.5 USING A CONTROL MENU


A few simple steps are all that is necessary to use each control menu. You are guided through these by a clear display of the choices available, shown in brackets. The steps are:

1. Choose the menu by pressing the relevant hard key. A choice of menu page is indicated by **square** brackets. Step through the pages by pressing **NEXT** or **PREV** e.g.

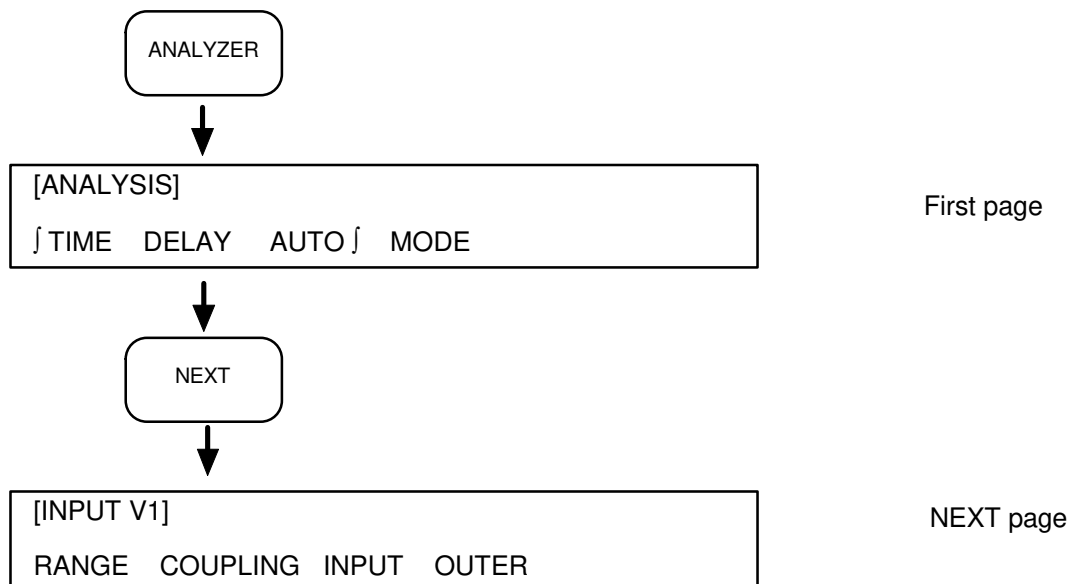


2. Access the parameter of interest by pressing the relevant soft key.
3. If necessary, choose another setting. A setting is either selected from a list of fixed choices or keyed in as a number from the numeric keypad.

Listed-choice parameter settings are enclosed in square brackets and are selected with **NEXT** or **PREV** e.g.

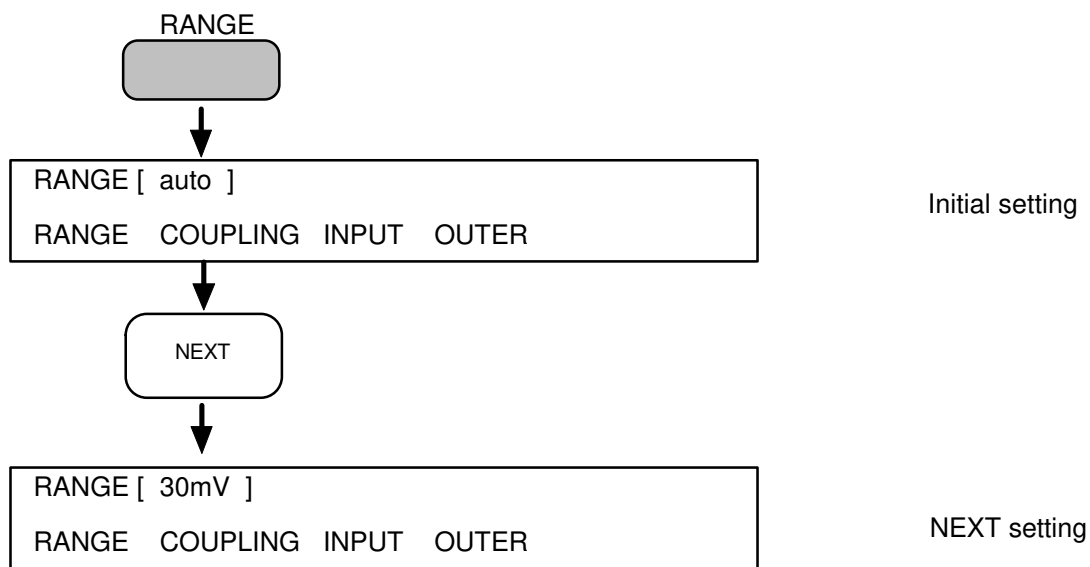

numeric parameter entries are invited with **round** brackets, e.g.

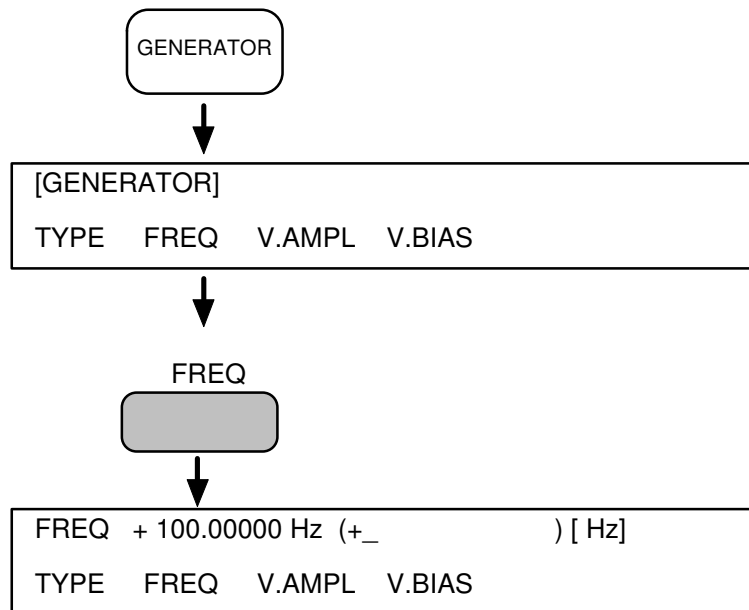

Also displayed is the present parameter value. Numeric values are keyed in from the numeric keypad and appear between the brackets as each number key is pressed. Pressing the CLEAR key deletes the characters in round brackets, one character at a time.

Note that multiples and sub-multiples of the parameter units may often be selected as well, with NEXT or PREV. In the example above this allows frequencies to be entered in μHz , mHz , Hz , kHz , or MHz .

4. **Enter the displayed parameter setting** by pressing the ENTER key. This returns the display to the basic menu to allow other parameters to be accessed. A selected setting must be entered for it to be acted on by the instrument; otherwise the setting last entered (or the default setting) is used.

POINTS TO REMEMBER:


- **Square brackets** enclose one item in a **list** of choices. Select other settings with the NEXT key (down the list) or PREV (up the list). Square brackets may enclose menu page titles, control settings, or units of control settings. Press the ENTER key to update the selection.
- **Round brackets** invite the entry of a **number** from the numeric keypad. Press the ENTER key to update the number.

3.6 MAKING A SIMPLE MEASUREMENT

In this example the impedance of a simple C,R network is measured at a single defined frequency and the results of analysis are displayed.

3.6.1 PRELIMINARIES

1. Ensure that the instrument is correctly installed, as described in Chapter 2.
2. Switch on the power, at source and on the instrument front panel. Check that the "POWER RESTORED" message is displayed. If it is, proceed with the example if it isn't, refer to Section 2 in this Chapter.
3. Reset or initialize the instrument. This sets the. control-parameters to a known state, from which setting up may begin. Before initializing, ensure that you will not be deleting any useful data, or control set-ups. To retain stored data and control set-ups in memory, reset the instrument instead. The procedure is:

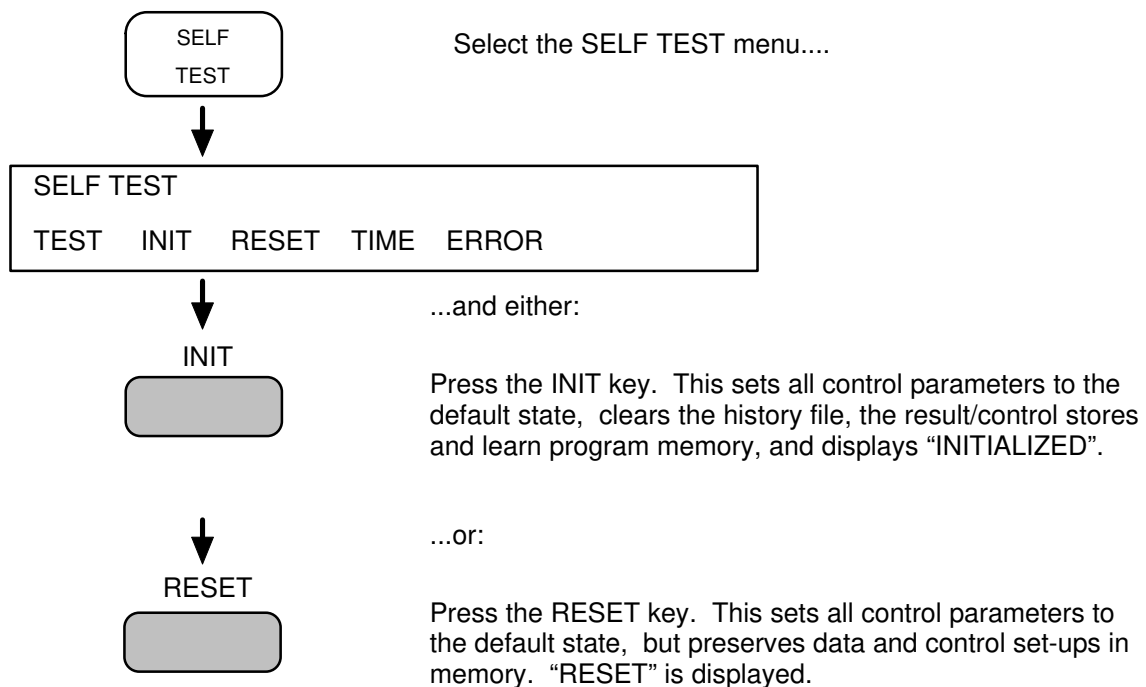

3.6.2 CONNECTING THE ITEM UNDER TEST

Items under test may be connected to the instrument either directly through the front panel terminals or through one of the test modules that fit over the terminals.

The easiest way of connecting the C,R network presently under test is through the component test module, as shown in Fig 3.1.

Measurement connections, generally, are described in Chapter 6.

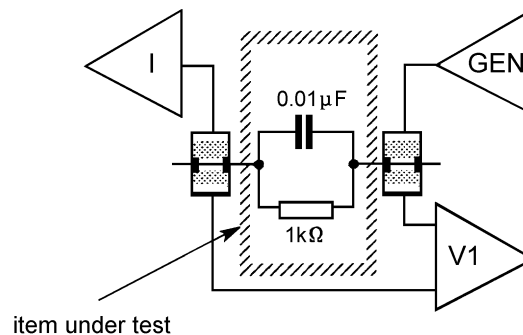



Fig 3.1 - Connections for a simple impedance measurement

To complete the measurement connections the analyzer inputs must be configured to suit the test module. This is done from the ANALYZER menu.

3.6.3 SETTING THE ANALYZER

The analyzer parameters should be set in accordance with the test set-up and the expected test response.

In the present example all the analyzer parameters are left at their default settings (shown in Table 3.2), *with the exception of OUTER for the VOLTAGE 1 input*. This parameter is altered to floating ground, as follows:

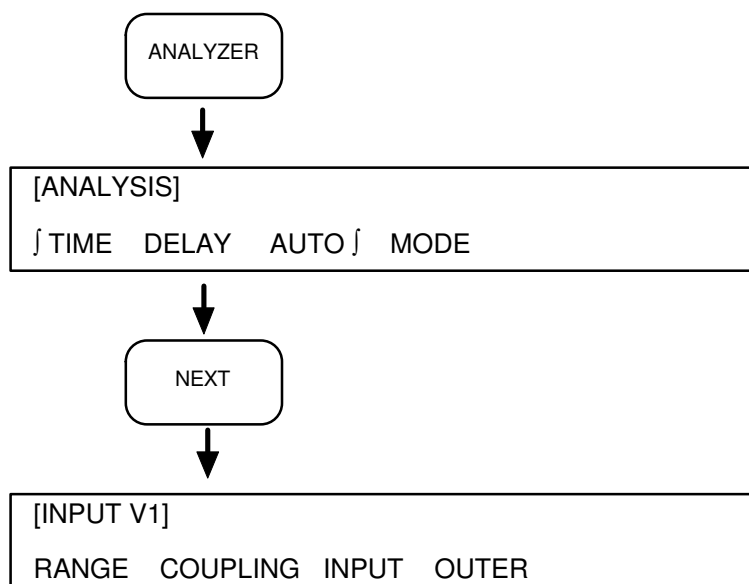


Press the ANALYSER hard key....

... to select the ANALYSIS menu.

Then press the NEXT key....

... to select the INPUT V1 menu.

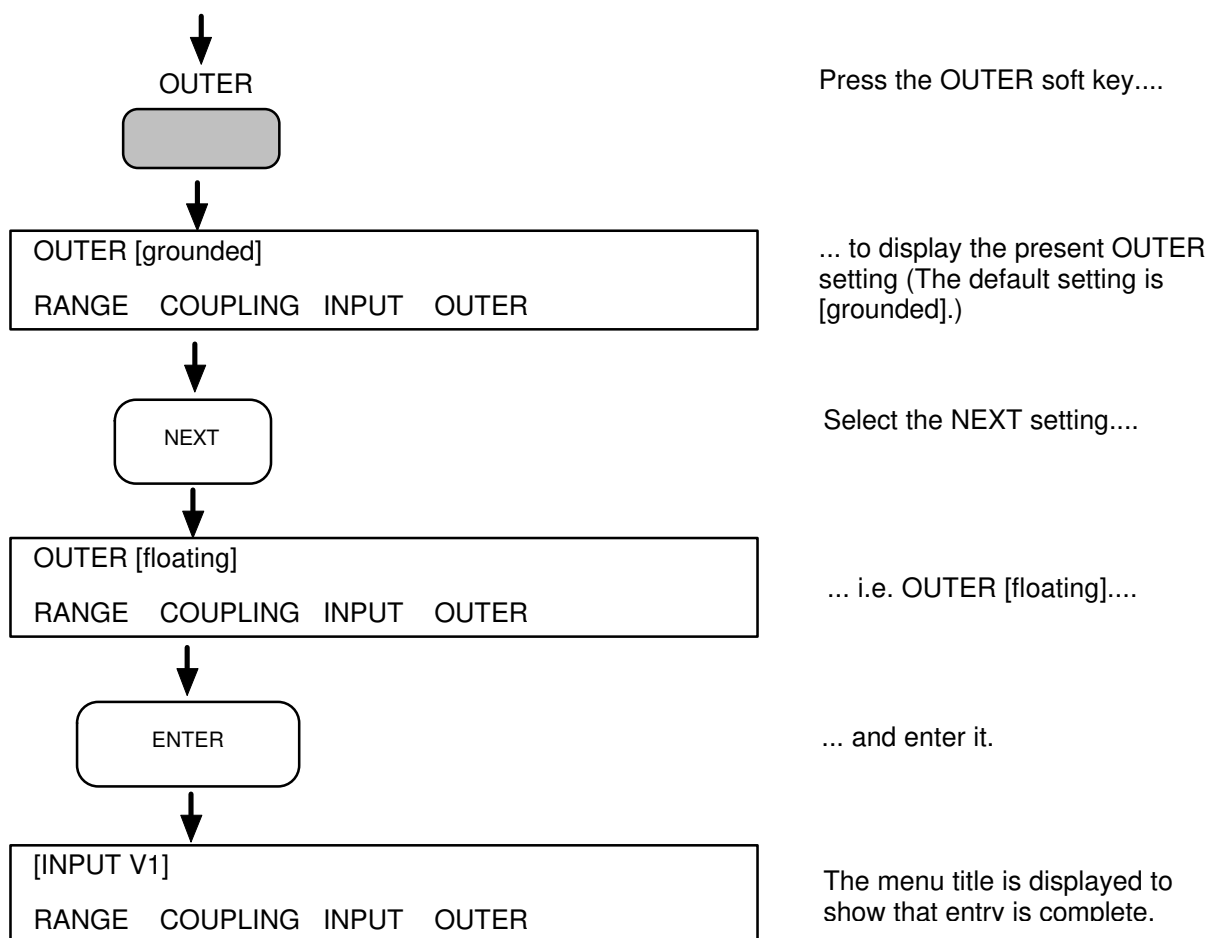**Table 3.2 - Analyzer Default Settings**

Parameter	Setting	Characteristics
[ANALYSIS] } TIME DELAY AUTO } MODE	200ms zero secs off. normal	Suitable for low noise input. Suitable for the item under test. UT has constant low noise input: auto integration not required. Suitable for all display coordinates, except r,t and r (dB), t. There is no need for the auto impedance facility, as the form of the circuit is known.
[INPUT V1] RANGE COUPLING	auto dc	Covers all input voltage ranges. IUT gives no dc component at voltage 1 input, therefore dc coupling is used for minimum phase shift.
INPUT	differential	Differential input (Hi - Lo).
OUTER	grounded	Screens grounded. (Altered to screens floating in this example.)
[INPUT V2]		Same settings as [INPUT V1].
[INPUT II RANGE COUPLING	auto dc	Covers all input current ranges. IUT gives no dc component at CURRENT input, therefore dc coupling is used for minimum phase shift.


3.6.4 SETTING THE GENERATOR


Set the generator parameters to provide a suitable drive for the item under test (IUT). Remember that the drive specified must satisfy:

- the generator output capability,
- the rating of the JUT, and
- the analyzer input range.

In the present example the IUT is driven at a frequency of 15.9kHz. At this frequency the impedance of the circuit is approximately 707Ω , and a drive amplitude of 1V (applied both to the item under test and to the analyzer VOLTAGE 1 input) develops a drive current of approximately 1.4mA. The drive and expected test response are thus well within the capabilities of the generator and analyzer.

The generator set-up sequence is:

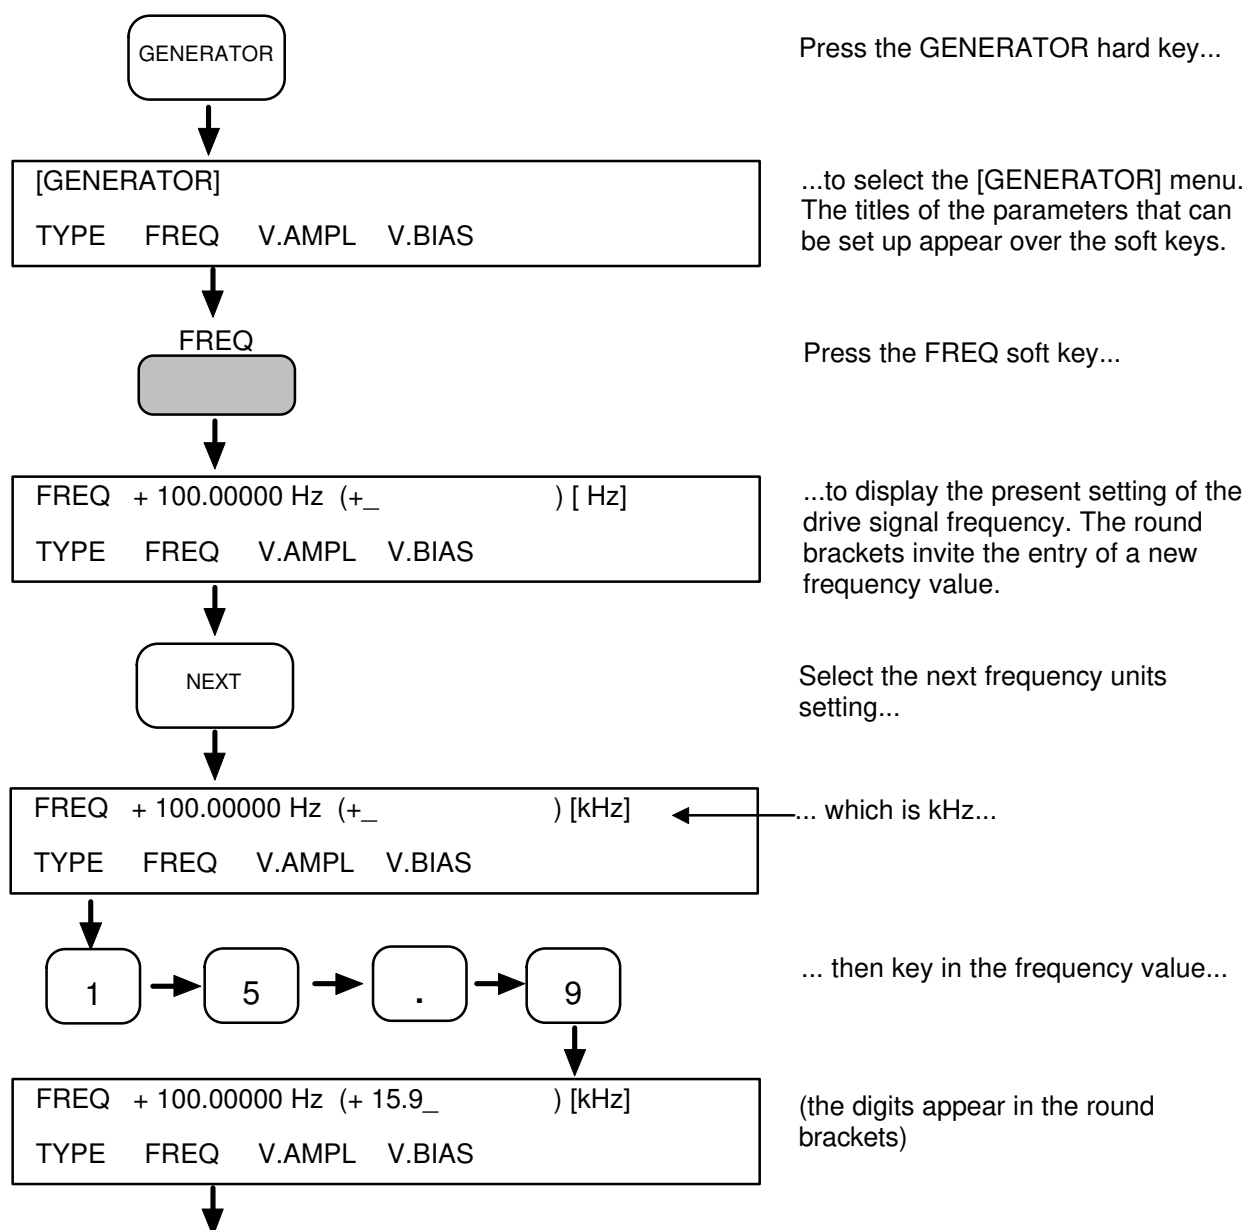


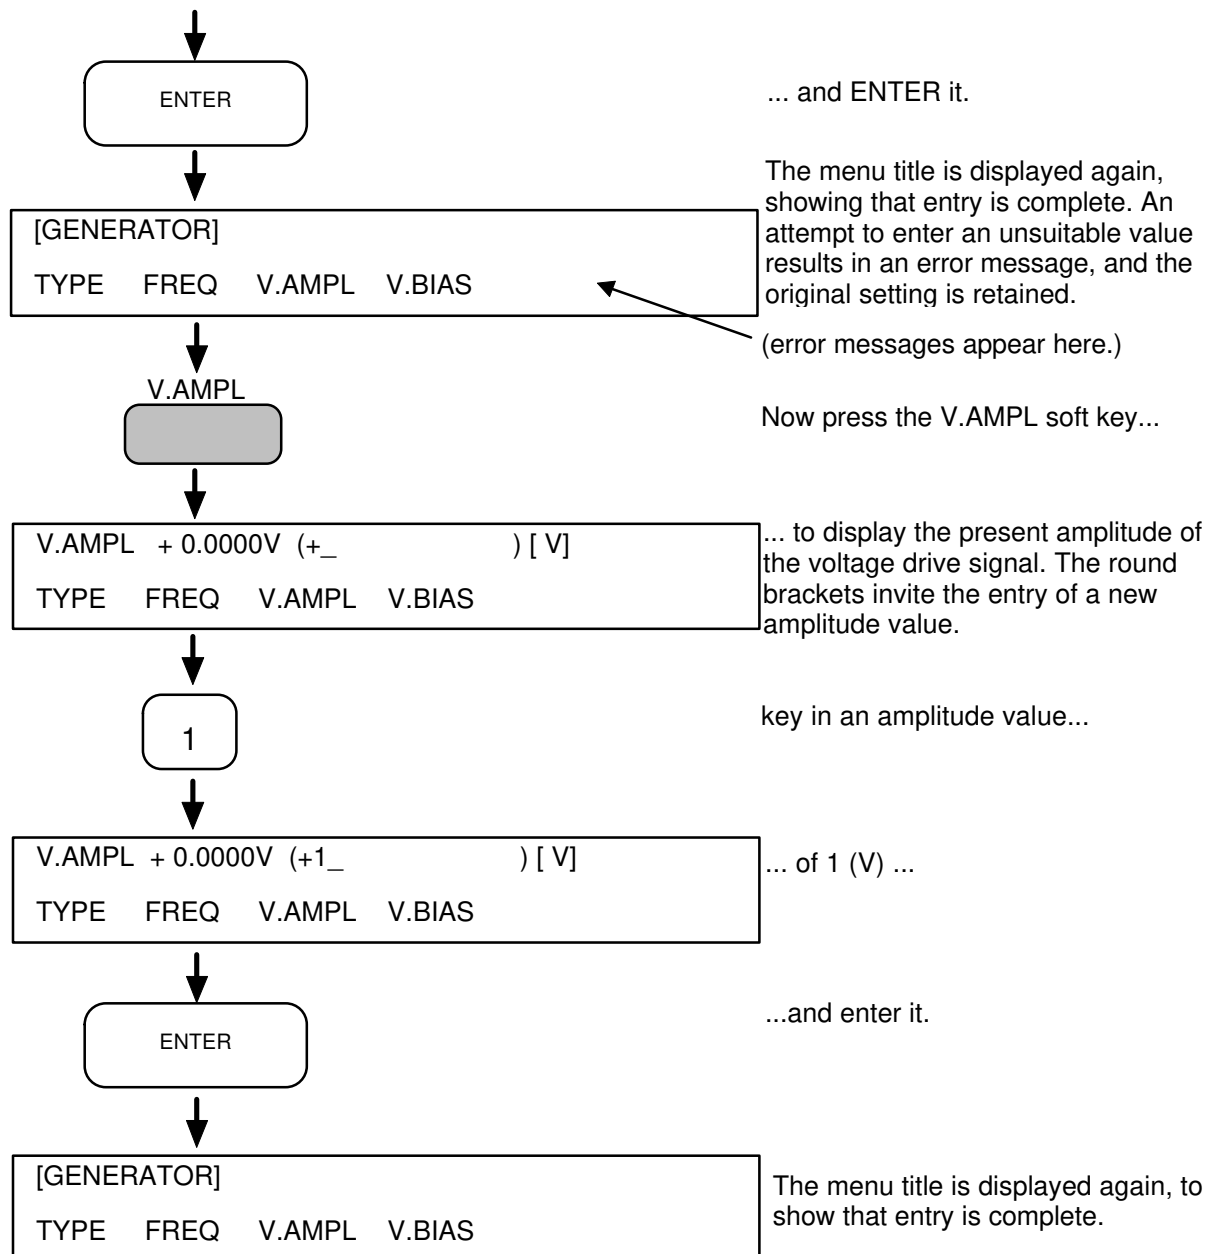

The generator parameters are now set, but the generator output is not applied to the IUT until a measurement is commanded. See next page.

3.6.5 COMMANDING A MEASUREMENT

Once the generator and analyzer have been set up it is possible to command a measurement and get some sensible results.

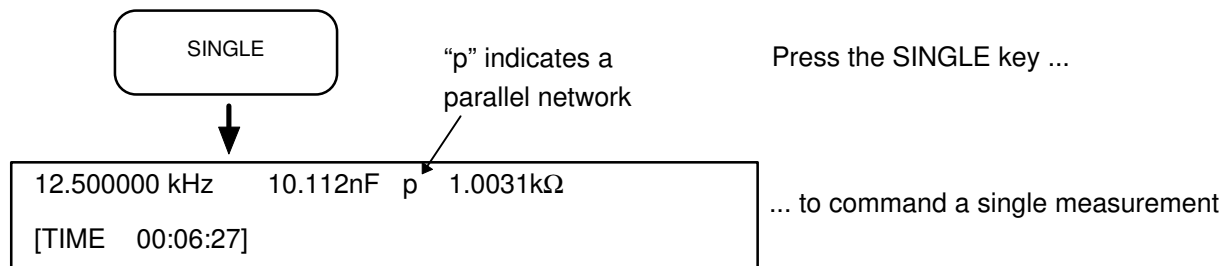


On completion of the single measurement the instrument displays the component values of the parallel C,R circuit presently under test. This is the default display. Other measurement sources and coordinates may be selected from the DISPLAY menu.


Note that the generator output is switched on, and stays on, when a measurement is first commanded. BREAK switches the generator output off.

3.6.6 SETTING THE DISPLAY

Once a measurement has been made the basic data are stored in memory. From these basic data the instrument is able to compute various results in various formats: you simply select the appropriate result from the DISPLAY menu. This allows the same measurement data to be viewed in many different ways.

The next example, in Section 7, shows you how to use the sweep facility. A series of measurements is made, each one at a different frequency, in preparation for making an impedance plot. As an exercise, use the DISPLAY menu to select the polar coordinates Z, θ . (You may, if you wish, do this after the swept measurements are made, but selecting coordinates Z, θ now allows you to see the changing impedance results as they occur.) The procedure is:

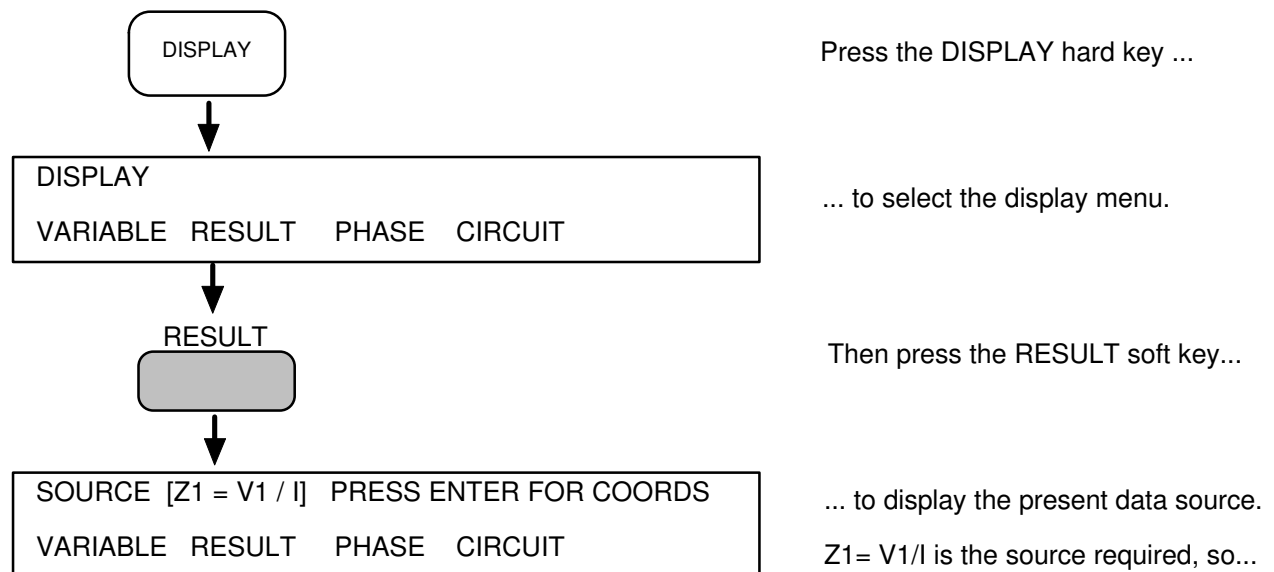

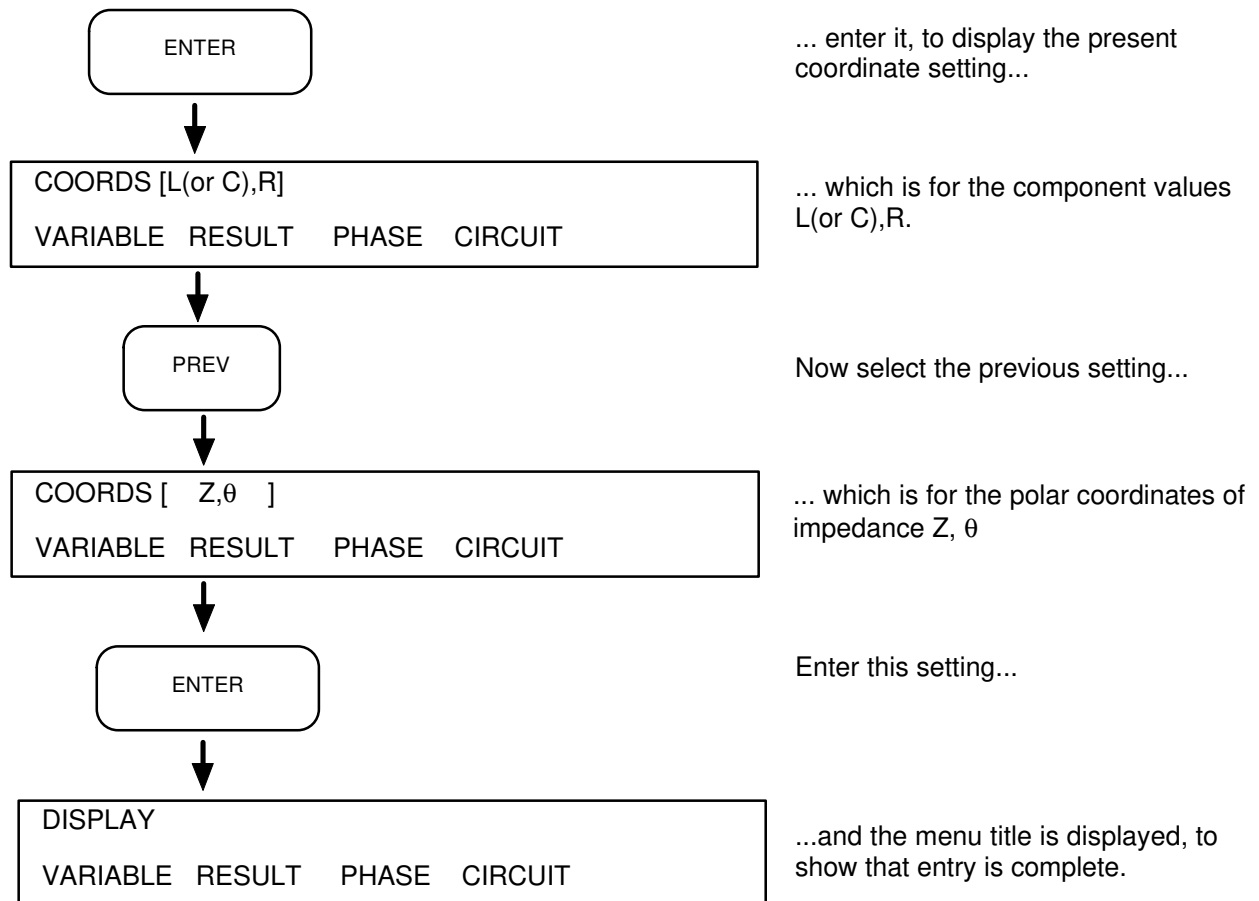


3.7 USING THE SWEEP FACILITY


SWEEP allows any one of the generator output parameters, frequency, amplitude, or bias, to be stepped through a range of settings, a new setting being used for each measurement. The basic data of the series of measurements thus made are held in the history file and may be reviewed with the VIEW FILE facility. A graph can be plotted from the stored data with the PLOT facility (example in Section 8).

In the following example a series of measurements is made of the C,R circuit shown in Fig 3.1, using a frequency sweep. (The settings of the GENERATOR, ANALYZER and DISPLAY menus are the same.) The frequency is swept between the limits 100Hz (F.MIN) and 900kHz (F.MAX). Fifty measurements are made, at logarithmic intervals, going from the minimum to the maximum frequency.

3.7.1 SETTING THE SWEEP

The sweep set-up sequence is:

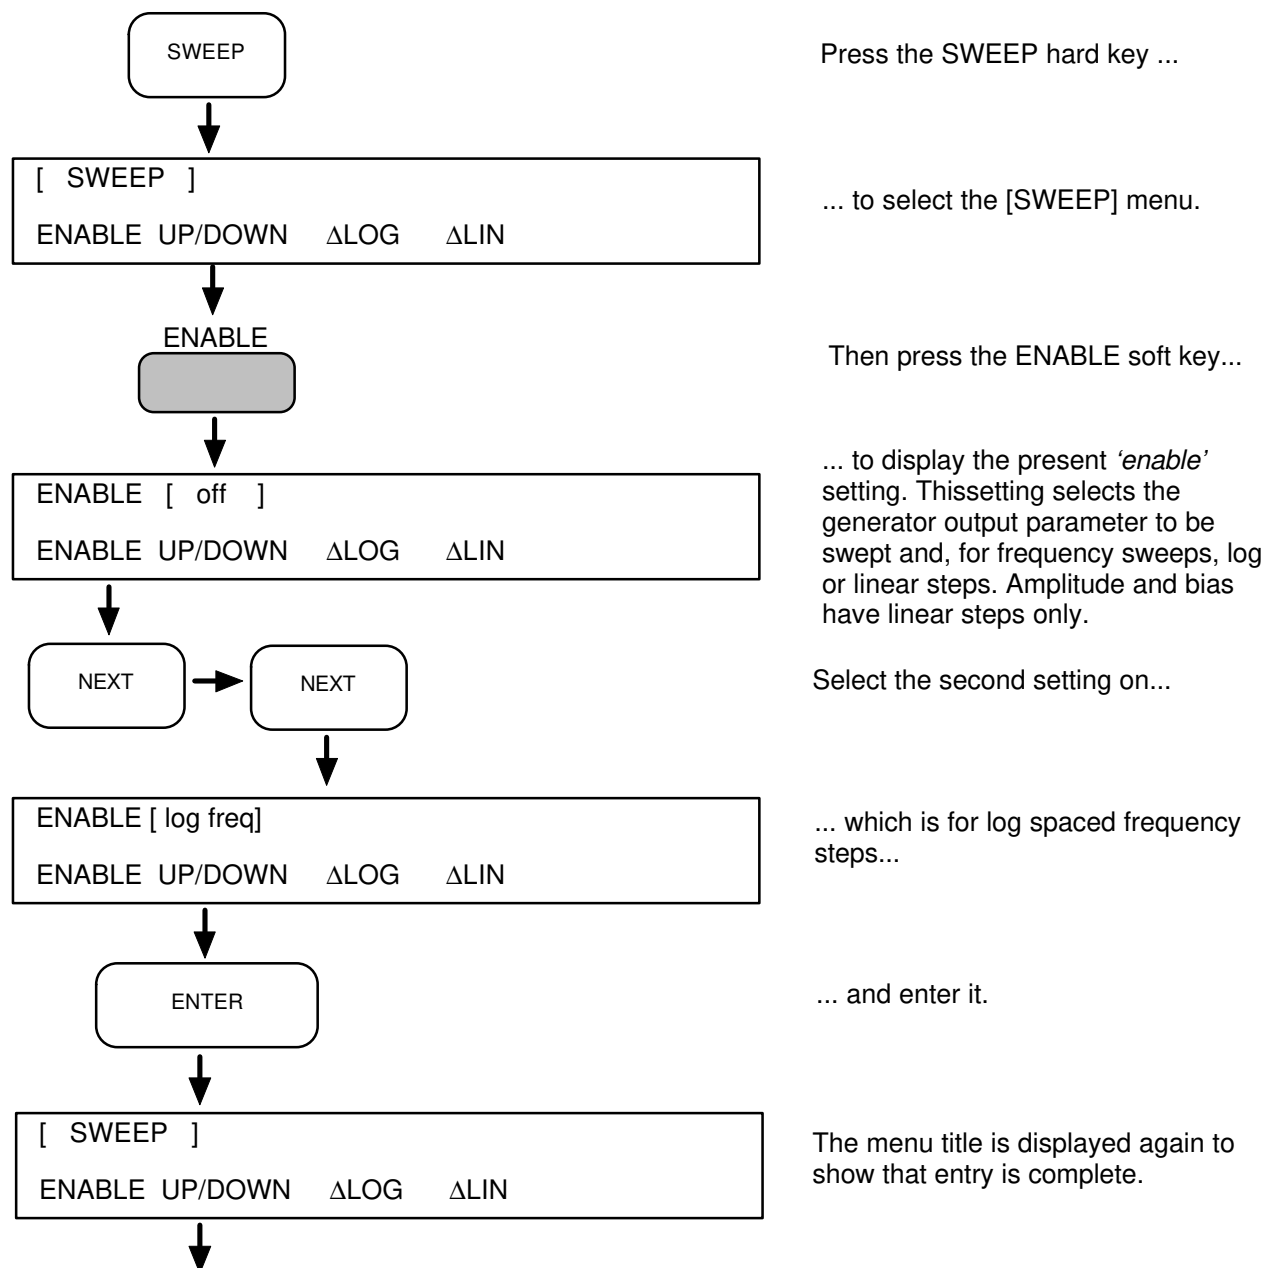

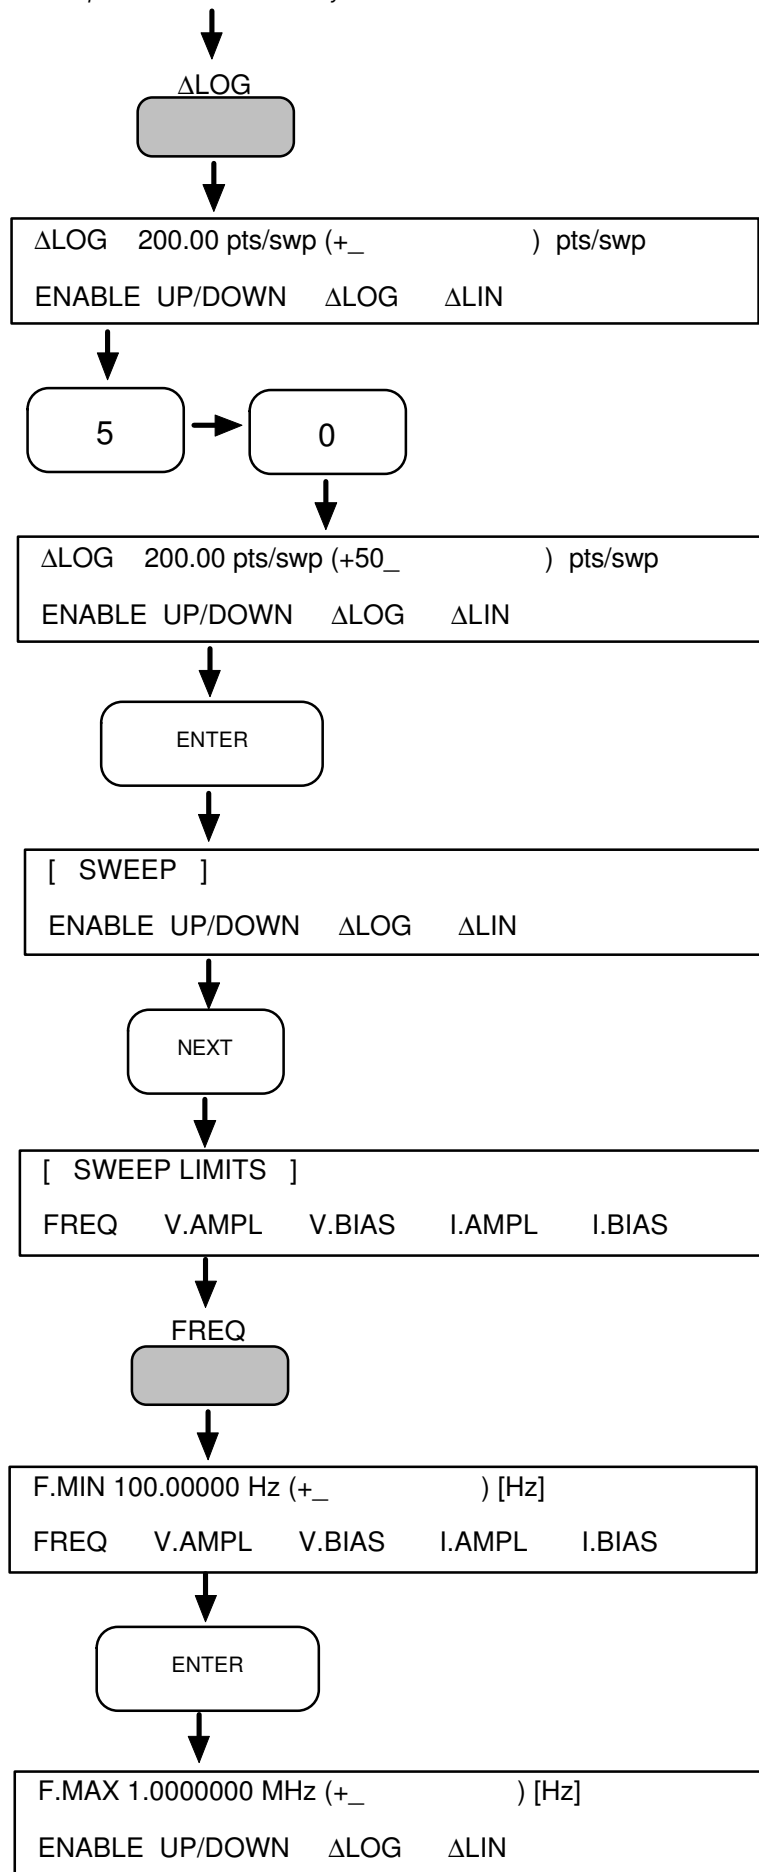

Then press the ENABLE soft key...

... to display the present 'enable' setting. This setting selects the generator output parameter to be swept and, for frequency sweeps, log or linear steps. Amplitude and bias have linear steps only.

Select the second setting on...

... which is for log spaced frequency steps...

... and enter it.

The menu title is displayed again to show that entry is complete.

Select the next menu page...


... which is [SWEEP LIMITS].

... and press the FREQ key

... to display the present value of F.MIN, the minimum frequency. The default value of 100Hz is the frequency you want, so...

... press ENTER, to...

... display the present setting of F.MAX, the maximum frequency. Round brackets invite the entry of a new frequency, so...

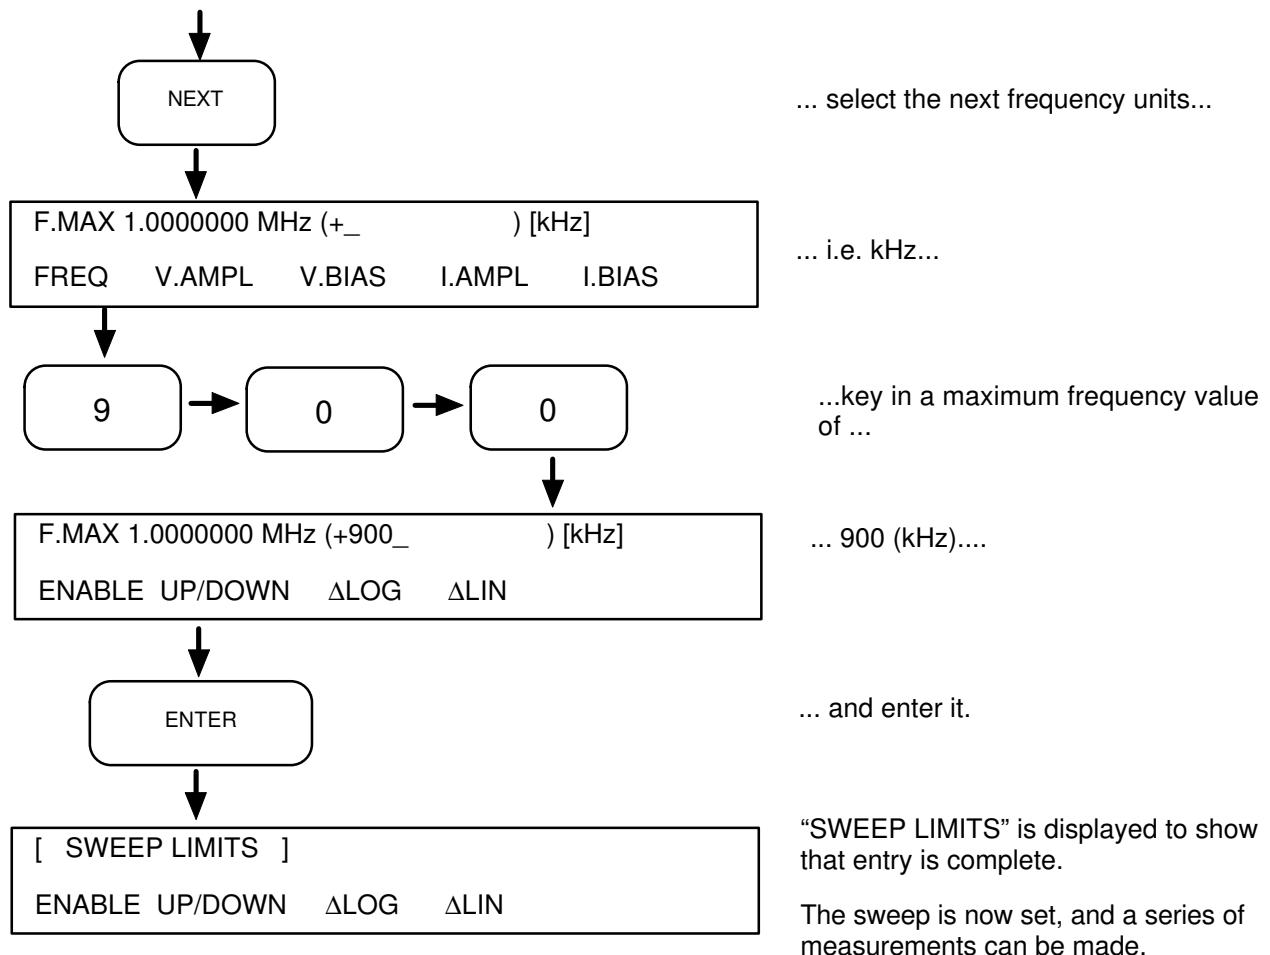

3.7.1.1 Effect of Sweep on Generator Loading

Before actually commanding a sweep it is wise to consider how the variation in drive frequency will affect the generator loading.

In the present example a constant drive amplitude of 1V is used. The impedance of the item under test decreases with frequency, therefore we should look at the loading at 900kHz. At this frequency the reactance of the capacitor ($= 1/\omega C$) 17.70. The effect of the 1k Ω parallel resistance is negligible, so the impedance of the item under test $\approx 17.7\Omega$. The current drain on the generator output will thus be around 56.5mA, which the generator can supply (max. ac- current output = 60mA). To keep the test current within reasonable bounds at the higher test frequencies a lower drive voltage should be selected: two or more consecutive sweeps, each covering part of the test band and using a suitable drive voltage, can be set up with a *learnt program* (See Chapter 11).

You can, of course, select a constant current drive, by entering [current] under the GENERATOR TYPE. Then, with the present item under test, you should consider the current at the low frequency end of the sweep: the impedance of the item at 100Hz approaches 1k Ω , therefore the highest test current which can be obtained, at this frequency, is 3mA. (The maximum drive voltage is 3V.)

3.7.2 PREPARING THE HISTORY FILE

The flow of data to the history file is controlled from the DATA OUTPUT menu. For the present example the default settings are used. As a result:


- the file is *cleared automatically* at the beginning of sweep....
(CLEAR set to [auto] on [FILE CONFIGURE] page)
- and, as the sweep progresses, the basic data of *all measurements* are filed....
(FILE set to [all] on [DATA OUTPUT] page)
- in *normal format*.
(FORMAT set to [normal] on [FILE CONFIGURE] page)

3.7.3 Commanding a Series of Measurements

To complete a sweep, a measure command must be given for each point defined in the SWEEP menu.

SINGLE commands advance the sweep one measurement at a time, and allow measurement results to be assessed as they occur.


RECYCLE advances the sweep automatically. The measurement results can be assessed on sweep completion by reading them from the history file, with the VIEW FILE facility. This is the procedure used in the present example:

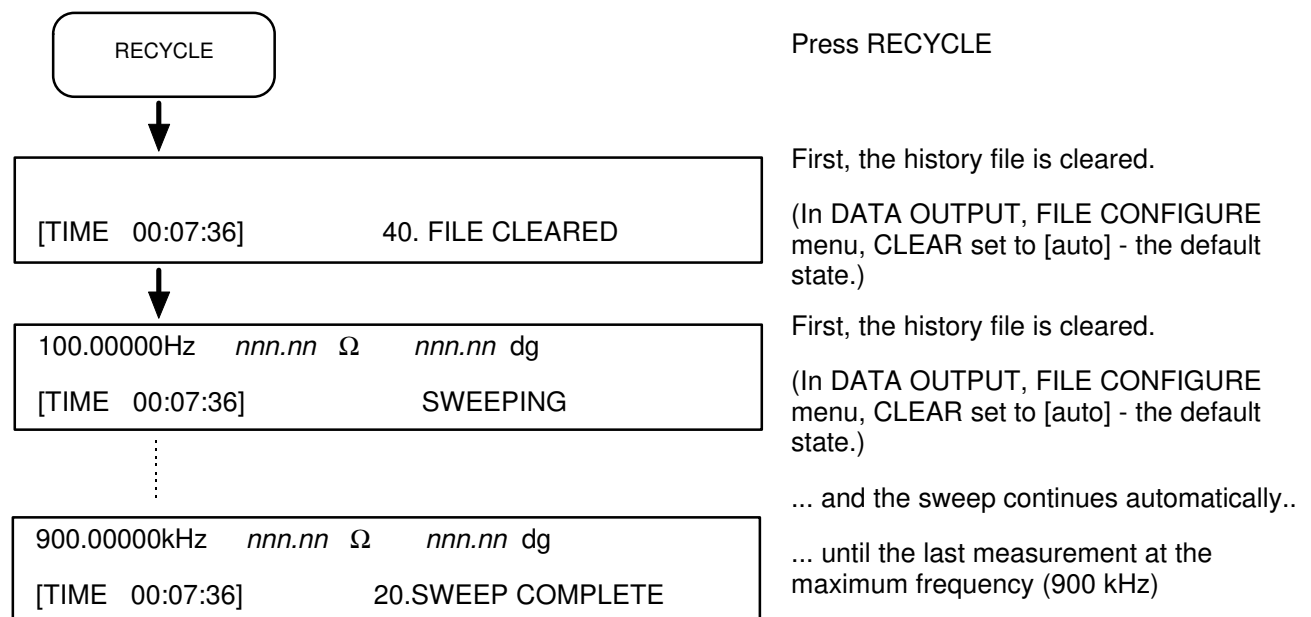

The measurement results may now be read from the history file.

3.7.4 READING THE HISTORY FILE

The history file contains the basic data of all measurements made in the sweep. For each measurement the data are stored in a specific file location, known as a *line*. The first measurement data are stored on line #1, the second on line #2, and so on. File locations may be accessed in any order from VIEW FILE. The form of the measurement results obtained from the basic data is selected from the DISPLAY menu. The results may be displayed in any order. They can, for example, be displayed in measurement order:

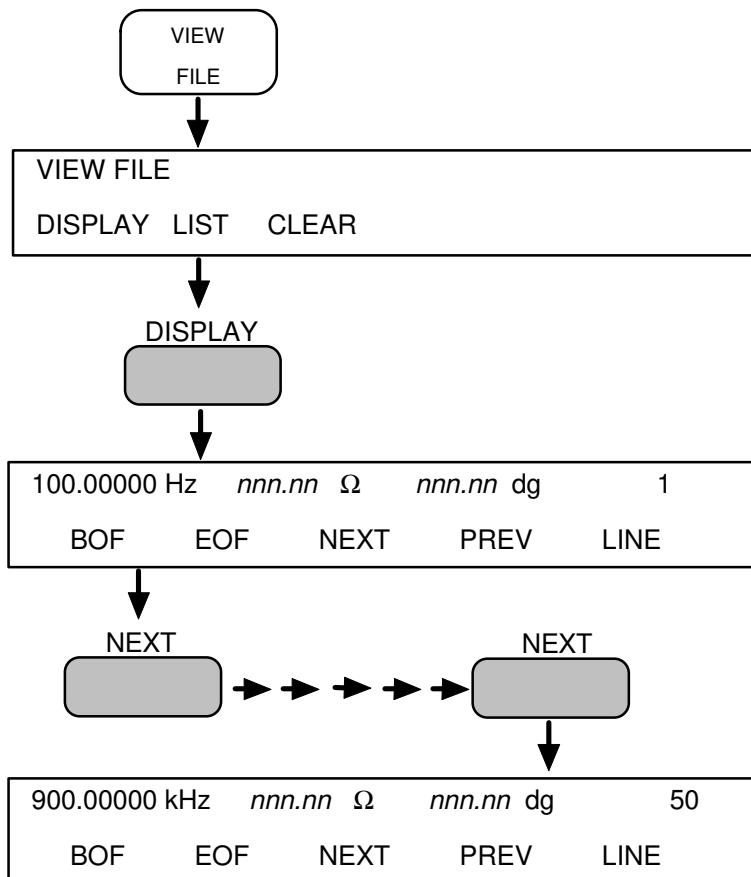

Press VIEW FILE...

... to access the file control keys.

Then press DISPLAY...

... to display a result from line #1...

... and the file display functions.

Using NEXT, step to each location in turn, until...

... the line at the end of the file (EOF) is reached (e.g. #50).


The functions of the other DISPLAY keys are:

PREV Steps through the file in reverse order.

BOF Displays line #1

EOF Displays the highest numbered line containing data.

LINE Displays the results on a specified line number.

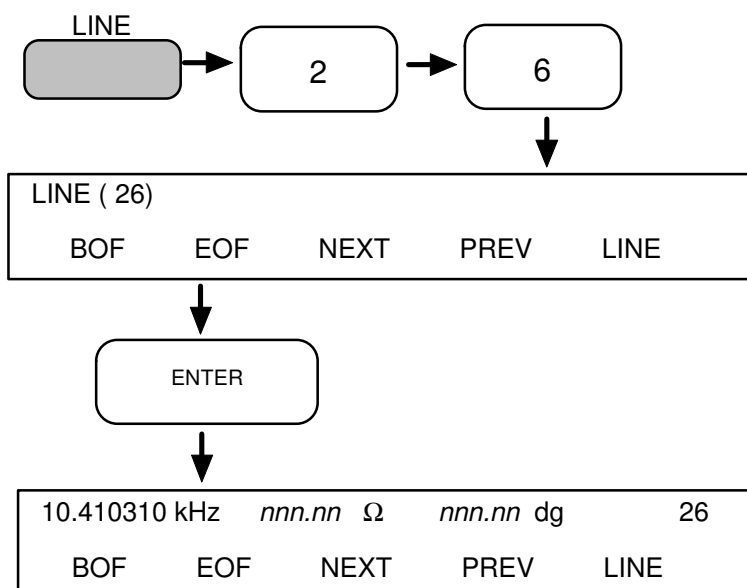

Press LINE and key in the line number.

Enter the line number...

... and the result is displayed.

3.8 USING THE PLOT FACILITY

With the present example a Z, θ plot may be made of the sweep results (stored in the history file) simply by pressing the PLOT key. This assumes, of course, that a digital plotter, suitably set up, is connected to the instruments GPIB interface. Other types of plot, e.g. R, X may be made from the same basic data. The procedures for making a Z, θ plot and an R, X plot are given below.

The appearance of a plot may be changed from the PLOTTER menu. For example, the results can be plotted as points rather than joined by straight lines, a grid can be printed over the plot to assist in interpreting the results, and the plot can be given a title. (See Chapter 5, Section 5.)

Measurement results may also be plotted as they occur. For this, however, the plotting field must be set manually, from the PLOTTER AXES menu. (See Chapter 5, Section 7.)

3.8.1 MAKING A Z, θ PLOT OF THE HISTORY FILE DATA

This example uses the data acquired in the previous example. A digital plotter, using HPGL (Hewlett Packard Graphics Language), is connected to the GPIB interface. (For plotters using ESGL (Enertec Schlumberger Graphics Language) the DEVICE setting in the PLOTTER menu must be set to [ESGL].)

3.8.1.1 Installing the GPIB Plotter

At the GPIB interface on the rear panel, set the *talk* only switch to ON, press BREAK, and plug a digital plotter into the GPIB connector. (See Fig 3.2.) Ensure that the plotter is set to *listen only*, as described in its operating manual.

Switch the plotter on and load a clean sheet of paper onto the platten.


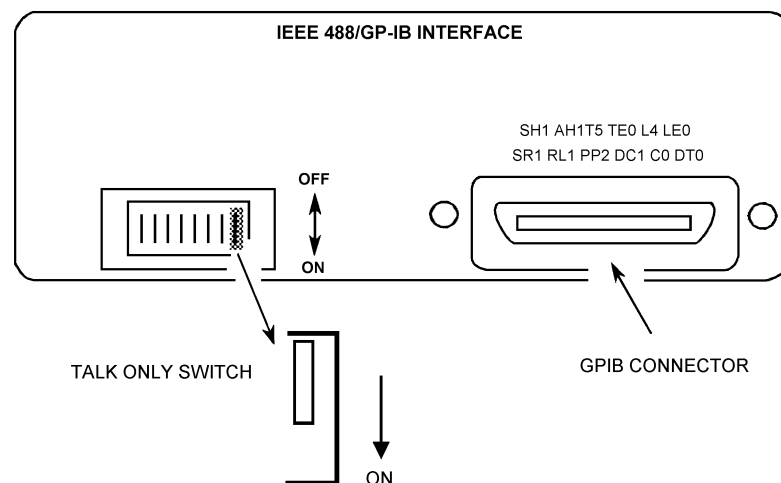


Fig 3.2 - Setting the instrument to “talk only”.

3.8.1.2 Commanding the Z,θ plot

Press the PLOT key and the pen should move from the parking position to the top right corner of the plotting area; this shows that something is happening. Then, after a short “thinking” delay, the plot will begin.

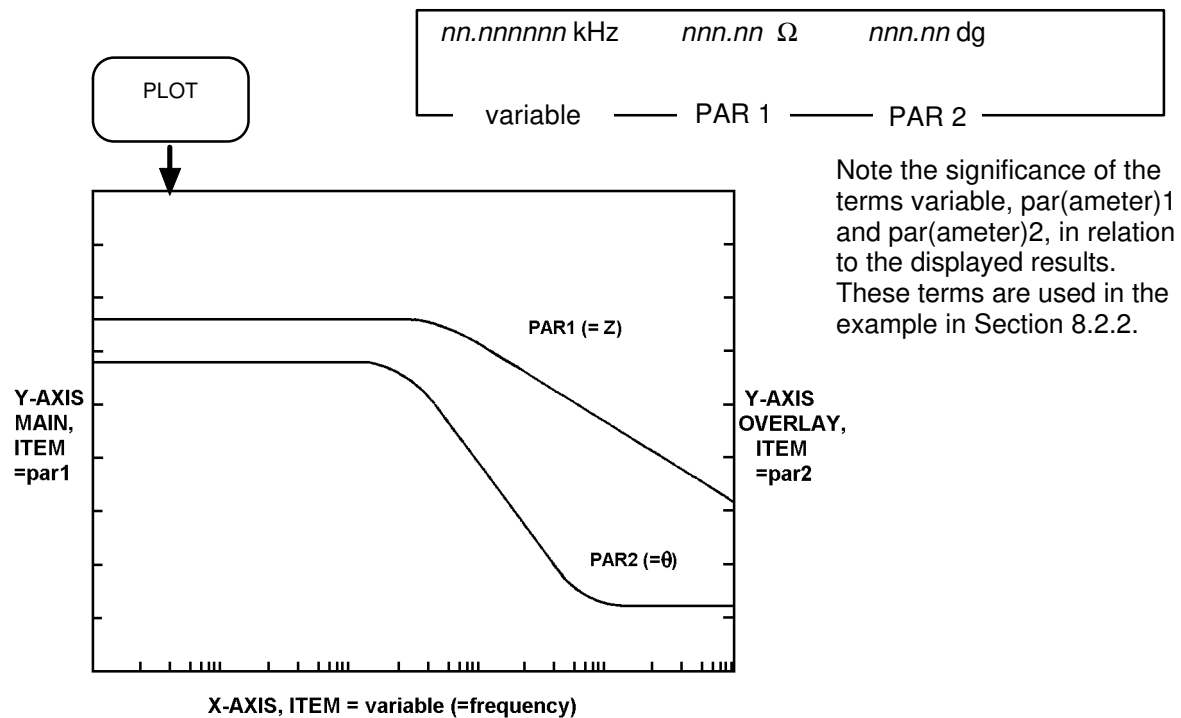


3.8.2 MAKING AN R,X PLOT OF THE HISTORY FILE DATA

To make an R,X plot, the R (resistance) and X (reactance) coordinates must first be selected as the displayed result. The two coordinates must also be assigned to the plotter X- and Y-axes.

3.8.2.1 Setting the Display Coordinates

Use the DISPLAY menu to select the R,X coordinates:

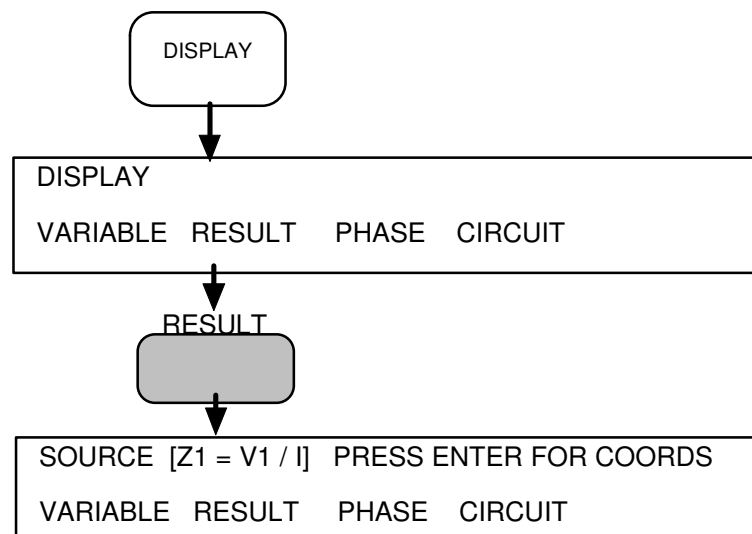


Press the DISPLAY hard key ...

... to select the display menu. The titles of the parameters that can be set up appear over the soft keys.


Then press the RESULT soft key...


... to display the present data source. Z1= V1/I is the source required, so...

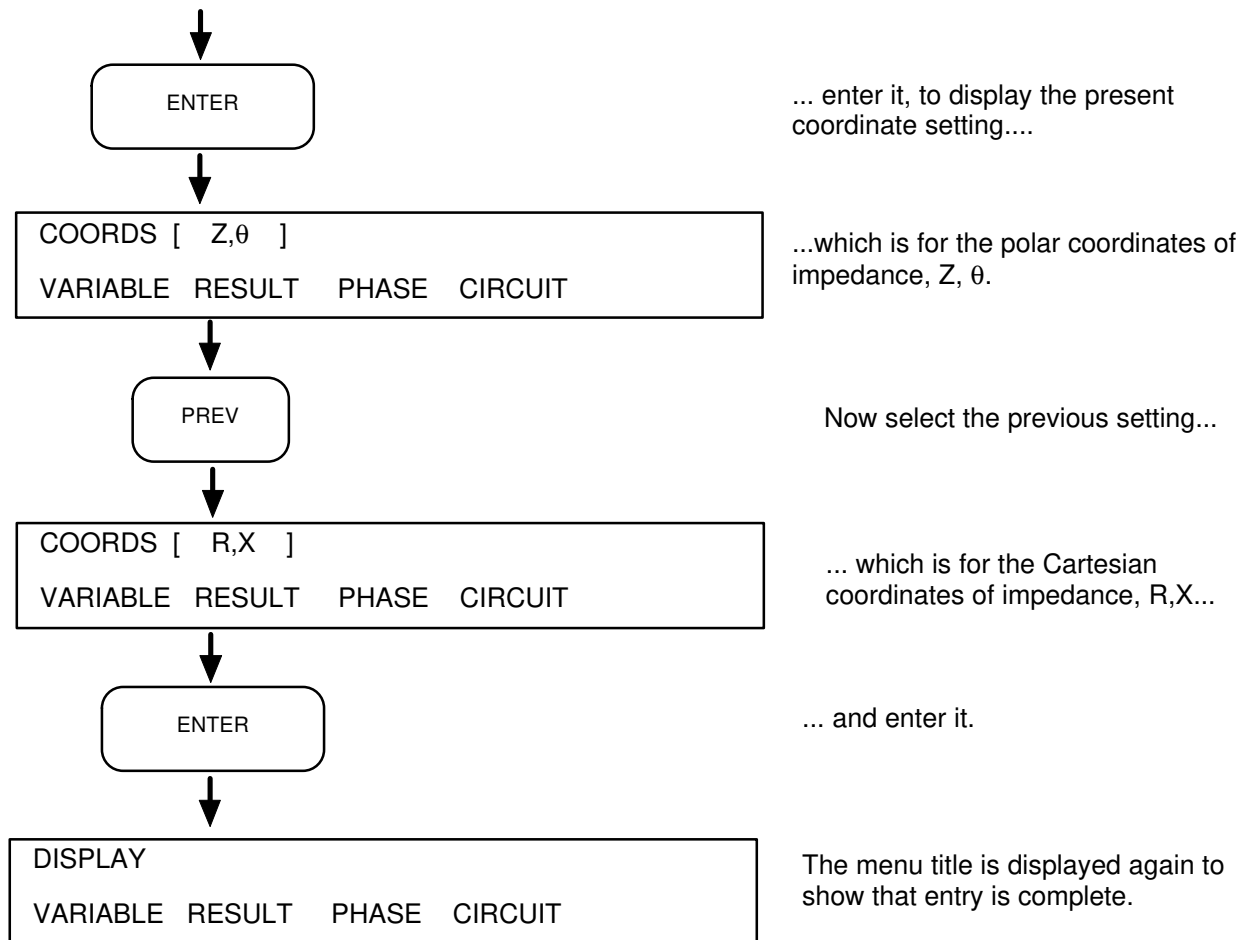


3.8.2.2 Setting the Plotter Axes

Use the PLOTTER AXES menu to assign the R (resistance) coordinate to the X-axis and the X (reactance) coordinate to the Y-axis.

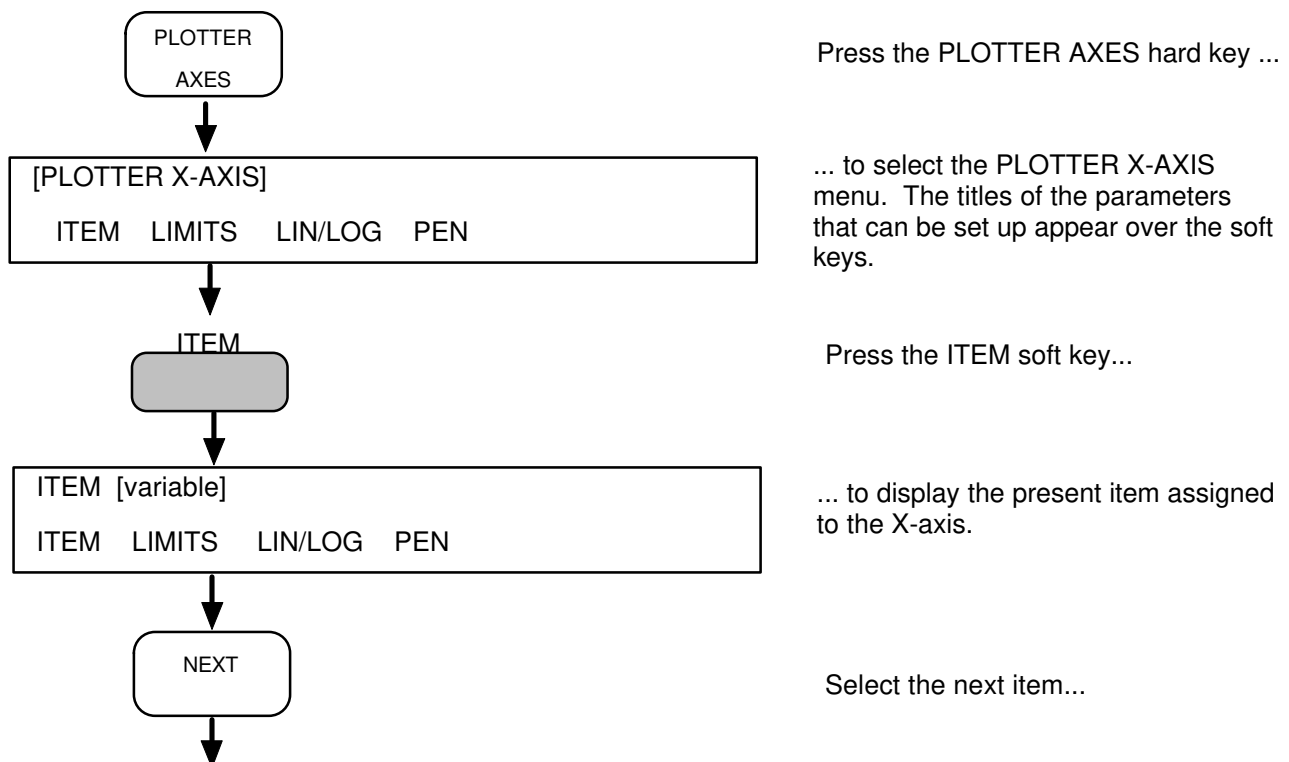

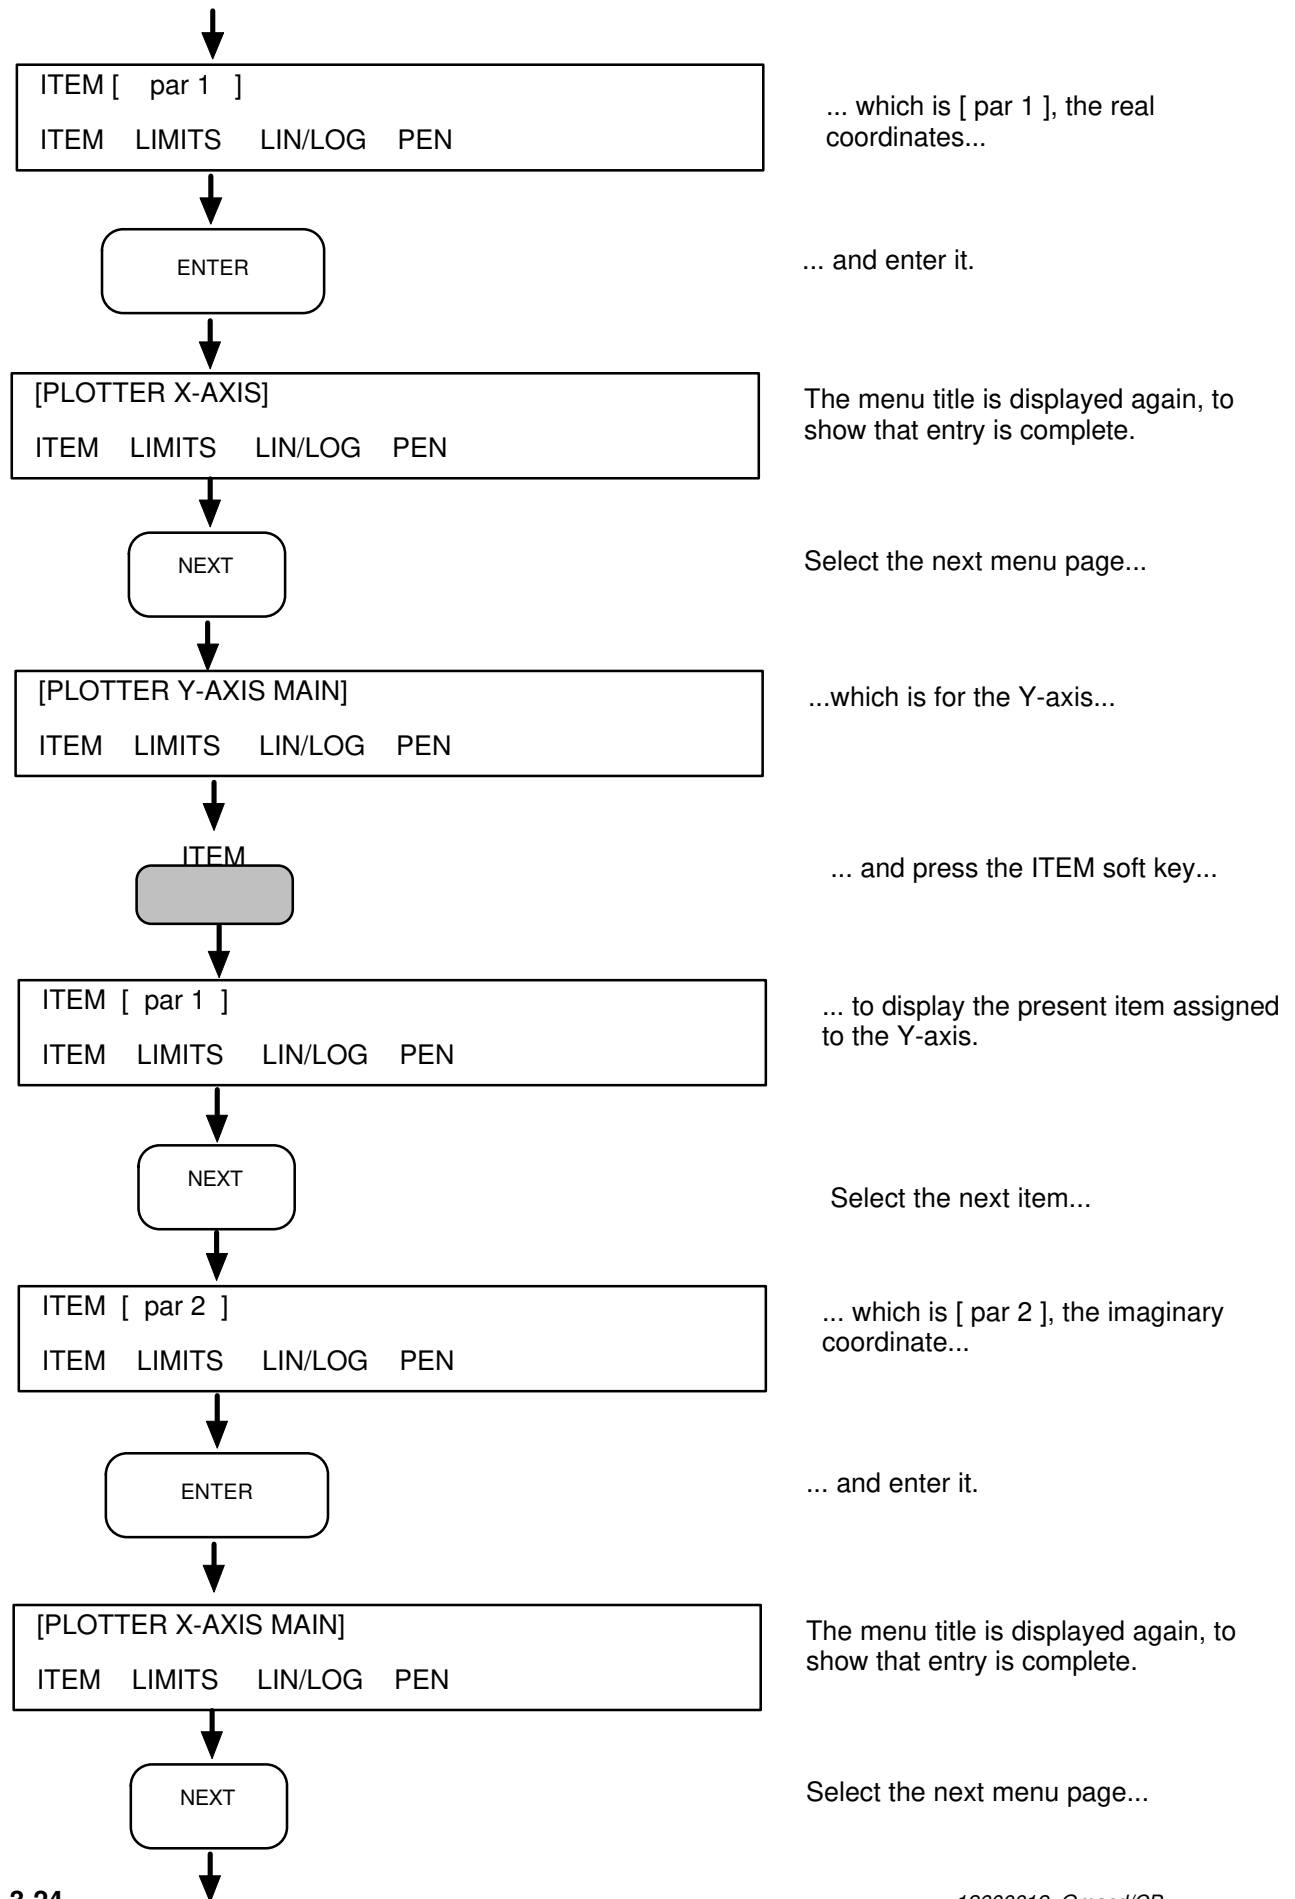


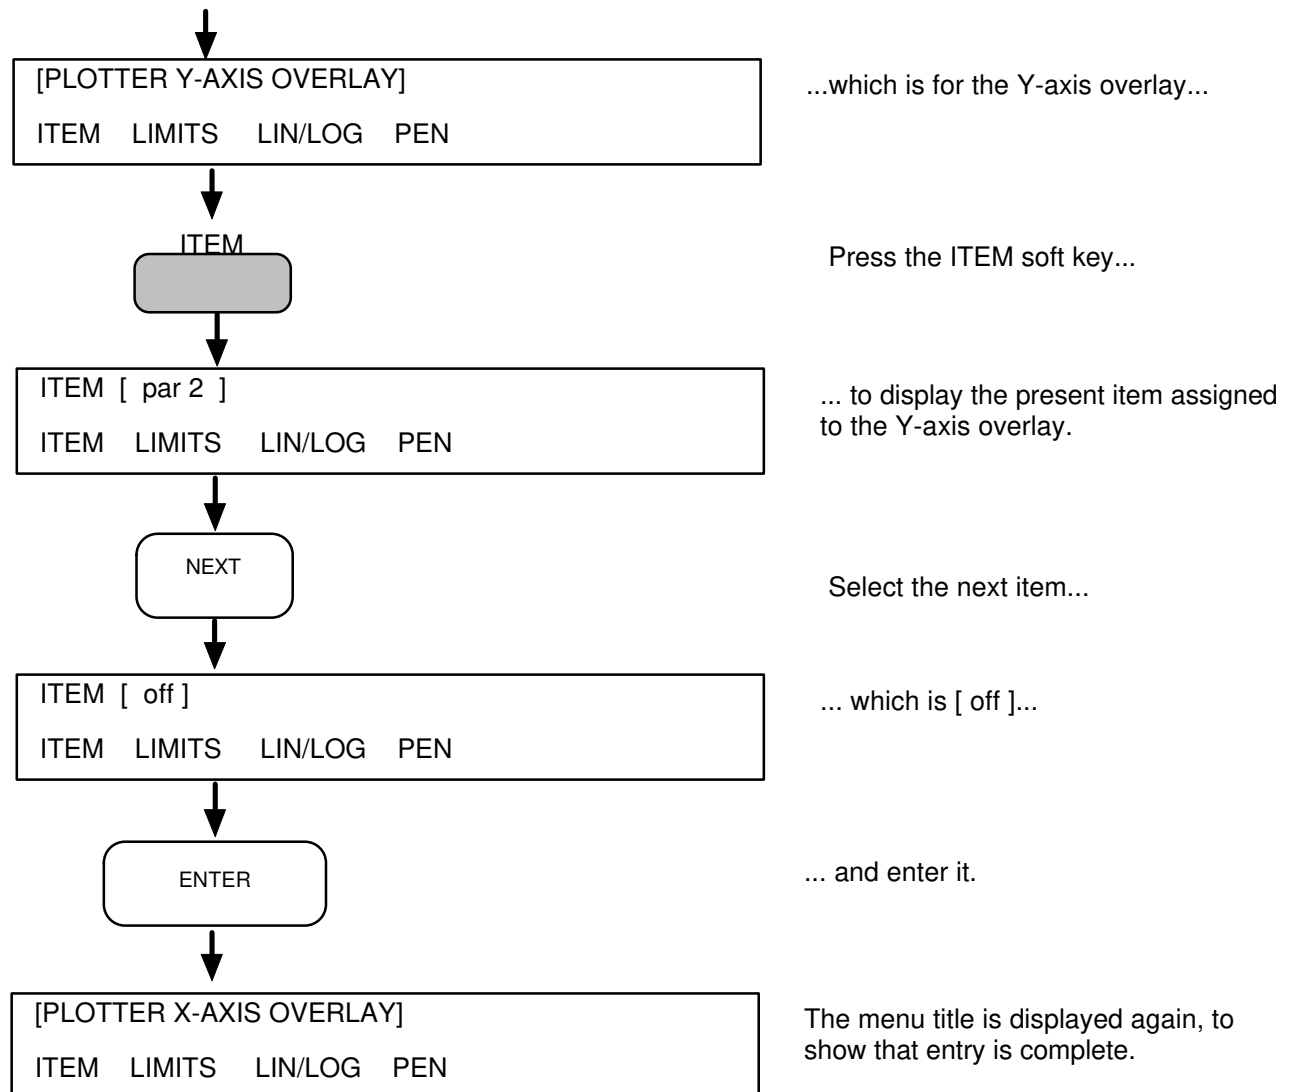

Now command the R , X plot, as shown overleaf.

3.8.2.3 Commanding the R,X Plot

To start the R,X plot press the PLOT key:

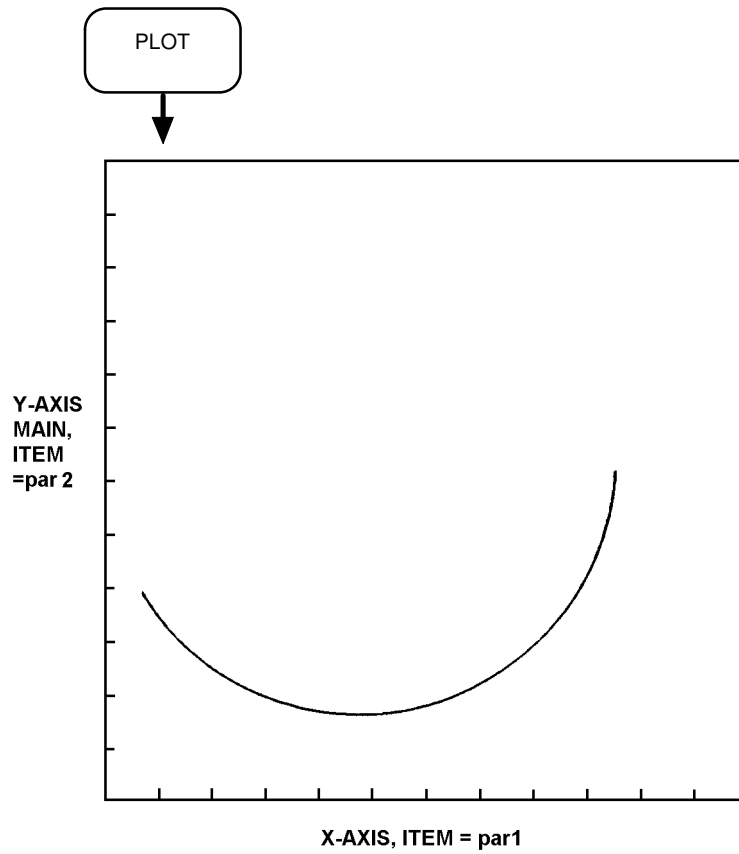

4

Menu Summary

Section	Page
4.1 Menu Summary	4.2
Generator	4.3
Analyzer	4.3
Sweep	4.4
Display	4.5
Plotter	4.5
Plotter Axes	4.6
Data Output	4.6
Scale/Limits	4.7
View File	4.8
Vernier	4.8
Status	4.8
Store/recall	4.9
Learn Program	4.9
Self Test	4.9

4.1 MENU SUMMARY

This summary is intended as a memory aid for experienced users.

Numeric parameters are indicated by round brackets. The generator output frequency, for example, appears thus:

FREQ (+)

Where applicable, the range and default values of a numeric parameter are shown against it. For example, the range and default values of the generator output frequency are shown thus:

10μHz to 32MHz;
default=100Hz.

The absence of a default value generally indicates that a parameter defaults to zero.

With listed choice parameters the full list of settings is shown, with the default setting enclosed in square brackets. For example, the choice of frequency units available for the generator output is shown thus:

[Hz] • kHz • MHz • μHz • mHz

MENU	PARAMETER	SETTINGS
GENERATOR	TYPE	[voltage] • current
	FREQ	(+) [Hz] • kHz • MHz • pHHz • mHz 10μHz to 32 MHz default = 100Hz
	V. AMPL	(+) [V] • mV 0V to 3V ($f \leq 10\text{MHz}$) 0V to 1V ($f > 10\text{MHz}$)
	V. BIAS	(+) [V] • mV -40.95V to +40.95V
[GENERATOR Cont.]	TYPE	[voltage] • current
	FREQ	(+) [Hz] • kHz • MHz • pHHz • mHz 10μHz to 32 MHz default = 100Hz
	I. AMPL	(+) [mA] • μA 0mA to 60mA ($f \leq 10\text{MHz}$) 0V to 1V ($f > 10\text{MHz}$)
	I. BIAS	(+) [mA] • μA -100mA to +100mA
[MONITOR]	ENABLE	[monitor off] • monitor V1, target = V. AMPL • monitor I, target = I. AMPL
	V. LIMIT	(+) [V] • mV 0V to 3V ($f \leq 10\text{MHz}$) 0V to 1V ($f > 10\text{MHz}$) default = 3V
	I. LIMIT	(+) [mA] • μA 0mA to 60mA ($f \leq 10\text{MHz}$) 0mA to 20mA ($f > 10\text{MHz}$)
	ERROR %	(+) 1% to 50% default = 5%
ANALYZER [ANALYSIS]	⌈ TIME	(+) secs 0.01 secs to 10 ⁵ secs default = 3V
	DELAY	(+) secs 0 secs to 10 ⁵ secs
	AUTO ⌈	[off] • long ⌈ on V1 • short ⌈ on V1 • long ⌈ on V2 • short ⌈ on V2 • long ⌈ on I • short ⌈ on I
	MODE	[normal] • group delay* • auto impedance *-ΔFREQ % (+) 0% to 50% *+ΔFREQ % (+) 0% to 50%
[INPUT]	RANGE	[auto] • 30mV • 300mV • 3V
	COUPLING	[dc] • ac
	INPUT	[diff.] • single
	OUTER	[grounded] • floating

MENU	PARAMETER	SETTINGS
ANALYZER Cont [INPUT V2]	RANGE COUPLING INPUT OUTER	[auto] • 30mV • 300mV • 3V [dc] • ac [single] • diff. [grounded] • floating
[INPUT]	RANGE COUPLING	[auto] • 6μA • 60μA • 600μA • 6mA • 60mA [dc] • ac
SWEEP [SWEEP]	ENABLE V. LIMIT ΔLOG ΔLIN	[off] • lin freq • log freq • amplitude • bias [up] • down (+) pts/swp 2 to 50 x 10 ³ points; default 200 points (+) [pts/swp] • unit/st* *1 x 10 ⁻⁵ to 20 x 10 ⁶ units/step
[SWEEP LIMITS]	FREQ V. AMPL V. BIAS I. AMPL I. BIAS	F. MIN (+) [Hz] • kHz • MHz • μHz • mHz 10μHz to 32MHz default 100Hz F. MAX (+) [Hz] • kHz • MHz • μHz • mHz 10μHz to 32MHz default 1MHz V. MIN (+) [V] • mV 0V to 3V ($f \leq 10\text{MHz}$) 0V to 1V ($f > 10\text{MHz}$) V. MAX (+) [V] • mV 0V to 3V ($f \leq 10\text{MHz}$) 0V to 1V ($f > 10\text{MHz}$) BIAS MIN (+) [V] • mV -40.95V to +40.95V BIAS MAX (+) [V] • mV -40.95V to +40.95V I. MIN (+) [mA] • μA 0mA to 60mA ($f \leq 10\text{MHz}$) 0mA to 20mA ($f > 10\text{MHz}$) I. MAX (+) [mA] • μA 0mA to 60mA ($f \leq 10\text{MHz}$) 0mA to 20mA ($f > 10\text{MHz}$) I. MIN (+) [mA] • μA -100mA to +100mA I. MAX (+) [mA] • μA -100mA to +100mA

MENU	PARAMETER	SETTINGS
DISPLAY	VARIABLE RESULT	[freq] • ampl • bias SOURCE [Z1 = V1/I] Enter for COORDS: [L(or C),R] • L(or C),Q • L(or C),D • R,X • Z,θ • Y1 = I/V1 Enter for COORDS: [L(or C),R] • L(or C),Q • L(or C),D • G,B • Y,θ • Z2 = V2/I Enter for COORDS: [L(or C),R] • L(or C),Q • L(or C),D • R,X • Z,θ • Y2 = I/V2 Enter for COORDS: [L(or C),R] • L(or C),Q • L(or C),D • G,B • Z,θ • FUNCTION () Enter for COORDS: [R,θ] • r(dB),θ • r,t • r(dB),t • [L(or C),R] • L(or C),Q • L(or C),D • a,b • V1 • V2 • V1/V2 • V2/V1 Enter for COORDS: [r(dB),θ] • r,t • r(dB),t • a,b • r,θ • I Enter for COORDS: [r,θ] • a,b
	PHASE CIRCUIT	[normal] • unwrapped [parallel C,R] • auto • series L,R • series C,R • parallel L,R
PLOTTER	MODE TEXT GRID AXES DEVICE	[vector] • point [on] • off [off] • on [on] • off [GPIB-HPGL] • GPIB-ESGL
[PLOTTER SCALING]	SIZE X-MIN Y-MIN X-MAX Y-MAX	[A4] • A3 • scaled (+) 0 to 32000 units: default = 1404 units (+) 0 to 32000 units: default = 1368 units (+) 0 to 32000 units: default = 8920 units (+) 0 to 32000 units: default = 6984 units
[PLOTTER TITLE]	OLD NEW	

MENU	PARAMETER	SETTINGS
PLOTTER AXES [PLOTTER X-AXIS]	ITEM	[variable] • par 1 • par 2
	LIMITS	[auto] • manual • *MINIMUM (+) -999 x 10 ¹⁵ to +999 x 10 ¹⁵ *MAXIMUM (+) -999 x 10 ¹⁵ to +999 x 10 ¹⁵
	LIN/LOG	[auto] • linear • log
	PEN	() pen number: 1 to 9; default = pen 3
[PLOTTER Y-AXIS MAIN]	ITEM	[par 1] • par 2 • variable
	LIMITS	[auto] • manual • *MINIMUM (+) -999 x 10 ¹⁵ to +999 x 10 ¹⁵ *MAXIMUM (+) -999 x 10 ¹⁵ to +999 x 10 ¹⁵
	LIN/LOG	[auto] • linear • log
	PEN	() pen number: 1 to 9; default = pen 1
[PLOTTER Y-AXIS OVERLAY]	ITEM	[par 2] • off • variable • par 1
	LIMITS	[auto] • manual • same as main *MINIMUM (+) -999 x 10 ¹⁵ to +999 x 10 ¹⁵ *MAXIMUM (+) -999 x 10 ¹⁵ to +999 x 10 ¹⁵
	LIN/LOG	[auto] • linear • log
	PEN	() pen number: 1 to 9; default = pen 2
DATA OUTPUT [DATA OUTPUT]	RS-423	[off] • all • fail • pass • dump • dump all
	GPIB	[off] • all • fail • pass • dump • dump all • plotter
	FILE	[all] • fail • pass • off
	HEADING	[on] • off
[GPIB CONFIGURE]	TERM. SEP.	[cr lf + EOI] • cr • cr + EOI • cr lf [comma] • terminator
[RS 423 CONFIGURE]	MODE	[printer] • terminator
	ECHO	[on] • off
	TERM.	[cr lf] • cr lf + null • cr • cr + null
	SEP.	[comma] • terminator
	XOFF/XON	[enable] • disable

MENU	PARAMETER	SETTINGS
DATA O/P Cont. [FILE CONFIGURE]	FORMAT CLEAR STATS	[normal] • group delay [auto] • manual [par 1] • par 2
SCALE/LIMITS [SCALING]	NORM. NULL CONSTS FUNCT. LEARN CLEAR DEVA	[off] • on • evaluate [off] • on • evaluate CONSTANT NUMBER () constant number 1 to 9 LEARN FUNCTION () function number 1 to 18 CLEAR FUNCTION () function number 1 to 18 [off] • Δ* • Δ%* *STORE=() store number 1 to 9; default = store 1
[LIMITS]	ITEM LIMITS	[off] • par 1 • par 2 LOWER LIMIT () -999 x 10 ¹² to +999 x 10 ¹² UPPER LIMIT () -999 x 10 ¹² to +999 x 10 ¹²
[BINSORT A]	ENABLE ITEM BINS STOP	[off] • continuous • fixed count • random *STEP SIZE () step size 0 to 255 [par 1] • par 2 PARAMETER VALUE () -999 x 10 ¹² to +999 x 10 ¹² NUMBER OF BINS () 1 to 32; default = 1 BIN 01 MIN% () default = +1% -999 x 10 ¹² to +999 x 10 ¹² BIN 01 MAX% () default = -1% -999 x 10 ¹² to +999 x 10 ¹² [off] • on STOP AFTER () number of measurements 0 to 999 x 10 ¹²
[BINSORT B]	RETRY LEVELS LOGIC	NUMBER OF RETRIES () number of retries 0 to 255; default = 0 [+5V] • 18V [negative] • 18V


MENU	PARAMETER	SETTINGS
VIEW FILE	DISPLAY BOF EOF NEXT PREV LINE LIST CLEAR	Display file location #1. Go to beginning of file. Go to end of file. Go to next line (line $n + 1$). Go to previous line (line $n - 1$). Go to location n . Output each file location in succession. Erase file contents.
VERNIER [VERNIER]	FREQ AMPL BIAS	Adjust generator output: • frequency • amplitude • bias
[VERNIER]	X-min Y-min X-max Y-max	Adjust plotter scaling for: • minimum value of X coordinate0 to 32000 units • minimum value of Y coordinate0 to 32000 units • minimum value of Y coordinate0 to 32000 units • minimum value of Y coordinate0 to 32000 units
STATUS [STATUS 1]	PROGRAM μP INT.FACE STORE FILE	Display status of: • learn program memory (three pages). • microprocessor (two pages). • GPIB and RS423 data ports (three pages). • control/result store (two pages). • History file (two pages).
[STATUS 2]	FUNCTION CONST RESULTS STATS	Display status of: • scaling functions (twenty pages). • scaling constants (ten pages). • stored results (ten pages). • history file statistics (two pages).

MENU	PARAMETER	SETTINGS
STORE/ RECALL [SET UP]	STORE RECALL CLEAR	() * Store control set-ups in location <i>n</i> . () * Recall control set-ups in location <i>n</i> . () * Delete control set-ups in location <i>n</i> . * location no. 1 to 9, volatile mem; 10 to 16, non-vol. mem.
[RESULT]	STORE	() * Store measurement result in location <i>n</i> . * location no. 1 to 9
LEARN PROGRAM	LEARN QUIT EDIT INSERT EDIT DELETE NEXT PREV QUIT CLEAR COPY	() * Store commands as program <i>n</i> . • quit the learn function () * Enable edit of program <i>n</i> , using the commands: • insert instruction (return to edit level) • delete instruction • go to next instruction • go to previous instruction • quit the edit function () * Erase program <i>n</i> . () * Copy program <i>n</i> to (). * location no. 1 to 9, volatile mem; * location no. 1 to 9, volatile mem; 10 to 18, non-vol. mem.
SELF TEST	TEST INIT RESET TIME ERROR-	Test the operation of the measurement hardware, the microprocessor, the keyboard and the display. Set the control parameters to the default state and clear the history file, the result/control stores, and the learn program memory. Reset the control parameters to the default state. Set up the internal clock. [on] • off error “beep”

5

Menu Terms

<i>Section</i>	<i>Page</i>
5.1 Generator	5.3
5.2 Analyzer	5.6
5.3 Sweep	5.12
5.4 Display	5.15
5.5 Plotter	5.18
5.6 Plot	5.23
5.7 Plotter Axes	5.24
5.8 Data Output	5.27
5.9 Scale/limits	5.31
5.10 View File	5.37
5.11 Vernier	5.38
5.12 Status	5.41
5.13 Store/recall	5.47
5.14 Learn program	5.48
5.15 Self test	5.50

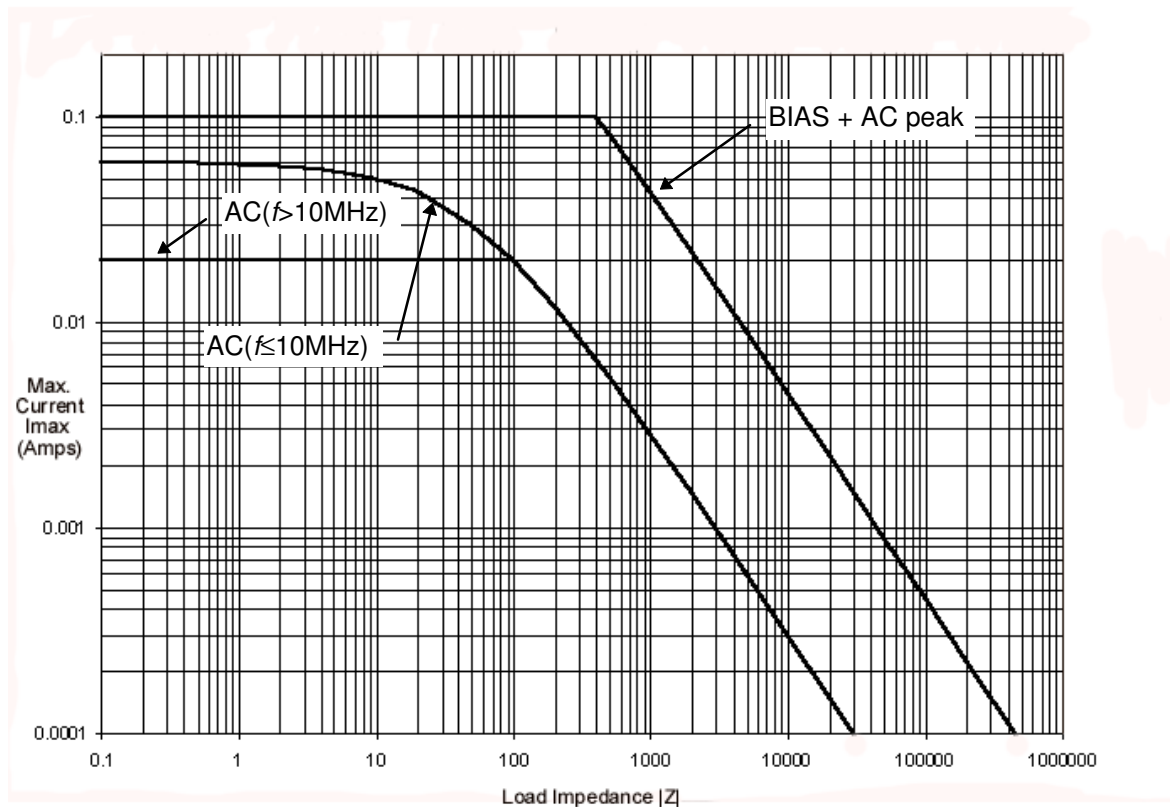

Current Limit of Generator Output

The current limit curves shown above result from the voltage compliance limit of the current generator (3 volts rms) and the amplitude limit (60mA for 10MHz and below; 20mA for above 10MHz). The ac curve fits the limit

$$|I_{\max}| \times (50\Omega + |Z|) \leq 3V_{\text{rms}}$$

Similarly the curve for BIAS current is subject to a voltage compliance of 45 volts and a current limit of 100mA peak. The bias curve fits the limit

$$|I_{\max}| \times (50\Omega + |Z|) \leq 45V_{\text{peak}}$$

with an upper limit of 100mA.

Note that the BIAS limit is for BIAS + AC peak and that the impedance-AC-BIAS combination chosen must satisfy the limits for both AC and BIAS.

5.1 GENERATOR

The generator drives the item under test (IUT). The drive signal parameters are shown in Figure 5.1.

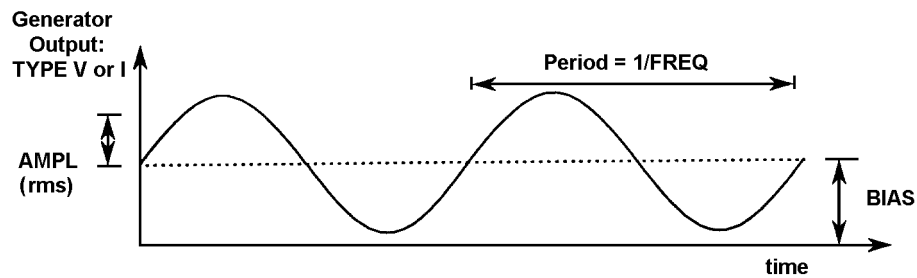


Figure 5.1 - Drive signal parameters

5.1.1 [GENERATOR]

Type of drive and constant voltage drive parameters.

TYPE Selects constant voltage or constant current drive:

- **[voltage]** Constant voltage drive:

With MONITOR ENABLE set to [monitor off] the amplitude of the generator output voltage is held at the VAMPL value.

With MONITOR ENABLE set to [monitor V1, target = V AMPL] the generator output is varied between 0V and V LIMIT in an attempt to hold the analyzer VOLTAGE 1 input at the V AMPL value.

With MONITOR ENABLE set to [monitor 1, target = I AMPL] the generator output is varied between 0V and V LIMIT in an attempt to hold the analyzer CURRENT input at the I AMPL value.

- **[current]** Constant current drive:

With MONITOR ENABLE set to [off] the amplitude of the generator output current is held at I AMPL value. (Set up the drive current parameters from the [GENERATOR Cont] page.)

With MONITOR ENABLE set to [monitor V1, target = V AMPL] the generator output is varied between 0mA and I LIMIT in an attempt to hold the analyzer VOLTAGE 1 input at the V AMPL value.

With MONITOR ENABLE set to [monitor I, target = I AMPL] the generator output is varied between 0mA and I LIMIT in an attempt to hold the analyzer CURRENT input at the I AMPL value.

FREQ Frequency of generator output. This is selectable in the range 10μHz to 32MHz. To vary the frequency progressively, use SWEEP.

V. AMPL Constant voltage ac amplitude, in the range 0V to 3V rms ($f \leq 10\text{MHz}$) and 0V to 1V ($f > \text{MHz}$).

V. BIAS Constant voltage dc level, in the range -40.95V to +40.95V. Used for setting the quiescent operating point of the IUT or for nulling a dc offset.

5.1.2 [GENERATOR Cont]

Type of drive and constant current drive parameters.

- TYPE** Selects constant voltage or constant current drive. Duplicate of TYPE in Section 1.1 above.
- FREQ** Frequency of generator output. Duplicate of FREQ in Section 1.1 above.
- I AMPL** Constant current ac amplitude, in the range 0mA to 60mA rms ($f \leq 10\text{MHz}$) and 0mA to 20mA rms ($f > 10\text{MHz}$).
- I BIAS** Constant voltage dc level, in the range -100mA to +100mA. Used for setting the quiescent operating point of the IUT or for nulling a dc offset.

5.1.3 [MONITOR]

Constant input signal parameters.

- ENABLE** Selects a constant signal level at the analyzer VOLTAGE 1 or CURRENT input. (In monitor mode the displayed amplitude variable represents the actual generator output.)
- **[monitor off]**
Monitor facility off: generator output held at V AMPL or I AMPL value, in accordance with TYPE setting. (See Sections 1.1 and 1.2 above.)
 - **[monitor V1, target = V. AMPL]**
Constant voltage input. Generator output is adjusted automatically to hold the analyzer VOLTAGE 1 input at V AMPL $\pm$ ERROR%. During this process the generator output is not allowed to exceed the V LIMIT value.
 - **[monitor I, target = I. AMPL]**
Constant current input. Generator output is adjusted automatically to hold the analyzer CURRENT input at I AMPL $\pm$ ERROR%. During this process the generator output is not allowed to exceed the I LIMIT value.
- V LIMIT** Maximum amplitude voltage allowed at generator output in [monitor V1, target = V. AMPL] mode. (Default value = 3V.)
- I LIMIT** Maximum amplitude current allowed at generator output in [monitor I, target I. AMPL] mode. (Default value 60mA.)
- ERROR%** Percentage difference (1% to 50%) allowed between the generator output and the target value, in monitor mode.

A failure to obtain a target value within the defined error percentage (after two attempts) results in the error message "84. MONITOR FAILED".

5.1.4 MONITOR CONFIGURATIONS

To hold an input signal at a constant level the instrument uses one of the feedback configurations schematized in Fig 5.2. These configurations are part hardware and part software and, excluding the IUT, are contained in the instrument. In each case the generator output is varied, within defined limits, to maintain the selected input at a defined level. An amplitude sweep with monitor enabled sweeps the selected input.

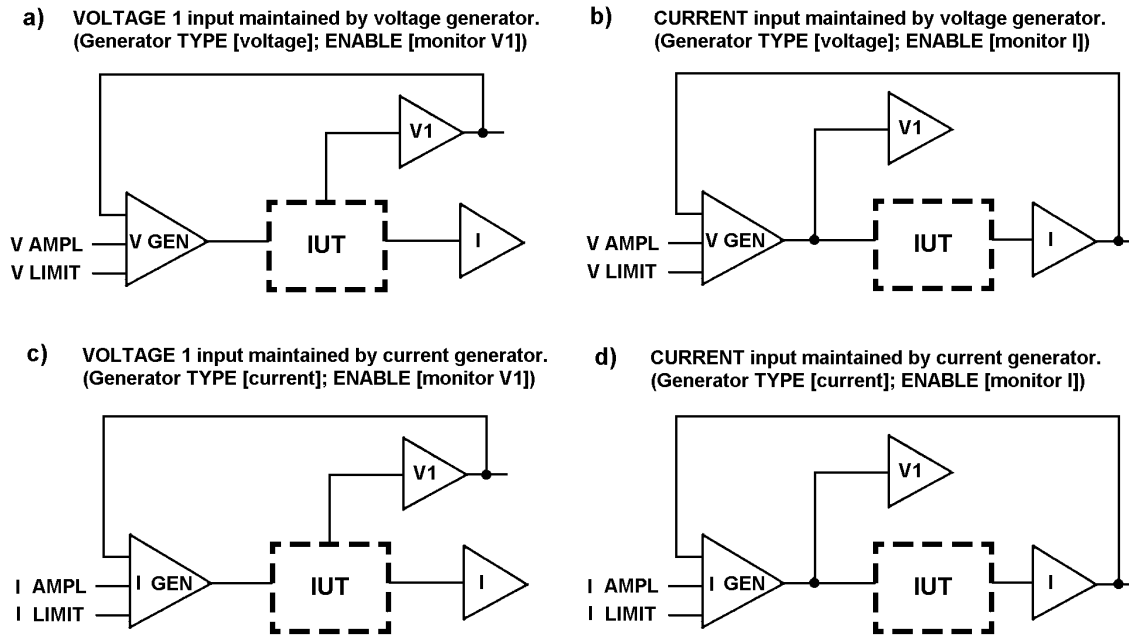


Figure 5.2 - Simplified schematic of monitor feedback configurations

5.1.5 GENERATOR START AND STOP CONTROL

The generator output is switched on, and stays on, when a measurement, SINGLE or RECYCLE, is commanded or when NULL [evaluate] or NORMALIZE [evaluate] is commanded.

BREAK switches the output off.

Other commands that switch the generator output off are:

KILL This remotely generated signal is applied to a connector on the rear panel. When asserted, it holds the generator output at zero volts; when released, it allows the excitation signal to assume its set amplitude.

KILL also halts measurement data processing. Processing restarts, after KILL is released, with the next complete measurement.

Note that, with low frequency measurements, you may have to wait a considerable time for the measurement results to appear. For example, when measuring at 1mHz, the present ("killed") measurement will take up to 1000 secs to complete. Then, assuming KILL was released during this period, you will have to wait another 1000 secs for the results of the "released" measurement.

SELF TEST Same action on generator output as BREAK.

RESET Sets the AMPL value in the GENERATOR menu to zero.

INITIALIZE Same action on generator output as RESET.

5.2 ANALYZER

The analyzer correlates the input signals V1,V2, and I at the drive signal frequency to obtain the frequency response and impedance of the item under test. From these basic measurement data the instrument can compute many different results in various formats: you select the result of your choice from the DISPLAY menu. Any scaling that may be necessary is selected from the SCALING menu: this includes nulling, normalisation, end scaling by functions. Limits checking and sorting of the results may be selected from the LIMITS and BINSORT menus.

The basic analysis data are stored in the history file (when this is enabled, from the DATA OUTPUT menu) and may be reviewed with the VIEW FILE facility.

5.2.1 [ANALYSIS]

Parameters common to all analyzer inputs. The DELAY and $\int$ TIME parameters are shown in Figure 5.3.

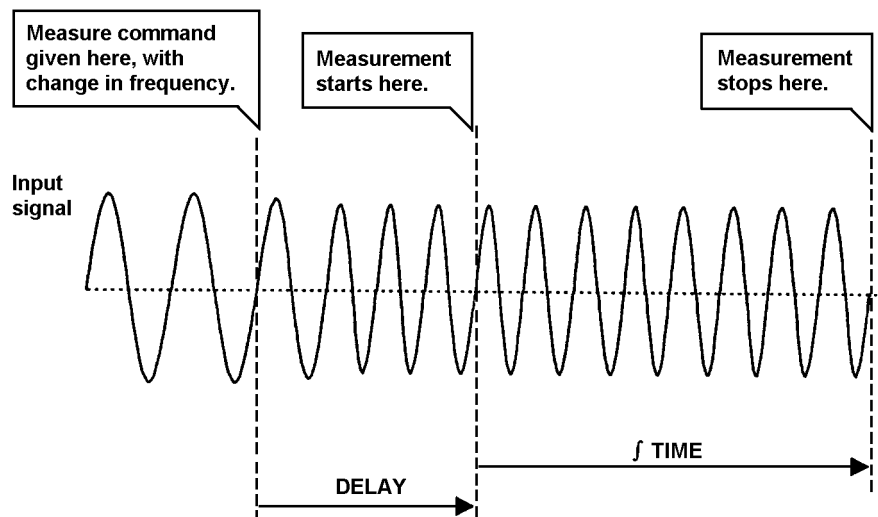


Figure 5.3 - Measurement delay and integration time

5.2.1.1 $\int$ TIME

Integration time. The period over which the analyzer measures the input signals. The duration of this period determines the harmonic and noise rejection ability of the analyzer. Defined in seconds, the time is rounded up or down to cover a whole number of cycles. Figure 5.4 shows how rejection increases with time.

The integration time can be adjusted automatically, in accordance with the amount of noise present at the input and the statistical accuracy required for the measurement result. See Section 2.1.3.

5.2.1.2 DELAY

Delays the start of a measurement on the measure command. Typically, used with SWEEP. Allows the response of the item under test to settle after a change in drive.

5.2.1.3 AUTO $\int$

Auto integration. Selects an integration time in keeping with the interference on a selected input. Measurement continues, within the $\int$ TIME period, until the standard deviation of the input data reaches a target value:

- **[off]**
Auto integration off. Analyzer inputs measured over $\int$ TIME.
- **[Long $\int$ on V1]**
Aims for a standard deviation of $\pm 1\%$ of reading $\pm 0.001\%$ of full scale on analyzer VOLTAGE 1 input.
- **[Short $\int$ on V1]**
Aims for a standard deviation of $\pm 10\%$ of reading $\pm 0.01\%$ of full scale on analyzer VOLTAGE 1 input.
- **[Long $\int$ on V2]**
Aims for a standard deviation of $\pm 1\%$ of reading $\pm 0.001\%$ of full scale on analyzer VOLTAGE 2 input.
- **[Short $\int$ on V2]**
Aims for a standard deviation of $\pm 10\%$ of reading $\pm 0.01\%$ of full scale on analyzer VOLTAGE 2 input.
- **[Long $\int$ on I]**
Aims for a standard deviation of $\pm 1\%$ of reading $\pm 0.001\%$ of full scale on analyzer CURRENT input.
- **[Short $\int$ on I]**
Aims for a standard deviation of $\pm 10\%$ of reading $\pm 0.01\%$ of full scale on analyzer CURRENT input.

In each case, the standard deviation value can be accepted with 90% confidence. A failure to reach the required deviation value within the $\int$ TIME is indicated by the message "82. AUTO INT. FAILED".

To ensure that the standard deviation of all input data is equal to or less than one of the values stated above, select the input signal with the most interference for auto integration.

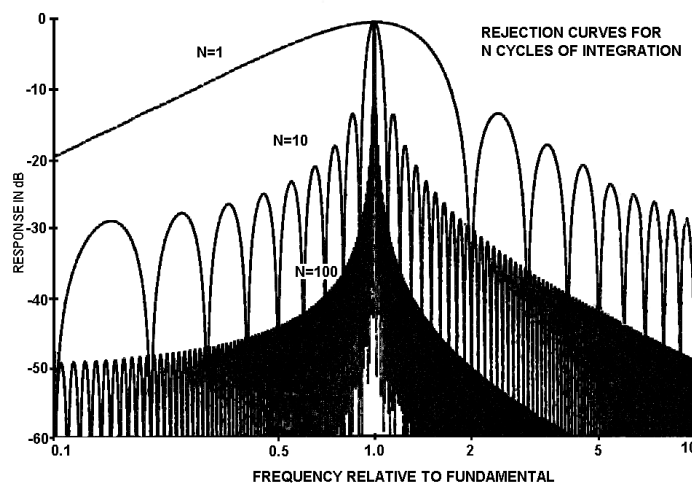


Figure 5.4 - Noise and harmonic rejection v cycles of integration

5.2.1.4 MODE

Selects a measurement mode suitable for the results to be displayed (see Section 4).

- **[normal]**
Single measurement. Used for all displayed functions, except r, t , $r(\text{dB})$, t , and *auto circuit*.
- **[group delay]**
Triple measurement. Used for the functions r, t and $r(\text{dB})$, t , whose prime purpose is to determine the transmission quality of filters. *Time t represents the delay between the frequencies $F - n\%$ and $F + p\%$. F , the generator output frequency, and the values n and p are all defined by the user. All other display functions, except *auto circuit*, may be derived from group delay measurements.*


The error incurred in a group delay measurement

$$= \frac{\text{phase error (in degrees)}}{360 \times f_{\text{span}}}$$

$$\text{where } f_{\text{span}} = F(n + p)\text{Hz}$$

This shows that the group delay error is inversely proportional to f_{span} . To minimize the group delay error at the lower drive frequencies, increase the values of n and p as the value of F is decreased.

- **[auto impedance]**
Double measurement. Used primarily for the auto circuit function, but can also be used for any other function except r, t and $r(\text{dB}), t$.

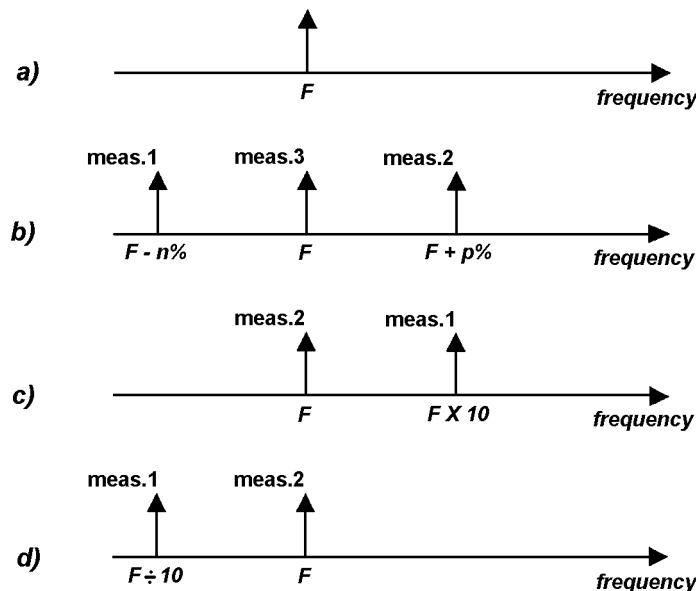

F = Generator FREQ value

Figure 5.5 - Measurement modes: a) normal, b) group delay, c) auto impedance ($F < 128\text{Hz}$), d) auto impedance ($F \geq 128\text{Hz}$)

5.2.2 [INPUT V1]

Parameters of the analyzer VOLTAGE 1 input.

5.2.2.1 *RANGE*

Auto ranging or a *fixed* range can be used:

- **[auto]**
Auto ranging selects the most accurate range for the signal amplitude being measured. Each measurement starts on the most sensitive range. If an overload is detected the result is discarded and measurement restarts on the next range up; this procedure is continued until a valid result is obtained.

Auto ranging should be used when the signal amplitudes being measured cover more than one input range, or are unpredictable.
- **[30mV]**
Fixed range for signal amplitudes between 0V and 30mV.
- **[300mV]**
Fixed range for signal amplitudes between 0V and 300mV.
- **[3V]**
Fixed range for signal amplitudes between 0V and 3V.

The use of a fixed range avoids the range search time penalty incurred with auto ranging. Select the most sensitive range possible, to obtain the finest measurement resolution.

5.2.2.2 *COUPLING*


Coupling of the measured signal to the analyzer VOLTAGE 1 input.

- **[dc]**
Dc coupling introduces minimum phase shift and should be used whenever possible, particularly on low frequency work.
- **[ac]**
Ac coupling can be used to reject an unwanted dc component. This may allow a more sensitive input range to be selected.


5.2.2.3 INPUT AND OUTER

These settings select the internal connections between the Hi and Lo voltage inputs and the analyzer input amplifier:


a) INPUT = diff; OUTER = floating

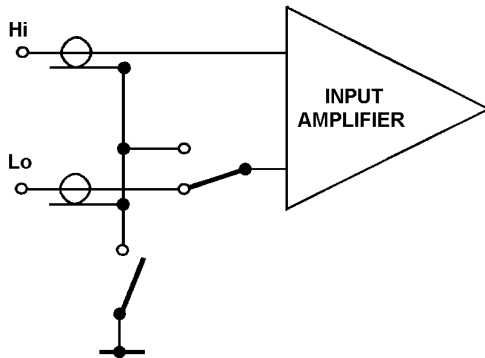


b) INPUT = diff; OUTER = grounded

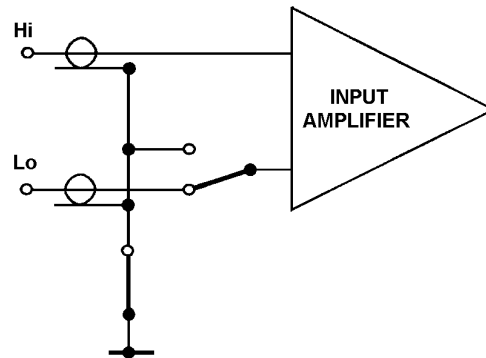

c) INPUT = single; OUTER = floating

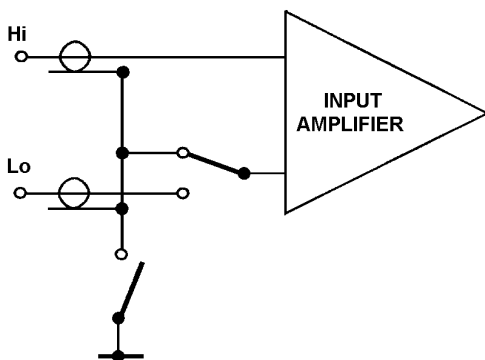

d) INPUT = single; OUTER = grounded

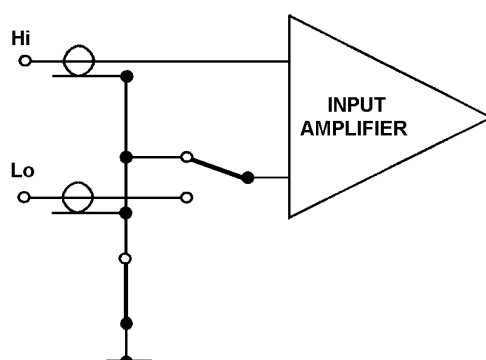

5.2.3 [INPUT V2]

Same parameters as for [VOLTAGE 1] , but applicable to the VOLTAGE 2 input.

5.2.4 [INPUT I]

Parameters of the analyzer CURRENT input.

5.2.4.1 RANGE

Auto ranging or a fixed range can be used:

- **[auto]**
Auto ranging selects the most accurate range for the signal amplitude being measured. Each measurement starts on the most sensitive range. If an overload is detected the result is discarded and measurement restarts on the next range up; this procedure is continued until a valid result is obtained.

Auto ranging should be used when the input signal amplitudes cover more than one range, or are unpredictable.

- **[6μA] to [60mA]**
A fixed range provides for the measurement of signal amplitudes in the range:

- ◆ 0 to 6μA,
- ◆ 0 to 60μA,
- ◆ 0 to 600μA,
- ◆ 0 to 6mA,
- ◆ 0 to 60mA,

The use of a fixed range avoids the range search time penalty incurred with auto ranging. Select the most sensitive range possible, to obtain the finest measurement resolution.

5.2.4.2 COUPLING

Coupling of the measured signal to the analyzer CURRENT input.

- **[dc]**
Dc coupling introduces minimum phase shift and should be used whenever possible, particularly on low frequency work.
- **[ac]**
Ac coupling can be used to reject an unwanted dc component. This may allow a more sensitive input range to be selected.

5.3 SWEEP

SWEEP allows any one of the generator output parameters, *frequency*, *amplitude*, or *bias*, to be stepped through a range of settings, a new setting being used for each measurement.

5.3.1 [SWEEP]

Selection of sweep type, direction, and resolution.

5.3.1.1 *ENABLE*

Sweep type:

- **[off]**
Sweep off.
- **[lin. freq]**
Linear frequency sweep. Successive frequencies differ by a constant frequency value (Δ LIN).
- **[log. freq]**
Logarithmic frequency sweep. Successive frequencies differ by a constant frequency ratio (Δ LOG).
- **[amplitude]**
Amplitude sweep. Successive amplitudes differ by a constant value (Δ LIN).
- **[bias]**
Bias sweep. Successive bias levels differ by a constant value (Δ LIN).

5.3.1.2 *UP/DOWN*

Sweep direction:

- **[up]**
Sweep from minimum limit to maximum limit.
- **[down]**
Sweep from maximum limit to minimum limit.

5.3.1.3 Δ LOG

Numeric entry which defines the number of measurement points for a [log. freq] sweep.

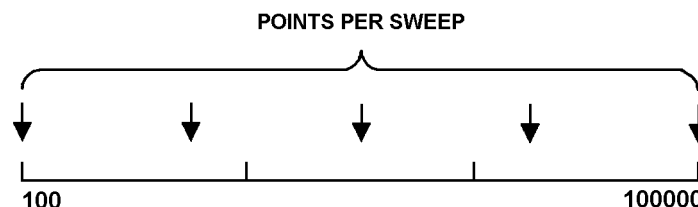


Fig 5.6 - Example of logarithmic frequency sweep: A LOG = 5 points per sweep (= 4 steps/sweep)

5.3.1.4 ΔLIN

Numeric entry which defines, for a [lin freq] sweep.

- **[pts/swp]**
The number of points per sweep.
- **[unit/st]**
The number of units per step. The “units” are Hz on frequency sweeps and volts or amps on amplitude or bias sweeps. (The step value need not be a sub-multiple of the sweep span.)

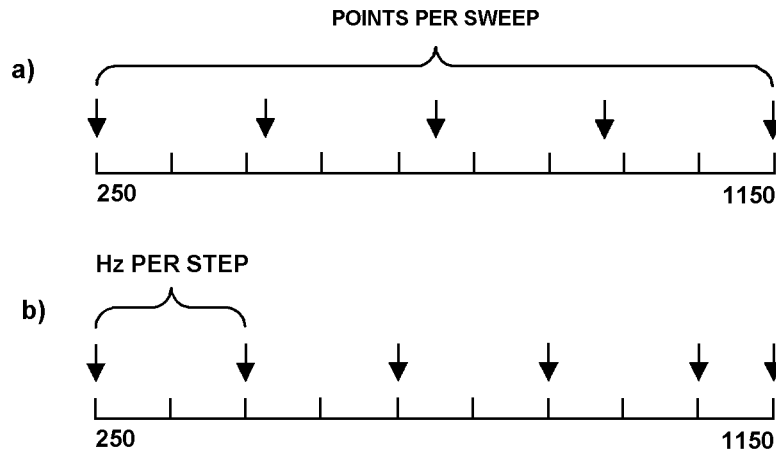


Figure 5.7 - Examples of linear frequency sweep:

- a) $\Delta LIN = 5$ points per sweep (= 4 steps/sweep);
b) $\Delta LIN = 200\text{Hz}$ per step.

5.3.2 [SWEEP LIMITS]

Selection of sweep limits for frequency, amplitude and bias.

5.3.2.1 *FREQ*

Frequency limits:

F MIN ()

Minimum frequency, in the range 10 μ Hz to 32MHz.

F MAX ()

Maximum frequency, in the range 10 μ Hz to 32MHz.

5.3.2.2 *V. AMPL*

Voltage amplitude limits:

V MIN ()

Minimum amplitude, in the range:

0V to 3V ($f \leq 10\text{MHz}$)
0V to 1V ($f > 10\text{MHz}$)

V MAX ()

Minimum amplitude, in the range:

0V to 3V ($f \leq 10\text{MHz}$)
0V to 1V ($f > 10\text{MHz}$)

5.3.2.3 V. BIAS

Voltage bias limits:

V MIN ()

Minimum bias, in the range - 40.95V to +40.95V.

V MAX ()

Maximum bias, in the range - 40.95V to +40.95V.

5.3.2.4 I. AMPL

Current amplitude limits:

I MIN ()

Minimum amplitude, in the range:

0mA to 60mA ($f \leq 10\text{MHz}$);
0mA to 20mA ($f > 10\text{MHz}$).

I MAX ()

Maximum amplitude, in the range:

0mA to 60mA ($f \leq 10\text{MHz}$);
0mA to 20mA ($f > 10\text{MHz}$).

5.3.2.5 I. BIAS

Current bias limits:

I MIN ()

Minimum bias, in the range -100mA to + 100mA.

I MAX ()

Maximum bias, in the range -100mA to + 100mA.

5.4 DISPLAY

DISPLAY acts on the basic measurement data, obtained either from the analyzer or from the history file. These data are the amplitudes of the signals present at the V1, V2, and I inputs of the analyzer, and their phase relations. Various combinations of the data can be selected and the measurement results derived from them can be output in different forms. The history file can be accessed repeatedly to view the same data in many different ways.

5.4.1 DISPLAY

Selection of measurement results to be displayed and/or passed to the output ports. The display format is shown in Figure 5.8.

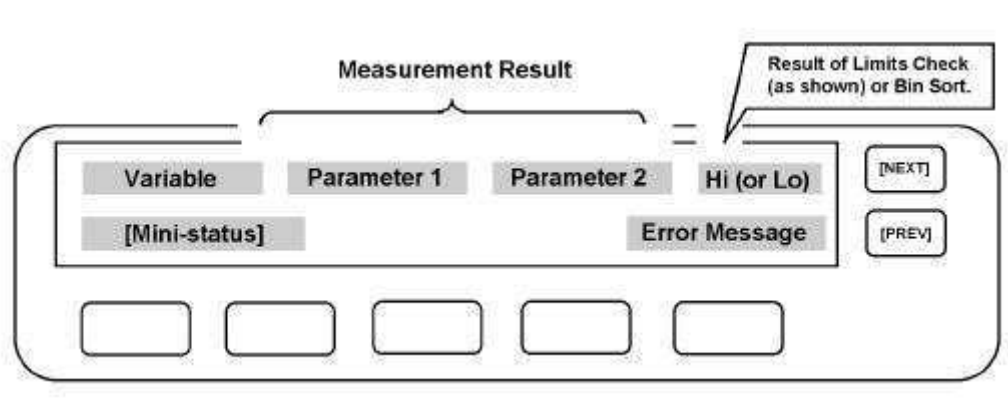


Fig 5.8 - Display format for measurement results

5.4.1.1 VARIABLE

The generator output parameter to be displayed as the *variable*:

- **[freq]**
Generator output frequency.
- **[ampl]**
Amplitude (rms) of ac component of generator output.
- **[bias]**
Level (dc) of generator output.

5.4.1.2 RESULT

To display a specific result a choice of measurement *source* is offered first. Then, depending on the source entered, a choice of *coordinates* is offered. The full range of sources and coordinates is shown in Table 5.1.

Table 5.1 - Measurement Source and Displayed Coordinates

SOURCE	→COORDS→							
[Z1=VI/I]	Z,θ		[L(orc),R]		L(orc),Q	L(orc),D	R,X	
Y1=I/V1	Y,θ		[L(orc),R]		L(orc),Q	L(orc),D	G,B	
Z2=V2/I	Z,θ		[L(orc),R]		L(orc),Q	L(orc),D	R,X	
Y2=I/V2	Y,θ		[L(orc),R]		L(orc),Q	L(orc),D	G,B	
FUNCTION ()	[r,θ]	r(dB),θ	r,t*	r(dB),t*	L(orc),R	L(orc),Q	L(orc),D	a,b
V1	r,θ	[r(dB),θ]	r,t	r(dB),t				a,b
V2	r,θ	[r(dB),θ]	r,t	r(dB),t				a,b
V1/V2	r,θ	[r(dB),θ]	r,t	r(dB),t				a,b
V2/V1	r,θ	[r(dB),θ]	r,t	r(dB),t				a,b
I	[r,θ]							a,b


*For time scale measurements use the analyser 'group delay' mode. (See Section 2.1.4.)

5.4.1.3 PHASE

Phase presentation:


- **[normal]**

Phase presented as an angle between + 180° and ~180°. Angles > ± 180° are *wrapped* to obtain an equivalent *relative* angle. A plot of wrapped phase results relating to a system at resonance could appear thus:

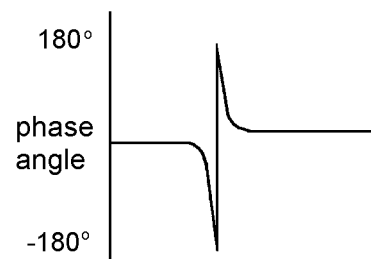

- **[unwrapped]**

Phase presented as an *absolute* angle between 0° and ± n°. A plot of *unwrapped* phase results from the same basic data as the normal plot above would appear thus:

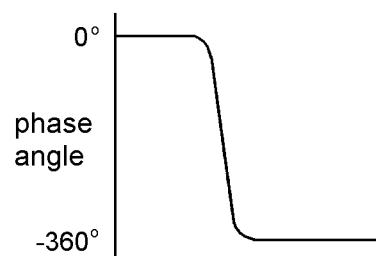


5.4.1.4 CIRCUIT

The form of the circuit being measured, defined for SOURCE set to Z1, Y1, Z2, or Y2:

- **[parallel C,R]**
Capacitor and resistor in parallel.
- **[auto]**
With MODE in the ANALYSIS menu set to auto impedance the instrument automatically ascertains the form of the circuit being measured and displays component values for that form: a "p" or an "s" is displayed also, to indicate a parallel or series circuit. Use auto if the form of the circuit is not known.

Note that small phase components (resistors, for example) may give a confusing reading; noise can change a series R,L result to a series R,C result:

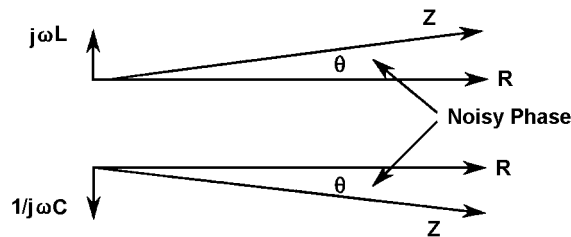

- **[series L,R]**
Inductor and resistor in series.
- **[series C,R]**
Capacitor and resistor in series.
- **[parallel L,R]**
Inductor and resistor in parallel.

5.4.1.5 ALTERNATIVE CIRCUIT FORMS

The CIRCUIT setting can be used to find the equivalent component values of an alternative circuit form. Simply select the required form and read the component values from the display, using the L (or C) coordinates (see Section 5.4.1.2 above). For series to parallel, or parallel to series conversions the equivalent values are valid for the frequency of measurement only.

5.5 PLOTTER

Measurement results can be plotted on a suitable digital plotter. The PLOTTER menu gives a choice of graphics language, plot size and trace, and on/off control of text, grid and axes.


5.5.1 [PLOTTER]

Trace, text, grid, axes, and graphics language selection.


5.5.1.1 *MODE*

Type of trace:

- **[vector]**
Adjacent measurement results connected by a straight line, e.g.

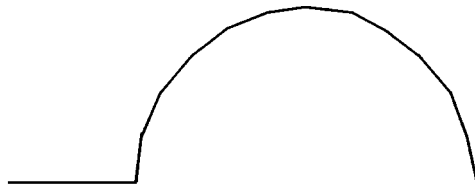

- **[point]**
Measurement results plotted as separate points, e.g.

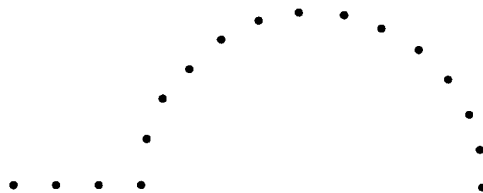

5.5.1.2 *TEXT*

Plot annotation:

- **[on]**
X and Y axes annotated with minimum and maximum values, items, units (if appropriate), title and time.
- **[off]**
Results plotted without annotation.

5.5.1.3 *GRID*


Selects grid on or off; for divisions along the X and Y axes.

5.5.1.4 AXES


On/off control of text, grid and axes:

- **[off]**
Results alone are plotted; no text, grid or axes.
- **[on]**
Depending on the TEXT and GRID selections, plots may be made in the following styles:


a) TEXT off, GRID off,

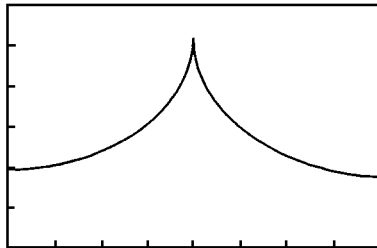


b) TEXT on, GRID off,

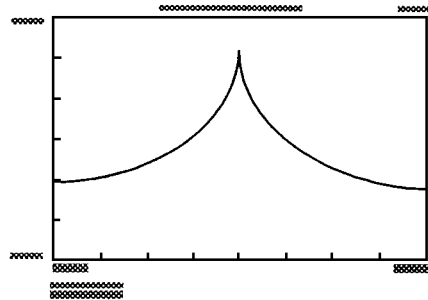

c) TEXT off, GRID on,

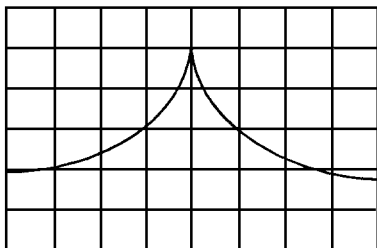

d) TEXT on, GRID on,

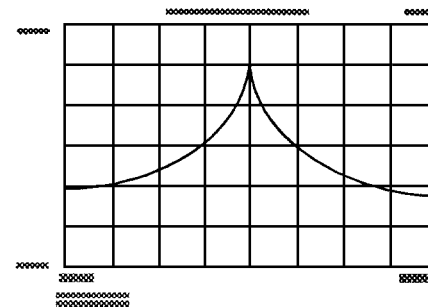

5.5.1.5 DEVICE

Plotting device:

- **[GPIB-HPGL]**
Device using the Hewlett-Packard graphics language.
- **[GPIB-ESGL]**
Device using the Enertec Schlumberger graphics language.

5.5.2 [PLOTTER SCALING]

Choice of plot size:

5.5.2.1 SIZE

Standard size or scaled size.

- **[A4] [A3]**
Standard plot sizes.
- **[scaled]**
Plot size, aspect ratio and position defined by X-MIN, Y-MIN, X-MAX, Y-MAX. See Section 11, for VERNIER method of setting up the scaled graph size.

5.5.2.2 X-MIN, Y-MIN, X-MAX, Y-MAX

Coordinates which define the plotting field, as shown in Fig 5.11. The coordinates can be set in the range 0 to 32000 units. One unit = 0.025mm, measured from the reference origin.

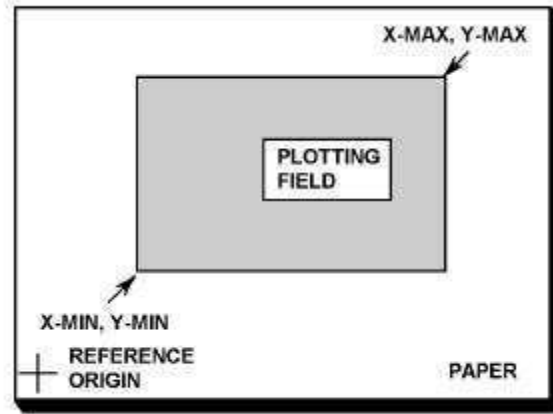


Figure 5.9 - Coordinates of the plotting field

5.5.3 [PLOTTER TITLE]

A user-defined title containing up to twenty five characters, alpha and numeric, can be entered. This title appears at the top of the plotting field.

OLD Displays the present title, e.g.

[WXYZABCDE]		<Freq Response Test No 5_>		
<-	->	COPY	<--	-->

This title can now be edited, if required. This is done by overwriting the original characters. (There is no character insertion facility.)


NEW Displays a blank title space, for the entry of a new title.

[WXYZABCDE]	<_	>
<-	->	COPY
<--	-->	

5.5.3.1 TITLE ENTRY

Characters are copied from the group in square brackets in the top left hand corner of the display. For each character to be copied the procedure is:


1. Select the group in which the character appears. Four different groups can be selected with NEXT or PREV:
 - [WXYZABCDE] upper case alpha characters,
 - [SPACE] a space character,
 - [, . : 1 2 3 4 5] numeric and miscellaneous characters,
 - [w x y z a b c d e] lower case alpha characters.
2. Select the character for copying by aligning it with the flashing cursor. To do this, move the selected group to the left or right by pressing the appropriate arrow key (on the left-hand side), e.g.

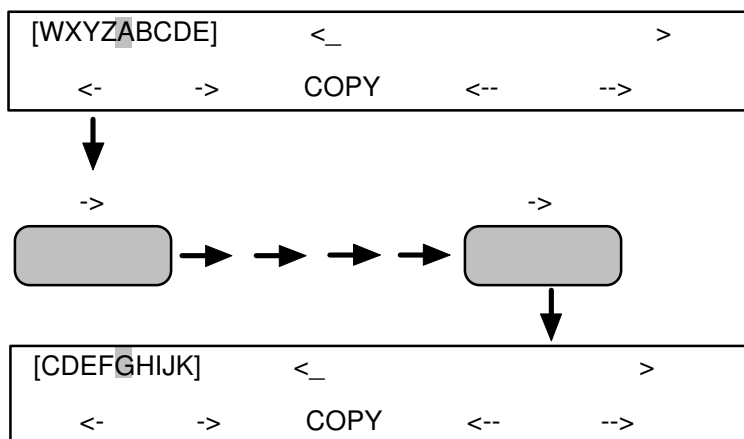

3. Copy selected character into title:




4. Repeat steps 1 to 3 until complete title is copied, then ENTER it.

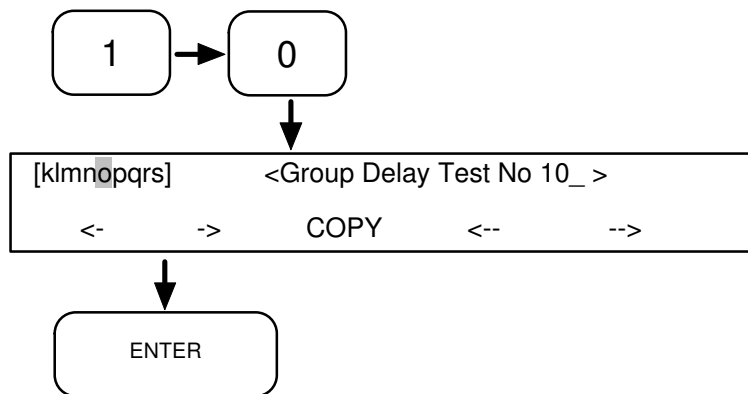


Note that numbers may be keyed in from the keypad. Spaces may be created in a blank title space simply by moving the cursor with the right-hand "-->" key.

5.5.3.2 TITLE EDIT

The title is edited by overwriting the character(s) to be changed. The procedure is:

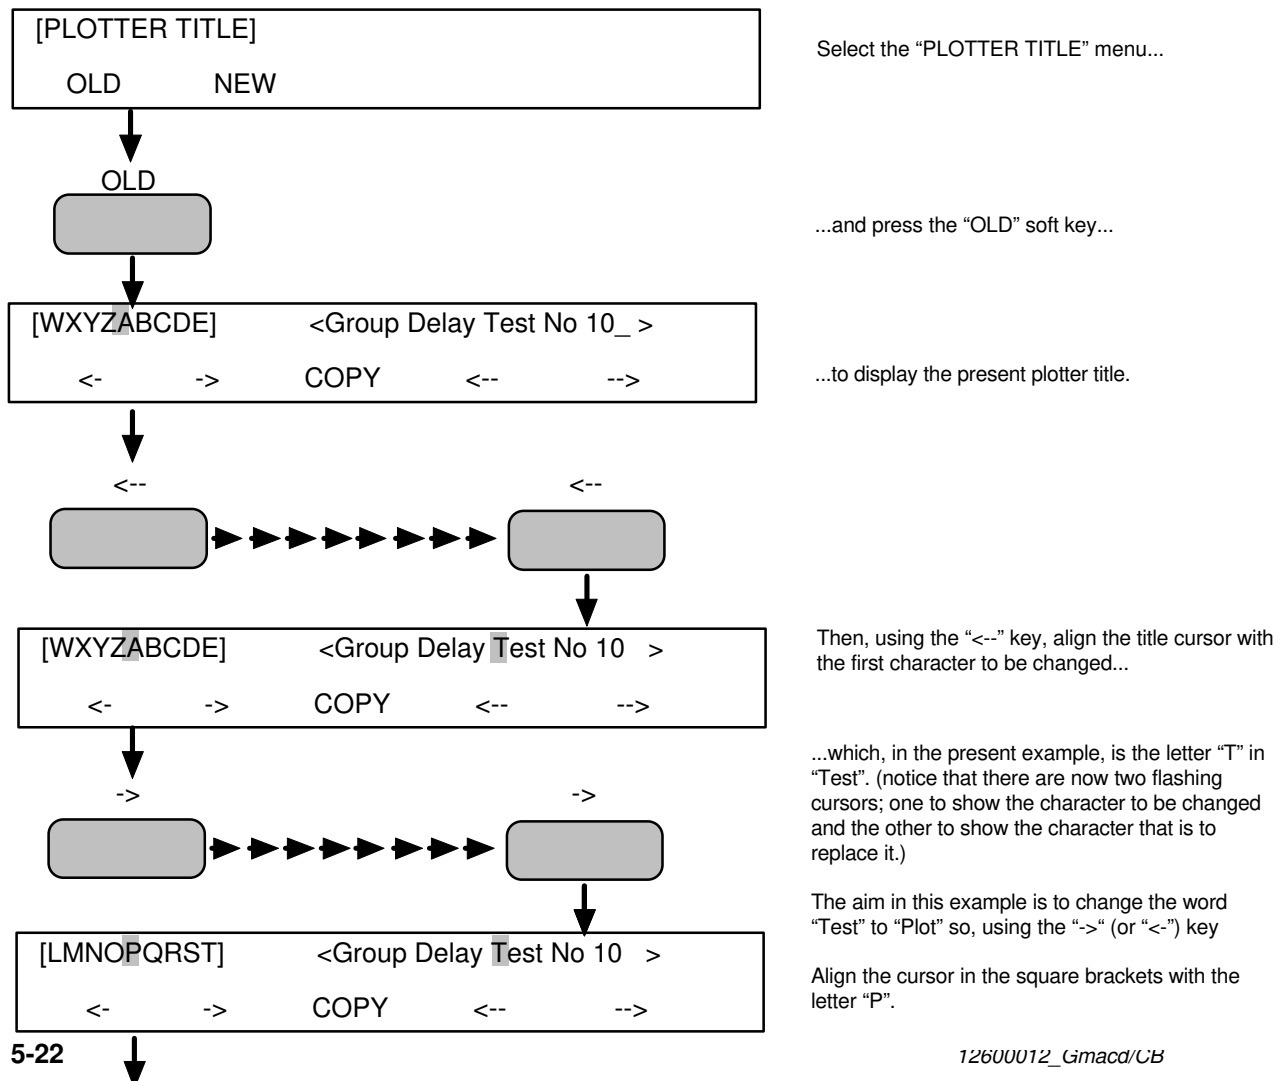

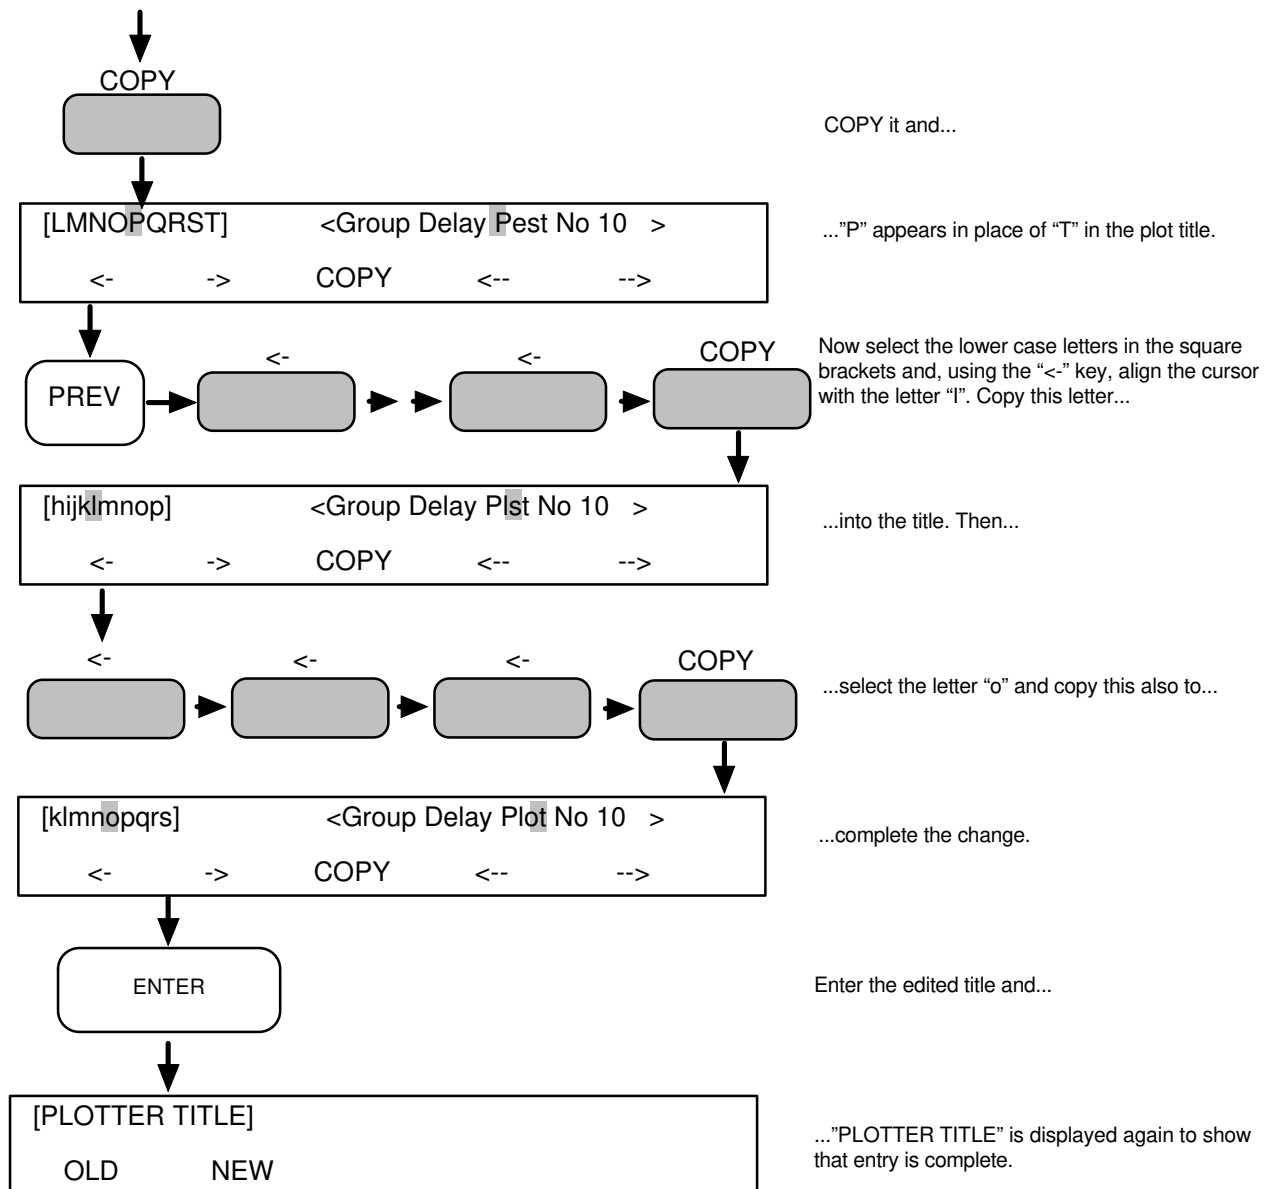

5.6 PLOT

Direct action. Outputs data in the history file to the GPIB plotter. The data source and co-ordinates are selected from the DISPLAY menu and scaling values may be selected from SCALE/LIMITS.

The same data can be plotted in many different ways by varying the PLOTTER AXES settings.

5.7 PLOTTER AXES

The displayed *variable* and the two result parameters, *par 1* and *par 2*, can be assigned individually to any of the plotter axes. The relationship between displayed and plotted results for the default plotter axes settings is shown in Figure 5.10.

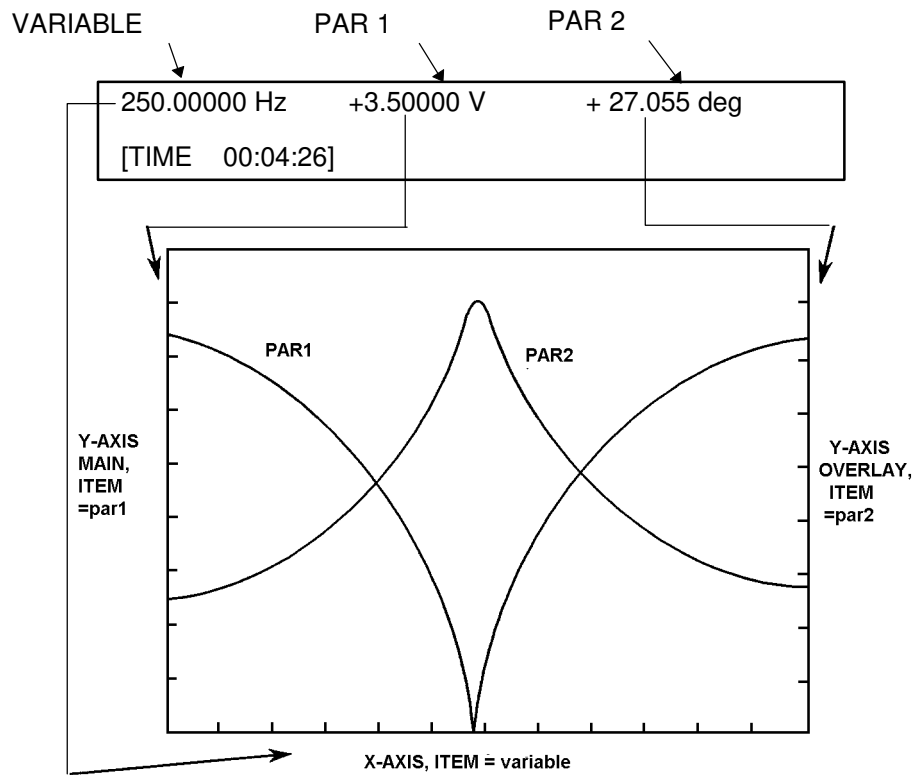


Figure 5.10 - Relationship between displayed and plotted results (default ITEM settings)

5.7.1 [PLOTTER X-AXIS]

X-axis definition, with the control parameters *item*, *limits*, *lin/log*, and *pen*.

5.7.1.1 ITEM

The item to be plotted along the X-axis. Selectable from *variable*, *par 1*, and *par 2*.

5.7.1.2 LIMITS

The minimum and maximum values of the X-axis. These values can be set automatically or manually, as required.

- **[auto]**
Maximum and minimum values of the X-axis are set automatically, in accordance with the minimum and maximum values measured in a sweep. This gives the best plot resolution. (There is a brief delay, during which the plot limits are calculated, before the plot starts.)
- **[manual]**
Maximum and minimum values of the X-axis are set manually.

5.7.1.2.1 MINIMUM and MAXIMUM

These two settings define the full-scale range of an X-coordinate, when LIMITS is set to *manual*. A similar pair of values is defined for the Y-axes and the overall effect is as shown in Figure 5.11.

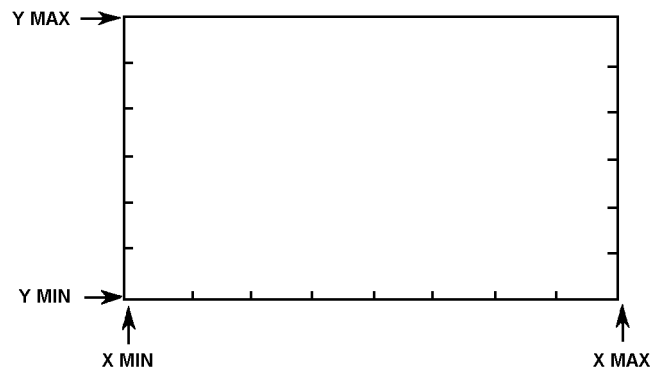


Figure 5.11 - Minimum and maximum values of the plot scale

5.7.1.3 LIN/LOG

Scaling of plotter X-axis.

- **[auto]**
Plotter X-axis scaling set automatically. Log scaling is selected for *log f sweeps*, whilst linear scaling is selected for all other sweeps (including amplitude and bias sweeps).
- **[linear]**
Linear X-axis scaling.
- **[log]**
Logarithmic X-axis scaling. (Note that the limit values must be >0 for log limits to be allowed.)

5.7.1.4 PEN

Pen selection, for multi-pen plotters. A pen number is entered.

5.7.2 [PLOTTER Y-AXIS MAIN]

Same parameters as for X-axis, but applicable to the Y axis.

5.7.3 [PLOTTER Y-AXIS OVERLAY]

Same parameters as for X-axis, except for ITEM and LIMITS, but applicable to the Y overlay axis.

ITEM in the Y-axis overlay menu has an *off* setting. This is selected when the overlay plot is not wanted.

LIMITS in the Y-axis overlay menu has a *same as main* setting. This gives the same limits as for the Y-axis.

5.7.4 PLOT TYPES

The ability to assign any display item to any plot axis allows a wide variety of plot types to be set up.

A *Bode* plot, for example, is obtained with the settings

- DISPLAY [COORDINATES]: [r(dB), θ]
- PLOTTER X-AXIS: [variable]
- PLOTTER Y-AXIS: [par 1]

This gives a Bode plot of amplitude r(dB) against frequency. If ITEM is set to [par 2] in the plotter Y-axis overlay menu an overlaid plot of phase angle θ against frequency is obtained also.

For the same data, a *Nyquist* plot can be obtained with the settings

- DISPLAY [COORDINATES]: [a,b]
- PLOTTER X-AXIS: [par 1]
- PLOTTER Y-AXIS: [par 2]

Examples of typical Bode and Nyquist plots are shown in Figure 5.12.

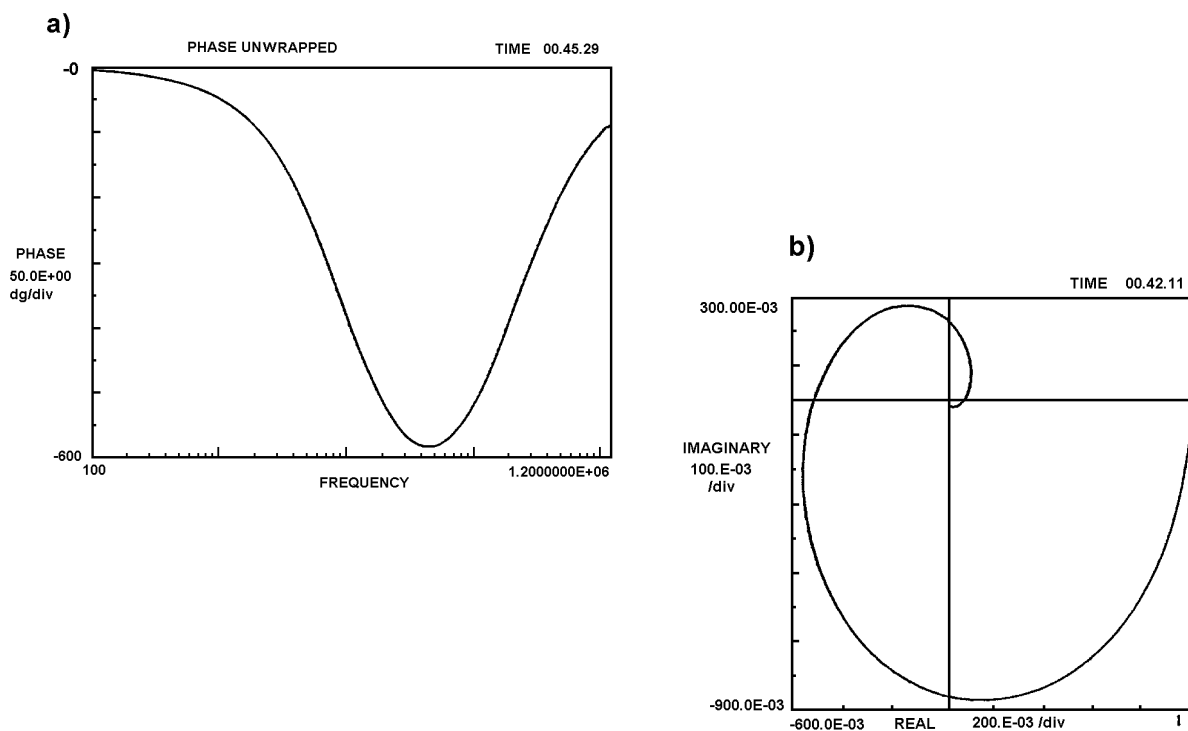


Figure 5.12 - Plot examples: a) Bode plot, b) Nyquist plot

5.8 DATA OUTPUT

DATA OUTPUT selects:

- the data output ports,
- the data to be output, and
- the data format.

5.8.1 [DATA OUTPUT]

As well as being displayed, the measurement results may be output through any combination of the RS423 port, the GPIB port, and the history file.

The data output facilities are listed in Table 5.2. Each output stream may not only be switched *on* or *off*, but can be restricted to data of interest with the *pass* or *fail* settings. The *dump* modes provide compressed data for computers and similar equipment. A [plotter] setting for the GPIB allows data to be output to a plotter as measurements occur.

Table 5.2 Data Output Facilities

Settings Available: RS-423 GPIB FILE			Facility
D	D	➤	[off] No data output.
➤	➤	D	[all] All data are output, but, with LIMITS on, any off-limit data are indicated by 'Hi' and 'Lo'.
➤	➤	➤	[fail] Output restricted to <i>fail</i> data. No data are output if LIMITS is off.
➤	➤	➤	[pass] Output restricted to <i>pass</i> data if LIMITS is on. All data output if LIMITS is off.
➤	➤		[dump] The measurement source data are output in a compressed form, suitable for storage or for computer processing.
➤	➤		[dump all] The analysis data from all input channels, and all variables, <i>frequency</i> , <i>amplitude</i> , and <i>bias</i> , are output in compressed form.
	➤		[plotter] Data are output to the GPIB plotter, as measurements occur. (The plotter limits for this facility <i>must</i> be entered manually, otherwise it will not work.)

D = default setting; ➤ = setting available

5.8.1.1 **HEADING**

Headings can be included in the data that are output to RS423 and the GPIB.

Headings are intended for use with printers and VDUs, when data are presented in tabular form. A heading is assigned to each column to indicate the data type, units, etc.

- **[off]**
No headings are output.
- **[on]**
Headings are output to:
 - a) the RS423 port, if MODE is set for [printer].
 - b) the GPIB port, if Talk Only is selected.Headings are output when:
 - a) HEADING [on] is entered, regardless of whether [on] was selected previously or not,
 - b) a change is made to any control parameter which invalidates existing headings.

5.8.2 **[GPIB CONFIGURE]**

GPIB parameters. (The device address, Talk Only, and the input command terminator are set on a rear panel switch. PAR POLL, P SENSE, and SER POLL are set by remote command only.)

5.8.2.1 **TERM**

Output terminator. The character, or characters, with which each measurement result is terminated:

- **[cr lf]**
Carriage return and line feed.
- **[cr lf + EOI]**
Carriage return, line feed and the signal EOI (end or identify).
- **[cr]**
Carriage return.
- **[cr + EOI]**
Carriage return and EOI.

5.8.2.2 **SEP.**

Output separator. The character with which output data fields are separated:

- **[commal]**
Comma separator.
- **[terminator]**
Separator same as terminator.

5.8.3 [RS423 CONFIGURE]

RS423 parameters. Note that the RS423 port is intended mainly for data output to a printer, VDU, etc. Use it for *limited* remote control of the instrument *only if you are fully conversant with RS423 protocol*.

5.8.3.1 *MODE*

Choice of output data format, for controller or printer:

- **[printer]**
Spaced field format, suitable for printers having a minimum of 80 characters per line.
- **[controller]**
Condensed format, suitable for a controller.

5.8.3.2 *ECHO*

Echoes back to an external device each character received from it. Typically used with keyboard type devices operating from RS423 to obtain a copy of the data sent. Refer to the device handbook to see if an echo is needed or not.

- **[on]**
echo applied.
- **[off]**
echo disabled.

5.8.3.3 *TERM.*

Output terminator. The character, or characters, with which each measurement result is terminated:

- **[cr lf]**
Carriage return and line feed.
- **[cr lf + null]**
Carriage return, line feed and four null characters.
- **[cr]**
Carriage return.
- **[cr + null]**
Carriage return and four null characters.

5.8.3.4 *SEP.*

Output separator. The character with which output data fields are separated:

- **[comma]**
Comma separator.
- **[terminator]**
Separator same as terminator.

5.8.3.5 *XOFF/XON*

Transmit off/transmit on software handshake facility.

- **[enable]**
handshake enabled; XOFF and XON used.
- **[disable]**
handshake disabled; XOFF and XON not used.

This selection governs the use of the XON/XOFF code by the instrument, i.e. whether or not the instrument outputs the command to a device sending data to it.

The instrument will always respond to an XON/XOFF command from a controller.

5.8.4 [FILE CONFIGURE]

History file parameters.

5.8.4.1 *FORMAT*

Measurements to be filed. Specified according to measurement mode.

- **[normal]**
File set for *normal* measurements.
- **[group delay]**
File set for *group delay* measurements.

The history file must be cleared before changing the *format*.

5.8.4.2 *CLEAR*

History file clear function, auto or manual.

- **[auto]**
File cleared automatically, at start of every sweep.
- **[manual]**
File cleared manually, from VIEW FILE menu.

5.8.4.3 *STATS*

The results from which statistics are to be derived:

- **[par 1]**
Statistics computed from Parameter 1*.
- **[par 2]**
Statistics computed from Parameter 2*.

*Displayed parameter, see Section 4, Display.

5.9 SCALE/LIMITS

Under SCALE/LIMITS five functions are available:

- Swept measurements may be *normalized* to separate the results of interest from background data.
- Effect - of stray capacitance and inductance on the measurement results may be compensated for with the *null* facility.
- Individual measurement results may have a user-defined scaling function applied to them. The scaling function, set from the scale/limits menu, is applied when FUNCTION is selected as the display SOURCE; see Section 4.1.2.
- A limits check may be applied, which compares each measurement result against user-defined limits. This facility and *normalize* may be used together, for a profiled limits check.
- Electrical components may be sorted.

5.9.1 [SCALING]

On/off control of NORMALIZE and NULL, and selection of CONSTANTS and FUNCTION for measurement scaling.

5.9.1.1 *NORM.**

Normalize on/off/evaluate:

- **[off]**
Normalize not applied.
- **[on]**
The measurement results are divided by normalize values, the normalize values having been previously evaluated.
- **[evaluate]**
First set up the sweep parameters and then enter [evaluate]. A sweep is actioned and the normalize values thus obtained are stored. On completion, [on] is selected automatically and the results from any further sweeps are divided by the normalize values.

Changing the sweep parameters after evaluate has been entered invalidates the normalize values. Commanding a sweep with normalize [on] then evokes the message, "29. RENORMALIZE", until [evaluate] is entered again.

Note that the maximum number of points/sweep selectable for normalize [on] or [evaluate] is 243 for the normal analyzer mode and 192 for group delay.

* DATA O/P: FILE CONFIGURE CLEAR must be in [auto] mode when normalize [on] or [evaluate] is used.

5.9.1.2 *NULL**

Null on/off/evaluate:

- **[off]**
Null not applied.
- **[on]**
Effect of stray inductance and capacitance on measurement results is removed in accordance with previously evaluated null values.
- **[evaluate]**
Starts the null procedure, which is:
 1. In accordance with the displayed message, insert a shorting bar.
 2. Press the PAUSE/CONT key.
 3. Wait for the message "Remove shorting bar." then do so.
 4. Press the PAUSE/CONT key.

When nulling is complete NULL is set to [on] automatically.

Nulling may be used with either single-point -or sweep measurements. Set the input and sweep parameters before selecting [evaluate].

Whilst the null values are being evaluated some of the generator and analyzer control parameters are set temporarily to settings which may differ from those selected by the user. However, a return is made to the user-defined settings when null evaluation is complete.

* DATA O/P: FILE CONFIGURE CLEAR must be in [auto] mode when null [on] or [evaluate] is used.

5.9.1.3 *CONSTS*

Nine user-defined constants, for use with scaling facility.

- **[a, b]**
Scaling by Cartesian coordinates.
- **[r, θ]**
Scaling by polar coordinates.

Scaling constants are numbered from 1 to 9 inclusive. This number is entered by the user when CONSTS is selected.

The entry of [a, b] or [r, θ] prompts the entry of user-defined coordinate values.

5.9.1.4 *FUNCT*

User-defined scaling function. Eighteen different functions may be entered, and are numbered by the user on entry. Functions 1 to 9 are stored in the battery sustained memory and functions 10 to 18 are stored in the non-volatile memory.

New functions are *learnt*. Previously entered functions no longer needed may be *cleared*.

The use of the scaling function is described in detail in Chapter 10, "Measurement Scaling".

LEARN displays a choice of variables and operators which the user may use to build up a scaling function. To ensure correct syntax, only valid choices are shown.

CLEAR deletes the specified function, ready for the entry of a new function under the same number.

5.9.1.5 *DEV Δ*

Computes the deviation of the present result from a stored result.

- **[off]**
Deviation facility not selected.
- **[Δ]**
You are invited to enter the number of a stored result. When this is done the display shows, for each measured result, the difference between the result and the stored value. An asterisk (*) is displayed also, to show that the displayed value is not the measured result.
- **[Δ%]**
Same procedure as for [Δ]. With the [Δ%] setting, however, the difference between stored and measured results is expressed as a percentage value.

5.9.2 **[LIMITS]**

Displayed parameter limits check.

ITEM Parameter to be checked:

- **[par 1]**
Parameter 1.
- **[par 2]**
Parameter 2.

Parameter 1 and Parameter 2 are the coordinates of the displayed measurement result. (See Section 4.)

LIMITS The LOWER LIMIT and the UPPER LIMIT against which the selected parameter is to be checked.

5.9.3 **[BINSORT A]**

Note: *The Binsort option is no longer available from Solartron. This section is retained for reference only.*

The [BINSORT A] menu allows you to choose:

- the sorting method, *continuous*, *fixed count*, or *random*,
- the item to be sorted,
- the number of the tolerance bands, or *bins*,
- when to stop the sort.

Continued overleaf....

5.9.3.1 **ENABLE**

The sorting method. This may be chosen from:

- **[off]**
No sorting done.
- **[continuous]**
Every component sorted.
- **[fixed count]**
Every n th component sorted. (n = STEP SIZE.)
- **[random]**
Random sort, within a maximum step size.

5.9.3.2 **ITEM**

The display parameter sorted.

- **[par1]**
Parameter 1 sorted.
- **[par2]**
Parameter 2 sorted.

On entry of the display parameter setting you are invited to enter the *parameter value*. This is the nominal value to which the tolerance values, specified under BINS, refer.

5.9.3.3 **BINS**

First you specify the number of bins into which the components are to be sorted. Then, for each bin, you define the MIN% and MAX% tolerance values, each of which refers to the parameter value entered under ITEM. A physical set of component bins may be used to store the components as their corresponding bin number is displayed.

5.9.3.4 **STOP**

Defined conditions for stopping test.

- **[off]**
Test stopped only when ENABLE [off] is selected.
- **[on]**
Measurements stopped after a number of tests have been made. This number is defined by the user.

5.9.4 **[BINSORT B]**

Note: The Binsort option is no longer available from Solartron. This section is retained for reference only.

The [BINSORT B] menu allows you to choose the parameters for operating a component test machine. These are:

- the number of attempts to be made to get a “pass” result.
- the machine drive levels,
- the machine drive logic.

5.9.4.1 RETRY

Enter the maximum number of times each component is to be measured in an attempt to obtain a pass result.

5.9.4.2 LEVELS

The voltage levels required to drive the component test machine.

- **[+5V]**
Drive levels are +5V and 0V.
- **[+18V]**
Drive levels are +18V and 0V.

5.9.4.3 LOGIC

The logic sense required to drive the component test machine.

- **[negative]**
Negative logic, i.e. 0V = '1' and +5V (or + 18V) = '0'.
- **[positive]**
Positive logic, i.e. 0V = '0' and +5V (or +18V) = '1'.

5.9.5 BINSORT FUNCTIONS

Note: *The Binsort option is no longer available from Solartron. This section is retained for reference only.*

To perform the functions defined under BINSORT A and BINSORT B the instrument must be fitted with the binsort option card. The following hierarchy of binsort functions is then available:

SWEEP With a sweep enabled, each component tested is subjected to a sweep and the bin selected is related to the worst case result. In this mode a SINGLE command results in a single sweep and a RECYCLE command results in repeated sweeps. This function encompasses the LIMIT and NORMAL functions described below.

LIMIT A limit check can be selected for one display parameter whilst the other parameter is used for sorting. A fail result from the limits check fails the component, regardless of the binsort result. The LIMIT function encompasses the NORMAL function described below.

NORMAL A binsort check is applied to each measurement result, for a selected number of "bins" (32 max.). Each bin corresponds to a specified tolerance band.

The value of the displayed parameter to be sorted is compared with the bin limits (which define the tolerance bands) and the number of the bin whose tolerance fits the sorted parameter is displayed. Also, an appropriate bin select line is asserted: this may be used to energise the appropriate trap on a mechanical binsorter or, with manual sorting, to illuminate a lamp on the appropriate acceptor bin.

If the value of the sorted parameter is outside all specified tolerance bands then "99" is displayed to signify that the component has failed. The identity of the bin select line asserted is one greater than that of the number of bins. This line may be used to energise the fail trap on a mechanical sorter or, with manual sorting, to illuminate the fail bin.

5.9.5.1 BINSORT CONNECTIONS

The way to connect the instrument to a mechanical binsorter will be described in the binsorter manual.

Nulling with a binsorter should be done at the component test contacts.

5.9.5.2 EFFECT OF "BREAK" COMMAND

If "break" is commanded during a binsort the instrument remembers the point at which it was stopped and restarts from that point. The "stop on" value* which is displayed on sort completion includes the number of tests made before break was commanded.

*Number of components tested, see Section 9.3.4.

5.9.6 PROGRAM KEYSWITCH

The setting of the PROGRAM keyswitch on the rear panel determines the use of the non-volatile memory for scaling functions (see Section 9.1.4). Two switch positions are used:

- | | |
|---------------|--|
| a) SUPERVISOR | A scaling function may be stored in, or recalled from, any location, from 1 through 18. All locations may be cleared. In SUPERVISOR mode the instrument takes several seconds to initialize. |
| b) NORMAL | A scaling function may be recalled from any location, but may be stored only in locations 1 through 9. Only locations 1 through 9 may be cleared. |
| c) OPERATOR | Reserved for future use. |

To set the instrument into the supervisor or normal mode, turn the key to the appropriate position and command "BREAK".

To protect the contents of the non-volatile memory, operate the instrument in the normal mode whenever possible.

5.10 VIEW FILE

VIEW FILE acts on the basic measurement data stored in the history file. The form of the output results is selected from the DISPLAY menu (see Section 4).

5.10.1 [VIEW FILE]

DISPLAY Displays file location #1. Use the [DISPLAY FILE] menu to go to other file locations.

LIST On entry, each file location is output in quick succession. This facility is intended for sending filed data to an external device, via RS423 or the GPIB.

LIST may also be used for updating the statistics readings: see Section 12.2.4.

CLEAR Erases the file contents and displays '40. FILE CLEARED'.

5.10.2 [DISPLAY FILE]

When DISPLAY is selected, in the [VIEW FILE] menu, file location #1 is displayed. Other file locations are accessed as follows:

- **BOF**
Beginning of file. (Location 1)
- **EOF**
End of file. (The highest numbered location containing a result)
- **NEXT**
Next location. (Location $n + 1$)
- **PREV**
Previous location. (Location $n - 1$)
- **LINE**
Location n .

5.10.3 FILE SIZE

The number of results that the history file will hold depends on which analyzer mode is in use, *normal* or *group delay*, and on whether or not *null* or *normalise* is selected (from the SCALING menu). See Table 5.3.

Table 5.3 Size of History File

Null/Normalize	Storage Space Available	
	Normal	Group Delay
Null off; normalize off	405 results	331 results
Null on; normalize off	280 results	243 results
Null off; normalize on	243 results	192 results

5.11 VERNIER


Use VERNIER to adjust the generator output, whether measurements are being made or not.

VERNIER can also be used to adjust the size of the plotting field, whilst watching the pen movement.

5.11.1 ADJUSTING GENERATOR PARAMETERS: FREQ, AMPL, OR BIAS

The generator parameter on which the vernier is to act is selected from the first menu page.


The selected parameter is displayed on entry, together with the vernier soft key functions. The format of the display depends on whether or not measurements are being made:

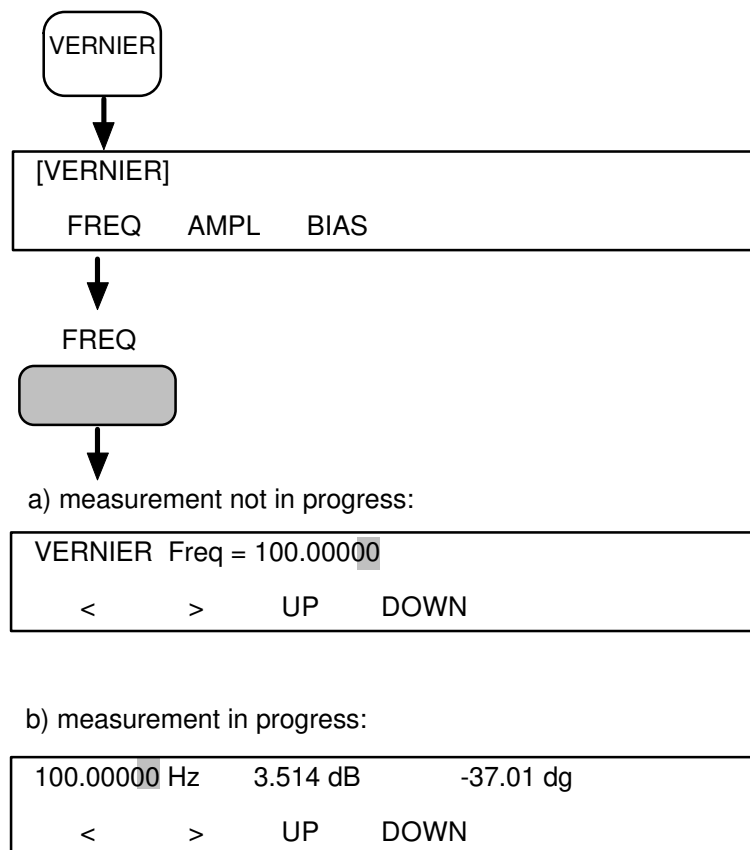


In case b) the generator parameter selected from the [VERNIER] menu is automatically selected as the displayed *variable*. In both cases, the selected parameter is adjusted as described in Sections 11.3 and 11.4.

5.11.2 ADJUSTING PLOTTER SCALING

Plotter scaling can be adjusted with the second [VERNIER] menu, which is selected with the NEXT key. (For this facility to work, [plotter] must be selected for the data output to the GPIB; see Section 8.1, in the present chapter.)

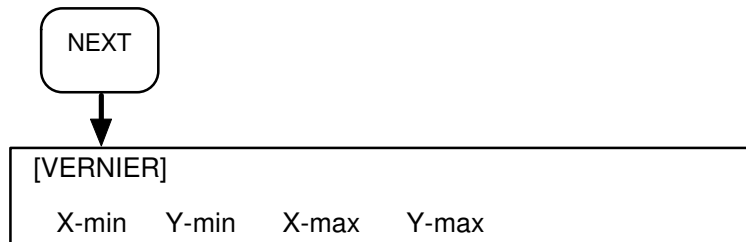

Pressing a soft key, for X-min, Y-min, X-max, or Y-max, displays the previously entered value. This value can be adjusted with the arrow keys and up/down keys, whilst watching the pen movement. See Sections 11.3 and 11.4 below.

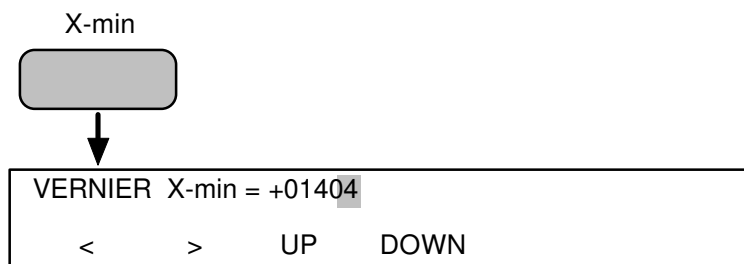

5.11.3 VERNIER DECADE

The decade on which VERNIER is to act is indicated by a flashing cursor. Set the cursor position with the arrow keys:

- < Moves cursor one place to the left.
- > Moves cursor one place to the right.

5.11.4 VERNIER ADJUSTMENT

Adjust the selected parameter with the UP and DOWN keys:

- UP Increments the parameter value by one digit.
- DOWN Decrements the parameter value by one digit.

Sustained pressure on either key gives continuous parameter adjustment.

5.11.5 REMOTE CONTROL OF THE VERNIER

Vernier control of the generator parameters *frequency*, *amplitude* and *bias* is selected with the commands V0, V1 and V2. In reply to each of these commands the instrument outputs the present parameter value. The controller can then use the step vernier command *SPF* to increment or decrement the value accordingly.

Vernier control of the plotter scaling values X-MIN, Y-MIN, X-MAX and Y-MAX is selected with the commands V3, V4, V5 and V6. In reply to each of these commands the instrument outputs the present parameter value followed by three strings of instructions, coded in HPGL. The controller uses the HPGL instructions to relay the parameter value, modified as necessary, to the plotter.

5.12 STATUS

The STATUS pages display control information not accessible under other control keys. Two leader pages [STATUS 1] and [STATUS 2] display the information sources; each source has available several pages of information. Pages are selected with NEXT and PREV. To return from an information page to a leader page, press ENTER.

5.12.1 [STATUS 1]


The Status 1 information appears under five headings:

- a) PROGRAM Learnt program memory.
- b) μ P Microprocessor mode.
- c) INTERFACE GPIB and RS423 data ports.
- d) STORE Control set-up store.
- e) FILE History file.

5.12.1.1 PROGRAM

Learnt program status. (Three pages)

Page 1: Capacity and Availability of Program Memory

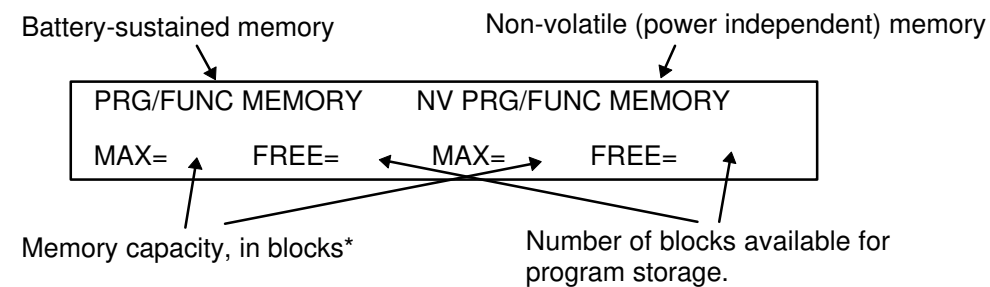

* Each block holds one instruction

Page 2: Program Slots In Use in Battery-Sustained Memory

Numbered program slots									
PROGRAM	1	2	3	4	5	6	7	8	9
LEARNT	P	P	P						

P=program learnt.

Page 3: Program Slots In Use in Non-Volatile Program Memory


Numbered program slots									
PROGRAM	10	11	12	13	14	15	16	17	18
LEARNT	P	P							

P=program learnt.

5.12.1.2 μP


Microprocessor status. (Two pages.)

Page 1: Microprocessor Operation

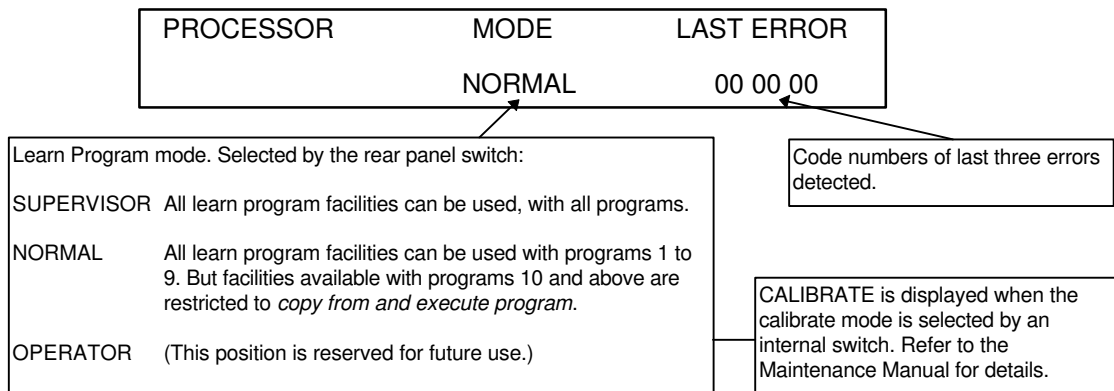

Page 2: Permitted range of last entered control parameter

The values displayed are the upper and lower limits of the range. For example, after the entry of a frequency value this page would show:

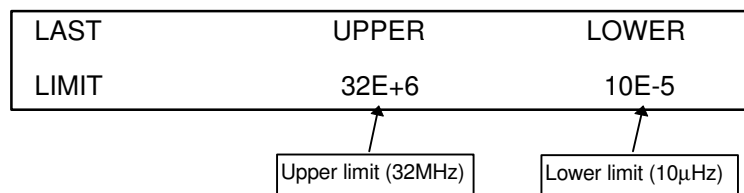


5.12.1.3 INT.FACE

GPIB and RS 423 status. (Three pages.)


Page 1: GPIB Status

Talker/listener mode, operating state, and device address:

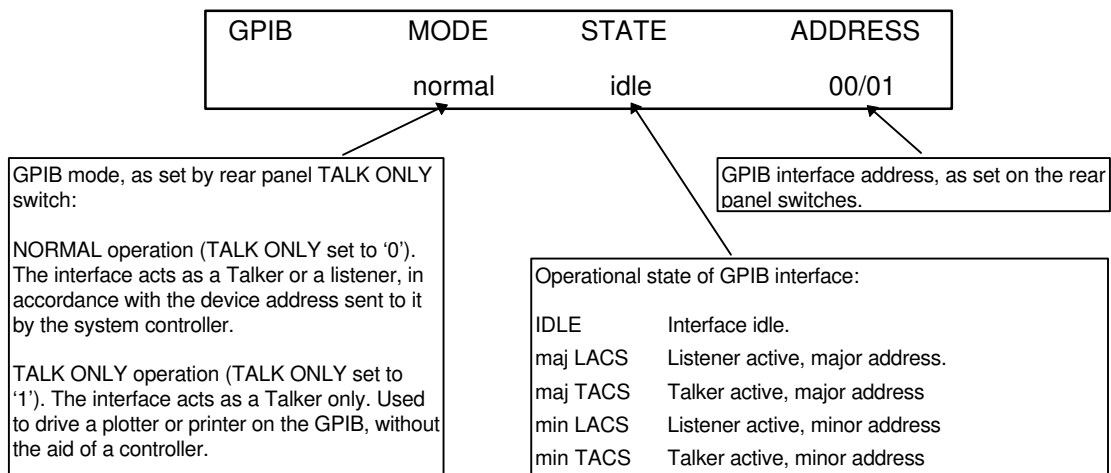


Page 2: GPIB status

Serial poll byte, parallel poll identity and sense, and control state:

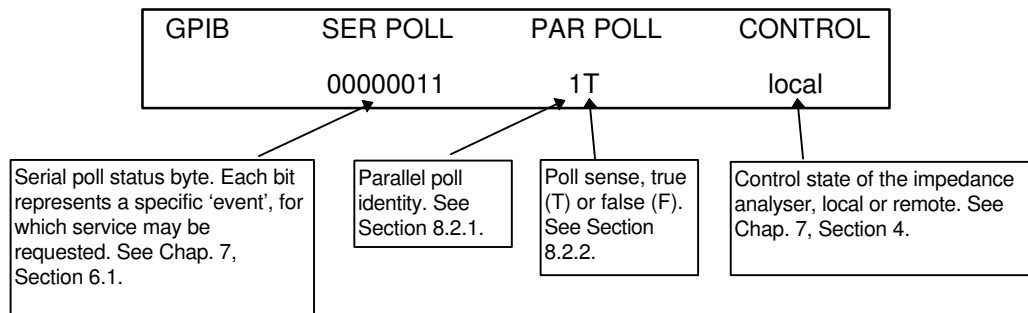**Page 3: RS423 Status**

Baud rate:

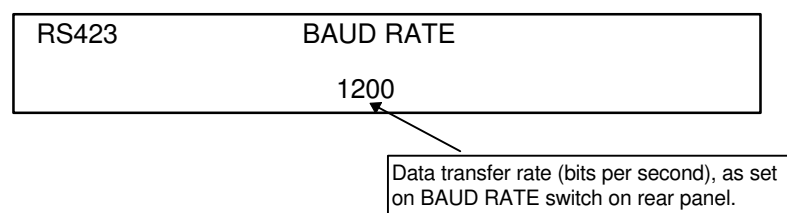**5.12.1.4 STORE**

Set-up stores in use. (Two pages.)

Page 1: Control set-ups Stored in Battery-Sustained Memory

Set-up stores									
SET-UPS	1	2	3	4	5	6	7	8	9
STORED	S	S	S						

S = set-up stored

Page 2: Control set-ups Stored in Non-Volatile Memory

Set-up stores							
NV SET-UPS	10	11	12	13	14	15	16
STORED	S	S					


S = set-up stored

5.12.1.5 FILE

History file status. (Two pages)


Page 1: File Summary

Number of measurements made, accepted (passed limits test) and filed:

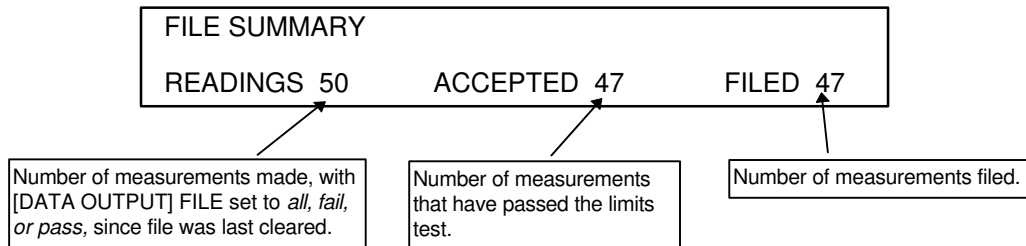

Page 2: File Memory

Capacity and availability of history file:

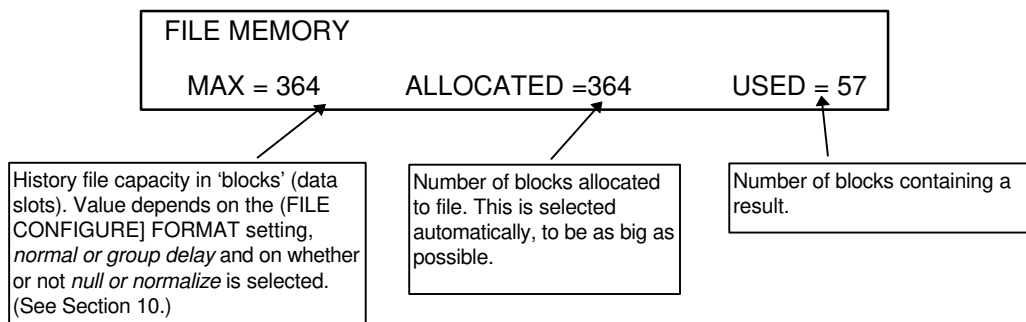

5.12.2 [STATUS 2]

The Status 2 information appears under four headings:

- | | |
|-------------|--------------------|
| a) FUNCTION | Scaling functions. |
| b) CONST | Scaling constants. |
| c) RESULTS | Stored results. |
| d) STATS | Statistics. |

5.12.2.1 FUNCTION

Scaling function slots in use, and functions stored. (Twenty pages)

Page 1: Function Slots In Use in Battery-Sustained Memory

	Numbered function slots								
FUNCTION	1	2	3	4	5	6	7	8	9
LEARNT	F		F						

F = function learnt

Page 2: Function Slots In Use in Non-Volatile Program Memory

Numbered function slots										
NV FUNCTION	10	11	12	13	14	15	16	17	18	
LEARNT			F		F					

F = function learnt

Page 3 to 20: Function stored

FUNCTION 1
V! ²

5.12.2.2 CONST

Scaling constant stores in use, and constants stored. (Ten pages.)

Numbered constant slots									
CONSTANT	1	2	3	4	5	6	7	8	9
ENTERED	C		C						

C = constant entered.

Pages 2 to 10: Constants Stored in Battery-Sustained Memory

CONSTANT 1	a	b
	+1.35	-0.275

Constant stored

5.12.2.3 RESULTS

Results stores in use, and results stored. (Ten pages.)

Page 1: Results Stored in Battery-Sustained Memory

Result stores									
RESULT	1	2	3	4	5	6	7	8	9
STORED	R		R						

R = result stored

Page 2: Stored Results

RESULT STORE 1	g. delay = 5.3479ns
a = 13.567	b = 1.259

5.12.2.4 STATS

Statistics of measurements stored in history file. (Two pages)

MEAN	MINIMUM	MAXIMUM
------	---------	---------

COUNT	STANDARD DEV	VARIANCE
-------	--------------	----------

The results from which the statistics are to be derived are selected as *Par 1* or *Par 2*, from *STATS* in the *FILE CONFIGURE* menu. *Par 1* and *Par 2* are the displayed parameters, which, in turn, are selected from the *DISPLAY* menu.

The statistics computed are the minimum and maximum values, the result count, i.e. the sample size n , and

$$MEAN = \sum_{i=1}^{i=n} \frac{x^i}{n} = x_{mean}$$

$$VARIANCE = \sum_{i=1}^{i=n} \frac{(x_i - x_{mean})^2}{n}$$

$$STANDARD\ DEV = \sqrt{\left(\sum_{i=1}^{i=n} \frac{(x_i - x_{mean})^2}{n} \right)}$$

To ensure that the statistics are meaningful and accurate:

1. CLEAR the history file, from the VIEW FILE menu.
2. Make a series of measurements, ensuring they are stored in the history file.
3. Select the parameter from which the statistics are to be derived, from the DISPLAY and FILE CONFIGURE menus.
4. LIST the filed results, from the VIEW FILE menu.
5. Read the statistics from the STATS pages shown above.

To derive the statistics of other parameters from the same measurements, repeat steps 3 through 5.

5.13 STORE/RECALL

Control set-ups, and measurement results, can be stored in memory for later use.

5.13.1 [SET UP]

Sixteen locations are available for control set-ups.

Control set-up action:

- STORE** Stores the present settings of all control parameters, in any free location from 1 through 16. (Stores 10 and 16 are in non-volatile (NV) memory.)
- RECALL** Sets the control parameters in accordance with the contents of the specified store.
- CLEAR** Clears the specified store.

5.13.2 [RESULT]

Nine locations are available for measurement results.

Result storage is all that needs to be commanded. The stored values are used by FUNCTION in the [SCALE/LIMITS] menu (see Chapter 10) and are recalled automatically when scaling by a stored value is specified.

- STORE** Stores the displayed result (derived from the last measurement or from filed data) in any free location from 1 to 9.

5.13.3 PROGRAM KEYSWITCH

The setting of the PROGRAM keyswitch on the rear panel determines the use of non-volatile memory for control set-ups and measurement results. Two switch positions are used:

- a) **SUPERVISOR** Control settings may be stored in, or recalled from, any location, from 1 through 16. All locations may be cleared.
- b) **NORMAL** Control settings may be recalled from any location, but may be stored only in locations 1 through 9. Only locations 1 through 9 may be cleared.
- c) **OPERATOR** Reserved for future use.

To set the instrument into the supervisor or normal mode, turn the key to the appropriate position and command "BREAK".

To protect the contents of the non-volatile memory, operate the instrument in the normal mode whenever possible.

5.14 LEARN PROGRAM

LEARN PROGRAM allows the instrument to be programmed with a series of commands. A maximum of eighteen separate programs can be stored, and each is started from EXECUTE PROGRAM. See program STATUS (Section 12.1) for memory availability.

5.14.1 LEARN

Sets the instrument to memorize the commands. First enter a program number. Then, each command entered is stored as a program instruction.

NV programs can not be learnt directly. Learn a program in the range 1 to 9 and then copy it to an NV program 10 to 18.

QUIT When program entry is complete press QUIT.

5.14.2 EDIT

Allows a learnt program to be modified. First enter the program number. The first program instruction is then displayed and the following functions become available:

INSERT Allows one or more instructions to be inserted between the displayed instruction and the instruction before it. Select the instruction you want displayed, with PREV or NEXT. To return to the edit level (as selected by the EDIT hard key) press the EDIT soft key.

DELETE Deletes the displayed instruction. Select displayed instruction with PREV or NEXT.

NEXT Selects and displays the next instruction.

PREV Selects and displays the previous instruction.

QUIT When editing is complete press QUIT.

To edit an NV program, copy it to program 1 to 9, edit it, clear the original NV program, and then copy the edited program back again.

5.14.3 CLEAR

Deletes the instructions stored under a selected program number. The number is then available for a new program.

5.14.4 COPY

Provides a complete copy of a selected program under another program number. Used with EDIT, this facility allows one program to be derived from another.

5.14.5 PROGRAM KEYSWITCH

The setting of the PROGRAM keyswitch on the rear panel determines the use of the non-volatile memory for learn programs. Two switch positions are used:

- a) SUPERVISOR Learn programs may be stored in, or recalled from, any location, from 1 through 18. All locations may be cleared.
- b) NORMAL Learn programs may be recalled from any location, but may be stored only in locations 1 through 9. Only locations 1 through 9 may be cleared.
- c) OPERATOR Reserved for future use.

To set the instrument into the supervisor or normal mode, turn the key to the appropriate position and command "BREAK".

To protect the contents of the non-volatile memory, operate the instrument in the normal mode whenever possible. In particular, do not switch the instrument on or off when the keyswitch is in 'Supervisor' mode

5.15 SELF TEST

Under SELF TEST, four functions are available:

5.15.1 TEST

Checks the operation of the measurement hardware, the microprocessor, the keyboard, and the display.

On entry, the microprocessor is tested first. Then a test is made on the display.

The first stage of the display test starts immediately, but user action is required to progress through the remaining stages. The test sequence is:

1. Press TEST. All display elements light, and horizontal lines scroll down the display.
2. Press ENTER. Vertical lines run through each character in turn. The display elements light in sequence.
3. Press ENTER. The character set is displayed.
4. Press ENTER. The keyboard test is offered. Press any control key to display the command code associated with it. The number of keys tested in this way is recorded and displayed.
5. Press ENTER. Test complete. A successful test displays a 'PASS' message and the software issue.

If the test was unsuccessful, a test failure message will be displayed. Some errors may be corrected from the front panel, as described below:

PROG. MEMORY FAIL (?TS1 =1) : Try initialising memory.

NV PROG. MEMORY FAIL (?TS1 = 2) : Problem may be caused by turning power off with unit in "Supervisor" mode. Fault can be cleared by pressing "Initialise" with the unit in "Supervisor" mode.

SET-UP FAIL (?TS1 =1) : Try initialising memory.

NVSETUP FAIL (?TS1 = 2) : Problem may be caused by turning power off with unit in "Supervisor" mode. Fault can be cleared by pressing "Initialise" with the unit in "Supervisor" mode.

Once the remedial action has been taken, re-test the instrument using SELF-TEST-Test. If the fault persists, contact your Solartron Service Centre.

5.15.2 INIT

Sets the control parameters to the default state, clears the history file, the result/control stores and learn program memory, and displays 'INITIALIZED'.

CAUTION: The content of the non-volatile stores and program memory is cleared if the PROGRAM keyswitch is set to SUPERVISOR when INIT(ialize) is commanded. In this case initialise takes several seconds.

5.15.3 RESET

Sets the control parameters to the default state and displays 'RESET'. The data in user-accessible memory are left intact.

5.15.4 TIME

The internal clock stops whenever power is switched off and restarts from zero when power is restored, on *reset*, or *initialize*. Use TIME to set the clock. Enter HOURS first, then MINUTES.

5.15.5 ERROR-

Beep tone that draws attention to a displayed 'error' message.

[on] Beep tone sounds briefly when message is -displayed.
[off] Beep tone off.

6

Measurement Connections

Section	Page
6.1 Introduction	6.3
6.2 Analyzer Input Configurations	6.3
6.2.1 Single-ended Inputs	6.3
6.2.2 Differential Inputs	6.4
6.3 High Frequency Measurements	6.5
6.4 Equivalent Circuits	6.6
6.5 Basic Connections for In-circuit Impedance Measurements	6.7
6.5.1 Cable Lengths	6.7
6.6 The Test Modules	6.8
6.6.1 12601A Component Test Module	6.8
6.6.1.1 Component Clamps	6.8
6.6.1.2 Fitting and Removing the Test Module	6.9
6.6.1.3 Test Module Connections	6.9
6.6.2 12603A In-Circuit Test Module	6.10

6.1 INTRODUCTION

Connections to the item under test are made from BNC sockets on the instrument front panel. The GENERATOR output is connected to the input of the item under test, and three input channels, VOLTAGE 1, VOLTAGE 2, and CURRENT, are available for measuring the test response.

Connections can be made directly to the front panel connectors, using suitably terminated screened leads. Or, for impedance measurements, connections can be made via a test module which fits over the connectors.

6.2 ANALYZER VOLTAGE INPUT CONFIGURATIONS

A menu of input configurations, available under the ANALYZER hard key, allows the analyzer inputs to be configured independently for single-ended or differential measurements, with the outer (screen) of the input leads grounded or floating. The connections and input configurations for typical applications are shown in Sections 2.1 and 2.2.

6.2.1 SINGLE-ENDED VOLTAGE INPUTS

Single-ended inputs may be used where the signals to be measured are referred to a general ground, such as the main chassis of the item under test. A typical application is shown in Fig. 6.1. The connections shown will allow the combined performance of amplifiers A1 and A2 to be measured. Alternatively, INPUT V1 Hi could be connected to test point TP2 to measure amplifier A2 only, or INPUT V2 Hi could be connected to TP2 to measure amplifier A1 only.

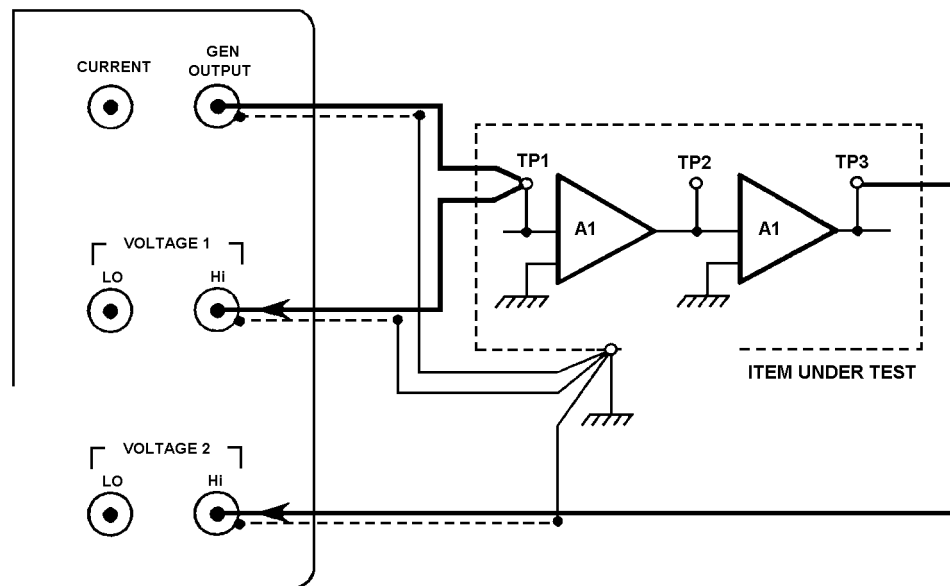


Figure 6.1 - Typical use of single-ended voltage inputs

The connections made at the analyzer input for single-ended inputs, floating or grounded screen, are shown in Figure 6.2. These connections are made within the instrument and are selected from the INPUT V1 and INPUT V2 menu pages.

A floating screen can accommodate a limited common mode signal from the item under test.

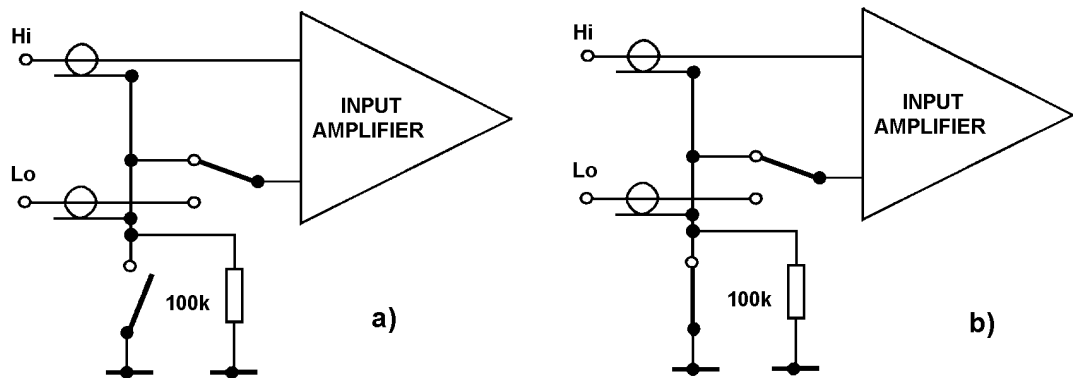


Figure 6.2 - Single-ended input configuration, with a) floating screen and b) grounded screen

6.2.2 DIFFERENTIAL VOLTAGE INPUTS

Differential inputs may be used where the signal to be measured has a reference point separate from the general ground. Such signals could appear:

- a) across an individual component or
- b) between a test point and signal ground, as in the example shown in Figure 6.3.

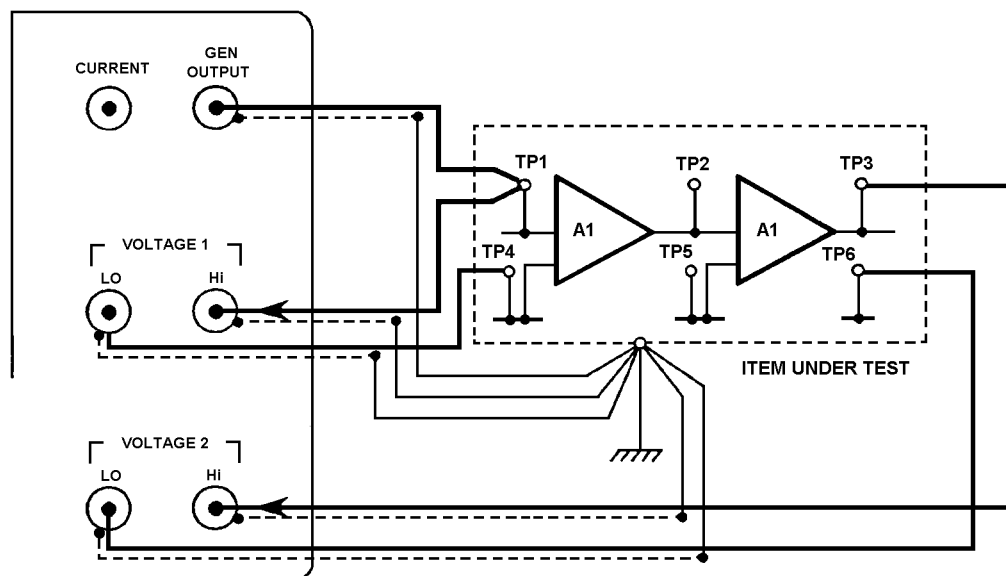


Figure 6.3 - Typical use of differential voltage inputs

The analyzer inputs will tolerate a common mode signal of up to 5V. In the above example this would appear between test points TP4, 5, and 6, and the general ground.

The generator output has a “floating” Lo (screen) which will tolerate 0.4V of ripple or dc potential from the general ground.

The connections made for differential inputs, floating or grounded screen, are shown in Figure 6.4.

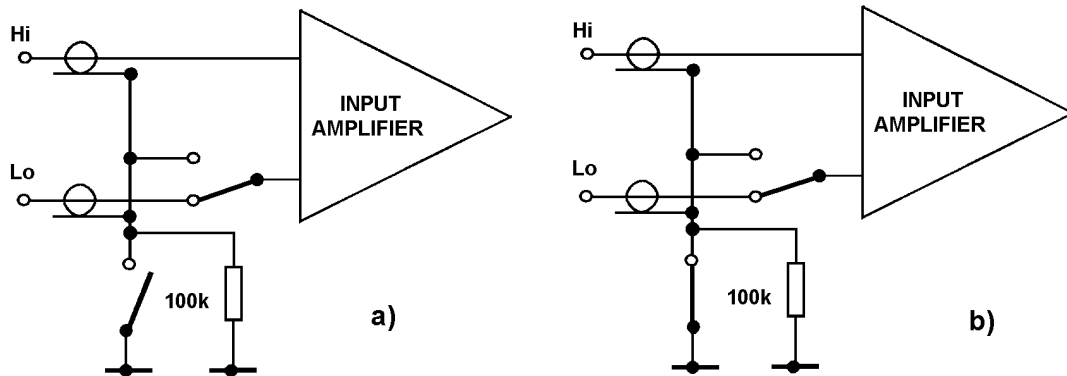


Figure 6.4 - Differential input configuration, with a) floating screen and b) grounded screen

6.3 HIGH FREQUENCY MEASUREMENTS

For drive frequencies in the region of 1MHz and above, care must be taken to match the input and output impedances of the instrument and item under test with the impedance of the connecting cables (50Ω). This is to avoid standing wave problems, which occur when the length of the connecting cables is about a quarter-wavelength of the drive signal frequency.

Inputs are matched to the cable with 50Ω feedthrough terminators. The generator output, when driving a pair of inputs, is connected through a 50 power splitter. A typical application of these devices is shown in Figure 6.5.

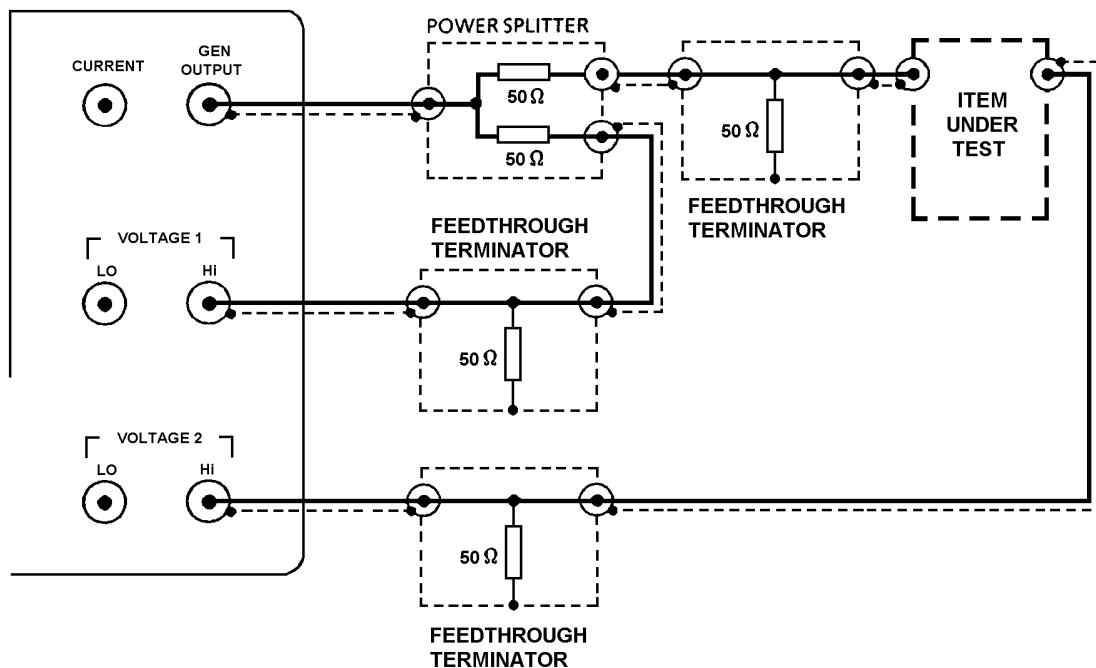


Figure 6.5 - Typical connections for high frequency voltage measurements

6.4 EQUIVALENT CIRCUITS

The equivalent circuits of the generator output and the analyzer inputs are given in Figures 6.6 and 6.7. These may be used when estimating loading effects on a) the item under test and b) the generator output.

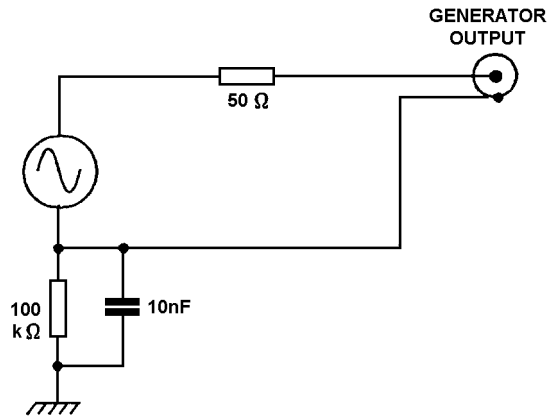


Figure 6.6 - Equivalent circuit of generator output

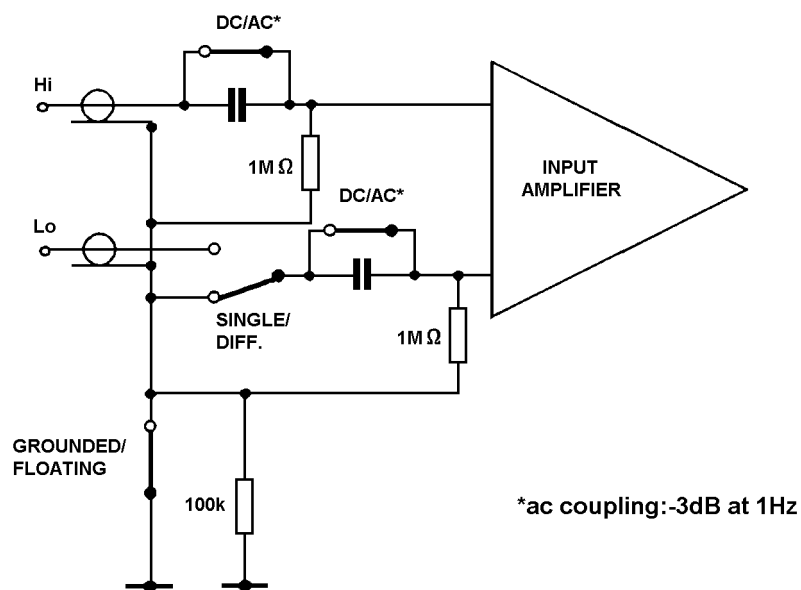


Figure 6.7 - Equivalent circuit of analyzer input

6.5 BASIC CONNECTIONS FOR IN-CIRCUIT IMPEDANCE MEASUREMENTS

The basic connections for in-circuit impedance measurements are shown in figure 6.8. This is intended as a guide when connections are made other than through a test module, e.g. in automatic test systems.

All circuit paths in parallel with the item under test, **which have an external node**, may be excluded from the measurement by virtual earth guarding. Simply connect each node to ground through the screens, as shown in figure 6.8.

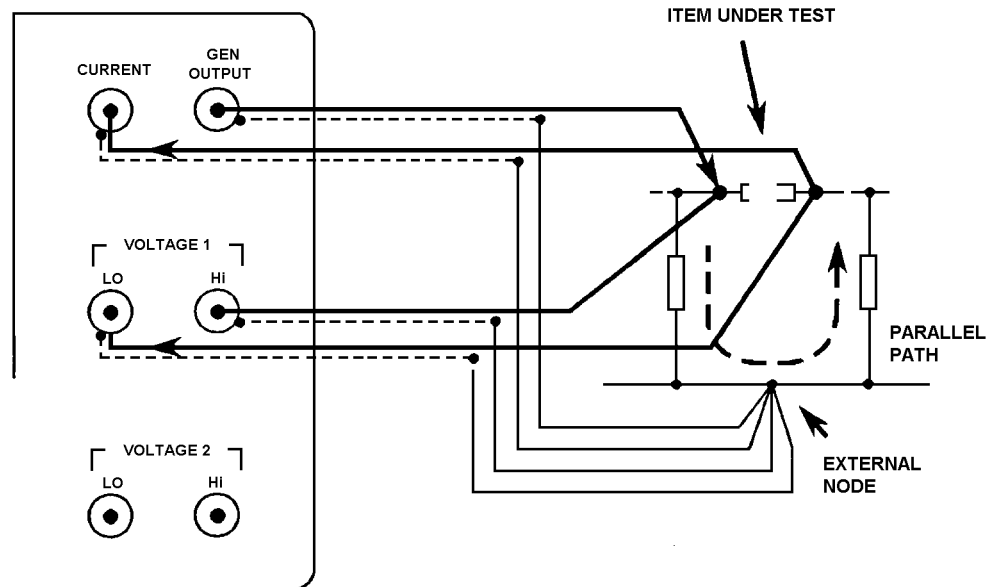


Figure 6.8 - Connections to be made for in-circuit impedance measurements when not using the in-circuit test module

For convenience two modules are available for impedance measurement. The 12603A is for in-circuit measurement, as shown in figure 6.8, while the 12601A is optimised for h.f. measurements on components. See section 6 for details.

6.5.1 CABLE LENGTHS

Accuracy may be degraded by long cable lengths. In particular, capacitance in the CURRENT and VOLTAGE 1 LO inputs will affect current measurement accuracy at h.f. so these cables should be kept as short as possible. Use the high current ranges (6mA or 60mA) above 1MHz as these are less affected.

Best h.f. impedance measurements are obtained using the 12601A Test Module which minimises connection strays.

6.6 THE TEST MODULES


Two types of impedance test module are available: the 12601A module, for testing loose components, and the 12603A module, for measuring components in-circuit. Both types are available as options.

6.6.1 12601A COMPONENT TEST MODULE

The 12601A component test module makes it easy to connect loose components to the instrument front panel terminals.


6.6.1.1 COMPONENT CLAMPS

Two types of component clamps are supplied with the module

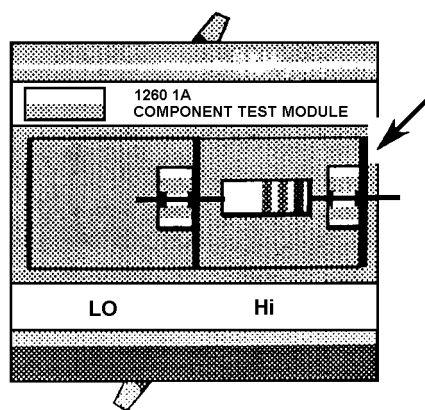


One type of clamp is suitable for components with axial leads. To insert the component under test, simply grasp the leads firmly at either end and push them into the clamps.

Note that the component clamps are labelled HI and LO. These labels refer to the HI and LO connectors of the Voltage 1 analyzer input. As shown in Section 6.1.3, the generator output is applied to the HI side of the item under test. When testing polarized components, make sure that you insert them the right way round. (Remember, the bias can be set either positive or negative.)

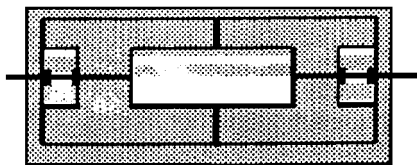


Axial lead component clamps can be inserted into the test module either way round. This allows connections to be made near to the lead entry points on both large and small components and minimizes errors due to lead impedance.

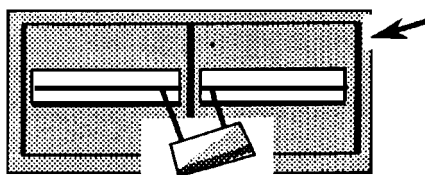


The other type of clamp may be fitted for components with radial leads.

6.6.1.2 FITTING AND REMOVING THE TEST MODULE

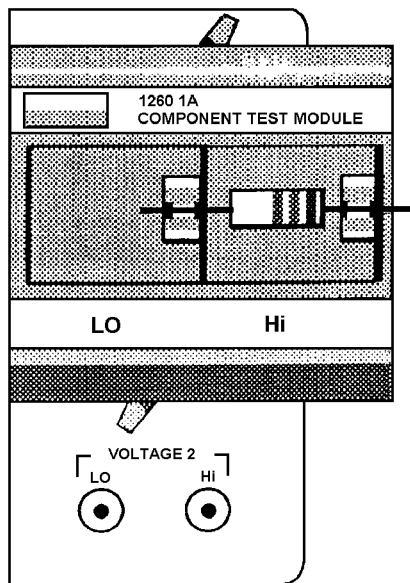


The test module fits onto the four upper BNC terminals on the instrument front panel and is locked onto these by a pair of lever-operated connectors.

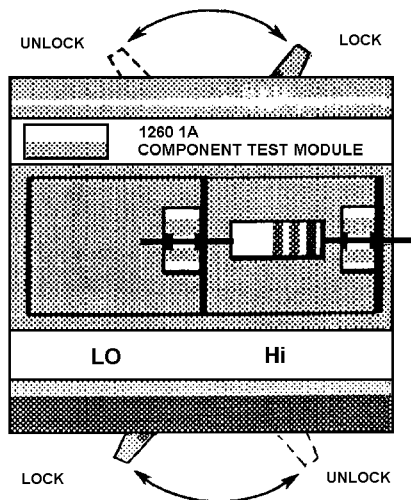

To fit the module, set the levers to UNLOCK, push the module firmly onto the four upper connectors until resistance is met, and set the levers to LOCK.

To remove the module, set the two levers to the UNLOCK position and pull the module carefully away from the front panel connectors.


6.6.2.1 TEST MODULE CONNECTIONS

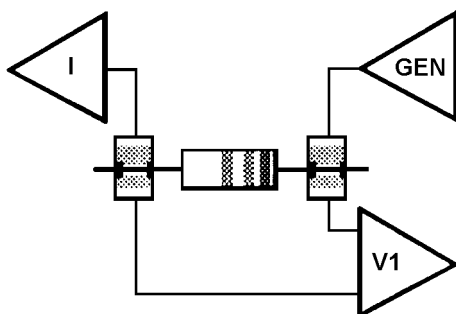

The GEN OUTPUT drives a current through the component under test, into the CURRENT input. A voltage is thus developed across the component and is applied across the Hi and Lo terminals of the VOLTAGE 1 input. Ratios of the current and voltage values measured yield the impedance values.

6.6.3 12603A IN CIRCUIT TEST MODULE

The 12603A test module allows components to be measured in-circuit. The effect of parallel component networks may be eliminated by using *virtual earth* guarding. The 12603A is not recommended for use above 1MHz.

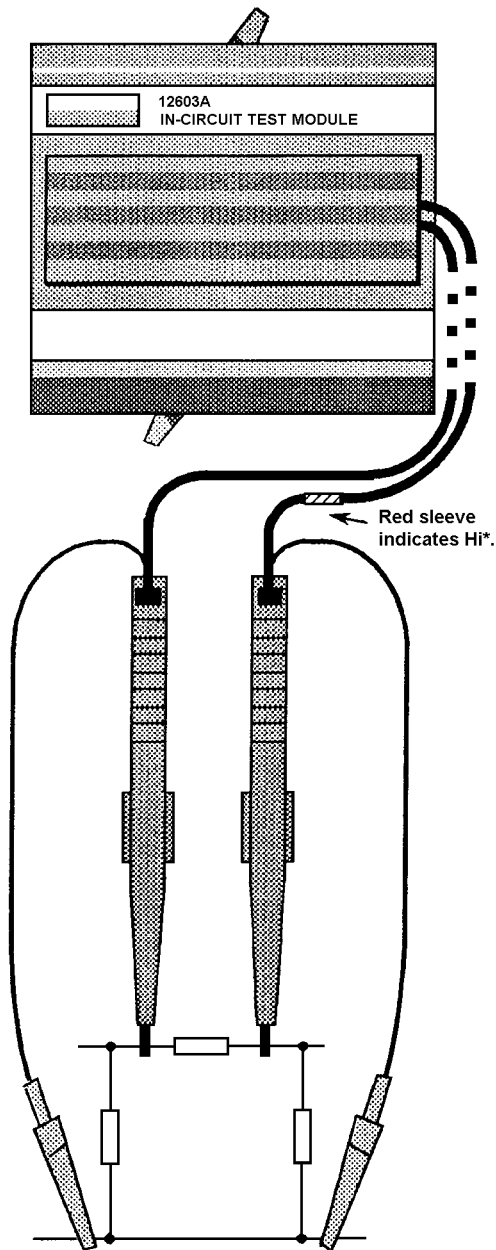

A pair of component clamps on flying leads are fitted on either side of the component to be measured.

Both guard clips are connected to the 'nodes' surrounding the points of measurement. This largely eliminates the effect of parallel networks from the measurement result.

The effect of guarding is, however, frequency dependent. Errors can occur towards the high end of the frequency range, particularly with capacitive parallel networks. The remedy is to reduce the measurement frequency until consistent results are obtained.

Stray impedances that appear across the component to be measured may be nulled. See Chapter 5, Section 5.9.1.2.

*See Section 2.1.1, regarding the testing of polarized components.

*See section 5.2.1.1, regarding the testing of polarized components.

Remote Control: GPIB & RS423

Section	Page
7.1 Introduction	7.3
7.2 GPIB Interface	7.3
7.2.1 GPIB Capability Code	7.3
7.2.2 GPIB Connector	7.3
7.2.3 GPIB Switches	7.4
7.2.3.1 Device Address	7.4
7.2.3.2 Input Command Terminator	7.4
7.2.3.3 Talk Only	7.5
7.2.3.4 Example of GPIB Switch Settings	7.5
7.2.4 Output to the GPIB	7.5
7.2.4.1 ASCII Output to a Talk Only Device	7.6
7.2.4.2 Normal ASCII Output (for Talker-listener Devices)	7.6
7.2.4.3 GPIB Dump Output	7.6
7.2.5 Serial Poll	7.7
7.2.5.1 The Status Byte	7.7
7.2.5.2 Service Request Enable	7.8
7.2.5.3 Assigning Error Events	7.9
7.2.6 Parallel Poll	7.10
7.2.7 Summary of Commands for IEEE 488 Protocol	7.10
7.3 Serial Interface	7.11
7.3.1 Data Handshake	7.11
7.3.2 Echo	7.11
7.3.3 Input Command Terminator and Character Frame	7.11
7.3.4 Serial Interface Connector	7.11
7.3.5 Baud Rate Switches	7.11
7.3.6 Output to Serial Interface	7.12
7.3.6.1 ASCII Output to a Printer	7.12
7.3.6.2 ASCII Output to a Controller	7.13
7.3.6.3 Dump Output	7.13
7.4 Dump Output Format, for RS423 and GPIB	7.14
7.4.1 "Dump" Output	7.14
7.4.2 "Dump All" Output	7.14
7.4.3 Floating Point Format ("Dump" and "Dump All" Data)	7.15
7.5 Remote/Local Control	7.16
7.5.1 Local Lock-out	7.17
7.5.2 Combined Use of RS423 and GPIB Devices	7.18
7.6 Control Program Examples	7.19
7.6.1 Language Used in Program Examples	7.19
7.6.2 Example: Outputting Readings to the GPIB	7.19
7.6.3 Example: Plotting Results from the History File, Using a Controller	7.20
7.6.4 Example: Outputting the History File to the GPIB	7.20

7.1 INTRODUCTION

The instrument is fitted, as standard, with a GPIB interface and an RS423 interface, for communication with remote devices.

Full control and data input/output is possible through the GPIB.

RS423 is intended mainly for data output to a printer, VDU, etc, but, if the user is fully conversant with RS423 protocol, limited control of the instrument may, in some cases, be possible.

7.2 GPIB INTERFACE

The GPIB Interface conforms to the IEEE 488,1978 standard. The complete standard is published by the IEEE under the title: "IEEE Standard Digital Interface for Programmable Instrumentation". A useful introduction to the theory of the GPIB is given in the Solartron monograph: "Plus Bus - the Solartron GP-IB".

7.2.1 GPIB CAPABILITY CODE

The GPIB Interface in the instrument conforms to the following sub-functions within the standard, as listed on the rear panel:

SH1	Source handshake.
AH1	Acceptor handshake.
T5	Basic talker, . serial poll, talk only selectable, unaddressed if MLA ('My Listener Address').
TE0	No extended talker capability.
L4	Basic listener, no listen only mode, unaddressed if MTA (My Talker Address).
LE0	No extended listener capability.
SR1	Complete service request capability.
RL1	Complete remote/local capability, with local lock-out.
PP2	Parallel poll with local configuration.
DC1	Complete device clear capability, including selective device clear.
C0	No controller capability.
DT0	No device trigger capability.
E1	Open collector drivers:

7.2.2 GPIB CONNECTOR

Connection to the GPIB is made via the 24-way connector on the IEEE 488/GPIB interface. See Fig. 7.1. The pin connections conform to the IEEE 488, 1978 standard.

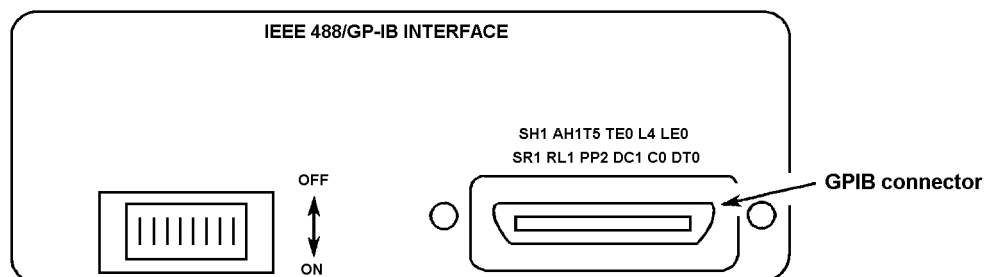


Figure 7.1 - GPIB interface

7.2.3 GPIB SWITCHES

Some interface functions are set by miniature toggle switches on the rear panel of the instrument. These functions are described below. (The remaining interface functions are set from the [GPIB CONFIGURE] menu.)

The GPIB switches are shown in Fig 7.2. These switches must be set before the instrument can be used in a GPIB system.

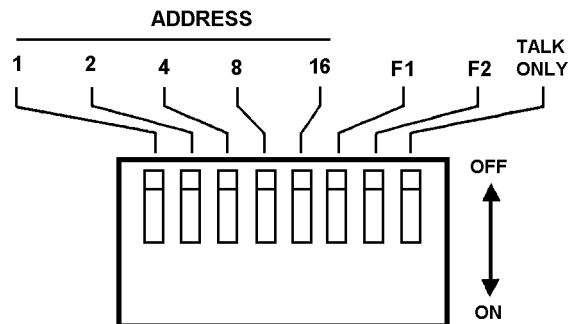


Figure 7.2 - GPIB switches. (All switches shown in off position.)

Once the switches have been set the instrument must read them, so that their settings can be implemented. The switches are read automatically at power-on, or on INITIALIZE, RESET, or BREAK. Power-on and BREAK leave other control settings unchanged, whilst INITIALIZE and RESET return them to the default state.

The GPIB switch functions are described in Sections 7.2.3.1 to 7.2.3.4 below.

7.2.3.1 Device Address

The ADDRESS switches select the GPIB address of the instrument. To avoid problems associated with mixing binary and ASCII information two GPIB ports are provided. One port is used for ASCII commands and data and the other for high speed binary *dump* output. The two ports are serviced through the same GPIB connector, but each has its own software address.

The address of the ASCII input/output port is the *major* address. This address must always be an even number, so always set the left-hand '1' switch to the *off* position. The odd-numbered address immediately following a major address is the *minor* address and is assigned automatically to the binary port.

7.2.3.2 Input Command Terminator

Use switches F1 and F2 to select the terminator that the instrument is to recognise for GPIB commands:

F1	F2	Terminator Selected
off	off	lf (line feed)
on	off	cr (carriage return)
off	on	;(semicolon)
on	on	EOI (End or Identify signal)


EOI is one of the five GPIB management lines. Some controllers automatically assert EOI accompanied by a command terminator. In this case, select "EOI" with switches F1 and F2. If the controller itself offers a choice of command terminator, choose *carriage return*, *line feed*, or *semicolon*; this prevents command data being lost or corrupted.

Any command terminator other than the one selected is ignored by the instrument.


The command terminator selected should agree with that used by the GPIB controller. Details of the command terminator should appear in the controller handbook

7.2.3.3 Talk Only

Choose between *talk only* and *talker/listener* operation with the TALK ONLY switch:

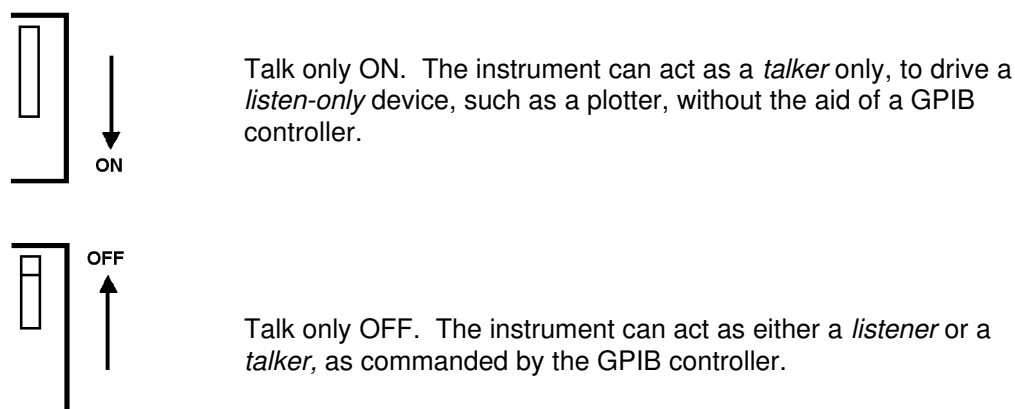

7.2.3.4 Example of GPIB Switch Settings

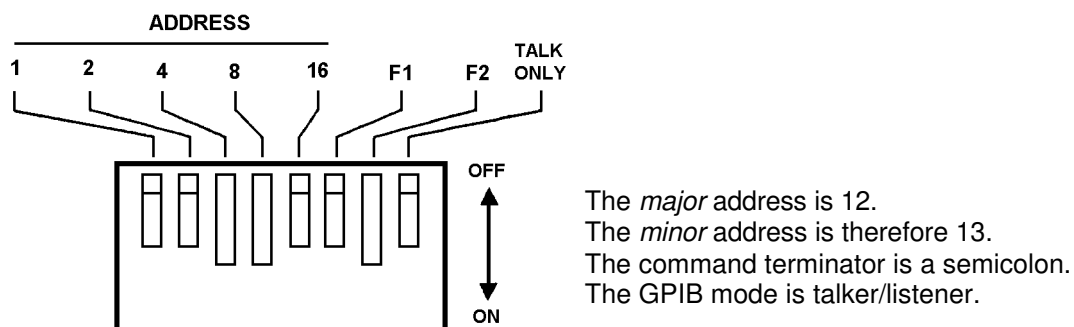

7.2.4 OUTPUT TO THE GPIB

The output of measurement results to the GPIB is controlled by the [DATA OUTPUT] GPIB setting (Chapter 5, Section 8.1). *All*, *fail*, and *pass* results are output in ASCII, and *dump* results in binary. The ASCII output can be selected for either a *talk only* device, such as a printer, or a *talker-listener* device, such as a GPIB controller. Binary data can be interpreted only by a controller, but can be stored, on disk for example, for subsequent controller processing.


7.2.4.1 ASCII Output to a Talk Only Device

When the instrument is set for talk only operation (TALK ONLY switch set to ON) the format of ASCII data output to the GPIB is the same as for data output to an RS423 printer. (See Section 7.3.6.1 below.) This format is suitable for GPIB *listen only* devices such as printers or VDUs.


Column headings are selected *on* or *off* from [FORMAT] HEADING, as for RS423 devices. The same setting applies to both RS423 and GPIB devices.

7.2.4.2 Normal ASCII Output (for Talker-Listener Devices)

When the instrument is set for talker-listener operation (TALK ONLY switch set to OFF) data are output to the GPIB in a compressed form, suitable for interpretation by a GPIB controller. Each parameter, *except frequency*, is represented by an eleven character field, containing a five-digit fixed point part and a two-digit exponent:

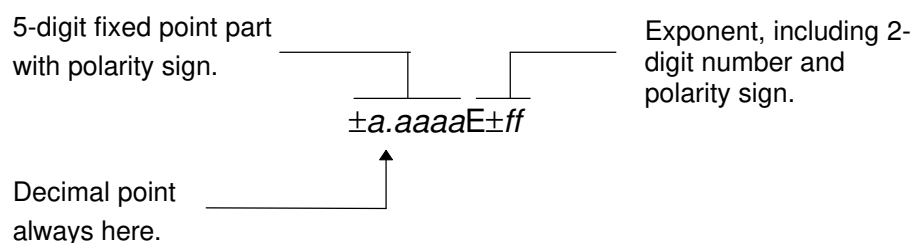

Frequency is represented by a fourteen character field, containing an eight digit fixed point part:

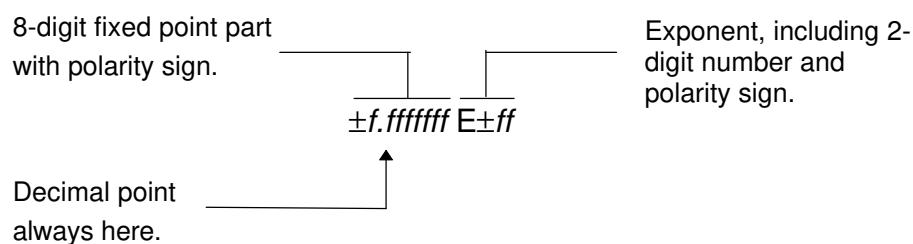

A complete reading takes the form:

Variable Parameter 1 Parameter 2 Error Code Limits Code cr

The error code is represented by a single digit; only the last digit of a Group 8 error code is reported. The output separator is shown as a comma, and the output terminator is carriage return. The limits code represents a limits check: 00 = pass; -1 = Lo; +1 = Hi.

The output separator and terminator are selected from the [GPIB CONFIGURE] menu.

No headings are available and the last result is not re-output after menu changes. Use the 'DO' remote command to read the last result again, e.g. after changing the DISPLAY SOURCE.

7.2.4.3 GPIB Dump Output

Dump output gives the fastest output data rate. Each parameter is represented by a 32-bit floating point number whose format conforms to the ANSI/IEEE Standard 754 (see Section 7.4.3).

The full precision of the frequency setting cannot be represented in the 4-byte version of the IEEE 754 format. So, if full precision is required, a separate FR? command should be sent. The frequency can then be read in ASCII format.

No separators or terminators are used, as they cannot be distinguished from binary data. However, if the output terminator selected from [GPIB CONFIGURE] is either *cr + EOI* or *cr, lf + EOI*, then the GPIB signal EOI (*End* or *Identify*) is asserted with the last byte.

The output rate is the same as that of the ASCII port, approximately 1 byte per millisecond, but the data is compressed. Also, the instrument's internal computation time is much less.

No headings are available and the last result is not re-output after menu changes. Use the 'DO' remote command to read the last result again, e.g. after changing the DISPLAY SOURCE.

7.2.5 SERIAL POLL

The instrument can be configured to request service from a GPIB controller when a particular event has occurred, e.g. on *end of sweep*, or *data ready*. The controller may then conduct a serial poll to find the source of the request. In a serial poll the controller examines the *status byte* of each device in turn.

7.2.5.1 The Status Byte

The status byte register (read only) holds the status of all events for which it is possible to request service.

The status byte can be read by a serial poll command (which clears the RQS bit) or by an *STB? command (which leaves the byte unchanged).

The status byte register is cleared by the commands *break* (BK), *clear status* (*CLS), *reset* (*RST) *initialize* (TT1) and *reset* (TT2), and on power-up.

128	64	32	16	8	4	2	1
END OF FILE	RQS	ESB	MAV	END OF PLOT	END OF SWEEP	END OF MEASURE	END OF PROGRAM

The significance of these bits is as follows:

Bit	Event	Comments
128	End of file	Set when the end of file is reached, either after a <i>list file</i> command or when filing data. Cleared by the <i>list file</i> command, the <i>clear file</i> command, or by adding more data to the file (except when file is full).
64	RQS	Request service. Set when there is a correspondence between one or more of the bits set in the status byte register and one or more of the bits set in the service request enable register. Cleared by a serial poll or an *SREn command.

(Continued overleaf)

Bit	Event	Comments
32	ESB	Event status byte. Set when there is a correspondence between one or more of the bits set in the event status register and one or more of the bits set in the event status enable register. Cleared by an *ESEn command.
16	MAV	Measurement (or message) available. Set when there are data available to be read. The data may be measurement results, parameter query replies or anything being output to the GPIB. Cleared when the data are read.
8	End of plot	Set at the end of a plot. Cleared when a new plot is started.
4	End of sweep	Set at the end of a sweep. Cleared when a new sweep is started.
2	End of measure	Set when a measurement is completed. Cleared when a new measurement is started.
1	End of program	Set when a learnt program is completed. Cleared when a new program is started.

7.2.5.2 Service Request Enable

The instrument can be enabled to request service (and set the RQS bit) for one or more specified events. (Alternatively, if several of the status bits must be monitored simultaneously, the controller can be programmed to poll the status byte continually.)

To enable a service request send the remote command *SREn. This sets the number *n* (in the range 0 to 255) into the service request enable register. “*n*” represents an event, or combination of events, for which service is to be requested. For example, *n* = 8 (STB 00001000) results in a service request at the next *end of plot* (see Fig 7.3).

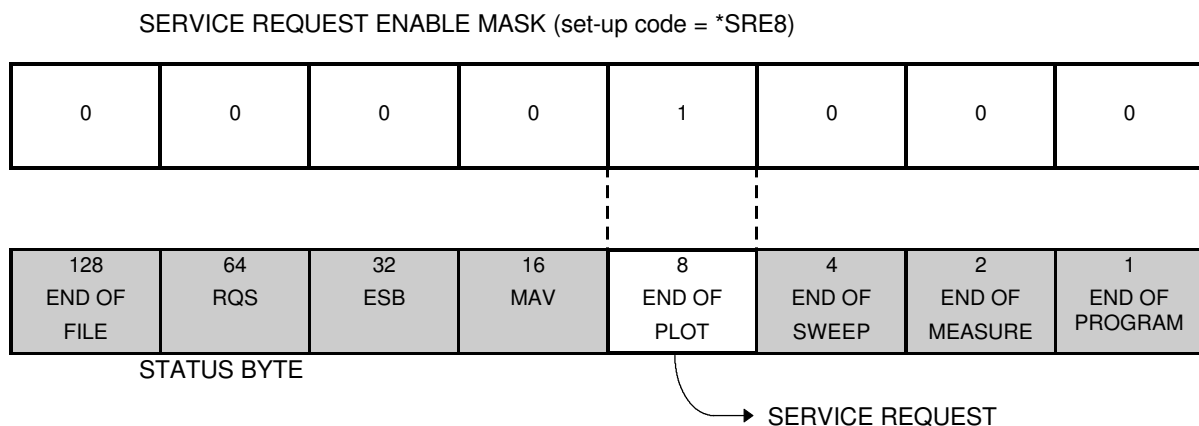


Figure 7.3 - Setting up a service request for “end of plot”

Once the instrument has requested service, the service request enable register must be set up again before another request can be made. The command **SREn* with which this is done also resets the RQS bit (bit 64) in the status register.

The service request enable register can be read with the command **SRE?*

7.2.5.3 Assigning Error Events

The error bit in the status byte register may have assigned to it any combination of the events stored in the event status register (ESR). This register (read only) can be read with the command **ESR?*

Error events are assigned by setting the appropriate bit(s) in the event status enable register (ESE) with the command **ESEn*. See the example in Fig 7.4.

The event status register is cleared by the commands *break* (BK), *event status enable* (**ESEn*), *event status query* (**ESR?*), *clear status* (**CLS*), *reset* (**RST*), *initialize* (TTI) and *reset* (TT2), and on power-up. The command **ESEn* also resets the ESB bit (bit 32) in the status byte register.

Remember that if an interrupt is required for the error event(s) then the error bit in the service request enable mask must be set to '1' (**SRE32*).

EVENT STATUS ENABLE (set-up code = **ESE17*)

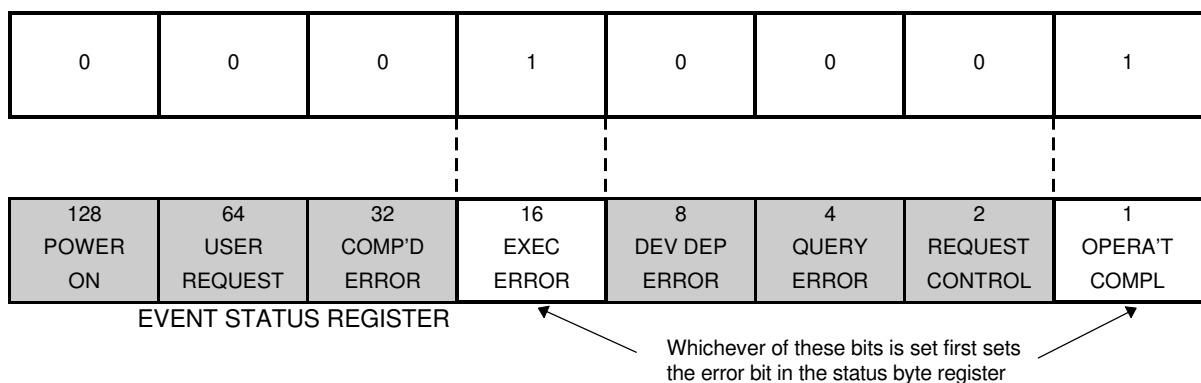


Figure 7.4 - Assigning "execution error" and "operation complete" to the status byte error bit

The significance of the event bits is as follows:

Bit	Event
128	Power On
64	User Request
32	Command Error
16	Execution Error
8	Device Dependent Error
4	Query Error
2	Request Control
1	Operation Complete

Set when the power supply has been switched off and on.

Not used.

Set by Error 01 and Error 02.

Set by Error 03 and Error 61.

Set by any other errors or warnings.

Set if an attempt is made to read non-existent data, or if a reading is aborted before all data is read.

Not used.

Set when the instrument has completed an operation. This bit must first be enabled by an operation complete (**OPC*) command.

7.2.6 PARALLEL POLL

The instrument can be configured to give a parallel poll *true/false* response on a selected GPIB data line, to indicate whether or not the instrument is requesting service. However, the instrument must first be configured for serial poll (see Section 7.2.5.1 above).

To set up a parallel poll configuration send the remote command PPn , where n is an integer from 1 to 8 defining which GPIB data line is to carry the response.

Setting PARALLEL POLL to zero or sending $PP0$ unconfigures parallel poll.

To select the sense of the parallel poll line send the remote command PSn , where $n = 1$ signifies *true* and $n = 0$ signifies *false*.

The parallel poll response is also cleared by any change to the SERIAL POLL value, by any BREAK action-key selection, and by power-off.

Unlike serial poll, parallel poll need not be reconfigured after each service request. It is, however, cleared by the command $*SREn$.

7.2.7 SUMMARY OF COMMANDS FOR IEEE 488 PROTOCOL

The following commands are supported by the instrument for IEEE 488 protocol:

Cmd	Action
*RST	Reset command, equivalent to the break command (BK).
*CLS	Clears the status byte register and the event status register. Any *OPC command is cancelled
*STB?	Queries the status byte register, leaving it unchanged.
*SRE n	Sets the service request enable register to the bit pattern corresponding to n .
*SRE?	Queries the service request enable register, leaving it unchanged.
*ESR?	Queries the event status register, clearing it in the process.
*ESE n	Sets the event status enable register to the bit pattern corresponding to n .
*ESE?	Queries the event status enable register, leaving it unchanged.
*OPC	Enables the instrument to set the <i>operation complete</i> bit in the event status register when the idle state is next entered.
*IDN?	Instrument outputs the identifier string " 1260 IMPEDANCE ANALYZER, SOLARTRON, 0, 0"
*TST?	Starts a self test, on completion of which the instrument outputs the result: "0" for <i>fail</i> or "1," for <i>pass</i> . The front panel is left in self test mode, scrolling the rows. The next command clears this, or the operator can clear it by keying ENTER twice.
*RCL n	Recalls a stored setup. Equivalent action to the RS/ command.
*SAV n	Stores the present setup. Equivalent action to the SS/ command.

7.3 SERIAL INTERFACE

The serial interface is suitable for use with printers, display units and keyboards compatible with RS232 and RS423.

7.3.1 DATA HANDSHAKE

The instrument supports XON/XOFF data handshake. The ASCII commands XON (transmit on) and XOFF (transmit off) are recognised when outputting data to an external device. These commands are equivalent to the ASCII device control characters DC1 and DC3.

The instrument also asserts XOFF when it is busy, and XON when it is free. Full information is given in the standards:

- * American National Standard Code for Information Interchange (ASCII) X3.4 1977
- * BS 4730; The United Kingdom 7-bit data code (ISO-7-UK) February 1974, Section 5.3
- * CCITT Volume VIII. 1 Recommendation V3 "International Alphabet No. 5".

7.3.2 ECHO

The instrument *echoes* all characters received by the serial interface, unless the echo function is disabled. (See Chapter 5, Section 5.8.3.)

7.3.3 INPUT COMMAND TERMINATOR AND CHARACTER FRAME

Valid command terminators for the serial interface are *carriage return*, *line feed*, or *semi-colon*.

The character frame always contains one start bit, eight data bits, one stop bit and no parity.

7.3.4 SERIAL INTERFACE CONNECTOR


Connection to RS423 devices is made via the 25-way sub-miniature D-type connector on the serial interface. See Fig. 7.5. The pin functions are shown in the connector detail.

7.3.5 BAUD RATE SWITCHES

The Baud rate of the serial interface is set by miniature toggle switches on the rear panel of the instrument. This function is described below. The remaining interface functions are set from the [RS 423 CONFIGURE] menu (Chapter 5, Section 5.8.3).

Set the RS423 baud rate to the required value (from 110 to 9600) by means of the 8-way BAUD RATE switch (Fig. 7.5).

Only one of the eight switches should be set in the down position, under the required baud rate.

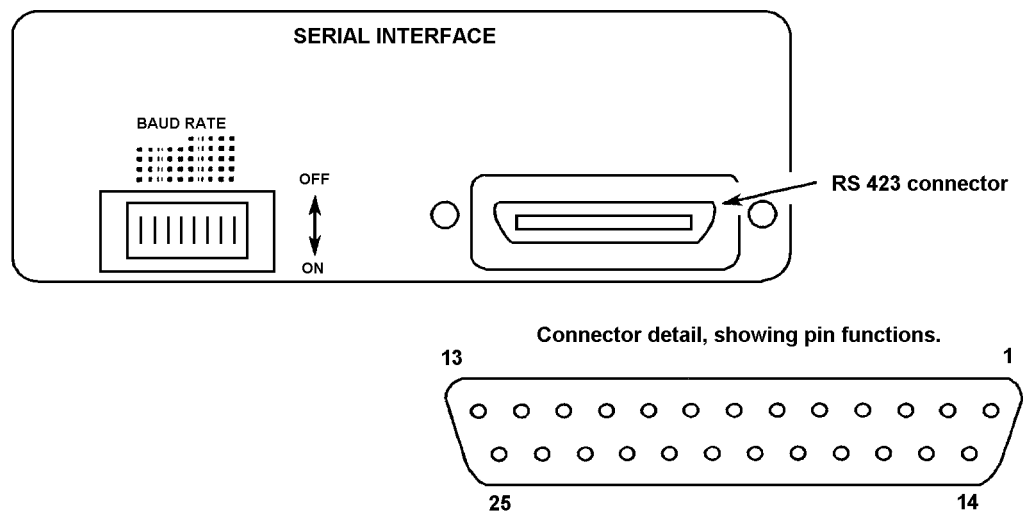

Pin 1 = Ground

Pin 4 = RTS (Request to Send)

Pin 7 = Ground

Pin 2 = Serial Data to instrument

Pin 5 = CTS (Clear to Send)

Pin 8 = DCD (Data Carrier Detect)

Pin 3 = Serial Data from instrument

Pin 6 = DSR (Data Set Ready)

Pin 20 = DTR (Data Terminal Ready)

Figure 7.5 - Serial interface (on instrument rear panel)

7.3.6 OUTPUT TO THE SERIAL INTERFACE

The output of measurement results to the serial interface is controlled by the [DATA OUTPUT] RS423 setting (Chapter 5, Section 5.8 1). *All*, *fail*, and *pass* results are output in ASCII, and *dump* results in binary. The ASCII output can be selected for either a printer or a controller. Binary data can be interpreted only by a controller.

7.3.6.1 ASCII Output to a Printer

The *printer* format, selected from [RS423 CONFIGURE] MODE, is suitable for an 80 (or more) character-per-line printer. The results are separated by spaces, a complete result taking the form:

Variable	Par. 1	Par. 2	Limits	Check/Bin No	Channel and error	Time.
----------	--------	--------	--------	--------------	-------------------	-------

Each measurement result is terminated by an output *terminator*, selected from [RS423 CONFIGURE] TERM (Chapter 5, Section 5.8.3). Two of the terminators available include five *null* characters. These characters give a mechanical printer time to complete a carriage return, before receiving the next result. The exact content of the results output depends on the DISPLAY menu (Chapter 5, Section 5.5.4).

Column headings may be printed, or not, as selected by [FORMAT] HEADING on or *off*. Typical headings are:

FREQUENCY (Hz)	CAPACITOR (F)	PARALLEL R. (ohms)	LIMIT CHECK	CHANNEL & ERROR	TIME
-------------------	------------------	-----------------------	----------------	--------------------	------

Column headings and results are automatically re-output when menu changes are made that affect their validity, e.g. changing the DISPLAY [COORDINATES] from r,θ to a,b .

7.3.6.2 *ASCII Output to a Controller*

The *controller* format, selected from [RS 423 CONFIGURE] MODE, is the same as that of the ASCII output to a talker/listener on the GPIB (see Section 7.2.4.2). The output terminator and separator are selected from the [RS423 CONFIGURE] menu (Chapter 5, Section 5.8.3).

Headings are not output when the controller format is selected, and the last result is not re-output after menu changes. Use the 'DO' remote command to read the last result again, e.g. after changing the display *source*.

7.3.6.3 *Dump Output*

In *dump* output, selected from the [DATA OUTPUT] menu, each measurement result is output in binary form.

No headings are available and the last result is not re-output after menu changes. Use the 'DO' remote command to read the last result again, e.g. after changing the DISPLAY SOURCE.

No separators or terminators are available, as they cannot be distinguished from binary data.

7.4 DUMP OUTPUT FORMAT, for RS423 and GPIB

There are two types of dump output, *dump* and *dump all*. The binary numbers which make up these outputs are all in IEEE 754 standard format.

7.4.1 “Dump” Output

For each measurement the *dump* output produces ‘three floating point numbers’:

<i>ffff</i>	measurement frequency
<i>aaaa</i>	in-phase component of the displayed
<i>bbbb</i>	result quadrature component of the displayed result
<i>e</i>	single byte error code
<i>l</i>	single byte limits code

The coordinates available for the dump output are selected from the DISPLAY menu.

The single byte limit code (in 2s complement form) represents the result of a limits check: ‘1’ = Hi, ‘-1’ (= 255, or FF_H) = Lo, and ‘0’ = pass.

7.4.2 “Dump All” Output


For each measurement the *dump all* output produces nine floating point numbers:

<i>ffff</i>	the measurement frequency
<i>nnnn₁</i>	the generator amplitude
<i>nnnn₂</i>	the generator bias
<i>aaaa₁, bbbb₁</i>	the in-phase and quadrature components of the Voltage 1 input
<i>e</i>	single byte error code
<i>aaaa₂, bbbb₂</i>	the in-phase and quadrature components of the Voltage 2 input
<i>e</i>	single byte error code
<i>aaaa₂, bbbb₂</i>	the in-phase and quadrature components of the Current input
<i>e</i>	single byte error code

The only coordinates available for the *dump all* output are a,jb.

7.4.3 FLOATING POINT FORMAT (“Dump” and “Dump All” Data)

The floating point format conforms to the ANSI / IEEE Standard 754. It consists of a 4-byte (32 bit) floating point number, as shown below:

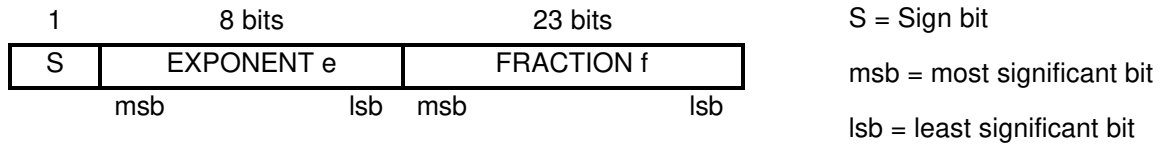

The value of the number is $(-1)^s 2^{e-127} (1.f)$ provided that $0 < e < 255$

 
NOTE:

1. A zero sign bit indicates a positive number, a 1 sign bit indicates a negative number.
2. If $e = 0$ and $f = 0$, the value of the floating point number is zero.
3. If $e = 255$ and $f = 0$, the value of the floating point number is $\pm \infty$

EXAMPLE: Converting a 4-byte floating point number to decimal.

Byte 1 contains 01000001_2 (most significant byte)
 Byte 2 contains 11000000_2
 Byte 3 contains 00000000_2
 Byte 4 contains 00000000_2 (least significant byte)

Arranged with the most significant byte on the left and the least significant byte on the right, these bytes form the following binary number:



From this:

The sign bit value of '0' indicates that the number is positive

The exponent value of $10000011_2 = 131_{10}$ represents an exponent of:

$$\begin{aligned}
 &2^{131-127} \\
 &= 2^4 \\
 &= 16_{10}
 \end{aligned}$$

The fraction part

$$\begin{aligned}
 &= 1.f_2 \\
 &= 1.100000000000000000000000_2 \\
 &= 1.5_2
 \end{aligned}$$

Therefore the decimal equivalent of the floating point number is

$$1.5 \times 16 = + 24$$

7.5 REMOTE/LOCAL CONTROL

The REMOTE/LOCAL facility enables the instrument to receive commands from either a *remote* or a *local* source. The remote facility is provided by the GPIB interface and has priority over local control.

The instrument offers two forms of local control:

- Local 1 Commands accepted from the instrument front panel and/or from the serial interface. The two sources have equal priority.
- Local 2 Commands accepted from the RS423 port only. No settings can be changed from the front panel, but the LOCAL key and the ON/OFF switch are still operative. The Menu keys can be used to examine, but not alter, the state of the controls.

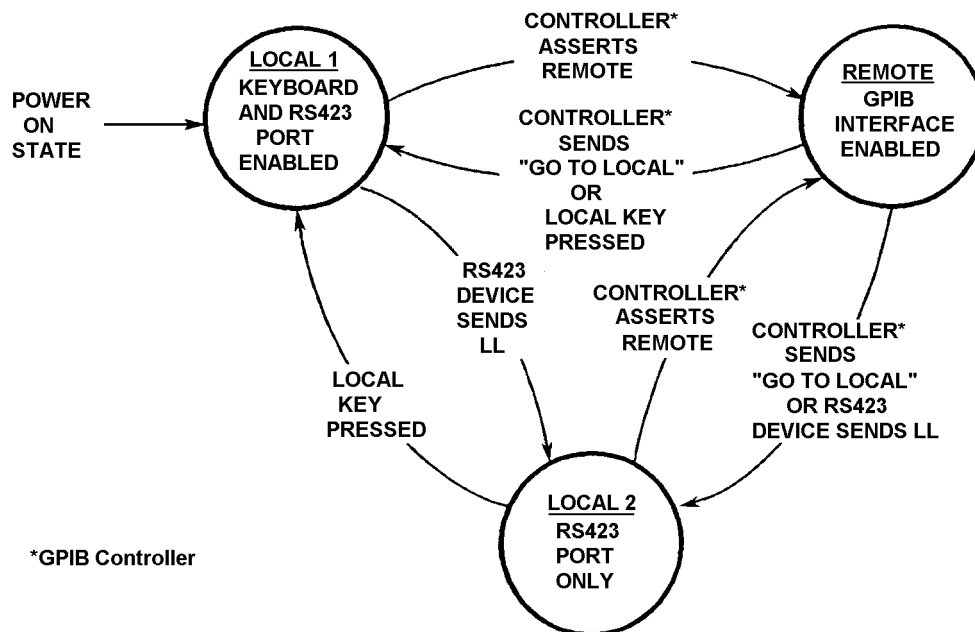


Figure 7.6 - REMOTE/LOCAL state diagram

The instrument powers up in LOCAL 1. Many GPIB controllers, however, automatically assert *remote* on power-up, in preparation for remotely controlling the system. Therefore, if the instrument is used in such a system it may be necessary to press the LOCAL key to allow local commands to be accepted. Figure 7.6 shows how the instrument control state is selected.

The program instructions for selecting LOCAL and REMOTE from the GPIB can be found in the GPIB controller operating manual. Note that a command to 'Go to Local' reselects the local state in use prior to the selection of REMOTE.

7.5.1 LOCAL LOCKOUT

The remote/local facility can have a local lockout condition superimposed by a command from the GPIB controller. Once local lockout is applied, control can be transferred only by the controller.

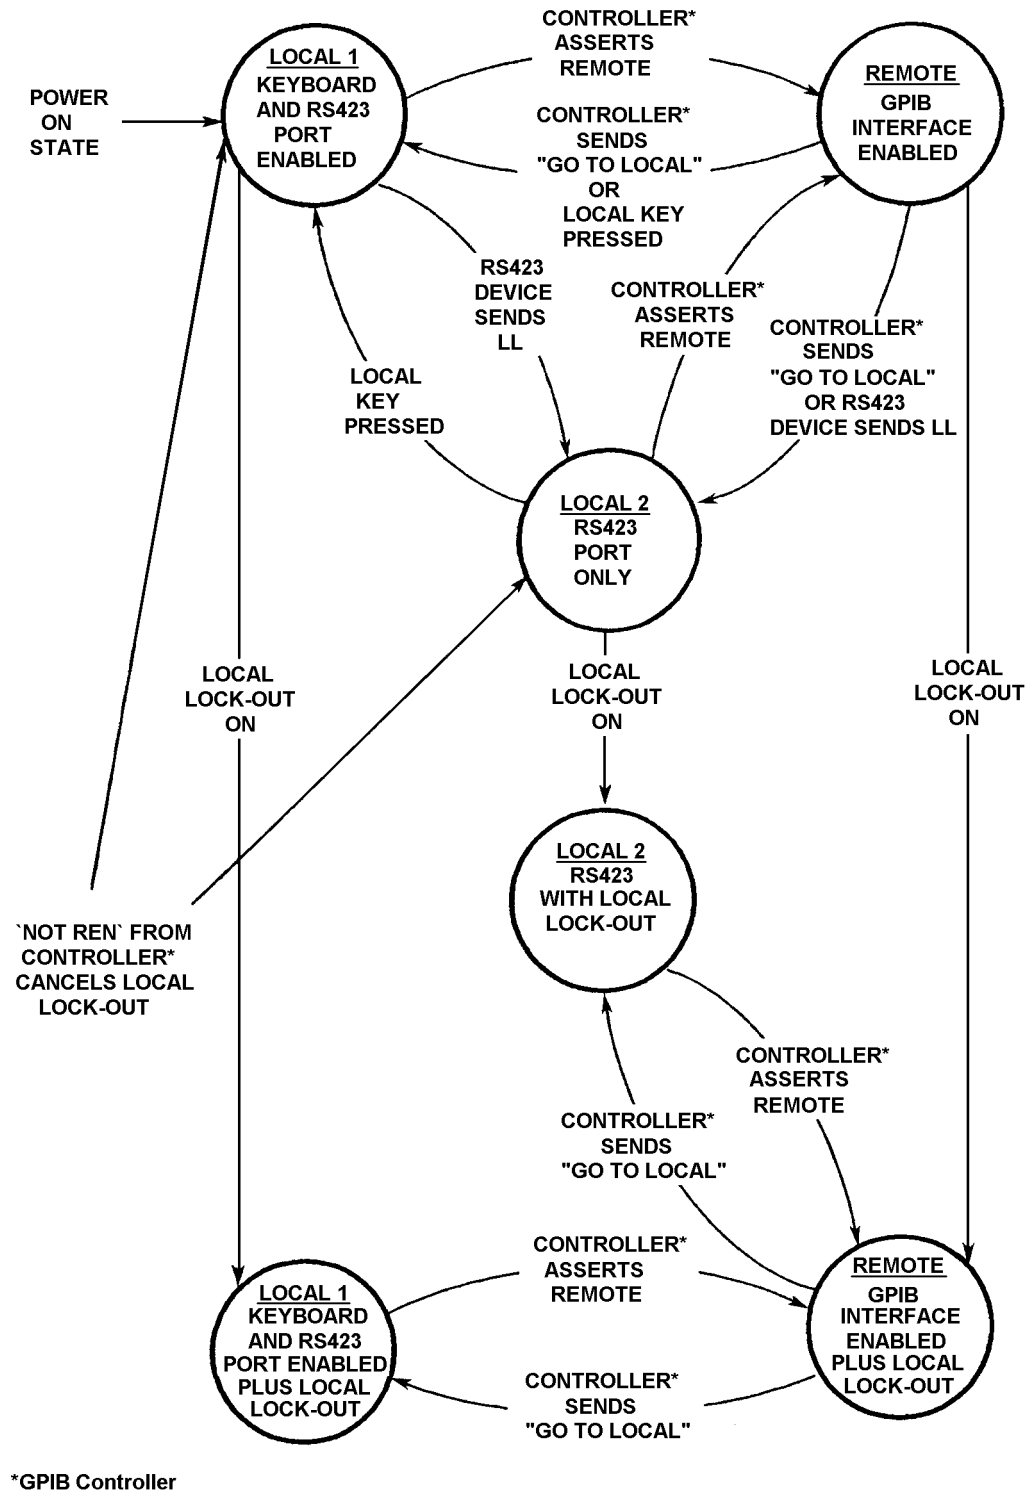


Figure 7.7 - State diagram of remote/local control with local lockout.

Local lockout prevents the control settings of the instrument being altered by unauthorized use of the front panel. Fig. 7.7 shows the relationship of local lockout to the remote and local states previously shown in Fig. 7.6.

As in Fig. 7.6, a GO TO LOCAL command from the controller reselects the local state previously in use.

The local lockout' state is cancelled' when the REMOTE ENABLE signal from the controller is negated, i.e. when the controller sends NOT REN.

7.5.2 COMBINED USE OF RS423 AND GPIB DEVICES

The instrument can be used in a system containing both GPIB and RS423 compatible devices.

For example, the GPIB controller could be a calculator with no recording capability, whilst the RS423 device could be a tape cassette unit, or a printer with no keyboard. Data requested by the GPIB controller, e.g. measurement results, are output also through the serial interface, provided that DATA OUTPUT for RS423 is enabled.

Conversely, if the instrument is set to *talk only*, and is connected to a *listen only* printer or plotter, data requested through the serial interface is sent also to the GPIB, provided that DATA OUTPUT for the GPIB is enabled.

However, if the instrument is set for operation as a talker/listener, data requested through the serial interface does not appear on the GPIB.

7.6 CONTROL PROGRAM EXAMPLES

To demonstrate the use of the GPIB port for remote control of the instrument, several examples are given of GPIB Controller programs. Each example is written as a series of abbreviated commands, including some BASIC programming language instructions. The programs are representational only and are not necessarily suitable for directly programming a Controller.

7.6.1 LANGUAGE USED IN PROGRAM EXAMPLES

The examples are intended to show the required sequence of events, as they affect the controls of the instrument. Other GPIB commands, such as Enable Signals and Addressing, are omitted. The most commonly used instructions are listed below, with a full explanation of their meaning.

Instruction	Meaning
OUTPUT " " "	Send to the instrument the string of characters within the inverted commas, plus a Command Terminator.
INPUT	Receive data from the instrument
INPUT A	Receive data from the instrument and store it in location A.
PRINT "FREQUENCY =", A	Print the statement: Frequency = "the value stored in location A".
DIM A\$(100)	The Controller is instructed to allocate sufficient temporary store space to accommodate a maximum of 100 character strings. A string could consist of a Learnt Program Command, a stored reading from the file etc. The store area is given the name A\$.
FOR I = 1 TO N INPUT A\$(I)	This is a loop instruction telling the controller to store each line of the instrument's output in area A\$, from line 1 to the final line N.
NEXT I	The loop instruction terminates when I = N

7.6.2 EXAMPLE: Outputting Readings to the GPIB

The use of comma as separator and crlf as terminator is assumed.

Instruction	Meaning
OUTPUT "CV0"	Select co-ordinates a,b
OUTPUT "OP2,1"	Send all readings to the GPIB
OUTPUT "SI"	Make a Single measurement
INPUT F,A,B,E,L	Store the results of the measurement
PRINT "FREQ = ", F	Print the results of the measurement
PRINT "a = ", A	
PRINT "b = ", B	
PRINT "error = ", E	
PRINT "Limit check = ", L	

Note that the results sent to the GPIB ASCII port are from the same source channel and have the same co-ordinates as the results displayed on the Front Panel.

7.6.3 EXAMPLE: Plotting Results from the History File, Using a Controller

First set up the sweep and plotter parameters of the instrument, using the "OUTPUT *command*" statement. The commands are listed in Chapter 8.

The controller program should now continue:

Instruction	Meaning
OUTPUT "**SRE4"	Configure for interrupt at <i>end of sweep</i> .
OUTPUT "RE"	Start repetitive measurements
'	
'	(Wait for interrupt)
OUTPUT "**SRE8"	Configure SRQ for <i>end of plot</i>
OUTPUT "PL"	Start plot.
	(Configure instrument to talk and plotter to listen.)
	(Wait for interrupt.)

7.6.4 EXAMPLE: Outputting the History File to the GPIB

Instruction	Meaning
OUTPUT "**FP0?"	Query number of lines in File
INPUT N	N = number of lines in File
DIM A\$(N)	Allocate temporary store space
OUTPUT "OP2,1"	Output all readings to GPIB
OUTPUT "FO"	List File
FOR I = 1 to N	Start plot.
INPUT A\$(I)	Store all readings from File until I = N
NEXT I	

8

Remote Commands

<i>Section</i>	<i>Page</i>	<i>Section</i>	<i>Page</i>
8.1 Introduction	8.1		
8.2 Command Syntax	8.2	Query Commands:	
8.3 Command Summary	8.3	Analyzer	8.12
Generator	8.3	View File	8.12
Monitor	8.3	Program	8.12
Analysis	8.3	Self Test	8.12
Input V1	8.4	Firmware	8.12
Input V2	8.4	Calibration	8.13
Input I	8.4	Statistics	8.13
Sweep	8.4	Calibration Commands	8.13
Sweep Limits	8.5	Command Index	8.14
Display	8.5		
Plotter	8.6		
Plotter Scaling	8.6		
Plot	8.7		
Plotter X-axis	8.7		
Plotter Y-axis, Main	8.7		
Plotter Y-axis, Overlay	8.7		
Data Output	8.8		
GPIB Configure	8.8		
IEEE 488 Protocol	8.8		
RS423 Configure	8.9		
File Configure	8.9		
Scaling	8.9		
Limits	8.10		
Binsort A	8.10		
Binsort B	8.10		
View File	8.10		
Vernier	8.11		
Status	8.11		
Store/Recall	8.11		
Learn Program	8.11		
Self Test	8.12		
Execute Program	8.12		
Mini-status	8.12		
Direct Actions:	8.12		

8.1 INTRODUCTION

This chapter lists the instrument remote commands. The commands are the same for RS423 and GPIB-operation. They are presented in menu order to relate to Chapter 5, "Menu Terms".

8.2 COMMAND SYNTAX

The majority of codes are qualified by a numeric argument. In the following lists:

F is a floating point number $\pm n.nnnnnnn E \pm xx$,

I is an integer up to 2 digits,

I,I is two integers of up to 2 digits each, separated by a comma.

Default settings are shown in italics.

Including a query (?) with a command code, in any position, returns the associated parameter setting. Additional query commands are available for examining control information not accessible in this way.

8.3 COMMAND SUMMARY

The command summary appears on pages 8.3 through 8.13.

Parameter	Command	Argument	Setting
GENERATOR			
TYPE	GT	0 1	<i>voltage</i> <i>current</i>
FREQ	FR <i>F</i>	10E-6 to 32E6	hertz
V. AMPL	VA <i>F</i>	0 to 3 ($\leq 10\text{MHz}$) 0 to 1 ($> 10\text{MHz}$)	volts volts
V. BIAS	VB <i>F</i>	-40.95 to +40.95	volts
I. AMPL	IA <i>F</i>	0 to 60 $\times 10^{-3}$ ($\leq 10\text{MHz}$) 0 to 20 $\times 10^{-3}$ ($> 10\text{MHz}$)	amps amps
I. BIAS	IB <i>F</i>	-100 $\times 10^{-3}$ to +100 $\times 10^{-3}$	amps
Waveform (For test and cal. purposes only.)	WF <i>I</i>	0 1	<i>sine</i> <i>square</i>
MONITOR			
ENABLE	ME <i>I</i>	0 1 2	<i>monitor off</i> <i>monitor V1</i> <i>monitor I</i>
V. LIMIT	VC <i>F</i>	0 to 3 ($\leq 10\text{MHz}$) 0 to 1 ($> 10\text{MHz}$)	volts volts
I. LIMIT	IC <i>F</i>	0 to 60 $\times 10^{-3}$ ($\leq 10\text{MHz}$) 0 to 20 $\times 10^{-3}$ ($> 10\text{MHz}$)	amps amps
ERROR%	AE <i>F</i>	1 to 50	%
ANALYSIS			
∫ TIME	IS <i>F</i>	0.01 to 1E5	seconds
DELAY	MS <i>F</i>	0 to 1E5	seconds
AUTO ∫	AU <i>I</i>	0 1 2 3 4 5 6	<i>off</i> long ∫ on V1 short ∫ on V1 long ∫ on V2 short ∫ on V2 long ∫ on I short ∫ on I
MODE	MD <i>I</i>	0 1 2	<i>normal</i> group delay* auto impedance
*group delay %	GP <i>F</i>	0 to 50	+ %FREQ
	GN <i>F</i>	0 to 50	- %FREQ

Parameter	Command	Argument	Setting
INPUT V1			
RANGE	RA <i>I,I</i>	1,0	<i>auto</i>
		1,1	30mV
		1,2	300 mV
		1,3	3V
COUPLING	DC <i>I,I</i>	1,0	<i>dc</i>
		1,1	<i>ac</i>
INPUT	IP <i>I,I</i>	1,0	<i>single</i>
		1,1	<i>differential</i>
OUTER	OU <i>I,I</i>	1,0	<i>grounded</i>
		1,1	<i>floating</i>
INPUT V2			
RANGE	RA <i>I,I</i>	2,0	<i>auto</i>
		2,1	30mV
		2,2	300 mV
		2,3	3V
COUPLING	DC <i>I,I</i>	2,0	<i>dc</i>
		2,1	<i>ac</i>
INPUT	IP <i>I,I</i>	2,0	<i>single</i>
		2,1	<i>differential</i>
OUTER	OU <i>I,I</i>	2,0	<i>grounded</i>
		2,1	<i>floating</i>
INPUT I			
RANGE	RA <i>I,I</i>	3,0	<i>auto</i>
		3,1	6μA
		3,2	60μA
		3,3	600μA
		3,4	6mA
		3,5	60mA
COUPLING	DC <i>I,I</i>	3,0	<i>dc</i>
		3,1	<i>ac</i>
SWEEP			
ENABLE	SW <i>I</i>	0	<i>off</i>
		1	<i>lin freq</i>
		2	<i>log freq</i>
		3	<i>amplitude</i>
		4	<i>bias</i>
UP/DOWN	SD <i>I</i>	0	<i>up</i>
		1	<i>down</i>
Δ LOG	SF <i>F</i>	2 to 50 x 10 ³	points/sweep
Δ LIN	LF <i>F</i>	2 to 50 x 10 ³	points/sweep
	HF <i>F</i>	1 x 10 ⁻⁵ to 20 x 10 ⁶	units/step

Parameter	Command	Argument	Setting
SWEEP LIMITS			
FREQ	FM <i>F</i>	10E-6 to 32E6	min. freq, hertz
	FX <i>F</i>	10E-6 to 32E6	max. freq, hertz
V. AMPL	VM <i>F</i>	0 to 3 ($f \leq 10\text{MHz}$)	min. ampl, volts
		0 to 1 ($f > 10\text{MHz}$)	min. ampl, volts
	VX <i>F</i>	0 to 3 ($f \leq 10\text{MHz}$)	max. ampl, volts
		0 to 1 ($f > 10\text{MHz}$)	max. ampl, volts
V. BIAS	BM <i>F</i>	-40.95 to +40.95	min. bias, volts
	BX <i>F</i>	-40.95 to +40.95	max. bias, volts
I. AMPL	IM <i>F</i>	0 to 60×10^{-3} ($f \leq 10\text{MHz}$)	amps
		0 to 20×10^{-3} ($f > 10\text{MHz}$)	amps
	IX <i>F</i>	0 to 60×10^{-3} ($f \leq 10\text{MHz}$)	amps
		0 to 20×10^{-3} ($f > 10\text{MHz}$)	amps
I. BIAS	QM <i>F</i>	-100×10^{-3} to $+100 \times 10^{-3}$	amps
	QX <i>F</i>	-100×10^{-3} to $+100 \times 10^{-3}$	amps
DISPLAY			
VARIABLE	VI <i>I</i>	0	frequency
		1	amplitude
		2	bias
Source	SO <i>I,I</i>	0, <i>n</i>	FUNCTION (<i>n</i>)
		1,0	V1
		2,0	V2
		1,2	V1/V2
		2,1	V2/V1
		3,0	I
		1,3	$Z1=V1/I$
		3,1	$Y1=I/V1$
		2,3	$Z2=V2/I$
		3,2	$Y2=I/V2$
V coordinates	CV <i>I</i>	0	a,b
		1	<i>r</i> , θ
		2	<i>r</i> (dB), θ
		3	<i>r</i> , <i>t</i>
		4	<i>r</i> (dB), <i>t</i>
Func. coordinates	FV <i>I</i>	0	a,b
		1	<i>r</i> , θ
		2	<i>r</i> (dB), θ
		3	<i>r</i> , <i>t</i>
		4	<i>r</i> (dB), <i>t</i>
		5	L (orC),R
		6	L (orC),Q
I coordinates	CI <i>I</i>	7	L (orC),D
		0	a,b
		1	<i>r</i> , θ

Parameter	Command	Argument	Setting
DISPLAY (Cont.)			
Z coordinates	CZ /	0	R,X
		1	Z,θ
		2	L (orC),R
		3	L (orC),Q
		4	L (orC),D
Y coordinates	CY /	0	G,B
		1	Y,θ
		2	L (orC),R
		3	L (orC),Q
		4	L (orC),D
PHASE	UW /	0	normal
		1	unwrapped
ERROR BEEP	BP /	0	off
		1	on
CIRCUIT	CC /	0	series L,R
		1	series C,R
		2	parallel L,R
		3	parallel C,R
		4	auto
(error message)	CL		clear
PLOTTER			
MODE	VE /	0	point
		1	vector
TEXT	PT /	0	off
		1	on
GRID	GD /	0	off
		1	on
AXES	PA /	0	off
		1	on
DEVICE	PD /	0	HPGL
		1	ESGL
PLOTTER SCALING			
SIZE	AA /	0	A4
		1	A3
		2	scaled
X-MIN	XB F	0 to 32000	
X-MAX	XT F	0 to 32000	
Y-MIN	YB F	0 to 32000	
Y-MAX	YT F	0 to 32000	
PLOTTER TITLE	TI text		

Parameter	Command	Argument	Setting
PLOT	PL		
PLOTTER X-AXIS			
ITEM	XI /	0	<i>variable</i>
		1	<i>par 1</i>
		2	<i>par 2</i>
LIMITS	XL /	0	<i>auto</i>
		1	<i>manual</i>
MINIMUM	XM0, F	-999 x 10 ¹⁵ to +999 x 10 ¹⁵	
MAXIMUM	XM1, F	-999 x 10 ¹⁵ to +999 x 10 ¹⁵	
LIN/LOG	XZ /	0	<i>auto</i>
		1	<i>linear</i>
		2	<i>log</i>
PEN	XP /	1 to 9	<i>pen ()</i>
PLOTTER Y-AXIS MAIN			
ITEM	YI /	0	<i>variable</i>
		1	<i>par 1</i>
		2	<i>par 2</i>
LIMITS	YL /	0	<i>auto</i>
		1	<i>manual</i>
MINIMUM	YM0, F	-999 x 10 ¹⁵ to +999 x 10 ¹⁵	
MAXIMUM	YM1, F	-999 x 10 ¹⁵ to +999 x 10 ¹⁵	
LIN/LOG	YZ /	0	<i>auto</i>
		1	<i>linear</i>
		2	<i>log</i>
PEN	YP /	1 to 9	<i>pen ()</i>
PLOTTER Y-AXIS OVERLAY			
ITEM	OI /	0	<i>off</i>
		1	<i>variable</i>
		2	<i>par 1</i>
		3	<i>par 2</i>
LIMITS	OL /	0	<i>auto</i>
		1	<i>manual</i>
		2	<i>same as main</i>
MINIMUM	OM0, F	-999 x 10 ¹⁵ to +999 x 10 ¹⁵	
MAXIMUM	OM1, F	-999 x 10 ¹⁵ to +999 x 10 ¹⁵	
LIN/LOG	OZ /	0	<i>auto</i>
		1	<i>linear</i>
		2	<i>log</i>
PEN	VP /	1 to 9	<i>pen ()</i>

Parameter	Command	Argument	Setting
DATA OUTPUT			
RS423	OP <i>I,I</i>	1,0	<i>off</i>
		1,1	<i>all</i>
		1,2	<i>fail</i>
		1,3	<i>pass</i>
		1,4	<i>dump</i>
		1,5	<i>dump all</i>
GPIB	OP <i>I,I</i>	2,0	<i>off</i>
		2,1	<i>all</i>
		2,2	<i>fail</i>
		2,3	<i>pass</i>
		2,4	<i>dump</i>
		2,5	<i>dump all</i>
FILE	OP <i>I,I</i>	2,6	<i>plotter</i>
		3,0	<i>off</i>
		3,1	<i>all</i>
		3,2	<i>fail</i>
HEADING	RH <i>I</i>	3,3	<i>pass</i>
		0	<i>off</i>
		1	<i>on</i>
GPIB CONFIGURE			
PAR ROLL	PP <i>I</i>	0	<i>unconfigure</i>
		1 to 8	<i>device identity</i>
P SENSE	PS <i>I</i>	0	<i>false</i>
		1	<i>true</i>
TERM	OT <i>I</i>	0	<i>cr lf</i>
		1	<i>cr lf+EOI</i>
		2	<i>cr</i>
SEP	OS <i>I</i>	3	<i>cr+EOI</i>
		0	<i>comma</i>
		1	<i>terminator</i>
IEEE 488 Protocol			
Clear status.	*CLS		
Event status enable.	*ESE <i>I</i>	0 to 255	<i>configure</i>
Event status enable?	*ESE?		<i>query</i>
Event status register?	*ESR?		<i>query</i>
Device identity string?	*IDN?		<i>return errors</i>
Learn device set-up?	*LRN?		
Enable oper`n complete.	*OPC		
Recall set-up.	*RCL		
Reset.	*RST		
Store set-up.	*SAV	0 to 255	
Service request enable.	*SRE <i>I</i>		<i>query</i>
Service request enable?	*SRE?		<i>query</i>
Read status byte query.	*STB?		<i>returns test result</i>
Self test query.	*TST?		

Parameter	Command	Argument	Setting
RS423			
CONFIGURE			
MODE	RR /	0	controller
		1	printer
ECHO	EC /	0	off
		1	on
TERM	RT /	0	cr lf
		1	cr lf and null
		2	cr
		3	cr and null
SEP	RP /	0	comma
		1	terminator
XOFF/XON	XO /	0	enable
		1	disable
FILE			
CONFIGURE			
FORMAT	FG /	0	normal
		1	group delay
CLEAR	MC /	0	auto
		1	manual
STATUS	SX /	0	par 1
		1	par 2
SCALING			
NORM.	NO /	0	off
		1	on
		2	evaluate
NULL	NL /	0	off
		1	on
		2	evaluate
CONSTS	CO I,I,F,F	1 to 9	constant no.
		0	r,θ
		1	a,b
		-999x10 ¹⁵ to +999x10 ¹⁵	r,θ,a, or b
FUNCT.	FU /, text	1 to 18	function no.
Clear Function	CF /	1 to 18	function no.
DEV Δ	DE /	0	off
		1	Δ
		2	Δ%
DEV Δ STORE	DS /	1 to 9	store no.

Parameter	Command	Argument	Setting
LIMITS			
ITEM	LI /	0	<i>off</i>
		1	parameter 1
		2	parameter 2
LOWER LIMIT	LV 0, F	-999x10 ¹² to +999x10 ¹²	
UPPER LIMIT	LV 1, F	-999x10 ¹² to +999x10 ¹²	
BINSORT A			
ENABLE	BN /	0	<i>off</i>
		1	continuous
		2	fixed count
		3	random
STEP SIZE	BC /	0 to 255	fixed cnt/random
ITEM	BI /	0	<i>par 1 sort</i>
		1	<i>par 2 sort</i>
BINS	BZ /	1 to 32	bin number
Par 1 value	VF F	-999x10 ¹² to +999x10 ¹²	base value, par 1
Par 2 value	VL F	-999x10 ¹² to +999x10 ¹²	base value, par 2
MIN%	BL F	-999x10 ¹² to +999x10 ¹²	lower tolerance
MAX%	BU F	-999x10 ¹² to +999x10 ¹²	upper tolerance
STOP	BS /	0	<i>No automatic stop.</i>
(after <i>n</i> meas.)		1	Stop after <i>n</i> comps
Value of <i>n</i>	BF F	0 to 999x10 ¹²	No. of components (<i>n</i>) to be tested.
BINSORT B			
RETRY	BR /	0 to 255	no. of "tries"
LEVELS	BV /	0	0V, +5V levels
		1	0V, +18V levels
LOGIC	BG /	0	<i>negative</i> sense
		1	positive sense
VIEW FILE			
DISPLAY	FD /	0	beginning of file,
		1	end of file,
		2	next line,
		3	previous line.
LIST	FO		output file.
CLEAR	FC		clear file.
LINE	FL /	1 to 405	output specified line.

Parameter	Command	Argument	Setting
VERNIER			
FREQ	VR 0		
AMPL	VR 1		
BIAS	VR 2		
X-MIN	VR 3	0 to 32000	
Y-MIN	VR 4	0 to 32000	
X-MAX	VR 5	0 to 32000	
Y-MAX	VR 6	0 to 32000	
Step Vernier	SP F	-20E6 to 20E6	
STATUS			
PROGRAM	ST 0		
μP	ST1		
INTERFACE	ST 2		
STORE	ST 3		
FILE	ST 4		
FUNCTION	ST 5		
CONST.	ST 6		
RESULTS	ST 7		
STATS	ST 8		
Next page	PG 0		
Previous page	PG1		
STORE/RECALL			
SET-UP			
STORE	SS /	1 to 16	store no.
RECALL	RS /	1 to 16	store no.
CLEAR	CS /	1 to 16	store no.
RESULT			
STORE	SR /	1 to 9	store no.
LEARN PROGRAM			
LEARN	# L /	1 to 9	program no.
QUIT	# Q		
EDIT	# E /	1 to 9	program no.
INSERT	# I		
DELETE	# D		
NEXT	# F		
PREV	# B		
QUIT	# Q		
CLEAR	# C /	1 to 18	program no.
COPY	# K /, /	1 to 18, 1 to 18	program nos
JUMP	JP /	1 to 99	line no.
LIST	# P /	1 to 18	program no.

Parameter	Command	Argument	Setting
SELF TEST			
TEST	TT 0		
INIT	TT 1		
RESET	TT 2		
TIME	TM I, / TM0? TM1? TM2?	0 to 23, 0 to 59	hours, minutes hours? minutes? seconds?
EXECUTE PROGRAM	EP I	1 to 18	program no.
MINI-STATUS	SM I	0 1	next prev
DIRECT ACTIONS:			
BREAK	BK		
LOCAL	LL		
REMOTE	RM		
PAUSE/CONT.	CP		
RECYCLE	RE		
SINGLE	SI		
SWEEP HOLD	HS		
Output last results.	DO		
Clear errors.	CE		
ANALYZER			
QUERIES:			
AUTO ∫ TIME	AI?		
AUTORANGE		Returns actual range used for measurement when Range is set to Autorange.	
VOLTAGE 1	AR0?		1 = 30mV
VOLTAGE 2	AR1?		2 = 300mV
CURRENT	AR2?	(To query Range set, use RAn?, where n=1 for V1, 2 for V2, 3 for I)	3 = 3V
VIEW FILE QUERIES:			
Readings taken	NR?		
Readings accepted	NA?		
Readings filed	FP I?	0 1	no. of readings? file pointer?
PROGRAM			
QUERY	PN I?		No. of instructions for prog. n

Parameter	Command	Argument	Setting
SELF TEST			
QUERIES:			
Test results	TS?		
Last error	ER?		
FIRMWARE			
QUERY	VN?		version number
CALIBRATION			
QUERIES			
Week of cal.	WK?		
Place of cal.	PC?		
Year of cal.	YR?		
STATISTICS			
QUERIES			
Standard dev.	DV?		
Maximum	MA?		
Minimum	MI?		
Mean	MU?		
Variance	VS?		
CALIBRATION			
COMMANDS*			
Ideal cal. value	CAF	0 to 5	
Calibration mode	CM/	0	Normal first pass.
		1	No magnitue first pass.
		2	No phase first pass.
		3	Second pass: phase range-range adjustment.
		4	Generator calibration.
		5	Clear calibration data.
Forcing w/f freq.	DF F		Hz
Waveform	WF /	0	sine
		1	square
Year of calibration	YR /		
Week of calibration	WK /	1 to 53	
Calibration place	PC text	""	

* These commands are obeyed only when the instrument is operating in the calibration mode. The use of the calibration commands is described in the 1255/1260 Maintenance Manual.

COMMAND INDEX

Note: In the remote commands listed below

- *I* = integer,
- *F* = floating point number.

B edit program: go to previous line
 # C *I* clear program
 # D edit program: delete
 # E *I* edit program
 # F edit program: go to next line
 # I edit program: insert
 # K *I, I* copy program
 # L *I* learn program
 # P *I* list program
 # Q quit program

*CLS clear status
 *ESE event status enable
 *ESE? event status enable query
 *ESR? event status register query
 *IDN? identification query
 *OPC operation complete
 *RCL recall
 *RST reset
 *SAV save
 *SRE service request enable
 *SRE? service request enable query
 *STB? read status byte query
 *TST? self-test query

AA *I* plotter scaling:size
 AE *F* monitor error%
 AI? auto-integration time query
 AR1? autorange query, voltage 1 input
 AR2? autorange query, voltage 2 input
 AR3? autorange query, current input
 AU *I* analyzer auto-integration

BC *I* binsort A: step size
 BF *F* no. of meas. (*n*) after stop
 BG *I* binsort B: logic sense
 BK break
 BL *F* binsort A: bin min.%
 BM *F* sweep limits: V bias min.
 BN *I* binsort A: enable
 BP *I* error beep
 BR *I* binsort B: no. of retries
 BS *I* binsort A: stop after *n* meas.
 BU *F* binsort A: bin max.%
 BV *I* binsort B: logic levels
 BX *F* sweep limits: V bias max.
 BZ *I* binsort A: bin number

CA *F* ideal calibration value
 CC *I* display: circuit
 CE clear error code
 CF *I* clear function
 CI *I* display: current coordinates
 CL clear error message
 CM *I* calibration mode
 CO *I, I, F, F* scaling constant
 CP pause/continue (program)
 CV *I* display: voltage coordinates
 CS *I* clear set-up
 CY *I* display: admittance coordinates
 CZ *I* display: impedance coordinates

DC1, *I* input V1 coupling
 DC2, *I* input V2 coupling
 DC3, *I* input I coupling
 DE *I* scaling: dev Δ
 DF *F* Forcing waveform frequency
 DO output last result
 DS *I* scaling: dev Δ store
 DV? standard deviation query

EC *I* output echo (RS423)
 EP *I* execute program
 ER? last error query

FC clear file
 FD *I* display file
 FG *I* file format
 FL *I* output file line
 FM *F* sweep limits frequency min
 FO output file
 FP *I?* file query: blocks filed/pointer
 FR *F* generator frequency
 FU *I, text* scaling function
 FV *I* display: function coordinates
 FX *F* sweep limits: frequency max.

GD *I* plotter grid
 GN *F* group delay, negative
 GP *F* group delay, positive
 GT *I* generator type

HF *F* linear sweep: units/step
 HS sweep hold

IA *F* generator current amplitude
 IB *F* generator current bias
 IC *F* monitor current limit
 IM *F* sweep limits: I amplitude min.

IX <i>F</i>	sweep limits: I amplitude max.	QX <i>F</i>	sweep limits: I bias, max.
IP1, <i>I</i>	input V1 single/diff.	RA1, <i>I</i>	input V1 range
IP2, <i>I</i>	input V2 single/diff.	RA2, <i>I</i>	input V2 range
IS <i>F</i>	analyzer integration time	RA3, <i>I</i>	input I range
JP <i>I</i>	jump program line no.	RE	recycle measurements
LF <i>F</i>	linear sweep: points/sweep	RH <i>I</i>	data output: heading
LI <i>I</i>	limits check item	RM	remote
LL	local	RP <i>I</i>	command separator (RS423)
LV0, <i>F</i>	limits check: lower limit	RR <i>I</i>	output mode (RS423)
LV1, <i>F</i>	limits check: upper limit	RS <i>I</i>	recall set-up
		RT <i>I</i>	command terminator (RS423)
MA?	statistics query: maximum	SD <i>I</i>	sweep up/down
MC <i>I</i>	file clear: auto/manual	SF <i>F</i>	log sweep: points/sweep
MD <i>I</i>	analyzer mode	SI	single measurement
ME <i>I</i>	analyzer monitor	SM0	go to next mini-status page
MI?	statistics query: minimum	SM1	go to previous mini-status page
MS <i>F</i>	analyzer delay	SO, <i>I</i>	display: source
MU?	statistics query: mean	SP <i>F</i>	step vernier
NA?	file query: readings accepted	SR <i>I</i>	store result
NL <i>I</i>	null	SS <i>I</i>	store set-up
NO <i>I</i>	normalize	ST0	program status
NR?	file query: readings taken	ST1	microprocessor status
OI <i>I</i>	plotter Y-axis overlay item	ST2	interface status
OL <i>I</i>	plotter Y-axis o'lay limits: auto/man.	ST3	store status
OM0, <i>F</i>	plotter Y-axis overlay limits: min.	ST4	file status
OM1, <i>F</i>	plotter Y-axis overlay limits: max.	ST5	scaling function status
OP1, <i>I</i>	data putput (RS423)	ST6	scaling constant status
OP2, <i>I</i>	data output (GPIB)	ST7	results status
OP3, <i>I</i>	data output (file)	ST8	statistics status
OS <i>I</i>	command separator (GPIB)	SV <i>I</i>	serial poll configure (GPIB)
OT <i>I</i>	command terminator (GPIB)	SW <i>I</i>	sweep enable
OU1, <i>I</i>	input V1: grounded/floating	SX <i>I</i>	staticised result
OU2, <i>I</i>	input V2: grounded/floating	TI <i>text</i>	plotter title
OZ <i>I</i>	plotter Y-axis overlay log/lin	TM <i>I,I</i>	set time
PA <i>I</i>	plotter axes	TS?	test results query
PC?	place of last calibration	TT0	self test
PC <i>text</i>	calibration place	TT1	initialize
PD <i>I</i>	plotter device	TT2	reset
PG0	go to next status page	UW <i>I</i>	display: phase normal/unwrapped
PG1	go to previous status page	VA <i>F</i>	generator voltage amplitude
PL	plot (from file)	VB <i>F</i>	generator voltage bias
PN <i>I</i> ?	program query (length)	VC <i>F</i>	monitor voltage limit
PP <i>I</i>	parallel poll configure (GPIB)	VE <i>I</i>	plotter mode
PS <i>I</i>	parallel poll sense (GPIB)	VF <i>F</i>	parameter 1 value
PT <i>I</i>	plotter text enable	VL <i>F</i>	parameter 2 value
QM <i>F</i>	sweep limits: I bias, min.	VI <i>I</i>	display: variable
		VM <i>F</i>	sweep limits: V amplitude min.
		VN?	version number

VP /	plotter Y-axis overlay pen
VR0	frequency vernier
VR1	amplitude vernier
VR2	bias vernier
VR3	plotter X-min. vernier
VR4	plotter Y-min. vernier
VR5	plotter X-max. vernier
VR6	plotter Y-max. vernier
VS?	statistics query: variance
VX F	sweep limits: V amplitude max.
WF /	calibration waveform
WK /	calibration week
WK?	week of last calibration
XB F	plotter scaled size: X-min.
XI /	plotter X-axis item
XL /	plotter X-axis limits: auto/manual
XM0,F	plotter Y-axis limits: min.
XM1,F	plotter Y-axis limits: max.
XO /	XOFF/XON select (RS423)
XP /	plotter X-axis pen
XT F	plotter scaled size: X-max.
XZ /	plotter X-axis lin/log
YB F	plotter scaled size: Y-min.
YI /	plotter Y-axis item
YL /	plotter Y-axis limits: auto/man.
YM0,F	plotter Y-axis limits: min.
YM1,F	plotter Y-axis limits: max.
YP /	plotter Y-axis pen
YR /	calibration year
YR?	year of last calibration
YT F	plotter scaled size: Y-max.
YZ /	plotter Y-axis log/lin

Messages and Error Codes

<i>Section</i>	<i>Page</i>
9.1 Introduction	9.2
9.2 Command Summary	9.3
Group 0: Command Structure	9.3
Group 1: Learn Program	9.3
Group 2: Combined Parameters	9.4
Group 3: Generator	9.5
Group 4: Learnt Program; History File; Vernier	9.5
Group 5: Missing Modules	9.6
Group 6: Illegal input/Output	9.6
Group 7: System/Calibration	9.7
Group 8: Measurement Validity	9.8
Group 9: Store/recall	9.8

9.1 INTRODUCTION

Displayed messages tell the user:

- a) that an operation has been completed,
- b) that an undesirable situation exists, or
- c) that the requested operation is not possible.

Each message is preceded by number, e.g. "81. INPUT OVERLOAD". Where necessary, this number is included in the data output to remote devices as an error code. Messages are accompanied by a *beep*, unless this is switched off from [DISPLAY] ERROR BEEP. A message is displayed only briefly but can be recalled using the STATUS menu (μ P, first page, LAST ERROR) or the ER? remote command.

Messages are classified according to the first digit of the message number. The meaning of each message is explained in this chapter, under the class number and area of application.

9.2 ERROR CODE SUMMARY

9.2.1 GROUP 0: COMMAND STRUCTURE

MESSAGE	EXPLANATION
01. UNKNOWN COMMAND	Command not included in instrument command set
02. ARG MISMATCH	Command contained the wrong type, or wrong number, of arguments.
03. OUT OF RANGE	Argument value out of range.
04. FORMAT ERROR	Floating point format error. Attempt made to enter a floating point number in an incorrect format, e.g. 1.2.5E2 instead 1.25E2.
05. ILLEGAL REQUEST	Illegal request for parameter value. Some control parameters have no value, e.g. HS (sweep hold).
06. INVALID FUNCTION	Function syntax error.
07. NO. OUT OF RANGE	Integer out of range for store or constant in scaling function.
08. INVALID SYMBOL	Attempt made to enter an invalid symbol in scaling function.
09. AMPL ILL. FOR HF	Attempt made to enter an amplitude >1V at a frequency >10MHz.

9.2.2 GROUP 1: LEARNT PROGRAM

MESSAGE	EXPLANATION
11. ILLEGAL EDIT	After EDIT has been selected, with an <i>En</i> command, the only valid commands are: #F Select next instruction. #B Select previous instruction. #I Insert command(s) that follow as program instruction(s). #D Delete presently selected instruction. #Q Quit edit.
12. ILLEGAL COMMAND	Command cannot be learnt. Some commands, e.g. <i>En</i> (edit), cannot be used as learnt program instructions.
13. NO SUCH PROGRAM	Program does not exist, under number specified.
14. NESTING ERROR	Invalid recursion attempted. A program can execute itself only if the <i>execute program</i> instruction (<i>EPn</i>) is the last instruction entered before *Q (quit). (Continued on next page.)

Or, program “nesting” to more than five levels attempted. For example, the sequence:

P1:EP2→ P2:EP3→ P3:EP4→ P4:EP5→ P5:EP6→ P6:EP7 results in error message 14 at the command EP7. (P1:EP2 means “Program 1 commands the execution of Program 2”, and so on.) However, if EP7 were EP1 then the sequence would be valid - just.

15. PROGRAM RUNNING	Attempt made to edit a running program. Stop the program, using BREAK, and try again.
16. PROG. CHKSUM ERR.	Program checksum error. When learnt programs are stored in memory a checksum is calculated and stored with the program data. Before a stored program can be used, a new checksum is calculated, and compared with the original. If the checksums disagree, the stored data is presumed to have been corrupted. The program is not executed and ERROR 16 is displayed. The remedy is to initialize the instrument: the SUPERVISOR mode must be selected if the program number is 10 or above.
17. PROGRAM EXISTS	Attempt made to learn a program, using the number of an existing program. Previously learnt programs must be cleared before another program can be learnt under the same number.
18. PROG. CLEARED	Specified program has been cleared.
19. COPY COMPLETE	Specified program has been copied.

9.2.3 GROUP 2: COMBINED PARAMETERS

MESSAGE	EXPLANATION
20. SWEEP COMPLETE	A measurement sweep has been completed.
21. SWEEP NOT SET UP	Sweep limits, or increment/decrement, not entered. Or, maximum<minimum.
22. GEN OVERLOADED	Generator overloaded, due to excessive peak current demand, i.e. peak ac+dc.100mA.
23. NULL/NORMALIZED	Nulling or normalization complete.
24. ILL NULL SOURCE	Source for null must be V1/I, V2/I, I/V1, I/V2.
25. PLOTTER LIM. ERROR	X-MIN greater than X-MAX, or Y-MIN greater than Y-MAX, in [PLOTTER SCALING] menu. Or, invalid MINIMUM or MAXIMUM value entered for a log item in the [PLOTTER X-AXIS] or [PLOTTER Y-AXIS] menu.

27. GPIB/PLOTTER ERR.	If results are to be plotted from the history file, the GPIB data output should be set to [off]. Or, if results are to be plotted as measurements are made, the GPIB data output should be set to [plotter].
28. NUL/NORMALIZE ON	You are not allowed to change the sweep parameters when <i>null</i> or <i>normalize</i> is selected.
29. RENUK/NORMALIZE	Present null/normalization data invalid, due to change in sweep parameter(s) or null/normalization not yet done.

9.2.4 GROUP 3: GENERATOR

MESSAGE	EXPLANATION
31. GENERATOR KILLED	Generator output <i>killed</i> . KILL signal applied to rear panel connector: inner shorted to outer, or inner held at TTL logic `0`.
32. GENERATOR O/LOAD	Generator overload, or power fail.
34. GEN RESTART	Generator output reinstated. KILL signal removed from rear panel connector.

9.2.5 GROUP 4: LEARNT PROGRAM; HISTORY FILE; VERNIER

MESSAGE	EXPLANATION
40. FILE CLEARED	History file cleared.
41. LINE NO. ERROR	Line number specified in a <i>jump</i> instruction (JPi) was not found. (Line numbers can be assigned only in remotely compiled programs).
42. ILLEGAL JUMP	<i>Jump</i> has been commanded without <i>learn program</i> selected.
43. OUT OF RANGE	Vernier adjustment attempted outside parameter range, when parameter is already at maximum value. (The first attempt to enter a value outside the parameter range, with the present setting in range, results in the parameter being set to the maximum value: no error message is given at this time.)
44. FILE EMPTY	History file empty.
45. ILL FILE ACCESS	Illegal file access attempted. It is illegal to display, list, or clear the history file whilst the analyzer is running. Or plot attempted whilst measurement in progress. (Plot uses file contents.)

46. ILL FILE SIZE	Sweep too large. With [on] or [evaluate] selected for null or normalize the following max. file sizes apply:	
	Analyzer Mode	Max. File Size
	null normal	280
	null group delay	243
	normalize normal	243
	normalize group delay	192
47. FILE NOT EMPTY	History file not empty. Attempt made to alter the file format before clearing the file contents.	
48. G. DELAY/FILE ERR.	Incompatible file format. The analyzer is operating in <i>group delay</i> MODE, whilst the history file FORMAT is set for <i>normal</i> measurements. Initially the message is just a warning, but any attempt to display group delay parameters will cause the message to be repeated.	
49. VERNIER N/A	Attempt made to adjust plotter parameters with vernier whilst recycled measurements are being made. Or sweep in progress.	

9.2.6 GROUP 5: MISSING MODULES

These messages are returned when an attempt has been made to use a hardware module (printed circuit board) that is not fitted.

MESSAGE	EXPLANATION
50. NO SUCH ANALYZER	Analyzer not fitted.
52. NO GENERATOR	Generator not fitted.
53. NO HF GENERATOR	H F Generator not fitted.
54. NO ANALYZER CTRL	Analyzer control not fitted.
55. NO SYNTHESIZER	Synthesizer not fitted.
56. NO HF SYNTH.	H F Synthesizer not fitted.

9.2.7 GROUP 6: ILLEGAL INPUT/OUTPUT

MESSAGE	EXPLANATION
60. ILL. I/O CHANGE	Input/output device changed during <i>learn</i> sequence. The input/output device (controller/front panel) was changed whilst a program being learnt. The program was terminated automatically but remains usable up to the point where the change was made.
61. DEV. NOT ENABLED	Attempt made to change operating conditions from a non-enabled input/output device. For example, an RS423 device has attempted to send commands whilst the instrument is under <i>local lock-out</i> GPIB control. For more information on the combined use of RS423 and GPIB devices see Chapter 7, Section 7.5.2.

(62) WARNING:V1 NOT DIFF	Displayed if single-ended inputs are selected for the Voltage 1 input when an impedance measurement is made. Select differential inputs, otherwise the measurement will include the impedance of the current analyzer.
(63) WARNING:V2 NOT DIFF	Displayed if single-ended inputs are selected for the Voltage 2 input when an impedance measurement is made. Select differential inputs, otherwise the measurement will include the impedance of the current analyzer.
64. AUTO-CLEAR OFF	For NULL or NORMALIZE set CLEAR in FILE CONFIGURE to [auto].
65. INTERLOCK	Interlock signal negated during a binsort. Binsort suspended.
66. OPEN LOOP MODE	The component handler has asserted the SOS line before measurement completion. The handler is now in open loop mode. Measurements will continue in this mode, but are unlikely to be valid.
67. SORTING FINISHED	The specified number of components have been sorted. To sort another batch another BF command must be sent or stop check must be disabled (BS=0).

9.2.8 GROUP 7: SYSTEM/CALIBRATION

MESSAGE	EXPLANATION
70. OUT OF MEMORY	No further memory is available for the operation attempted. To make more room, delete any unwanted programs/functions and/or reduce size of program. ERROR 70 is also returned when attempt is made to copy to non-volatile memory when this has insufficient room.
71. NV RAM CORRUPTED	Non-volatile memory not initialized, or contents invalid. The remedy is to initialize the instrument, with the <i>supervisor</i> mode selected.
72. NOT SUPERVISOR	Rear panel keyswitch incorrectly set. Some learnt program operations can be performed only when the keyswitch is set to SUPERVISOR.
73. CAL. DATA CLEARED	Calibration data cleared.
74. I/P UNREASONABLE	Input to channel being calibrated is outside calibration range.
75. CAL. DATA CORRUPT>	One copy of calibration data is corrupted.
76. RECALIBRATE	Both copies of calibration data are corrupted. Instrument should be recalibrated as described in 1255/1260 Maintenance Manual.
77. ILL RANGE COMB.	Autorange is not applicable. Attempt made to calibrate with autorange selected. Or wrong combination of range commanded.

78. ILL FREQUENCY	Illegal frequency. Calibration frequency incorrectly set.
79. ILL CAL. SOURCE	Illegal calibration source.

9.2.9 GROUP 8: MEASUREMENT VALIDITY

MESSAGE	EXPLANATION
81. INPUT OVERLOAD	Overload on displayed channel(s).
82. AUTO INT. FAILED	Auto-Integration terminated before valid result obtained.
83. O/L + A. INT FAIL	Combination of Errors 81 and 82.
84. MONITOR FAILED	Failure to reach the target value at the monitor input, within the defined error %.
85. O/L + MON. FAIL	Combination of Errors 81 and 84.
86. MON. + A. INT FAIL	Combination of Errors 82 and 84.
87. OL, MON. + A/I FAIL	Combination of Errors 81, 82 and 84.
88. AUTO IMPED ERROR	When display CIRCUIT is set to [auto] the analyzer MODE must be set to [auto impedance].
89. G. DEL NOT SET UP	Group display not set.

9.2.10 GROUP 9: STORE/RECALL

MESSAGE	EXPLANATION
90. NO SUCH SET-UP	Attempt made to recall or clear an empty set-up store; or a checksum error has been detected on recalling a stored set-up.
91. SET-UP STORED	Control set-up stored.
92. SET-UP RECALLED	Control set-up recalled.
93. SET-UP CLEARED	Control set-up cleared.
94. SET-UP EXISTS	Set-up store in use. Before the store can be re-used it must be cleared.
95. RESULT STORED	Present result stored.
98. FUNCTION EXISTS	Attempt made to write a function under a number which is already in use. A used function must be cleared before a new function can be written under the same number.
99. NO SUCH FUNCTION	Attempt made to scale a measurement result by a non-existent function.

10

Measurement Scaling and Limit Checking

<i>Section</i>	<i>Page</i>
10.1 Scaling Facilities	10.3
10.2 Normalizing Sweep Measurements	10.3
10.3 Scaling a Measurement	10.5
10.3.1 Checking the Constants Store	10.5
10.3.2 Entering a Scaling Constant	10.6
10.3.3 Checking the Function Store	10.8
10.3.3.1 Accessing the Function Status Page	10.8
10.3.3.2 Accessing the Program/Function (Memory) status page	10.9
10.3.4 Clearing a Scaling Function	10.10
10.3.5 Entering a Scaling Function	10.11
10.3.6 Scaling Function Examples	10.12
10.3.6.1 Assigning Fixed Values	10.12
10.3.6.2 Entering the Function	10.14
10.3.7 Applying a Scaling Function	10.19
10.4 The Limits Facility	10.21
10.4.1 Setting the Limits	10.21

10.1 SCALING FACILITIES

Measurement results may be scaled in two ways:

- a) sweep measurements may be *normalised*, and
- b) individual results may have a scaling function applied to them.


These two facilities may be used independently. When they are both used, normalisation occurs before function.


10.2 NORMALIZING SWEEP MEASUREMENTS

The normalize facility computes the ratio of two sets of values, *normalize* values and the values resulting from a subsequent measurement sweep. Two useful applications are:

- Separating measurement results from background data
- Measuring the effect of a modification on the item under test. Three simple steps - normalize, modify, measure - give measurement results that are related to the *difference* in the item under test, after modification.

To normalize a sweep, set up the initial test conditions, set the sweep parameters, ensure that DATA OUTPUT, FILE is set to [all] and then

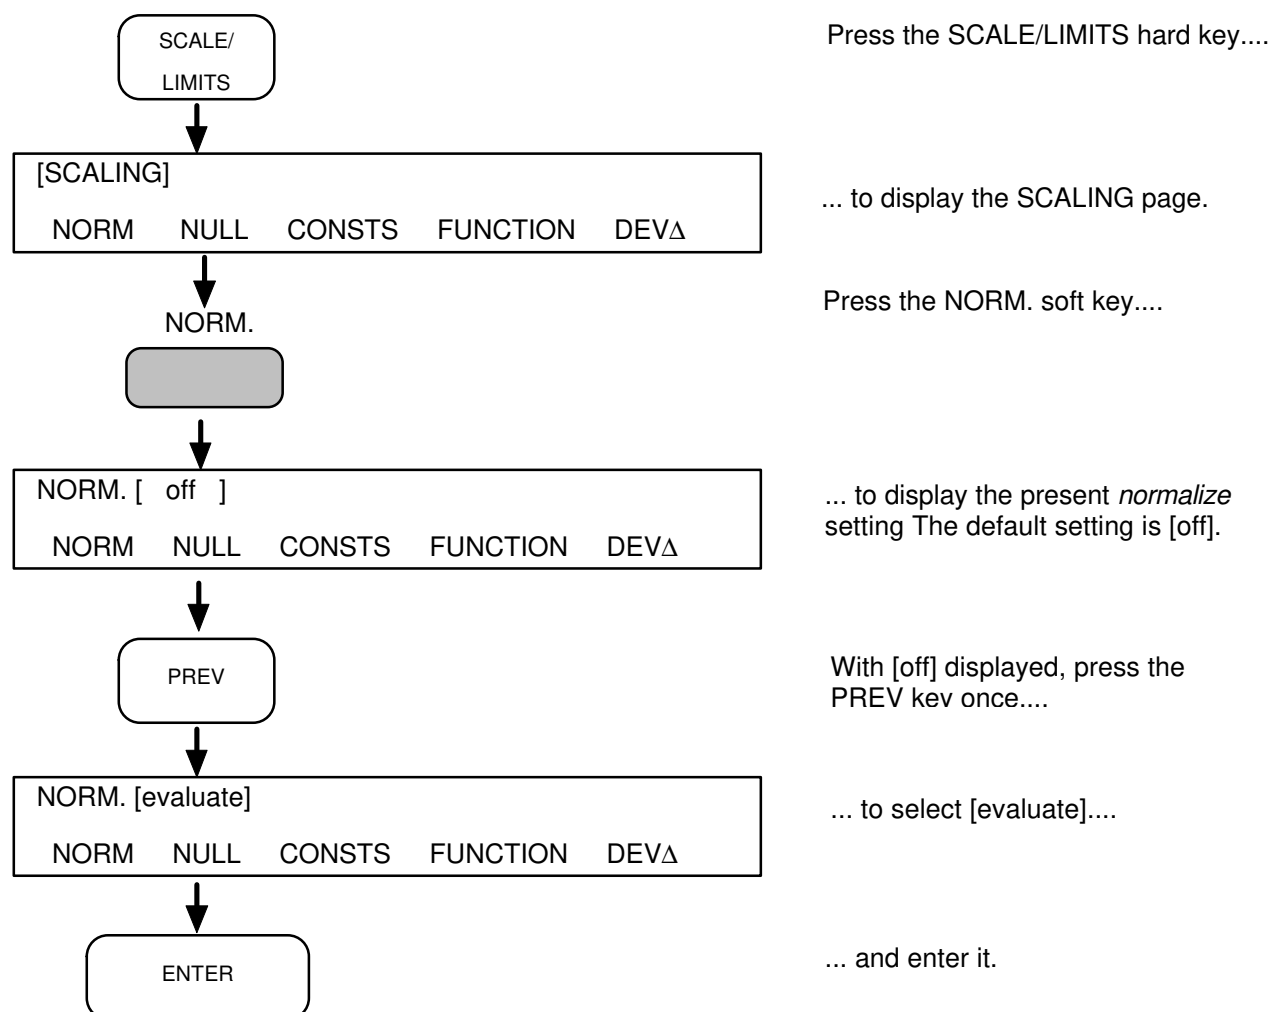

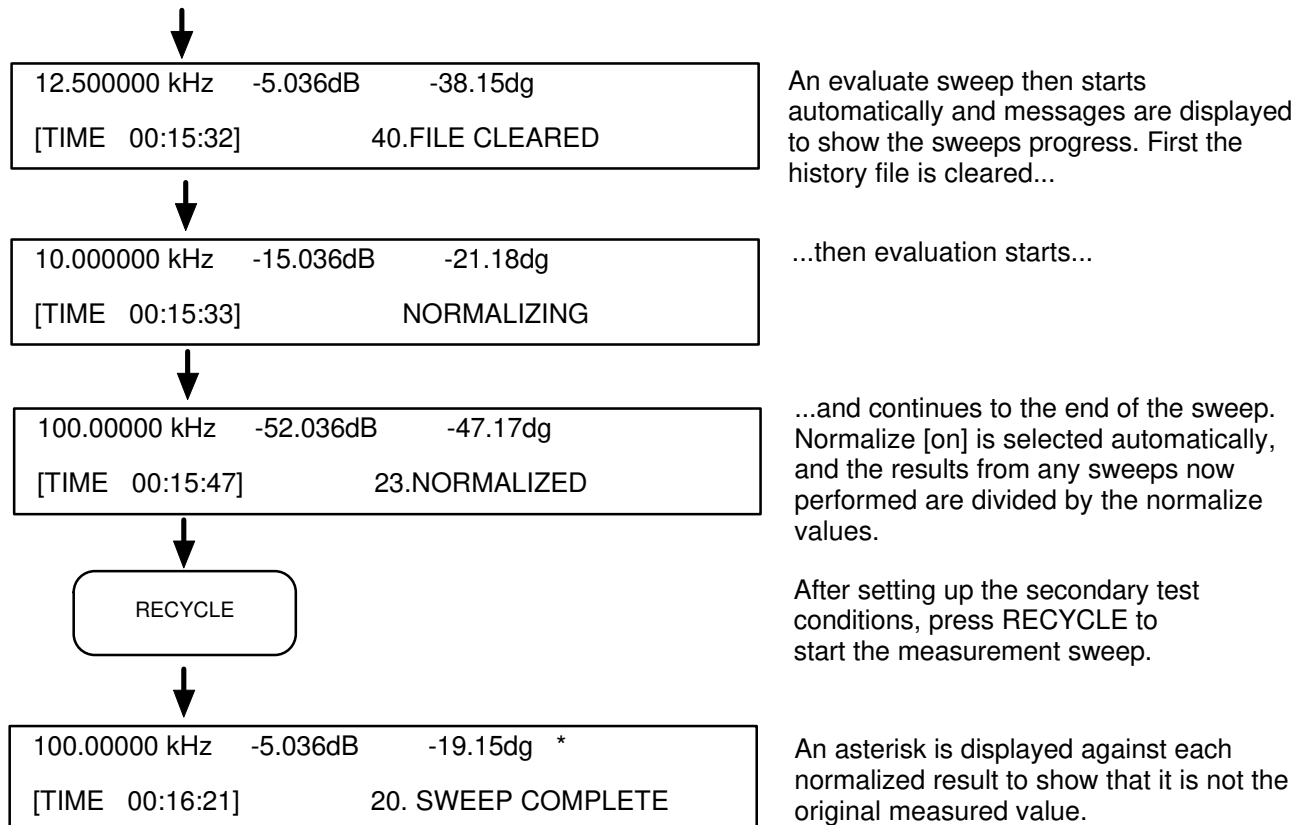

While the sweep parameters remain at their present settings the normalize facility may be used as required, by entering NORM. [on] or [off].

Changing the sweep parameters after [evaluate] has been entered invalidates the present normalize values, "29. RENORMALIZE", until [evaluate] is entered again.

10.3 SCALING A MEASUREMENT

Individual measurements are scaled by entering a user-defined scaling *function* and then selecting "FUNCTION" as the display source. A scaling function may include user-defined scaling *constants*.


Eighteen scaling *functions* may be stored, nine in battery-maintained memory and nine in non-volatile memory. Nine scaling *constants* may be stored, in battery-maintained memory.

10.3.1 CHECKING THE CONSTANTS STORE

Before trying to enter a constant check that a slot is available for it.


If the instrument has been initialized since constants were last entered then the constants store will be completely clear and user-defined values may be entered under any number from 1 through 9, as described in Section 10.3.2.

If the instrument has not been initialized and you are uncertain of the constants stored, then the STATUS menu will show you. If space is not available, then you may overwrite the values stored under a constant slot already in use.

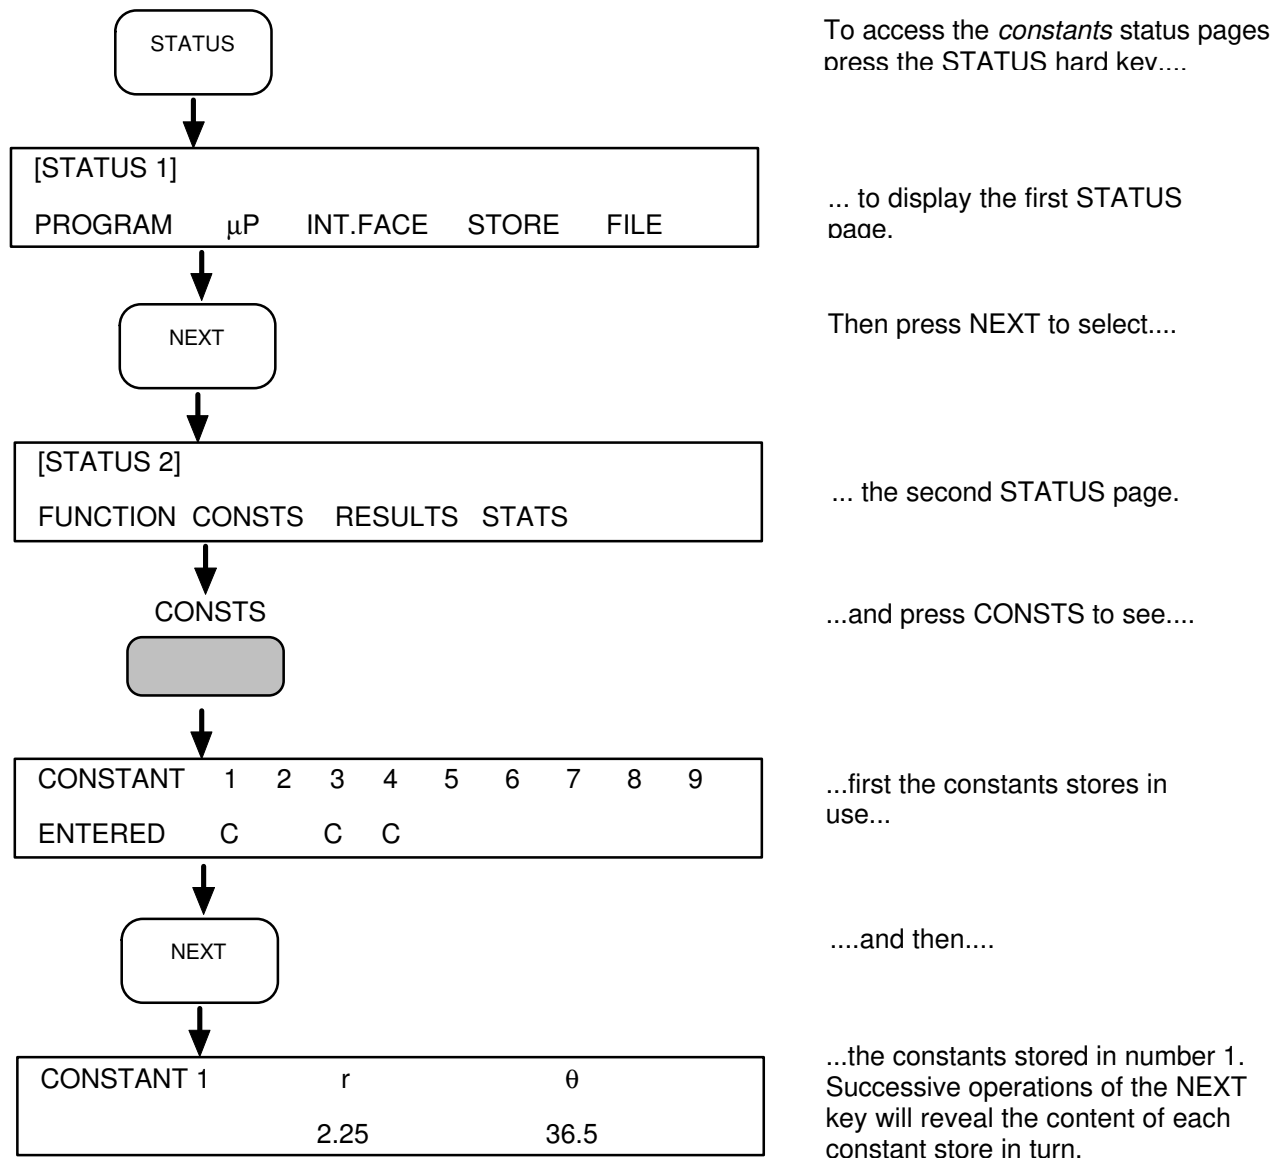

10.3.2 ENTERING A SCALING CONSTANT

To enter a scaling constant, the procedure is:

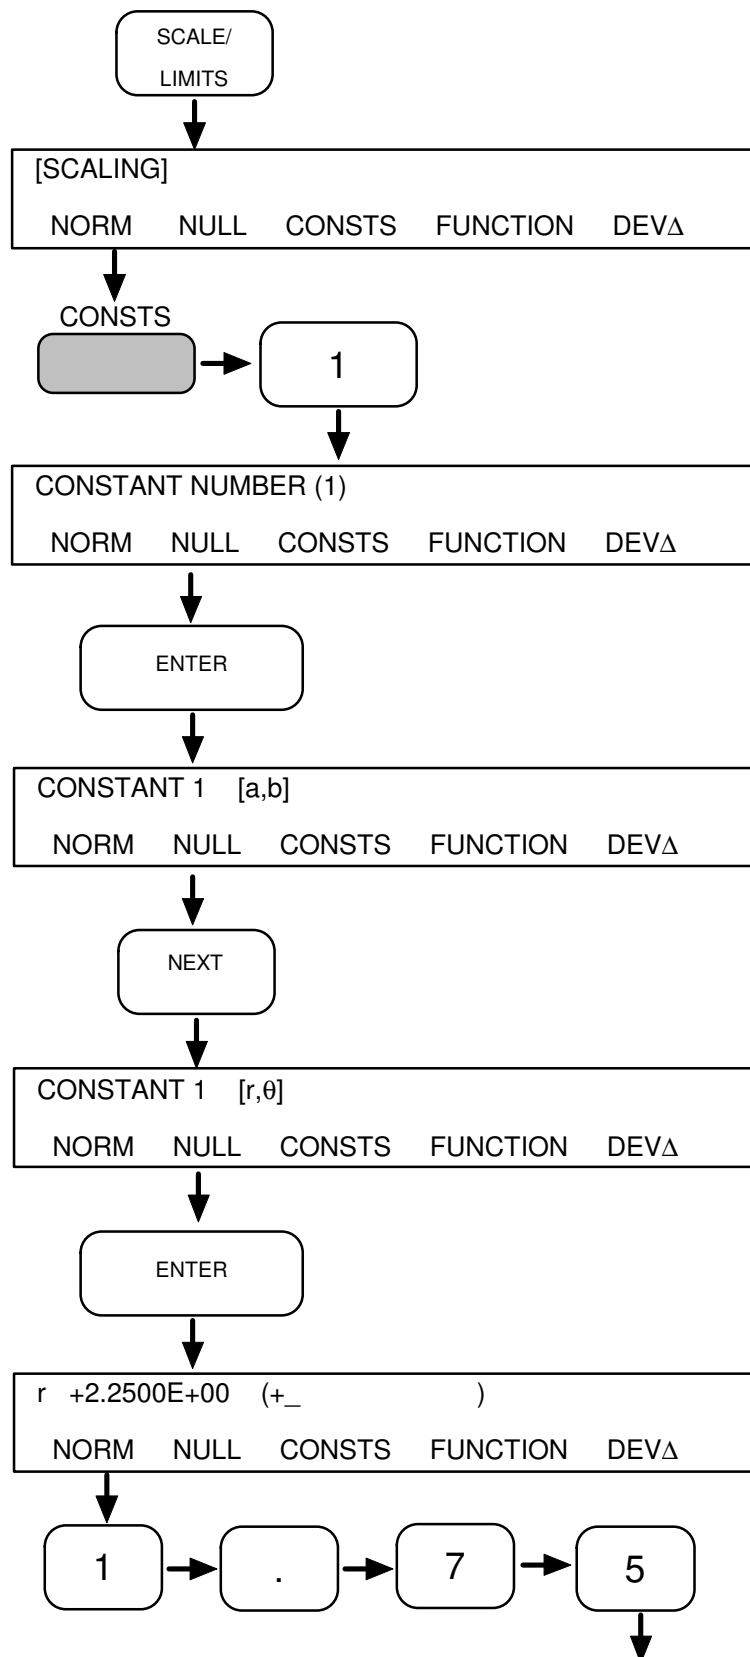

Press the SCALE/LIMITS hard key....

... to display the SCALING page.

Press the CONSTS soft key and assign the intended constant a number....

... e.g. 1

Enter the number...

...and the form of the intended constant is displayed. After *initialize* this is [a,b].


If the alternative form is wanted, select the next setting...

... which is [r,θ]...

... and enter it.

The present value of the r coordinate is now displayed and round brackets invite the entry of a new value.

If required, key in a new value, e.g. 1.75...

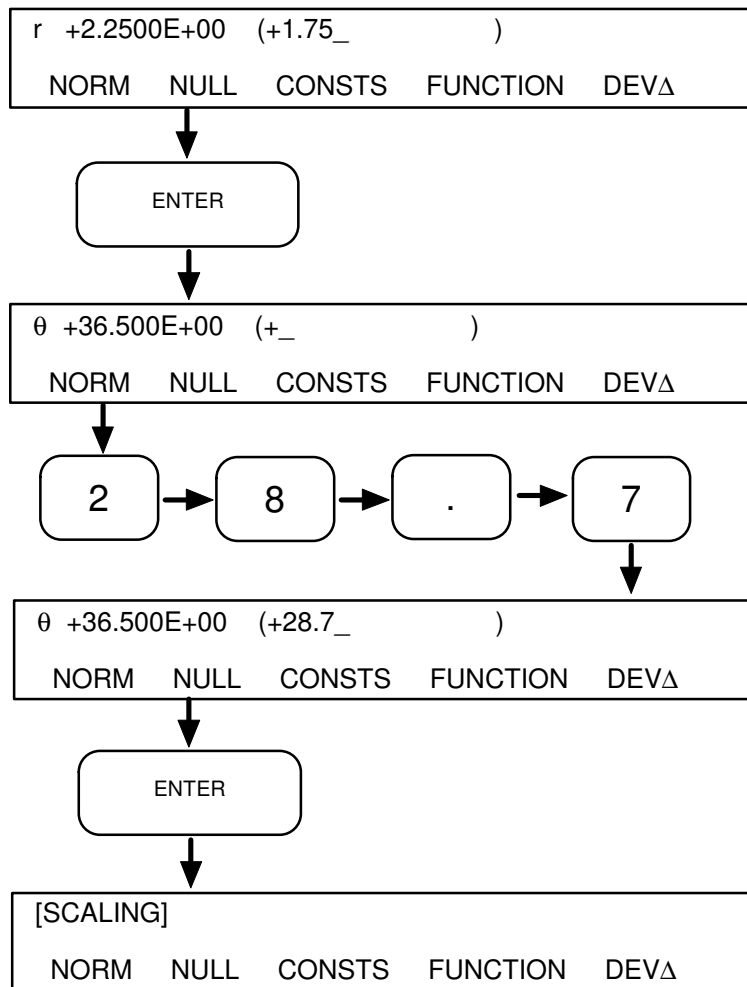

... and enter it.

Next, the present value of the θ coordinate is displayed, again with an invitation to enter a new value.

If required, key in a new value, e.g. 1.75...

... and enter it.

"SCALING" is displayed again to show that constant entry is complete.

10.3.3 CHECKING THE FUNCTION STORE

Before trying to enter a function check that

- a function slot is vacant (FUNCTION status) and
- sufficient memory space is available to hold the function (PROGRAM status).


If the instrument has been initialized since the functions were last entered then user-defined scaling functions may be entered under any number from 1 through 9, as described in Section 10.3.5.


If the instrument has not been initialized and you are uncertain of the contents of the function store, then the FUNCTION pages of the STATUS menu will show you. When all function slots are in use, you may clear unwanted functions selectively, as described in Section 10.3.4.

Stored functions and learnt programs use the same area of memory and the availability of this, for battery-sustained and non-volatile memory, appears under PROGRAM on the first STATUS page. A function uses two memory blocks.

10.3.3.1 Accessing the Function Status Page


To access the FUNCTION status pages:

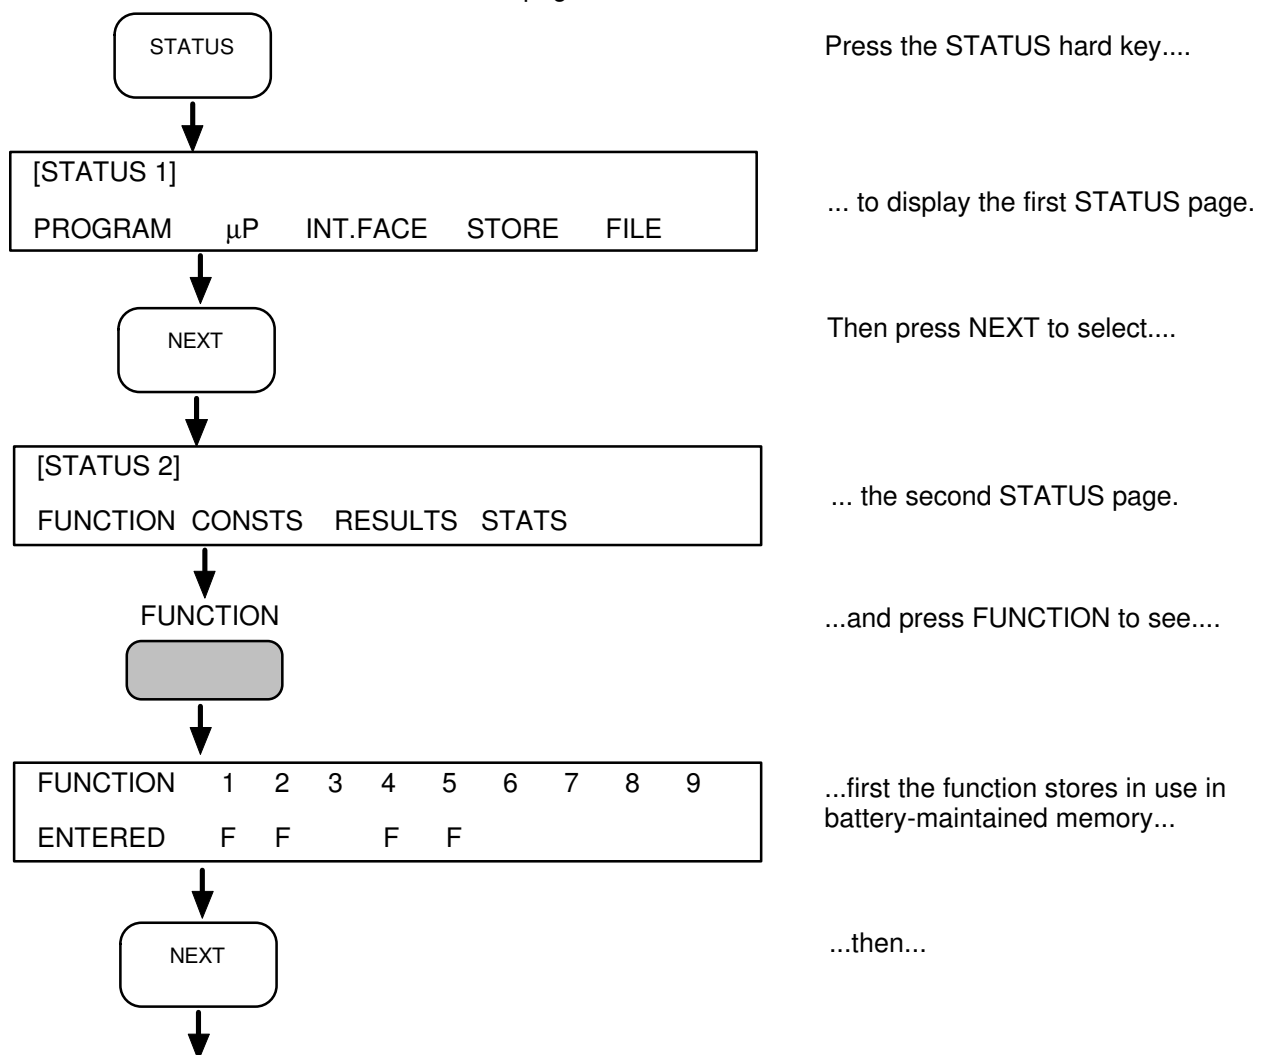

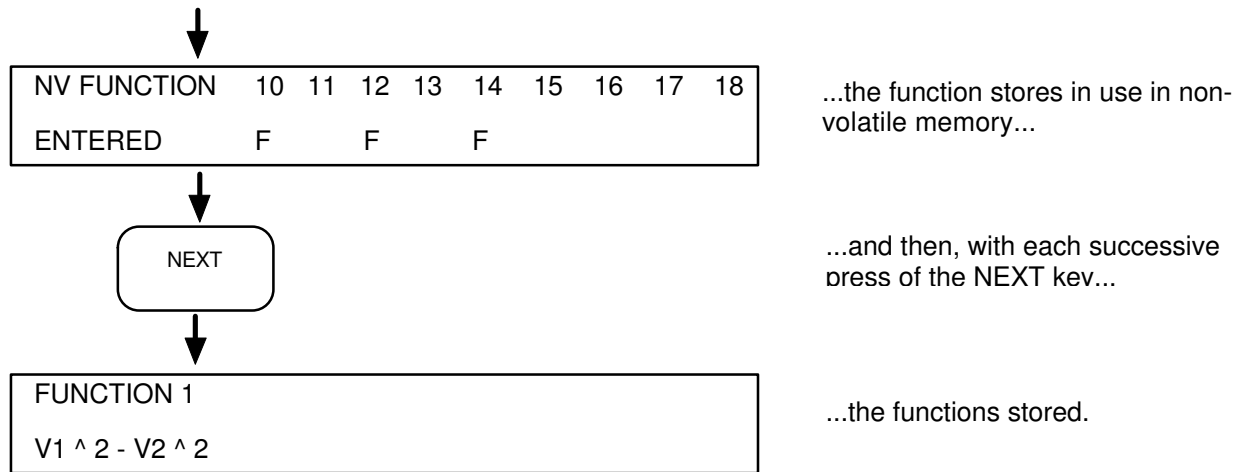

10.3.3.2 Accessing the Program/Function (Memory) Status Page

To access the program/function memory status page:

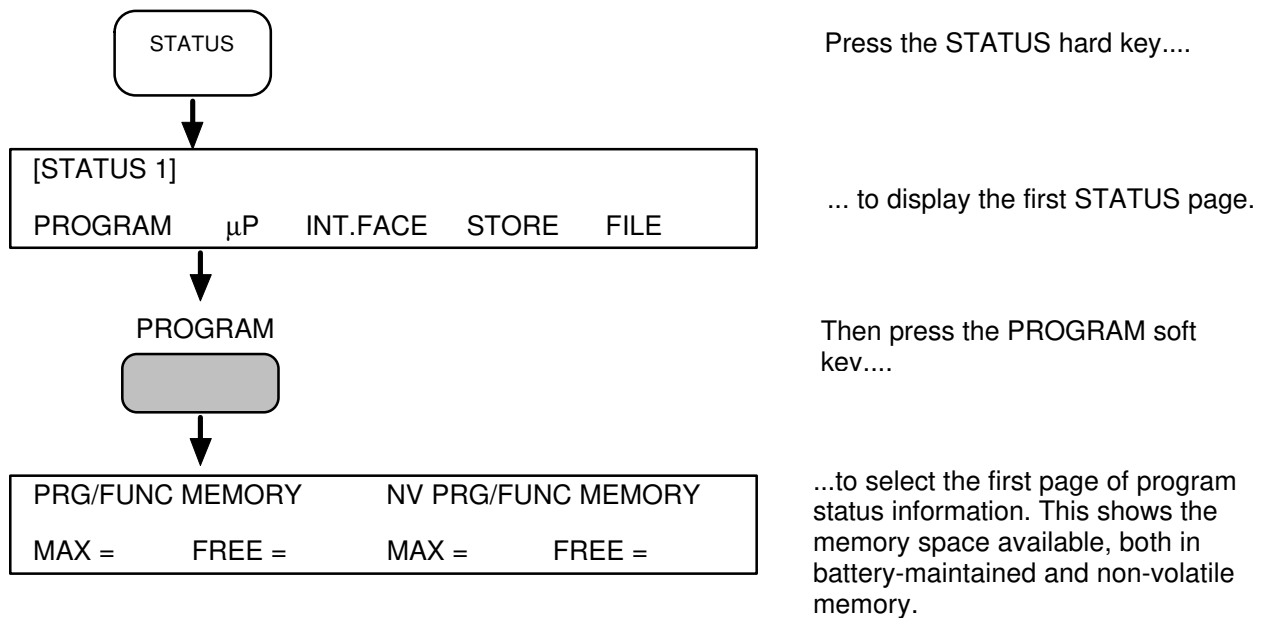


10.3.4 CLEARING A SCALING FUNCTION

If none of the functions presently stored in the instrument are wanted then the whole program/function memory may be cleared by initializing the instrument. Remember, however, that this will also erase the history file and other stored data and set the control settings to their default states.

The battery-maintained program memory (program/functions 1 through 9) is always cleared on initialization, but the non-volatile memory (program/functions 10 through 18) is cleared only if the instrument is operating in the supervisor mode, i.e. when the PROGRAM keyswitch on the instrument rear panel is set to SUPERVISOR and INITIALIZE has been commanded.


If you wish to keep the contents of the non-volatile memory, always set the PROGRAM keyswitch to NORMAL before initializing the instrument.

If some functions are wanted, or if you do not wish to initialize the instrument, then unwanted functions may be cleared selectively. The procedure is:

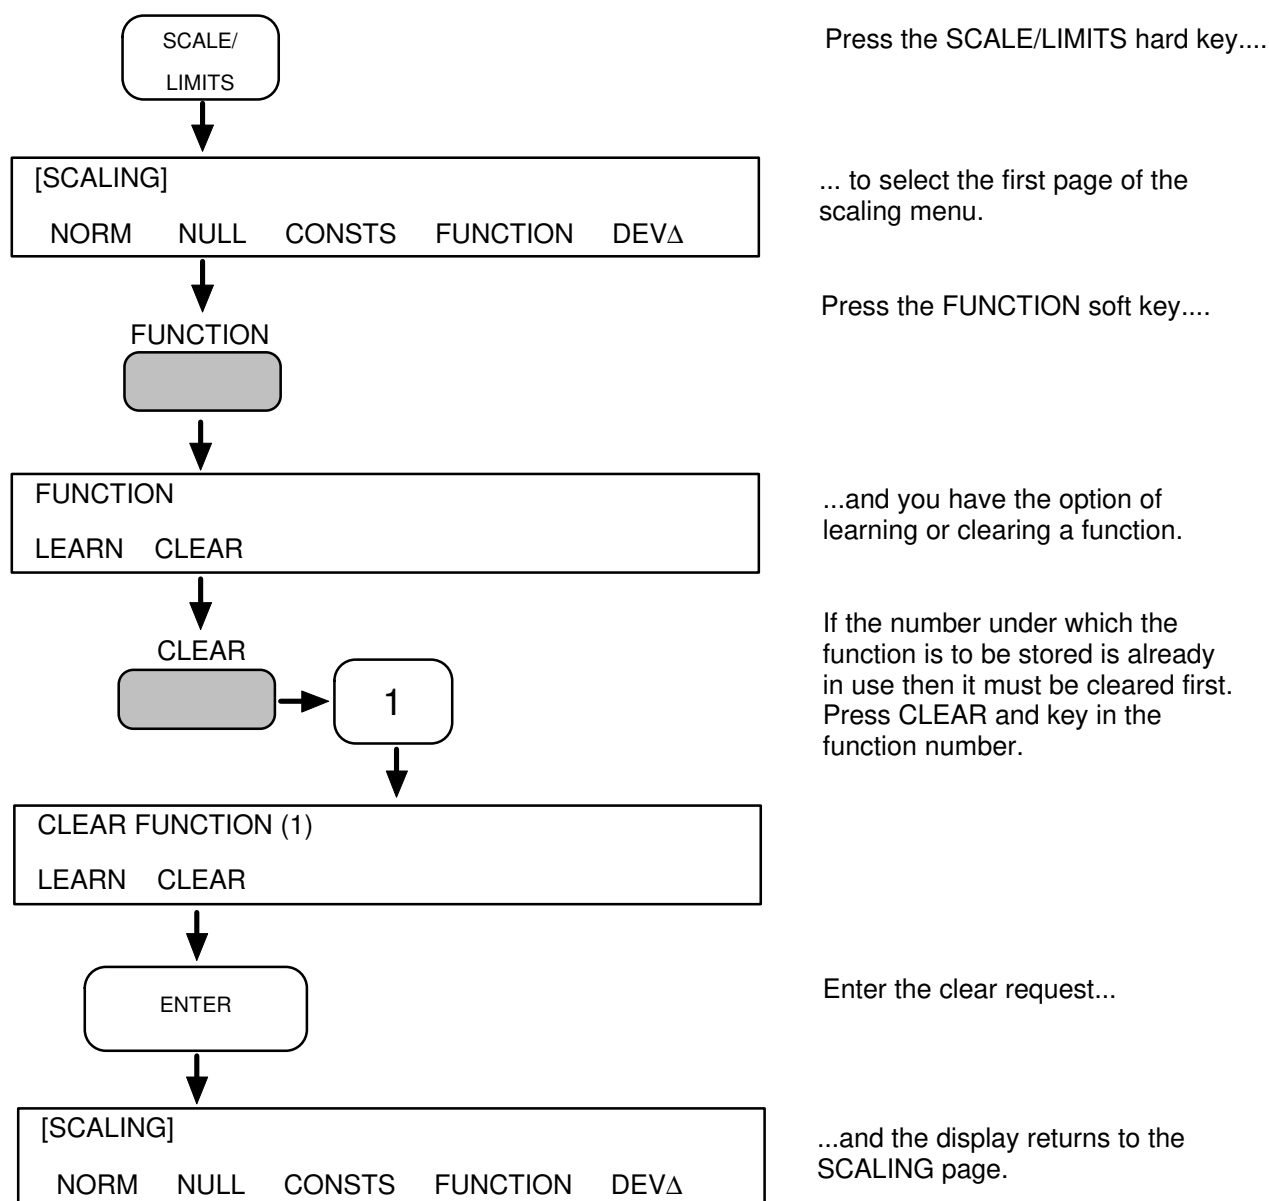

10.3.5 ENTERING A SCALING FUNCTION

To enter a scaling function:

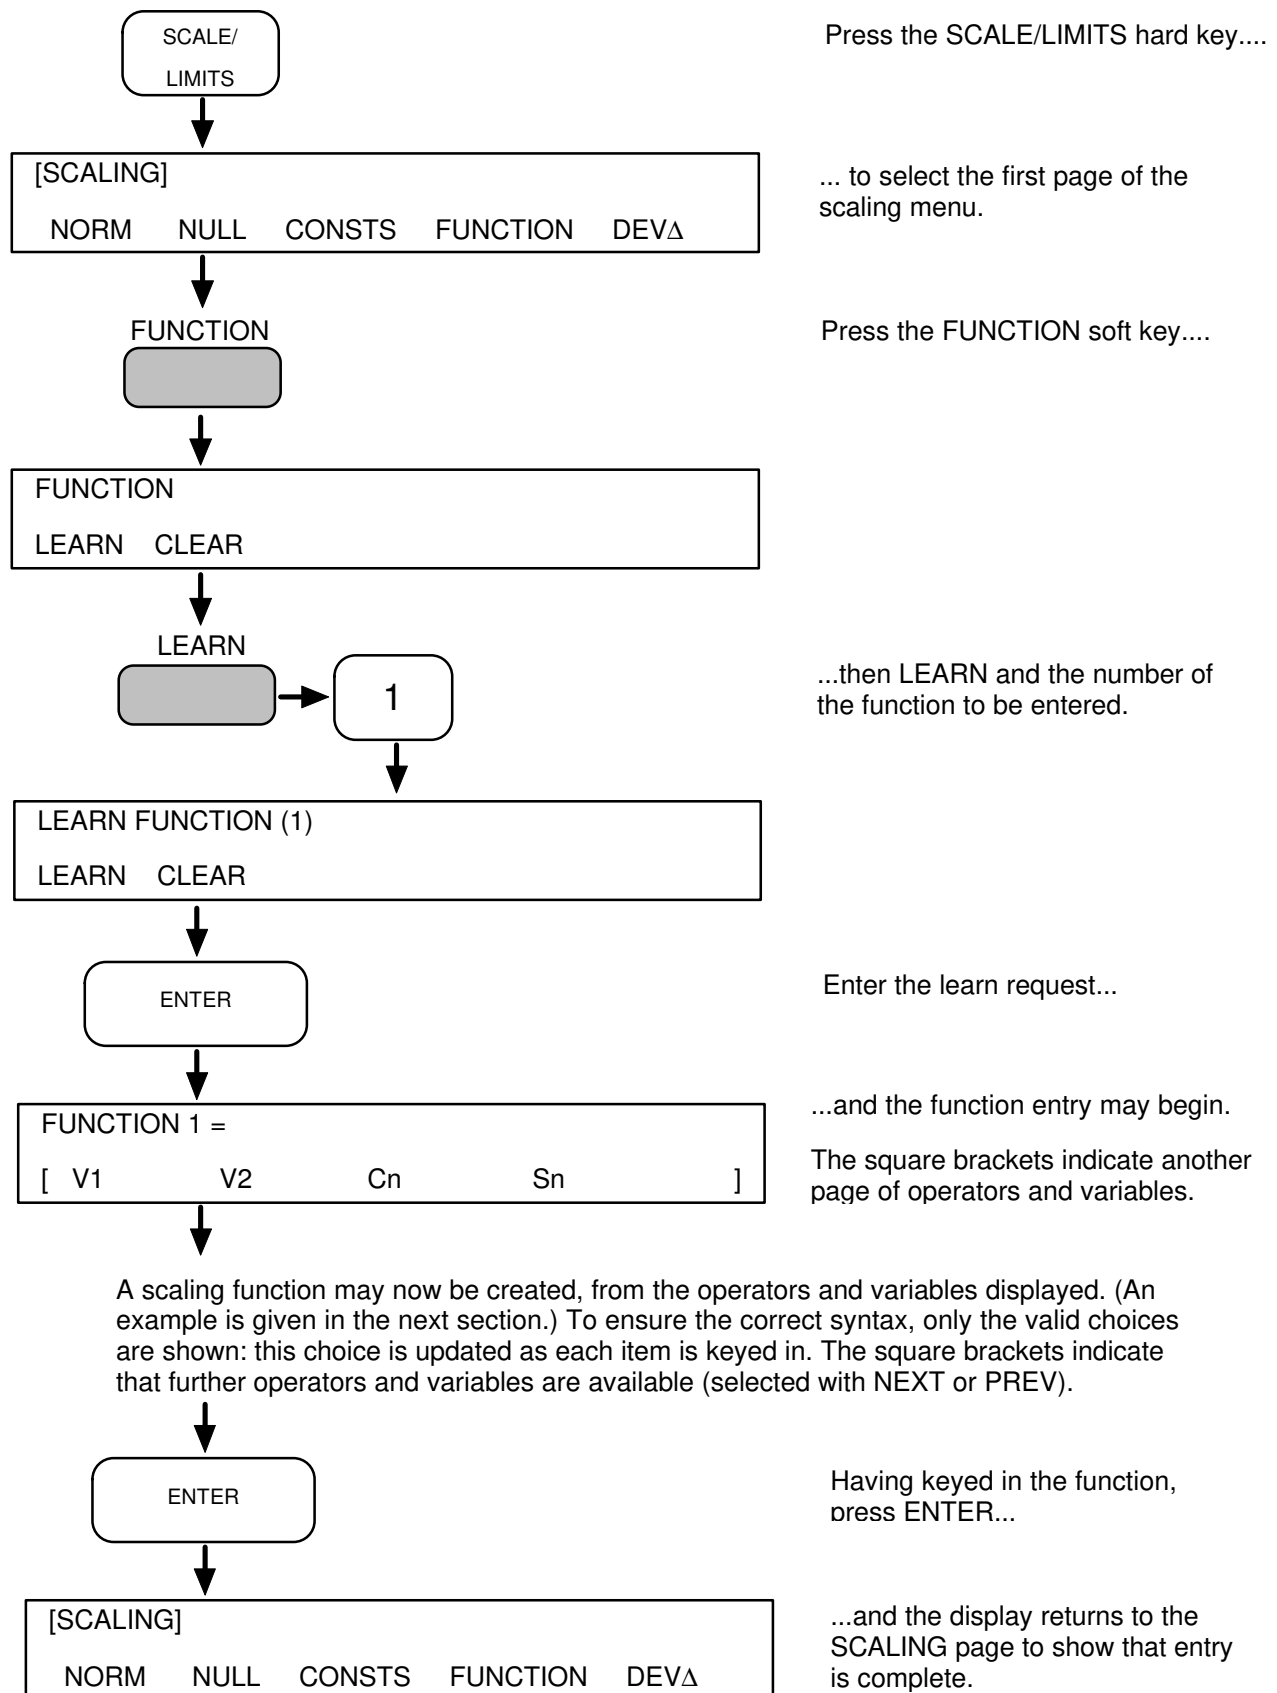

10.3.6 SCALING FUNCTION EXAMPLE

A practical example shows how scaling functions work. In this particular case the open-loop gain (A) of an amplifier is computed from the closed-loop gain (A'), using the function

$$A = \frac{A'}{1 - RA'}$$

where

$$A' = \frac{V_o}{V_i} = \frac{V_2}{V_1}$$

and


$$R = \frac{R_{input}}{R_{feedback}}$$


Note that all functions use vector arithmetic, i.e. $V1 = a + jb$

10.3.6.1 Assigning Fixed Values

Fixed values are assigned to a function from stored results (S_n) and user-defined constants (C_n). In the present example, therefore, the values "1" and R are stored as constants. This is done before entering the function itself.

The procedure is:

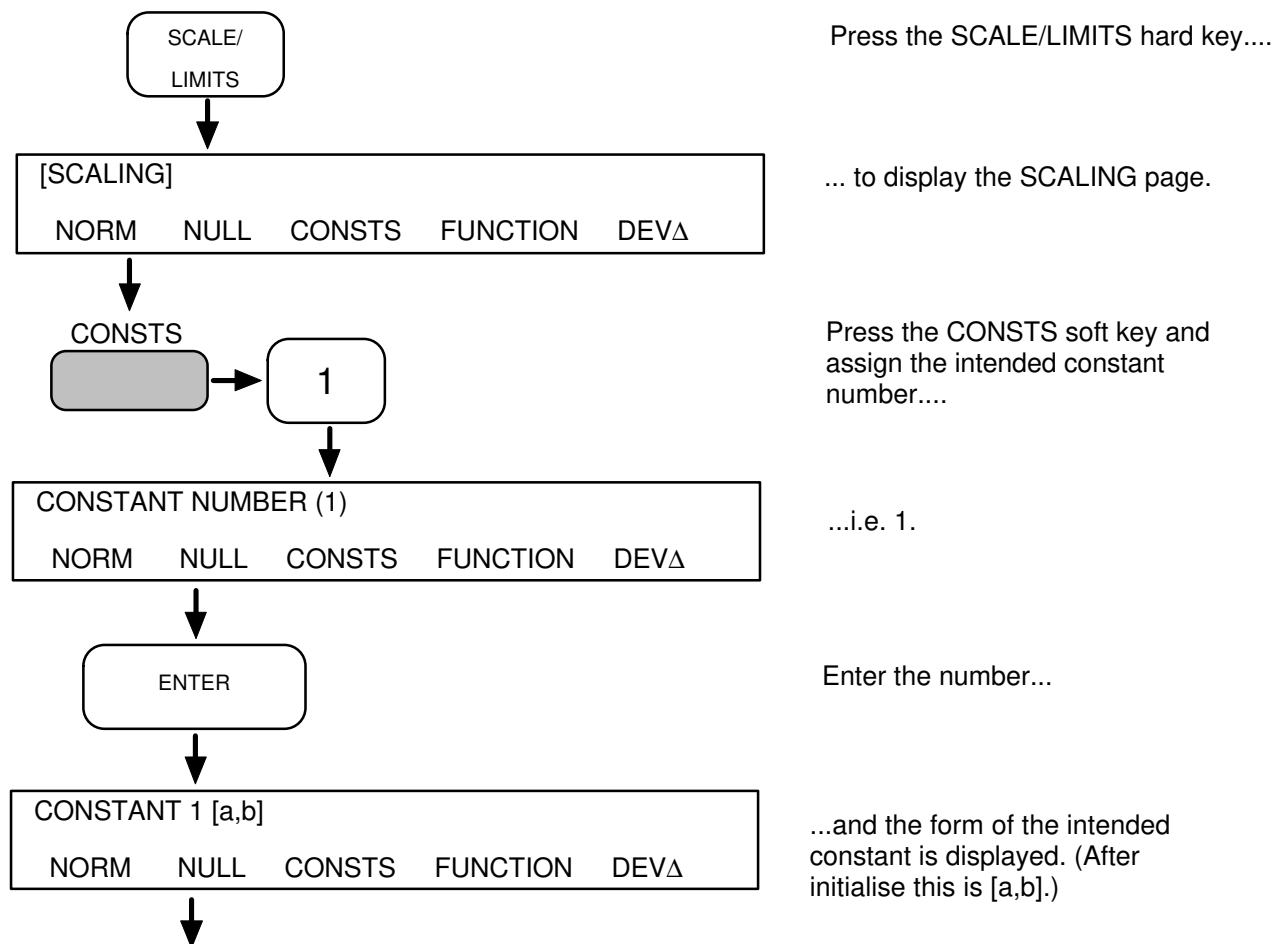

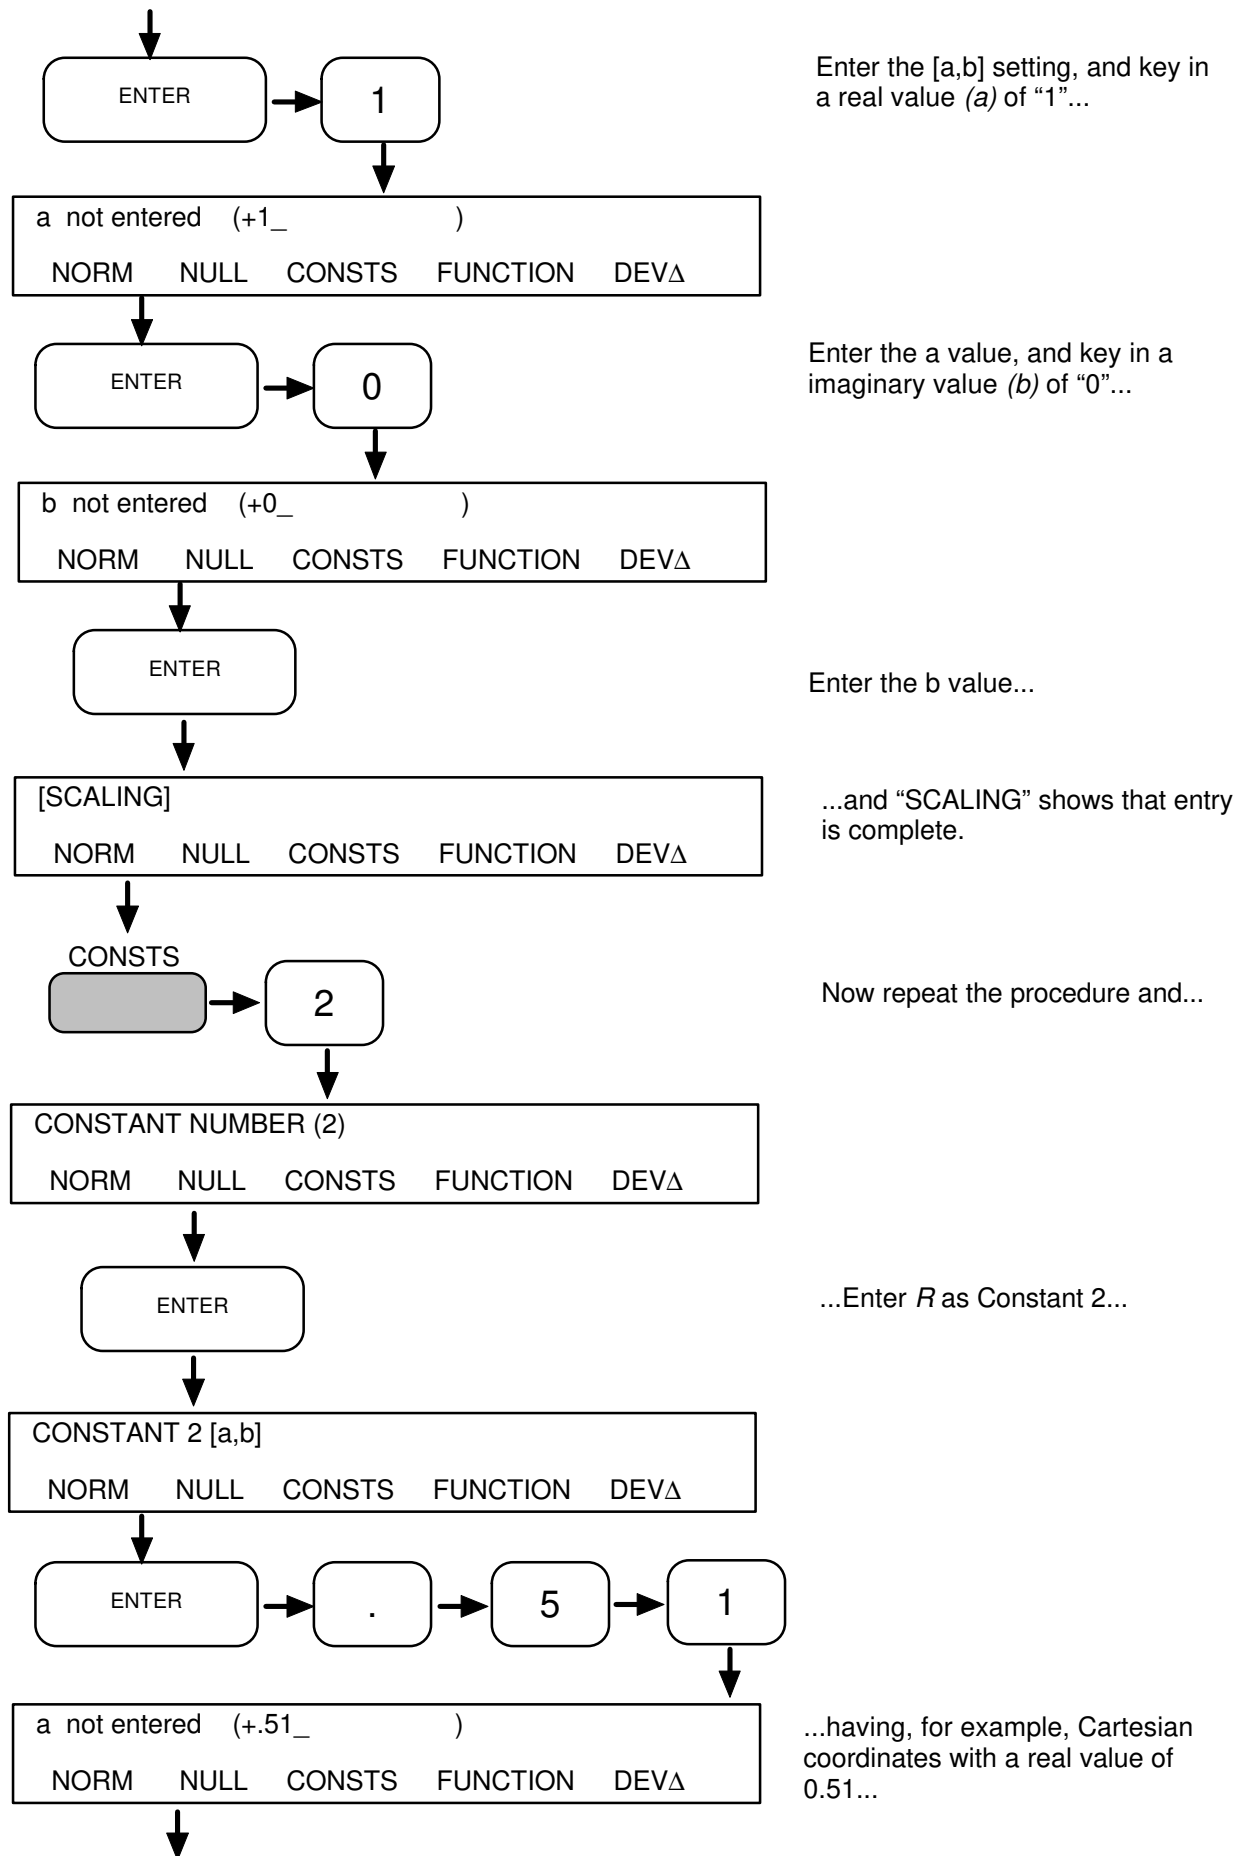

Enter the [a,b] setting, and key in a real value (a) of "1"...


Enter the a value, and key in a imaginary value (b) of "0"...

Enter the b value...

...and "SCALING" shows that entry is complete.

Now repeat the procedure and...

...Enter R as Constant 2...

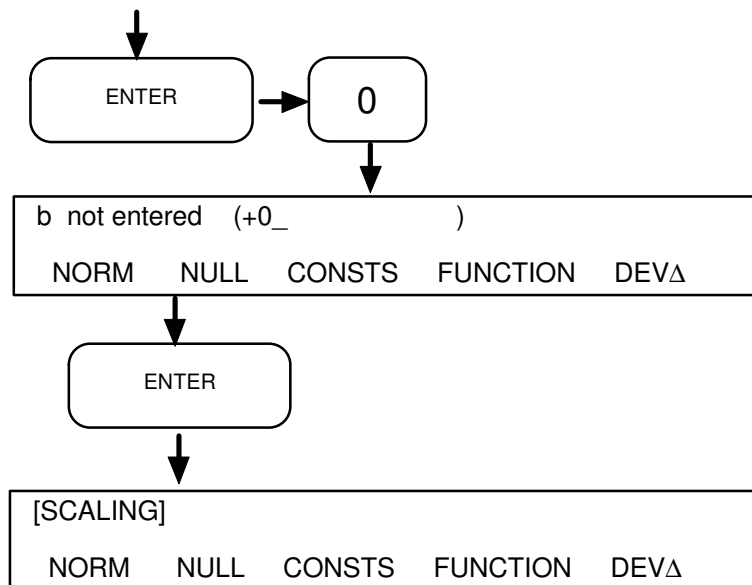


...and an imaginary value of zero.

The fixed values "1" and R are now held as constants.

10.3.6.2 Entering the Function

A function to compute the value, A , of the open-loop gain is now entered.

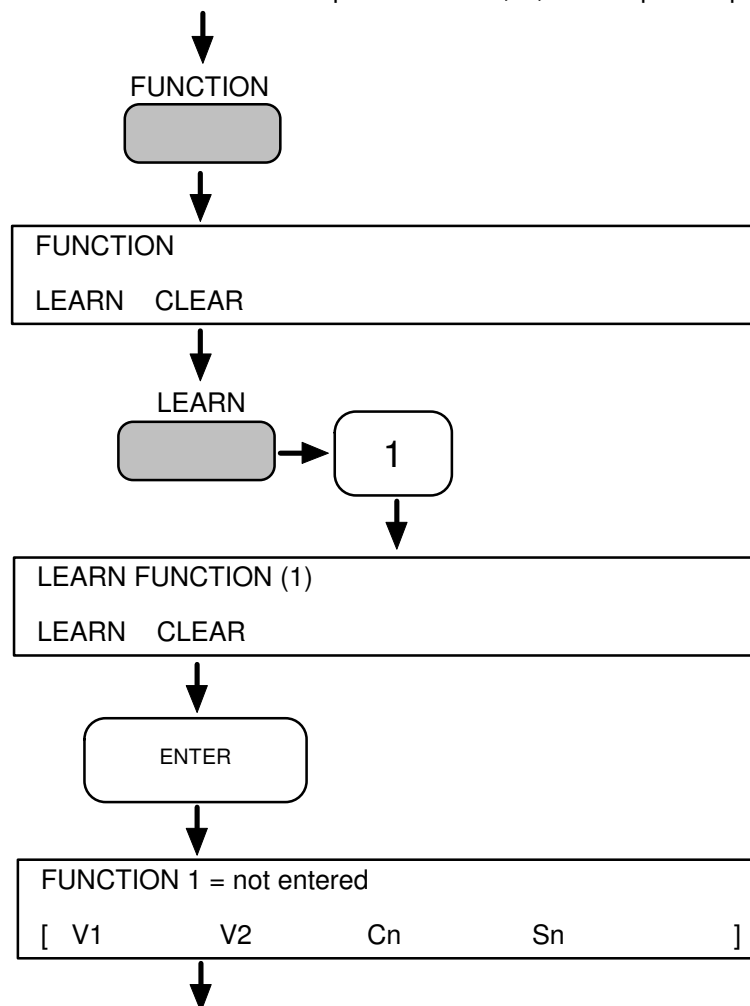


Press the FUNCTION soft key....

...then LEARN and the number of the function to be entered.


Enter the learn request...

...and a choice of items is displayed. Square brackets show that other choices are available.

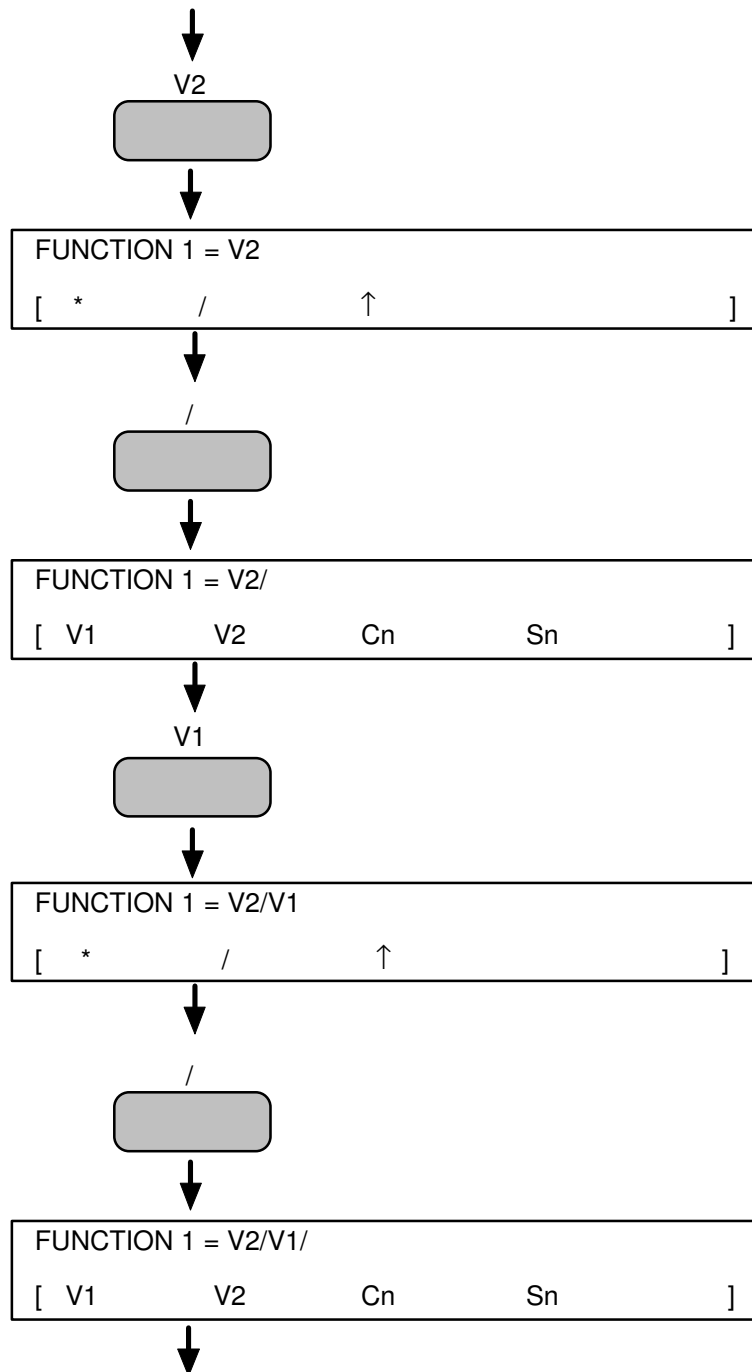

The function keyed in so far is:

$$F_1 = \frac{V_2}{V_1}$$

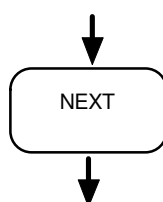

Key in the first item, which, in the present example, is V2....

This item appears after "FUNCTION 1 = ", and the next selection of items appears.

As the example shows it is a simple matter to key in the rest of the function. All that is needed is a little thought as to the action of the operators. These act from left to right, at the following priorities:


1st priority: powers and negative powers, represented by "↑" and "↓"

2nd priority: division and multiplication represented by "/" and "*".

3rd priority: addition and subtraction, represented by "+" and "-".


Brackets tie several terms together, so that a common operator can be applied. An example of this is given on the next page.

An open bracket is needed now, so press NEXT to display the alternative items.

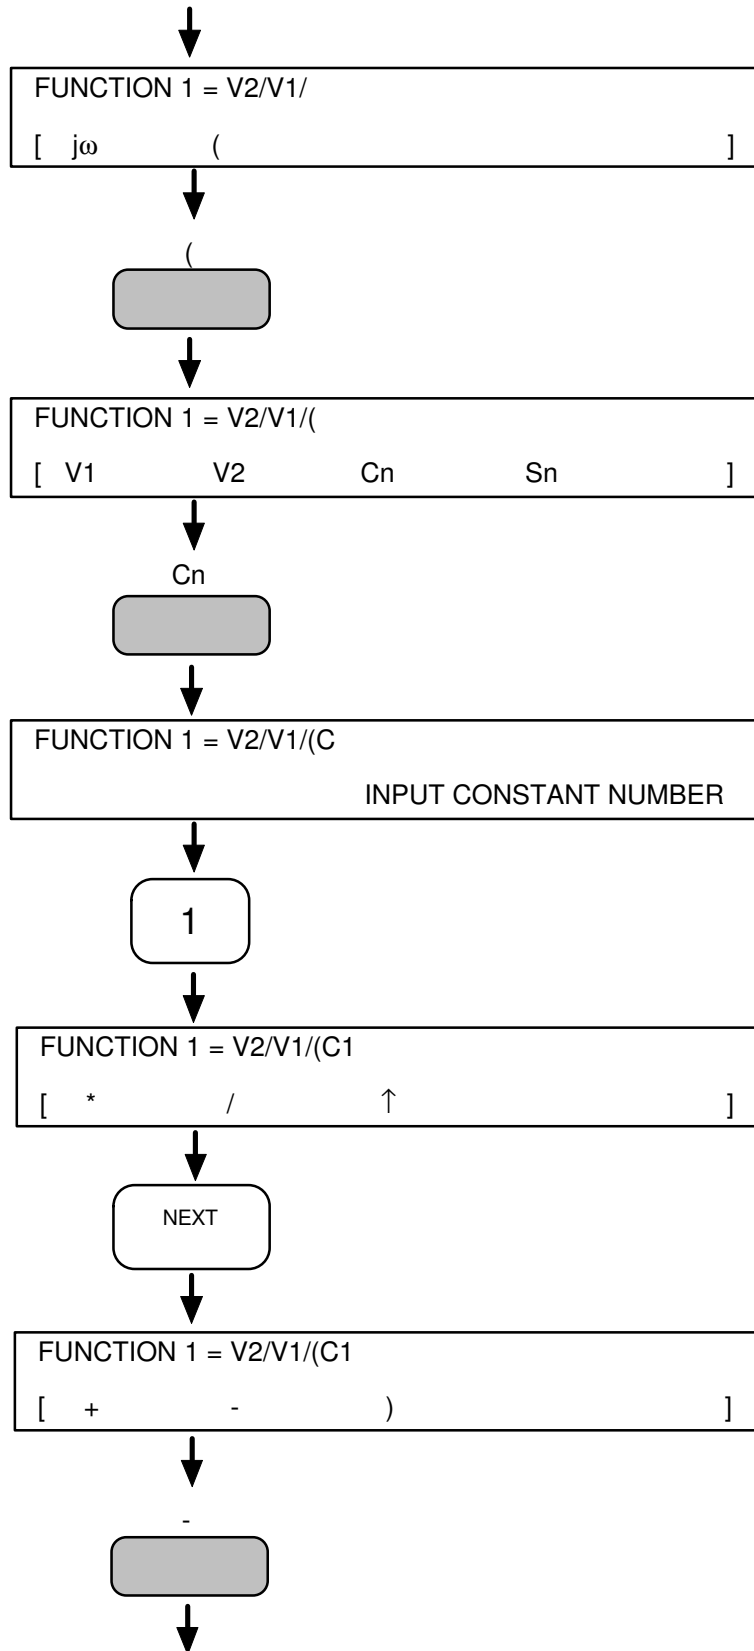


The function keyed in so far is :

$$F_1 = \frac{V_2}{V_1 / C_1 - 1}$$

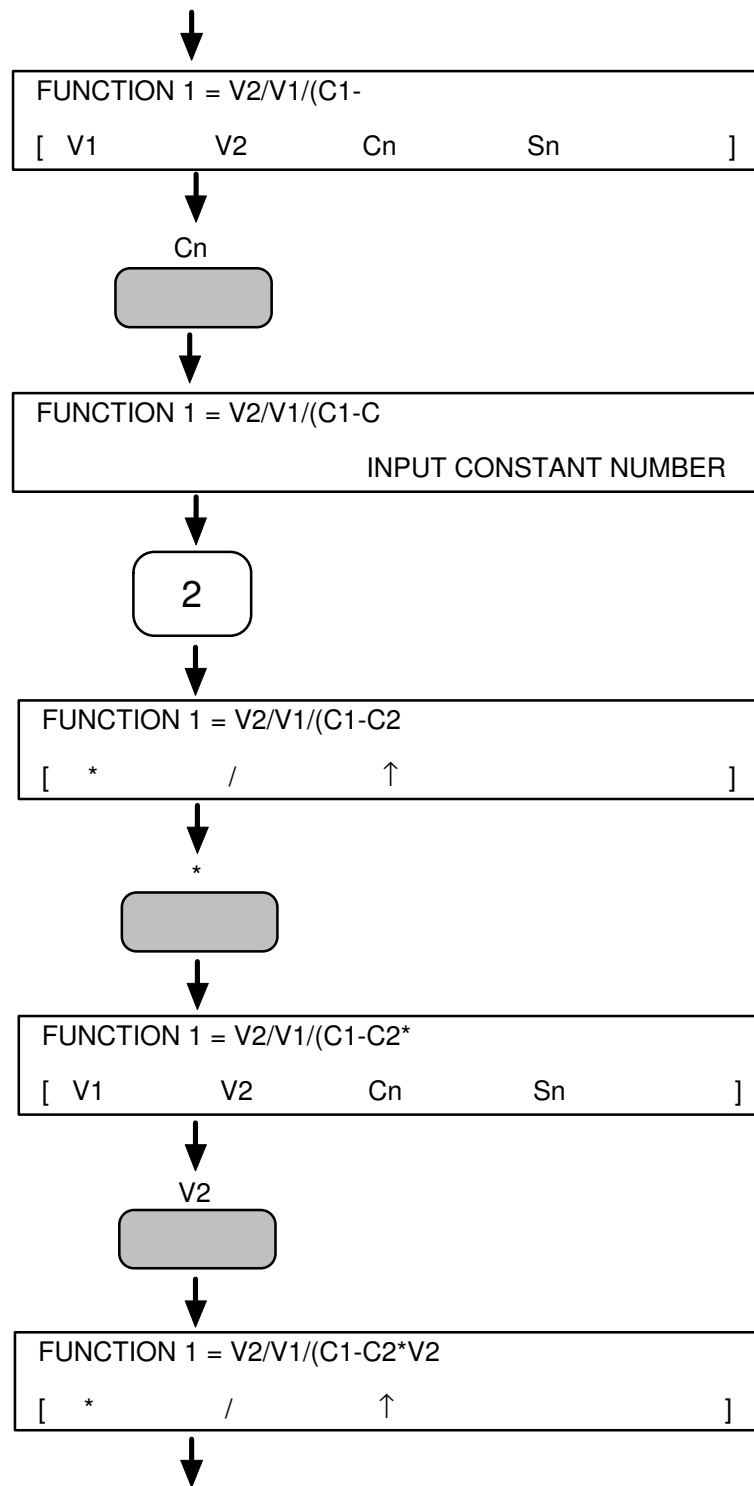

The function keyed in so far is :

$$F_1 = \frac{\frac{V_2}{V_1}}{C_1 - C_2 V_2}$$

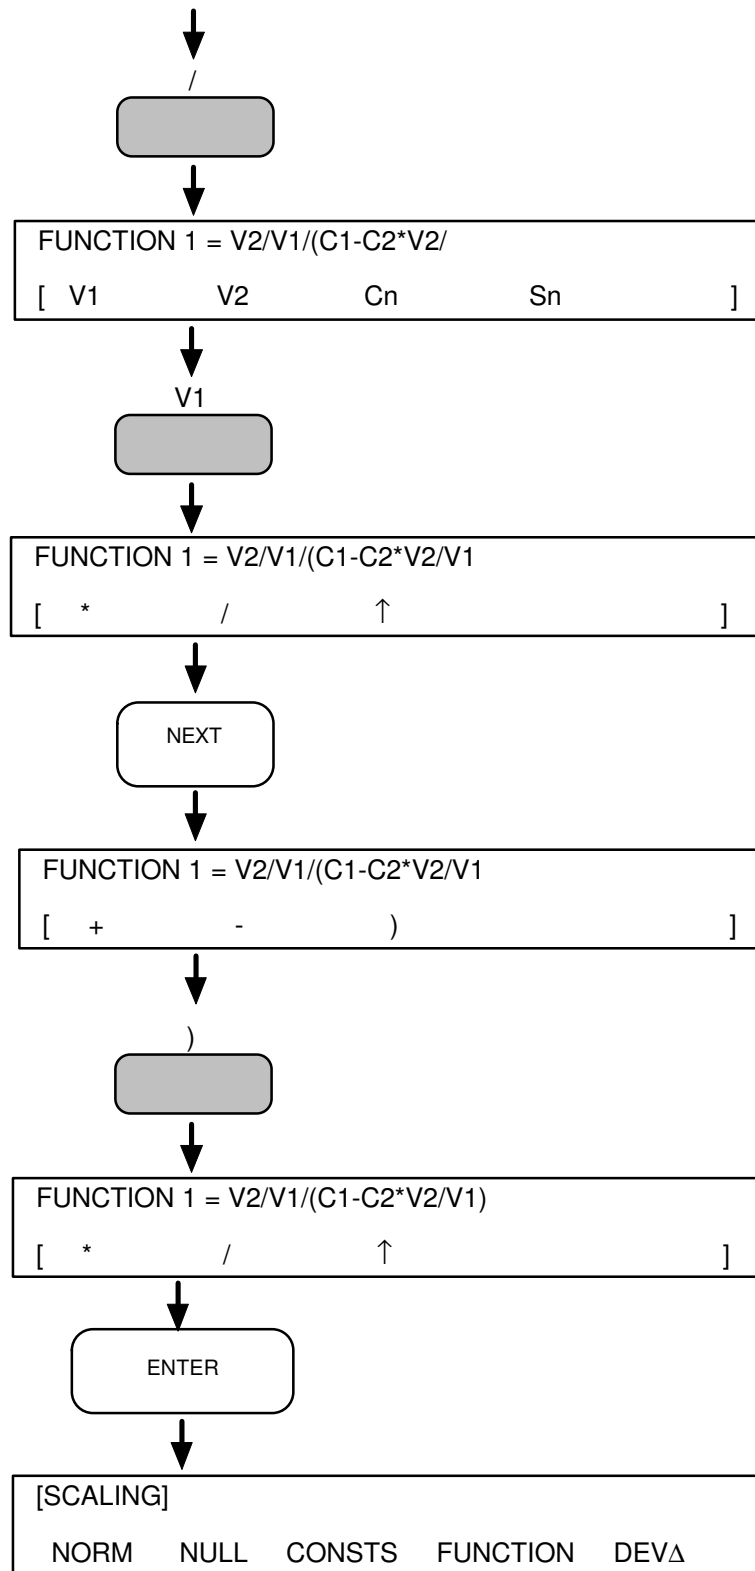

Having keyed in the function, press ENTER....


...and the display returns to the "SCALING" page to show that entry is complete.


Function 1 is now ready to apply, as:

$$F_1 = \frac{\frac{V_2}{V_1}}{C_1 - C_2 \frac{V_2}{V_1}}$$

10.3.7 APPLYING A SCALING FUNCTION

Once a scaling function has been entered (as shown in the previous section) it is applied by selecting "FUNCTION" as the display source. The procedure is:

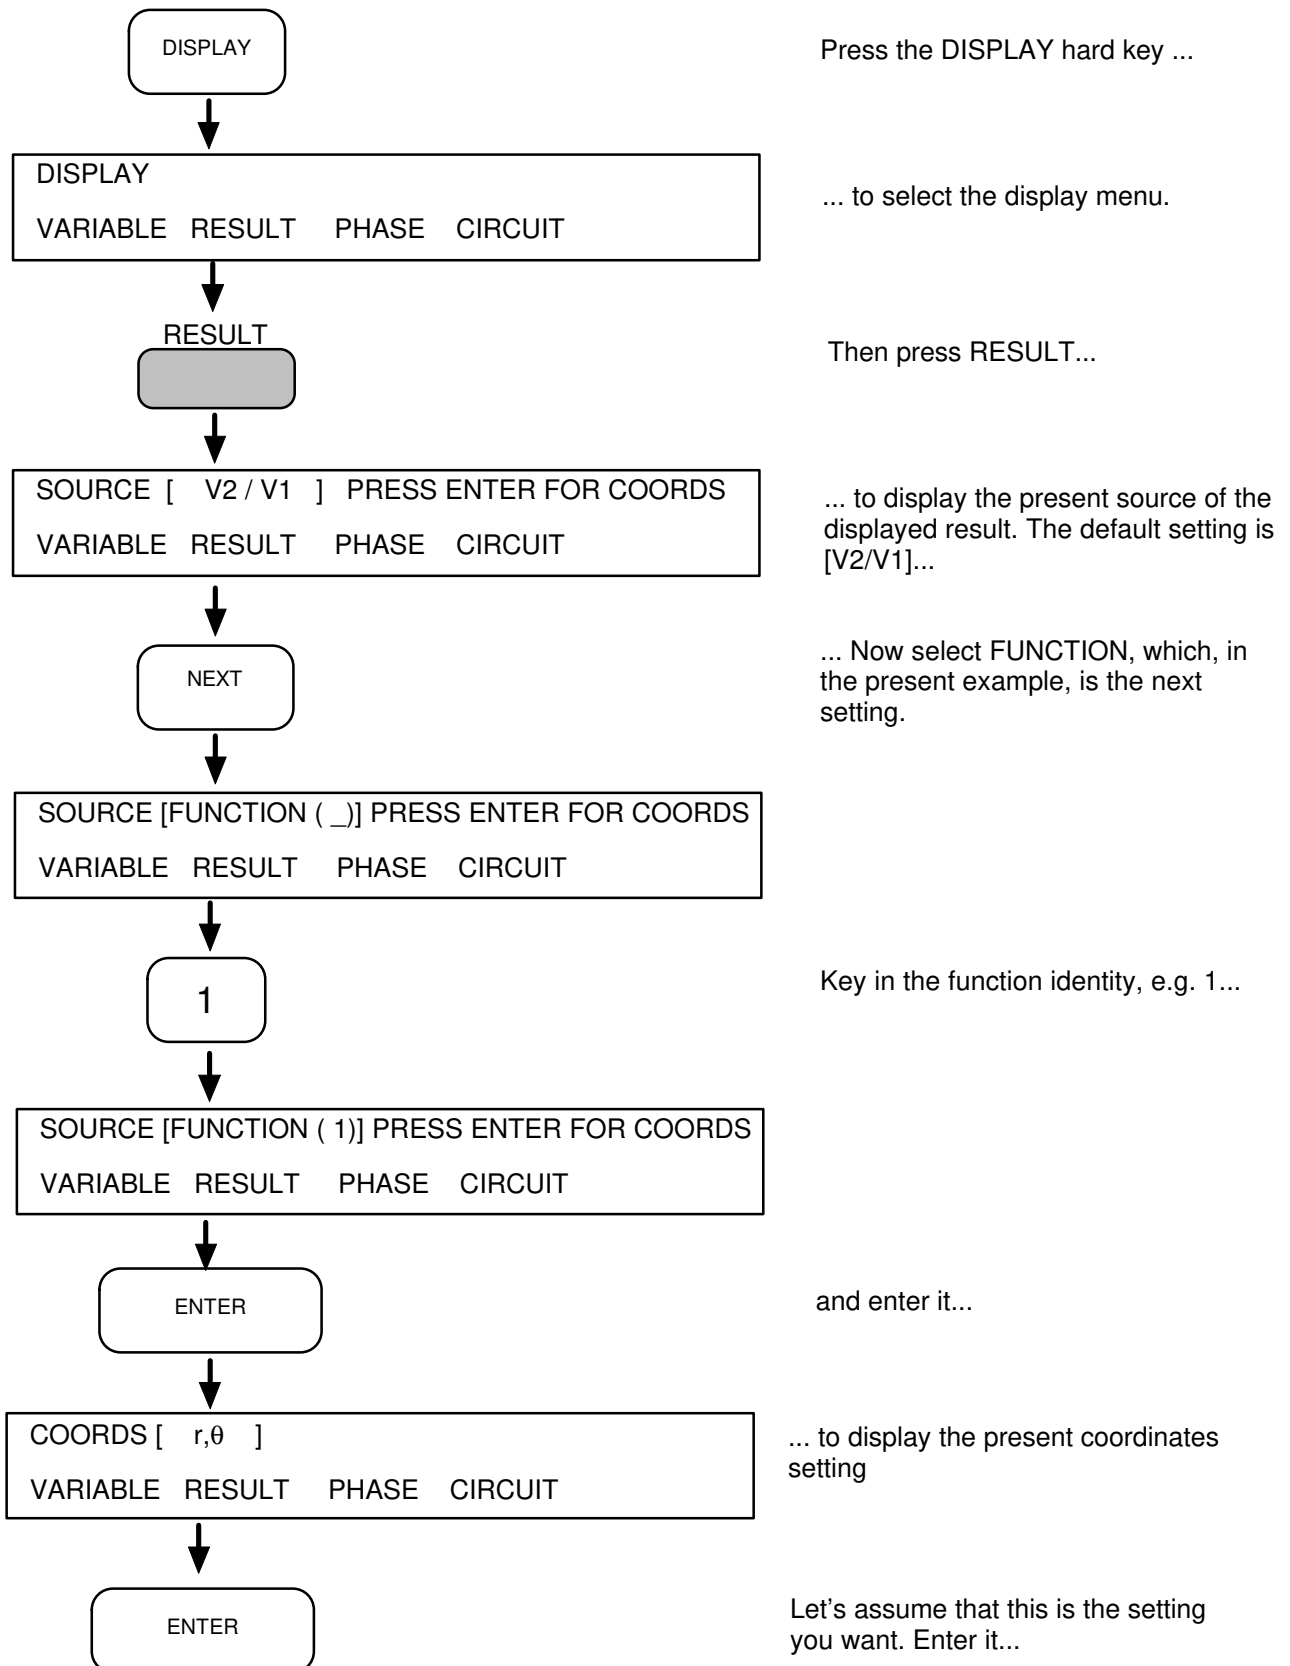

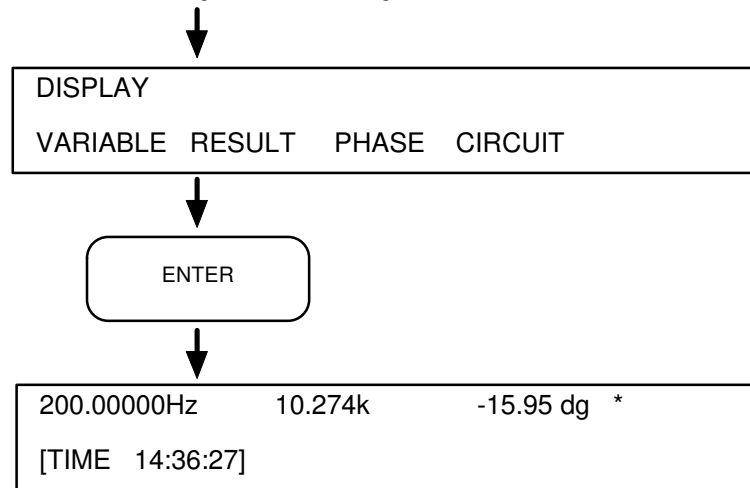

...and "DISPLAY" is displayed again to show that entry is complete.

Press ENTER again...

...to display the present measurement result in its scaled form. All other measurements displayed will be scaled in the same way, until a different display source is entered.

10.4 THE LIMITS FACILITY

Measurement results may be checked against a user-defined limits, which define pass and fail zones. Fig 4.1 shows the set-up:

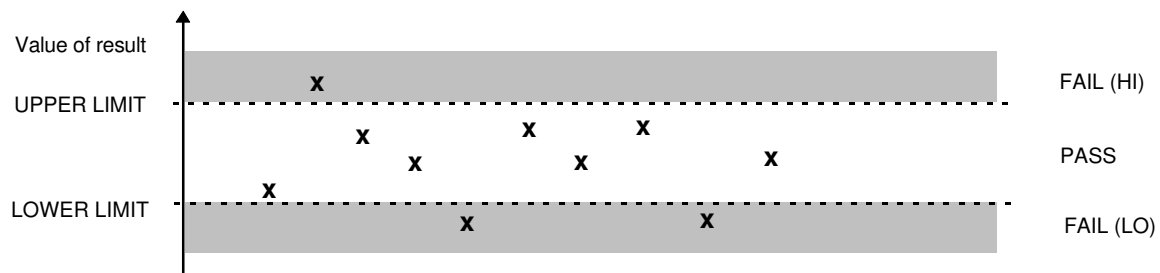


Fig 4.1 Pass and fail zones, as defined by the upper and lower limits.


An upper limit defines the ceiling, and a lower limit defines the floor, of the measurement pass zone. The pass condition is " $lower\ limit \leq result \leq upper\ limit$ ", whilst the fail condition is " $result < lower\ limit$ " or " $result > upper\ limit$ ". The example in Fig 4.1 shows ten measurement results, each represented by an "x": seven results have passed the check and three have failed.


In accordance with the limits check, "Hi" or "Lo" is displayed against failed results.

Once a limits item has been entered, output data may be restricted to *pass* or *fail* results. The choice, for each output port, is made from the DATA OUTPUT menu.

10.4.1 SETTING THE LIMITS

To enter the limits the procedure is:

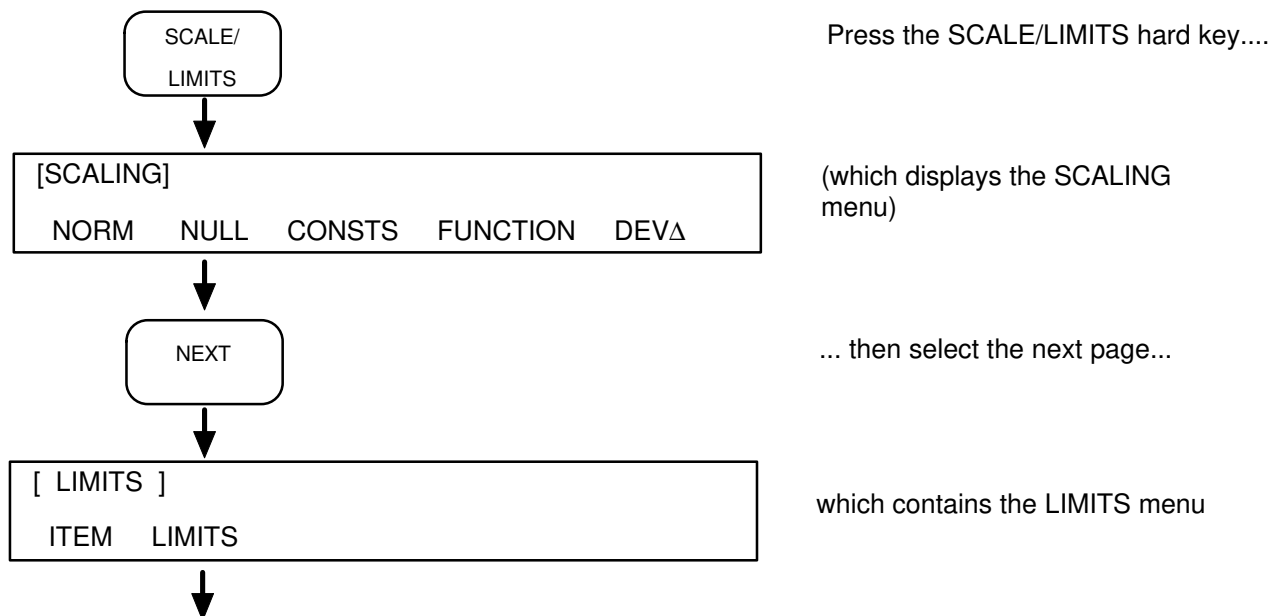

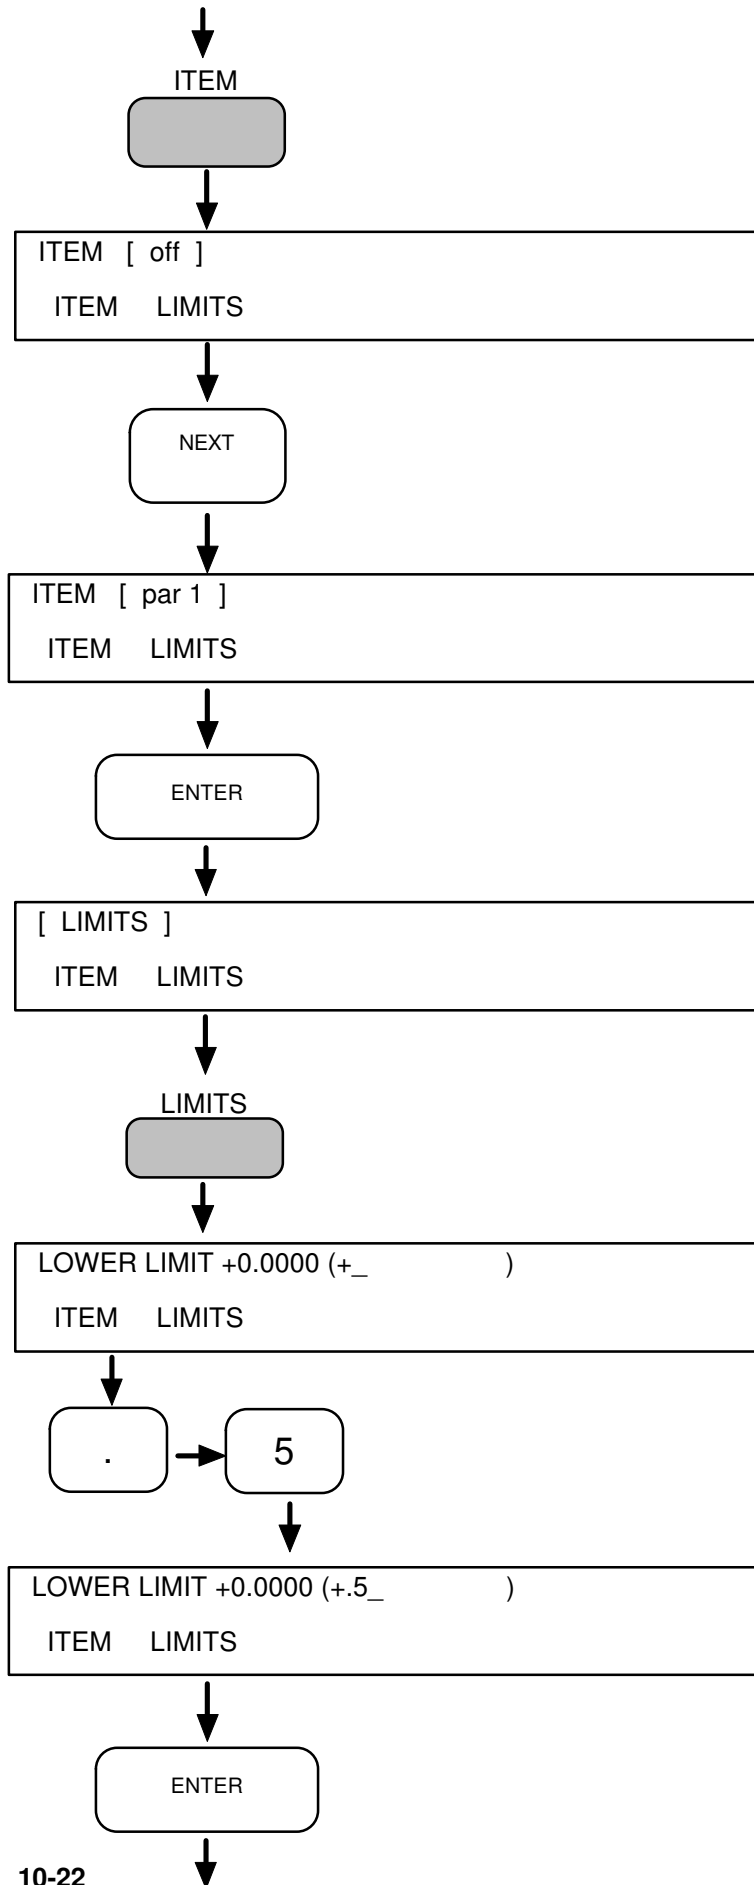

Then press ITEM soft key...

...to display the present status of the limit check. [off] indicates that a limits check is not applied.

Select the item to be limits checked, which, in the present example, is the next setting...

...i.e. [par 1]. This setting and the alternative setting [par 2] relate to the measurement result displayed. (See Chapter 5. Section 4.)

ENTER the selected item...


...and "LIMITS" is displayed again to show that the item is entered.

Then press the LIMITS soft key...

...to display the present lower limit for the selected item. Round brackets invite the entry of a new lower limit.

Key in the required lower limit value, e.g. 0.5. (There is no need to key in the leading zero, it is assumed. A leading zero is displayed when the value is next interrogated.)

ENTER the lower limit value...

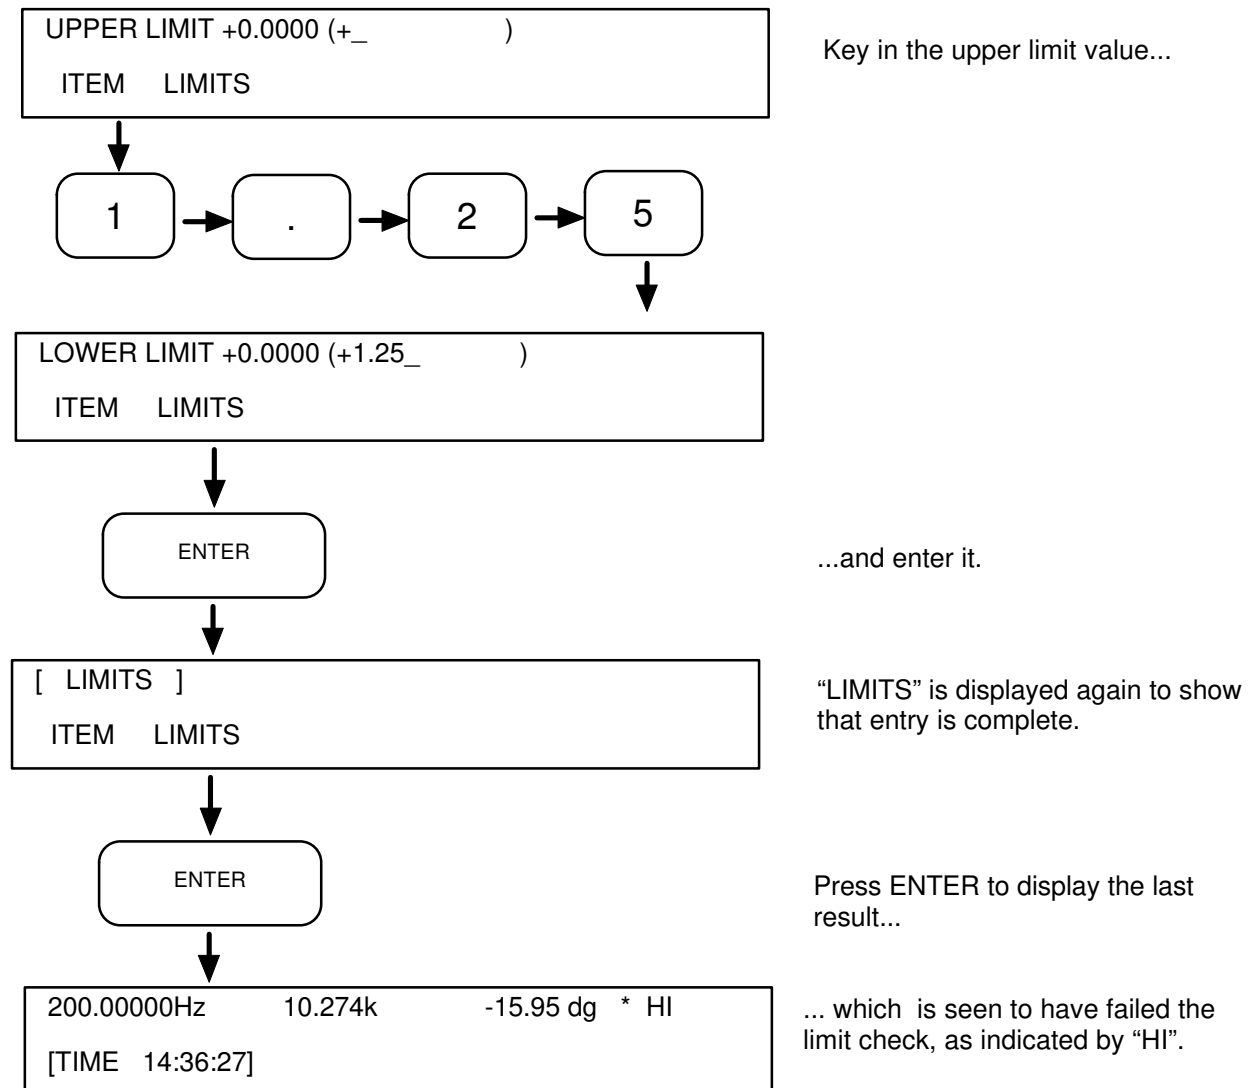

11

Learnt Programs

<i>Section</i>	<i>Page</i>
11.1 Learnt Program Facilities	11.3
11.1.1 Program Storage	11.3
11.1.2 Program Keyswitch	11.3
11.2 Checking the Program Memory Space	11.4
11.3 Clearing a Learnt Program	11.5
11.4 Creating a Learnt Program	11.6
11.4.1 Entering the Learn Mode	11.6
11.4.2 Learnt Program Example	11.7
11.5 Executing a Learnt Program	11.11
11.6 Editing a Learnt Program	11.12
11.6.1 Entering the Edit Mode	11.12
11.6.2 Listing of Example Program	11.13
11.6.3 Using the Edit Functions	11.14
11.7 Copying a Learnt program	11.16
11.7.1 Copy Procedure	11.16

11.1 LEARNT PROGRAM FACILITIES

The instrument is able to store a series of commands, which may be actioned later as a *learnt* program. A learnt program is useful where a test sequence is used repeatedly, as, for example, in production testing. Up to eighteen programs may be stored.

Each learnt program instruction is equivalent to a single menu entry.

A *set-up recall* instruction allows a complete instrument set-up to be recalled. This reduces the number of instructions necessary when altering groups of settings throughout the test. Single acting instructions need to be used only for sequential operations.

The learnt program facilities are presented under three hard keys, LEARN PROG, EXECUTE PROGRAM, and STATUS. The LEARN PROG functions are:

- | | |
|--------------|--|
| Learn | Sets the instrument into the learn program mode in which it interprets each command as a learn program instruction. Programs are learnt under program numbers 1 through 9. |
| Edit | Allows a learnt program to be modified. Only programs 1 to 9 may be edited. To edit a program in non-volatile memory (programs 10 to 18) copy the program to a program number between 1 and 9, edit it, clear the original program and copy it back. |
| Clear | Clears an unwanted learnt program from memory. |
| Copy | Copies a complete learnt program under another program number. This facilities is used for transferring a learnt program to non-volatile memory. It may also be used, with EDIT, to derive one program from another. |

EXECUTE PROGRAM allows a selected program to be executed.

The STATUS 1, PROGRAM pages show the memory space available for program storage.

11.1.1 PROGRAM STORAGE

Programs 1 through 9 are held in the battery-maintained memory. There is also room for nine programs in non-volatile memory, under program numbers 10 through 18. Use COPY to transfer important programs to locations 10 through 18: the original programs may then be cleared, so that other programs may be learnt.

11.1.2 PROGRAM KEYSWITCH

A PROGRAM keyswitch on the instrument rear panel may be set to protect the learnt programs in non-volatile memory. Two switch settings are used:

- The SUPERVISOR setting allows learnt programs to be stored in, or recalled from, any location from 1 through 18. All programs may be cleared.

CAUTION: Do not switch the instrument on or off when the keyswitch is in the "Supervisor" mode.

- The NORMAL setting allows learnt programs to be recalled from any location, but stored only in locations 1 through 9. Only programs 1 through 9 may be cleared.


11.2 CHECKING THE PROGRAM MEMORY SPACE

Before trying to create a learnt program check that

- a vacant program slot is available and
- sufficient memory space is available to hold all the instructions.

If the instrument has been initialized since programs were last entered then the learnt program memory will be completely clear and a program may be created under any number from 1 through 9, as described in Section 11.4.

If the instrument has not been initialized and you are uncertain about the contents of the program memory, then use the STATUS menu to find out what space is available:

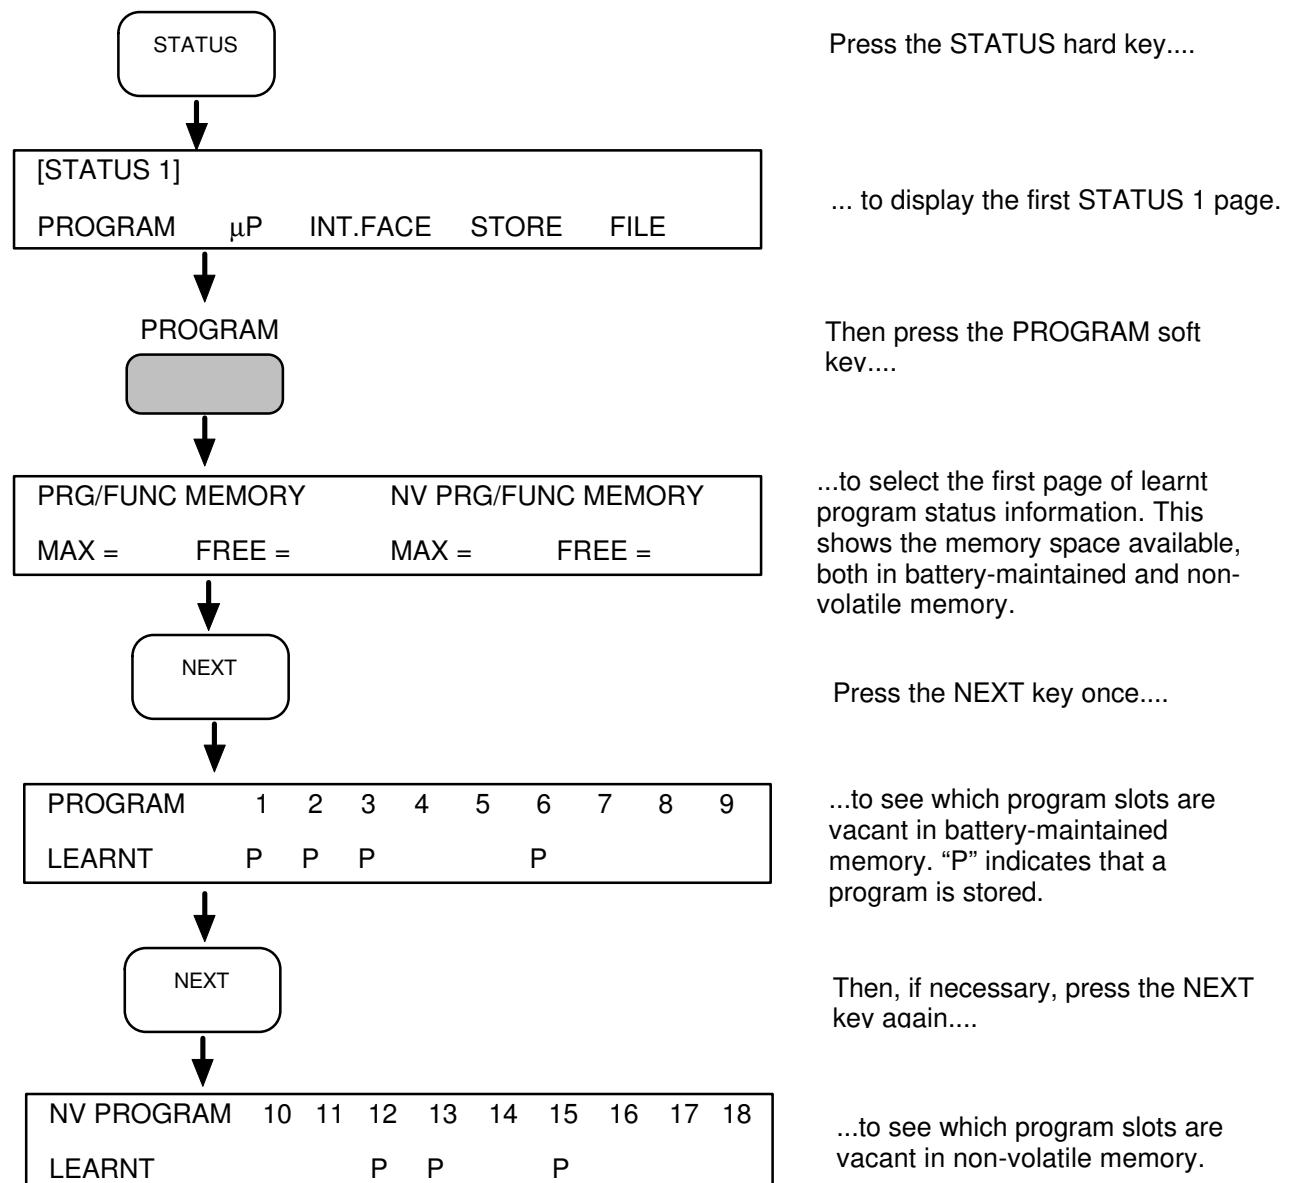


If there is insufficient memory space for the intended program then the entire memory, or selected parts of it, may be cleared as described in Section 11.3.

11.3 CLEARING A LEARNT PROGRAM

If none of the learnt programs presently stored in the instrument are wanted then the whole program memory may be cleared by initializing the instrument. Remember, however, that this will also erase the history file and other stored data and set the control settings to their default states. The battery-maintained program memory (programs/functions 1 through 9 and stored set-ups/results 1 through 9) is always cleared on initialization, but the non-volatile memory (programs/functions 10 through 18 and stored set-ups 10 through 16) is cleared only if the instrument is operating in the supervisor mode, i.e. when the PROGRAM keyswitch on the instrument rear panel is set to SUPERVISOR and INITIALIZE has been commanded.

If you wish to keep the contents of the non-volatile memory, always set the PROGRAM keyswitch to NORMAL before initializing the instrument.

If some learnt programs are wanted, or if you do not wish to initialize the instrument, then unwanted programs may be cleared selectively. The procedure is:

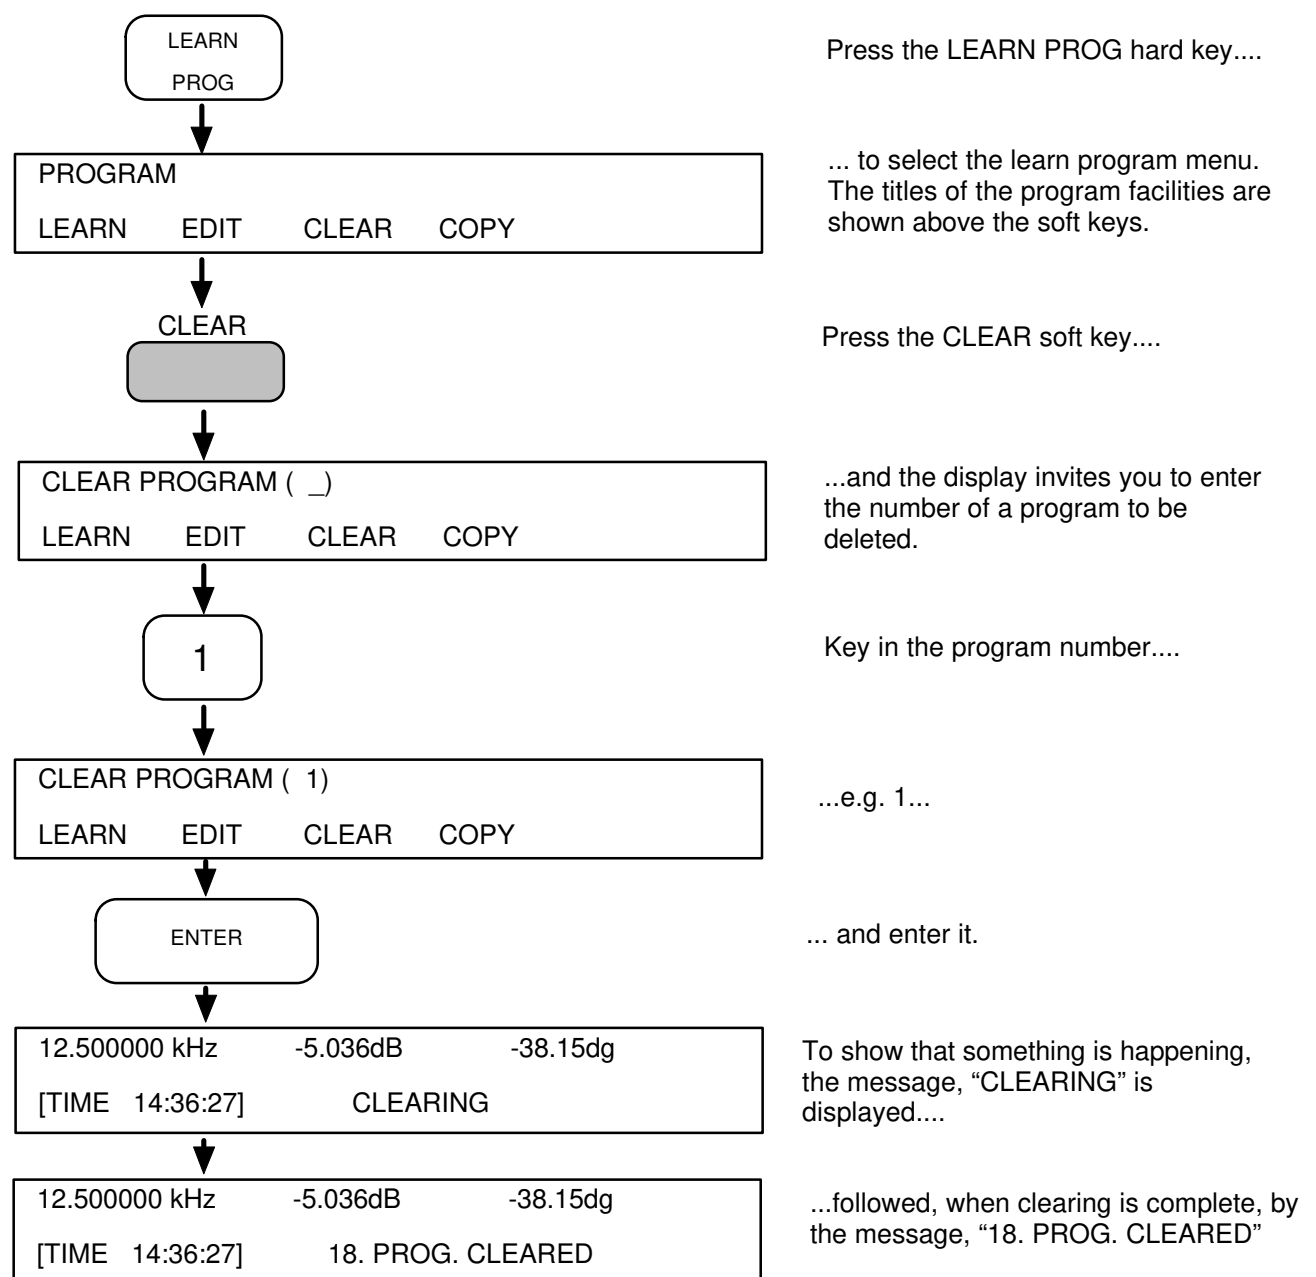


12600012_Gmacd/CB

11.4 CREATING A LEARNT PROGRAM

To create a learnt program, simply set the instrument into the learn program mode and then enter commands in the order in which they are to be executed. Remember that a recall set-up instruction can set any number of control parameters in one go. This is useful in tests that require several parameters (e.g. the SWEEP settings) to be altered part of the way through.

11.4.1 ENTERING THE LEARN MODE


To enter the learn mode the procedure is:

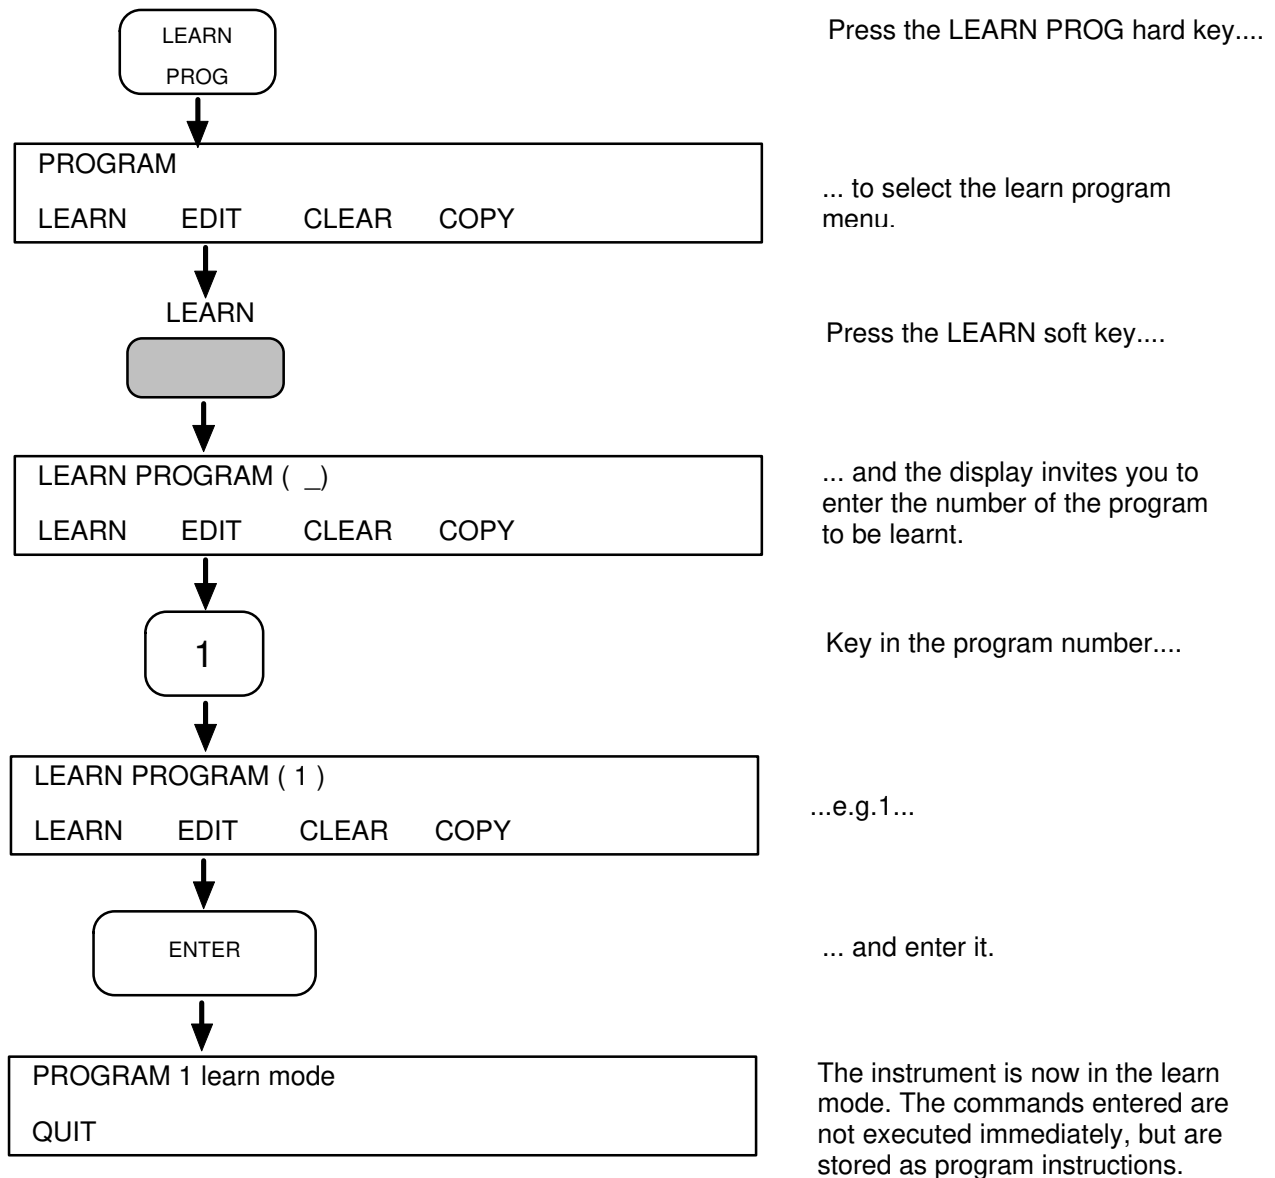


11.4.2 LEARNT PROGRAM EXAMPLE

In the following example the instrument is programmed to subject the item under test to a series of frequency sweeps of increasing amplitude. The aim is to test the item for linearity.

The procedure is: reset the control settings (as described in Chapter 3, Section 6.1), set up a frequency sweep (as described in Chapter 3, Section 7.1), store the set-up in store number 1 (similar to recall procedure below), then proceed as follows:

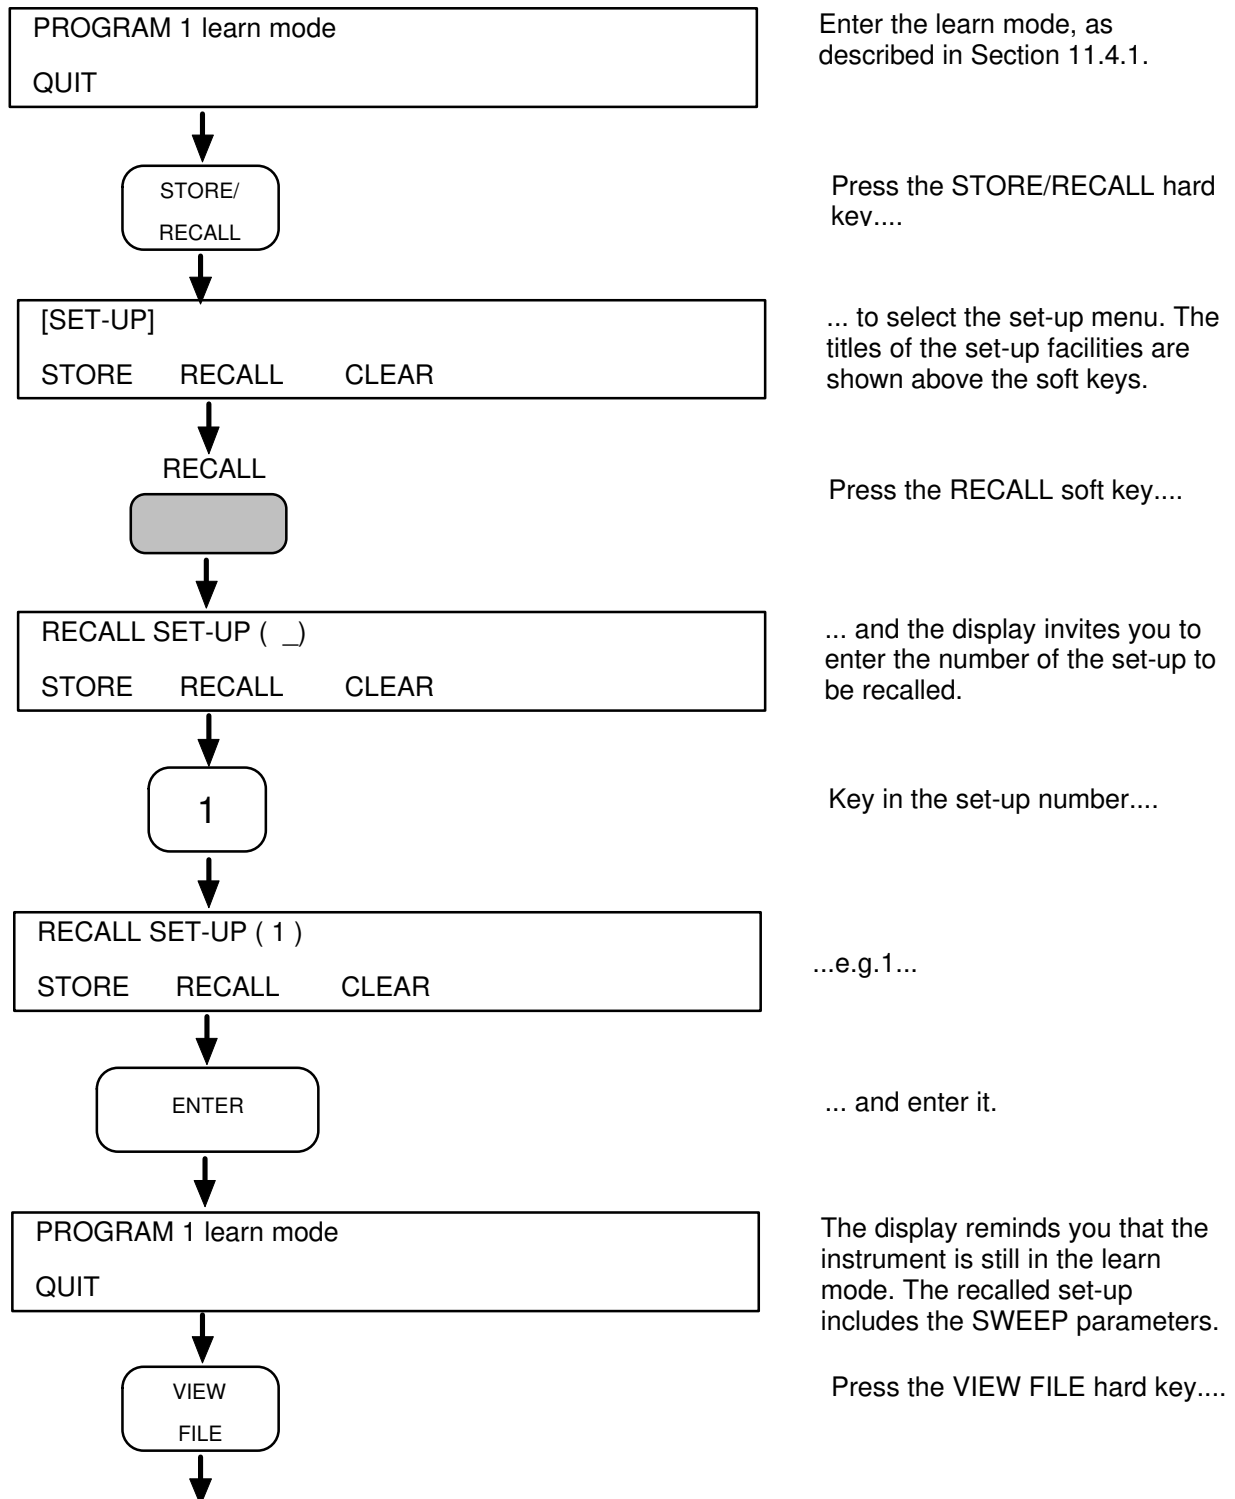

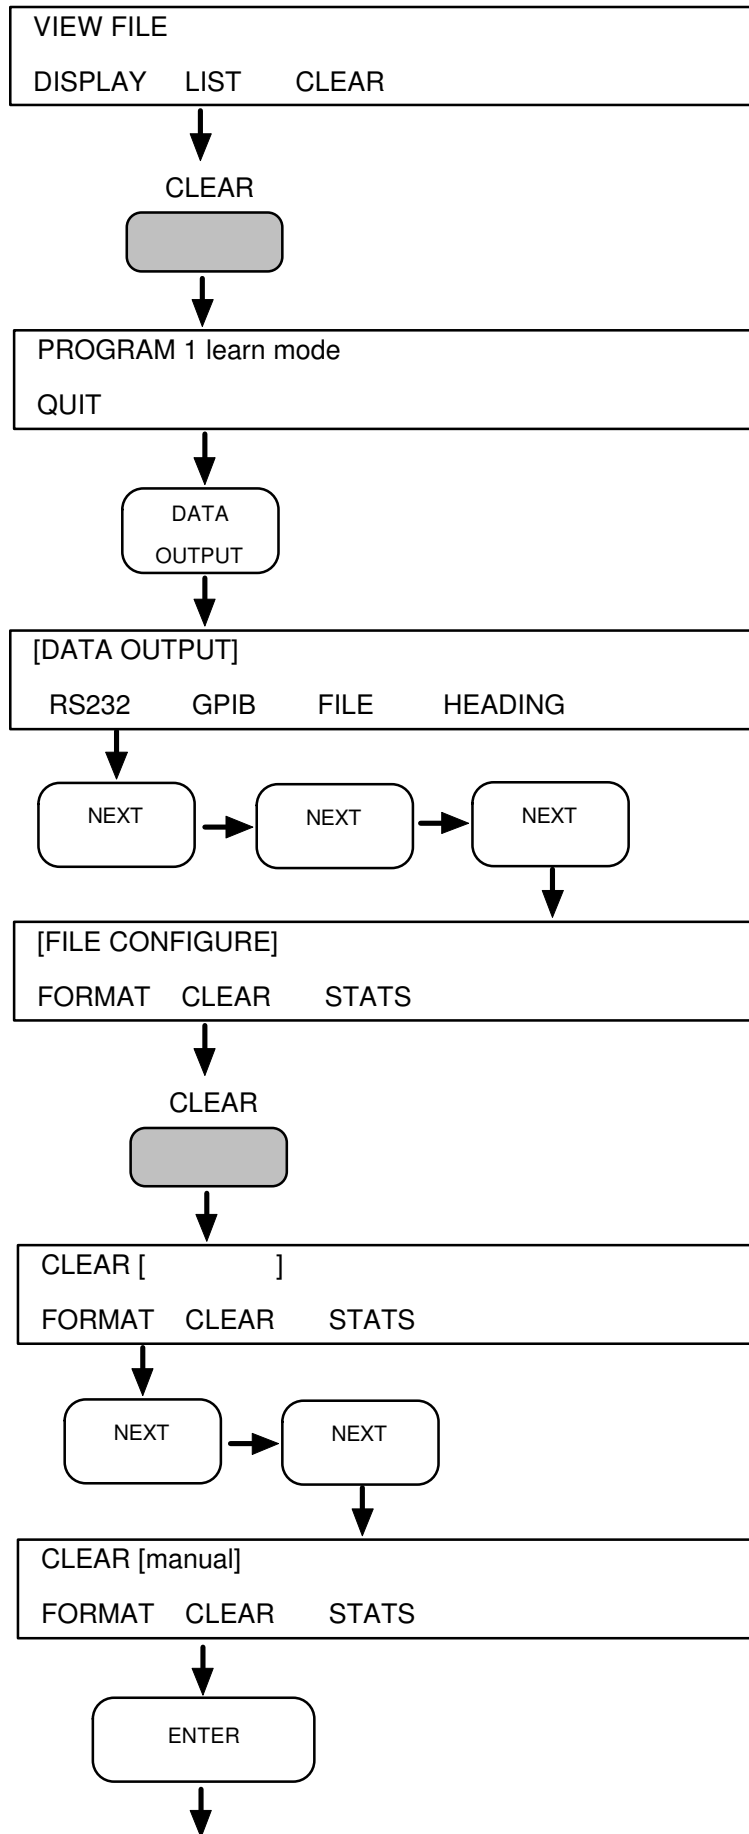

... to select the view menu. The titles of the file facilities are shown above the soft keys.

Press the CLEAR soft key to erase any data that may be in the history file.

The display reaffirms the learn mode.

Now press the DATA OUTPUT soft key....

...to get into the data output menu...

...and select the third page on...

... which contains the file configure functions.


Press the CLEAR soft key...

...to access the clear file parameter. When a control parameter is first accessed in the learnt program mode no setting is shown, as it is yet to be entered into the program.

...So, press the NEXT key twice...

...to select [manual] clear. This setting allows the data from several sweeps to be filed, which, in the present example, is what we want.

Enter the clear file setting...

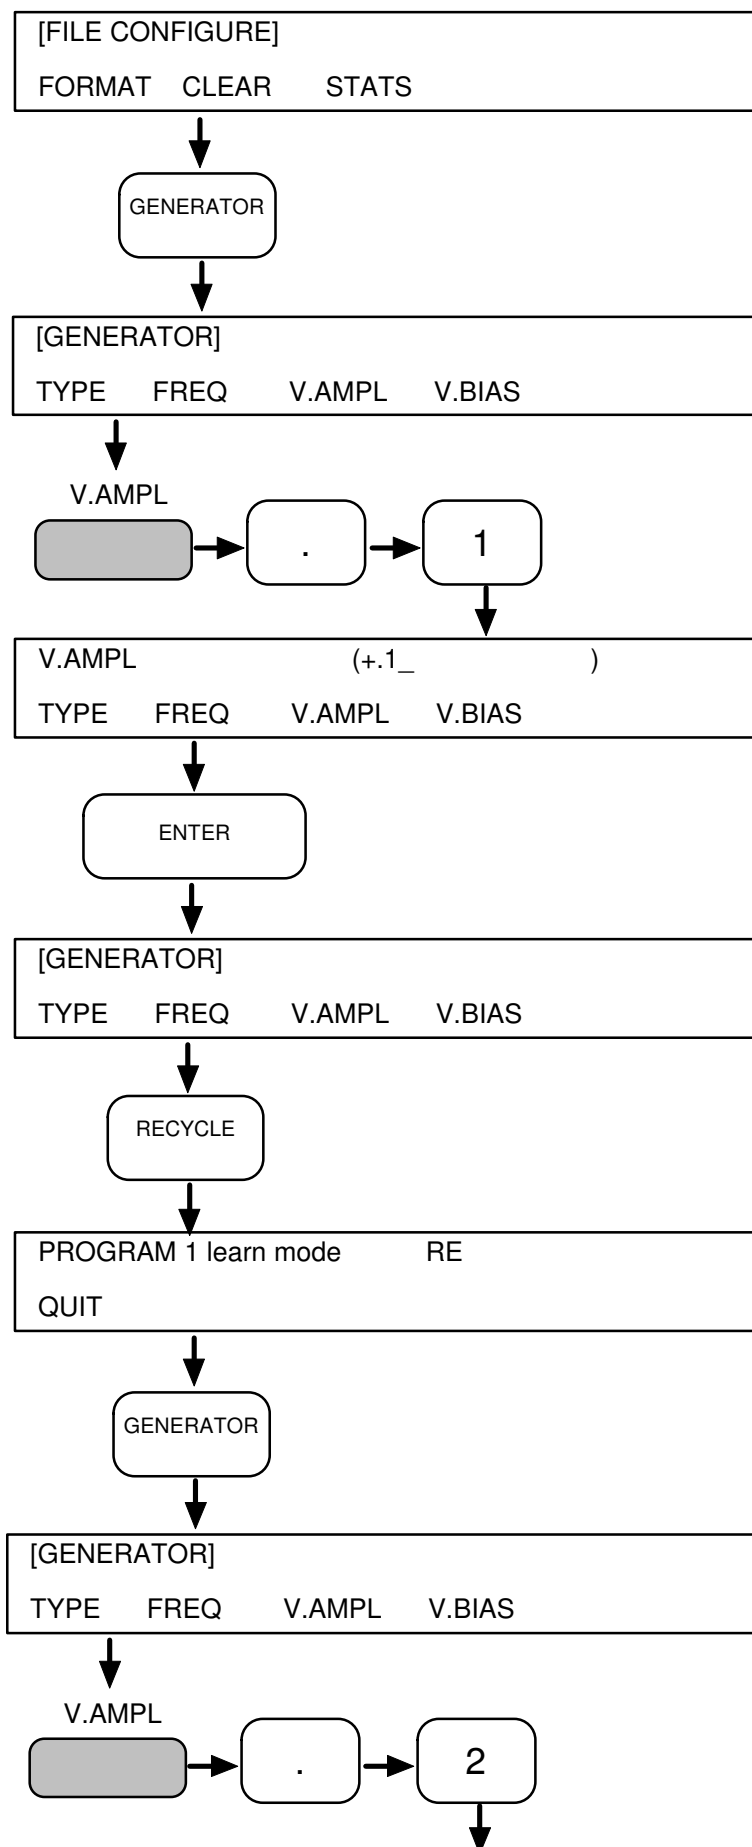

...and "FILE CONFIGURE" is displayed again, to show that the last entry is complete.

Next, press the GENERATOR hard key....

...to select the [GENERATOR] menu.

Select V.AMPL and key in the drive amplitude for the first sweep, e.g. (0).1V. (There is no need to key in the leading zero.)


Enter the amplitude value...

...and "GENERATOR" is displayed again to show that entry is complete.

Enter a recycle instruction to complete the first phase of the test program.

The display reaffirms the learn mode and shows the command code "RE" for the recycle instruction

The remaining part of the program, which commands further sweeps at increasing amplitudes, is entered by repeating the key presses from GENERATOR to RECYCLE for each amplitude value.

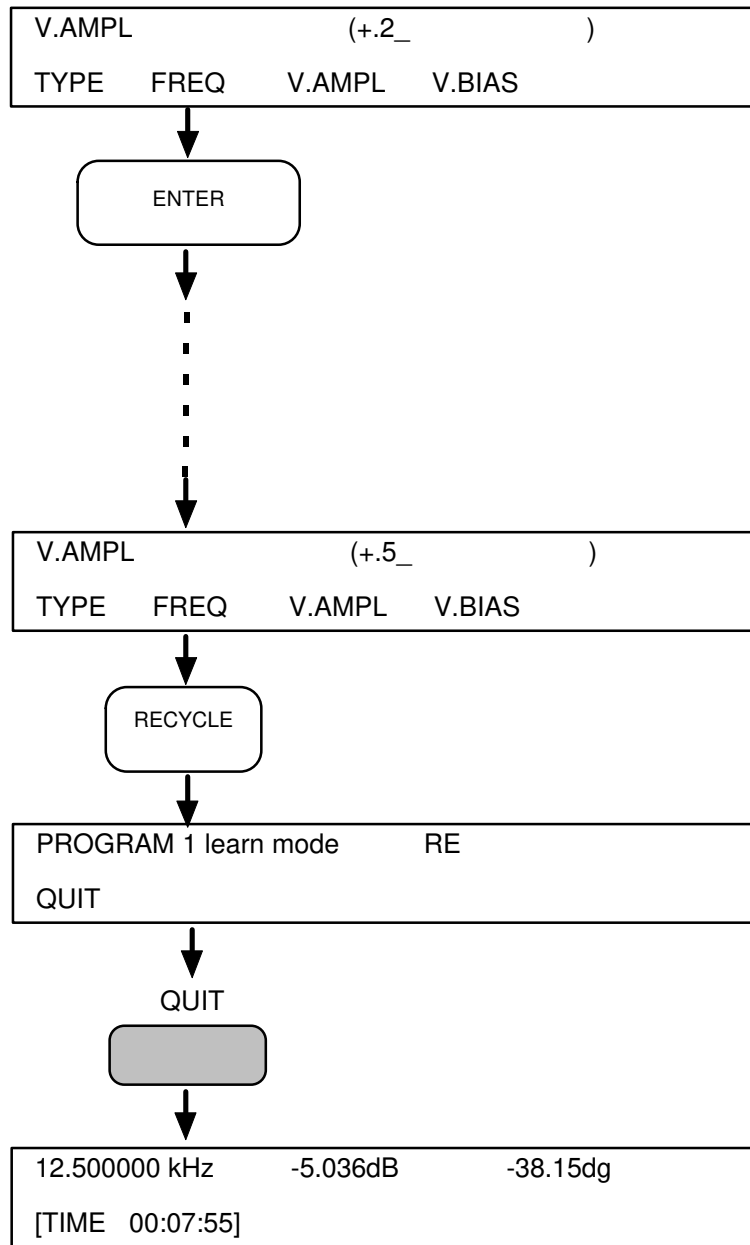


When the last program instruction has been entered, press QUIT to exit from the learn mode.

The instructions which make up this program can be seen in Section 11.6, "Editing a Learnt Program".

11.5 EXECUTING A LEARNT PROGRAM

A program is started simply by entering the program number from EXECUTE PROGRAM.
The procedure is:

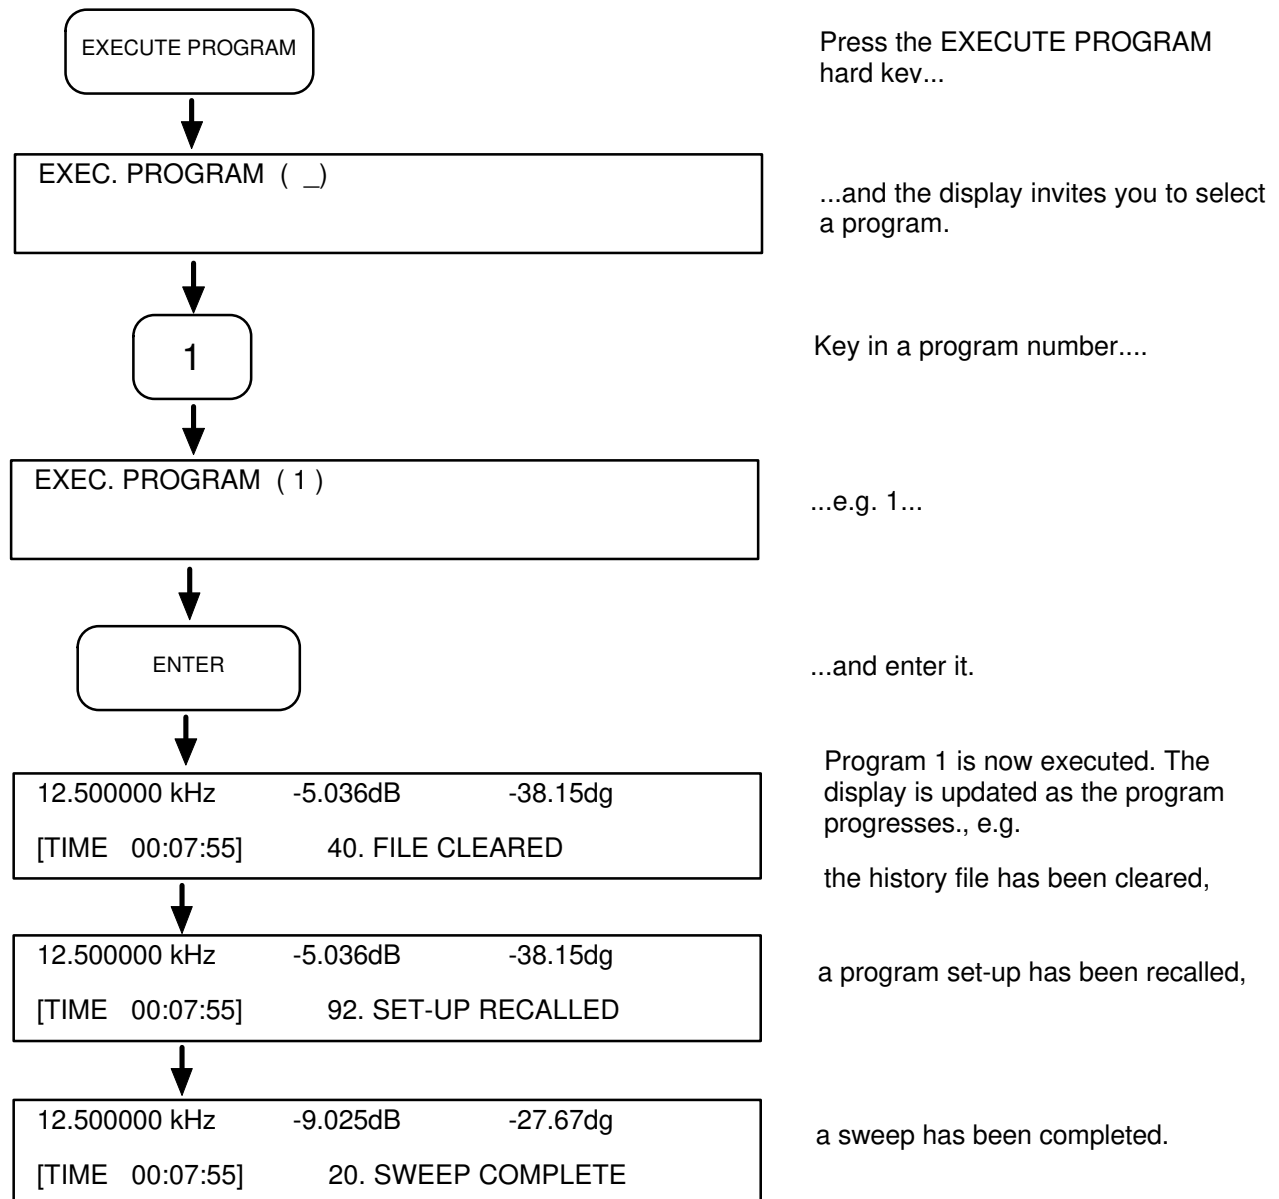

When the example program is finished the basic data of five sweeps, made at increasing drive signal amplitudes, are contained in the history file. With the sweep set for 50 measurement points this amounts to 250 data blocks.

Results may now be displayed in various formats, by selecting the appropriate source and coordinates from the DISPLAY menu. The results may then be


- displayed in succession, with the VIEW FILE facility,
- plotted, with the PLOT facility, and/or
- output to remote devices via the GPIB or RS232 ports.

11.6 EDITING A LEARNT PROGRAM

EDIT allows a learnt program to be altered. Instructions may be inserted or deleted.

11.6.1 ENTERING THE EDIT MODE

To enter the edit mode the procedure is:

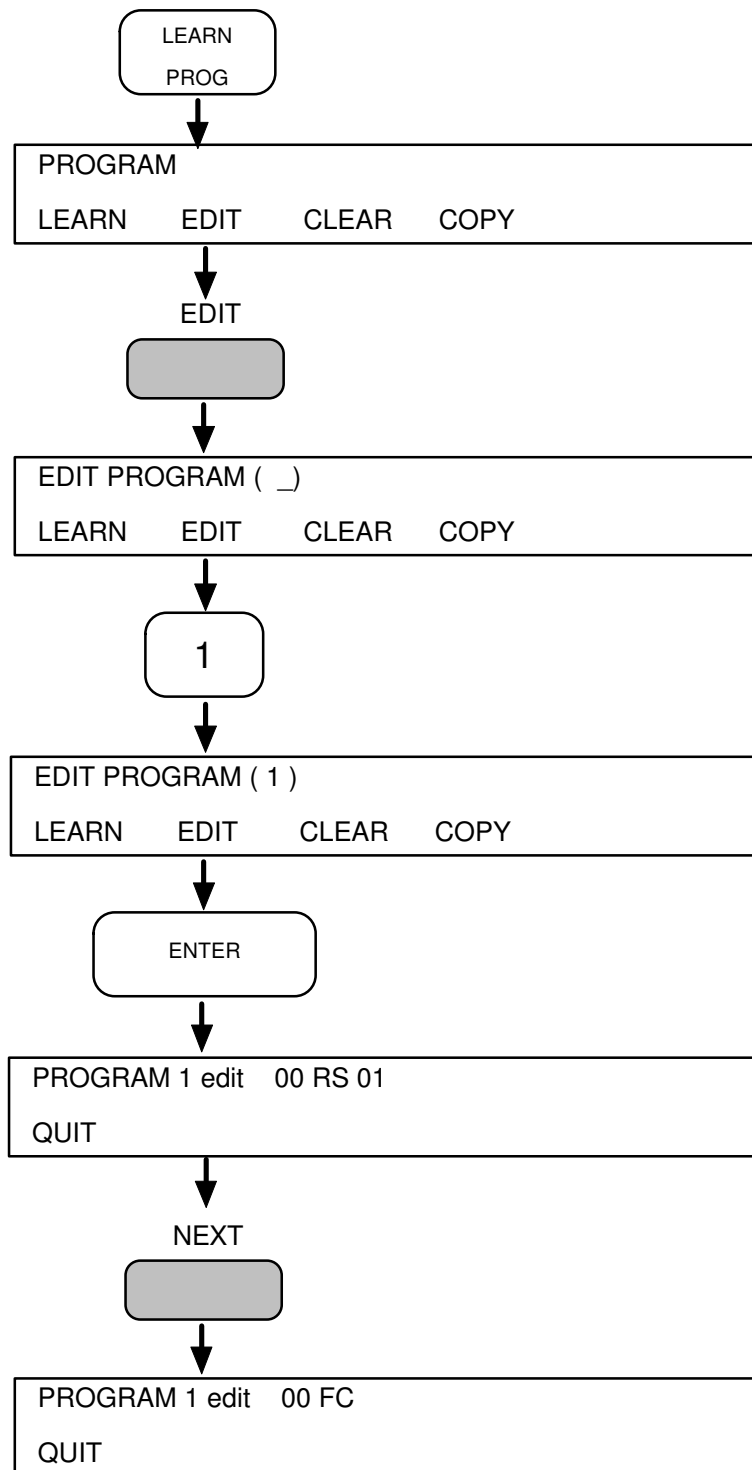

Press the LEARN PROG hard key....

... to select the learn program menu. The titles of the program facilities are shown above the soft keys.

Press the EDIT soft key....

... and the display invites you to enter the number of the program to be edited.

Key in the program number....

...e.g.1...

... and enter it.

The first instruction in the program is now displayed, in the form of a command code. This particular code means, "Recall set-up 1".

Each program instruction may be selected in turn, with the NEXT soft key.

The second instruction, now displayed, is the code FC which means, "Clear history file".

The command codes for the complete program are listed on the next page.


11.6.2 LISTING OF EXAMPLE PROGRAM

Command code	Comments
00 RS 01	Recall set-up number 1
00 FC	File Clear, i.e. clear the history file
00 MC 01	Set history file clear mode to manual. This inhibits the automatic file clear function and allows the history file to store the data from several sweeps.
00 VA +1.0000E-01	Set the drive signal amplitude to 0.1V
00 RE	Recycled measurements. This command takes the instrument through the first sweep.
00 VA +2.0000E-01	Set the drive signal amplitude to 0.2V
00 RE	Recycled measurements. This command takes the instrument through the second sweep.
00 VA +3.0000E-01	Set the drive signal amplitude to 0.3V
00 RE	Recycled measurements. This command takes the instrument through the third sweep.
00 VA +4.0000E-01	Set the drive signal amplitude to 0.4V
00 RE	Recycled measurements. This command takes the instrument through the forth sweep.
00 VA +5.0000E-01	Set the drive signal amplitude to 0.5V
00 RE	Recycled measurements. This command takes the instrument through the fifth sweep.
99 #Q	Quit program.

This program may be modified as shown in Section 11.6.3.

11.7 USING THE EDIT FUNCTIONS

The way in which the edit functions are used to modify a program is shown in the following example. In this particular sequence the aim is to change the drive amplitude of the first sweep in the example program.

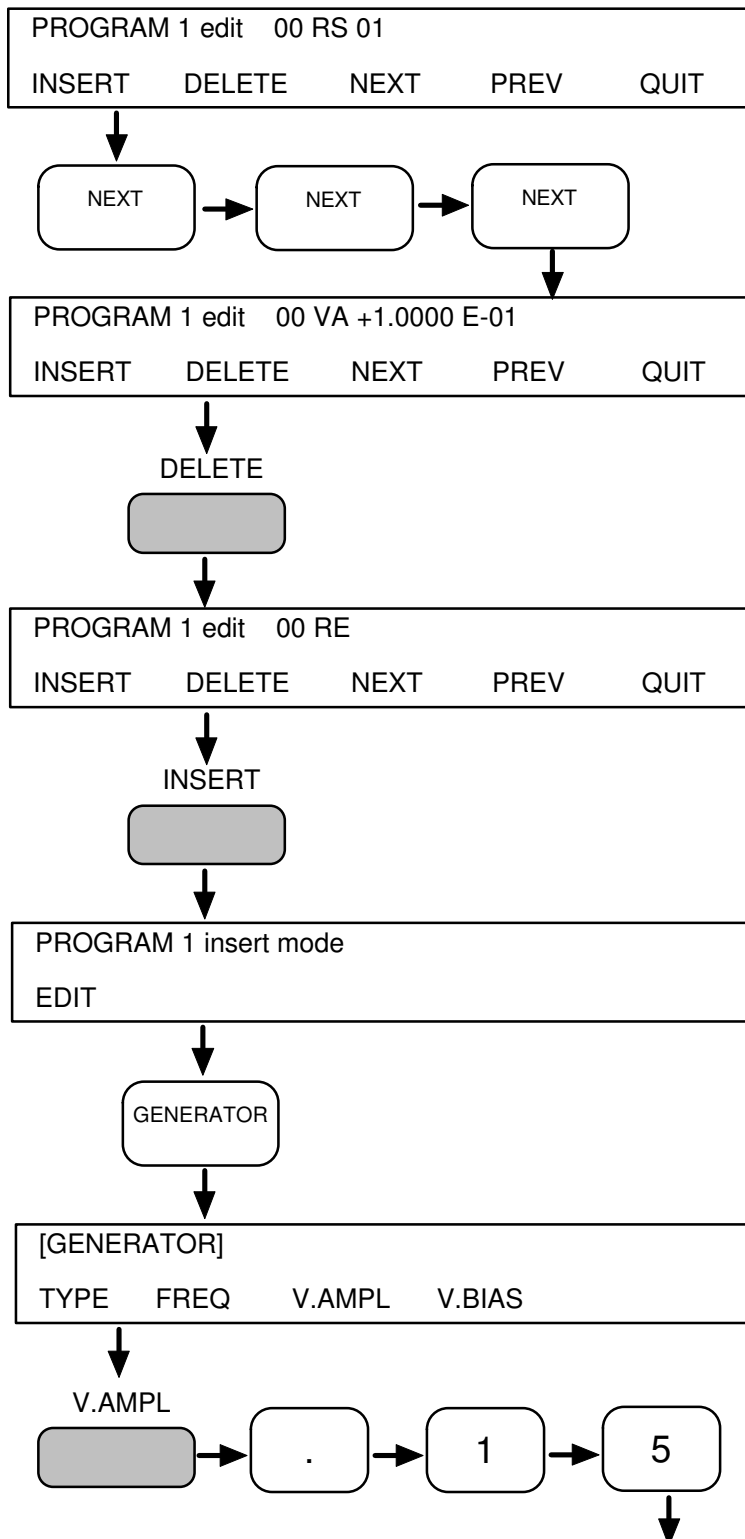

Enter the edit mode as shown in Section 11.6.1...

...and step to the instruction to be altered...

i.e. the instruction which sets the drive amplitude for the first sweep.

Delete this instruction....

(the instruction which follows it is displayed)


...and press INSERT....

...to enter the insert mode.

Now select...

...the [GENERATOR] menu...

...and key in the new drive amplitude, e.g. (0).15V.

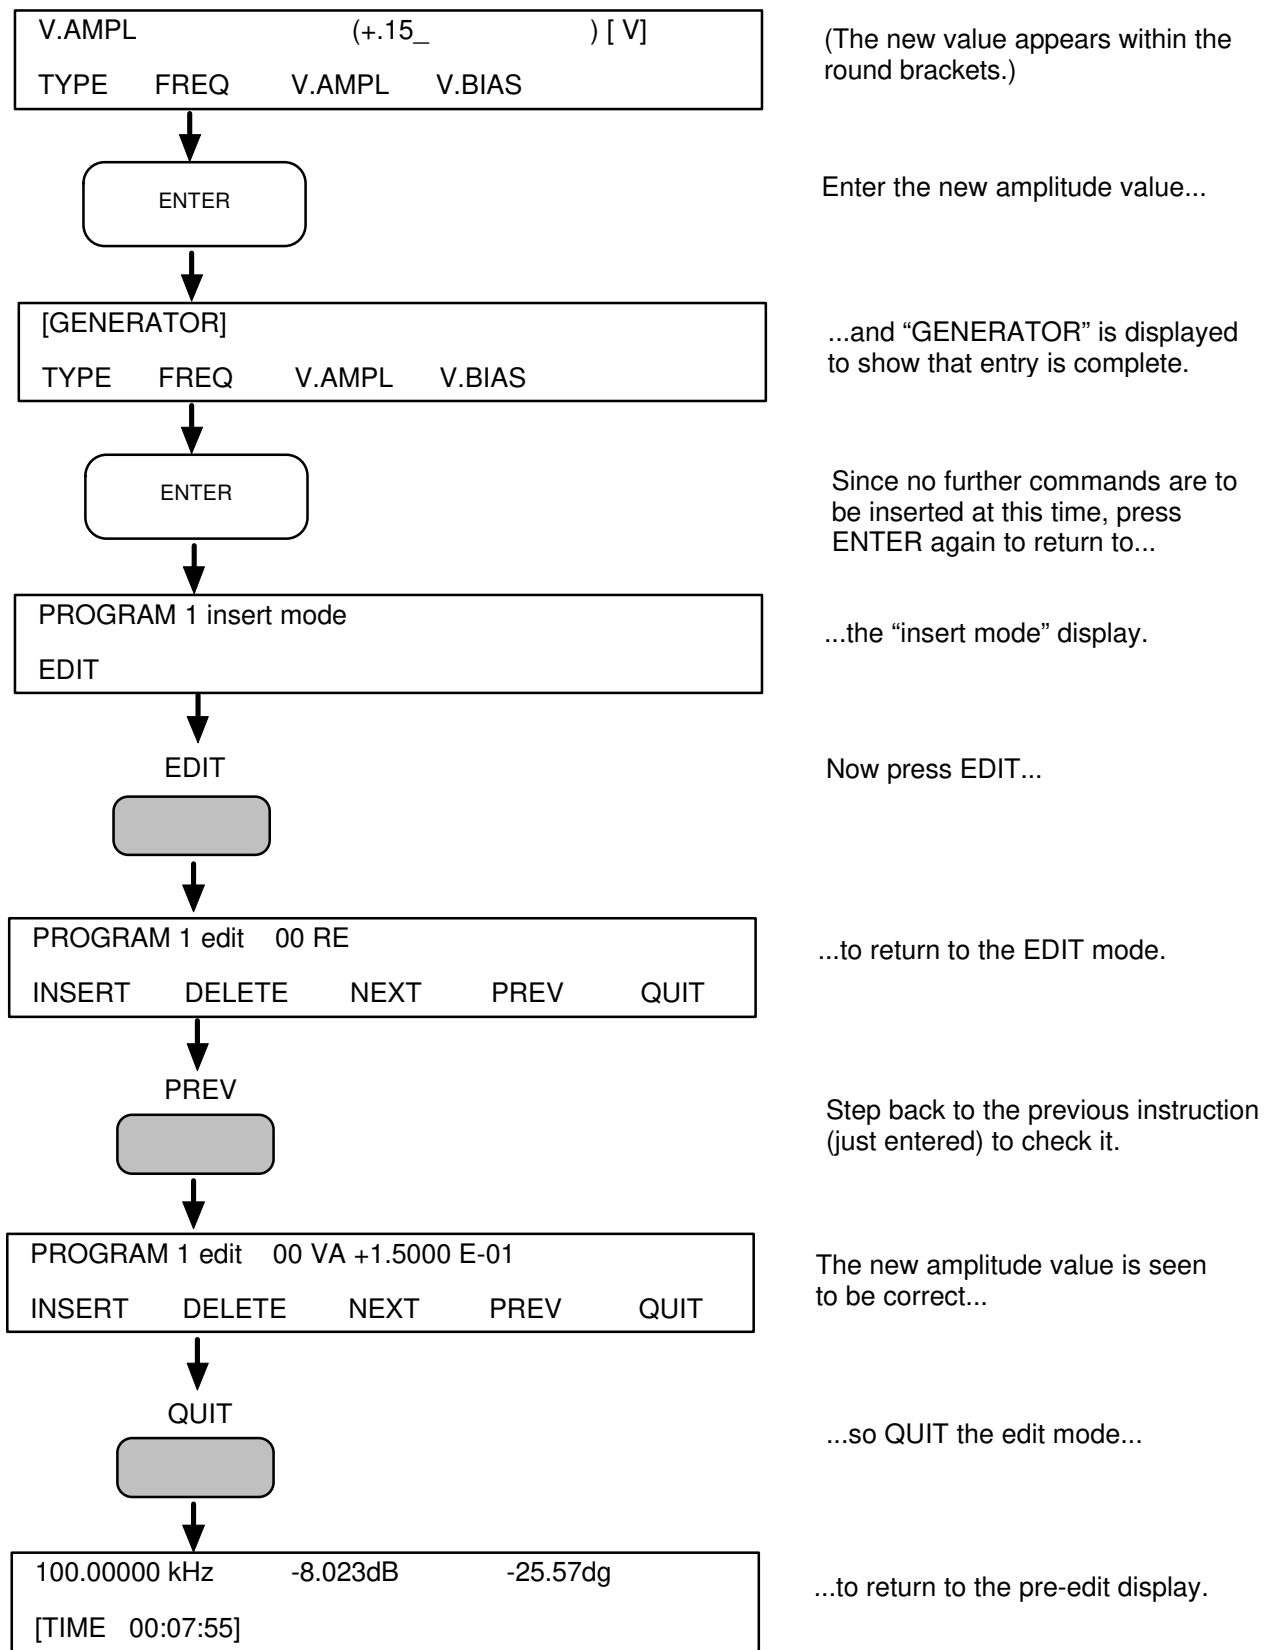

REMEMBER THE LEARNT PROGRAM RULES:

- A program may call another program as a sub-routine, from anywhere within itself. This sub-routine, in turn, may call a sub-sub-routine, and program “nesting” may be extended in this way up to five levels (counting the initial program as the first level). A sixth level is permitted on one condition, *that the routine at this level calls the initial program on completion*.
- A program may execute itself, but only if the execute instruction is the last one in the program.


11.8 COPYING A LEARNT PROGRAM

COPY allows a complete learnt program to be copied, under another program number. This facility is used for transferring learnt programs to non-volatile memory (program numbers 10 through 18). It may also be used, with EDIT, to derive one learnt program from another.

Note that the instrument must be operating in the supervisor mode for programs to be copied to program numbers 10 to 18. To protect these programs it is advisable to return the instrument to the normal mode immediately after copy complete, otherwise the programs may be corrupted by an inadvertent initialize.

11.8.1 COPY PROCEDURE

The copy procedure is:

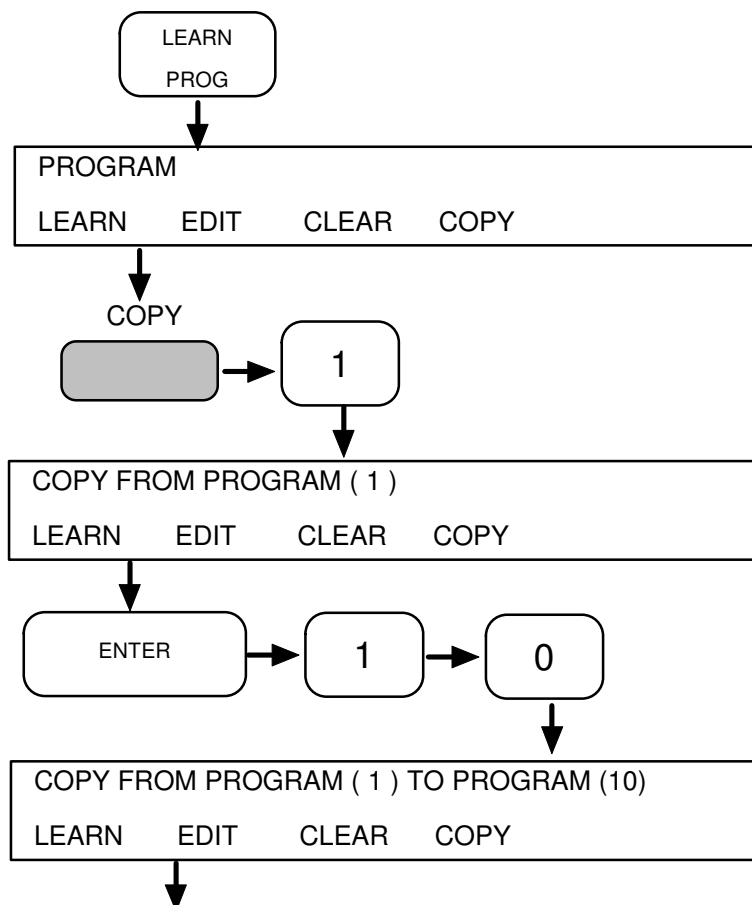


Press the LEARN PROG hard key....

... to select the learn program menu.

Press COPY and key in the number of the program to be copied.

Then press ENTER, and then key in the number under which the program is to be copied.

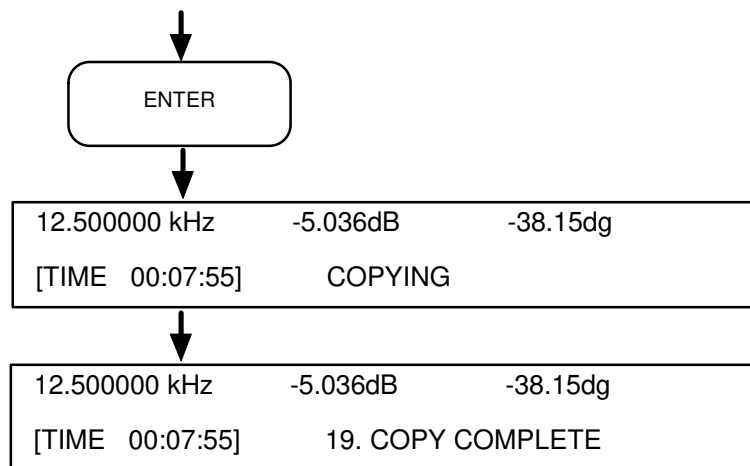

Enter the request...

...and, to show that something is happening, the message, "COPYING" is displayed...

...followed, when copying is complete, by the message, "19. COPY COMPLETE".

If a program is to execute itself (via an EPn instruction) remember to change the number n to the "copy to" program number.

INDEX

- accessories 2.3
- alternative circuit forms (display) 5.17
- analyzer
 - auto-integration 5.6
 - current input coupling 5.11
 - current input range 5.11
 - default settings 3.11
 - integration time 5.6
 - measurement delay 5.6
 - menu summary 4.3
 - menu terms 5.6
 - mode 5.8
 - query remote commands 8.12
 - remote commands 8.3
 - voltage input connections 5.10
 - voltage input coupling 5.9
 - voltage input range 5.9
- ASCII output
 - to a controller, RS423 7.13
 - to a printer, RS423 7.12
 - to a talk only device, GPIB 7.6
- assigning error events, GPIB 7.9
- auto impedance mode (analyzer) 5.8
-
- Baud rate switches, RS423 7.11
- binsorting (with CTM) 5.33
- binsorting (with test machine) 5.34
- Bode plot, making a (example) 3.19
-
- clear learn program 5.48
- clear set-up 5.47
- combined use of RS423 and GPIB 7.18
- commanding a single measurement 3.14
- constant, scaling, store status 5.45
- copy learn program 5.48
-
- data handshake, RS423 7.11
- data output
 - heading, RS423 and GPIB 5.28
 - menu summary 4.6
 - menu terms 5.27
 - ports 5.27
 - remote commands 8.8
- direct action remote commands 8.12
- display 3.6
 - circuit 5.17
 - coordinates, setting the (example) 3.22
 - menu summary 4.5
 - menu terms 5.15
 - phase 5.16
 - remote commands 8.5
 - result (source and coordinate) 5.15
 - variable 5.15
- dump output format, RS423 and GPIB 7.14
- grounding the instrument 2.4
-
- edit learn program 5.48
- error beep 5.50
- event status enable 7.9
- execute program, remote command 8.12
-
- file
 - clear 5.37
 - configure 5.30
 - configure, remote commands 8.9
 - format 5.30
 - statistics 5.30
-
- generator
 - current amplitude 5.4
 - voltage amplitude 5.3
 - current bias 5.4
 - voltage bias 5.3
 - frequency 5.3
 - menu summary 4.3
 - menu terms 5.3
 - output, vernier adjustment of 5.38
 - remote commands 8.3
 - setting the (example) 3.12
 - start and stop control 5.5
 - type: voltage or current 5.3
- GPIB
 - capability code 7.3
 - configure 5.28
 - configure, remote commands 8.8
 - connector 7.3
 - device address 7.4
 - dump output 7.6
 - input command terminator 7.4
 - interface 7.3
 - output data format 7.6
 - output separator 5.28
 - output terminator 5.28
 - status 5.42
 - switch settings (example) 7.5
 - switches 7.4
 - talk only switch 7.5
- group delay mode (analyzer) 5.8
-
- hard keys 3.4
- hard key assignments 3.5
- history file
 - clear 5.37
 - default settings 3.19
 - display 5.37
 - list 5.37
 - status 5.44
 - reading the (example) 3.20
-
- initialise 5.50

- input command terminator and character frame, RS423 7.11
- input, analyzer, remote commands 8.4
- installing a GPIB plotter (for PLOT) 3.21
- instrument keyboard 3.4

- key features (of instrument) 1.3

- learn program
 - clear 5.48
 - copy 5.48
 - edit 5.48
 - learn 5.48
 - memory status 5.41
 - menu summary 4.9
 - menu terms 5.48
 - remote commands 8.11

- limits
 - item 5.33
 - menu summary 5.33
 - remote commands 8.10
- local lockout 7.17

- making a Bode plot 3.21
- making a Nyquist plot 3.22
- main

- connection 2.6
 - fuse 2.5
 - lead 2.6
 - voltage selector 2.5

- measurement
 - auto integration 5.6
 - delay 5.6
 - integration time 5.6
 - limits check 5.33
 - mode 5.8
 - preliminaries 3.9
 - recycled (example) 3.19
 - statistics 5.46

- menu summary
 - analyzer 4.3
 - data output 4.6
 - display 4.5
 - generator 4.3
 - learn program 4.9
 - plotter 4.5
 - plotter axes 4.6
 - scale / limits 4.7
 - self test 4.9
 - status 4.8
 - store / recall 4.9
 - sweep 4.4
 - vernier 4.8
 - view file 4.8

- menu terms
 - analyzer 5.6
 - data output 5.27

- display 5.15
- generator 5.3
- learn program 5.48
- plotter 5.18
- plotter axes 5.24
- scale / limits 5.31
- self test 5.50
- status 5.41
- store / recall 5.47
- sweep 5.12
- vernier 5.38
- view file 5.37

- messages and error codes 9.1
- microprocessor status 5.42
- mini-status remote commands 8.12

- monitor
 - configurations 5.4
 - current limit 5.4
 - enable 5.4
 - error% 5.4
 - remote commands 8.3
 - voltage limit 5.4

- normal ASCII output to talker / listener devices, GPIB 7.6

- normalize 5.31
- null 5.32
- normal mode (analyzer) 5.8
- numeric keypad 3.4
- nyquist plot, making a 3.22

- parallel poll 7.10

- plot
 - facility, using the (example) 3.21
 - menu terms 5.23
 - remote commands 8.6
 - types 5.26

- plotter
 - axes 5.19
 - device 5.19
 - grid 5.18
 - menu summary 4.5
 - menu terms 5.18
 - mode 5.18
 - remote commands 8.6
 - scaling 5.19
 - scaling remote commands 8.6
 - scaling, vernier adjustments of 5.39
 - size 5.19
 - text 5.18
 - title 5.20
 - title edit 5.22
 - title entry 5.21
 - X-axis remote commands 8.7
 - Y-axis overlay remote commands 8.7
 - Y-axis main remote commands 8.7

- plotter axes
 - menu summary 4.6
 - menu terms 5.24
 - setting the (example) 3.23
- plotter X-axis
 - item 5.24
 - limits 5.24
 - full scale range (LIMITS) 5.24
 - lin / log scaling 5.25
 - pen 5.25
- plotter Y-axis, main 5.25
- plotter Y-axis, overlay 5.25
- power-up status 3.6
- program
 - keyswitch, learn program 5.49
 - keyswitch, scaling function 5.36
 - keyswitch, store / recall 5.47
 - query, remote commands 8.12
 - status 5.41
- rack dimensions 2.7
- rack mounting 2.7
- reading the history file (example) 3.20
- recall set-up 5.47
- recycled measurements (example) 3.19
- remote / local control, GPIB and RS423 7.16
- reset 5.50
- result deviation 5.33
- result store status 5.45
- RS423
 - configure 5.29
 - configure, remote commands 8.9
 - dump output 7.13
 - input data echo 5.29
 - output data format (mode) 5.29
 - output separator 5.29
 - output terminator 5.29
 - software handshake (XON / XOFF) 5.30
 - status 5.43
- safety 2.3
- scale / limits menu summary 4.7
- scale / limits menu terms 5.31
- scaling
 - constants 5.32
 - constant store status 5.45
 - function 5.32
 - function store status 5.44
 - remote commands 8.9
- self test
 - menu summary 4.9
 - menu terms 5.50
 - query, remote commands 8.12
 - remote commands 8.12
- serial interface (RS423)
 - connector 7.12
 - data handshake 7.11
 - output data format 7.12
 - standards 7.11
- serial poll 7.7
- service request enable 7.8
- set-up store status 5.43
- setting
 - the display coordinates 3.22
 - the generator (example) 3.12
 - the plotter axes (example) 3.23
 - the sweep 3.16
 - the time 5.50
 - a service request, GPIB 7.8
- single measurement, commanding a 3.14
- soft keys 3.4
- specification 1.5
- status
 - byte 7.7
 - menu summary 4.8
 - menu terms 5.41
 - remote commands 8.11
- status 1
 - GPIB interface 5.42
 - microprocessor 5.42
 - program 5.41
 - RS423 interface 5.43
 - control set-up store 5.43
 - history file 5.44
- status 2
 - scaling constants 5.45
 - scaling functions 5.44
 - statistics 5.46
 - stored results 5.45
- store
 - result 5.47
 - set-up 5.47
- stored result status 5.45
- stored set-up status 5.43
- store / recall
 - menu summary 4.9
 - menu terms 5.47
 - remote commands 8.11
- sweep
 - direction 5.12
 - facility, using the 3.16
 - limits,
 - current amplitude 5.14
 - current bias 5.14
 - frequency 5.13
 - remote commands 8.5
 - voltage amplitude 5.13
 - voltage bias 5.14
- linear frequency steps 5.13
- log frequency steps 5.12
- menu summary 4.4
- menu terms 5.12
- remote commands 8.4

- sweep (continued)
 - type (enable) 5.12
 - setting the 3.16
- talk only, GPIB 3.21, 7.5
- telescopic slide fitting (Accuride) 2.8
- telescopic slide fitting (Jonathan) 2.14
- telescopic slide kit (Accuride) 2.7
- use of manual 1,4
- using a control menu 3.7
- using the plot facility 3.21
- ventilation 2.7
- vernier
 - generator adjustment 5.38
 - plotter adjustment 5.39
 - menu summary 4.8
 - menu terms 5.38
 - remote commands 8.11
- view file
 - menu summary 4.8
 - menu terms 5.37
 - query, remote commands 8.12
 - remote commands 8.10

