

CT6844

CT6844-05

AC/DC CURRENT PROBE

Instruction Manual

Oct. 2015 Edition 1

Printed in Japan

CT6844A961-00 15-10H

EN

HIOKI

HIOKI E. E. CORPORATION

HEADQUARTERS

81 Koizumi, Ueda, Nagano 386-1192, Japan

TEL +81-268-28-0562 FAX +81-268-28-0568

os-com@hioki.co.jp www.hioki.com

(International Sales Department)

Please visit our website at www.hioki.com for the following:

• Regional contact information

• The latest revisions of instruction manuals and manuals in other languages.

• Declarations of Conformity for instruments that comply with CE mark requirements.

Warranty

Warranty malfunctions occurring under conditions of normal use in conformity with the Instruction Manual and Product Precautionary Markings will be repaired free of charge. This warranty is valid for a period of one (1) year from the date of purchase. Please contact the distributor from which you purchased the product for further information on warranty provisions.

Introduction

Thank you for purchasing the HIOKI Model CT6844, CT6844-05 AC/DC Current Probe. To obtain maximum performance from the device, please read this manual first, and keep it handy for future reference.

Inspection

When you receive the device, inspect it carefully to ensure that no damage occurred during shipping. In particular, check the accessories and cables. If damage is evident, or if it fails to operate according to the specifications, contact your dealer or Hioki representative.

Precautions during Shipment

Handle the device carefully so that it is not damaged due to a vibration or shock.

Safety

This device is designed to conform to IEC 61010 Safety Standards, and has been thoroughly tested for safety prior to shipment. However, using the instrument in a way not described in this manual may negate the provided safety features. Before using the instrument, be certain to carefully read the following safety notes.

⚠ DANGER

ⓘ Mishandling during use could result in injury or death, as well as damage to the device. Be certain that you understand the instructions and precautions in the manual before use.

⚠ WARNING

With regard to the electricity supply, there are risks of electric shock, heat generation, fire, and arc discharge due to short circuits. If persons unfamiliar with electricity measuring instrument are to use the instrument, another person familiar with such instruments must supervise operations.

Notation

In this manual, the risk seriousness and the hazard levels are classified as follows.

⚠ DANGER	Indicates an imminently hazardous situation that will result in death or serious injury to the operator.
⚠ WARNING	Indicates a potentially hazardous situation that may result in death or serious injury to the operator.
⚠ CAUTION	Indicates a potentially hazardous situation that may result in minor or moderate injury to the operator or damage to the device or malfunction.

Safety Symbols

⚡	Indicates hazardous high voltage. Provides warning that negligent safety check or incorrect operation presents a significant hazard that could result in electrical shock, burn injury, or even death to the user.
🚫	Indicates the prohibited action.
ⓘ	Indicates the compulsory action.

Symbols Affixed to the Device

⚠	Indicates cautions and hazards. When the symbol is printed on the device, refer to a corresponding topic in the Instruction Manual.
🚫	Indicates that only insulated conductors suited to the voltage of the conductor under test can be measured.

Symbols for Various Standards

♻	Indicates the Waste Electrical and Electronic Equipment Directive (WEEE Directive) in EU member states.
CE	Indicates that the product conforms to regulations set out by the EC Directive.

Usage Notes

Follow these precautions to ensure safe operation and to obtain the full benefits of the various functions.

⚠ DANGER

Do not use the device to measure bare conductors. Doing so may result in a short-circuit or electrical shock. Make measurements at a location on an insulated wire that has a suitable amount of insulation for the circuit voltage.

ⓘ

The maximum measurable current varies with the frequency, and the current that can be measured continuously is limited. Operating the device at less than this limitation is referred to as derating. Do not measure currents in excess of the derating curve. Doing so may result in device damage or malfunction, fire, or burns due to sensor heating.

⚠ CAUTION

🚫

Do not place foreign objects between the jaws or insert foreign objects into the gaps of the sensor head. Doing so may worsen the performances of the sensor or interfere with clamping action.

ⓘ

When the connected instrument's power is turned off, do not apply current to the sensor. Doing so may damage the device.

🚫

Avoid stepping on or pinching cables, which could damage the cables insulation.

🚫

Be careful to avoid dropping the device or otherwise subjecting them to mechanical shock, which could damage the jaw and adversely affect measurement.

🚫

Do not touch the cores with the jaw opened. If the cores are subject to static electricity, the device may be damaged.

🚫

Keep the jaw closed when not in use, to avoid accumulating dust or dirt on the facing core surfaces, which could interfere with clamp performance.

ⓘ

When the power to conductors to be measured is turned on or off, a current flowing through the lines can exceed considerably the maximum allowable current of the device. This could result in damage to the device. Make sure that there is not any over-current.

🚫

When disconnecting the output connector, be sure to release the lock before pulling off the connector. Forcibly pulling the connector without releasing the lock, or pulling on the cable, can damage the connector.

🚫

The cable is hardened under the 0°C or colder environment. Do not bend or pull it to avoid tearing its shield or cutting cable.

Installation Environment

⚠ WARNING

Installing the device in inappropriate locations may cause a malfunction of device or may give rise to an accident. Avoid the following locations:

🚫

Exposed to direct sunlight or high temperature

Exposed to corrosive or combustible gases

Exposed to a strong electromagnetic field or electrostatic charge

Near induction heating systems (such as high-frequency induction heating systems and IH cooking equipment)

Susceptible to vibration

Exposed to water, oil, chemicals, or solvents

Exposed to high humidity or condensation

Exposed to high quantities of dust particles

Overview

The CT6844 and CT6844-05 are openable and closable clamp current sensors that are designed to measure AC and DC currents of up to 500 A at a high level of precision. They offer excellent frequency characteristics (amplitude and phase) as well as excellent temperature characteristics (sensitivity and offset) and can be used not only for current measurement, but also for high-precision power measurement.

Usage with Other Hioki Products


This device is used in connection with a dedicated instrument (Hioki product). Refer to “Combined accuracy and conditions” specified in the specifications for details.

Maintenance and Service

- To clean the device, wipe it gently with a soft cloth moistened with water or mild detergent.

- Measurements are degraded by dirt on the mating surfaces of the jaw, so keep the surfaces clean by gently wiping with a soft, dry cloth.

Names of Parts

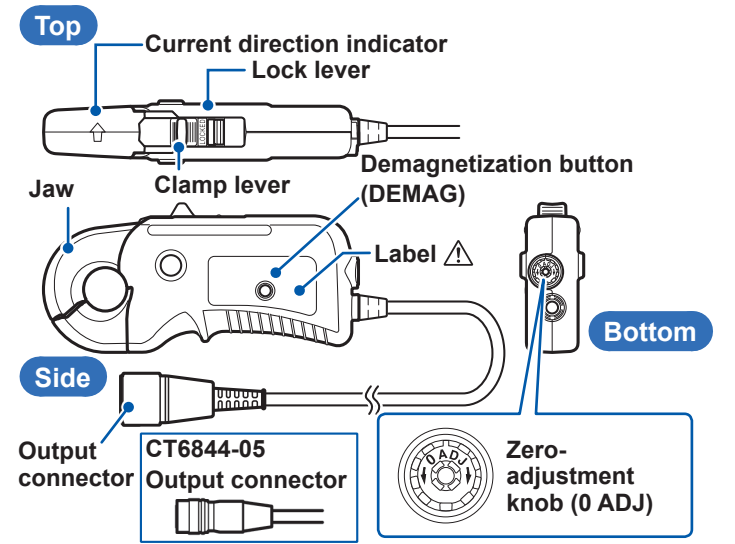

Options


9705 Conversion Cable*1, 9318 Conversion Cable*1, CT9900 Conversion Cable*1, CT9901 Conversion Cable*2

The Conversion Cable makes it possible to connect to and use with products that cannot be directly connected to the CT6844 or CT6844-05 (Refer to “Connection example”).

9706 Extension Cable*1(5 m), CT9902 Extension Cable*2(5 m)

- The cable length extended to 8 m
 - Up to two of the Extension Cable available (If three or more extension cables are connected to the device, its performance is not guaranteed)
 - Add the following values to each of the accuracy per cable:
Amplitude accuracy: $\pm 0.1\%$ rdg. ($DC \leq f^{*3} \leq 1$ kHz)
 $\pm 0.5\%$ rdg. (1 kHz $< f^{*3}$)
Phase accuracy: $\pm (0.1 \times f^{*3}$ kHz) deg. (1 kHz $< f^{*3}$)
- *1: For CT6844, *2: For CT6844-05, *3: frequency

Connection Example

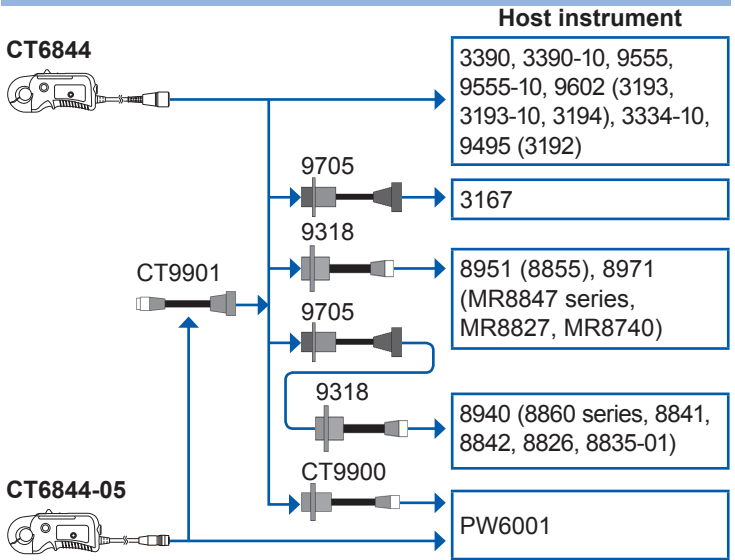

Cannot be directly connected to any parenthesized models. A module is required. Refer to “Combined accuracy and conditions” specified in the specifications.

Measurement

Pre-operation Inspection

Verify that the device operates normally to ensure that no damage occurred during storage or shipping. If you find any damage, contact your authorized Hioki distributor or reseller.

Check Items	Solution
Is there any wiring break involving the output connector or sensor base?	If any, proper measurement cannot be made. Discontinue use and contact your authorized Hioki distributor or reseller.
Is the cable insulation torn?	If there is any damage, electric shock may result. Discontinue use and have the sensor repaired.
Is there any cracking or damage on the jaw?	Is there any cracking or repaired.

CAUTION

Do not place conductors carrying currents with frequencies of 10 kHz or higher in close proximity to the jaw, even if the device does not clamp them. Current flowing through nearby conductors may cause self-heating of the jaw, damaging the device.

This device has the protective resistance (output resistance) in the signal output circuit. To monitor the output signal, it is recommended to use a measuring instrument, such as digital multimeter, that has an input resistance of 1 MΩ or higher.

Procedures

1

Attach the device to the host instrument that is powered off.

2

Turn on the host instrument.

3

Perform a demagnetization (DE MAG) and/or zero-adjustment (0 ADJ) (if needed). Refer to “Demagnetization (DE MAG) and Zero-adjustment (0 ADJ).”

4

Release the jaw lock (UNLOCKED will appear).

5

Open the jaw.

6

Clamp only one conductor to be measured and close the jaw.

• Check that the tips of jaw are engaged each other.

• If the current direction indication is oriented against the current direction, a polarity of output signal is reversed.

7

Lock the jaw (LOCKED will appear).

Slide the clamp lever.

Source side

Conductor

Load side

Current direction indicator

Current direction

OK

NO

NO

Slide the lock lever.

5

6

7

4

UNLOCKED

8

Start measurement.

9

On completion of the measurement, remove the device from the conductor.

10

Turn off the host instrument.

11

Detach the device from the host instrument.

Demagnetization (DE MAG) and Zero-Adjustment (0 ADJ)

Immediately after the power is turned on or an over-current exceeding the rated current is input, an offset can be output. Because the offset behaves as an error during DC current measurement, perform a demagnetization and/or zero-adjustment, going through the following procedure.

1

Open the jaw and press the demagnetization (DE MAG) button.

Demagnetization (DE MAG) button

2

Open and close the jaw several times and check if the offset output is stabilized, observing the host instrument display.

3

Lock the jaw (LOCKED will appear).

4

Perform a zero-adjustment by turning the zero-adjust knob (0 ADJ), observing the offset output displayed on the host instrument display.

Notch

• No zero-adjustment can be performed while any current is input.

• Because offset output varies with the surrounding environment and the ambient temperature (terrestrial magnetism and other devices that generate magnetic fields), perform the zero-adjustment at the same location at which measurements will be made.

• If the device is connected to an host instrument with a zero correction function, align the notch of the zero-adjustment knob with the upper center.

• Mechanical shock, for example from dropping the instrument, may cause the offset to shift.

• If no zero-adjustment can be completed, perform demagnifications (DE MAGs) several times with the jaw remaining closed.

• When measuring a DC or low-frequency (1 kHz or less) current of small magnitude, you can increase sensitivity on a relative basis by wrapping the conductor several times around the jaw. Wrapping the conductor 10 times will cause the device to output a signal equal to 10 times the measured current.

• In the high-frequency domain, when the high-potential side of a circuit (the High side) is clamped, measured values may be affected by common-mode noise.

• 1.5 MHz harmonic noise arising from the operating principle can be emitted.

• Place the clamped conductor to be measured as close to the jaw center as possible. Separate other conductors from the device as far away as possible. Measuring large currents with a frequency of 1 kHz or more or locating unclamped conductors carrying 500 A or more of such high-frequency currents close to the jaw can cause increases in errors or waveform distortions.

Source

High

Low

Current

Load

Specifications

Accuracy

f.s.	Maximum display value or scale length (This is usually the maximum value of the currently selected range.)
rdg.	Reading value (The value currently being measured and indicated on the measuring instrument)

The specs of the CT6844-05 are the same as those of the CT6844 except the output connector and options.

Operating environment	Indoors, Pollution Degree II, altitude up to 2000 m (6562 ft.)
-----------------------	--

Operating temperature and humidity	-40°C to 85°C (-40.0°F to 185.0°F), 80% RH or less (no condensation)
Storage temperature and humidity	-40°C to 85°C (-40.0°F to 185.0°F), 80% RH or less (no condensation)
Standards	Safety: EN61010 EMC: EN61326
Dielectric strength	4260 V AC (current sensitivity: 1 mA), 50 Hz/60 Hz, for 1 minute, between jaw and output connector of cable
Product warranty period	1 year
Rated current	500 A AC/DC
Output voltage	4 mV/A
Maximum input current	Within the derating curve
Output resistance	50 Ω (±5%)
Temperature and humidity for guaranteed accuracy	0°C to 40°C (32.0°F to 104.0°F), 80% RH or less
Guaranteed accuracy period	1 year, opening and closing of the jaw: up to 10000 times
Guaranteed accuracy period from adjustment made by Hioki	1 year, opening and closing of the jaw: up to 10000 times

Accuracy

Sine wave input; Conductor at center position; Connected with Model 9555-10; Not including each effect; Measuring instrument that has an input resistance of 1 MΩ or higher
Amplitude accuracy (Defined at the rated value or less and within the derating curve; The accuracy defined for the frequency range of DC < f < 5 Hz is the design value)
Phase accuracy (Defined at the rated value or the maximum value of derating curve, whichever is smaller; The accuracy defined for a frequency range of DC < f < 10 Hz is a design value)

Frequency	Amplitude	Phase
DC	±0.3% rdg.±0.02% f.s.*	–
DC < f ≤ 100 Hz	±0.3% rdg.±0.01% f.s.	±0.1 deg.
100 Hz < f ≤ 500 Hz	±0.3% rdg.±0.02% f.s.	±0.2 deg.
500 Hz < f ≤ 1 kHz	±0.5% rdg.±0.02% f.s.	±0.5 deg.
1 kHz < f ≤ 5 kHz	±1.0% rdg.±0.02% f.s.	±1.0 deg.
5 kHz < f ≤ 10 kHz	±1.5% rdg.±0.02% f.s.	±1.5 deg.
10 kHz < f ≤ 50 kHz	±5% rdg.±0.02% f.s.	±(0.5 + 0.1 × f kHz) deg.
50 kHz < f ≤ 100 kHz	±15% rdg.±0.05% f.s.	
100 kHz < f ≤ 200 kHz	±30% rdg.±0.05% f.s.	

* An accuracy of ±0.02% f.s. is accomplished after the offset voltage is adjusted within a range of ±0.2 mV.

Offset adjustable range	±2 mV
Emitted noise	5 mV pp or less (100 kHz or less)
Temperature coefficient	-40°C to 0°C and 40°C to 85°C Amplitude sensitivity: ±0.01% rdg./°C or less Offset voltage: ±0.005% f.s./°C or less
Effect of conductor position	±0.1% rdg. or less (input current of 100 A, DC to 100 Hz, with the use of a 10 mm diameter wire)
Effect of external electromagnetic field	100 mA or less (value scaled to the input, in a DC or 60 Hz magnetic field of 400 A/m)
Effect of magnetic	75 mA or less (value scaled to the input, after 500 A DC input)
Effect of common-mode voltage	0.05% f.s. or less (1000 V rms, DC to 100 Hz)
Effect of radiated radio-frequency electromagnetic field	6% f.s. at 10 V/m
Effect of conducted radio-frequency electromagnetic field	6% f.s. at 3 V
Measurable conductor diameter	φ20 mm or less

Supply voltage	±11 V to ±15 V (tracking)														
Power capacity	±300 mA or less (When measuring a current of 500 A with a frequency of 55 Hz, while ±12 V power is supplied)														
Rated power	7 VA or less (When measuring a current of 500 A with a frequency of 55 Hz, while ±12 V power supplied)														
Dimensions	Approx. 153W×67H×25D mm (6.02"W×2.64"H×0.98"D) (excluding protrusions or cable)														
Mass	Approx. 400 g (14.1 oz.)														
Cable length	Approx. 3 m														
Output connector	CT6844: Hioki PL23 CT6844-05: Hioki ME15W														
Accessories	Mark bands (×6), Carrying case, Instruction manual														
Options	<table><tbody><tr><td rowspan="4">For CT6844</td><td>9705</td><td>Conversion Cable</td></tr><tr><td>9706</td><td>Extension Cable</td></tr><tr><td>9318</td><td>Conversion Cable</td></tr><tr><td>CT9900</td><td>Conversion Cable</td></tr><tr><td rowspan="2">For CT6844-05</td><td>CT9901</td><td>Conversion Cable</td></tr><tr><td>CT9902</td><td>Extension Cable</td></tr></tbody></table>	For CT6844	9705	Conversion Cable	9706	Extension Cable	9318	Conversion Cable	CT9900	Conversion Cable	For CT6844-05	CT9901	Conversion Cable	CT9902	Extension Cable
For CT6844	9705		Conversion Cable												
	9706		Extension Cable												
	9318		Conversion Cable												
	CT9900	Conversion Cable													
For CT6844-05	CT9901	Conversion Cable													
	CT9902	Extension Cable													

Combined accuracy and conditions

Combined accuracy = Accuracy of CT6844(-05) + Accuracy of combined product (Power factor: 1)

Combined product	Required option	
	CT6844	CT6844-05
9555-10, 9555 Sensor Unit	–	CT9901
PW6001 Power Analyzer	CT9900	–
3390, 3390-10 Power Analyzer	–	CT9901
9602 AC/DC Clamp Input Unit ¹	–	CT9901
3334-10 AC/DC Power HiTester	–	CT9901
8940 F/V Unit ²	9705+9318	CT9901+9705+9318
8971 Current Unit ²	9318	CT9901+9318
8951 Voltage/Current Unit ²	9318	CT9901+9318
9495 Input Unit ³	–	CT9901
3167 AC/DC Clamp On Power HiTester	9705	CT9901+9705

*1: Add ±0.1% rdg. to the combined accuracy.

*2: The sensor recognition methods vary according to the Memory HiCorder settings (refer to the manuals of Memory HiCorder to be connected).

*3: Recognized as Model 9278 (200 A sensor). Set the CT ratio to 2.5.

Input current [A rms]

1 k

100

10

1

DC

1

10

100

1 k

10 k

100 k

1 M

720 A DC

500 A

2 kHz 500 A

20 kHz 100 A

200 kHz 20 A

-40°C ≤ T_a ≤ 85°C

T_a: Ambient temperature

Frequency [Hz]

Current derating curve

5

6

7

8