



**DC POWER SUPPLY
BENCH SERIES
MODEL 6217A**

OPERATING AND SERVICE MANUAL

FOR SERIALS 8G2551 - up*

*For Serials Above 8G2551
Check for inclusion of
change page.

For Serials Below 8G2551
Refer to Appendix A

100 Locust Avenue, Berkeley Heights, New Jersey 07922

HP Part No. 06217-90001

Printed: February, 1969

TABLE OF CONTENTS

Section	Page No.	Section	Page No.
I GENERAL INFORMATION	1-1	IV PRINCIPLES OF OPERATION (CONTINUED)	
1-1 Description	1-1	4-6 Feedback Loop	4-2
1-5 Specifications	1-1	4-11 Series Regulator	4-2
1-7 Options	1-1	4-13 Constant Voltage Input Circuit	4-2
1-9 Accessories	1-1	4-17 Driver and Error Amplifier	4-3
1-11 Instrument/Manual Identification	1-1	4-20 Current Limiting Circuit	4-3
1-14 Ordering Additional Manuals	1-1	4-22 Reference Circuit	4-3
		4-26 Meter Circuit	4-3
II INSTALLATION	2-1	V MAINTENANCE	5-1
2-1 Initial Inspection	2-1	5-1 Introduction	5-1
2-3 Mechanical Check	2-1	5-3 Cover Removal and Replacement	5-1
2-5 Electrical Check	2-1	5-6 General Measurement Technique	5-1
2-7 Installation Data	2-1	5-11 Test Equipment Required	5-2
2-9 Location	2-1	5-13 Performance Test	5-3
2-11 Outline Diagram	2-1	5-15 Rated Output and Meter Accuracy	5-3
2-13 Rack Mounting	2-1	5-18 Load Regulation	5-3
2-15 Input Power Requirements	2-2	5-20 Line Regulation	5-3
2-17 Connections for 230V Operation	2-2	5-35 Output Impedance	5-6
2-19 Power Cable	2-2	5-38 Current Limit	5-7
2-22 Repackaging For Shipment	2-2	5-40 Transient Recovery Time	5-7
III OPERATING INSTRUCTIONS	3-1	5-46 Troubleshooting	5-8
3-1 Turn-On Checkout Procedure	3-1	5-48 Trouble Analysis	5-8
3-3 Operation	3-1	5-53 Repair and Replacement	5-11
3-5 Constant Voltage	3-1	5-55 Adjustment and Calibration	5-13
3-7 Changing Current Limit	3-1	5-57 Meter Mechanical Zero	5-13
3-9 Connecting Load	3-1	5-59 Meter Calibration	5-13
3-12 Operation of Supply Beyond Rated Output	3-2	5-61 Zero Volts Output Adjustment	5-13
3-14 Optional Operating Modes	3-2	5-63 Output Current Limit Adjustment	5-13
3-15 Series Operation	3-2	VI REPLACEABLE PARTS	6-1
3-17 Parallel Operation	3-2	6-1 Introduction	6-1
3-19 Special Operating Considerations	3-2	6-4 Ordering Information	6-1
3-20 Pulse Loading	3-2	Reference Designators	
3-22 Output Capacitance	3-2	Abbreviations	
3-24 Reverse Current Loading	3-2	Manufacturers	
IV PRINCIPLES OF OPERATION	4-1	6-8 Code List of Manufacturers	6-2
4-1 Simplified Discussion	4-1	Parts List Table	
4-5 Detailed Circuit Analysis	4-2	APPENDIX A	A-1

TABLE OF CONTENTS (CONTINUED)

LIST OF TABLES

Table	Page No.	Table	Page No.
1-1 Specifications	1-2	5-4 Low Output Voltage Troubleshooting	5-10
5-1 Test Equipment Required	5-2	5-5 High Output Voltage Troubleshooting	5-11
5-2 Common Troubles	5-9	5-6 Selected Semiconductor Characteristics	5-11
5-3 Reference, Bias, and Filtered DC Troubleshooting	5-10	5-7 Calibration Adjustment Summary	5-13

LIST OF ILLUSTRATIONS

Figure	Page No.	Figure	Page No.
1-1 DC Power Supply	1v	5-3 Differential Voltmeter Substitute Test Setup	5-3
2-1 Outline Diagram	2-1	5-4 Output Current, Test Setup	5-3
2-2 Rack Kit with Three BENCH Supplies	2-1	5-5 Load Regulation, Test Setup	5-4
2-3 Input Power Transformer Connections	2-2	5-6 Ripple and Noise, Test Setup	5-5
3-1 Front Panel Controls and Indicators	3-1	5-7 Noise Spike Test Setup	5-6
4-1 Simplified Schematic	4-1	5-8 Output Impedance, Test Setup	5-6
5-1 Front Panel Terminal Connections	5-1	5-9 Transient Recovery Time, Test Setup	5-7
5-2 Output Current Measurement Technique	5-1	5-10 Transient Recovery Time, Waveforms	5-8
		5-11 Servicing Printed Wiring Boards	5-12



Figure 1-1. DC Power Supply

SECTION I GENERAL INFORMATION

1-1 DESCRIPTION

1-2 This power supply, Figure 1-1, is completely transistorized and suitable for either bench or relay rack operation. It is a compact, regulated, Constant Voltage/Current Limiting supply. The output voltage can be continuously adjusted throughout the output voltage range. The power supply is fully protected from overloads by a fixed current limit which is set by means of an internal adjustment. The current limit circuit permits series and parallel connection of two or more supplies when greater voltage or current is desired.

1-3 Either the positive or negative output terminal may be grounded or the power supply can be operated floating at up to a maximum of 300 volts off ground.

1-4 A single meter is used to measure either output voltage or output current in volts and milliamps, respectively. The voltage or current range is selected by the METER switch on the front panel.

1-5 SPECIFICATIONS

1-6 Detailed specifications for the power supply are given in Table 1-1.

1-7 OPTIONS

1-8 Options are factory modifications of a standard instrument that are requested by the customer. The following options are available for the instrument covered by this manual. Where necessary, detailed coverage of the options is included throughout the manual.

<u>Option No.</u>	<u>Description</u>
28	<u>230Vac, 50-400Hz, Single-Phase Output</u> ; Factory modification consists of reconnecting the input transformer for 230Vac operation. Refer to Section II for further details.

1-9 ACCESSORIES

1-10 The accessories listed in the following chart may be ordered with the power supply or separately from your local Hewlett-Packard field sales office (refer to list at rear of manual for addresses).

<u>Part No.</u>	<u>Description</u>
14521A	3½" High Rack Kit for mounting up to three BENCH supplies. (Refer to Section II for details.)
14522A	7" High Rack Kit for mounting up to six BENCH supplies. (Refer to Section II for details.)

1-11 INSTRUMENT/MANUAL IDENTIFICATION

1-12 Hewlett-Packard power supplies are identified by a three-part serial number tag. The first part is the power supply model number. The second part is the serial number prefix, which consists of a number-letter combination that denotes the date of a significant design change. The number designates the year, and the letter A through L designates the month, January through December respectively. The third part is the power supply serial number.

1-13 If the serial number prefix on your power supply does not agree with the prefix on the title page of this manual, change sheets are included to update the manual. Where applicable, backdating information is given in an appendix at the rear of the manual.

1-14 ORDERING ADDITIONAL MANUALS


1-15 One manual is shipped with each power supply. Additional manuals may be purchased from your local Hewlett-Packard field office (see list at rear of this manual for addresses). Specify the model number, serial number prefix, and  stock number provided on the title page.

Table 1-1. Specifications

INPUT:

105-125Vac, single phase, 50-400Hz.

OUTPUT:

0-50Vdc, 0-200mA.

LOAD REGULATION:

Less than 4mV for a full load to no load change in output current.

LINE REGULATION:

Less than 4mV for any line voltage change within the input rating.

RIPPLE AND NOISE:

Less than 200 μ V rms/1mV p-p (dc to 20MHz).

TEMPERATURE RANGES:

Operating: 0 to 55°C. Storage: -40 to +85°C.

TEMPERATURE COEFFICIENT:

Less than 0.02% plus 1mV per degree Centigrade.

STABILITY:

Less than 0.10% plus 5mV total drift for 8 hours after an initial warm-up time of 30 minutes at constant ambient, constant line voltage, and constant load.

INTERNAL IMPEDANCE AS A CONSTANT VOLTAGE SOURCE:

Less than 0.03 ohms from dc to 1KHz.

Less than 0.5 ohms from 1KHz to 100KHz.

Less than 3.0 ohms from 100KHz to 1MHz.

TRANSIENT RECOVERY TIME:

Less than 50 μ sec for output recovery to within 10mV following a full load current change in the output.

OVERLOAD PROTECTION:

A fixed current limiting circuit protects the power supply for all overloads including a direct short placed across the output terminals in constant voltage operation.

METER:

The front panel meter can be used as either a 0-60V voltmeter or as a 0-250mA ammeter.

OUTPUT CONTROLS:

Coarse and fine voltage controls set desired output voltage. Meter switch selects voltage or current.

OUTPUT TERMINALS:

Three "five-way" output posts are provided on the front panel. All power supply output terminals are isolated from the chassis and either the positive or negative terminal may be connected to the chassis through a separate ground terminal located on the output terminal strip.

COOLING:

Convection cooling is employed. The supply has no moving parts.

SIZE:

5 $\frac{1}{4}$ "/13,34cm W x 3 $\frac{1}{4}$ "/8,26cm H x 7"/17,78cm D. Using a Rack Mounting Kit, three units can be mounted side by side in a standard 19" relay rack.

WEIGHT:

5.25 lbs./2,38 kg net; 7 lbs./3,17 kg shipping.

FINISH: Dark Gray.

POWER CORD:

A three-wire, five-foot power cord is provided with each unit.

SECTION II INSTALLATION

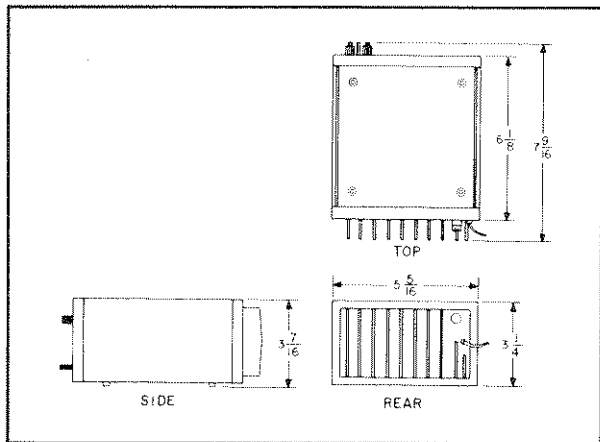


Figure 2-1. Outline Diagram

2-1 INITIAL INSPECTION

2-2 Before shipment, this instrument was inspected and found to be free of mechanical and electrical defects. As soon as the instrument is unpacked, inspect for any damage that may have occurred in transit. Save all packing materials until the inspection is completed. If damage is found, file claim with carrier immediately. Hewlett-Packard Sales and Service office should be notified as soon as possible.

2-3 MECHANICAL CHECK

2-4 This check should confirm that there are no broken knobs or connectors, that the cabinet and

panel surfaces are free of dents and scratches, and that the meter is not scratched or cracked.

2-5 ELECTRICAL CHECK

2-6 The instrument should be checked against its electrical specifications. Section V includes an "in-cabinet" performance check to verify proper instrument operation.

2-7 INSTALLATION DATA

2-8 The instrument is shipped ready for bench operation. It is necessary only to connect the instrument to a source of power and it is ready for operation.

2-9 LOCATION

2-10 This instrument is air cooled. Sufficient space should be allotted so that a free flow of cooling air can reach the rear of the instrument when it is in operation. It should be used in an area where the ambient temperature does not exceed 55°C.

2-11 OUTLINE DIAGRAM

2-12 Figure 2-1 illustrates the outline shape and dimensions of Models 6213A through 6218A.

2-13 RACK MOUNTING

2-14 This instrument may be rack mounted separately or with a maximum of two other BENCH Series supplies as shown in Figure 2-2. The

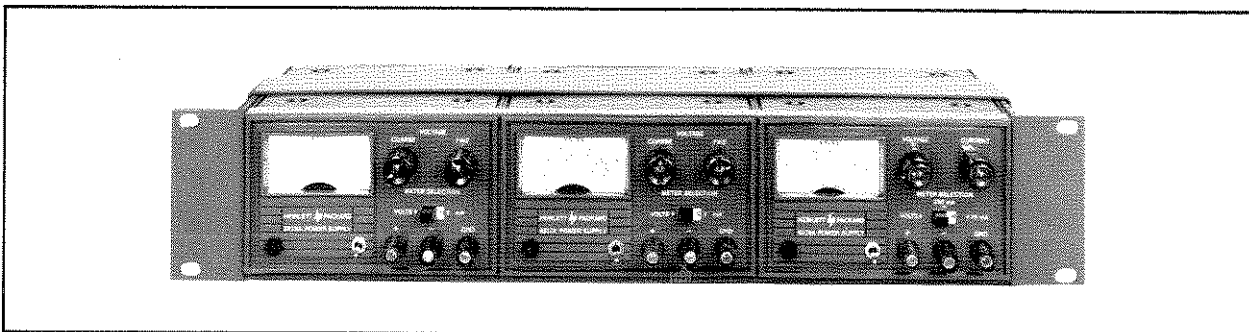


Figure 2-2. Rack Kit with Three BENCH Supplies

units are placed in the Rack Mounting Frame. The Rack Mounting Frame is then fastened to the rack frame.

2-15 INPUT POWER REQUIREMENTS

2-16 This power supply may be operated continuously from either a nominal 115 Volt or 230 Volt 50-400Hz power source. The unit as shipped from the factory, is wired for 115 Volt operation. The input power required when operated from a 115 Volt power source at full load is:

Model	Input Current	Input Power
6213A and 6214A	0.29A	28W
6215A and 6217A	0.25A	26W
6216A and 6218A	0.25A	26W

2-17 CONNECTIONS FOR 230 VOLT OPERATION (Figure 2-3)

2-18 Normally, the two primary windings of the input transformer are connected in parallel for operation from 115 Volt source. To convert the power supply to operation from a 230 Volt source, the power transformer windings are connected in series as follows:

- Unplug the line cord and remove the top cover as described in Paragraph 5-3.
- Remove the jumpers between taps 4-2 and 3-1. Solder a jumper between taps 3-2 on the input power transformer T1, see Figure 2-3.
- Replace existing fuse with a 0.5 Ampere, 230 Volt fuse.
- Replace existing line cord plug with a standard 230 Volt plug.

2-19 POWER CABLE

2-20 To protect operating personnel, the National Electrical Manufacturers Association (NEMA) recommends that the instrument panel and cabinet be grounded. This instrument is equipped with a three conductor power cable. The third conductor is the ground conductor and when the cable is plugged

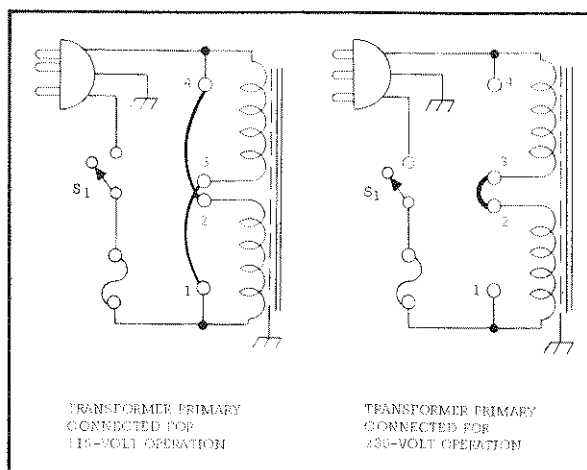


Figure 2-3. Input Power Transformer, Connections

into an appropriate receptacle, the instrument is grounded. The offset pin on the power cable three-prong connector is the ground connection.

2-21 To preserve the protection feature when operating the instrument from a two-contact outlet, use a three-prong to two-prong adapter and connect the green lead on the adapter to ground.

2-22 REPACKAGING FOR SHIPMENT

2-23 To insure safe shipment of the instrument, it is recommended that the package designed for the instrument be used. The original packaging material is reusable. If it is not available, contact your local Hewlett-Packard field office to obtain the materials. This office will also furnish the address of the nearest service office to which the instrument can be shipped. Be sure to attach a tag to the instrument which specifies the owner, model number, full serial number, and service required, or a brief description of the trouble.

SECTION III OPERATING INSTRUCTIONS

3-1 TURN-ON CHECKOUT PROCEDURE

3-2 The following checkout procedure describes the use of the front panel controls and indicators and ensures that the supply is operational:

- a. Set AC toggle switch (1) upward to on position; indicator (2) should light.

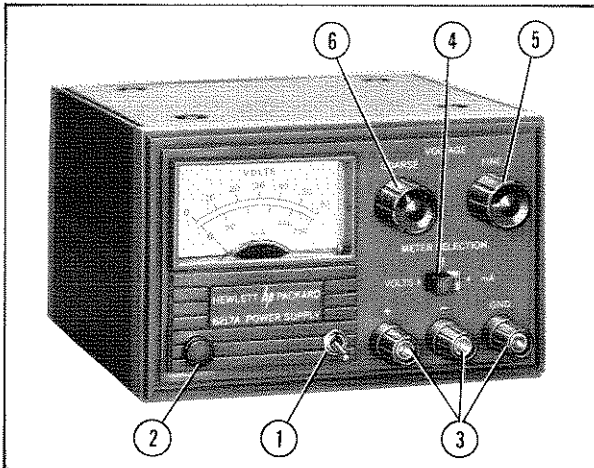


Figure 3-1. Front Panel Controls and Indicators

- b. Set METER SELECTION switch (4) to VOLTS position.
- c. Turn COARSE (6) and FINE (5) VOLTAGE controls fully ccw to ensure that output decreases to 0V, then turn the VOLTAGE controls fully cw to ensure that output voltage increases to the maximum rated output voltage.
- d. Connect a milliammeter across the output of the supply (3) to check that the current limit circuit within the supply is limiting the output current to:

Model	Current Limit
6213A	1300 \pm 50mA
6215A	475 \pm 10mA
6217A	250 \pm 10mA

- e. Remove milliammeter and connect load to output terminals.

3-3 OPERATION

3-4 The power supply can be operated as a single unit (normal operation), in parallel, or in series. The output of the supply can be floated up to 300 volts off ground.

3-5 CONSTANT VOLTAGE

3-6 To select a constant voltage output turn on the supply and, with no load connected, adjust the VOLTAGE controls for the desired output voltage. To check the current limit, connect an external ammeter across the output of the supply, turn the VOLTAGE controls fully clockwise, and observe the reading. The current limit is factory adjusted in excess of the current rating of the supply. If the existing current is not compatible with the anticipated load requirements, the limit can be changed as outlined in the following paragraphs.

3-7 CHANGING CURRENT LIMIT

3-8 The current limit can be varied by adjusting resistor R50, located on the printed wiring board. This adjustment procedure is described in Paragraph 5-63. The range of the current limit control R50 is as follows:

Model	Current Limit Range
6213A	800 - 1700mA
6215A	300 - 540mA
6217A	180 - 300mA

The current limit is normally adjusted to a value far in excess of the current rating of the supply to prevent the deterioration of line and load regulation. Therefore, if for any reason the current limit is adjusted so that the output current is close to this value, the performance will not meet the published specifications.

3-9 CONNECTING LOAD

3-10 Each load should be connected to the power supply output terminals using separate pairs of connecting wires. This will minimize mutual coupling effects between loads and will retain full advantage of the low output impedance of the power supply. Each pair of connecting wires should be as short as possible and twisted or shielded to reduce noise pickup. (If shield is used, connect one end to power supply ground terminal and leave the other end unconnected.)

3-11 If load considerations require that the output power distribution terminals be remotely located from the power supply, then the power supply output terminals should be connected to the remote distribution terminals via a pair of twisted or shielded wires and each load separately connected

to the remote distribution terminals.

3-12 OPERATION OF SUPPLY BEYOND RATED OUTPUT

3-13 The shaded area on the front panel meter face indicates the amount of output voltage or current that is available in excess of the normal rated output. Although the supply can be operated in this shaded region without being damaged, it cannot be guaranteed to meet all of its performance specifications. However, if the line voltage is maintained above 115 VAC, the supply will probably operate within its specifications.

3-14 OPTIONAL OPERATING MODES

3-15 SERIES OPERATION

3-16 Normal Series Connections. Two or more power supplies can be operated in series to obtain a higher voltage than that available from a single supply. When this connection is used, the output voltage is the sum of the voltages of the individual supplies. Each of the individual supplies must be adjusted in order to obtain the total output voltage. The power supply contains a protective diode connected internally across the output which protects the supply if one power supply is turned off while its series partner(s) is on.

3-17 PARALLEL OPERATION

3-18 Normal Parallel Connections. Two or more power supplies can be connected in parallel to obtain a total output current greater than that available from one power supply. The total output current is the sum of the output currents of the individual power supplies. The output CURRENT controls of each power supply can be separately set. The output voltage controls of one power supply should be set to the desired output voltage; the other power supply should be set for a slightly larger output voltage. The supply set to the lower output voltage will act as a constant voltage source; the supply set to the higher output will act as a current limit source, dropping its output voltage until it equals that of the other supply. The constant voltage source will deliver only that fraction of its total rated output current which is necessary to fulfill the total current demand.

3-19 SPECIAL OPERATING CONSIDERATIONS

3-20 PULSE LOADING

3-21 The power supply will automatically cross

over from constant voltage to current limit operation in response to an increase (over the preset limit) in the output current. Although the preset limit may be set higher than the average output current high peak currents (as occur in pulse loading) may exceed the preset current limit and cause crossover to occur. If this crossover limiting is not desired, set the preset limit for the peak requirement and not the average.

3-22 OUTPUT CAPACITANCE

3-23 An internal capacitor, across the output terminals of the power supply, helps to supply high-current pulses of short duration during constant voltage operation. Any capacitance added externally will improve the pulse current capability, but will decrease the safety provided by the current limiting circuit. A high-current pulse may damage load components before the average output current is large enough to cause the current limiting circuit to operate.

3-24 REVERSE CURRENT LOADING

3-25 Active loads connected to the power supply may actually deliver a reverse current to the power supply during a portion of its operating cycle. An external source cannot be allowed to pump current into the supply without loss of regulation and possible damage to the output capacitor. To avoid these effects, it is necessary to preload the supply with a dummy load resistor so that the power supply delivers current through the entire operating cycle of the load device.

3-26 Reverse Voltage Protection. A diode is connected across the output terminals with reverse polarity. This diode protects the output electrolytic capacitors and the series regulator transistors from the effects of a reverse voltage applied across the output terminals. For example, in series operation of two supplies, if the AC is removed from one supply, the diode prevents damage to the unenergized supply which would otherwise result from a reverse polarity voltage.

Since series regulator transistors or driver transistors cannot withstand reverse voltage, another diode is connected across the series transistor. This diode protects the series transistors in parallel or Auto-Parallel operation if one supply of the parallel combination is turned on before the other.

SECTION IV PRINCIPLES OF OPERATION

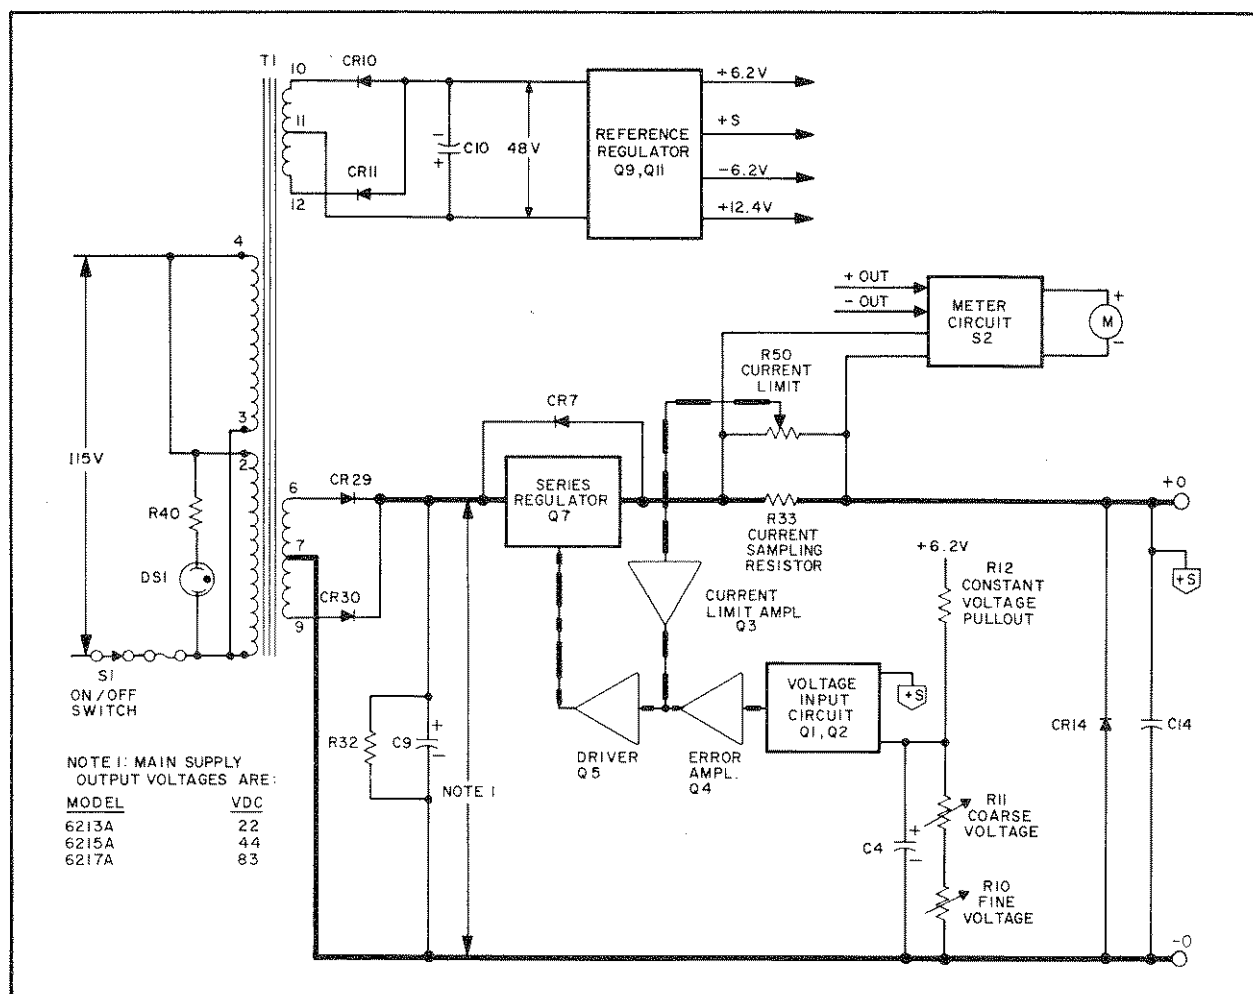


Figure 4-1. Simplified Schematic

4-1 SIMPLIFIED DISCUSSION

4-2 The power supply, as shown on the simplified schematic diagram of Figure 4-1, consists of a power transformer, rectifier and filter, series regulator, error amplifier and driver, constant voltage input circuit, current limiting circuit, reference regulator circuit, and a metering circuit.

4-3 The input line voltage passes through the power transformer to the rectifier and filter. The rectifier-filter converts the ac input to raw dc which is fed to the positive terminal via the regulator and current sampling resistor network. The

regulator, part of the feedback loop, is made to alter its conduction to maintain a constant output voltage. The voltage developed across the current sampling resistor is the input to the current limiting circuit. If the output current that passes through the sampling resistor exceeds a certain predetermined level, the current limiting circuit applies a feedback signal to the series regulator which alters the regulator's conduction so that the output current does not exceed the current limit. The constant voltage input circuit obtains its input by sampling the output voltage of the supply. Any changes in output voltage are detected in the constant voltage input circuit, amplified by the error

amplifier and driver, and applied to the series regulator in the correct phase and amplitude to counteract the change in output voltage. The reference regulator circuit provides stable reference voltages which are used by the constant voltage input circuit for comparison purposes. The meter circuit provides indications of output voltage or current in either operating mode.

4-4 Diode CR14, connected across the output terminals of the power supply, is a protective device which prevents internal damage that might occur if a reverse voltage were applied across the output terminals.

4-5 DETAILED CIRCUIT ANALYSIS (Refer to overall schematic diagram at rear of manual)

4-6 FEEDBACK LOOP

4-7 The feedback loop functions continuously to keep the output voltage constant, during constant voltage operation, and the output current at a safe limit during current limit operation. For purposes of this discussion, assume that the unit is in constant voltage operation and that the programming resistors R10 and R11 have been adjusted so that the supply is yielding the desired output voltage. Further assume that the output voltage instantaneously rises (goes positive) due to a variation in the external load circuit.

4-8 Note that the change may be in the form of a slow rise in the output voltage or a positive going AC signal. An AC signal is coupled to the voltage input circuit through capacitor C1 and a DC voltage is coupled through R10 and R11.

4-9 The rise in output voltage causes the voltage at the base of Q1 to decrease (go negative). Q1 now decreases its conduction and its collector voltage rises. The positive going error voltage is amplified and inverted by Q4 and fed to the base of series transistor Q7 via emitter follower Q5. The negative going input causes Q7 to decrease its conduction so that it drops more of the line voltage, and reduces the output voltage to its original level.

4-10 When the external load resistance decreases, the output current increases until the current limit is reached. The positive voltage developed at the wiper of R50 causes Q3 to conduct. CR4 becomes forward biased and controls the conduction of Q5 and Q7. Any further decreases in load resistance increase the negative voltage on the base of Q5 which decreases the conduction of Q7. Thus, through feedback action the output current is limited to the value at which CR4 conducts.

4-11 SERIES REGULATOR

4-12 The series regulator consists of transistor stage Q7 (see schematic at rear of manual). The regulator serves as a series control element by altering its conduction so that the output voltage is kept constant and the current limit is never exceeded. The conduction of Q5 is controlled by the feedback voltage obtained from driver Q4. Diode CR7, connected across the regulator circuit, protects the series transistor against reverse voltages that could develop across it during parallel or auto-parallel operation if one supply is turned on before the other.

4-13 CONSTANT VOLTAGE INPUT CIRCUIT (Refer to overall schematic at rear of manual)

4-14 The circuit consists of the coarse and fine programming resistors (R10 and R11), and a differential amplifier stage (Q1, Q2, and associated components). Drift due to thermal differentials is minimized, since both transistors operate at essentially the same temperature.

4-15 The constant voltage input circuit continuously compares a fixed reference voltage with a portion of the output voltage and, if a difference exists, produces an error voltage whose amplitude and phase is proportional to the difference. The error output is fed back to the series regulator, through the error and driver amplifiers. The error voltage changes the conduction of the series regulator which, in turn, alters the output voltage so that the difference between the two input voltages applied to the differential amplifier is reduced to zero. The above action maintains the output voltage constant.

4-16 Stage Q2 of the differential amplifier is connected to a common (+S) potential through impedance equalizing resistor R6. Resistors R5 and R7 are used to zero bias the input stage, offsetting minor base-to-emitter voltage differences in Q1 and Q2. The base of Q1 is connected to a summing point at the junction of the programming resistors and the current pullout resistor, R12. Instantaneous changes in output voltage result in an increase or decrease in the summing point potential. Q1 is then made to conduct more or less, in accordance with the summing point voltage change. The resultant output error voltage is fed back to the series regulator via the remaining components of the feedback loop. Resistor R1, in series with the base Q1, limits the current through the programming resistors during rapid voltage turn-down. Diodes CR1 and CR2 form a limiting network which prevents excessive voltage excursions from over driving stage Q1. Capacitor C1,

shunting the programming resistors, increases the high frequency gain of the input amplifier.

4-17 DRIVER AND ERROR AMPLIFIER (Refer to overall schematic at rear of manual)

4-18 The error and driver amplifiers amplify the error signal from the constant voltage input circuit to a level sufficient to drive the series regulator transistor. Driver Q5 also receives a current limiting input if CR4, the current limiting diode, becomes forward biased.

4-19 Stage Q4 contains a feedback equalizer network, C3 and R17, which provides for high frequency roll off in the loop gain in order to stabilize the feedback loop.

4-20 CURRENT LIMITING CIRCUIT

4-21 Current limiting occurs when transistor Q3 conducts. This is determined by the voltage drop across current sampling resistor R33 and the adjustment of current limit potentiometer R50. When the output current reaches the limit value, the positive voltage (with respect to +S) on the wiper arm of R50 causes Q3 to conduct. Diode CR4 becomes forward biased clamping the base of Q5 to a potential which decreases the conduction of the series regulator, thus limiting the output current. Potentiometer R50 permits the base potential of Q3 to be varied and thus changes the current limiting threshold.

4-22 REFERENCE CIRCUIT (Refer to schematic at rear of manual)

4-23 The reference circuit is a separate power

supply similar to the main supply. It provides stable reference voltages which are used throughout the unit. The reference voltages are all derived from smoothed dc obtained from the full wave rectifier (CR10 and CR11) and filter capacitor C5. The -6.2V reference voltage is derived from VR1 which is a second dc source regulating at 6.2vdc. Current for VR1 is supplied by the (-) side of C5 and flows through VR1, the base-emitter junction of Q7, R20, and back to the positive side of C5.

4-24 The base-emitter junction of Q11 is held constant by 6.2V zener diode VR7 which regulates line voltage changes that alter the voltage across C5. Thus Q11 is a constant current source feeding 12.4V zener diode VR4 and 6.2V temperature-compensated zener diode VR6.

4-25 Resistors R27 and R30 form a voltage divider across the stable 6.2 volts developed by VR1. The base-emitter junction of Q9 is therefore held constant by the voltage developed across R27. Thus Q9 provides a constant current to zener diode VR3, which regulates the -6.2V source.

4-26 METER CIRCUIT

4-27 This circuit provides indications of output voltage or output current. With METER SELECTION switch S2 set to VOLTS position the meter, in series with R38, is connected directly across the output of the supply. With S2 set to the MA position the meter, in series with R37 and R47, is connected across the current sampling resistor R33. Potentiometer R47 adjusts the electrical meter zero in the MA position.

SECTION V MAINTENANCE

5-1 INTRODUCTION

5-2 Upon receipt of the power supply, the performance check (Paragraph 5-13) should be made. This check is suitable for incoming inspection. If a fault is detected in the power supply while making the performance check or during normal operation, proceed to the troubleshooting procedures (Paragraph 5-46). After troubleshooting and repair (Paragraph 5-53), perform any necessary adjustments and calibrations (Paragraph 5-55). Before returning the power supply to normal operation, repeat the performance check to ensure that the fault has been properly corrected and that no other faults exist. Before doing any maintenance checks, turn-on power supply, allow a half-hour warm-up, and read the general information regarding measurement techniques (Paragraph 5-6).

5-3 COVER REMOVAL AND REPLACEMENT

5-4 To remove the top and bottom covers, proceed as follows:

- a. Insert a small screwdriver in each of the four notches at the front of the unit at the top and bottom. Push the screwdriver under the front panel and gently pry toward the front of the unit to release the holding mechanism.
- b. Pull the front panel forward until it clears the top and bottom covers.
- c. Remove the rear cover by repeating step a.
- d. Pull the rear cover until it clears the top and bottom covers. Then lift off the top cover and lift the unit out of the bottom cover.

5-5 To replace the top and bottom covers, proceed as follows:

- a. Place the unit into the bottom cover (identified by the four protruding feet) and align the heat sink into the track in the bottom cover.
- b. Place the top cover over the unit and align the track over the heat sink.
- c. While holding the covers together at the rear of the unit, carefully push on the rear panel.
- d. Position the front panel so that the two slotted ears at the bottom of the panel align with the printed wiring boards.
- e. Carefully push on the front panel.

5-6 GENERAL MEASUREMENT TECHNIQUES

5-7 The measuring device must be connected as close to the output terminals as possible when

measuring the output impedance, transient response, regulation, or ripple of the power supply in order to achieve valid measurements. A measurement made across the load includes the impedance of the leads to the load and such lead lengths can easily have an impedance several orders of magnitude greater than the supply impedance, thus invalidating the measurement.

5-8 The monitoring device should be connected as shown in Figure 5-1. Note that when measurements are made at the front terminals, the monitoring leads are connected at A, not B, as shown in Figure 5-1. Failure to connect the measuring device at A will result in a measurement that includes the resistance of the leads between the output terminals and the point of connection.

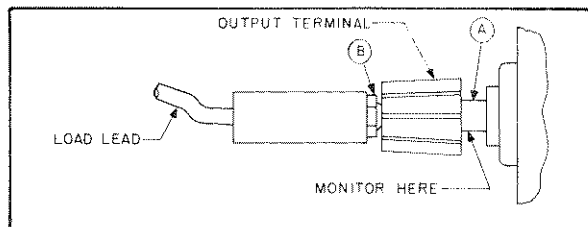


Figure 5-1. Front Panel Terminal Connections

5-9 For output current measurements, the current sampling resistor should be a four-terminal resistor. The four terminals are connected as shown in Figure 5-2. In addition, the resistor should be of the low noise, low temperature coefficient (less than 30 ppm/°C) type and should be used at no more than 5% of its rated power so that its temperature rise will be minimized.

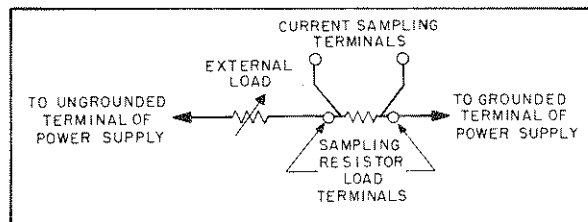


Figure 5-2. Output Current Measurement Technique

5-10 When using an oscilloscope, ground one terminal of the power supply and then ground the case

of the oscilloscope to this same point. Make certain that the case is not also grounded by some other means (power line). Connect both oscilloscope input leads to the power supply ground terminal and check that the oscilloscope is not exhibiting a ripple or transient due to ground loops, pick-up, or other means.

5-11 TEST EQUIPMENT REQUIRED

5-12 Table 5-1 lists the test equipment required to perform the various procedures described in this Section.

Table 5-1. Test Equipment Required

TYPE	REQUIRED CHARACTERISTICS	USE	RECOMMENDED MODEL
Differential Voltmeter	Sensitivity: 1mV full scale (min.). Input impedance: 10 megohms (min.).	Measure DC voltages; calibration procedures	Ⓜ 3420 (See Note)
Variable Voltage	Range: 90-130 volts. Equipped with voltmeter accurate within 1 volt.	Vary AC input	-----
AC Voltmeter	Accuracy: 2%. Sensitivity: 1mV full scale deflection (min.).	Measure AC voltages and ripple	Ⓜ 403B
Oscilloscope	Sensitivity: 100μV/cm. Differ- ential input.	Display transient response waveforms	Ⓜ 140A plus 1400A plug-in. 1402A plug-in for spike measurements only.
Oscillator	Range: 5Hz to 600KHz. Accuracy: 2%. Output: 10Vrms.	Impedance checks	Ⓜ 200CD
DC Voltmeter	Accuracy: 1%. Input resistance: 20,000 ohms/volt (min.).	Measure DC voltages	Ⓜ 412A
Repetitive Load Switch	Rate: 60-400Hz, 2μsec rise and fall time.	Measure transient response	See Figure 5-9.
Resistive Loads	Values: See Paragraph 5-16.	Power supply load resistors	-----
Current Sam- pling Resistor	See R33 in Parts List (Section VI).	Measure current; calibrate meter	-----
Resistor	1K Ω \pm 1%, 2 watt non-inductive.	Measure impedance	-----
Resistor	100 ohms, \pm 5%, 10 watt.	Measure impedance	-----
Capacitor	500μf, 50WVdc.	Measure impedance	-----

NOTE

A satisfactory substitute for a differential voltmeter is to arrange a reference voltage source and null detector as shown in Figure 5-3. The reference voltage source is adjusted so that the voltage difference between the supply being measured and the reference voltage will have the required resolution

for the measurement being made. The voltage difference will be a function of the null detector that is used. Examples of satisfactory null detectors are: Ⓜ 419A null detector, a dc coupled oscilloscope utilizing differential input, or a 50mv meter movement with a 100 division scale. For the latter, a 2mv change in voltage will result in a meter deflection of four divisions.

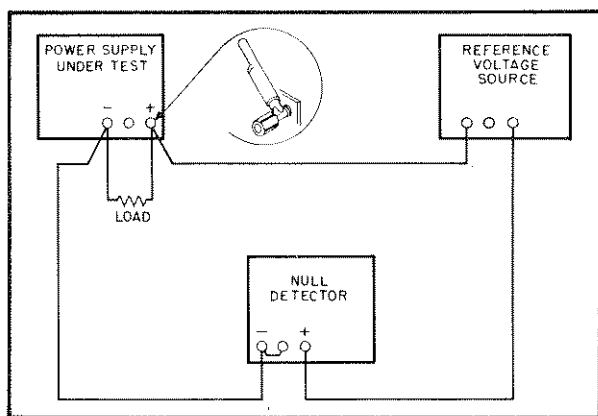


Figure 5-3. Differential Voltmeter Substitute Test Setup

CAUTION

Care must be exercised when using an electronic null detector in which one input terminal is grounded to avoid ground loops and circulating currents.

5-13 PERFORMANCE TEST

5-14 The following test can be used as an incoming inspection check and appropriate portions of the test can be repeated either to check the operation of the instrument after repairs or for periodic maintenance tests. The tests are performed using a 115-VAC 60 Hz, single phase input power source. If the correct result is not obtained for a particular check, do not adjust any controls; proceed to troubleshooting (Paragraph 5-48).

5-15 RATED OUTPUT AND METER ACCURACY

5-16 Voltage. To check the output voltage, proceed as follows:

- Connect load resistor (R_L) indicated in Figure 5-4 across the output terminals of supply.
- Connect differential voltmeter across (+) and (-) terminals of supply observing correct polarity.
- Set METER SELECTION switch to VOLTS and turn on supply.
- Adjust VOLTAGE controls until front panel meter indicates exactly the maximum rated output voltage.
- Differential voltmeter should indicate maximum rated output voltage within $\pm 2\%$.

5-17 Current. To check the output current, proceed as follows:

- Connect test setup shown in Figure 5-4.

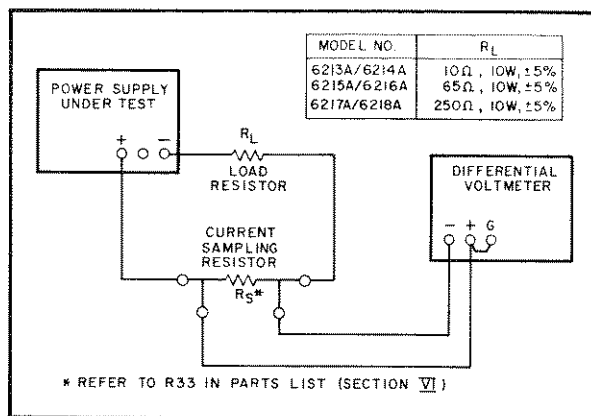


Figure 5-4. Output Current, Test Setup

- Set METER SELECTION switch to MA position.
- Turn on supply and adjust VOLTAGE controls until front panel meter indicates maximum rated output current.
- Differential voltmeter should read as follows:

Model No.	Reading (Vdc)
6213A	1 ± 0.03 V
6215A	1.2 ± 0.036 V
6217A	1.2 ± 0.036 V

5-18 LOAD REGULATION

Definition: The change ΔE_{OUT} in the static value of DC output voltage resulting from a change in load resistance from open circuit to a value which yields maximum rated output current (or vice versa).

5-19 To check the constant voltage load regulation, proceed as follows:

- Connect test setup as shown in Figure 5-5.
- Set METER SELECTION switch to MA position.
- Turn on supply and adjust VOLTAGE controls until front panel meter indicates maximum rated output current.
- Read and record voltage indicated on differential voltmeter.
- Disconnect load resistor.
- Reading on differential voltmeter should not vary from reading recorded in step d by more than 4mV.

5-20 LINE REGULATION

Definition: The change, ΔE_{OUT} , in the static value of DC output voltage resulting from a change in AC input voltage over the specified range from low line (usually 105 volts) to high line (usually 125 volts), or from high line to low line.

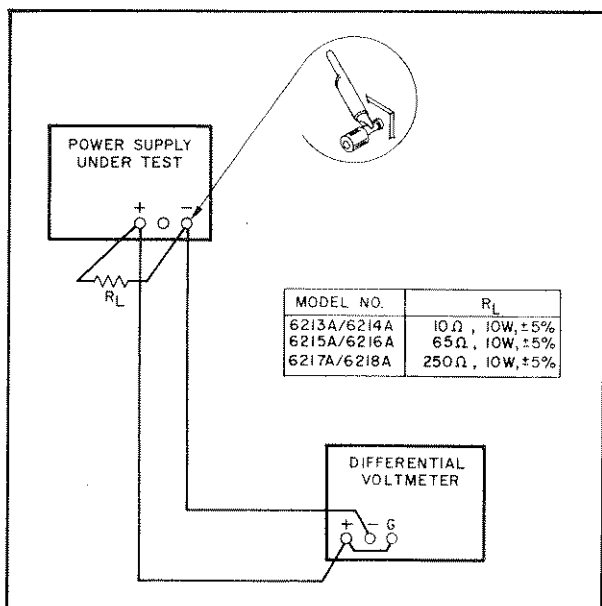


Figure 5-5. Load Regulation, Test Setup

5-21 To test the line regulation, proceed as follows:

- Connect variable auto transformer between input power source and power supply power input.
- Connect test setup shown in Figure 5-5.
- Adjust variable auto transformer for 105 VAC input.
- Set METER SELECTION switch to VOLTS position.
- Turn on supply and adjust VOLTAGE controls until front panel meter indicates exactly the maximum rated output voltage.
- Read and record voltage indicated on differential voltmeter.
- Adjust variable auto transformer for 125V ac input.
- Reading on differential voltmeter should not vary from reading recorded in step f by more than 4mv.

5-22 Ripple and Noise.

Definition: The residual ac voltage which is superimposed on the dc output of a regulated power supply.

Ripple and noise may be specified and measured in terms of its RMS or (preferably) peak-to-peak value.

Ripple and noise measurement can be made at any input ac line voltage combined with any dc output voltage and load current within rating.

5-23 The amount of ripple and noise that is present on the power supply output is measured either in

terms of the RMS or (preferably) peak-to-peak value. The peak-to-peak measurement is particularly important for applications where noise spikes could be detrimental to a sensitive load, such as logic circuitry. The RMS measurement is not an ideal representation of the noise, since fairly high output noise spikes of short duration could be present in the ripple and not appreciably increase the RMS value.

5-24 The technique used to measure high frequency noise or "spikes" on the output of a power supply is more critical than the low frequency ripple and noise measurement technique; therefore the former is discussed separately in Paragraph 5-32.

5-25 Ripple and Noise Measurements. Figure 5-6A shows an incorrect method of measuring p-p ripple. Note that a continuous ground loop exists from the third wire of the input power cord of the supply to the third wire of the input power cord of the oscilloscope via the grounded power supply case, the wire between the negative output terminal of the power supply and the vertical input of the scope, and the grounded scope case. Any ground current circulating in this loop as a result of the difference in potential E_G between the two ground points causes an IR drop which is in series with the scope input. This IR drop, normally having a 60 Hz line frequency fundamental, plus any pickup on the unshielded leads interconnecting the power supply and scope, appears on the face of the CRT. The magnitude of this resulting noise signal can easily be much greater than the true ripple developed between the plus and minus output terminals of the power supply, and can completely invalidate the measurement.

5-26 The same ground current and pickup problems can exist if an RMS voltmeter is substituted in place of the oscilloscope in Figure 5-6. However, the oscilloscope display, unlike the true RMS meter reading, tells the observer immediately whether the fundamental period of the signal displayed is 8.3 milliseconds (1/120 Hz) or 16.7 milliseconds (1/60 Hz). Since the fundamental ripple frequency present on the output of an ϕ_p supply is 120 Hz (due to full-wave rectification), an oscilloscope display showing a 120 Hz fundamental component is indicative of a "clean" measurement setup, while the presence of a 60 Hz fundamental usually means that an improved setup will result in a more accurate (and lower) value of measured ripple.

5-27 Figure 5-6B shows a correct method of measuring the output ripple of a constant voltage power supply using a single-ended scope. The ground loop path is broken with a 3 to 2 adapter in series with the power supply's AC line plug. Notice,

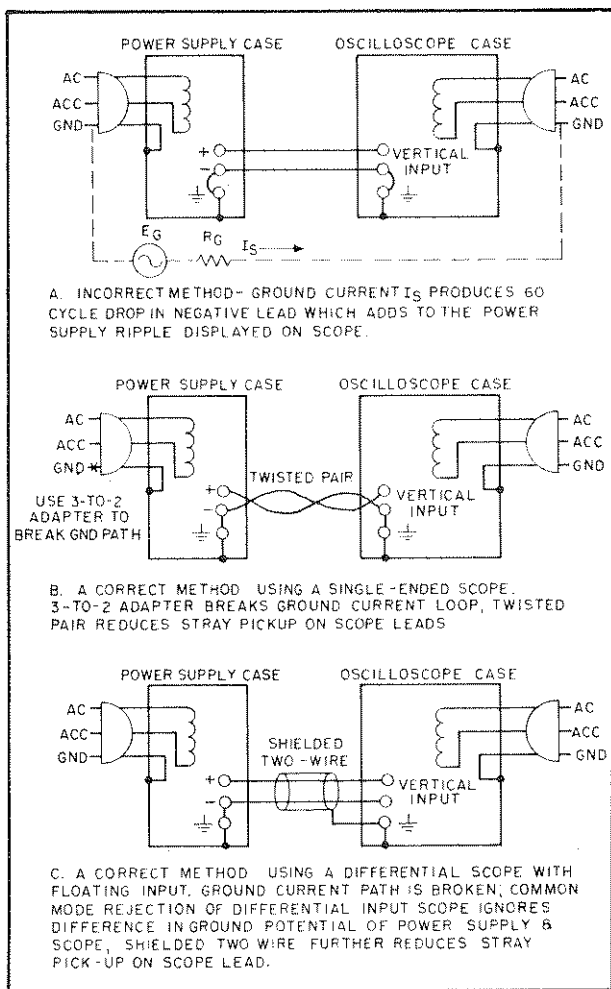


Figure 5-6. Ripple and Noise, Test Setup

however, that the power supply case is still connected to ground via the power supply output terminals, the leads connecting these terminals to the scope terminals, the scope case and the third wire of the power supply cord.

5-28 Either a twisted pair or (preferably) a shielded two-wire cable should be used to connect the output terminals of the power supply to the vertical input terminals of the scope. When using a twisted pair, care must be taken that one of the two wires is connected both to the grounded terminal of the power supply and the grounded input terminal of the oscilloscope. When using shielded two-wire, it is essential for the shield to be connected to ground at one end only so that no ground current will flow through this shield, thus inducing a noise signal in the shielded leads.

5-29 To verify that the oscilloscope is not displaying ripple that is induced in the leads or pick-

ed up from the grounds, the (+) scope lead should be shorted to the (-) scope lead at the power supply terminals. The ripple value obtained when the leads are shorted should be subtracted from the actual ripple measurement.

5-30 In most cases, the single-ended scope method of Figure 5-6B will be adequate to eliminate non-real components of ripple and noise so that a satisfactory measurement may be obtained. However, in more stubborn cases, or in measurement situations where it is essential that both the power supply case and the oscilloscope case be connected to ground (e.g. if both are rack-mounted), it may be necessary to use a differential scope with floating input as shown in Figure 5-6C. If desired, two single conductor shielded cables may be substituted in place of the shielded two-wire cable with equal success. Because of its common mode rejection, a differential oscilloscope displays only the difference in signal between its two vertical input terminals, thus ignoring the effects of any common mode signal introduced because of the difference in the AC potential between the power supply case and scope case. Before using a differential input scope in this manner, however, it is imperative that the common mode rejection capability of the scope be verified by shorting together its two input leads at the power supply and observing the trace on the CRT. If this trace is a straight line, the scope is properly ignoring any common mode signal present. If this trace is not a straight line, then the scope is not rejecting the ground signal and must be realigned in accordance with the manufacturer's instructions until proper common mode rejection is attained.

5-31 To check the ripple and noise output, proceed as follows:

- Connect the oscilloscope or RMS voltmeter as shown in Figures 5-6B or 5-6C.
- Adjust VOLTAGE control until front panel meter indicates maximum rated output voltage.
- The observed ripple and noise should be less than $200\mu\text{Vrms}$ and 1mV p-p .

5-32 Noise Spike Measurement. When a high frequency spike measurement is being made, an instrument of sufficient bandwidth must be used; an oscilloscope with a bandwidth of 20 MHz or more is adequate. Measuring noise with an instrument that has insufficient bandwidth may conceal high frequency spikes detrimental to the load.

5-33 The test setups illustrated in Figures 5-6A and 5-6B are generally not acceptable for measuring spikes; a differential oscilloscope is necessary. Furthermore, the measurement concept of Figure 5-6C must be modified if accurate spike measurement is to be achieved:

- As shown in Figure 5-7, two coax

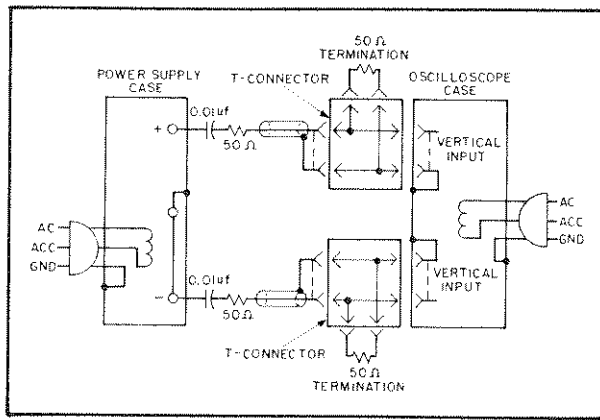


Figure 5-7. Noise Spike Test Setup

cables, must be substituted for the shielded two-wire cable.

2. Impedance matching resistors must be included to eliminate standing waves and cable ringing, and the capacitors must be connected to block the DC current path.

3. The length of the test leads outside the coax is critical and must be kept as short as possible; the blocking capacitor and the impedance matching resistor should be connected directly from the inner conductor of the cable to the power supply terminals.

4. Notice that the shields of the power supply end of the two coax cables are not connected to the power supply ground, since such a connection would give rise to a ground current path through the coax shield, resulting in an erroneous measurement.

5. The measured noise spike values must be doubled, since the impedance matching resistors constitute a 2-to-1 attenuator.

6. The noise spikes observed on the oscilloscope should be less than 0.5mV p-p.

5-34 The circuit of Figure 5-7 can also be used for the normal measurement of low frequency ripple and noise; simply remove the four terminating resistors and the blocking capacitors and substitute a higher gain vertical plug-in in place of the wide-band plug-in required for spike measurements. Notice that with these changes, Figure 5-7 becomes a two-cable version of Figure 5-6C.

5-35 OUTPUT IMPEDANCE

Definition: At any given frequency of load change, $\Delta E_{OUT} / \Delta I_{OUT}$. Strictly speaking the definition applies only for a sinusoidal load disturbance, unless, of course, the measurement is made at zero frequency (DC). The output impedance of an ideal constant voltage

power supply would be zero at all frequencies, while the output impedance for an ideal constant current power supply would be infinite at all frequencies.

The output impedance of a power supply is normally not measured, since the measurement of transient recovery time reveals both the static and dynamic output characteristics with just one measurement. The output impedance of a power supply is commonly measured only in those cases where the exact value at a particular frequency is of engineering importance.

5-36 To check the output impedance, proceed as follows:

- a. Connect test setup shown in Figure 5-8.

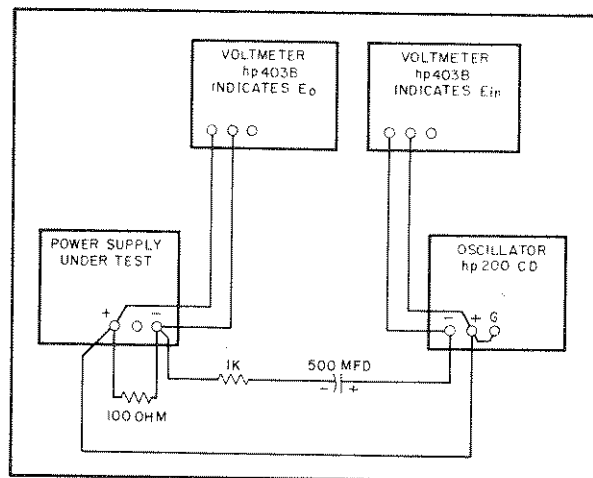


Figure 5-8. Output Impedance, Test Setup

- b. Set METER SELECTION switch to VOLTS position.
- c. Turn on supply and adjust VOLTAGE controls until front panel meter reads 20 volts.
- d. Set AMPLITUDE control on Oscillator to 10 volts (E_{in}), and FREQUENCY control to 100 Hz.
- e. Record voltage across output terminals of the power supply (E_O) as indicated on AC voltmeter.
- f. Calculate the output impedance by the following formula:

$$Z_{out} = \frac{E_O R}{E_{in} - E_O}$$

E_O = rms voltage across power supply output terminals.

$R = 1000$

$E_{in} = 10$ volts

- g. The output impedance (Z_{out}) should be less than 0.030 ohms.

h. Using formula of step f, calculate output impedance at frequencies of 50 kHz and 500 kHz. Values should be less than 0.5 ohm and 3.0 ohms, respectively.

5-37 **Output Inductance.** To check the output inductance, repeat steps a through f at frequencies of 10 kHz, 50 kHz and 100 kHz. Calculate the output inductance (L) using the following formula:

$$L = \frac{X_L}{2 \pi f} \text{ (See Note)}$$

The oscillator frequency is equivalent to f in the equation. The output inductance should be less than 20 microhenries.

NOTE

The equation assumes that X_L is much greater than R_{out} and therefore $X_L = Z_{out}$.

5-38 CURRENT LIMIT

5-39 To check the current limiting characteristics of the supply, proceed as follows:

a. Attach the multimeter or a milliammeter to the output terminals of the supply. Set the meter for approximately 600 mA. The internal resistance of the meter is low enough to overload the supply so that the output will current limit.

b. Adjust the VOLTAGE controls fully clockwise.

c. The meter should read as follows:

Model 6213A	1300 ± 50mA
6215A	475 ± 10mA
6217A	250 ± 10mA

5-40 TRANSIENT RECOVERY TIME

Definition: The time "X" for output voltage recovery to within "Y" millivolts of the nominal output voltage following a "Z" amp step change in load current — where: "Y" is specified separately for each model but is generally of the same order as the load regulation specification. The nominal output voltage is defined as the DC level half way between the static output voltage before and after the imposed load change, and "Z" is the specified load current change, normally equal to the full load current rating of the supply.

5-41 Transient recovery time may be measured at any input line voltage combined with any output voltage and load current within rating.

5-42 Reasonable care must be taken in switching the load resistance on and off. A hand-operated switch in series with the load is not adequate, since the resulting one-shot displays are difficult to observe on most oscilloscopes, and the arc energy occurring during switching action completely masks the display with a noise burst. Transistor load switching devices are expensive if reasonably rapid load current changes are to be achieved.

5-43 A mercury-wetted relay, as connected in the load switching circuit of Figure 5-9 should be used for loading and unloading the supply. When this load switch is connected to a 60 Hz AC input, the mercury-wetted relay will open and close 60 times per second. Adjustment of the 25K control permits adjustment of the duty cycle of the load current switching and reduction in jitter of the oscilloscope display.

5-44 The maximum load ratings listed in Figure 5-9 must be observed in order to preserve the mercury-wetted relay contacts. Switching of larger load currents can be accomplished with mercury pool relays; with this technique fast rise times can still be obtained, but the large inertia of mercury pool relays limits the maximum repetition rate of load switching and makes the clear display of the transient recovery characteristic on an oscilloscope more difficult.

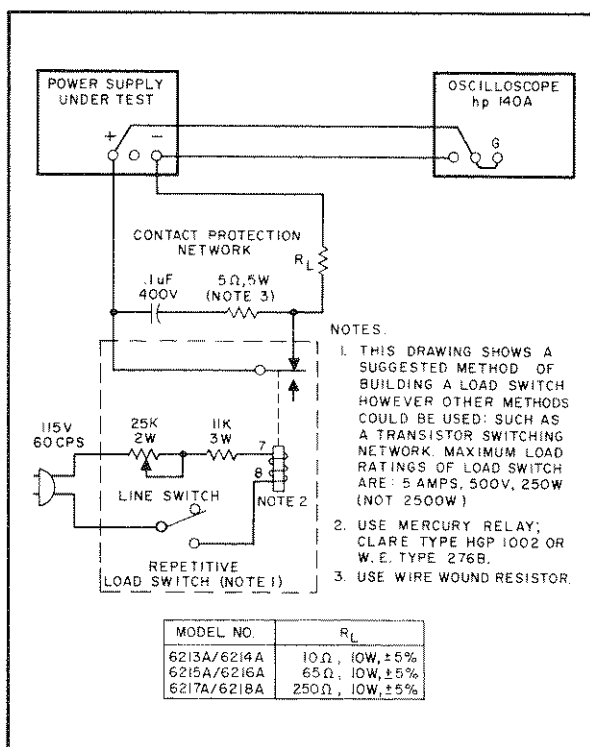


Figure 5-9. Transient Recovery Time, Test Setup

5-45 To check the transient recovery time, proceed as follows:

- a. Connect test setup shown in Figure 5-9.
- b. Set METER SELECTION switch to mA.
- c. Turn on supply and adjust voltage controls until front panel meter indicates exactly the maximum rated output current.
- d. Close the line switch on the repetitive load switch setup.
- e. Set the oscilloscope for internal sync and lock on either the positive or negative load transient spike.
- f. Set the vertical input of the oscilloscope for ac coupling so that small dc level changes in the output voltage of the power supply will not cause the display to shift.
- g. Adjust the vertical centering on the scope so that the tail ends of the no load and full load waveforms are symmetrically displaced about the horizontal center line of the oscilloscope. This center line now represents the nominal output voltage defined in the specification.
- h. Adjust the horizontal positioning control so that the trace starts at a point coincident with a major graticule division. This point is then representative of time zero.
- i. Increase the sweep rate so that a single transient spike can be examined in detail.
- j. Adjust the sync controls separately for the positive and negative going transients so that not only the recovery waveshape but also as much as possible of the rise time of the transient is displayed.

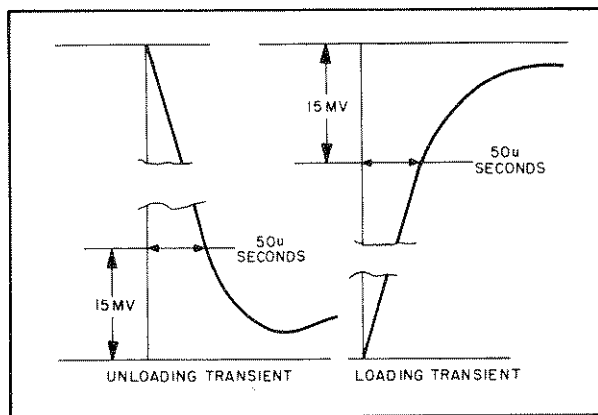


Figure 5-10. Transient Recovery Time, Waveforms

- k. Starting from the major graticule division representative of time zero, count to the right 50 μ sec and vertically 10 mV. Recovery should be within these tolerances as illustrated in Figure 5-10

5-46 TROUBLESHOOTING

5-47 Components within Hewlett-Packard power supplies are conservatively operated to provide maximum reliability. In spite of this, parts within a supply may fail. Usually the instrument must be immediately repaired with a minimum of "down time" and a systematic approach as outlined in succeeding paragraphs can greatly simplify and speed up the repair.

5-48 TROUBLE ANALYSIS

5-49 General. Before attempting to troubleshoot this instrument, ensure that the fault is with the instrument and not with an associated circuit. The performance test (Paragraph 5-13) enables this to be determined without having to remove the instrument from the cabinet.

5-50 Once it is determined that the power supply is at fault, check for obvious troubles such as open fuse, a defective power cable, or an input power failure. Next, remove the top and bottom covers as described in Paragraph 5-3 and inspect for open connections, charred components, etc. If the trouble source cannot be detected by visual inspection, follow the detailed procedure outlined in succeeding paragraphs. Once the defective component has been located (by means of visual inspection or trouble analysis) correct it and re-conduct the performance test. If a component is replaced, refer to the repair and replacement and adjustment and calibration paragraphs in this section.

5-51 A good understanding of the principles of operation is a helpful aid in troubleshooting, and it is recommended that the reader review Section IV of the manual before attempting to troubleshoot the unit in detail. Once the principles of operation are understood, logical application of this knowledge used in conjunction with the normal voltage readings shown on the schematic and the additional procedures given in the following paragraphs should suffice to isolate a fault to a component or small group of components. The normal voltages shown on the schematic are positioned adjacent to the applicable test points (identified by encircled numbers on the schematic and printed wiring boards).

5-52 Table 5-2 includes the symptoms and probable causes of many possible troubles. If either high or low output voltage is a symptom, there are two methods of isolating the fault. The first is a simplified procedure that involves only measuring voltages; the second is a more thorough approach requiring that transistor stages be opened or shorted. Both methods are described as follows:

1. First, the reference, bias, and filtered dc voltages as given in Table 5-3 should be checked. Then the voltage levels at critical points (base and collector) in the feedback loop should be measured and compared to the normal voltages given on the overall schematic diagram at the rear of the manual. This method of troubleshooting a

feedback loop is not always conclusive; a better method is described in (2).

2. First, measure the reference, bias, and filtered dc voltages as given in Table 5-3. Then, drive each stage in the feedback loop into conduction or cutoff by either shorting or opening the previous stage as indicated in Tables 5-4 or 5-5.

Table 5-2. Common Troubles

SYMPTOM	PROBABLE CAUSE
Low output or no output voltage	Refer to Table 5-3, then 5-4.
High output voltage	Refer to Table 5-3, then 5-5.
High ripple	<ul style="list-style-type: none"> a. Check operating setup for ground, refer to Paragraph 5-22. b. If output floating, connect 1μf capacitor between output and ground. c. Check for excessive internal ripple; refer to Table 5-3. d. Ensure that supply is not in current limit operation under loaded conditions. To prevent this condition, increase load resistance so that output current does not exceed maximum rated output. e. Check for low voltage across C5 or C9.
Poor line regulation	<ul style="list-style-type: none"> a. Improper measuring technique; refer to Paragraph 5-6. b. Check reference circuit voltages, Table 5-3.
Poor load regulation (Constant Voltage)	<ul style="list-style-type: none"> a. Improper measuring technique; refer to Paragraph 5-6. b. Check reference circuit voltages (Table 5-3). c. Ensure that supply is not in current limit operation under loaded conditions. To prevent this condition, ensure that output current does not exceed maximum rated output.
Oscillates	<ul style="list-style-type: none"> a. Check C3 and R17.
Poor stability (Constant Voltage)	<ul style="list-style-type: none"> a. Check +6.2Vdc reference voltage (Table 5-3). b. Noisy programming resistor R10 or R11. c. CR1, CR2 leaky. d. Check R1, R12, and C1 for noise or drift. e. Stage Q1/Q2 defective.
Poor transient recovery	<ul style="list-style-type: none"> a. Check R17 and C3.

Table 5-3. Reference, Bias, and Filtered DC Troubleshooting

METER COMMON	METER POSITIVE	NORMAL VDC	NORMAL RIPPLE (P-P)	PROBABLE CAUSE
C5(-)	C5(+)	+48 \pm 4.8V	2V	T1, C10, CR10, CR11, C5
+S	7	+12.4 \pm 0.6V	0.5mV	VR4, Q11, VR7
+S	8	+6.2 \pm 0.3V	0.2mV	VR6, R25
9	+S	+6.2 \pm 0.3V	0.1mV	VR3, Q9, R30, VR8
11	+S	+12.4 \pm 0.6V	4.5mV	VR1, R27, R30
-OUT	6	22 \pm 2.2V (6213A) 44 \pm 4.5V (6215A) 78 \pm 7.8V (6217A)	3V 400mV 500mV	CR15, CR16, C9, R32, T1

Table 5-4. Low Output Voltage Troubleshooting

STEP	ACTION	RESPONSE	PROBABLE CAUSE
1	Turn the VOLTAGE control fully clockwise and disconnect the load		
2	To eliminate the current limit circuit as a cause of the malfunction, remove CR4 cathode or anode lead	a. Output increases b. Output remains low	a. CR4 or Q3 defective b. Reconnect CR4 and proceed to Step 3
3	Check conduction of Q7 by connecting a jumper between Q5 emitter and base	a. Output remains low b. Output increases	a. Q7, CR7, or associated parts defective b. Remove jumper and proceed to Step 4
4	Check turnoff of Q5 by shorting Q4 emitter to collector	a. Output remains low b. Output increases	a. Q5, R19, R20 defective b. Remove jumper and proceed to Step 5
5	Check conduction of Q4 by shorting Q1 emitter to collector	a. Output remains low b. Output increases	a. Stage Q4 defective b. Stage Q1/Q2 defective. Check R10, R11, C1 for short and R12 for open.

Table 5-5. High Output Voltage Troubleshooting


STEP	ACTION	RESPONSE	PROBABLE CAUSE
1	Turn the VOLTAGE control to approximately mid-range and disconnect the load. If the output voltage should rise to an excessive value during the following procedures, the VOLTAGE control could be damaged if it is turned fully CCW.		
2	Check turnoff of Q7 by shorting Q5 emitter to collector	a. Output remains high b. Output decreases	a. Q7, CR7, R20 defective. b. Remove short across Q5 and proceed to Step 3.
	Check conduction of Q5 by removing Q4 collector lead	a. Output remains high b. Output decreases	a. Stage Q5 defective. b. Replace Q4 collector lead and proceed to Step 4.
4	Check turnoff of Q4 by shorting Q1 emitter to collector	a. Output remains high b. Output decreases	a. Stage Q4 defective b. Stage Q1/Q2 defective. Check R10, R11 for open and R12 for short.

5-53 REPAIR AND REPLACEMENT

5-54 Before servicing a printed wiring board, refer to Figure 5-11. Section VI of this manual contains a tabular list of the instruments replaceable parts. Before replacing a semiconductor device, refer to

Table 5-6 which lists the special characteristics of selected semiconductors. If the device to be replaced is not listed in Table 5-6, the standard manufacturers part number listed in Section VI is applicable.

Table 5-6. Selected Semiconductor Characteristics

REFERENCE DESIGNATOR	CHARACTERISTICS	 PART NO.	SUGGESTED REPLACEMENT
Q7	Power NPN Silicon $h_{fe} = 35 \text{ min. @ } I = 4 \text{ Ampere}$ $V_{CE} = 4 \text{ Volts.}$	1854-0225	2N3055 R.C.A.

Excessive heat or pressure can lift the copper strip from the board. Avoid damage by using a low power soldering iron (50 watts maximum) and following these instructions. Copper that lifts off the board should be cemented in place with a quick drying acetate base cement having good electrical insulating properties.

A break in the copper should be repaired by soldering a short length of tinned copper wire across the break.


Use only high quality rosin core solder when repairing etched circuit boards. NEVER USE PASTE FLUX. After soldering, clean off any excess flux and coat the repaired area with a high quality electrical varnish or lacquer.

When replacing components with multiple mounting pins such as tube sockets, electrolytic capacitors, and potentiometers, it will be necessary to lift each pin slightly, working around the components several times until it is free.

WARNING: If the specific instructions outlined in the steps below regarding etched circuit boards without eyelets are not followed, extensive damage to the etched circuit board will result.


1. Apply heat sparingly to lead of component to be replaced. If lead of component passes through an eyelet

in the circuit board, apply heat on component side of board. If lead of component does not pass through an eyelet, apply heat to conductor side of board.

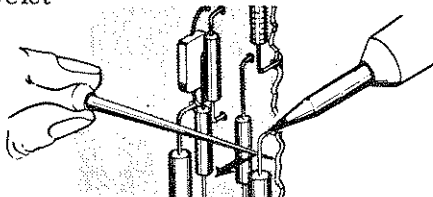


2. Reheat solder in vacant eyelet and quickly insert a small awl to clean inside of hole.

If hole does not have an eyelet, insert awl or a #57 drill from conductor side of board.

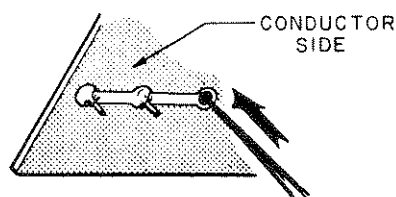


3. Bend clean tinned lead on new part and carefully insert through eyelets or holes in board.




4. Hold part against board (avoid overheating) and solder leads.

Apply heat to component leads on correct side of board as explained in step 1.

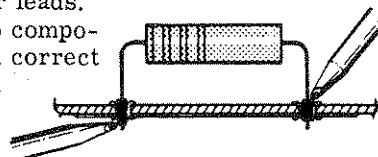


In the event that either the circuit board has been damaged or the conventional method is impractical, use method shown below. This is especially applicable for circuit boards without eyelets.

1. Clip lead as shown below.

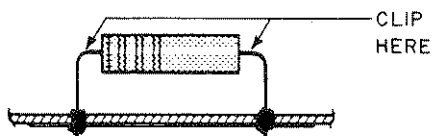

2. Bend protruding leads upward. Bend lead of new component around protruding lead. Apply solder using a pair of long nose pliers as a heat sink.

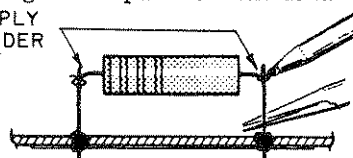

This procedure is used in the field only as an alternate means of repair. It is not used within the factory.

Figure 5-11. Servicing Printed Wiring Boards

Table 5-7. Calibration Adjustment Summary

Adjustment or Calibration	Paragraph	Control Device
Meter Zero	5-57	Pointer
Ammeter Tracking	5-59	R47
"Zero" Volt Output	5-61	R5
Current Limit	5-66	R50

5-55 ADJUSTMENT AND CALIBRATION

5-56 Adjustment and calibration may be required after performance testing, troubleshooting, or repair and replacement. Perform only those adjustments that affect the operation of the faulty circuit and no others. Table 5-7 summarizes the adjustments and calibrations contained in the following paragraphs.

5-57 METER MECHANICAL ZERO

5-58 Proceed as follows to zero meter:

- Turn off instrument (after it has reached normal operating temperature) and allow 30 seconds for all capacitors to discharge.
- Insert sharp pointed object (pen point or awl) into the small hole at top of round black plastic disc located directly below meter face.
- Rotate plastic disc clockwise (cw) until meter reads zero, then rotate ccw slightly in order to free adjustment screw from meter suspension. If pointer moves, repeat steps b and c.

5-59 METER CALIBRATION

5-60 To calibrate the ammeter, proceed as follows:

- Connect test setup as shown on Figure 5-4.
- Set METER SELECTION switch to mA position.
- Turn on supply and adjust VOLTAGE controls so that differential voltmeter indicates exactly 1.2 volts for 6215A and 6217A, and 1 Volt for 6213A.
- Adjust R47 until front panel ammeter indicates:

6213A	1A
6215A	400mA
6217A	200mA

5-61 ZERO VOLTS OUTPUT ADJUSTMENT

5-62 To calibrate the output voltage so that there is zero volts output when the VOLTAGE controls are fully ccw, proceed as follows:

- Connect differential voltmeter between (+) and (-) output terminals.
- Short out voltage controls by connecting jumper across R10 and R11.
- Turn on supply and observe reading on differential voltmeter.
- Shunt resistor R5 with a decade resistance box.
- Adjust decade resistance until differential voltmeter reads zero, then shunt R5 with resistance value equal to that of the decade resistance.

5-63 OUTPUT CURRENT LIMIT ADJUSTMENT

5-64 To adjust the limiting level of the output current, proceed as follows:

- Attach the multimeter or a milliammeter to the output terminals of the supply. Set the meter for approximately 600 mA. The internal resistance of the meter is low enough to overload the supply so that the output will current limit.
- Adjust the VOLTAGE controls fully clockwise.
- Adjust current limit control R50 for the following indications on the multimeter:

Model	Current Limit
6213A	1300mA
6215A	475mA
6217A	250mA

SECTION VI REPLACEABLE PARTS

6-1 INTRODUCTION

6-2 This section contains information for ordering replacement parts.

6-3 Table 6-4 lists parts in alpha-numerical order of the reference designators and provides the following information:

- a. Reference Designators. For abbreviations, refer to Table 6-1.
- b. Description. Refer to Table 6-2 for abbreviations.
- c. Total Quantity (TQ) used in the instrument; given only first time the part number is listed.
- d. Manufacturer's part number.
- e. Manufacturer's code number. Refer to Table 6-3 for manufacturer's name and address.
- f. Φ Part Number.
- g. Recommended spare parts quantity (RS) for complete maintenance of one instrument during one year of isolated service.
- h. Parts not identified by a reference designator are listed at the end of Table 6-4 under Miscellaneous.

6-4 ORDERING INFORMATION

6-5 To order a replacement part, address order or inquiry to your local Hewlett-Packard sales office (see lists at rear of this manual for addresses).

6-6 Specify the following information for each part:

- a. Model and complete serial number of instrument.
- b. Hewlett-Packard part number.
- c. Circuit reference designator.
- d. Description.

6-7 To order a part not listed in Table 6-4, give a complete description of the part and include its function and location.

Table 6-1. Reference Designators

A = assembly	CR = diode
B = motor	DS = device,
C = capacitor	signaling (lamp)

Table 6-1. Reference Designators (Continued)

E = misc. electronic part	RT = thermistor
F = fuse	S = switch
J = jack	T = transformer
K = relay	V = vacuum tube, neon bulb, photocell, etc.
L = inductor	X = socket
M = meter	XF = fuseholder
P = plug	XDS = lampholder
Q = transistor	Z = network
R = resistor	

Table 6-2. Description Abbreviations

a = amperes	obd = order by description
c = carbon	p = peak
cer = ceramic	pc = printed circuit board
coef = coefficient	pf = picofarads = 10 ⁻¹² farads
com = common	pp = peak-to-peak
comp = composition	ppm = parts per million
conn = connection	pos = position(s)
crt = cathode-ray tube	poly = polystyrene
dep = deposited	pot = potentiometer
elect = electrolytic	prv = peak reverse voltage
encap = encapsulated	rect = rectifier
f = farads	rot = rotary
fxd = fixed	rms = root-mean-square
GE = germanium	s-b = slow-blow
grd = ground(ed)	sect = section(s)
h = henries	Si = silicon
Hg = mercury	sil = silver
imp = impregnated	sl = slide
ins = insulation(ed)	td = time delay
K = kilo = 1000	TiO ₂ = titanium dioxide
lin = linear taper	tog = toggle
log = logarithmic taper	tol = tolerance
mA = milli = 10 ⁻³	trim = trimmer
M = megohms	tw = traveling wave tube
ma = milliamperes	var = variable
μ = micro = 10 ⁻⁶	w/ = with
mfr = manufacturer	W = watts
mtg = mounting	w/o = without
my = mylar	cmo = cabinet mount only
NC = normally closed	
Ne = neon	
NO = normally open	

Table 6-3. Code List of Manufacturers

CODE NO.	MANUFACTURER	ADDRESS	CODE NO.	MANUFACTURER	ADDRESS
00629	EBY Sales Co.	New York, N. Y.	06812	Torrington Mfg. Co., West Div.	Van Nuys, Calif.
00656	Aerovox Corp.	New Bedford, Mass.	07137	Transistor Electronics Corp.	Minneapolis, Minn.
00853	Sangamo Electric Company,		07138	Westinghouse Electric Corp.	Elmira, N.Y.
01121	Ordill Division (Capacitors)	Marion, Ill.	07263	Electronic Tube Div. of	
01255	Allen Bradley Co.	Milwaukee, Wis.		Fairchild Semiconductor Div. of	
01281	Litton Industries, Inc.	Beverly Hills, Calif.		Fairchild Camera and Instrument Corp.	Mountain View, Calif.
01295	TRW Semiconductors, Inc.	Lawndale, Calif.	07387	Birtcher Corp., The	Los Angeles, Calif.
01686	Texas Instruments, Inc. Semiconductor-		07397	Sylvania Electric Products Inc.	
01930	Components Division	Dallas, Texas		Mountain View Operations of	
02114	RCL Electronics, Inc.	Manchester, N. H.		Sylvania Electronic Systems	Mountain View, Calif.
02606	Amerock Corp.	Rockford, Ill.	07716	International Resistance Co.	Burlington, Iowa
02660	Ferroxcube Corp. of America	Saugerties, N. Y.	07910	Continental Device Corp.	Hawthorne, Calif.
02735	Fenwal Laboratories	Morton Grove, Ill.	07933	Raytheon Mfg. Co., Semiconductor Div.	Mountain View, Calif.
03508	Amphenol-Borg Electronics Corp.	Broadview, Ill.	08530	Reliance Mica Corp.	Brooklyn, N.Y.
03797	Radio Corp. of America, Commercial		08717	Sloan Company	Sun Valley, Calif.
03877	Receiving Tube and Semiconductor Div.	Somerville, N.J.	08730	Vemaline Products Co.	Franklin Lakes, N.J.
03888	G. E. Semiconductor Products Dept.	Syracuse, N. Y.	08863	Nylomatic Corp.	Morrisville, Pa.
04009	Eldema Corp.	Compton, Calif.	09182	Hewlett-Packard Co., Harrison Division	Berkeley Heights, N. J.
04072	Transitron Electronic Corp.	Wakefield, Mass.	09353	C & K Components	Newton, Mass.
04213	Pyrofilm Resistor Co.	Cedar Knolls, N.J.	11236	CTS of Berne, Inc.	Berne, Ind.
04404	Arrow, Hart and Hegeman Electric Co.	Hartford, Conn.	11237	Chicago Telephone of California, Inc.	So. Pasadena, Calif.
04713	ADC Electronics, Inc.	Harbor City, Calif.	11711	General Instrument Corp., Semiconductor	
05277	Caddell-Burns Mfg. Co. Inc.	Mineola, N. Y.		Prod. Group, Rectifier Div.	Newark, N.J.
05347	Dymec Division of		12136	Philadelphia Handle Co., Inc.	Camden, N.J.
05486	Hewlett-Packard Co.	Palo Alto, Calif.	12697	Clarostat Mfg. Co.	Dover, N.H.
06486	Motorola, Inc., Semiconductor		14493	Hewlett-Packard Co.,	
06540	Products Division	Phoenix, Arizona		Loveland Division	Loveland, Colo.
06555	Westinghouse Electric Corp.		14655	Cornell-Dubilier Elec. Corp.	Newark, N.J.
06666	Semi-Conductor Dept.	Youngwood, Pa.	14936	General Instrument Corp., Semiconductor	
06751	Ultronix, Inc.	Grand Junction, Colo.		Prod. Group, Semiconductor Div.	Hicksville, N.Y.
	North American Electronics, Inc.	Lynn, Mass.	15909	Daven Div. of Thos. Edison Industries,	
				McGraw Edison Co.	Livingston, N. J.
	Amathom Electronic Hardware Co., Inc.	New Rochelle, N. Y.	16299	Corning Glass Works,	
	Beede Electrical Instrument Co., Inc.	Penacook, N. H.		Electronic Components Div.	Raleigh, N. C.
	General Devices Co., Inc.	Indianapolis, Ind.	16758	Delco Radio Div. of General Motors Corp.	Kokomo, Ind.
	Nuclear Corp. of America, Inc.,		17545	Atlantic Semiconductors, Inc.	Asbury Park, N. J.
	U. S. Semcor Div.	Phoenix, Arizona			


Table 6-3. Code List of Manufacturers (Continued)

CODE NO.	MANUFACTURER	ADDRESS	CODE NO.	MANUFACTURER	ADDRESS
19315	The Bendix Corp., Eclipse Pioneer Div.	Teterboro, N.J.	73138	Helipot Div. of Beckman Instruments, Inc.	Fullerton, Calif.
19701	Electra Mfg. Co.	Independence, Kan.	73293	Hughes Components Division of Hughes Aircraft Co.	Newport Beach, Calif.
21520	Fansteel Metallurgical Corp.	No. Chicago, Ill.	73445	Amperex Electronic Co., Div. of North American Phillips Co., Inc.	Hicksville, N.Y.
22229	Union Carbide Corp., Linde Div., Kemet Dept.	Mountain View, Calif.	73506	Bradley Semiconductor Corp.	New Haven, Conn.
22767	ITT Semiconductors, A Division of International Telephone & Telegraph Corp.	Palo Alto, Calif.	73559	Carling Electric, Inc.	Hartford, Conn.
24446	General Electric Co.	Schenectady, N.Y.	73734	Federal Screw Products, Inc.	Chicago, Ill.
24455	General Electric Co., Lamp Division	Nela Park, Cleveland, Ohio	73978	Hardwick Hindle Co., Memcor Components Div.	Huntington, Ind.
24655	General Radio Co.	West Concord, Mass.	74193	Heinemann Electric Co.	Trenton, N.J.
28480	Hewlett-Packard Co.	Palo Alto, Calif.	74545	Harvey Hubbel, Inc.	Bridgeport, Conn.
28520	Heyman Mfg. Co.	Kenilworth, N.J.	74868	FXR Div. of Amphenol-Borg Electronics Corp.	Danbury, Conn.
33173	G. E., Tube Dept.	Owensboro, Ky.	75042	International Resistance Co.	Philadelphia, Pa.
35434	Lectrohm, Inc.	Chicago, Ill.	75183	Howard B. Jones Div., of Cinch Mfg. Corp. (Use 71785)	New York, N.Y.
37942	P.R. Mallory & Co., Inc.	Indianapolis, Ind.	75382	Kulka Electric Corp.	Mt. Vernon, N.Y.
42190	Muter Co.	Chicago, Ill.	75915	Littlefuse, Inc.	Des Plaines, Ill.
44655	Ohmite Manufacturing Co.	Skokie, Ill.	76493	J. W. Miller Co.	Los Angeles, Calif.
47904	Polaroid Corporation	Cambridge, Mass.	76854	Oak Manufacturing Co.	Crystal Lake, Ill.
49956	Raytheon Mfg. Co., Microwave and Power Tube Div.	Waltham, Mass.	77068	Bendix Corp., Bendix-Pacific Div.	No. Hollywood, Calif.
55026	Simpson Electric Co.	Chicago, Ill.	77221	Phaostron Instrument and Electronic Co.	South Pasadena, Calif.
56289	Sprague Electric Co.	North Adams, Mass.	77252	Philadelphia Steel and Wire Corp.	Philadelphia, Pa.
58474	Superior Electric Co.	Bristol, Conn.	77342	American Machine and Foundry, Potter and Brumfield Div.	Princeton, Ind.
61637	Union Carbide Corp.	New York, N.Y.	77630	TRW Electronics, Components Div.	Camden, N.J.
63743	Ward-Leonard Electric Co.	Mt. Vernon, N.Y.	77764	Resistance Products Co.	Harrisburg, Pa.
70563	Amperite Co., Inc.	Union City, N.J.	78189	Shakeproof Div. of Illinois Tool Works	Elgin, Ill.
70903	Belden Mfg. Co.	Chicago, Ill.	78488	Stackpole Carbon Co.	St. Marys, Pa.
71218	Bud Radio, Inc.	Willoughby, Ohio	78526	Stanwyck Winding Co., Inc.	Newburgh, N.Y.
71400	Bussmann Mfg. Div. of McGraw-Edison Co.	St. Louis, Mo.	78553	Tinnerman Products, Inc.	Cleveland, Ohio
71450	CTS Corporation	Elkhart, Ind.	79307	Whitehead Metal Products Co., Inc.	New York, N.Y.
71468	I. T. T. Cannon Electric Inc.	Los Angeles, Calif.	79727	Continental-Wirt Electronics Corp.	Philadelphia, Pa.
71590	Centralab Div. of Globe Union, Inc.	Milwaukee, Wis.	80031	Mepco Div. of Sessions Clock Co.	Morristown, N.J.
71700	The Cornish Wire Co.	New York, N.Y.	80294	Bourns, Inc.	Riverside, Calif.
71744	Chicago Miniature Lamp Works	Chicago, Ill.			
71785	Cinch Mfg. Co.	Chicago, Ill.			
71984	Dow Corning Corp.	Midland, Mich.			
72619	Dialight Corporation	Brooklyn, N.Y.			
72699	General Instrument Corp., Capacitor Div.	Newark, N.J.			
72765	Drake Mfg. Co.	Chicago, Ill.			
72982	Erie Technological Products, Inc.	Erie, Pa.			

Table 6-3. Code List of Manufacturers (Continued)

CODE NO.	MANUFACTURER	ADDRESS	CODE NO.	MANUFACTURER	ADDRESS
81042	Howard Industries, Inc.	Racine, Wis.	88140	Cutler-Hammer, Inc.	Lincoln, Ill.
81483	International Rectifier Corp.	El Segundo, Calif.	89473	General Electric Distributing Corp.	Schenectady, N.Y.
81751	Columbus Electronics Corp.	Yonkers, N.Y.	91345	Miller Dial and Nameplate Co.	El Monte, Calif.
82099	Goodyear Sundries & Mechanical Co., Inc.	New York, N.Y.	91637	Dale Electronics, Inc.	Columbus, Neb.
82219	Sylvania Electric Products, Inc.,		91662	Elco Corp.	Willow Grove, Pa.
	Electronic Tube Division	Emporium, Pa.	91929	Honeywell, Inc., Micro Switch Div.	Freeport, Ill.
82389	Switchcraft, Inc.	Chicago, Ill.	93332	Sylvania Electric Prod., Inc., Semicon-	
82647	Metals and Controls, Inc.,			ductor Prod. Div.	Woburn, Mass.
	Spencer Products	Attleboro, Mass.	93410	Stevens Mfg. Co., Inc.	Mansfield, Ohio
82866	Research Products Corp.	Madison, Wis.	94144	Raytheon Co., Components Div., Industrial	
82877	Rotron Mfg. Co., Inc.	Woodstock, N.Y.		Components Operation	Quincy, Mass.
82893	Vector Electronic Co.	Glendale, Calif.	94154	Tung-Sol Electric, Inc.	Newark, N.J.
83058	Carr Fastener Co.	Cambridge, Mass.	94310	Tru-Ohm Products, Memcor	
83186	Victory Engineering Corp.	Springfield, N.J.		Components Div.	Huntington, Ind.
83298	Bendix Corp., Red Bank Div.	Eatontown, N.J.	95263	Leecraft Mfg. Co., Inc.	Long Island City, N.Y.
83330	Herman H. Smith, Inc.	Brooklyn, N.Y.	95354	Methode Mfg. Co.	Chicago, Ill.
83385	Central Screw Co.	Chicago, Ill.	96791	Amphenol Controls Div. of Amphenol-	
83501	Gavitt Wire and Cable Co., Div. of			Borg Electronics Corp.	Janesville, Wis.
	Amerace Corp.	Brookfield, Mass.	98291	Seaelectro Corp.	Mamaroneck, N.Y.
83508	Grant Pulley and Hardware Co.	West Nyack, N.Y.	98978	International Electronic Research Corp.	Burbank, Calif.
83594	Burroughs Corp., Electronic		99934	Renbrandt, Inc.	Boston, Mass.
	Components Div.	Plainfield, N.J.	THE FOLLOWING H-P VENDORS HAVE NO NUMBERS ASSIGNED IN THE LATEST SUPPLEMENT TO THE FEDERAL SUPPLY CODE FOR MANUFACTURERS HANDBOOK.		
83877	Yardeny Laboratories, Inc.	New York, N.Y.			
84171	Arco Electronics, Inc.	Great Neck, N.Y.	0000	Cooltron	Oakland, Calif.
84411	TRW Capacitor Div.	Ogallala, Neb.	00000	Plastic Ware Co.	Brooklyn, N.Y.
86684	Radio Corporation of America, Electronic				
	Components & Devices Div.	Harrison, N.J.			
87034	Marco Industries Co.	Anaheim, Calif.			
87216	Philco Corp. (Lansdale Div.)	Lansdale, Pa.			
87585	Stockwell Rubber Co., Inc.	Philadelphia, Pa.			
87929	B.M. Tower Co., Inc.	Bridgeport, Conn.			

Table 6-4. Replaceable Parts

REF. DESIG.	DESCRIPTION	TQ	MFR. PART NO.	MFR. CODE	 PART NO.	RS
C1	fxd, elect 5 μ f 65Vdc	1		09182	0180-1836	1
C2, 4, 6-8, 12, 13	NOT ASSIGNED	-	-	-	-	-
C3	fxd, film .0022 μ f 200Vdc	1	192P22292	56289	0160-0154	1
C5	fxd, elect 100 μ f 50Vdc	1		09182	0180-1852	1
C9	fxd, elect 490 μ f 100Vdc	1		09182	0180-1887	1
C10, 11A	fxd, ceramic .02 μ f 600Vdc	2	Z5U-203Z	72982	0150-0024	1
C14	fxd, elect 100 μ f 65Vdc	1		09182	0180-1853	1
CR1, 2	Rect. Si. 250mA 200prv	3		09182	1901-0033	3
CR3, 5, 6, 8, 9, 12	NOT ASSIGNED	-	-	-	-	-
CR4	Rect. Si. 250mA 200prv			09182	1901-0033	
CR7, 10, 11	Rect. Si. 500mA 200prv	8	1N3253	02735	1901-0389	6
CR13	Stabistor 2.4V @ 100mA	1	1N4830	03508	1901-0460	1
CR14-18	Rect. Si. 500mA 200prv		1N3253	02735	1901-0389	
DS1	Lamp-neon, glow	1	A1C	03508	2140-0047	1
F1	Fuse Cartridge 0.5A 250V 3AG	1	312.005	75915	2110-0012	5
Q1-3	SS NPN Si.	3		09182	1854-0071	3
Q4	SS PNP Si.	2	MPS6517	04713	1853-0099	2
Q5	SS PNP Si.	1	38640	02735	1853-0041	1
Q6, 8, 10	NOT ASSIGNED	-	-	-	-	-
Q7	Power NPN Si.	1		09182	1854-0239	1
Q9	SS NPN Si.	1	2N3417	03508	1854-0087	1
Q11	SS PNP Si.		MPS6517	04713	1853-0099	
R1	fxd, ww 1K Ω \pm 5% 3W	1	242E1025	56289	0813-0001	1
R2	fxd, met. film 6.2K Ω \pm 1% 1/8W	1	Type CEA T-O	07716	0698-5087	1
R3, 4	fxd, met. film 20K Ω \pm 1% 1/8W	2	Type CEA T-O	07716	0757-0444	1
R5	fxd, comp 150K Ω \pm 5% $\frac{1}{2}$ W	1	EB-1545	01121	0686-1545	1
R6	fxd, met. film 1.5K Ω \pm 1% 1/8W	1	Type CEA T-O	07716	0757-0427	1
R7-9, 13-15, 22, 23, 29, 34, 39, 41-46, 48, 49	NOT ASSIGNED	-	-	-	-	-
R10	var, ww 100 Ω \pm 5%	1		09182	2100-1987	1
R11	var, ww 10K Ω \pm 5%	1		09182	2100-1854	1
R12	fxd, ww 1.2K Ω \pm 5% 3W	1	242E1225	56289	0811-1208	1
R16	fxd, comp 2.2K Ω \pm 5% $\frac{1}{2}$ W	1	EB-2225	01121	0686-2225	1
R17	fxd, comp 4.7K Ω \pm 5% $\frac{1}{2}$ W	1	EB-4725	01121	0686-4725	1
R18	fxd, comp 6.2K Ω \pm 5% $\frac{1}{2}$ W	1	EB-6225	01121	0686-6225	1
R19	fxd, comp 1K Ω \pm 5% $\frac{1}{2}$ W	1	EB-1025	01121	0686-1025	1
R20	fxd, met. film 2K Ω \pm 5% 2W	1	Type C42S	16299	0764-0025	1
R21	fxd, comp 240 Ω \pm 5% $\frac{1}{2}$ W	1	EB-2415	01121	0686-2415	1
R24	fxd, comp 3.6K Ω \pm 5% 1W	1	GB-3625	01121	0689-3625	1
R25	fxd, comp 510 Ω \pm 5% $\frac{1}{2}$ W	1	EB-5115	01121	0686-5115	1
R26	fxd, comp 180 Ω \pm 5% $\frac{1}{2}$ W	1	EB-1815	01121	0686-1815	1
R27	fxd, comp 820 Ω \pm 5% $\frac{1}{2}$ W	1	EB-8215	01121	0686-8215	1
R28	fxd, comp 680 Ω \pm 5% $\frac{1}{2}$ W	1	EB-6815	01121	0686-6815	1
R30	fxd, comp 1.8K Ω \pm 5% $\frac{1}{2}$ W	1	EB-1825	01121	0686-1825	1
R31	fxd, comp 750 Ω \pm 5% $\frac{1}{2}$ W	1	EB-7515	01121	0686-7515	1
R32	fxd, met. oxide 6.5K Ω \pm 5% 3W	1	242E6525	56289	0811-1814	1

REF. DESIG.	DESCRIPTION	TQ	MFR. PART NO.	MFR. CODE	ϕ_p PART NO.	RS
R33	fxd, ww $6\Omega \pm 0.5\%$ 3W 10ppm	1	Type T-3	01686	0811-2499	1
R35	fxd, met. film $1.3K\Omega \pm 0.5\%$ $\frac{1}{4}$ W	1	Type CEB T-O	07716	0757-0735	1
R36	fxd, comp $56\Omega \pm 5\%$ $\frac{1}{2}$ W	1	EB-5605	01121	0686-5605	1
R37	fxd, comp $12K\Omega \pm 5\%$ $\frac{1}{2}$ W	1	EB-1235	01121	0686-1235	1
R38	fxd, met. film $60.4K\Omega \pm 1\%$ 1/8W	1	Type CEA T-O	07716	0698-3572	1
R40	fxd, comp $47K\Omega \pm 5\%$ $\frac{1}{2}$ W	1	EB-4735	01121	0686-4735	1
R47	var. ww $250\Omega \pm 20\%$	1	Type 110-F4	11236	2100-0439	1
R50	var. ww $100\Omega \pm 20\%$	1	Type 110-F4	11236	2100-0281	1
S1	Switch, Toggle-Power	1	7101	09353	3101-0163	1
S2	Slide switch, DPDT, solder terminals, $\frac{1}{2}$ " knob	1	XA-70420	82389	3101-1364	1
T1	Power Transformer	1		09182	9100-2182	1
VR1	Zener, 12.4V $\pm 5\%$ 400mW	2		09182	1902-3185	2
VR2	Zener, 4.22V $\pm 5\%$ 400mW	1		09182	1902-3070	1
VR3	Zener, 6.19V $\pm 5\%$ 400mW	2		09182	1902-0049	2
VR4	Zener, 12.4V $\pm 5\%$ 400mW			09182	1902-3185	
VR5	NOT ASSIGNED	-	-	-	-	-
VR6	Zener, 6.2V $\pm 5\%$	1	1N821	06486	1902-0761	1
VR7	Zener, 6.19V $\pm 5\%$ 400mW			09182	1902-0049	
MISCELLANEOUS						
	Printed Circuit Board Assembly (Includes Components)	1		09182	06217-60021	
	P.C. Board (Blank)	1		09182	5020-5722	
	Front Panel Printed Circuit Board (Includes Components)	1		09182	06217-60022	
	Front Panel P.C. Board (Blank)	1		09182	5020-5723	
	Rear Panel Assembly	1		09182	4040-0052	
	Heat Sink	1		09182	5060-6141	
	Front Panel Assembly	1		09182	06217-60002	
	Bottom Cover	1		09182	4040-0051	
	Top Cover	1		09182	4040-0050	
	5 Way Binding Post (maroon)	1		09182	1510-0040	1
	5 Way Binding Post (black)	2	DF21C	58474	1510-0039	1
	Meter $2\frac{1}{4}$ " Dual Scale 0-60V, 0-300mA	1		09182	1120-1142	1
	Bezel, Meter	1		09182	4040-0295	1
	Spring, Meter	4		09182	1460-0256	1
	Line Cord	1	KH-4096	70903	8120-0050	1
	Strain Relief Bushing	1	SR-5P-1	28520	0400-0013	1
	Fuseholder Assembly	1	342014	75915	1400-0084	1
	Mica Insulator	1	734	08530	0340-0174	1
	Insulator	2		09182	0340-0166	2
	Insulator	2		09182	0340-0168	2
	Knob $\frac{1}{4}$ " Insert Pointer	2		09182	0370-0084	1
	Fastener	1	C17373-012-24B	89032	0510-0123	1
	Lens (DS1)	1		09182	1450-0358	1

SECTION VII CIRCUIT DIAGRAMS

This section contains the circuit diagrams necessary for the operation and maintenance of this power supply. Included are:

a. Component Location Diagram, Figure 7-1, which shows the physical location and reference designator of parts mounted on the printed

wiring board.

b. Schematic Diagram, Figure 7-2, which illustrates the circuitry for the entire power supply. Voltages are given adjacent to test points, identified by encircled numbers on the schematic and printed wiring board.

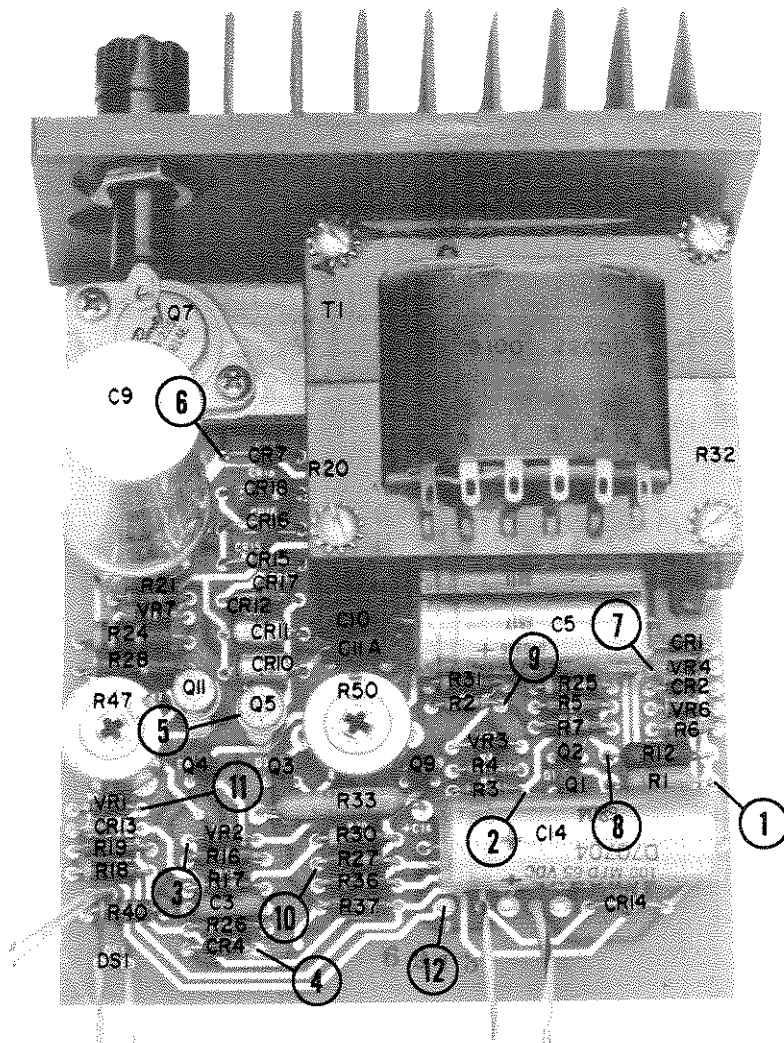


Figure 7-1. Model 6217A
Component Location Diagram

APPENDIX A MANUAL BACKDATING CHANGES


Manual backdating changes describe changes necessary to adapt this manual to earlier instruments. To adapt the manual to serial numbers prior to 8G2551, inspect the following table for your serial number and then make the appropriate changes. For serial numbers 8G2550 and up check for inclusion of change sheet.

SERIAL		MAKE CHANGES
Prefix	Number	
8G	1801 - 2400	1
8B	1401 - 1800	1, 2
7H	0701 - 1400	1, 2, 3
7H	0501 - 0700	1, 2, 3, 4
7D	0100 - 0500	1, 2, 3, 4, 5

CHANGE 1: In the replaceable parts list, Table 6-4, and on the schematic, make the following changes:

R40	Change to	fxd, comp 68K Ω \pm 5% $\frac{1}{2}$ W	EB-6835	01121	0686-6835
DS1	Change to	Lamp, Neon, Clear	6141-000-603	72765	1450-0361

CHANGE 2: In the replaceable parts list, Table 6-4, make the following changes:


REF. DESIG.		DESCRIPTION	MFR. PART NO.	MFR. CODE	 PART NO.
Q11	Change to	SS PNP	38640	02735	1853-0041
R3, 4	Change to	fxd, met. film 23K Ω \pm 1% 1/8W	Type CEA T-O	07716	0698-3269
R5	Change to	fxd, comp 150K Ω \pm 5% $\frac{1}{2}$ W	EB-1545	01121	0686-1545
R7	Add	fxd, comp 560K Ω \pm 5% $\frac{1}{2}$ W	EB-5645	01121	0686-5645
R14	Add	fxd, comp 24 Ω \pm 5% $\frac{1}{2}$ W	EB-2405	01121	0686-2405
R16	Change to	fxd, comp 2.2K Ω \pm 5% $\frac{1}{2}$ W	EB-2225	01121	0686-2225
R17	Change to	fxd, comp 6.2K Ω \pm 5% $\frac{1}{2}$ W	EB-6225	01121	0686-6225
R18	Change to	fxd, comp 12K Ω \pm 5% $\frac{1}{2}$ W	EB-1235	01121	0686-1235
R28	Delete	-	-	-	-
S2	Change to	Slide Switch DPDT, Solder Terminals $\frac{1}{2}$ " knob	11A1138	82389	3101-1172
	Change to	P.C. Board Assembly		09182	06217-60020
	Change to	P.C. Board Blank		09182	5020-5597
	Delete	P.C. Board, Front Panel	-	-	-

On the schematic, make the following changes:

Delete R28 (open).

Add R7 from base of Q2 to reference voltage -6.2V, Test Point 9.

Add R14 from the junction of R12 and R11 to the -OUT line.

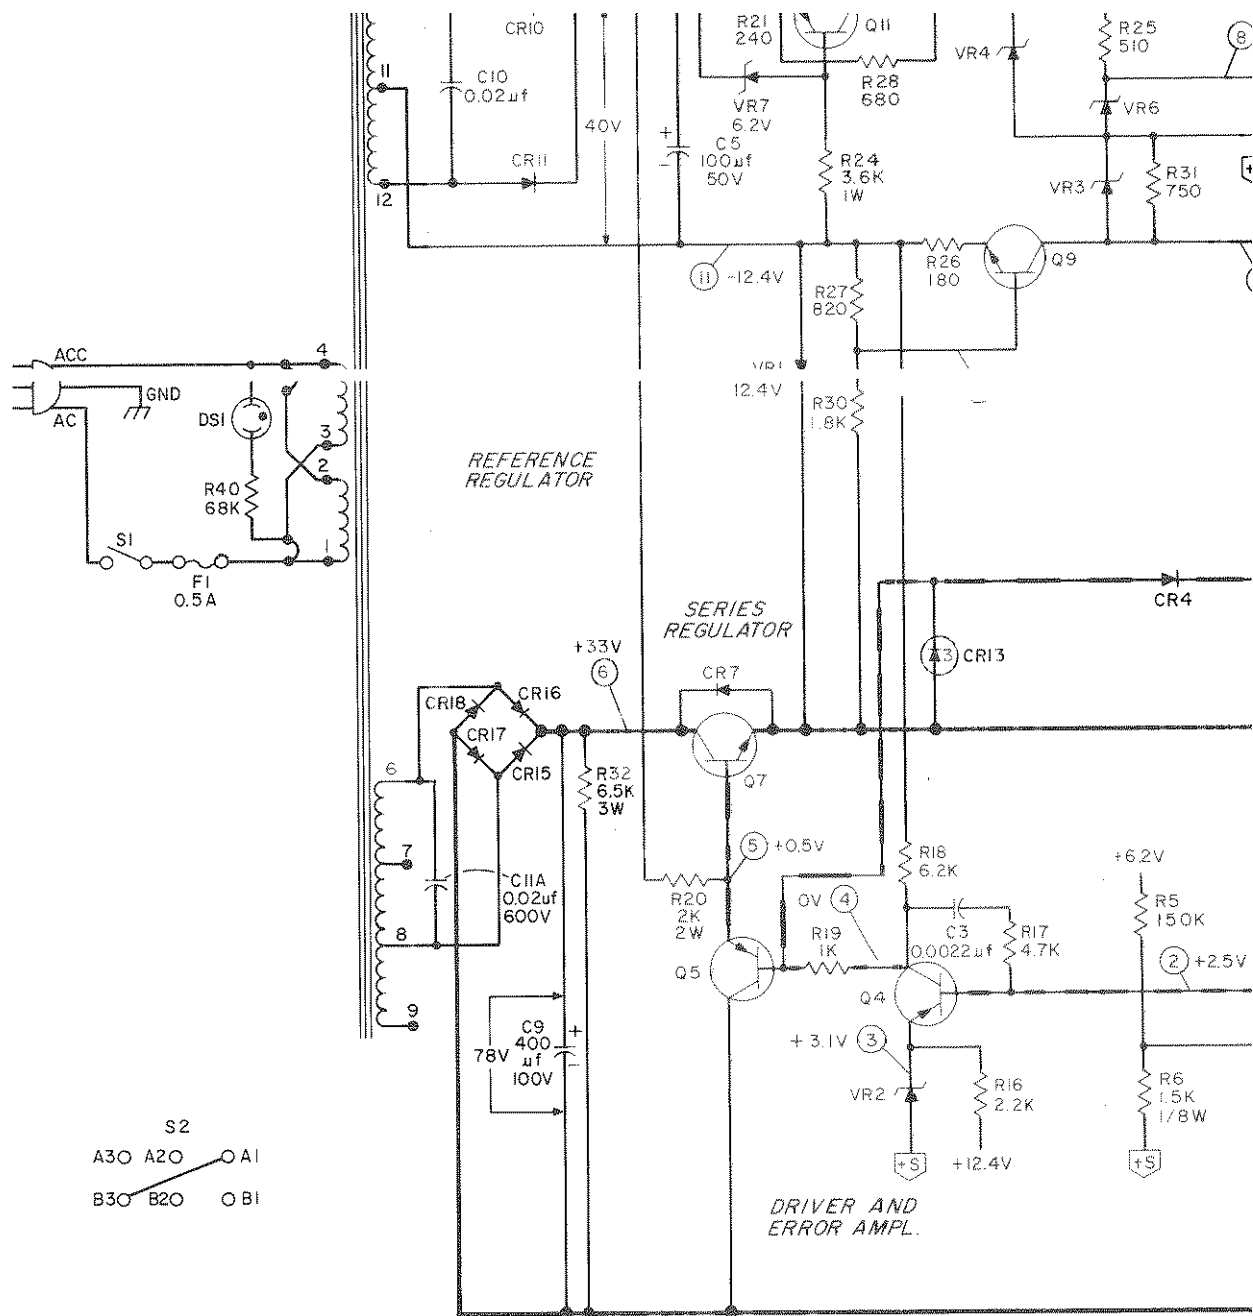

NOTES:

1. ALL RESISTORS ARE 1/2 WATT, 5% UNLESS OTHERWISE SPECIFIED.
2. ALL 1/8 AND 1/4 WATT RESISTORS ARE $\pm 1\%$, 100PPM.
3. * DENOTES 20PPM WIRE TEMPERATURE COEFFICIENT.
4. METER SWITCH S2 AS VIEWED FROM REAR; SEE ABOVE.
5. ———— DENOTES VOLTAGE FEEDBACK SIGNAL.
6. ———— DENOTES CURRENT FEEDBACK SIGNAL.
7. TRANSFORMER SHOWN STRAPPED FOR 115VAC OPERATION. SEE INSTRUCTION MANUAL FOR 220VAC.
8. DC VOLTAGES WERE MEASURED UNDER THE FOLLOWING CONDITIONS:
 - A. SIMPSON MODEL 269 OR EQUIVALENT.
 - B. 115 VAC INPUT
 - C. VOLTAGES REFERENCED TO +S UNLESS OTHERWISE NOTED
 - D. VOLTAGES ARE TYPICAL, $\pm 10\%$ UNLESS OTHERWISE NOTED
 - E. ALL READINGS TAKEN IN CONSTANT VOLTAGE OPERATION AT MAXIMUM RATED OUTPUT WITH NO LOAD CONNECTED.

CHANGE 3: Use the Component Location Diagram below:

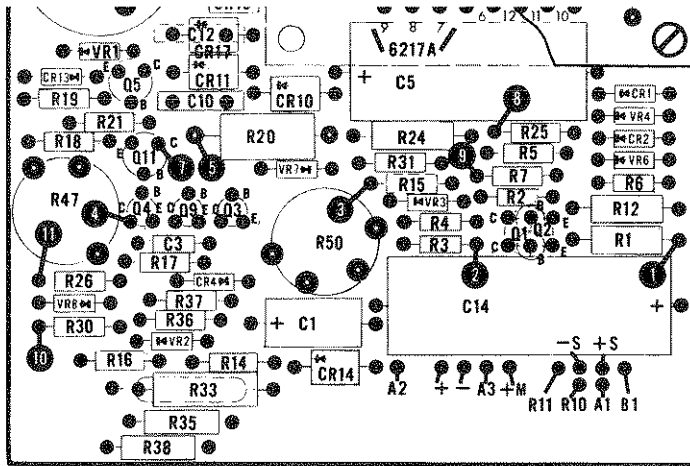



Figure A-1. Model 6217A, Component Location Diagram

Change CR13 to Rect. 250mA 200prv, 1N485B, 93332,  Part No. 1901-0033.

CHANGE 4: In the replaceable parts list, Table 6-4, make the following change:

F1	Fuse Cartridge 1A 250V 3AG	312.001	75915	2110-0001
----	----------------------------	---------	-------	-----------

Use the Component Location Diagram below:

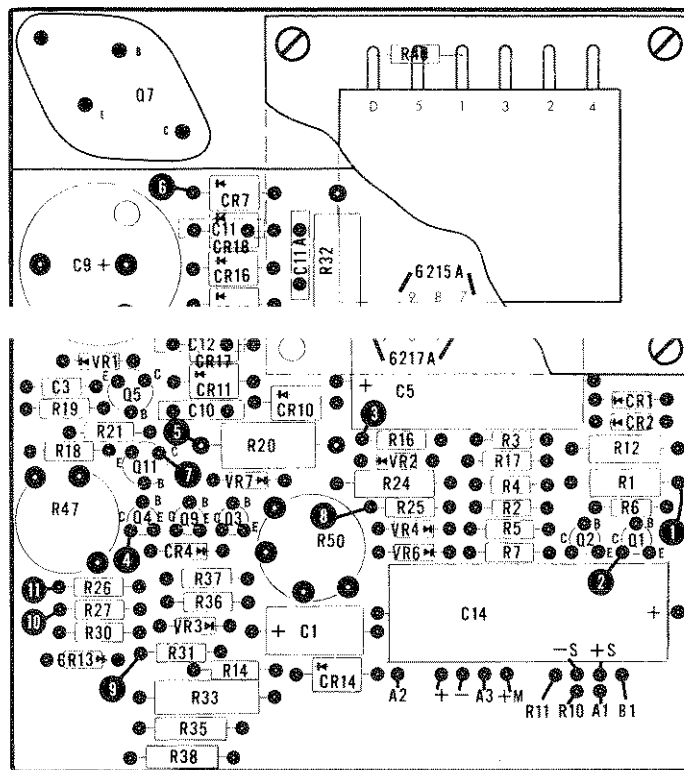


Figure A-2. Model 6217A, Component Location Diagram

CHANGE 5:

Page 3-1, Paragraph 3-2d. Change current limit as follows:

6215A 550 ± 10mA

6217A 310 ± 10mA

Page 3-1, Paragraph 3-8. Change current limit as follows:

6215A 300 - 630mA

6217A 200 - 350mA

Page 4-1, Figure 4-1. Delete amplifier Q3.

Page 4-2, Paragraph 4-10. Change to:

4-10 When the external load resistance decreases, the output current increases until the current limit is reached. The negative voltage developed across R33 and R50 forward biases CR4 controlling the conduction of Q5 and Q7. Any further decreases in load resistance increase the negative voltage on the base of Q5 which decreases the conduction of Q7. Thus, through feedback action the output current is limited to the value at which CR4 conducts.

Page 4-3, Paragraph 4-21. Change to:

4-21 Current limiting occurs when diode CR4 becomes forward biased. Its anode potential is determined by the voltage at the base of Q5. The cathode potential of CR4 is determined by the voltage drop across current limit potentiometer R50 which, in turn is connected across the current sampling resistor. The cathode potential of CR4 is a function of the output current. As this current increases, the drop across

the sampling network increases, and CR4 will start to conduct. Conduction of this diode clamps the base of Q5 to a potential which decreases the conduction of the series regulator, thus limiting the output current. Potentiometer R50 permits the cathode potential of CR4 to be varied and thus changes the current limiting threshold.

Page 5-7, Paragraph 5-39c. **Change:**

475 \pm 10mA to 550 \pm 10mA
 250 \pm 10mA to 250 \pm 10mA

Page 6-5 and overall schematic at rear of manual. **Change to:**

C10-12	fxd, ceramic .02 μ f 600Vdc	3	Type ED.02	72982	0150-0024	1
R16,17	fxd, comp 6.2K Ω \pm 5% $\frac{1}{2}$ W	2	EB-6225	01121	0686-6225	1
S2	Slide Switch, 3PDT, $\frac{1}{2}$ " knob, Solder Term.	1	11A-1138	82389	3101-1172	1
Delete: CR13, Q3, R14, R36, R37, and VR2						
Add: CR3	Rect. Si. 400mW 10prv	1		09182	1901-0460	1

On overall schematic at rear of manual, make the following changes:

Delete: Q3 and connect wiper of R50 to cathode of CR4.

HEWLETT • PACKARD SALES AND SERVICE

UNITED STATES

ALABAMA
P.O. Box 4207
2003 Byrd Spring Road S.W.
Huntsville 35802
Tel: (205) 881-4591
TWX: 810-726-2204

ARIZONA
3009 North Scottsdale Road
Scottsdale 85251
Tel: (602) 945-7601
TWX: 910-950-1282

5737 East Broadway
Tucson 85716
Tel: (602) 298-2313
TWX: 910-959-1162

111 East Avenue
Norwalk 06851
Tel: (203) 853-1251
TWX: 710-468-3750

DELAWARE
3941 Kennett Pike
Wilmington 19807
Tel: (302) 655-6161
TWX: 510-666-2214

FLORIDA
P.O. Box 545
Suite 106
8939 N.E. 2nd Avenue
Miami Shores 33153
Tel: (305) 754-4565
TWX: 810-848-7269

INDIANA
4602 Meadows Drive
Indianapolis 46205
Tel: (317) 546-4861
TWX: 810-941-3263

LOUISIANA
P.O. Box 856
1942 Williams Boulevard
Kenner 70062
Tel: (504) 721-6201
TWX: 810-953-5824

MARYLAND
6707 Whitestone Road
Baltimore 21207
Tel: (301) 944-5400
TWX: 710-862-0850

2812 South Brentwood Blvd.
St. Louis 63144
Tel: (314) 862-5000
TWX: 910-760-1670

NEW JERSEY
W. 120 Century Road
Paramus 07652
Tel: (201) 265-5000
TWX: 710-990-4951

1060 N. Kings Highway
Cherry Hill 08034
Tel: (609) 667-4090
TWX: 710-892-1945

NEW MEXICO
P.O. Box 8366

1025 Northern Boulevard
Roslyn, Long Island 11576
Tel: (516) 869-8400
TWX: 510-223-6811

5858 East Moily Road
Syracuse 13211
Tel: (315) 454-2486
TWX: 710-541-0482

NORTH CAROLINA
P.O. Box 5188
1923 North Main Street
High Point 27262
Tel: (919) 882-6873
TWX: 510-926-1516

OHIO

81th Avenue
King of Prussia Industrial Park
King of Prussia 19406
Tel: (215) 265-7060
TWX: 510-660-2670

TEXAS
P.O. Box 1270
201 E. Arapahoe Rd.
Richardson 75080
Tel: (214) 231-6101
TWX: 910-867-4723

P.O. Box 22813
4242 Richmond Avenue
Houston 77027
Tel: (713) 667-2407
TWX: 910-881-2645

UTAH AND CALIFORNIA

1055 Shafter Street
San Diego 92106
Tel: (714) 223-8103
TWX: 910-335-2000

COLORADO
7865 East Prentice
Englewood 80110
Tel: (303) 771-3455
TWX: 510-935-0705

CONNECTICUT
508 Tolland Street
East Hartford 06108
Tel: (203) 289-9394
TWX: 710-425-3416

GEORGIA
P.O. Box 28234
450 Interstate North
Atlanta 30328
Tel: (404) 436-6181
TWX: 810-766-4890

ILLINOIS
5500 Howard Street
Skokie 60076
Tel: (312) 677-0400
TWX: 910-223-3613

Southfield 48076
Tel: (313) 358-9100
TWX: 810-232-1532

MINNESOTA
2459 University Avenue
St. Paul 55114
Tel: (612) 645-9461
TWX: 510-563-3734

MISSOURI
9208 Wyoming Place
Kansas City 64114
Tel: (816) 333-2445
TWX: 910-771-2087

1219 Campville Road
Endicott 13764
Tel: (607) 754-0050
TWX: 510-252-0890

82 Washington Street
Poughkeepsie 12601
Tel: (914) 454-7330
TWX: 510-248-0012

35 Saginaw Drive
Rochester 14623
Tel: (716) 473-9500
TWX: 510-253-5941

OREGON
Westhills Mall, Suite 158
4475 S.W. Scholls Ferry Road
Portland 97225
Tel: (503) 252-9171
TWX: 910-664-6103

PENNSYLVANIA
2500 Moss Side Boulevard
Monroeville 15146
Tel: (412) 271-0724
TWX: 710-797-3650

2111 Spencer Road
Richmond 23230
Tel: (703) 282-5451
TWX: 710-956-0157

WASHINGTON
433-108th N.E.
Bellevue 98004
Tel: (206) 454-3971
TWX: 910-443-2303

FOR U.S. AREAS NOT LISTED:
Contact the regional office nearest you: Atlanta, Georgia... North Hollywood, California... Paramus, New Jersey... Skokie, Illinois. Their complete addresses are listed above.

CANADA

ALBERTA
Hewlett-Packard (Canada) Ltd.
11745 Jasper Ave.
Edmonton
Tel: (403) 482-5561
TWX: 610-831-2431

BRITISH COLUMBIA
Hewlett-Packard (Canada) Ltd.
304-1037 West Broadway
Vancouver 9
Tel: (604) 738-5361
TWX: 610-922-5059

MANITOBA
Hewlett-Packard (Canada) Ltd.
511 Bradford Ct.
St. James
Tel: (204) 786-7581

NOVA SCOTIA
Hewlett-Packard (Canada) Ltd.
7001 Mumford Road
Suite 356
Halifax
Tel: (902) 455-0511
TWX: 610-271-4482

ONTARIO
Hewlett-Packard (Canada) Ltd.
880 Lady Ellen Place
Ottawa 3
Tel: (613) 722-4223
TWX: 610-562-1952

Hewlett-Packard (Canada) Ltd.
1415 Lawrence Avenue West
Toronto
Tel: (416) 249-9196
TWX: 610-492-2382

QUEBEC
Hewlett-Packard (Canada) Ltd.
275 Hymus Boulevard
Pointe Claire
Tel: (514) 697-4232
TWX: 610-422-3022
Telex: 01-20607

FOR CANADIAN AREAS NOT LISTED:
Contact Hewlett-Packard (Canada) Ltd. in Pointe Claire, at the complete address listed above.

CENTRAL AND SOUTH AMERICA

ARGENTINA
Hewlett-Packard Argentina
S.A.C.e.I.
Lavalle 1271 - 3
Buenos Aires
Tel: 35-0436, 35-0627, 35-0431
Telex: 012-1009
Cable: HEWPACKARG

BRAZIL
Hewlett-Packard Do Brasil
L.d.C. Ltda.
Rua Coronel Oscar Porto, 691
Sao Paulo - 8, SP
Tel: 71-1503
Cable: HEWPACK Sao Paulo

Hewlett-Packard Do Brasil
L.d.C. Ltda.
Avenida Franklin Roosevelt 84-
grupo 203
Rio de Janeiro, 20-39, GB
Tel: 32-9733
Cable: HEWPACK Rio de Janeiro

CHILE
Hector Calicagni P.
Casilla 13942
Estado 715 - Oficina 1016
Santiago
Tel: 31-890, 450-505

COLOMBIA
Instrumentacion
Henrik A. Langebaek & Kier
Ltda.
Carrera 7 - 48-55
Apartado Aereo 6287
Bogota, 1 D.F.
Tel: 45-78-06, 45-55-46
Cable: AARIS Bogota

COSTA RICA
Lic. Alfredo Gallegos Gudián
Apartado 3243
San José
Tel: 21-86-13
Cable: CALGUR San José

ECUADOR
Laboratorios de Radio-Ingenieria
Calle Guayaquil 1246
Post Office Box 3199
Quito
Tel: 12496
Cable: HORVATH Quito

EL SALVADOR
Electronica
Apartado Postal 1589
27 Avenida Norte 1133
San Salvador
Tel: 25-74-50
Cable: ELECTRONICA
San Salvador

GUATEMALA
Olander Associates Latin America
Apartado 1226
7a. Calle, Q.22, Zona 1
Guatemala City
Tel: 22812
Cable: OLALA Guatemala City

MEXICO
Hewlett-Packard Mexicana, S.A.
de C.V.
Apartado Postal 12-832
Eugenia 408, Dept. 1
Mexico 12, D.F.
Tel: 43-03-79, 36-08-78

NICARAGUA
Roberto Terán G.
Apartado Postal 629
Edificio Terán
Managua
Tel: 3451, 3452
Cable: ROTERAN Managua

PANAMA
Electronica Balboa, S.A.
P.O. Box 4929
Ave. Manuel Espinosa No. 13-50
Bleg. Alina
Panama City
Tel: 30833
Cable: ELECTRON Panama City

PERU
Fernando Ezeta B.
Avenida Petit Thouars 4719
Miraflores
Casilla 3061
Lima
Tel: 50346
Cable: FEPERU Lima

PUERTO RICO
San Juan Electronics, Inc.
P.O. Box 5167
Ponce de Leon 154
P.O. 3-Pla. de Tierra
San Juan, P.R. 00906
Tel: (174) 725-3342
Cable: SATRONICS San Juan
Telex: SATRON 3450 332

URUGUAY
Pablo Ferrando S.A.
Comercial e Industrial
Avenida Italia 2877
Casilla de Correo 370
Montevideo
Tel: 40-3102
Cable: RADIUM Montevideo

VENEZUELA
Hewlett-Packard De Venezuela
C.A.
Apartado del Este 10934
Chacaito
Caracas
Tel: 71-88-05
Cable: HEWPAK Caracas

FOR AREAS NOT LISTED, CONTACT:
Hewlett-Packard Inter-Americas
3200 Hillview Ave.
Palo Alto, California 94304
Tel: (415) 325-7000
TWX: 910-373-1267
Cable: HEWPACK Palo Alto
Telex: 034-8461

MANUAL CHANGES
Model 6217A DC Power Supply
Manual Serial Number Prefix 8G

Make all corrections in the manual according to errata below, then check the following table for your power supply serial number and enter any listed change(s) in the manual.

SERIAL		MAKE CHANGES
Prefix	Number	
ALL 8G	- 2851 - up	Errata 1

ERRATA:

In Paragraph 3-18, delete the entire third sentence stating that "the output current controls of each power supply can be separately set. "

CHANGE 1:

In the replaceable parts table, change R28 to 820 Ω ,
 $\frac{1}{2}$ W, $\text{\textcircled{P}}$ Part No. 0686-8215.

6-24-68

