



DC POWER SUPPLY
MPB-3 SERIES
MODEL 6294A

OPERATING AND SERVICE MANUAL
FOR SERIALS 8H0691 AND ABOVE*

*For Serials Above 8H0691
Check for inclusion of
change page.

100 Locust Avenue, Berkeley Heights, New Jersey 07922

TABLE OF CONTENTS

Section	Page No.	Section	Page No.
I GENERAL INFORMATION	1-1	III OPERATING INSTRUCTIONS.....(Continued)	
1-1 Description	1-1	3-51 Reverse Voltage Loading	3-7
1-6 Specifications	1-1	3-53 Reverse Current Loading	3-7
1-8 Options	1-1		
1-10 Accessories	1-2	IV PRINCIPLES OF OPERATION.....	4-1
1-12 Instrument Identification	1-2	4-1 Overall Block Diagram	
1-15 Ordering Additional Manuals	1-2	Discussion	4-1
		4-8 Detailed Circuit Analysis	4-2
II INSTALLATION	2-1	4-9 Feedback Loop	4-2
2-1 Initial Inspection	2-1	4-14 Series Regulator	4-2
2-3 Mechanical Check	2-1	4-16 Constant Voltage Input Circuit	4-3
2-5 Electrical Check	2-1	4-21 Constant Current Input Circuit	4-3
2-7 Installation Data	2-1	4-26 Voltage Clamp Circuit	4-4
2-9 Location	2-1	4-29 Mixer Amplifier and Driver	4-4
2-11 Rack Mounting	2-1	4-33 Reference Circuit	4-4
2-15 Input Power Requirements	2-2	4-36 Meter Circuit	4-4
2-17 Connections for 230 Volt			
Operation	2-2	V MAINTENANCE.....	5-1
2-19 Power Cable	2-3	5-1 Introduction	5-1
2-22 Repackaging for Shipment	2-3	5-3 General Measurement Techniques	5-1
		5-8 Test Equipment Required	5-1
III OPERATING INSTRUCTIONS.....	3-1	5-10 Performance Test	5-3
3-1 Operating Controls and		5-12 Constant Voltage Tests	5-3
Indicators	3-1	5-33 Constant Current Tests	5-7
3-3 Operating Modes	3-1	5-38 Troubleshooting	5-8
3-5 Normal Operating Mode	3-1	5-42 Overall Troubleshooting	
3-7 Constant Voltage	3-1	Procedure	5-8
3-9 Constant Current	3-1	5-46 Repair and Replacement	5-12
3-11 Connecting Load	3-2	5-48 Adjustment and Calibration	5-13
3-14 Operation of Supply Beyond		5-50 Meter Zero	5-13
Rated Output	3-2	5-52 Voltmeter Tracking	5-13
3-16 Optional Operating Modes	3-2	5-54 Ammeter Tracking	5-13
3-17 Remote Programming, Constant		5-56 Constant Voltage Programming	
Voltage	3-2	Current	5-15
3-24 Remote Programming, Constant		5-59 Constant Current Programming	
Current	3-3	Current	5-15
3-30 Remote Sensing	3-3	5-62 Reference Circuit Adjustments	5-15
3-35 Series Operation	3-4	5-64 Constant Voltage Transient	
3-39 Parallel Operation	3-5	Response	5-16
3-42 Auto-Tracking Operation	3-6		
3-45 Special Operating Considerations	3-6	VI REPLACEABLE PARTS.....	6-1
3-46 Pulse Loading	3-6	6-1 Introduction	6-1
3-48 Output Capacitance	3-6	6-4 Ordering Information	6-1

LIST OF TABLES

Table	Page No.
1-1 Specifications.....	1-1
5-1 Test Equipment Required.....	5-2
5-2 Reference, Bias, and Filtered DC Troubleshooting.....	5-8
5-3 Overall Troubleshooting.....	5-9
5-4 Low Output Voltage Troubleshooting.....	5-11
5-5 High Output Voltage Troubleshooting.....	5-11
5-6 Selected Semiconductor Characteristics.....	5-12
5-7 Checks and Adjustments After Replacement of Semiconductor Devices.....	5-12
6-1 Reference Designators.....	6-1
6-2 Description Abbreviations.....	6-1
6-3 Code List of Manufacturers.....	6-2
6-4 Replaceable Parts.....	6-5

LIST OF ILLUSTRATIONS

Figure	Page No.
1-1 DC Power Supply, Model 6294A.....	i v
2-1 Rack Mounting, Two Units.....	2-1
2-2 Rack Mounting, One Unit.....	2-2
2-3 Primary Connections.....	2-2
3-1 Front Panel Controls and Indicators.....	3-1
3-2 Normal Strapping Pattern.....	3-1
3-3 Remote Resistance Programming (Constant Voltage).....	3-2
3-4 Remote Voltage Programming (Constant Voltage).....	3-2
3-5 Remote Resistance Programming (Constant Current).....	3-3
3-6 Remote Voltage Programming (Constant Current).....	3-3
3-7 Remote Sensing.....	3-4
3-8 Normal Series Connections.....	3-4
3-9 Auto-Series, Two and Three Units.....	3-5
3-10 Normal Parallel Connections.....	3-5
3-11 Auto-Parallel, Two and Three Units.....	3-5
3-12 Auto-Tracking, Two and Three Units.....	3-6
4-1 Overall Block Diagram.....	4-1
4-2 Operating Locus of a CV/CC Power Supply.....	4-2
4-3 Voltmeter Connections, Simplified Schematic.....	4-5
4-4 Ammeter Connections, Simplified Schematic.....	4-5
5-1 Front Panel Terminal Connections.....	5-1
5-2 Output Current Measurement Technique.....	5-1
5-3 Differential Voltmeter Substitute, Test Setup.....	5-3
5-4 Output Current, Test Setup.....	5-3
5-5 Load Regulation, Constant Voltage, Test Setup.....	5-4
5-6 CV Ripple and Noise, Test Setup.....	5-4
5-7 CV Noise Spike, Test Setup.....	5-6
5-8 Transient Response, Test Setup.....	5-6
5-9 Transient Response, Waveforms.....	5-6
5-10 Output Impedance, Test Setup.....	5-7
5-11 CC Ripple and Noise, Test Setup.....	5-8
5-12 Servicing Printed Wiring Boards.....	5-14



Figure 1-1. DC Power Supply, Model 6294A

MANUAL CHANGES

Model 6294A DC Power Supply
Manual HP Part No. 06294-90002

Make all corrections in the manual according to errata below, then check the following table for your power supply serial number and enter any listed change(s) in the manual.

SERIAL		MAKE CHANGES
Prefix	Number	
8H	0691 - 1130	1
ALL	-	Errata
8H	1131 - 1220	1, 2
8H	1221 - 1310	1, 2, 3
1202A	1311 - 2050	1 thru 4
1202A	2051-2565	1 thru 5
1932A	2566 - 2595	1 thru 6
1936A	2596 - up	1 thru 7

CHANGE 1:

In the Replaceable Parts Table, make the following changes:

Change "Knob, Voltage Control and Meter Switch, quantity 2, HP Part No. 3070-0084" to "Knob, Meter Switch, quantity 1, HP Part No. 3070-0084." Add "Knob, Voltage Control, quantity 1, HP Part No. 0370-0137."

ERRATA:

In Paragraph 5-60, on Page 5-15, change Step (a) to read:

"Connect power supply as shown in Figure 5-4."

In the Replaceable Parts List, make the following changes:

CR22-CR25: Change to 0.75A, 200prv, G.E.
1N5059, HP Part No. 1901-0327.

CHANGE 2:

In the replaceable parts table, make the following changes:

S1: Change to HP Part No. to 3101-1248.

Terminal Strip: Add, HP Part No. 0360-0417.

CHANGE 3:

In the replaceable parts table and on the schematic, change power transformer T1 to HP Part No. 06294-80091.

CHANGE 4:

The serial prefix of this supply has been changed to 1202A. This is the only change.

ERRATA:

Add to the parts list the replacement lamp for illuminated switch 3101-1248, which is used in those supplies that include Change 2. The HP Part No. of the type A1H lamp is 2140-0244.

In Table 1-1 and paragraph 5-32, change the output impedance specification to read: "15 milli-ohms in series with 1 microhenry."

The standard colors for this instrument are now mint gray (for front panel) and olive gray (for all other external surfaces). Option X95 designates use of the former color scheme of light gray and blue gray. Option A85 designates use of a light gray front panel with olive gray used for all other external surfaces. New part numbers are shown below.

CHANGE 5:

Add to paragraph 2-18 and to the parts list the correct fuse (F1) for Option 028 (230Vac) instruments. Fuse F1 should be a 1A slow-blow type, HP Part No. 2110-0007.

DESCRIPTION	HP PART NUMBER		
	STANDARD	OPTION A85	OPTION X95
Front Panel	06294-60004	06294-60001	←
Left Side Chassis	5060-7954	←	5060-6130
Right Side Chassis	5060-7954	←	5060-6129
Cover (2)	5000-9424	←	5000-6061
Heat Sink Assembly	5060-7967	←	5060-6128

ERRATA:

Effective January 1, 1977, Option 008 (10-turn current control) has been redesignated Option 009. Also, Options 013 (decadial for voltage control) and 014 (10-turn current control with decadial) are no longer available individually, but they are available combined into a single new option designated Option 015. Make these changes wherever Option 008, 013 or 014 is mentioned in the manual.

On page 2-1, delete the last sentence of paragraph 2-2.

The front panel binding posts have been changed to a type with better designed insulation. Delete the two types of posts listed on page 6-7 of the parts list and add: black binding post, HP Part No. 1510-0114 (qty. 2); and red binding post, HP Part No. 1510-0115 (qty. 1).

The corrugated shipping carton for this model has been changed to HP Part No. 9211-2570. Two 9220-2703 floater pads are used.

The blue-gray meter bezel has been replaced by a black one, HP Part No. 4040-0414.

►ERRATA:

For all instruments delivered on or after July 1, 1978, change the HP Part No. for fuseholder from 1400-0084 to fuseholder body 2100-0564 and fuseholder carrier 2100-0565. Change the HP Part No. for fuseholder nut from 2950-0038 to 2110-0569. If old fuseholder must be replaced for any reason, replace complete fuseholder and nut with new fuseholder parts. Do not replace new parts with old parts.

CHANGE 6

In the parts list, change the HP Part No. for the binding posts and associated hardware to the following:
Red binding post, qty 2 : 1510-0091
Terminal lug, qty 2 : 0360-0042

Nut, qty 2 : 2500-0001
Black binding post, qty 1 : 1510-0107
Terminal lug, qty 1 : 0360-1190
Nut, qty 3 : 2950-0144

► CHANGE 7

In the replaceable parts list, change Switch S1 to HP Part No. 3101-2287 and change Terminal Strip (added in Change 2) to HP Part No. 0360-0015. On the schematic diagram change Switch S1 to show two switch sections, one which breaks the AC line (as shown), the other breaks the ACC line.

8-10-79

MANUAL CHANGES

Model 6294A DC Power Supply
Manual HP Part No. 06294-90002

Make all corrections in the manual according to errata below, then check the following table for your power supply serial number and enter any listed change(s) in the manual.

SERIAL		MAKE CHANGES
Prefix	Number	
8H	0691 - 1130	1
ALL	-	Errata
8H	1131 - 1220	1, 2
8H	1221 - 1310	1, 2, 3
1202A	1311 - 2050	1 thru 4
1202A	2051-2565	1 thru 5
1932A	2566 - 2595	1 thru 6
1936A	2596 - up	1 thru 7

CHANGE 1:

In the Replaceable Parts Table, make the following changes:

Change "Knob, Voltage Control and Meter Switch, quantity 2, HP Part No. 3070-0084" to "Knob, Meter Switch, quantity 1, HP Part No. 3070-0084." Add "Knob, Voltage Control, quantity 1, HP Part No. 0370-0137."

ERRATA:

In Paragraph 5-60, on Page 5-15, change Step (a) to read:

"Connect power supply as shown in Figure 5-4."

In the Replaceable Parts List, make the following changes:

CR22-CR25: Change to 0.75A, 200prv, G. E.
1N5059, HP Part No. 1901-0327.

CHANGE 2:

In the replaceable parts table, make the following changes:

S1: Change to HP Part No. to 3101-1248.
Terminal Strip: Add, HP Part No. 0360-0417.

CHANGE 3:

In the replaceable parts table and on the schematic, change power transformer T1 to HP Part No. 06294-80091.

CHANGE 4:

The serial prefix of this supply has been changed to 1202A. This is the only change.

ERRATA:

Add to the parts list the replacement lamp for illuminated switch 3101-1248, which is used in those supplies that include Change 2. The HP Part No. of the type A1H lamp is 2140-0244.

In Table 1-1 and paragraph 5-32, change the output impedance specification to read: "15 milli-ohms in series with 1 microhenry."

The standard colors for this instrument are now mint gray (for front panel) and olive gray (for all other external surfaces). Option X95 designates use of the former color scheme of light gray and blue gray. Option A85 designates use of a light gray front panel with olive gray used for all other external surfaces. New part numbers are shown below.

CHANGE 5:

Add to paragraph 2-18 and to the parts list the correct fuse (F1) for Option 028 (230Vac) instruments. Fuse F1 should be a 1A slow-blow type, HP Part No. 2110-0007.

DESCRIPTION	HP PART NUMBER		
	STANDARD	OPTION A85	OPTION X95
Front Panel	06294-60004	06294-60001	←
Left Side Chassis	5060-7954	←	5060-6130
Right Side Chassis	5060- 7954	←	5060-6129
Cover (2)	5000-9424	←	5000-6061
Heat Sink Assembly	5060-7967	←	5060-6128

ERRATA:

Effective January 1, 1977, Option 008 (10-turn current control) has been redesignated Option 009. Also, Options 013 (decadial for voltage control) and 014 (10-turn current control with decadial) are no longer available individually, but they are available combined into a single new option designated Option 015. Make these changes wherever Option 008, 013 or 014 is mentioned in the manual.

On page 2-1, delete the last sentence of paragraph 2-2.

The front panel binding posts have been changed to a type with better designed insulation. Delete the two types of posts listed on page 6-7 of the parts list and add: black binding post, HP Part No. 1510-0114 (qty. 2); and red binding post, HP Part No. 1510-0115 (qty. 1).

The corrugated shipping carton for this model has been changed to HP Part No. 9211-2570. Two 9220-2703 floater pads are used.

The blue-gray meter bezel has been replaced by a black one, HP Part No. 4040-0414.

►ERRATA:

For all instruments delivered on or after July 1, 1978, change the HP Part No. for fuseholder from 1400-0084 to fuseholder body 2100-0564 and fuseholder carrier 2100-0565. Change the HP Part No. for fuseholder nut from 2950-0038 to 2110-0569. If old fuseholder must be replaced for any reason, replace complete fuseholder and nut with new fuseholder parts. Do not replace new parts with old parts.

— CHANGE 6

In the parts list, change the HP Part No. for the binding posts and associated hardware to the following:
Red binding post, qty 2 : 1510-0091
Terminal lug, qty 2 : 0360-0042


Nut, qty 2 : 2500-0001
Black binding post, qty 1 : 1510-0107
Terminal lug, qty 1 : 0360-1190
Nut, qty 3 : 2950-0144

► CHANGE 7

In the replaceable parts list, change Switch S1 to HP Part No. 3101-2287 and change Terminal Strip (added in Change 2) to HP Part No. 0360-0015. On the schematic diagram change Switch S1 to show two switch sections, one which breaks the AC line (as shown), the other breaks the ACC line.

8-10-79

KIT NO. 14523A RACK MOUNTING FOR TWO SUPPLIES 3 1/2" HIGH
INSTALLATION INSTRUCTIONS

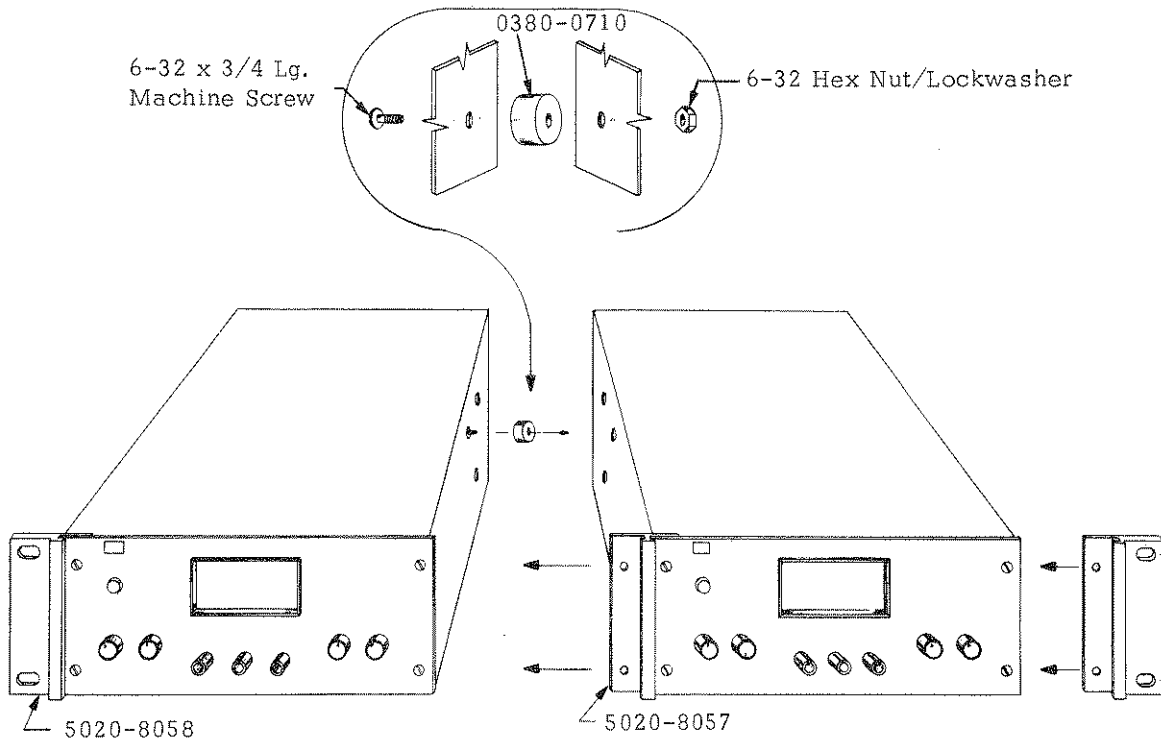

- To mount two units side-by-side, proceed as follows:
- Remove the four screws from the front panels of both units.
 - Slide rack mounting ears 5020-8058 between the front panel and case of each unit.
 - Slide combining strip 5020-8057 between the front panels and cases of the two units.
 - After fastening near portions of units together using the screw, nut, and spacer provided, replace panel screws.

HEWLETT-PACKARD

5950-5243

SECTION I
GENERAL INFORMATION

1-1 DESCRIPTION

1-2 This power supply, Figure 1-1, is completely transistorized and suitable for either bench or relay rack operation. It is a compact, well-regulated, Constant Voltage/Constant Current supply that will furnish full rated output voltage at the maximum rated output current or can be continuously adjusted throughout the output range. The front panel CURRENT controls can be used to establish the output current limit (overload or short circuit) when the supply is used as a constant voltage source and the VOLTAGE controls can be used to establish the voltage limit (ceiling) when the supply is used as a constant current source. The supply will automatically crossover from constant voltage to constant current operation and vice versa if the output current or voltage exceeds these preset limits.

1-3 The power supply has both front and rear terminals. Either the positive or negative output terminal may be grounded or the power supply can be operated floating at up to a maximum of 300 Volts off ground.

1-4 A single meter is used to measure either output voltage or output current in one of two ranges. The voltage or current ranges are selected by a METER switch on the front panel.

1-5 The programming terminals located at the rear of the unit allow ease in adapting to the many operational capabilities of the power supply. A brief description of these capabilities is given below:

a. Remote Programming. The power supply may be programmed from a remote location by means of an external voltage source or resistance.

b. Remote Sensing. The degradation in regulation which occurs at the load because of the voltage drop in the load leads can be reduced by using the power supply in the remote sensing mode of operation.

c. Series and Auto-Series Operation. Power supplies may be used in series when a higher output voltage is required in the constant voltage mode of operation or when greater voltage compliance is required in the constant current mode of operation. Auto-Series operation permits one knob control of the total output voltage from a "master" supply.

d. Parallel and Auto-Parallel Operation. The power supply may be operated in parallel with a similar unit when greater output current capability

is required. Auto-Parallel operation permits one knob control of the total output current from a "master" supply.

e. Auto-Tracking. The power supply may be used as a "master" supply, having control over one (or more) "slave" supplies that furnish various voltages for a system.

1-6 SPECIFICATIONS

1-7 Detailed specifications for the power supply are given in Table 1-1.

1-8 OPTIONS

1-9 Options are factory modifications of a standard instrument that are requested by the customer. The following options are available for the instrument covered by this manual. Where necessary, detailed coverage of the options is included throughout the manual.

<u>Option No.</u>	<u>Description</u>
07	<u>Voltage 10-Turn Potentiometer:</u> A single control that replaces both coarse and fine voltage controls and improves output settability (6281A, 6284A, and 6289A only).
08	<u>Current 10-Turn Pot:</u> A single control that replaces both coarse and fine current controls and improves output settability.
09	<u>Voltage and Current 10-Turn Pots:</u> Consists of Options 07 and 08 on the same instrument. (6281A, 6284A, and 6289A only.)
11	<u>Internal Overvoltage "Crowbar":</u> Protects delicate loads by monitoring the output voltage and firing an SCR that shorts the output when a preset trip voltage is exceeded. The circuit board is factory installed within the supply and a Crowbar Adjust control is mounted on the front panel. <u>Trip Voltage Range:</u>
	<u>6281A 6284A 6289A</u> 2.5-10V 2.5-23V 2.5-44V

<u>Option No.</u>	<u>Description</u>
11 (Continued)	<u>Trip Voltage Margin:</u> The minimum crowbar trip setting above the desired operating voltage to prevent false crowbar tripping is 4% of the output voltage setting plus 2 Volts. Refer to Appendix A for complete details.
13	<u>Three Digit Graduated Decadial Voltage Control:</u> Control that replaces voltage control permitting accurate resettability.
14	<u>Three Digit Graduated Decadial Current Control:</u> Control that replaces coarse and fine current controls permitting accurate resettability.
28	<u>Rewire for 230Vac Input:</u> Supply as normally shipped is wired for 115Vac input. Option 28 consists of reconnecting the input transformer for 230 Vac operation.

1-10 ACCESSORIES

1-11 The accessories listed in the following chart may be ordered with the power supply or separately from your local Hewlett-Packard field sales office. (Refer to list at rear of manual for addresses.)

<u>HP Part No.</u>	<u>Description</u>
C05	8" Black Handle that can be attached to side of supply.
14513A	Rack Kit for mounting one 3½"-high supply. (Refer to Section II for details.)

<u>HP Part No.</u>	<u>Description</u>
14523A	Rack Kit for mounting two 3½"-high supplies. (Refer to Section II for details.)

1-12 INSTRUMENT IDENTIFICATION

1-13 Hewlett-Packard power supplies are identified by a three-part serial number tag. The first part is the power supply model number. The second part is the serial number prefix, which consists of a number-letter combination that denotes the date of a significant design change. The number designates the year, and the letter A through L designates the month, January through December respectively. The third part is the power supply serial number.

1-14 If the serial number prefix on your power supply does not agree with the prefix on the title page of this manual, change sheets are included to update the manual. Where applicable, backdating information is given in an appendix at the rear of the manual.

1-15 ORDERING ADDITIONAL MANUALS

1-16 One manual is shipped with each power supply. Additional manuals may be purchased from your local Hewlett-Packard field office (see list at rear of this manual for addresses). Specify the model number, serial number prefix, and HP part number provided on the title page.

Table 1-1. Specifications

<p>INPUT: 115Vac \pm10%, single phase, 48-440Hz.</p> <p>OUTPUT: 0-60 Volts @ 1 Ampere.</p> <p>LOAD REGULATION: <u>Constant Voltage</u> - Less than 0.01% plus 2mV for a full load to no load change in output current. <u>Constant Current</u> - Less than 0.01% plus 250μA for a zero to maximum change in output voltage.</p> <p>LINE REGULATION: <u>Constant Voltage</u> - Less than 0.01% plus 2mV for any line voltage change within the input rating. <u>Constant Current</u> - Less than 0.01% plus 250μA for any line voltage change within the input rating.</p> <p>RIPPLE AND NOISE: <u>Constant Voltage</u> - Less than 200μVrms/1mV p-p. <u>Constant Current</u> - Less than 500μArms.</p> <p>TEMPERATURE RANGES: Operating: 0 to 50°C. Storage: -20 to +85°C.</p> <p>TEMPERATURE COEFFICIENT: <u>Constant Voltage</u> - Less than 0.02% plus 500μV per degree Centigrade. <u>Constant Current</u> - Less than 0.02% plus .5mA per degree Centigrade.</p> <p>STABILITY: <u>Constant Voltage</u> - Less than 0.10% plus 2.5mV total drift for 8 hours after an initial warm-up time of 30 minutes at constant ambient, constant line voltage, and constant load. <u>Constant Current</u> - Less than 0.10% plus 2.5mA total drift for 8 hours after an initial warm-up time of 30 minutes at constant ambient, constant line voltage, and constant load.</p> <p>INTERNAL IMPEDANCE AS A CONSTANT VOLTAGE SOURCE: 8 milliohms in series with 1μh.</p> <p>TRANSIENT RECOVERY TIME: Less than 50μsec for output recovery to within 15mV following a full load current change in the output.</p> <p>OVERLOAD PROTECTION: A continuously acting constant current circuit protects the power supply for all overloads including a direct short placed across the terminals in constant voltage operation. The constant voltage</p>	<p>circuit limits the output voltage in the constant current mode of operation.</p> <p>METER: The front panel meter can be used as either a 0-70 or 0-7 Volt voltmeter or as a 0-1.2 or 0-0.12 Ampere ammeter. Accuracy is 3%.</p> <p>OUTPUT CONTROLS: Ten-turn voltage control and coarse and fine current controls set desired output voltage or current.</p> <p>OUTPUT TERMINALS: Three "five-way" output posts are provided on the front panel and an output terminal strip is located on the rear of the chassis. All power supply output terminals are isolated from the chassis and either the positive or negative terminal may be connected to the chassis through a separate ground terminal located on output terminal strip.</p> <p>ERROR SENSING: Error sensing is normally accomplished at the front terminals if the load is attached to the front or at the rear terminals if the load is attached to the rear terminals. Also, provision is included on the rear terminal strip for remote sensing.</p> <p>REMOTE RESISTANCE PROGRAMMING: Remote programming of the supply output at approximately 300 ohms per Volt in constant voltage is made available at the rear terminals. In constant current mode of operation, the current can be remotely programmed at approximately 1000 ohms per Ampere.</p> <p>COOLING: Convection cooling is employed. The supply has no moving parts.</p> <p>SIZE: 3$\frac{1}{2}$" H x 14$\frac{1}{2}$" D x 8$\frac{1}{2}$" W. Two of the units can be mounted side by side in a standard 19" relay rack.</p> <p>WEIGHT: 14 lbs. net, 19 lbs. shipping.</p> <p>FINISH: Light gray front panel with dark gray case.</p> <p>POWER CORD: A three-wire, five-foot power cord is provided with each unit.</p>
--	---

SECTION II INSTALLATION

2-1 INITIAL INSPECTION

2-2 Before shipment, this instrument was inspected and found to be free of mechanical and electrical defects. As soon as the instrument is unpacked, inspect for any damage that may have occurred in transit. Save all packing materials until the inspection is completed. If damage is found, proceed as described in the Claim for Damage in Shipment section of the warranty page at the rear of this manual.

2-3 MECHANICAL CHECK

2-4 This check should confirm that there are no broken knobs or connectors, that the cabinet and panel surfaces are free of dents and scratches, and that the meter is not scratched or cracked.

2-5 ELECTRICAL CHECK

2-6 The instrument should be checked against its electrical specifications. Section V includes an

"in-cabinet" performance check to verify proper instrument operation.

2-7 INSTALLATION DATA

2-8 The instrument is shipped ready for bench operation. It is necessary only to connect the instrument to a source of power and it is ready for operation.

2-9 LOCATION

2-10 This instrument is air cooled. Sufficient space should be allotted so that a free flow of cooling air can reach the sides and rear of the instrument when it is in operation. It should be used in an area where the ambient temperature does not exceed 50°C.

2-11 RACK MOUNTING

2-12 This instrument may be rack mounted in a standard 19" rack panel either alongside a similar

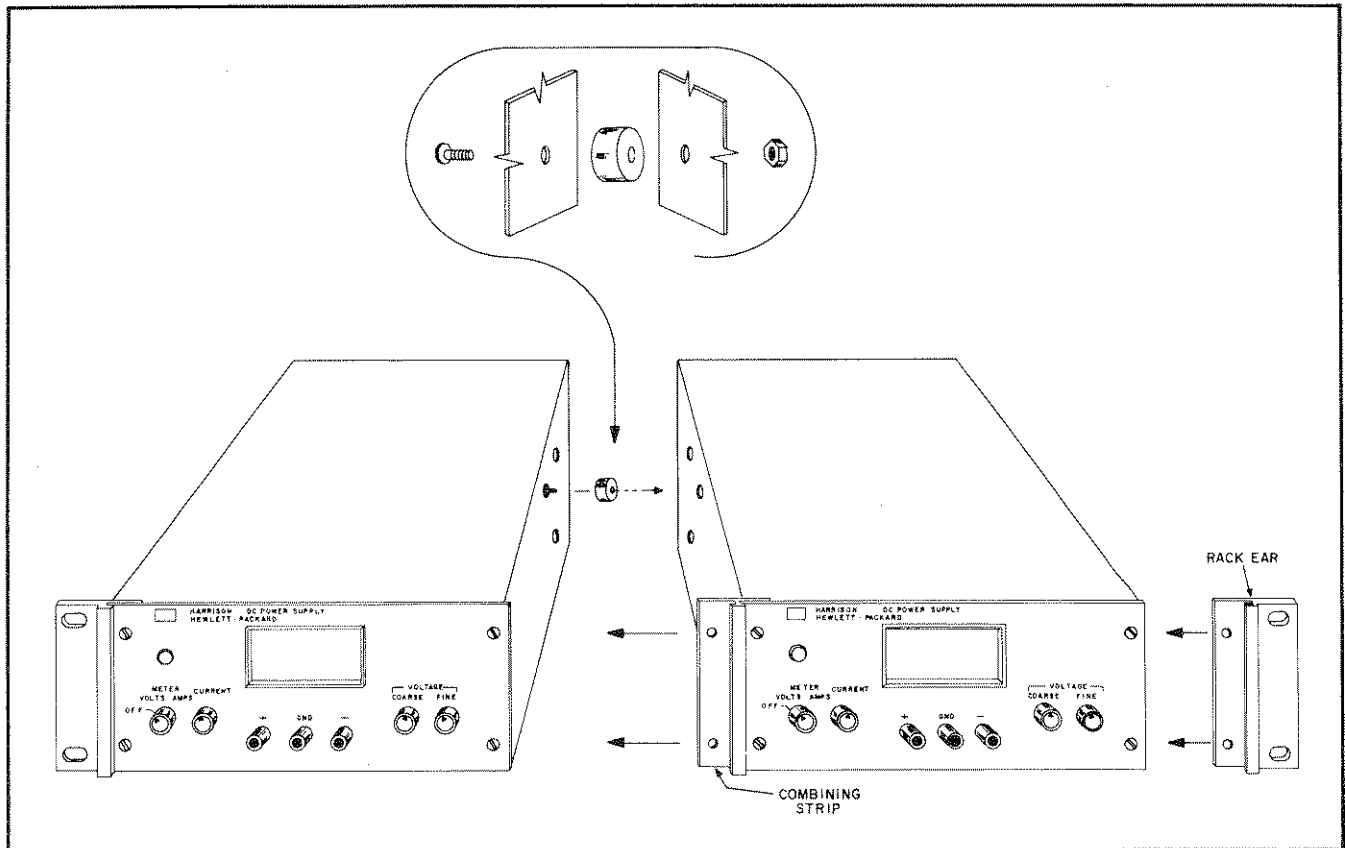


Figure 2-1. Rack Mounting, Two Units

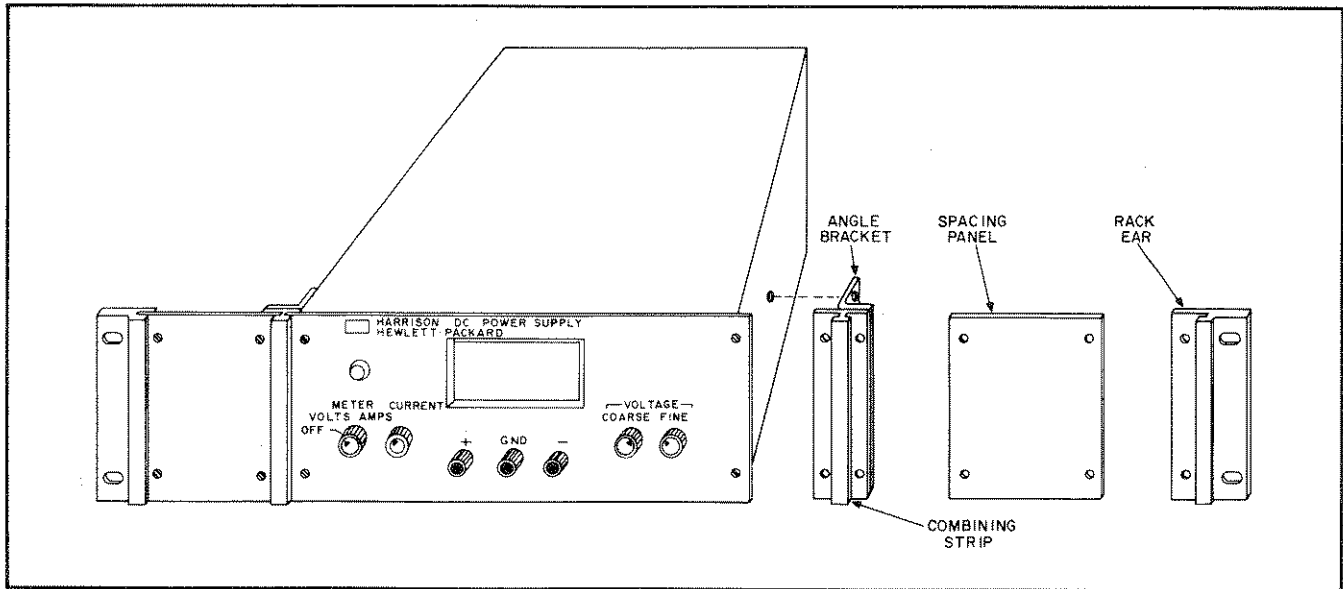


Figure 2-2. Rack Mounting, One Unit

unit or by itself. Figures 2-1 and 2-2 show how both types of installations are accomplished.

2-13 To mount two units side-by-side, proceed as follows:

- a. Remove the four screws from the front panels of both units.
- b. Slide rack mounting ears between the front panel and case of each unit.
- c. Slide combining strip between the front panels and cases of the two units.
- d. After fastening rear portions of units together using the bolt, nut, and spacer, replace panel screws.

2-14 To mount a single unit in the rack panel, proceed as follows:

- a. Bolt rack mounting ears, combining straps, and angle brackets to each side of center spacing panels. Angle brackets are placed behind combining straps as shown in Figure 2-2.
- b. Remove four screws from front panel of unit.
- c. Slide combining strips between front panel and case of unit.
- d. Bolt angle brackets to front sides of case and replace front panel screws.

2-15 INPUT POWER REQUIREMENTS

2-16 This power supply may be operated from either a nominal 115V or 230V, 48-440Hz power source. The unit, as shipped from the factory, is wired for 115V operation. The input power required when operated from a 115V 60Hz power source at full load is:

<u>6281A, 6289A, 6294A</u>	<u>6284A</u>
118W, 1.5A	135W, 1.5A

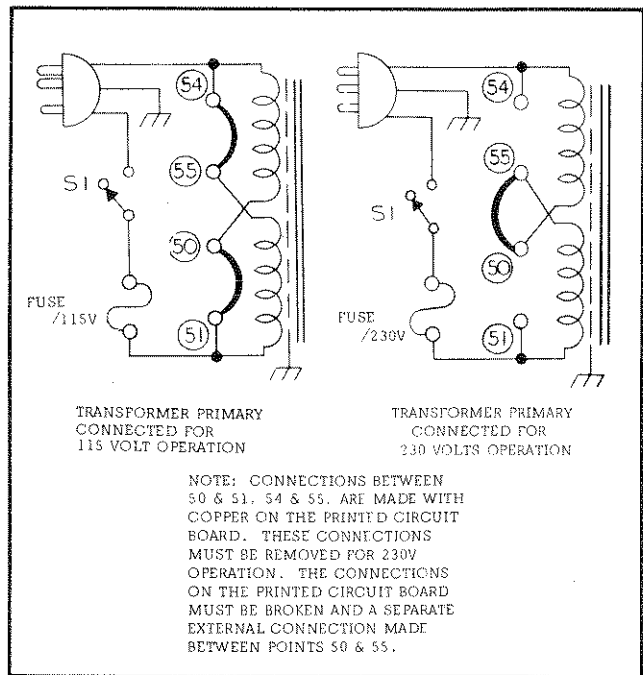


Figure 2-3. Primary Connections

2-17 CONNECTIONS FOR 230 VOLT OPERATION
(See Figure 2-3)

2-18 Normally, the two primary windings of the input transformer are connected in parallel for operation from 115 Volt source. To convert the power supply to operation from a 230 Volt source, the power transformer windings are connected in series as follows:

- a. Unplug the line cord and remove the unit from case.
- b. Break the copper between 54 and 55 and also between 50 and 51 on the printed circuit board. These are shown in Figure 2-3, and are labeled on copper side of printed circuit board.
- c. Add strap between 50 and 55.
- d. Replace existing fuse with 1 Ampere, 230 Volt fuse. Return unit to case and operate normally.

2-19 POWER CABLE

2-20 To protect operating personnel, the National Electrical Manufacturers' Association (NEMA) recommends that the instrument panel and cabinet be grounded. This instrument is equipped with a three conductor power cable. The third conductor is the ground conductor and when the cable is plugged into an appropriate receptacle, the instrument is grounded. The offset pin on the power cable three-

prong connector is the ground connection.

2-21 To preserve the protection feature when operating the instrument from a two-contact outlet, use a three-prong to two-prong adapter and connect the green lead on the adapter to ground.

2-22 REPACKAGING FOR SHIPMENT

2-23 To insure safe shipment of the instrument, it is recommended that the package designed for the instrument be used. The original packaging material is reusable. If it is not available, contact your local Hewlett-Packard field office to obtain the materials. This office will also furnish the address of the nearest service office to which the instrument can be shipped. Be sure to attach a tag to the instrument which specifies the owner, model number, full serial number, and service required, or a brief description of the trouble.

SECTION III
OPERATING INSTRUCTIONS

3-1 OPERATING CONTROLS AND INDICATORS

3-2 The front panel controls and indicators, together with the normal turn-on sequence, are shown in Figure 3-1.

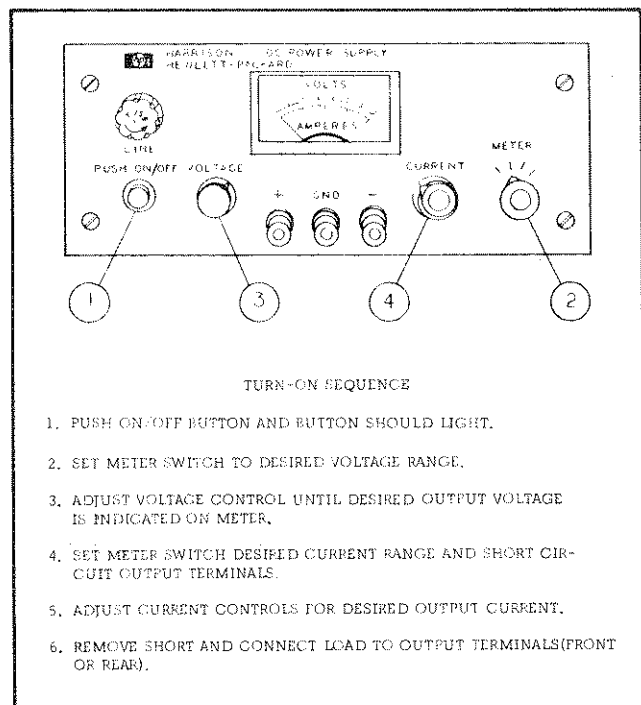


Figure 3-1. Front Panel Controls and Indicators

3-3 OPERATING MODES

3-4 The power supply is designed so that its mode of operation can be selected by making strapping connections between particular terminals on the terminal strip at the rear of the power supply. The terminal designations are stenciled in white on the power supply above their respective terminals. Although the strapping patterns illustrated in this section show the positive terminal grounded, the operator can ground either terminal or operate the power supply up to 300Vdc off ground (floating). The following paragraphs describe the procedures for utilizing the various operational capabilities of the power supply. A more theoretical description concerning the operational features of this supply is contained in Application Note 90, DC Power Supply Handbook, which may be obtained from your local Hewlett-Packard field sales office.

3-5 NORMAL OPERATING MODE

3-6 The power supply is normally shipped with its rear terminal strapping connections arranged for Constant Voltage/Constant Current, local sensing, local programming, single unit mode of operation. This strapping pattern is illustrated in Figure 3-2. The operator selects either a constant voltage or a constant current output using the front panel controls (local programming, no strapping changes are necessary).

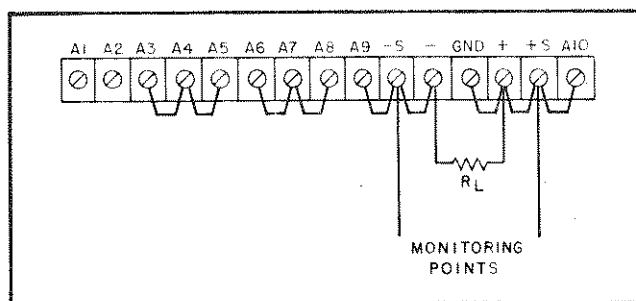


Figure 3-2. Normal Strapping Pattern

3-7 CONSTANT VOLTAGE

3-8 To select a constant voltage output, proceed as follows:

- a. Turn-on power supply and adjust VOLTAGE controls for desired output voltage (output terminals open).
- b. Short output terminals and adjust CURRENT controls for maximum output current allowable (current limit), as determined by load conditions. If a load change causes the current limit to be exceeded, the power supply will automatically cross-over to constant current output at the preset current limit and the output voltage will drop proportionately. In setting the current limit, allowance must be made for high peak current which can cause unwanted cross-over. (Refer to Paragraph 3-46.)

3-9 CONSTANT CURRENT

3-10 To select a constant current output, proceed as follows:

- a. Short output terminals and adjust CURRENT controls for desired output current.
- b. Open output terminals and adjust VOLTAGE controls for maximum output voltage allowable (voltage limit), as determined by load conditions. If a

load change causes the voltage limit to be exceeded, the power supply will automatically crossover to constant voltage output at the preset voltage limit and the output current will drop proportionately. In setting the voltage limit, allowance must be made for high peak voltages which can cause unwanted crossover. (Refer to Paragraph 3-46.)

3-11 CONNECTING LOAD

3-12 Each load should be connected to the power supply output terminals using separate pairs of connecting wires. This will minimize mutual coupling effects between loads and will retain full advantage of the low output impedance of the power supply. Each pair of connecting wires should be as short as possible and twisted or shielded to reduce noise pickup. (If shield is used, connect one end to power supply ground terminal and leave the other end unconnected.)

3-13 If load considerations require that the output power distribution terminals be remotely located from the power supply, then the power supply output terminals should be connected to the remote distribution terminals via a pair of twisted or shielded wires and each load separately connected to the remote distribution terminals. For this case, remote sensing should be used (Paragraph 3-20).

3-14 OPERATION OF SUPPLY BEYOND RATED OUTPUT

3-15 The shaded area on the front panel meter face indicates the amount of output voltage or current that is available in excess of the normal rated output. Although the supply can be operated in this shaded region without being damaged, it cannot be guaranteed to meet all of its performance specifications. However, if the line voltage is maintained above 115 Vac, the supply will probably operate within its specifications.

3-16 OPTIONAL OPERATING MODES

3-17 REMOTE PROGRAMMING, CONSTANT VOLTAGE

3-18 The constant voltage output of the power supply can be programmed (controlled) from a remote location if required. Either a resistance or voltage source can be used for the programming device. The wires connecting the programming terminals of the supply to the remote programming device should be twisted or shielded to reduce noise pick-up. The VOLTAGE controls on the front panel are disabled according to the following procedures.

3-19 Resistance Programming (Figure 3-3). In this mode, the output voltage will vary at a rate determined by the programming coefficient (200 ohms per Volt for Models 6253A, 6255A, 6281A, 6284A, and 6289A or 300 ohms per Volt for Models 6294A and

6299A). The output voltage will increase 1 Volt for each 200 ohms (or 300 ohms) added in series with the programming terminals. The programming coefficient is determined by the programming current. This current is factory adjusted to within 2% of 5mA for Models 6253A, 6255A, 6281A, 6284A, and 6289A or 2% of 3.3mA for Models 6294A and 6299A. If greater programming accuracy is required, it may be achieved by changing resistor R13.

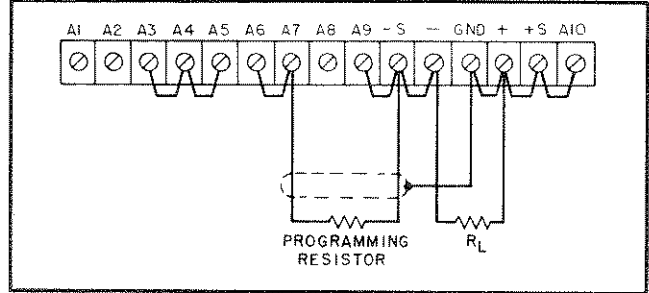


Figure 3-3. Remote Resistance Programming (Constant Voltage)

3-20 The output voltage of the power supply should be zero Volts ± 20 millivolts when zero ohms is connected across the programming terminals. If a zero ohm voltage closer than this is required, it may be achieved by changing resistor R6 or R8 as described in Paragraph 5-59.

3-21 To maintain the stability and temperature coefficient of the power supply, use programming resistors that have stable, low noise, and low temperature (less than 30 ppm per degree Centigrade) characteristics. A switch can be used in conjunction with various resistance values in order to obtain discrete output voltages. The switch should have make-before-break contacts to avoid momentarily opening the programming terminals during the switching interval.

3-22 Voltage Programming (Figure 3-4). Employ the strapping pattern shown on Figure 3-4 for

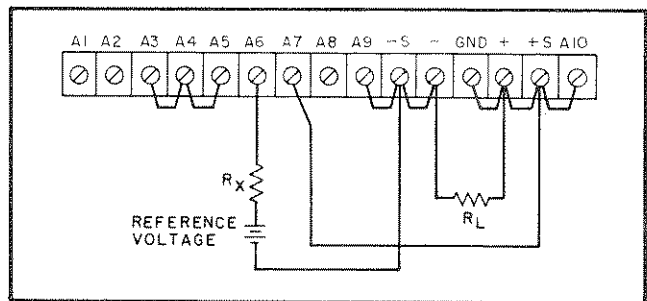


Figure 3-4. Remote Voltage Programming (Constant Voltage)

voltage programming. In this mode, the output voltage will vary in a 1 to 1 ratio with the programming voltage (reference voltage) and the load on the programming voltage source will not exceed 25mA.

3-23 The impedance matching resistor (R_X) for the programming voltage source should be approximately 500 ohms to maintain the temperature and stability specifications of the power supply.

3-24 REMOTE PROGRAMMING, CONSTANT CURRENT

3-25 Either a resistance or a voltage source can be used to control the constant current output of the supply. The CURRENT controls on the front panel are disabled according to the following procedures.

3-26 Resistance Programming (Figure 3-5). In this mode, the output current varies at a rate determined by the programming coefficient — 200 ohms per Amp for Model 6281A, 500 ohms per Ampere for Models 6253A, 6255A, 6284A, and 6289A, and 1000 ohms per Ampere for Models 6294A and 6299A. The programming coefficient is determined by the Constant Current programming current (2mA for Models 6253A, 6255A, 6284A, and 6289A, 5mA for Model 6281A, 1mA for Model 6294A and 1.33mA for Model 6299A). This current is adjusted to within 10% at the factory. If greater programming accuracy is required, it may be achieved by changing resistor R19 as outlined in Section V.

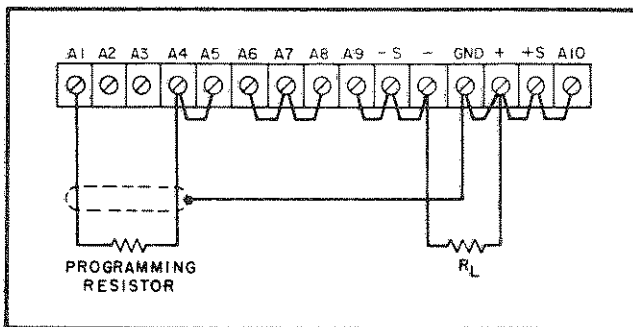


Figure 3-5. Remote Resistance Programming (Constant Current)

3-27 Use stable, low noise, low temperature coefficient (less than 30ppm/°C) programming resistors to maintain the power supply temperature coefficient and stability specifications. A switch may be used to set discrete values of output current. A make-before-break type of switch should be used since the output current will exceed the maximum rating of the power supply if the switch contacts open during the switching interval.

CAUTION

If the programming terminals (A1 and A5) should open at any time during this mode, the output current will rise to a value that may damage the power supply and/or the load. To avoid this possibility, connect a resistor across the programming terminals having the value listed below. Like the programming resistor, this resistor should be of the low noise, low temperature coefficient type.

Model	6253A, 6284A	6255A, 6289A, 6299A
Resistance	1.5K Ω	750 Ω
Model	6281A, 6294A	
Resistance	1K Ω	

3-28 Voltage Programming (Figure 3-6). In this mode, the output current will vary linearly with changes in the programming voltage. The programming voltage should not exceed 1.2 Volts. Voltage in excess of 1.2 Volts will result in excessive power dissipation in the instrument and possible damage.

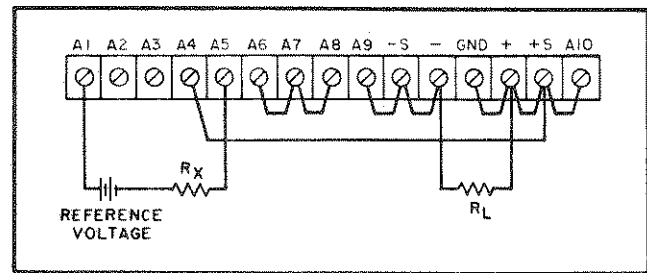


Figure 3-6. Remote Voltage Programming (Constant Current)

3-29 The output current will be the programming voltage divided by 1 ohm. The current required from the voltage source will be less than 25 microamperes. The impedance matching resistor (R_X) should be approximately 500 ohms if the temperature coefficient and stability specifications of the power supply are to be maintained.

3-30 REMOTE SENSING (See Figure 3-7)

3-31 Remote sensing is used to maintain good regulation at the load and reduce the degradation of regulation which would occur due to the voltage drop in the leads between the power supply and the load. Remote sensing is accomplished by utilizing the strapping pattern shown in Figure 3-7. The power supply should be turned off before changing strap-

ping patterns. The leads from the +S terminals to the load will carry less than 10mA of current, and it is not required that these leads be as heavy as the load leads. However, they must be twisted or shielded to minimize noise pick-up.

CAUTION

Observe polarity when connecting the sensing leads to the load.

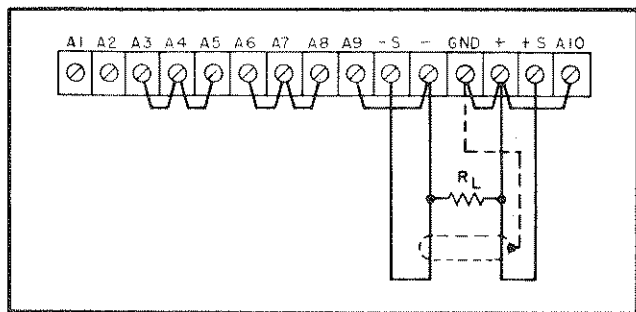


Figure 3-7. Remote Sensing

3-32 Note that it is desirable to minimize the drop in the load leads and it is recommended that the drop not exceed 1 Volt per lead if the power supply is to meet its dc specifications. If a larger drop must be tolerated, please consult a Hewlett-Packard field representative.

NOTE

Due to the voltage drop in the load leads, it may be necessary to readjust the current limit in the remote sensing mode.

3-33 The procedure just described will result in a low dc output impedance at the load. If a low ac impedance is required, it is recommended that the following precautions be taken:

- a. Disconnect output capacitor C20 by disconnecting the strap between A9 and -S.
- b. Connect a capacitor having similar characteristics (approximately same capacitance, same voltage rating or greater, and having good high frequency characteristics) across the load using short leads.

3-34 Although the strapping patterns shown in Figures 3-3 through 3-6 employ local sensing, note that it is possible to operate a power supply simultaneously in the remote sensing and Constant Voltage/Constant Current remote programming modes.

3-35 SERIES OPERATION

3-36 Normal Series Connections (Figure 3-8). Two

or more power supplies can be operated in series to obtain a higher voltage than that available from a single supply. When this connection is used, the output voltage is the sum of the voltages of the individual supplies. Each of the individual supplies must be adjusted in order to obtain the total output voltage. The power supply contains a protective diode connected internally across the output which protects the supply if one power supply is turned off while its series partner(s) is on.

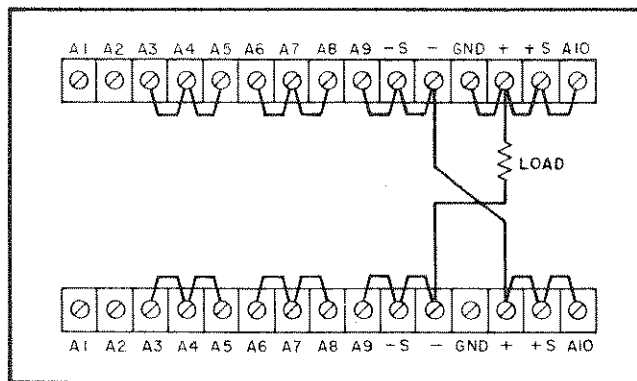


Figure 3-8. Normal Series Connections

3-37 Auto-Series Connections (Figure 3-9). The Auto-Series configuration is used when it is desirable to have the output voltage of each of the series connected supplies vary in accordance with the setting of a control unit. The control unit is called the master; the controlled units are called slaves. At maximum output voltage, the voltage of the slaves is determined by the setting of the front panel VOLTAGE control on the master. The master supply must be the most positive supply of the series. The output CURRENT controls of all series units are operative and the current limit is equal to the lowest control setting. If any output CURRENT controls are set too low, automatic crossover to constant current operation will occur and the output voltage will drop. Remote sensing and programming can be used; however, the strapping arrangements shown in the applicable figures show local sensing and programming.

3-38 In order to maintain the temperature coefficient and stability specifications of the power supply, the external resistors (Rx) shown in Figure 3-9 should be stable, low noise, low temperature coefficient (less than 30 ppm per degree Centigrade) resistors. The value of each resistor is dependant on the maximum voltage rating of the "master" supply. The value of Rx is this voltage divided by the voltage programming current of the slave supply (1/Kp where Kp is the voltage programming coefficient). The voltage contribution of the slave is determined by its voltage control setting.

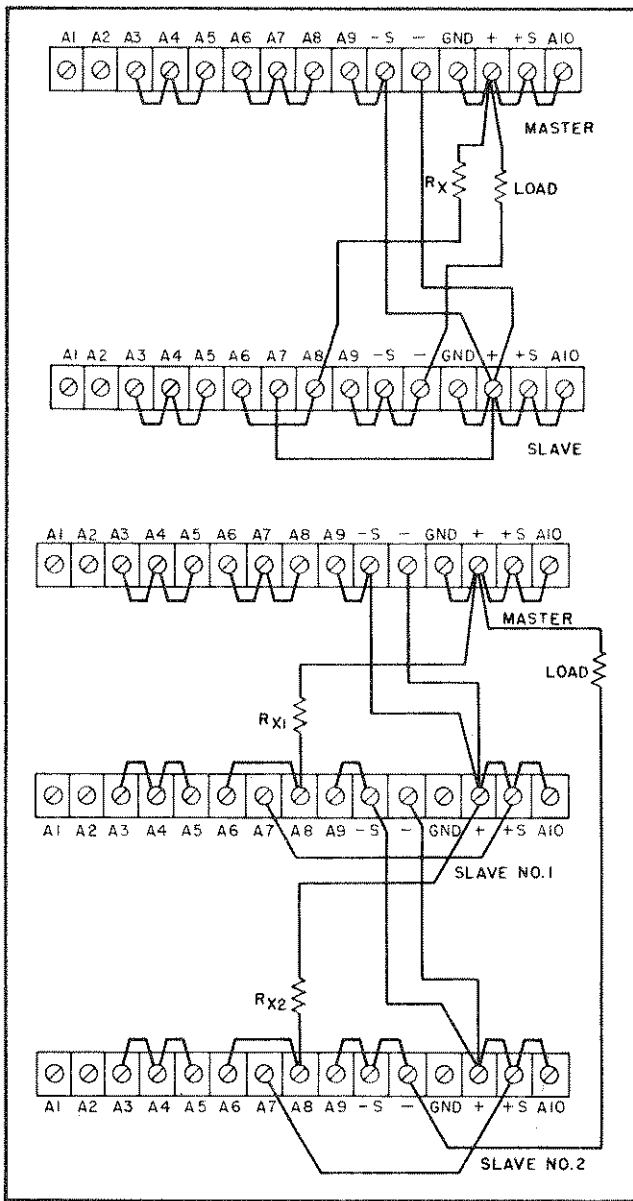


Figure 3-9. Auto-Series, Two and Three Units

3-39 PARALLEL OPERATION

3-40 Normal Parallel Connections (Figure 3-10). Two or more power supplies can be connected in parallel to obtain a total output current greater than that available from one power supply. The total output current is the sum of the output currents of the individual power supplies. The output CURRENT controls of each power supply can be separately set. The output voltage controls of one power supply should be set to the desired output voltage; the other power supply should be set for a slightly larger output voltage. The supply set to the lower output voltage will act as a constant voltage source; the supply set to the higher output will act as a constant current source, dropping its output

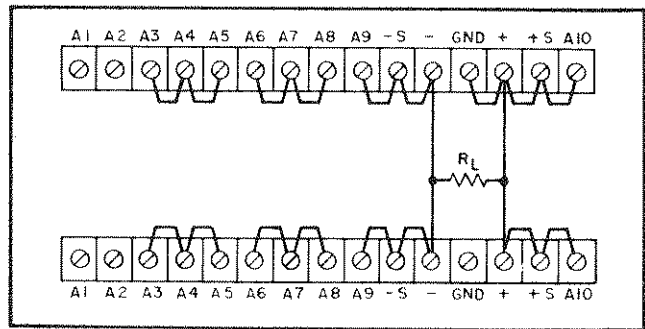


Figure 3-10. Normal Parallel Connections

voltage until it equals that of the other supply. The constant voltage source will deliver only that fraction of its total rated output current which is necessary to fulfill the total current demand.

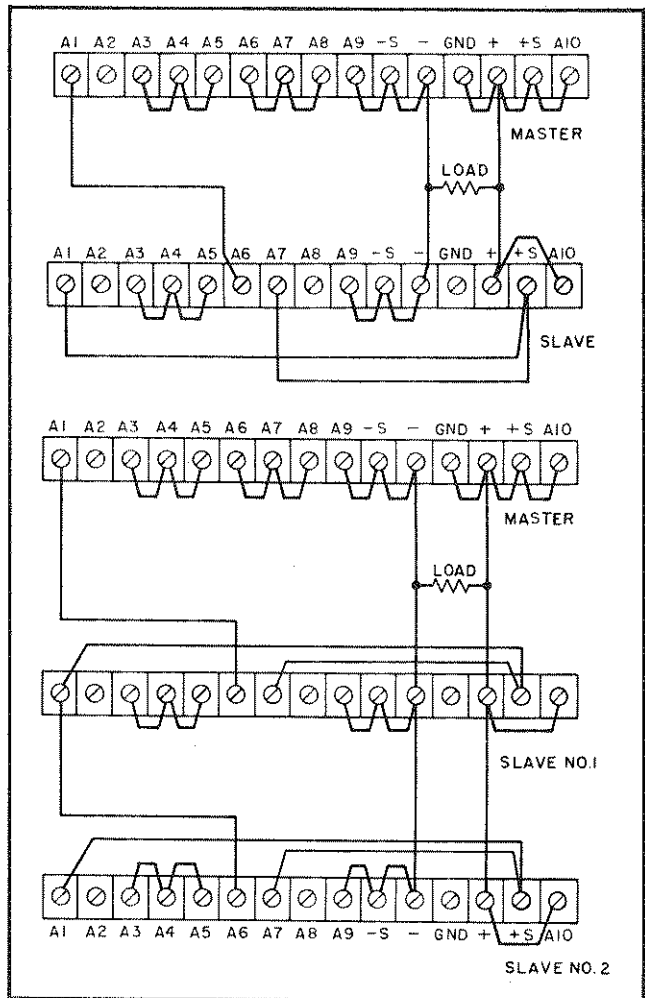


Figure 3-11. Auto-Parallel, Two and Three Units

3-41 Auto-Parallel. The strapping patterns for Auto-Parallel operation of two power supplies are shown in Figure 3-11. Auto-Parallel operation permits equal current sharing under all load con-

ditions, and allows complete control of output current from one master power supply. The output current of each slave will be approximately equal to the master's regardless of the load conditions. Because the output current controls of each slave are operative, they should be set to maximum to avoid having the slave revert to constant current operation; this would occur if the master output current setting exceeded the slave's.

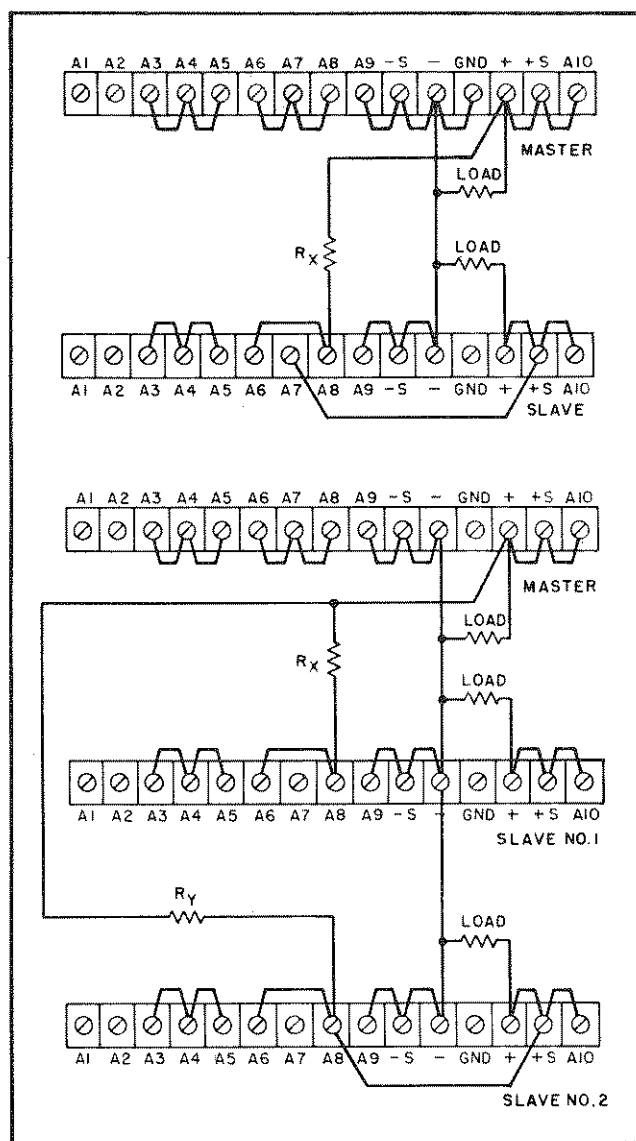


Figure 3-12. Auto-Tracking, Two and Three Units

3-42 AUTO-TRACKING OPERATION (See Figure 3-12)

3-43 The Auto-Tracking configuration is used when it is necessary that several different voltages referred to a common bus, vary in proportion to the setting of a particular instrument (the control or

master). A fraction of the master's output voltage is fed to the comparison amplifier of the slave supply, thus controlling the slave's output. The master must have the largest output voltage of any power supply in the group (must be the most positive supply in the example shown on Figure 3-12).

3-44 The output voltage of the slave is a percentage of the master's output voltage, and is determined by the voltage divider consisting of R_X (or R_X and R_Y) and the voltage control of the slave supply, R_p , where: $E_S = E_M R_p / R_X + R_p$. Turn-on and turn-off of the power supplies is controlled by the master. Remote sensing and programming can be used; although the strapping patterns for these modes show only local sensing and programming. In order to maintain the temperature coefficient and stability specifications of the power supply, the external resistors should be stable, low noise, low temperature (less than 30ppm per °C) resistors.

3-45 SPECIAL OPERATING CONSIDERATIONS

3-46 PULSE LOADING

3-47 The power supply will automatically crossover from constant voltage to constant current operation, or the reverse, in response to an increase (over the preset limit) in the output current or voltage, respectively. Although the preset limit may be set higher than the average output current or voltage, high peak currents or voltages (as occur in pulse loading) may exceed the preset limit and cause crossover to occur. If this crossover limiting is not desired, set the preset limit for the peak requirement and not the average.

3-48 OUTPUT CAPACITANCE

3-49 An internal capacitor, connected across the output terminals of the power supply, helps to supply high-current pulses of short duration during constant voltage operation. Any capacitance added externally will improve the pulse current capability, but will decrease the safety provided by the constant current circuit. A high-current pulse may damage load components before the average output current is large enough to cause the constant current circuit to operate.

3-50 The effects of the output capacitor during constant current operation are as follows:

- The output impedance of the power supply decreases with increasing frequency.
- The recovery time of the output voltage is longer for load resistance changes.
- A large surge current causing a high power dissipation in the load occurs when the load resistance is reduced rapidly.

3-51 REVERSE VOLTAGE LOADING

3-52 A diode is connected across the output terminals. Under normal operating conditions, the diode is reverse biased (anode connected to negative terminal). If a reverse voltage is applied to the output terminals (positive voltage applied to negative terminal), the diode will conduct, shunting current across the output terminals and limiting the voltage to the forward voltage drop of the diode. This diode protects the series transistors and the output electrolytic capacitor.

3-53 REVERSE CURRENT LOADING

3-54 Active loads connected to the power supply may actually deliver a reverse current to the power supply during a portion of its operating cycle. An external source cannot be allowed to pump current into the supply without loss of regulation and possible damage to the output capacitor. To avoid these effects, it is necessary to preload the supply with a dummy load resistor so that the power supply delivers current through the entire operating cycle of the load device.

SECTION IV
PRINCIPLES OF OPERATION

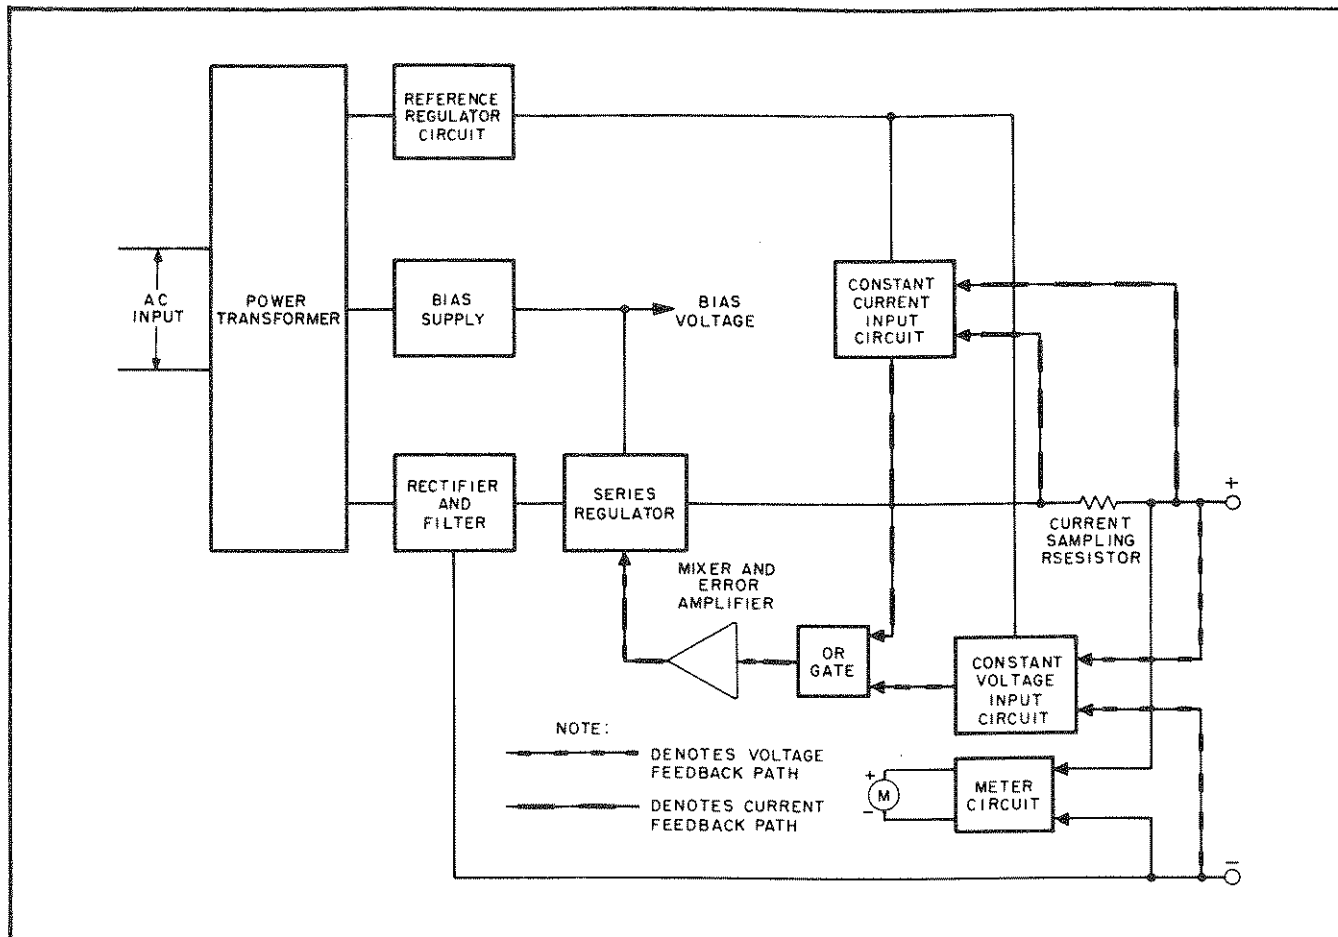


Figure 4-1. Overall Block Diagram

4-1 OVERALL BLOCK DIAGRAM DISCUSSION

4-2 The power supply, as shown on the overall block diagram on Figure 4-1, consists of a power transformer, a rectifier and filter, a series regulator, the mixer and driver amplifiers, an "OR" gate, a constant voltage input circuit, a constant current input circuit, a reference regulator circuit, a bias supply, and a metering circuit.

4-3 The input line voltage passes through the power transformer to the rectifier and filter. The rectifier-filter converts the ac input to raw dc which is fed to the positive terminal via the regulator and current sampling resistor network. The regulator, part of the feedback loop, is made to alter its conduction to maintain a constant output voltage or

current. The voltage developed across the sampling resistor network is the input to the constant current input circuit. The constant voltage input circuit obtains its input by sampling the output voltage of the supply.

4-4 Any changes in output voltage/current are detected in the constant voltage/constant current input circuit, amplified by the mixer and driver amplifiers, and applied to the series regulator in the correct phase and amplitude to counteract the change in output voltage/output current.

4-5 Since the constant voltage input circuit tends to achieve zero output impedance and alters the output current whenever the load resistance changes, while the constant current input circuit causes the

connected in a manner which minimizes the power dissipated in series transistor Q6. The bias voltage for Q7 is developed across CR12 and CR13. The conduction of Q7 will decrease as the collector-to-emitter voltage of Q6 approaches the voltage developed across the biasing diodes. At low output voltages Q7 is completely cutoff and all of the load current flows through the shunt resistors. The voltage that is dropped across Q7 and the shunt resistors reduces the voltage dropped across Q6, thus diminishing its power dissipation. The reliability of the regulator is further increased by mounting the shunt resistors outside the rear of the cabinet so that the internal components are operated under lower temperature conditions. Diode CR11, connected across Q6, protects it from reverse voltages that could develop across it during parallel or auto-parallel operation if one supply is turned on before the other. Diodes CR18 and CR19 perform a similar function for Q7.

4-16 CONSTANT VOLTAGE INPUT CIRCUIT

4-17 The circuit consists of VOLTAGE control R10 and a differential amplifier stage (Q1 and associated components). Transistor Q1 consists of two transistors housed in a single package. The transistors have matched characteristics minimizing differential voltages due to mismatched stages. Moreover, drift due to thermal differentials is minimized, since both transistors operate at essentially the same temperature.

4-18 The constant voltage input circuit continuously compares a fixed reference voltage with a portion of the output voltage and, if a difference exists, produces an error voltage whose amplitude and phase is proportional to the difference. The error output is fed back to the series regulator, through an OR gate and the mixer/error amplifiers. The error voltage changes the conduction of the series regulator, which, in turn, alters the output voltage so that the difference between the two input voltages applied to the differential amplifier is reduced to zero. The above action maintains the output voltage constant.

4-19 Stage Q1B of the differential amplifier is connected to a common (+S) potential through impedance equalizing resistor R5. Resistors R6 and R8 are used to zero bias the input stage, offsetting minor base-to-emitter voltage differences in Q1. The base of Q1A is connected to a summing point at the junction of R10 and R12, R13. Instantaneous changes in output voltage result in an increase or decrease in the summing point potential. Q1A is then made to conduct more or less, in accordance with the summing point voltage change. The resultant output error voltage is fed back to the series regulator via OR-gate diode CR3 and the remaining components of the feedback loop. Resistor R1, in series with the base of Q1A, limits the current through the programming

resistor during rapid voltage turn-down. Diodes CR1 and CR2 form a limiting network which prevent excessive voltage excursions from over driving stage Q1A. Capacitors C1 and C2, shunting the programming resistors, increase the high frequency gain of the input amplifier. Pullout resistor R13, shunting resistor R12, serves as a trimming adjustment for the programming current that flows through the voltage control from the +6.2 Volt reference source. R13 is factory selected so that all of the +6.2 Volt reference is dropped across R12 and R13. This keeps the programming current constant, thus assuring linear constant voltage programming.

4-20 Main output capacitor C20, connected across the output of the supply, stabilizes the feedback loop when the normal strapping pattern shown on the schematic is employed. Note that C20 can be removed to avoid output current surges or to increase the programming speed of the supply. With C20 removed, capacitor C19 serves to maintain loop stability.

4-21 CONSTANT CURRENT INPUT CIRCUIT

4-22 This circuit is similar in appearance and operation to the constant voltage input circuit. It consists basically of the current programming resistors R16A and B, and a differential amplifier stage (Q2 and associated components). Like transistor Q1 in the voltage input circuit, Q2 consists of two transistors, having matched characteristics, that are housed in a single package.

4-23 The constant current input circuit continuously compares a fixed reference voltage with the voltage drop across the current sampling resistor, R54. If a difference exists, the differential amplifier produces an error voltage which is proportional to this difference. The remaining components in the feedback loop (amplifiers and series regulator) function to maintain the drop across the current sampling resistor, and consequently the output current, at a constant value.

4-24 Stage Q2B is connected to a common (+S) potential through impedance equalizing resistor R26. Resistors R25 and R28 are used to zero bias the input stage, offsetting minor base-to-emitter voltage differences in Q2. Instantaneous changes in output current on the positive line are felt at the current summing point and, hence, the base of Q2A. Stage Q2A varies its conduction in accordance with the polarity of the change at the summing point. The change in Q2A's conduction also varies the conduction of Q2B due to the coupling effects of the common emitter resistor, R22. The error voltage is taken from the collector of Q2B and fed back to the series regulator through OR-gate diode CR4 and the remaining components of the feedback loop. The error voltage then varies the conduction of the regulator so

that the output current is maintained at the proper level.

4-25 Resistor R20, in conjunction with R21 and C3 helps stabilize the feedback loop. Diode CR5 limits voltage excursions on the base of Q2A. Resistor R19, shunting the pullout resistor, serves as a trimming adjustment for the programming current flowing through R16.

4-26 VOLTAGE CLAMP CIRCUIT

4-27 The voltage clamp circuit keeps the constant voltage programming current relatively constant when the power supply is operating in the constant current mode. This is accomplished by clamping terminal A6, the voltage summing point, to a fixed bias voltage. During constant current operation the constant voltage programming resistor is a shunt load across the output terminals of the power supply. When the output voltage changes, the current through this control also tends to change. Since this programming current flows through the current sampling resistor, it is erroneously interpreted as a load change by the current input circuit. The clamp circuit eliminates this undesirable effect by maintaining this programming current constant.

4-28 The voltage divider, R51, R52, and CR31, back biases CR30 and Q10 during constant voltage operation. When the power supply goes into constant current operation, CR30 becomes forward biased by the collector voltage of Q1A. This results in conduction of Q10 and the clamping of the summing point at a potential only slightly more negative than the normal constant voltage potential. Clamping this voltage at approximately the same potential that exists in constant voltage operation, results in a constant voltage across, and consequently a constant current through, the programming current resistors R12 and R13.

4-29 MIXER AMPLIFIER AND DRIVER

4-30 The mixer and driver amplifiers amplify the error signal from the constant voltage or constant current input circuit to a level sufficient to drive the series regulating transistors. Transistor Q3 receives its error voltage input from either the constant voltage or constant current circuit via the OR-gate diode (CR3 or CR4) that is conducting at that time. Diode CR3 is forward biased, and CR4 reverse biased, during constant voltage operation. The reverse is true during constant current operation.

4-31 The RC network, composed of C5 and R30, is an equalizing network which provides for high frequency roll off in the loop gain response in order to stabilize the feedback loop.

4-32 Emitter follower Q4 serves as the driver ele-

ment for the series regulator. For greater current gain, Q4 is connected in a Darlington configuration with regulating transistor, Q6.

4-33 REFERENCE CIRCUIT

4-34 The reference circuit is a feedback power supply similar to the main supply. It provides stable reference voltages which are used throughout the unit. The reference voltages are all derived from smoothed dc obtained from the full wave rectifier (CR22 and CR23) and filter capacitor C10. The +6.2 and -6.2 voltages, which are used in the constant voltage and current input circuits for comparison purposes, are developed across temperature compensated Zener diodes VR1 and VR2. Resistor R43 limits the current through the Zener diodes to establish an optimum bias level.

4-35 The regulating circuit consists of series regulating transistor Q9 and error amplifier Q8. Output voltage changes are detected by Q8 whose base is connected to the junction of a voltage divider (R41, R42) connected directly across the supply. Any error signals are amplified and inverted by Q8 and applied to the base of series transistor Q9. The series element then alters its conduction, in the direction and by the amount necessary to maintain the voltage across VR1 and VR2 constant. Resistor R46, the emitter resistor for Q8, is connected in a manner which minimizes changes in the reference voltage caused by variations in the input line. Output capacitor C9 stabilizes the regulator loop.

4-36 METER CIRCUIT

4-37 The meter circuit provides continuous indications of output voltage or current on a single multiple range meter. The meter can be used either as a voltmeter or an ammeter depending upon the position of the METER switch S2 on the front panel of the supply. This switch also selects one or two meter ranges on each scale. The meter circuit consists basically of a selection circuit (switch S2 and associated voltage dividers), stable differential amplifier stages (Q11, Q12, and Q14), and the meter movement.

4-38 The selection circuit determines which voltage divider is connected to the differential amplifier input. When the METER section of S2 is in one of the voltage positions, the voltage across divider R59, R60, and R61 (connected across the output of the supply) is the input to the differential amplifier.

4-39 When S2 is in one of the current positions the voltage across divider R56, R57, and R58 is the input to the differential amplifier. Note that this divider is connected across the sampling resistor network. The amplified output of the differential amplifier is used to deflect the meter.

4-40 The differential amplifier is a stable device having a fixed gain of ten. Stage Q11B of the amplifier receives a negative voltage from the applicable voltage divider when S2 is in one of the voltage positions while stage Q11A is connected to the +S (common) terminal. With S2 in a current position, stage Q11A receives a positive voltage from the applicable voltage divider while stage Q11B is connected to the +S terminal. The differential output of the amplifier is taken from the collectors of Q12 and Q14. Transistor Q15 is a constant current source which sets up the proper bias current for the amplifier. Potentiometer R63 permits zeroing of the meter.

4-41 The meter amplifier contains an inherent current limiting feature which protects the meter movement against overloads. For example, if METER switch S2 is placed in the low current range when the power supply is actually delivering a higher Ampere output, the differential amplifiers are quickly driven into saturation limiting the current through the meter to a safe value.

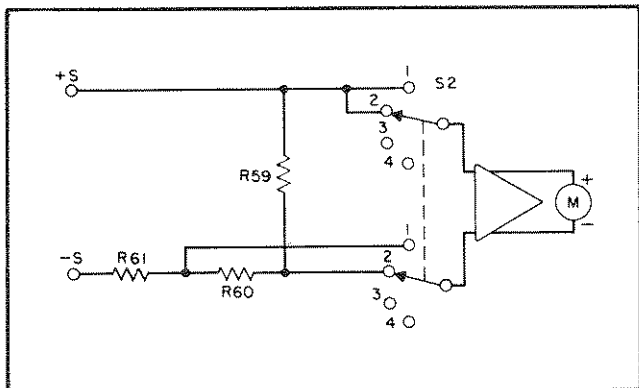


Figure 4-3. Voltmeter Connections, Simplified Schematic

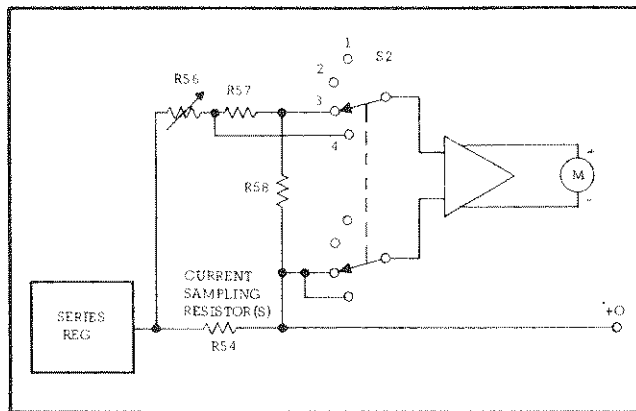


Figure 4-4. Ammeter Connections, Simplified Schematic

4-42 Figures 4-3 and 4-4 show the meter connections when the METER section of S2 is in the higher voltage and current range positions, respectively. For the sake of simplicity, some of the actual circuit components are not shown on these drawings. With the METER switch in the higher voltage range, position 2, the voltage drop across R59 is the input to the meter amplifier and the meter indicates the output voltage across the +S and -S terminals. For low output voltages, S2 can be switched to the low voltage position (1) resulting in the application of a larger percentage of the output voltage (drop across R59 and R60) to the meter amplifier.

4-43 As illustrated in Figure 4-4 with the METER switch in the high current position (3) the voltage drop across R58 is applied to the meter amplifier and the meter indicates the output current which flows through the sampling resistor network. For low values of output current, the METER switch can be set to position 4 and the voltage drop across R57 and R58 is applied to the meter amplifier.

SECTION V MAINTENANCE

5-1 INTRODUCTION

5-2 Upon receipt of the power supply, the performance check (Paragraph 5-10) should be made. This check is suitable for incoming inspection. If a fault is detected in the power supply while making the performance check or during normal operation, proceed to the troubleshooting procedures (Paragraph 5-41). After troubleshooting and repair (Paragraph 5-46), perform any necessary adjustments and calibrations (Paragraph 5-48). Before returning the power supply to normal operation, repeat the performance check to ensure that the fault has been properly corrected and that no other faults exist. Before doing any maintenance checks, turn on power supply, allow a half-hour warm-up, and read the general information regarding measurement techniques (Paragraph 5-3).

5-3 GENERAL MEASUREMENT TECHNIQUES

5-4 The measuring device must be connected across the sensing leads of the supply or as close to the output terminals as possible when measuring the output impedance, transient response, regulation, or ripple of the power supply in order to achieve valid measurements. A measurement made across the load includes the impedance of the leads to the load and such lead lengths can easily have an impedance several orders of magnitude greater than the supply impedance, thus invalidating the measurement.

5-5 The monitoring device should be connected to the +S and -S terminals (see Figure 3-2) or as shown in Figure 5-1. The performance characteristics should never be measured on the front terminals if the load is connected across the rear terminals. Note that when measurements are made at the front terminals, the monitoring leads are connected at A, not B, as shown in Figure 5-1. Failure to connect the measuring device at A will result in a measurement that includes the resistance of the leads between the output terminals and the point of connection.

5-6 For output current measurements, the current sampling resistor should be a four-terminal resis-

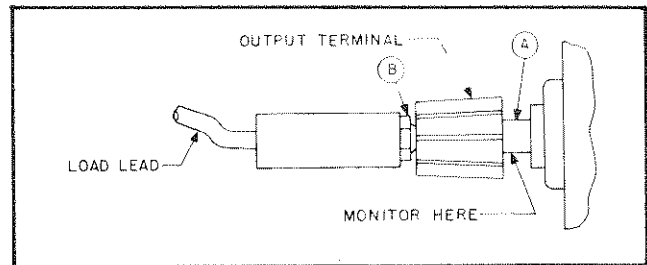


Figure 5-1. Front Panel Terminal Connections

tor. The four terminals are connected as shown in Figure 5-2. In addition, the resistor should be of the low noise, low temperature coefficient (less than 30ppm/°C) type and should be used at no more than 5% of its rated power so that its temperature rise will be minimized.

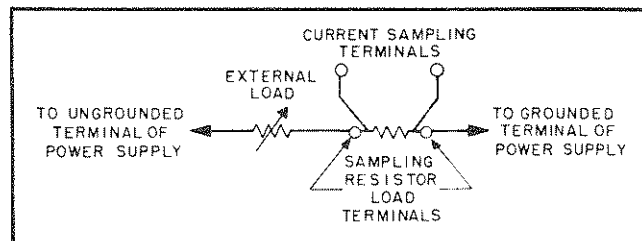


Figure 5-2. Output Current Measurement Technique

5-7 When using an oscilloscope, ground one terminal of the power supply and then ground the case of the oscilloscope to this same point. Make certain that the case is not also grounded by some other means (Power line). Connect both oscilloscope input leads to the power supply ground terminal and check that the oscilloscope is not exhibiting a ripple or transient due to ground loops, pickup, or other means.

5-8 TEST EQUIPMENT REQUIRED

5-9 Table 5-1 lists the test equipment required to perform the various procedures described in this Section.

Table 5-1. Test Equipment Required

TYPE	REQUIRED CHARACTERISTICS	USE	RECOMMENDED MODEL
Differential Voltmeter	Sensitivity: 1mV full scale (min.). Input impedance: 10 megohms (min.).	Measure DC voltages; calibration procedures	Ⓢ 3420 (See Note)
Variable Voltage Transformer	Range: 90-130 volts. Equipped with voltmeter accurate within 1 volt.	Vary AC input	---
AC Voltmeter	Accuracy: 2%. Sensitivity: 1mV full scale deflection (min.).	Measure AC voltages and ripple	Ⓢ 403B
Oscilloscope	Sensitivity: 100 μ V/cm. Differential input.	Display transient response waveforms	Ⓢ 140A plus 1400A plug-in. 1402A plug-in for spike measurements only.
Oscillator	Range: 5 Hz to 600 kHz. Accuracy: 2%. Output: 10Vrms.	Impedance checks	Ⓢ 200 CD
DC Voltmeter	Accuracy: 1%. Input resistance: 20,000 ohms/volt (min.).	Measure DC voltages	Ⓢ 412A
Repetitive Load Switch	Rate: 60-400 Hz, 2 μ sec rise and fall time.	Measure transient response	See Figure 5-8.
Resistive Loads	Values: See Paragraph 5-14 and Figure 5-4. \pm 5%, 75 watts.	Power supply load resis- tors	---
Current Sampling Resistor	6253A, 6284A: 0.33 Ω 6255A, 6289A: 0.66 Ω 6281A: 0.2 Ω 6294A: 1 Ω	Measure current; calibrate meter; cc ripple and noise	See Parts List R54 (R55)
Resistor	1K Ω \pm 1%, 2 watt non-inductive.	Measure impedance	---
Resistor	100 ohms, \pm 5%, 10 watt.	Measure impedance	---
Resistor	Value: See Paragraph 5-59. \pm 0.1%, 1/2 watt.	Calibrate programming current	---
Resistor	Value: See Paragraph 5-62. \pm 0.1% 1/2 watt.	Calibrate programming current	---
Capacitor	500 μ F, 50 wVdc.	Measure impedance	---
Decade Resistance Box	Range: 0-500K. Accuracy: 0.1% plus 1 ohm. Make-before-break contacts.	Measure programming coefficients	---

NOTE

A satisfactory substitute for a differential voltmeter is to arrange a reference voltage source and null detector as shown in Figure 5-3. The reference voltage source is adjusted so that the voltage difference between the supply being measured and the reference voltage will have the required resolution for the measurement being made. The voltage difference will be a function of the null detector that is used. Examples of satisfactory null detectors are: Ⓢ 419A null detector, a dc coupled oscilloscope utilizing differential input, or a 50mV meter movement with a 100 division scale. For the latter, a 2mV change in voltage will result in a meter deflection of four divisions.

CAUTION

Care must be exercised when using an electronic null detector in which one input terminal is grounded to avoid ground loops and circulating currents.

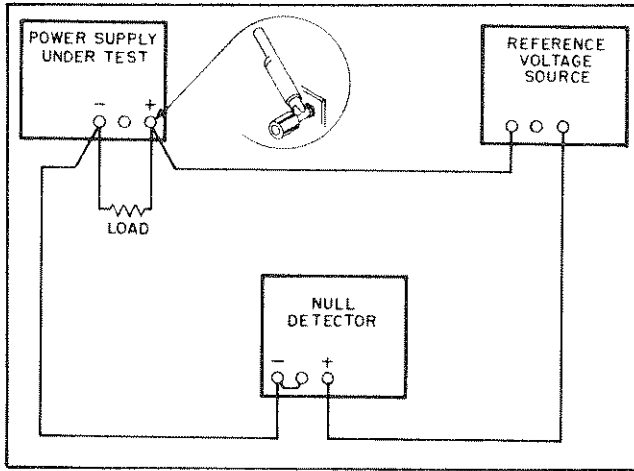


Figure 5-3. Differential Voltmeter Substitute, Test Setup

5-10 PERFORMANCE TEST

5-11 The following test can be used as an incoming inspection check and appropriate portions of the test can be repeated either to check the operation of the instrument after repairs or for periodic maintenance tests. The tests are performed using a 115Vac 60Hz, single phase input power source. If the correct result is not obtained for a particular check, do not adjust any controls; proceed to troubleshooting (Paragraph 5-41).

5-12 CONSTANT VOLTAGE TESTS

5-13 Rated Output and Meter Accuracy.

5-14 Voltage. Proceed as follows:

a. Connect load resistor across rear output terminals of supply. Resistor value to be as follows:

Model	6253A	6255A	6281A	6284A	6289A	6294A
Resistance	6 Ω	26 Ω	1.5 Ω	6 Ω	26 Ω	60 Ω

b. Connect differential voltmeter across +S and -S terminals of supply observing correct polarity.

c. Set METER switch to highest voltage range and turn on supply.

d. Adjust VOLTAGE control(s) until front panel meter indicates exactly the maximum rated output voltage.

e. Differential voltmeter should indicate maximum rated output voltage within $\pm 2\%$.

5-15 Current. Proceed as follows:

a. Connect test setup as shown in Figure 5-4 leaving switch S1 open.

b. Turn CURRENT controls fully clockwise.

c. Set METER switch to highest current range and turn on supply.

d. Adjust VOLTAGE control(s) until front panel meter indicates exactly the maximum rated output current.

e. Differential voltmeter should read 1.0 ± 0.02 Vdc.

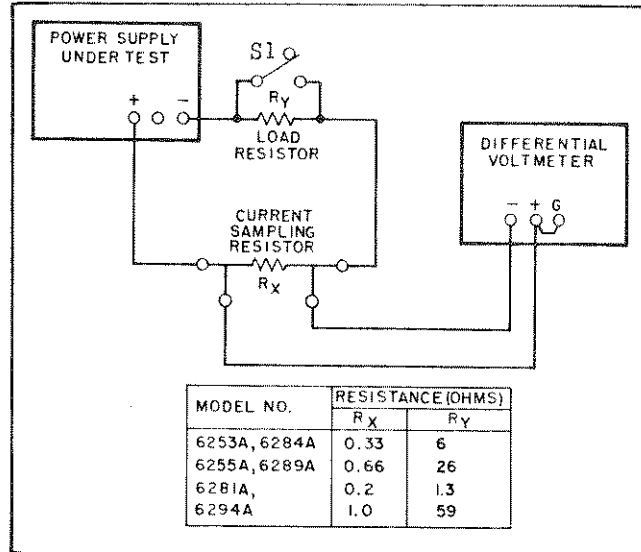


Figure 5-4. Output Current Test Setup

5-16. Load Regulation. To check constant voltage load regulation, proceed as follows:

a. Connect test setup as shown in Figure 5-5.

b. Turn CURRENT controls fully clockwise.

c. Set METER switch to highest current range and turn on supply.

d. Adjust VOLTAGE control(s) until front panel meter indicates exactly the maximum rated output voltage.

e. Read and record voltage indicated on differential voltmeter.

f. Disconnect load resistors.

g. Reading on differential voltmeter should not vary from reading recorded in step e by more than the following:

Model No.	6253A, 6284A	6255A, 6289A
Variation (mVdc)	± 6	± 6

Model No.	6281A	6294A
Variation (mVdc)	± 5	± 8

5-17 Line Regulation: To check the line regulation, proceed as follows:

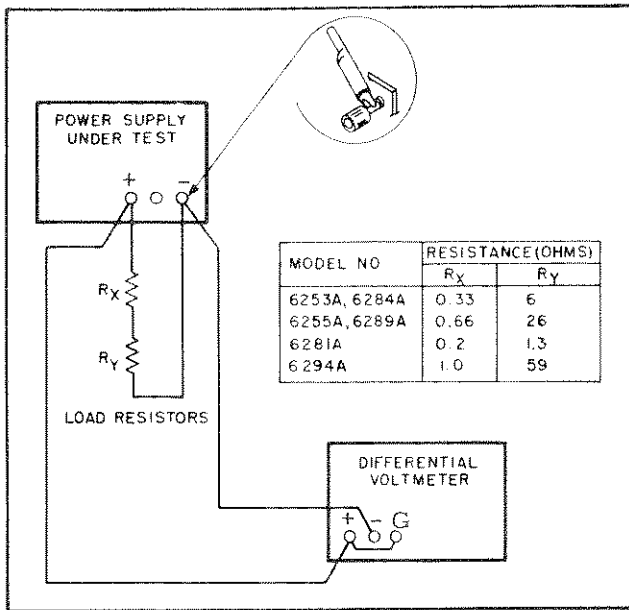


Figure 5-5. Load Regulation, Constant Voltage Test Setup

- Connect variable auto transformer between input power source and power supply power input.
- Turn CURRENT controls fully clockwise.
- Connect test setup shown in Figure 5-5.
- Adjust variable auto transformer for 105Vac input.
- Set METER switch to highest voltage range and turn on supply.
- Adjust VOLTAGE control(s) until front panel meter indicates exactly the maximum rated output voltage.
- Read and record voltage indicated on differential voltmeter.
- Adjust variable auto transformer for 125Vac input.
- Reading on differential voltmeter should not vary from reading recorded in step g by more than the following:

Model No.	6253A, 6284A	6255A, 6289A
Variation (mVdc)	±4	±6
Model No.	6281A	6294A
Variation (mVdc)	±2.75	±8

5-18 **Ripple and Noise.** Ripple and noise measurement can be made at any input AC line voltage combined with any DC output voltage and load current within rating.

5-19 The amount of ripple and noise that is present on the power supply output is measured either in terms of the RMS or (preferably) peak-to-peak value. The peak-to-peak measurement is particularly important for applications where noise spikes could be detrimental to a sensitive load, such as logic circuitry. The RMS measurement is not an ideal

representation of the noise, since fairly high output noise spikes of short duration could be present in the ripple and not appreciably increase the RMS value.

5-20 The technique used to measure high frequency noise or "spikes" on the output of a power supply is more critical than the low frequency ripple and noise measurement technique; therefore the former is discussed separately in Paragraph 5-28.

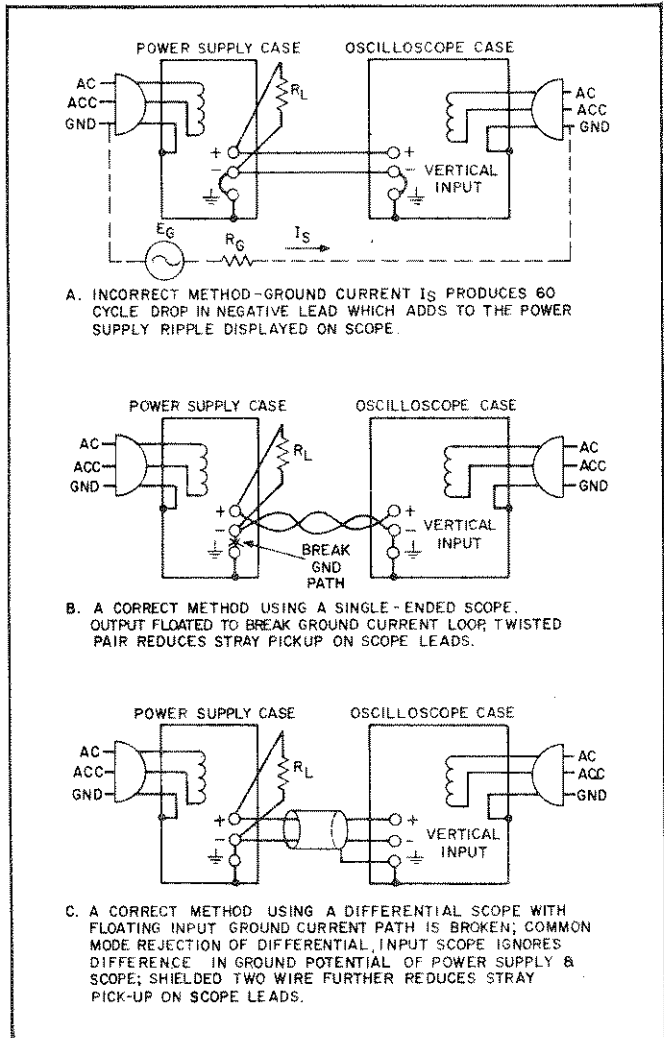


Figure 5-6. CV Ripple and Noise Test Setup

5-21 Ripple and Noise Measurements. Figure 5-6A shows an incorrect method of measuring p-p ripple. Note that a continuous ground loop exists from the third wire of the input power cord of the supply to the third wire of the input power cord of the oscilloscope via the grounded power supply case, the wire between the negative output terminal of the power supply and the vertical input of the scope, and the grounded scope case. Any ground current

circulating in this loop as a result of the difference in potential E_G between the two ground points causes an IR drop which is in series with the scope input. This IR drop, normally having a 60 Hz line frequency fundamental, plus any pickup on the unshielded leads interconnecting the power supply and scope, appears on the face of the CRT. The magnitude of this resulting noise signal can easily be much greater than the true ripple developed between the plus and minus output terminals of the power supply, and can completely invalidate the measurement.

5-22 The same ground current and pickup problems can exist if an RMS voltmeter is substituted in place of the oscilloscope in Figure 5-6. However, the oscilloscope display, unlike the true RMS meter reading, tells the observer immediately whether the fundamental period of the signal displayed is 8.3 milliseconds (1/120 Hz) or 16.7 milliseconds (1/60 Hz). Since the fundamental ripple frequency present on the output of an ϕ supply is 120 Hz (due to full-wave rectification), an oscilloscope display showing a 120 Hz fundamental component is indicative of a "clean" measurement setup, while the presence of a 60 Hz fundamental usually means that an improved setup will result in a more accurate (and lower) value of measured ripple.

5-23 Figure 5-6B shows a correct method of measuring the output ripple of a constant voltage power supply using a single-ended scope. The ground loop path is broken by floating the supply output. Note that to ensure that no potential difference exists between the supply and the oscilloscope, it is recommended that whenever possible they both be plugged into the same AC power buss. If the same buss cannot be used, both AC grounds must be at earth ground potential.

5-24 Either a twisted pair or (preferably) a shielded two-wire cable should be used to connect the output terminals of the power supply to the vertical input terminals of the scope. When using a twisted pair, care must be taken that one of the two wires is connected to the grounded input terminal of the oscilloscope. When using shielded two-wire, it is essential for the shield to be connected to ground at one end only so that no ground current will flow through this shield, thus inducing a noise signal in the shielded leads.

5-25 To verify that the oscilloscope is not displaying ripple that is induced in the leads or picked up from the grounds, the (+) scope lead should be shorted to the (-) scope lead at the power supply terminals. The ripple value obtained when the leads are shorted should be subtracted from the actual ripple measurement.

5-26 In most cases, the single-ended scope method of Figure 5-6B will be adequate to eliminate non-real components of ripple and noise so that a satisfactory measurement may be obtained. However, in more stubborn cases it may be necessary to use a differential scope with floating input as shown in Figure 5-6C. If desired, two single conductor shielded cables may be substituted in place of the shielded two-wire cable with equal success. Because of its common mode rejection, a differential oscilloscope displays only the difference in signal between its two vertical input terminals, thus ignoring the effects of any common mode signal introduced because of the difference in the AC potential between the power supply case and scope case. Before using a differential input scope in this manner, however, it is imperative that the common mode rejection capability of the scope be verified by shorting together its two input leads at the power supply and observing the trace on the CRT. If this trace is a straight line, the scope is properly ignoring any common mode signal present. If this trace is not a straight line, then the scope is not rejecting the ground signal and must be realigned in accordance with the manufacturer's instructions until proper common mode rejection is attained.

5-27 To check the ripple and noise output, proceed as follows:

- a. Connect the oscilloscope or RMS voltmeter as shown in Figures 5-6B or 5-6C.
- b. Turn the CURRENT control fully clockwise and adjust VOLTAGE control until front panel meter indicates maximum rated output voltage.
- c. The observed ripple and noise should be less than 200 μ V RMS and 1 mV p-p.

5-28 Noise Spike Measurement. When a high frequency spike measurement is being made, an instrument of sufficient bandwidth must be used; an oscilloscope with a bandwidth of 20 MHz or more is adequate. Measuring noise with an instrument that has insufficient bandwidth may conceal high frequency spikes detrimental to the load.

5-29 The test setups illustrated in Figures 5-6A and 5-6B are generally not acceptable for measuring spikes; a differential oscilloscope is necessary. Furthermore, the measurement concept of Figure 5-6C must be modified if accurate spike measurement is to be achieved:

1. As shown in Figure 5-7, two coax cables, must be substituted for the shielded two-wire cable.
2. Impedance matching resistors must be included to eliminate standing waves and cable ringing, and the capacitors must be connected to block the DC current path.

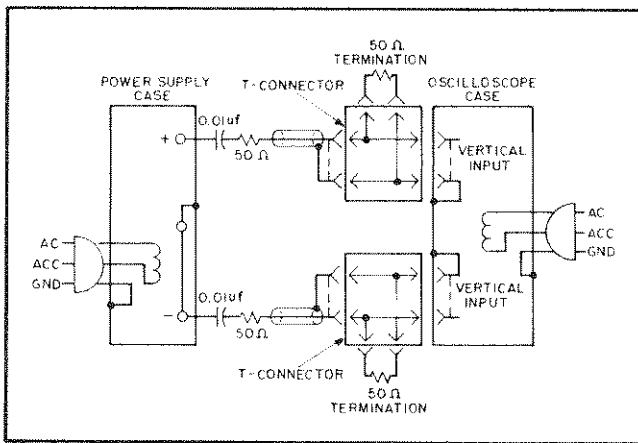


Figure 5-7. CV Noise Spike, Test Setup

3. The length of the test leads outside the coax is critical and must be kept as short as possible; the blocking capacitor and the impedance matching resistor should be connected directly from the inner conductor of the cable to the power supply terminals.

4. Notice that the shields of the power supply end of the two coax cables are not connected to the power supply ground, since such a connection would give rise to a ground current path through the coax shield, resulting in an erroneous measurement.

5. The measured noise spike values must be doubled, since the impedance matching resistors constitute a 2-to-1 attenuator.

6. The noise spikes observed on the oscilloscope should be less than 0.5mV p-p.

5-30 The circuit of Figure 5-7 can also be used for the normal measurement of low frequency ripple and noise; simply remove the four terminating resistors and the blocking capacitors and substitute a higher gain vertical plug-in in place of the wide-band plug-in required for spike measurements. Notice that with these changes, Figure 5-7 becomes a two-cable version of Figure 5-6C.

5-31 Transient Recovery Time. To check the transient recovery time, proceed as follows:

- Connect test setup shown in Figure 5-8.
- Turn CURRENT controls fully clockwise.
- Set METER switch to highest current range and turn on supply.
- Adjust VOLTAGE control(s) until front panel meter indicates exactly the maximum rated output voltage.
- Close line switch on repetitive load switch setup.
- Adjust 25K potentiometer until a stable display is obtained on oscilloscope. Waveform should be within the tolerances shown in Figure 5-9 (output should return to within 15mV of original value in less than 50 microseconds).

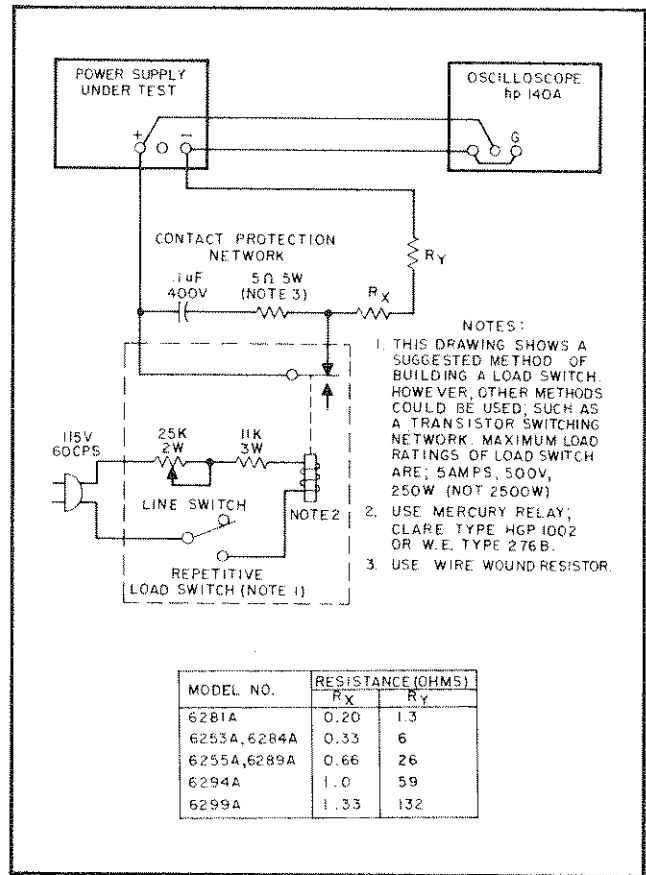


Figure 5-8. Transient Response, Test Setup

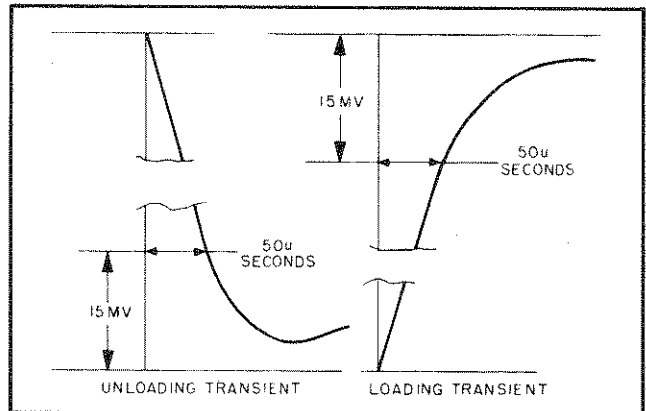


Figure 5-9. Transient Response, Waveforms

5-32 Output Impedance. To check the output impedance, proceed as follows:

- Connect test setup shown in Figure 5-10.
- Set METER switch to highest voltage range and turn CURRENT controls fully clockwise, and turn on supply.
- Adjust VOLTAGE control(s) until front panel meter reads 20 Volts.
- Set AMPLITUDE control on Oscillator to

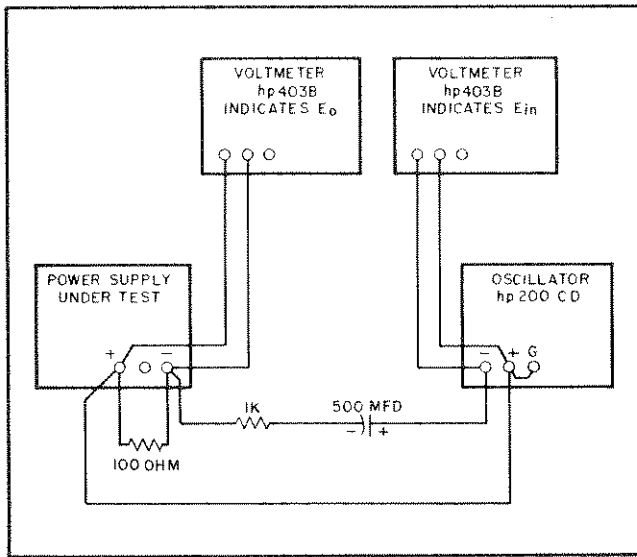


Figure 5-10. Output Impedance, Test Setup

10 Volts (E_{IN}), and FREQUENCY control to desired frequency.

e. Record voltage across output terminals of the power supply (E_O) as indicated on ac voltmeter.

f. Calculate the output impedance by the following formula: $Z_{OUT} = (E_O R) / (E_{IN} - E_O)$
 E_O = rms voltage across power supply output terminals.

$R = 1000.$

$E_{IN} = 10$ Volts.

g. The output impedance (Z_{OUT} , of Step f) should be less than the impedance calculated at the frequency of interest. (Use $8m\Omega + 1\mu H$ in the formula: $Z = \sqrt{R^2 + X_L^2}$).

5-33 CONSTANT CURRENT TESTS

5-34 Load Regulation. To check the constant current load regulation, proceed as follows:

- Connect test setup shown in Figure 5-4.
- Turn VOLTAGE control(s) fully clockwise.
- Set METER switch to highest current range and turn on supply.
- Adjust CURRENT control until front panel meter reads exactly the maximum rated output current.
- Read and record voltage indicated on differential voltmeter.
- Short out load resistor (R_L) by closing switch S1.
- Reading on differential voltmeter should not vary from reading recorded in Step 3 by more than the following:

Model No.	6253A, 6284A	6255A, 6289A
Variation (mVdc)	± 0.183	± 0.265
Model No.	6281A	6294A
Variation (mVdc)	± 0.5	± 0.35

5-35 Line Regulation. To check the line regulation, proceed as follows:

- Utilize test setup shown in Figure 5-4 leaving switch S1 open throughout test.
- Connect variable auto transformer between input power source and power supply power input.
- Adjust auto transformer for 105Vac input.
- Turn VOLTAGE control(s) fully clockwise.
- Set METER switch to highest current range and turn on supply.
- Adjust CURRENT controls until front panel meter reads exactly the maximum rated output current.
- Read and record voltage indicated on differential voltmeter.
- Adjust variable auto transformer for 125V ac input.
- Reading on differential voltmeter should not vary from reading recorded in Step g by more than the following:

Model No.	6253A, 6284A	6255A, 6289A
Variation (mVdc)	± 0.183	± 0.265
Model No.	6281A	6294A
Variation (mVdc)	± 0.15	± 0.35

5-36 Ripple and Noise. Most of the instructions pertaining to the ground loop and pickup problems associated with constant voltage ripple and noise measurement also apply to the measurement of constant current ripple and noise. Figure 5-11 illustrates the most important precautions to be observed when measuring the ripple and noise of a constant current supply. The presence of a 120Hz waveform on the oscilloscope is normally indicative of a correct measurement method. A waveshape having 60Hz as its fundamental component is typically associated with an incorrect measurement setup.

5-37 Ripple and Noise Measurement. To check the ripple and noise, proceed as follows:

- Connect the oscilloscope or RMS voltmeter as shown in Figures 5-11B or 5-11C.
- Rotate the VOLTAGE control fully ccw.
- Set METER switch to highest current range and turn on supply.
- Adjust CURRENT control until front panel meter reads exactly the maximum rated output current.
- The ripple and noise indication should be less than the following:

Model	6253A, 6284A	6255A, 6289A	6281A	6294A
mArms	2	0.5	4	0.5

5-39 Before attempting to troubleshoot this instrument, ensure that the fault is with the instrument and not with an associated circuit. The performance test (Paragraph 5-10) enables this to be determined without having to remove the instrument from the cabinet.

5-40 A good understanding of the principles of operation is a helpful aid in troubleshooting, and it is recommended that the reader review Section IV of the manual before attempting to troubleshoot the unit in detail. Once the principles of operation are understood, refer to the overall troubleshooting procedures in Paragraph 5-42 to locate the symptom and probable cause.

NOTE

The normal voltages shown on the schematic diagram at the rear of the manual are positioned adjacent to the applicable test points (identified by encircled numbers on the printed circuit board and schematic diagram.

5-41 Once the defective component has been located (by means of visual inspection or trouble analysis) replace it and reconduct the performance test. If a component is replaced, refer to the repair and replacement and adjustment and calibration paragraphs in this section.

5-42 OVERALL TROUBLESHOOTING PROCEDURE

5-43 To locate the cause of trouble follow steps 1, 2, and 3 in sequence.

(1) Check for obvious troubles such as open fuse, defective power cord, input power failure, or defective meter. Next, remove the top and bottom covers and inspect for open connections, charred components, etc. If the trouble source cannot be detected by visual inspection, proceed with Step 2.

(2) In almost all cases, the trouble can be caused by the dc bias or reference voltages; thus, it is a good practice to check voltages in Table 5-2 before proceeding with Step 3.

(3) Examine Table 5-3 to determine your symptom, then check the probable cause.

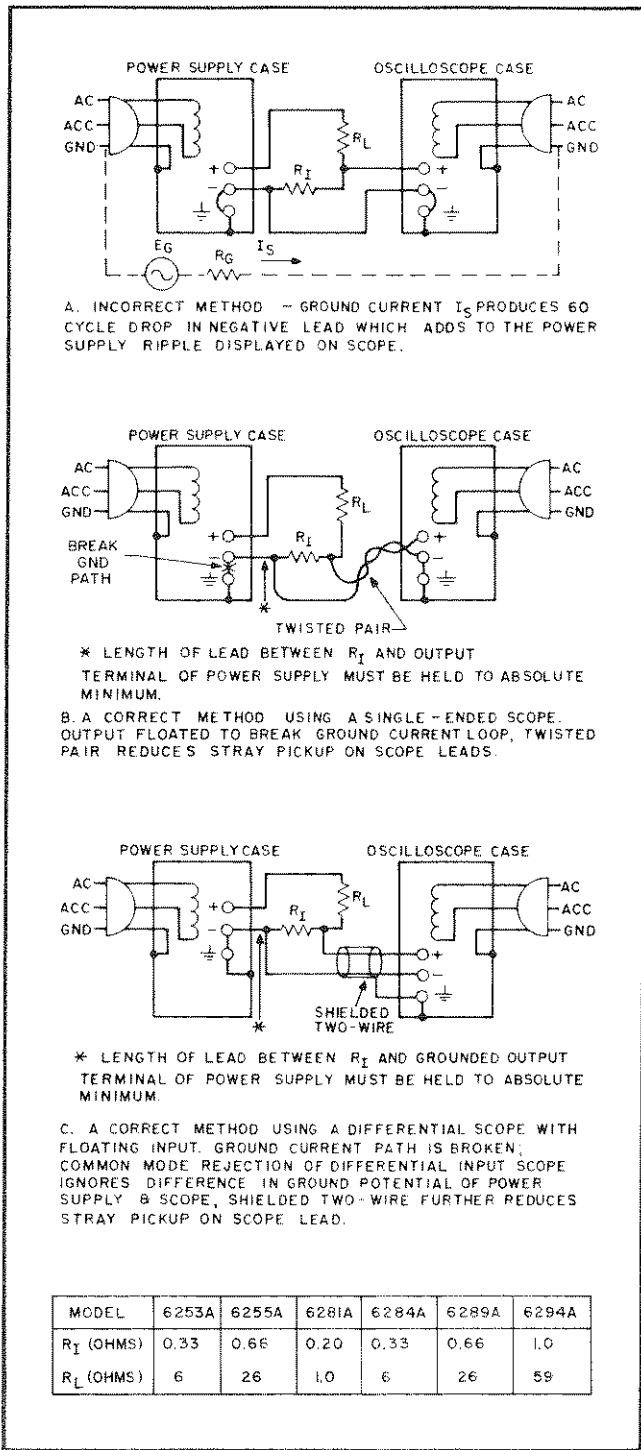


Figure 5-11. CC Ripple and Noise, Test Setup

Table 5-2. Reference, Bias, and Filtered DC Troubleshooting

METER COMMON	METER POSITIVE	NORMAL VDC	NORMAL RIPPLE (P-P)	PROBABLE CAUSE
31	+S	6.2	0.5mV	VR2

Table 5-2. Reference, Bias, and Filtered DC Troubleshooting (Continued)

METER COMMON	METER POSITIVE	NORMAL VDC	NORMAL RIPPLE (P-P)	PROBABLE CAUSE
+S	33	6.2	0.5mV	VR1
+S	37	12.4	5mV	Q8, Q9
34	37	27	1.5V	C10, CR22, CR23, T1
41	23	2.2	20mV	CR8-CR10
41	38	80V	1V	C12, CR24, CR25, T1
-Out	27	90V	0.8V	C14, CR26, CR27, R49, T1

Table 5-3. Overall Troubleshooting

SYMPTOM	PROBABLE CAUSE
Low output or no output voltage	Ensure that front panel meter is not defective, then refer to Paragraph 5-44.
High output voltage	Ensure that front panel meter is not defective, then refer to Paragraph 5-44.
High ripple	<ul style="list-style-type: none"> a. Check operating setup for ground loops, refer to Paragraph 5-18. b. If output floating, connect 1μf capacitor between output and ground. c. Check for excessive internal ripple; refer to Table 5-2. d. Ensure that supply is not in constant current operation under loaded conditions. To prevent this condition turn CURRENT control fully clockwise. e. Check for low voltage across C14, C12, or C10.
Poor line regulation	<ul style="list-style-type: none"> a. Improper measuring technique; refer to Paragraph 5-3. b. Check reference circuit voltages, Table 5-2. c. Check reference circuit adjustment, Paragraph 5-62.
Poor load regulation (Constant Voltage)	<ul style="list-style-type: none"> a. Improper measuring technique; refer to Paragraph 5-3. b. Check the regulation characteristics of Zener diode VR1 as follows: <ul style="list-style-type: none"> (1) Connect differential voltmeter across VR1 (2) Connect appropriate load resistor (R_L), given in Figure 5-4, across (+) and (-) output terminals (3) Perform Steps b through f of Paragraph 5-16 (4) If the differential voltmeter reading varies by more than 0.5mV, replace VR1.

Table 5-3. Overall Troubleshooting (Continued)

SYMPTOM	PROBABLE CAUSE
Poor load regulation (Constant Voltage)	c. Ensure that supply is not in constant current operation under loaded conditions. To prevent this condition turn CURRENT control fully clockwise.
Poor load regulation (Constant Current)	a. Improper measuring technique; refer to Paragraph 5-3. b. Check the regulation characteristics of Zener diode VR2 as follows: (1) Connect differential voltmeter across VR2 (2) Connect appropriate load resistor (R _L), given in Figure 5-4, across (+) and (-) output terminals (3) Perform Steps b through f of Paragraph 5-34 (4) If the differential voltmeter reading varies by more than 0.5mV, replace VR2. c. C19, C20, and CR34 leaky. d. Check clamp circuit, Q10, CR30, CR31, and CR32 for open. e. Ensure that supply is not crossing over into constant voltage operation. To prevent this condition, load the supply and turn the VOLTAGE control fully clockwise.
Oscillates	a. Check C5 open. Adjustment of R30; refer to Paragraph 5-64. b. Check R21 and C3 in current input circuit.
Poor stability (Constant Voltage)	a. Check +6.2Vdc reference voltage (Table 5-2). b. Noisy programming resistor R10. c. CR1, CR2 leaky. d. Check R1, R12, R13, and C2 for noise or drift. e. Stage Q1 defective.
Poor stability (Constant Current)	a. Check -6.2Vdc reference voltage (Table 5-2). b. Noisy programming resistor R16. c. CR5, CR34, C19, C3 leaky. d. Check R18, R19, R20, R21, R54, and R55 for noise or drift. e. Stage Q2 defective.
Poor transient recovery	a. Check R30 and C5. Refer to adjustment procedure Paragraph 5-64.

5-44 Regulating Loop Troubles. If the voltages in Table 5-2 have been checked to eliminate the reference, bias and rectifier circuits as a source of trouble; the malfunction is caused by the regulating loop. If any component in a feedback loop is defective, measurements made anywhere in the loop may appear abnormal. Under these circumstances it is very difficult to separate cause from effect with the loop closed. As described in Tables 5-4 and 5-5, the loop is effectively opened by checking the conduction and cutoff capability of each stage as fol-

lows:

1. Shorting the emitter to collector of a transistor simulates saturation, or the full ON condition.
2. Shorting the emitter to base or opening the collector lead of a transistor cuts it off, and simulates an open circuit between emitter and collector.

4-45 For low or high output voltage perform the instructions in Tables 5-4, or 5-5, respectively. Although a logical first choice might be to start near the loop mid-point, and then perform successive

subdividing test, it is more useful to trace the loop from the series regulator backwards a stage at a

time, since loop failures occur more often at the higher power levels.

Table 5-4. Low Output Voltage Troubleshooting

STEP	ACTION	RESPONSE	PROBABLE CAUSE
1	Turn the VOLTAGE control fully clockwise and disconnect the load.		
2	If output voltage is zero, check condition of fuse F1.	a. Blown b. Not blown	a. Shorted rectifier diode (CR26,CR27) or filter capacitor (C14). b. Proceed to Step 3.
3	Check conduction of Q6 and Q7 by shorting Q4, emitter-to-collector.	a. Output remains low b. Output increases	a. Q6 or Q7 open. b. Remove short and proceed to Step 4.
4	Check conduction of Q4 by disconnecting collector lead of mixer amplifier Q3.	a. Output remains low b. Output increases	a. Q4 open. b. Reconnect collector lead and Proceed to Step 5.
5	To eliminate the constant current circuit as a cause of the malfunction, remove CR4 cathode or anode lead.	a. Output increases b. Output remains low	a. Stage Q2 defective. b. Reconnect CR4 and proceed to Step 6.
6	Check turnoff of Q3 by shorting Q1A, emitter-to-collector.	a. Output remains low b. Output increases	a. Q3 shorted. b. Q1A open, Q1B shorted, Q10 shorted, C1 shorted, R12, R13 open.

Table 5-5. High Output Voltage Troubleshooting

STEP	ACTION	RESPONSE	PROBABLE CAUSE
1	Turn the VOLTAGE control to approximately mid-range and disconnect the load. If the output voltage should rise to an excessive value with the VOLTAGE control turned ccw, the control could be damaged.		
2	Check turnoff of Q6 and Q7 by disconnecting emitter of Q4.	a. Output remains high b. Output decreases	a. Q6 or Q7 shorted. b. Reconnect emitter of Q4 and proceed to Step 3.
3	Check turnoff of Q4 by shorting Q3 emitter to collector.	a. Output remains high b. Output decreases	a. Q4 shorted. b. Remove short across Q3. and proceed to Step 4.

Table 5-5. High Output Voltage Troubleshooting (Continued)

STEP	ACTION	RESPONSE	PROBABLE CAUSE
4	Check conduction of Q3 by shorting Q1B, emitter-to-collector.	a. Output remains high b. Output decreases	a. Q3 open, Q1 defective. b. Remove short and proceed to Step 5.
5	On rear terminal board, short A6 to (-).	a. Output remains high b. Output decreases	a. Stage Q1 defective. b. Remove short across terminals A6 and (-). Check R10 for open and R12, R13 for short.

5-46 REPAIR AND REPLACEMENT

5-47 Before servicing a printed wiring board, refer to Figure 5-12. Section VI of this manual contains a list of replaceable parts. Before replacing a semiconductor device, refer to Table 5-6 which lists the

special characteristics of selected semiconductors. If the device to be replaced is not listed in Table 5-6, the standard manufacturers' part number listed in Section VI is applicable. After replacing a semiconductor device, refer to Table 5-7 for checks and adjustments that may be necessary.

Table 5-6. Selected Semiconductor Characteristics

REFERENCE DESIGNATOR	CHARACTERISTICS	Ⓜ PART NO.	SUGGESTED REPLACEMENT
Q1, 2	Matched differential amplifier. NPN Si Planar. 70 (min.) h_{FE} $I_C = 1mA$. $V_{CE} = 5V$. $I_{CO} 0.01\mu A @ V_{CBO} = 5V$.	1854-0229	2N2917 G.E.
Q6, 7	NPN Power. $h_{FE} = 35$ (min.) @ $I_C = 1A$, $V_{CE} = 4V$. V_{CE} (sat.) = 1V max. @ $I_C = 1A$; $I_b = 0.1A$.	1854-0250	2N3442 R.C.A.
Q3, 9	NPN Small Signal. $P_d = 300mW$, $FT = 150MHz$, $BV_{CEO} = 30V$ (min.).	1854-0071	2N3391 G.E.

Table 5-7. Checks and Adjustments After Replacement of Semiconductor Devices

REFERENCE	FUNCTION	CHECK	ADJUST
Q1	Constant voltage differential amplifier	Constant voltage (CV) line and load regulation. Zero voltage output.	R6 or R8
Q2	Constant current differential amplifier	Constant current (CC) line and load regulation. Zero current output.	R25 or R28
Q3	Mixer amplifier	CV/CC load regulation. CV transient response.	R30
Q4	Driver	CV/CC load regulation.	
Q6, 7	Series regulator	CV/CC load regulation.	

Table 5-7. Checks and Adjustments After Replacement of Semiconductor Devices (Continued)

REFERENCE	FUNCTION	CHECK	ADJUST
Q8,9	Reference regulator	Reference circuit line regulation.	R46
Q10	Clamp circuit	CC load regulation.	
Q11-Q15	Meter circuit	Meter zero. Voltmeter/ammeter tracking.	R63, R72, R56
CR1, CR2	Limiting diodes	CV load regulation.	
CR3, CR4, CR5	OR-gate diodes and limiting diode	CV/CC load regulation.	
CR8-CR10, CR13	Forward bias regulator	Voltage across each diode 0.6 to 0.9 Volts.	
CR22-CR27	Rectifier diodes	Voltage across appropriate filter capacitor.	
CR34	Protection diode	Output voltage	
VR1	Positive reference voltage	Positive reference voltage (+6.2 Volts).	
VR2	Negative reference voltage	Negative reference voltage (-6.2 Volts).	

5-48 ADJUSTMENT AND CALIBRATION

5-49 Adjustment and calibration may be required after performance testing, troubleshooting, or repair and replacement. Perform only those adjustments that affect the operation of the faulty circuit and no others.

5-50 METER ZERO

5-51 The meter pointer must rest on the zero calibration mark on the meter scale when the instrument is at normal operating temperature, resting in its normal operating position, and the instrument is turned off. To zero-set the meter, proceed as follows:

- a. Turn on instrument and allow it to come up to normal operating temperature (about 20 minutes).
- b. Turn the instrument off. Wait two minutes for power supply capacitors to discharge completely.
- c. Rotate adjustment screw on front of meter clockwise until the meter pointer is to the left of zero and further clockwise rotation will move the pointer upscale towards zero.
- d. Turn the adjustment screw clockwise until the pointer is exactly over the zero mark on the scale. If the screw is turned too far, repeat Steps c and d.

- e. Turn meter adjustment screw counterclockwise about 15 degrees to break contact between adjustment screw and pointer mounting yoke, but not far enough to move the pointer back downscale. If screw is turned too far, as shown by the needle moving, repeat the procedure. The meter is now zero-set for best accuracy and mechanical stability.

5-52 VOLTMETER TRACKING

5-53 To calibrate voltmeter tracking, proceed as follows:

- a. To electrically zero meter, set METER switch to highest current position and, with supply on and no load connected, adjust R63 until front panel meter reads zero.
- b. Connect differential voltmeter across supply, observing correct polarity.
- c. Set METER switch to highest voltage range and turn on supply. Adjust VOLTAGE control until differential voltmeter reads exactly the maximum rated output voltage.
- d. Adjust R72 until front panel meter also indicates maximum rated output voltage.

5-54 AMMETER TRACKING

5-55 To calibrate ammeter tracking proceed as

Excessive heat or pressure can lift the copper strip from the board. Avoid damage by using a low power soldering iron (50 watts maximum) and following these instructions. Copper that lifts off the board should be cemented in place with a quick drying acetate base cement having good electrical insulating properties.


A break in the copper should be repaired by soldering a short length of tinned copper wire across the break.

Use only high quality rosin core solder when repairing etched circuit boards. NEVER USE PASTE FLUX. After soldering, clean off any excess flux and coat the repaired area with a high quality electrical varnish or lacquer.


When replacing components with multiple mounting pins such as tube sockets, electrolytic capacitors, and potentiometers, it will be necessary to lift each pin slightly, working around the components several times until it is free.

WARNING: If the specific instructions outlined in the steps below regarding etched circuit boards without eyelets are not followed, extensive damage to the etched circuit board will result.


1. Apply heat sparingly to lead of component to be replaced. If lead of component passes through an eyelet in the circuit board, apply heat on component side of board. If lead of component does not pass through an eyelet, apply heat to conductor side of board.

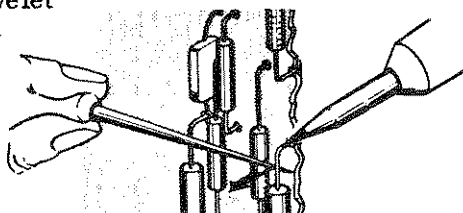


2. Reheat solder in vacant eyelet and quickly insert a small awl to clean inside of hole. If hole does not have an eyelet, insert awl or a #57 drill from conductor side of board.

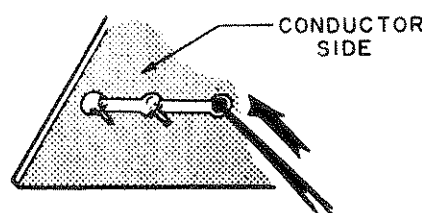

3. Bend clean tinned lead on new part and carefully insert through eyelets or holes in board.

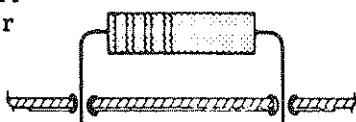


4. Hold part against board (avoid overheating) and solder leads. Apply heat to component leads on correct side of board as explained in step 1.

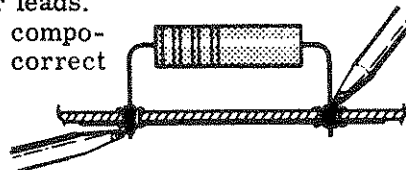


In the event that either the circuit board has been damaged or the conventional method is impractical, use method shown below. This is especially applicable for circuit boards without eyelets.

1. Clip lead as shown below.

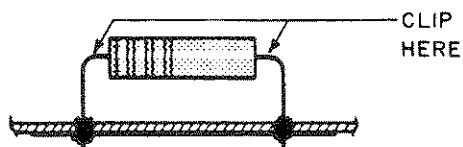

2. Bend protruding leads upward. Bend lead of new component around protruding lead. Apply solder using a pair of long nose pliers as a heat sink.

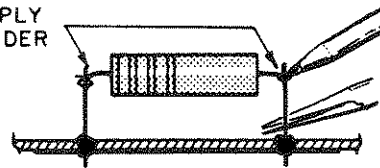

This procedure is used in the field only as an alternate means of repair. It is not used within the factory.

Figure 5-12. Servicing Printed Wiring Boards

follows:

- a. Connect test setup shown on Figure 5-4 leaving switch S1 open.
- b. Turn VOLTAGE control fully clockwise and set METER switch to highest current range.
- c. Turn on supply and adjust CURRENT controls until differential voltmeter reads 1.0Vdc.
- d. Adjust R56 until front panel meter indicates exactly the maximum rated output current.

5-56 CONSTANT VOLTAGE PROGRAMMING CURRENT

5-57 To calibrate the zero Volt programming accuracy, proceed as follows:

- a. Connect differential voltmeter between +S and -S terminals.
- b. Short out voltage controls by connecting jumper between terminals A6 and -S.
- c. Rotate CURRENT controls fully clockwise and turn on supply.
- d. Observe reading on differential voltmeter.
- e. If it is more positive than 0 Volts, shunt resistor R6 with decade resistance box.
- f. Adjust decade resistance until differential voltmeter reads zero, then shunt R6 with resistance value equal to that of the decade resistance.
- g. If reading of Step d is more negative than 0 Volts, shunt resistor R8 with the decade resistance box.
- h. Adjust decade resistance until differential voltmeter reads zero then shunt R8 with resistance value equal to that of the decade box.

5-58 To calibrate the constant voltage programming accuracy, proceed as follows:

- a. Connect a 0.1%, 1/2 Watt resistor between terminals -S and A6 on rear barrier strip. Resistor value to be as follows:
- | | | | | |
|--------------|--------------|--------------|---------------|--------------|
| <u>Model</u> | 6253A, 6284A | 6255A, 6289A | 6281A | 6294A |
| Resistance | 4K Ω | 8K Ω | 1.5K Ω | 18K Ω |
- b. Disconnect jumper between A6 and A8 (leaving A6 and A7 jumpered) on rear terminal barrier strip.
 - c. Connect a decade resistance in place of R13.
 - d. Connect a differential voltmeter between +S and -S and turn on supply.
 - e. Adjust decade resistance box so that differential voltmeter indicates maximum rated output voltage within the following tolerances:

<u>Model No.</u>	6253A, 6284A	6255A, 6289A
Tolerance (Vdc)	± 0.4	± 0.8
<u>Model No.</u>	6281A	6294A
Tolerance (Vdc)	± 0.15	± 1.2

- f. Replace decade resistance with resistor of appropriate value in R13 position.

5-59 CONSTANT CURRENT PROGRAMMING CURRENT

5-60 To calibrate the zero current programming accuracy, proceed as follows:

- a. Connect differential voltmeter between +S and -S terminals.
- b. Short out current controls by connecting jumper between terminals A1 and A5.
- c. Rotate VOLTAGE control(s) fully clockwise and turn on supply.
- d. Observe reading on differential voltmeter.
- e. If it is more positive than 0 Volts, shunt resistor R25 with a decade resistance box.
- f. Adjust decade resistance until differential voltmeter reads zero, then shunt R25 with resistance value equal to that of decade resistance.
- g. If reading of Step d is more negative than 0 Volts, shunt resistor R28 with decade resistance.
- h. Adjust decade resistance until differential voltmeter reads zero, then shunt R28 with resistance value equal to that of decade box.

5-61 To calibrate the constant current programming accuracy, proceed as follows:

- a. Connect power supply as shown in Figure 5-4.
- b. Remove strap between A3 and A4 (leaving A4 and A5 jumpered).
- c. Connect a 0.1%, 1/2 Watt resistor between A1 and A5. Resistor value to be as follows:

<u>Model</u>	6253A, 6284A	6255A, 6289A
Resistance	1.5K Ω	750 Ω
<u>Model</u>	6281A	6294A
Resistance	1K Ω	1K Ω

- d. Connect decade resistance box in place of R19.
- e. Set METER switch to highest current range and turn on supply.
- f. Adjust the decade resistance so that the differential voltmeter indicates 1.0 ± 0.01 Vdc.
- g. Replace decade resistance with appropriate value resistor in R19 position.

5-62 REFERENCE CIRCUIT ADJUSTMENTS

5-63 Line Regulation. To adjust the line regulation capabilities of the instrument, proceed as follows:

- a. Connect the differential voltmeter between +S (common) and 33 (positive).
- b. Connect variable voltage transformer between supply and input power source.
- c. Adjust line to 105Vac.
- d. Connect decade resistance in place of R46.
- e. Turn on supply and adjust VOLTAGE control(s) for maximum rated output voltage.
- f. Adjust decade resistance so that voltage

indicated by differential voltmeter does not change more than the following as input line voltage is varied from 105 to 125Vac:

<u>Model No.</u>	6253A, 6284A	6255A, 6289A
Variation (mVdc)	0.95	0.81
<u>Model No.</u>	6281A	6294A
Variation (mVdc)	1.24	0.75

g. Replace decade resistance with appropriate value resistor in R46 position.

5-64 CONSTANT VOLTAGE TRANSIENT RESPONSE

5-65 To adjust the transient response, proceed as follows:

- a. Connect test setup as shown in Figure 5-8.
- b. Repeat Steps a through e as outlined in Paragraph 5-31.
- c. Adjust R30 so that the transient response is as shown in Figure 5-9.

SECTION VI REPLACEABLE PARTS

6-1 INTRODUCTION

6-2 This section contains information for ordering replacement parts. Table 6-4 lists parts in alphanumeric order by reference designators and provides the following information:

- a. Reference Designators. Refer to Table 6-1.
- b. Description. Refer to Table 6-2 for abbreviations.
- c. Total Quantity (TQ). Given only the first time the part number is listed except in instruments containing many sub-modular assemblies, in which case the TQ appears the first time the part number is listed in each assembly.
- d. Manufacturer's Part Number or Type.
- e. Manufacturer's Federal Supply Code Number. Refer to Table 6-3 for manufacturer's name and address.
- f. Hewlett-Packard Part Number.
- g. Recommended Spare Parts Quantity (RS) for complete maintenance of one instrument during one year of isolated service.
- h. Parts not identified by a reference designator are listed at the end of Table 6-4 under Mechanical and/or Miscellaneous. The former consists of parts belonging to and grouped by individual assemblies; the latter consists of all parts not immediately associated with an assembly.

6-3 ORDERING INFORMATION

6-4 To order a replacement part, address order or inquiry to your local Hewlett-Packard sales office (see lists at rear of this manual for addresses). Specify the following information for each part: Model, complete serial number, and any Option or special modification (J) numbers of the instrument; Hewlett-Packard part number; circuit reference designator; and description. To order a part not listed in Table 6-4, give a complete description of the part, its function, and its location.

Table 6-1. Reference Designators

A = assembly	E = miscellaneous
B = blower (fan)	electronic part
C = capacitor	F = fuse
CB = circuit breaker	J = jack, jumper
CR = diode	K = relay
DS = device, signaling (lamp)	L = inductor
	M = meter

Table 6-1. Reference Designators (Continued)

P = plug	V = vacuum tube, neon bulb, photocell, etc.
Q = transistor	
R = resistor	VR = zener diode
S = switch	X = socket
T = transformer	Z = integrated circuit or network
TB = terminal block	
TS = thermal switch	

Table 6-2. Description Abbreviations

A = ampere	mfr = manufacturer
ac = alternating current	mod. = modular or modified
assy. = assembly	mtg = mounting
bd = board	n = nano = 10^{-9}
bkt = bracket	NC = normally closed
°C = degree Centigrade	NO = normally open
cd = card	NP = nickel-plated
coef = coefficient	Ω = ohm
comp = composition	obd = order by description
CRT = cathode-ray tube	OD = outside diameter
CT = center-tapped	p = pico = 10^{-12}
dc = direct current	P.C. = printed circuit
DPDT = double pole, double throw	pot. = potentiometer
DPST = double pole, single throw	p-p = peak-to-peak
elect = electrolytic	ppm = parts per million
encap = encapsulated	pvr = peak reverse voltage
F = farad	rect = rectifier
°F = degree Fahrenheit	rms = root mean square
fxd = fixed	Si = silicon
Ge = germanium	SPDT = single pole, double throw
H = Henry	SPST = single pole, single throw
Hz = Hertz	SS = small signal
IC = integrated circuit	T = slow-blow
ID = inside diameter	tan. = tantulum
incnd = incandescent	Ti = titanium
k = kilo = 10^3	V = volt
m = milli = 10^{-3}	var = variable
M = mega = 10^6	ww = wirewound
μ = micro = 10^{-6}	W = Watt
met. = metal	

Table 6-3. Code List of Manufacturers

CODE NO.	MANUFACTURER	ADDRESS
00629	EBY Sales Co., Inc.	Jamaica, N. Y.
00656	Aerovox Corp.	New Bedford, Mass.
00853	Sangamo Electric Co.	
	S. Carolina Div.	Pickens, S. C.
01121	Allen Bradley Co.	Milwaukee, Wis.
01255	Litton Industries, Inc.	Beverly Hills, Calif.
01281	TRW Semiconductors, Inc.	Lawndale, Calif.
01295	Texas Instruments, Inc.	
	Semiconductor-Components Div.	Dallas, Texas
01686	RCL Electronics, Inc.	Manchester, N. H.
01930	Amerock Corp.	Rockford, Ill.
02107	Sparta Mfg. Co.	Dover, Ohio
02114	Ferroxcube Corp.	Saugerties, N. Y.
02606	Fenwal Laboratories	Morton Grove, Ill.
02660	Amphenol Corp.	Broadview, Ill.
02735	Radio Corp. of America, Solid State	
	and Receiving Tube Div.	Somerville, N. J.
03508	G. E. Semiconductor Products Dept.	
		Syracuse, N. Y.
03797	Eldema Corp.	Compton, Calif.
03877	Transitron Electronic Corp.	Wakefield, Mass.
03888	Pyrofilm Resistor Co. Inc.	Cedar Knolls, N. J.
04009	Arrow, Hart and Hegeman Electric Co.	Hartford, Conn.
04072	ADC Electronics, Inc.	Harbor City, Calif.
04213	Caddell & Burns Mfg. Co. Inc.	Mineola, N. Y.
04404	*Hewlett-Packard Co. Palo Alto Div.	Palo Alto, Calif.
04713	Motorola Semiconductor Prod. Inc.	Phoenix, Arizona
05277	Westinghouse Electric Corp.	
	Semiconductor Dept.	Youngwood, Pa.
05347	Ultronix, Inc.	Grand Junction, Colo.
05820	Wakefield Engr. Inc.	Wakefield, Mass.
06001	General Elect. Co. Electronic	
	Capacitor & Battery Dept.	Irmo, S. C.
06004	Bassik Div. Stewart-Warner Corp.	Bridgeport, Conn.
06486	IRC Div. of TRW Inc.	
	Semiconductor Plant	Lynn, Mass.
06540	Amatom Electronic Hardware Co. Inc.	New Rochelle, N. Y.
06555	Beede Electrical Instrument Co.	Penacook, N. H.
06666	General Devices Co. Inc.	Indianapolis, Ind.
06751	Semcor Div. Components, Inc.	Phoenix, Arizona
06776	Robinson Nugent, Inc.	New Albany, Ind.
06812	Torrington Mfg. Co., West Div.	Van Nuys, Calif.
07137	Transistor Electronics Corp.	Minneapolis, Minn.

CODE NO.	MANUFACTURER	ADDRESS
07138	Westinghouse Electric Corp.	
	Electronic Tube Div.	Elmira, N. Y.
07263	Fairchild Camera and Instrument Corp. Semiconductor Div.	Mountain View, Calif.
07387	Birtcher Corp., The	Los Angeles, Calif.
07397	Sylvania Electric Prod. Inc.	
	Sylvania Electronic Systems	
	Western Div.	Mountain View, Calif.
07716	IRC Div. of TRW Inc. Burlington Plant	Burlington, Iowa
07910	Continental Device Corp.	Hawthorne, Calif.
07933	Raytheon Co. Components Div.	
	Semiconductor Operation	Mountain View, Calif.
08484	Breeze Corporations, Inc.	Union, N. J.
08530	Reliance Mica Corp.	Brooklyn, N. Y.
08717	Sloan Company, The	Sun Valley, Calif.
08730	Vemaline Products Co. Inc.	Wyckoff, N. J.
08806	General Elect. Co. Minia-	
	ture Lamp Dept.	Cleveland, Ohio
08863	Nylomatic Corp.	Norrisville, Pa.
08919	RCH Supply Co.	Vernon, Calif.
09021	Airco Speer Electronic Components	Bradford, Pa.
09182	*Hewlett-Packard Co. New Jersey Div.	Rockaway, N. J.
09213	General Elect. Co. Semiconductor	
	Prod. Dept.	Buffalo, N. Y.
09214	General Elect. Co. Semiconductor	
	Prod. Dept.	Auburn, N. Y.
09353	C & K Components Inc.	Newton, Mass.
09922	Burdy Corp.	Norwalk, Conn.
11115	Wagner Electric Corp.	
	Tung-Sol Div.	Bloomfield, N. J.
11236	CTS of Berne, Inc.	Berne, Ind.
11237	Chicago Telephone of Cal. Inc.	
	So. Pasadena, Calif.	
11502	IRC Div. of TRW Inc. Boone Plant	Boone, N. C.
11711	General Instrument Corp	
	Rectifier Div.	Newark, N. J.
12136	Philadelphia Handle Co. Inc.	Camden, N. J.
12615	U. S. Terminals, Inc.	Cincinnati, Ohio
12617	Hamlin Inc.	Lake Mills, Wisconsin
12697	Clarostat Mfg. Co. Inc.	Dover, N. H.
13103	Thermalloy Co.	Dallas, Texas
14493	*Hewlett-Packard Co. Loveland Div.	Loveland, Colo.
14655	Cornell-Dubilier Electronics Div.	
	Federal Pacific Electric Co.	Newark, N. J.
14936	General Instrument Corp. Semicon-	
	ductor Prod. Group	Hicksville, N. Y.
15801	Fenwal Elect.	Framingham, Mass.
16299	Corning Glass Works, Electronic	
	Components Div.	Raleigh, N. C.

*Use Code 28480 assigned to Hewlett-Packard Co., Palo Alto, California

Table 6-3. Code List of Manufacturers (Continued)

CODE NO.	MANUFACTURER	ADDRESS
16758	Delco Radio Div. of General Motors Corp.	Kokomo, Ind.
17545	Atlantic Semiconductors, Inc.	Asbury Park, N. J.
17803	Fairchild Camera and Instrument Corp Semiconductor Div. Transducer Plant	Mountain View, Calif.
17870	Daven Div. Thomas A. Edison Industries McGraw-Edison Co.	Orange, N. J.
18324	Signetics Corp.	Sunnyvale, Calif.
19315	Bendix Corp. The Navigation and Control Div.	Teterboro, N. J.
19701	Electra/Midland Corp.	Mineral Wells, Texas
21520	Fansteel Metallurgical Corp.	No. Chicago, Ill.
22229	Union Carbide Corp. Electronics Div.	Mountain View, Calif.
22753	UID Electronics Corp.	Hollywood, Fla.
23936	Pamotor, Inc.	Pampa, Texas
24446	General Electric Co.	Schenectady, N. Y.
24455	General Electric Co. Lamp Div. of Con- sumer Prod. Group	Nela Park, Cleveland, Ohio
24655	General Radio Co.	West Concord, Mass.
24681	LTV Electrosystems Inc Memcor/Com- ponents Operations	Huntington, Ind.
26982	Dynacool Mfg. Co. Inc.	Saugerties, N. Y.
27014	National Semiconductor Corp.	Santa Clara, Calif.
28480	Hewlett-Packard Co.	Palo Alto, Calif.
28520	Heyman Mfg. Co.	Kenilworth, N. J.
28875	IMC Magnetics Corp.	
31514	New Hampshire Div. SAE Advance Packaging, Inc.	Rochester, N. H.
31827	Budwig Mfg. Co.	Santa Ana, Calif.
33173	G. E. Co. Tube Dept.	Ramona, Calif.
35434	Lectrohm, Inc.	Owensboro, Ky.
37942	P. R. Mallory & Co. Inc.	Chicago, Ill.
42190		Indianapolis, Ind.
43334	Muter Co. New Departure-Hyatt Bearings Div.	Chicago, Ill.
44655	General Motors Corp.	Sandusky, Ohio
46384	Ohmite Manufacturing Co.	Skokie, Ill.
47904	Penn Engr. and Mfg. Corp.	Doylestown, Pa.
47904	Polaroid Corp.	Cambridge, Mass.
49956	Raytheon Co.	Lexington, Mass.
55026	Simpson Electric Co. Div. of American Gage and Machine Co.	Chicago, Ill.
56289	Sprague Electric Co.	North Adams, Mass.
58474	Superior Electric Co.	Bristol, Conn.
58849	Syntron Div. of FMC Corp.	
59730		Homer City, Pa.
61637	Thomas and Betts Co.	Philadelphia, Pa.
63743	Union Carbide Corp.	New York, N. Y.
	Ward Leonard Electric Co.	Mt. Vernon, N. Y.

CODE NO.	MANUFACTURER	ADDRESS
70563	Amperite Co. Inc.	Union City, N. J.
70901	Beemer Engrg. Co.	Fort Washington, Pa.
70903	Belden Corp.	Chicago, Ill.
71218	Bud Radio, Inc.	Willoughby, Ohio
71279	Cambridge Thermionic Corp.	Cambridge, Mass.
71400	Bussmann Mfg. Div. of McGraw & Edison Co.	St. Louis, Mo.
71450	CTS Corp.	Elkhart, Ind.
71468	I. T. T. Cannon Electric Inc.	Los Angeles, Calif.
71590	Globe-Union Inc.	
71700	Centralab Div. General Cable Corp. Cornish	Milwaukee, Wis.
71707	Wire Co. Div.	Williamstown, Mass.
71744	Coto Coil Co. Inc.	Providence, R. I.
71785	Chicago Miniature Lamp Works	Chicago, Ill.
71984	Cinch Mfg. Co. and Howard B. Jones Div.	Chicago, Ill.
72136	Dow Corning Corp.	Midland, Mich.
72619	Electro Motive Mfg. Co. Inc.	Willimantic, Conn.
72699	Dialight Corp.	Brooklyn, N. Y.
72765	General Instrument Corp.	Newark, N. J.
72962	Drake Mfg. Co.	Harwood Heights, Ill.
72982	Elastic Stop Nut Div. of Amerace Esna Corp.	Union, N. J.
73096	Erie Technological Products Inc.	Erie, Pa.
73138	Hart Mfg. Co.	Hartford, Conn.
73168	Beckman Instruments Inc. Helipot Div.	Fullerton, Calif.
73293	Fenwal, Inc.	Ashland, Mass.
73445	Hughes Aircraft Co. Electron Dynamics Div.	Torrance, Calif.
73506	Amperex Electronic Corp.	Hicksville, N. Y.
73559	Bradley Semiconductor Corp.	New Haven, Conn.
73734	Carling Electric, Inc.	Hartford, Conn.
74193	Federal Screw Products, Inc.	Chicago, Ill.
74545	Heinemann Electric Co.	Trenton, N. J.
74868	Hubbell Harvey Inc.	Bridgeport, Conn.
74970	Amphenol Corp. Amphenol RF Div.	Danbury, Conn.
75042	E. F. Johnson Co.	Waseca, Minn.
75183	IRC Div. of TRW, Inc.	Philadelphia, Pa.
75376	*Howard B. Jones Div. of Cinch Mfg. Corp.	New York, N. Y.
75382	Kurz and Kasch, Inc.	Dayton, Ohio
75915	Kilka Electric Corp.	Mt. Vernon, N. Y.
76381	Littlefuse, Inc.	Des Plaines, Ill.
76385	Minnesota Mining and Mfg. Co.	St. Paul, Minn.
76487	Minor Rubber Co. Inc.	Bloomfield, N. J.
76493	James Millen Mfg. Co. Inc.	Malden, Mass.
	J. W. Miller Co.	Compton, Calif.

*Use Code 71785 assigned to Cinch Mfg. Co., Chicago, Ill.

Table 6-3. Code List of Manufacturers (Continued)

CODE NO.	MANUFACTURER	ADDRESS
76530	Cinch	City of Industry, Calif.
76854	Oak Mfg. Co. Div. of Oak	
77068	Electro/Netics Corp.	Crystal Lake, Ill.
	Bendix Corp., Electrodynamics Div.	
		No. Hollywood, Calif.
77122	Palnut Co.	Mountainside, N. J.
77147	Patton-MacGuyer Co.	Providence, R. I.
77221	Phaotron Instrument and Electronic Co.	
		South Pasadena, Calif.
77252	Philadelphia Steel and Wire Corp.	
		Philadelphia, Pa.
77342	American Machine and Foundry Co.	
	Potter and Erumfield Div.	Princeton, Ind.
77630	TRW Electronic Components Div.	
		Camden, N. J.
77764	Resistance Products Co.	Harrisburg, Pa.
78189	Illinois Tool Works Inc. Shakeproof Div.	
		Elgin, Ill.
78452	Everlock Chicago, Inc.	Chicago, Ill.
78488	Stackpole Carbon Co.	St. Marys, Pa.
78526	Stanwyck Winding Div.	San Fernando
	Electric Mfg. Co. Inc.	Newburgh, N. Y.
78553	Tinnerman Products, Inc.	Cleveland, Ohio
78584	Stewart Stamping Corp.	Yonkers, N. Y.
79136	Waldes Kohinoor, Inc.	L. I. C., N. Y.
79307	Whitehead Metals Inc.	New York, N. Y.
79727	Continental-Wirt Electronics Corp.	
		Philadelphia, Pa.
79963	Zierick Mfg. Co.	Mt. Kisco, N. Y.
80031	Mepco Div. of Sessions Clock Co.	
		Morristown, N. J.
80294	Bourns, Inc.	Riverside, Calif.
81042	Howard Industries Div. of Msl Ind. Inc.	
		Racine, Wisc.
81073	Grayhill, Inc.	La Grange, Ill.
81483	International Rectifier Corp.	
		El Segundo, Calif.
81751	Columbus Electronics Corp.	Yonkers, N. Y.
82099	Goodyear Sundries & Mechanical Co. Inc.	
		New York, N. Y.
82142	Airco Speer Electronic Components	
		Du Bois, Pa.
82219	Sylvania Electric Products Inc.	
	Electronic Tube Div. Receiving	
	Tube Operations	Emporium, Pa.
82389	Switchcraft, Inc.	Chicago, Ill.
82647	Metals and Controls Inc. Control	
	Products Group	Attleboro, Mass.
82866	Research Products Corp.	Madison, Wis.
82877	Rotron Inc.	Woodstock, N. Y.
82893	Vector Electronic Co.	Glendale, Calif.
83058	Carr Fastener Co.	Cambridge, Mass.
83186	Victory Engineering Corp.	
		Springfield, N. J.
83298	Bendix Corp. Electric Power Div.	
		Eatontown, N. J.
83330	Herman H. Smith, Inc.	Brooklyn, N. Y.
83385	Central Screw Co.	Chicago, Ill.
83501	Gavitt Wire and Cable Div. of	
	Amerace Esna Corp.	Brookfield, Mass.


CODE NO.	MANUFACTURER	ADDRESS
83508	Grant Pulley and Hardware Co.	
		West Nyack, N. Y.
83594	Burroughs Corp. Electronic	
	Components Div.	Plainfield, N. J.
83835	U. S. Radium Corp.	Morristown, N. J.
83877	Yardeny Laboratories, Inc.	
		New York, N. Y.
84171	Arco Electronics, Inc.	Great Neck, N. Y.
84411	TRW Capacitor Div.	Ogallala, Neb.
86684	RCA Corp. Electronic Components	
		Harrison, N. J.
86838	Rummel Fibre Co.	Newark, N. J.
87034	Marco & Oak Industries a Div. of Oak	
	Electro/netics Corp.	Anaheim, Calif.
87216	Philco Corp. Lansdale Div.	Lansdale, Pa.
87585	Stockwell Rubber Co. Inc.	
		Philadelphia, Pa.
87929	Tower-Olschan Corp.	Bridgeport, Conn.
88140	Cutler-Hammer Inc. Power Distribution	
	and Control Div. Lincoln Plant	
		Lincoln, Ill.
88245	Litton Precision Products Inc, USECO	
	Div. Litton Industries	Van Nuys, Calif.
90634	Gulton Industries Inc.	Metuchen, N. J.
90763	United-Car Inc.	Chicago, Ill.
91345	Miller Dial and Nameplate Co.	
		El Monte, Calif.
91418	Radio Materials Co.	Chicago, Ill.
91506	Augat, Inc.	Attleboro, Mass.
91637	Dale Electronics, Inc.	Columbus, Neb.
91662	Elco Corp.	Willow Grove, Pa.
91929	Honeywell Inc. Div. Micro Switch	
		Freeport, Ill.
92825	Whitso, Inc.	Schiller Pk., Ill.
93332	Sylvania Electric Prod. Inc. Semi-	
	conductor Prod. Div.	Woburn, Mass.
93410	Essex Wire Corp. Stemco	
	Controls Div.	Mansfield, Ohio
94144	Raytheon Co. Components Div.	
	Ind. Components Oper.	Quincy, Mass.
94154	Wagner Electric Corp.	
	Tung-Sol Div.	Livingston, N. J.
94222	Southco Inc.	Lester, Pa.
95263	Leecraft Mfg. Co. Inc.	L. I. C., N. Y.
95354	Methode Mfg. Co.	Rolling Meadows, Ill.
95712	Bendix Corp. Microwave	
	Devices Div.	Franklin, Ind.
95987	Weckesser Co. Inc.	Chicago, Ill.
96791	Amphenol Corp. Amphenol	
	Controls Div.	Janesville, Wis.
97464	Industrial Retaining Ring Co.	
		Irvington, N. J.
97702	IMC Magnetics Corp. Eastern Div.	
		Westbury, N. Y.
98291	Seaelectro Corp.	Mamaroneck, N. Y.
98410	ETC Inc.	Cleveland, Ohio
98978	International Electronic Research Corp.	
		Burbank, Calif.
99934	Renbrandt, Inc.	Boston, Mass.

Table 6-4. Replaceable Parts

REF. DESIG.	DESCRIPTION	TO	MFR. PART NO.	MFR. CODE	Φ PART NO.	RS
C1	fxd, elect. 5 μ f 150Vdc	1	40D505F150DC4	56289	0180-1841	1
C2	fxd, film .01 μ f 200Vdc	2	192P10392	56289	0160-0161	1
C3	fxd, film .1 μ f 200Vdc	1	192P10492	56289	0160-0168	1
C4, 7, 8, 11	NOT ASSIGNED	-	-	-	-	-
C5	fxd, film .001 μ f 200Vdc	2	192P10292	56289	0160-0153	1
C6	fxd, elect. 20 μ f 15Vdc	1	30D206G015BB4	56289	0180-0300	1
C9	fxd, elect. 4.7 μ f 35Vdc	1	150D475X9035B2	56289	0180-0100	1
C10	fxd, elect: 100 μ f 50Vdc	1		09182	0180-1852	1
C12	fxd, elect. 400 μ f 100Vdc	2		09182	0180-1887	1
C13	fxd, film .001 μ f 200Vdc		192P10292	56289	0160-0153	
C14	fxd, elect. 1000 μ f 100Vdc	1		09182	0180-1881	1
C15	fxd, elect. 10 μ f 100Vdc	1	30D106G100DD4	56289	0180-0091	1
C16, 17	fxd, ceramic .05 μ f 400V	2	33C17A	56289	0150-0052	1
C18	fxd, film .01 μ f 200Vdc		192P10392	56289	0160-0161	
C19	fxd, elect. 20 μ f 200Vdc	1	34D206F200FJ4	56289	0180-0367	1
C20	fxd, elect. 400 μ f 100Vdc			09182	0180-1887	
CR1-CR5	Rect. Si. 200mA 200prv	9	1N485B	93332	1901-0033	6
CR6, 7, 14-17, 21, 28, 29, 35	NOT ASSIGNED	-	-	-	-	-
CR8-CR10	Rect. Si. 400mA 15prv	5	1N4828	03508	1901-0461	5
CR11	Rect. Si. 3A 200prv	3	MR1032B	04713	1901-0416	3
CR12	Stabistor, Si. 2.4V 100mA	2	1N4830	03508	1901-0460	2
CR13	Rect. Si. 400mA 15prv		1N4828	03508	1901-0461	
CR18	Rect. Si. 3A 200prv		MR1032B	04713	1901-0416	
CR19, 20	Rect. Si. 200mA 200prv		1N485B	93332	1901-0033	
CR22-CR25	Rect. Si. 500mA 200prv	4	1N3253	02735	1901-0389	4
CR26, 27	Rect. Si. 1A 400prv	2	1N5060	03508	1901-0328	2
CR30	Rect. Si. 200mA 200prv		1N485B	93332	1901-0033	
CR31	Stabistor, Si. 2.4V 100mA		1N4830	03508	1901-0460	
CR32	Rect. Si. 200mA 200prv		1N485B	93332	1901-0033	
CR33	Rect. Si. 400mA 15prv		1N4828	03508	1901-0461	
CR34	Rect. Si. 3A 200prv		MR1032B	04713	1901-0416	
DS1	Lamp, Neon (Part of S1 Assembly)	1		09182	2140-0244	1
F1	Fuse cartridge 2A @ 25V 3AG	1	312.002	75915	2110-0002	5
M1	Meter, dual scale, 0-70V, 0-1.2A	1		09182	1120-1144	1
Q1, 2	SS NPN Diff. Amp. Si. (Selected)	2	(obd)	09182	1854-0229	2
Q3	SS NPN Si. (Selected)	2	(obd)	09182	1854-0071	2
Q4	SS NPN Si.	1	2N3417	03508	1854-0087	1
Q5, 13	NOT ASSIGNED	-	-	-	-	-
Q6, 7	Power NPN Si. (Selected)	2	(obd)	09182	1854-0250	2
Q8	SS PNP Si.	5	2N2907A	56289	1853-0099	5
Q9	SS NPN Si. (Selected)		(obd)	09182	1854-0071	
Q10	SS PNP Si.		2N2907A	56289	1853-0099	
Q11	SS NPN Diff. Amp. Si.	1	2N4045	61637	1854-0221	1
Q12, 14, 15	SS PNP Si.		2N2907A	56289	1853-0099	
R1	fxd, ww 1K Ω \pm 5% 3W	1	242E1025	56289	0813-0001	1
R2	fxd, met. film 6.2K Ω \pm 1% 1/8W	2	Type CEA T-O	07716	0698-5087	1
R3, 4	fxd, met. film 20K Ω \pm 1% 1/8W	2	Type CEA T-O	07716	0757-0449	1
R5	fxd, met. film 1.5K Ω \pm 1% 1/8W	4	Type CEA T-O	07716	0757-0427	1
R6	fxd, comp 360K Ω \pm 5% 1/2 W	2	EB-3645	01121	0686-3645	1
R7	fxd, met. film 100K Ω \pm 1% 1/8W	1	Type CEA T-O	07716	0757-0465	1

REF. DESIG.	DESCRIPTION	TQ	MFR. PART NO.	MFR. CODE	ϕ PART NO.	RS
R8	fxd, comp 560K Ω \pm 5% $\frac{1}{2}$ W	2	EB-5645	01121	0686-5645	1
R9, 17, 27, 29, 34, 38-40, 53, 55, 78	NOT ASSIGNED	-	-	-	-	-
R10	var. ww 20K Ω \pm 5% 2W 10-Turn	1		09182	2100-1867	1
R11	fxd, ww 2.2K Ω \pm 5% Tap 1K Ω 20W	1		09182	0818-0058	1
R12	fxd, ww 2K Ω \pm 5% 3W	1	242E2025	56289	0811-1806	1
R13	fxd, comp Selected \pm 5% $\frac{1}{2}$ W	2	Type EB (obd)	01121	-	1
R14	fxd, comp 3.3 Ω \pm 5% $\frac{1}{2}$ W	1	EB-33G5	01121	0686-0335	1
R15	fxd, comp 220K Ω \pm 5% $\frac{1}{2}$ W	1	EB-2245	01121	0686-2245	1
R16	var. ww DUAL 1.2K Ω - 20 Ω	1		09182	2100-1803	1
R18	fxd, ww 6.5K Ω \pm 5% 3W	1	242E6525	56289	0811-1814	1
R19	fxd, comp Selected \pm 5% $\frac{1}{2}$ W		Type EB (obd)	01121	-	
R20	fxd, met. film 1K Ω \pm 1% $\frac{1}{4}$ W	1	Type CEB T-O	07716	0757-0338	1
R21	fxd, comp 39 Ω \pm 5% $\frac{1}{2}$ W	1	EB-3905	01121	0686-3905	1
R22	fxd, met. film 6.2K Ω \pm 1% 1/8W		Type CEA T-O	07716	0698-5087	
R23	fxd, met. film 9.09K Ω \pm 1% 1/8W	2	Type CEA T-O	07716	0757-0288	1
R24	fxd, met. film 8.25K Ω \pm 1% 1/8W	1	Type CEA T-O	07716	0757-0441	1
R25	fxd, comp 360K Ω \pm 5% $\frac{1}{2}$ W		EB-3645	01121	0686-3645	
R26	fxd, met. film 1.5K Ω \pm 1% 1/8W		Type CEA T-O	07716	0757-0427	
R28	fxd, comp 560K Ω \pm 5% $\frac{1}{2}$ W		EB-5645	01121	0686-5645	
R30	var. ww 5K Ω (Modify)	1	Type 110-F4	11236	2100-1824	1
R31	fxd, comp 1K Ω \pm 5% $\frac{1}{2}$ W	1	EB-1025	01121	0686-1025	1
R32	fxd, comp 510 Ω \pm 5% $\frac{1}{2}$ W	1	EB-5115	01121	0686-5115	1
R33	fxd, comp 10K Ω \pm 5% $\frac{1}{2}$ W	1	EB-1035	01121	0686-1035	1
R35	fxd, comp 11K Ω \pm 5% $\frac{1}{2}$ W	1	EB-1135	01121	0686-1135	1
R36	fxd, ww 900 Ω \pm 5% 15W	1		09182	0811-0957	1
R37	fxd, comp 33K Ω \pm 5% $\frac{1}{2}$ W	2	EB-3335	01121	0686-3335	1
R41	fxd, comp 12K Ω \pm 5% $\frac{1}{2}$ W	1	EB-1235	01121	0686-1235	1
R42	fxd, comp 6.8K Ω \pm 5% $\frac{1}{2}$ W	1	EB-6825	01121	0686-6825	1
R43	fxd, met. film 510 Ω \pm 1% $\frac{1}{4}$ W	1	Type CEB T-O	07716	0698-5145	1
R44	fxd, comp 47K Ω \pm 5% $\frac{1}{2}$ W	1	EB-4735	01121	0686-4735	1
R45	fxd, comp 5.1K Ω \pm 5% $\frac{1}{2}$ W	1	EB-5125	01121	0686-5125	1
R46	fxd, comp 100K Ω \pm 5% $\frac{1}{2}$ W	1	EB-1045	01121	0686-1045	1
R47	fxd, comp 430 Ω \pm 5% $\frac{1}{2}$ W	1	EB-4315	01121	0686-4315	1
R48	fxd, comp 1.8K Ω \pm 5% $\frac{1}{2}$ W	1	EB-1825	01121	0686-1825	1
R49	fxd, ww 1.5K Ω \pm 5% 15W	1		09182	0811-1824	1
R50	fxd, comp 10 Ω \pm 5% $\frac{1}{2}$ W	1	EB-1005	01121	0686-1005	1
R51	fxd, met. film 33K Ω \pm 1% 1/8W	1		09182	0698-5089	1
R52	fxd, met. film 27.4K Ω \pm 1% 1/8W	1		09182	0757-0452	1
R54	fxd, ww 1 Ω C.T. \pm 5% 20W	1		09182	0811-1819	1
R56	var. ww 1K Ω (Modify)	1	Type 110-F4	11236	2100-0391	1
R57	fxd, met. film 900 Ω \pm 1% 1/8W	2	Type CEA T-O	07716	0757-1099	1
R58, 59	fxd, met. film 100 Ω \pm 1% 1/8W	2	Type CEA T-O	07716	0757-0401	1
R60	fxd, met. film 900 Ω \pm 1% 1/8W		Type CEA T-O	07716	0757-1099	
R61	fxd, met. film 68.1K Ω \pm 1% 1/8W	1	Type CEA T-O	07716	0757-0461	1
R62	fxd, met. film 750 Ω \pm 1% 1/8W	2	Type CEA T-O	07716	0757-0420	1
R63	var. ww 5K Ω	1	Type 110-F4	11236	2100-1824	1
R64, 65	fxd, met. film 12K Ω \pm 1% 1/8W	2	Type CEA T-O	07716	0698-5088	1
R66, 67	fxd, met. film 3.40K Ω \pm 1% $\frac{1}{4}$ W	2	Type CEB T-O	07716	0698-4642	1
R68, 69	fxd, met. film 365 Ω \pm 1% $\frac{1}{4}$ W	2	Type CEB T-O	07716	0757-0723	1
R70, 71	fxd, met. film 3K Ω \pm 1% 1/8W	3	Type CEA T-O	07716	0757-1093	1
R72	var. ww 250 Ω (Modify)	1	Type 110-F4	11236	2100-0439	1
R73	fxd, met. film 750 Ω \pm 1% 1/8W		Type CEA T-O	07716	0757-0420	
R74	fxd, met. film 9.09K Ω \pm 1% 1/8W		Type CEA T-O	07716	0757-0288	
R75	fxd, met. film 3K Ω \pm 1% 1/8W		Type CEA T-O	07716	0757-1093	

REF. DESIG.	DESCRIPTION	TQ	MFR. PART NO.	MFR. CODE	ϕ PART NO.	RS
R76,77	fxd, met. film 1.5K Ω \pm 1% 1/8W		Type CEA T-O	07716	0757-0427	
R79	fxd, ww 3.3 Ω \pm 5% 1W	1	Type BWH	07716	0811-1672	1
R80	fxd, comp 33K Ω \pm 5% $\frac{1}{2}$ W		EB-3335	01121	0686-3335	
R81-R83	fxd, ww 250 Ω \pm 5% 75W	3	Type 6BR-37	73978	0811-1973	1
S1	Switch, Pilot Light (red) (push ON/OFF) SPDT	1	54-61681 26 A1H	87034	3101-0100	1
S2	Meter Switch, Wafer	1		09182	3100-1910	1
T1	Power Transformer	1		09812	9100-1839	1
VR1,2	Diode, Zener 6.2V	2	1N821	06486	1902-0761	2
VR3	Diode, Zener 4.22V	1	1N749	04713	1902-3070	1
	MISCELLANEOUS					
	Chassis Assembly, Right	1		09182	5060-6129	
	Chassis Assembly, Left	1		09182	5060-6130	
	Outrigger Chassis, R81-R83	1		09182	5000-6081	
	Covers, Top and Bottom	2		09182	5000-6061	
	Cover, Outrigger Chassis	1		09182	5000-6077	
	Fastener, Covers	10	C8091-632-24B	89032	0510-0275	2
	Front Panel, Lettered	1		09182	06294-60001	
	Bracket, Transformer, T1	1		09182	5000-6083	
	Heat Sink Assembly, Q6, Q7	1		09182	5060-6128	
	Mica Insulator, Q6, Q7	2	734	08530	0340-0174	2
	Insulator, Transistor Pin, Q6, Q7	4		09182	0340-0166	4
	Insulator, Collector Screws, Q6, Q7	4		09182	0340-0168	4
	P.C. Board, Includes Components	1		09182	06294-60021	
	P.C. Board, Blank	1		09182	5020-5522	
	Rubber Bumper, Foot	4	MB-50	87575	0403-0088	1
	Barrier Strip	1		09182	0360-1234	1
	Jumper, Barrier Strip	8	422-13-11-013	71785	0360-1143	2
	Cover, Barrier Strip	1		09182	5020-5540	
	Knob, Current Control, Coarse	1		09182	0370-0101	1
	Knob, Current Control, Fine	1		09182	0370-0179	1
	Knob, Voltage Control and Meter Switch	2		09182	3070-0084	1
	5 Way Binding Post, Maroon	1	DF21MN	58474	1510-0040	1
	5 Way Binding Post, Black	2	DF21BC	58474	1510-0039	1
	Bezel, Meter	1		09182	4040-0295	1
	Spring, Meter	4		09182	1460-0720	1
	Line Cord	1	KH-4096	70903	8120-0050	1
	Strain Relief Bushing, Line Cord	1	SR-5P-1	28520	0400-0013	1
	Cable Clamp, $\frac{1}{4}$ "	2	T4-4	79307	1400-0330	1
	Fuseholder	1	342014	75915	1400-0084	1
	Nut, Fuseholder	1	903-12	75915	2950-0038	1
	Washer, Neoprene, Fuseholder	1	901-2	75915	1400-0090	1
	Lockwasher, Fuseholder	1	1224-08	78189	2190-0037	1
	End Cap	2		09182	9220-1218	
	Carton, Packing	1		09182	9211-0849	
	OPTION 08: 10-Turn Current Control					
R16	var. ww 1K Ω \pm 5% 10-Turn 2W	1		09182	2100-1864	1
	Knob, R16, Black 5/8 Dia.	1		09182	0370-0137	1

REF. DESIG.	DESCRIPTION	TQ	MFR. PART NO.	MFR. CODE	 PART NO.	RS
	<p>OPTION 13: Three Digit Graduated Decadial Current Control</p> <p>Decadial Control</p>	1	RD-411	07716	1140-0020	1
R16	<p>OPTION 14: Three Digit Graduated Decadial Voltage Control</p> <p>var. ww 1KΩ \pm5% 10-Turn 2W Decadial Control</p>	1 1	RD-411	09182 07716	2100-1864 1140-0020	1 1
F1	<p>OPTION 28: 230Vac Single Phase Input</p> <p>Fuse cartridge 1A 250V</p>	1	312.001	75915	2110-0001	5

APPENDIX A

Option 11, Overvoltage Protection "Crowbar"

DESCRIPTION:

This option is installed in DC Power Supplies, 6200B, 6201B, 6202B, 6203B, 6204B, 6206B, and 6294A, and tested at the factory. It consists of a printed circuit board, screwdriver-type front panel potentiometer, and six wires that are soldered to the main power supply board.

The crowbar monitors the output voltage of the power supply and fires an SCR that shorts the output when it exceeds the preset trip voltage. The trip voltage is determined by the setting of the CROWBAR ADJUST control on the front panel. The trip voltage range is as follows:

Model	6200B	6201B	6202B	6203B	6204B	6205B	6206B 6294A
Trip Voltage Range	2.5-44V	2.5-23V	2.5-44V	2.5-10V	2.5-44V	2.5-44V	2.5-65V

To prevent transients from falsely tripping the crowbar, the trip voltage must be set higher than the power supply output voltage by the following margin: 4% of the output voltage plus 2V. The margin represents the minimum crowbar trip setting for a given output voltage; the trip voltage can always be set higher than this margin.

OPERATION:

1. Turn the CROWBAR ADJUST fully clockwise to set the trip voltage to maximum.
2. Set the power supply VOLTAGE control for the desired crowbar trip voltage. To prevent false crowbar tripping, the trip voltage should exceed the desired output voltage by the following amount: 4% of the output voltage plus 2V.
3. Slowly turn the CROWBAR ADJUST ccw until the crowbar trips, output goes to 0 Volt.
4. The crowbar will remain activated and the output shorted until the supply is turned off. To reset the crowbar, turn the supply off, then on.
5. If the CROWBAR must be completely disabled, remove the lead attached to the CROWBAR ADJUST potentiometer R5.


Table A-1. Replaceable Parts

REF. DESIG.	DESCRIPTION	TQ	MFR. PART NO.	MFR. CODE	PART NO.	RS
C1	fxd, elect. 1 μ f 50Vdc	1	30D105G050BA2	56289	0180-0108	1
C2	fxd, mica 510 μ f 500Vdc	1	RCM15E511J	04062	0140-0047	1
CR1-CR3	Rect. Si. 200mA 200prv	3	1N485E	93332	1901-0033	3
CR4	SCR 7.4A 100prv	1	C20A	03508	1884-0031	1
Q1,2	SS NPN Si.	2	2N3417	03508	1854-0087	2
R1	fxd, met. film 10 Ω \pm 1% 1/8W	1	Type CEA T-O	07716	0757-0346	1
R2	fxd, comp 5.1K Ω \pm 5% 2W	1	Type C42S	16299	0698-3644	1
R3	fxd, met. film 1.21K Ω \pm 1% 1/8W	1	Type CEA T-O	07716	0757-0274	1
R4	fxd, met. film 19.1K Ω \pm 1% 1/8W	1	Type CEA T-O	07716	0698-4484	1
R5	var. ww 10K Ω \pm 5%	1		09182	2100-1854	1
R6	fxd, ww 1K Ω \pm 5% 3W	1	242E1025	56289	0813-0001	1
R7	fxd, comp 22 Ω \pm 5% $\frac{1}{2}$ W	1	EB-2205	01121	0686-2205	1
R8	fxd, met. film 150 Ω \pm 1% 1/8W	1	Type CEA T-O	07716	0757-0284	1
T1	Transformer, Pulse	1		09182	5080-7122	1
VR1	Diode, Zener 16.2V \pm 5%	1	1N966	04713	1902-0184	1
VR2	Diode, Zener 2.37V \pm 5%	1	1N4370	04713	1902-3002	1
MISCELLANEOUS						
	Printed Circuit Board (Blank)	1		09182	5020-5750	
	P. C. Board (Includes Components)	1		09182	06206-6002	1
	Heat Sink	1		09182	5000-6229	
	Insulator (CR4)	1		09182	0340-0462	1
	Mica Washer	1		09182	2190-0709	1
	Cable Clamp	1	T4-4	79307	1400-0330	1
	Front Panel, Modified (Model 6206B)	1		09182	06206-60003	
	Front Panel, Modified (Model 6294A)	1		09182	06294-60003	

DC POWER SUPPLY
MODEL 6206B, 6294A

FROM INBOARD
SIDE OF P54


BIAS VOLTAGE FROM
COLLECTOR OF Q7

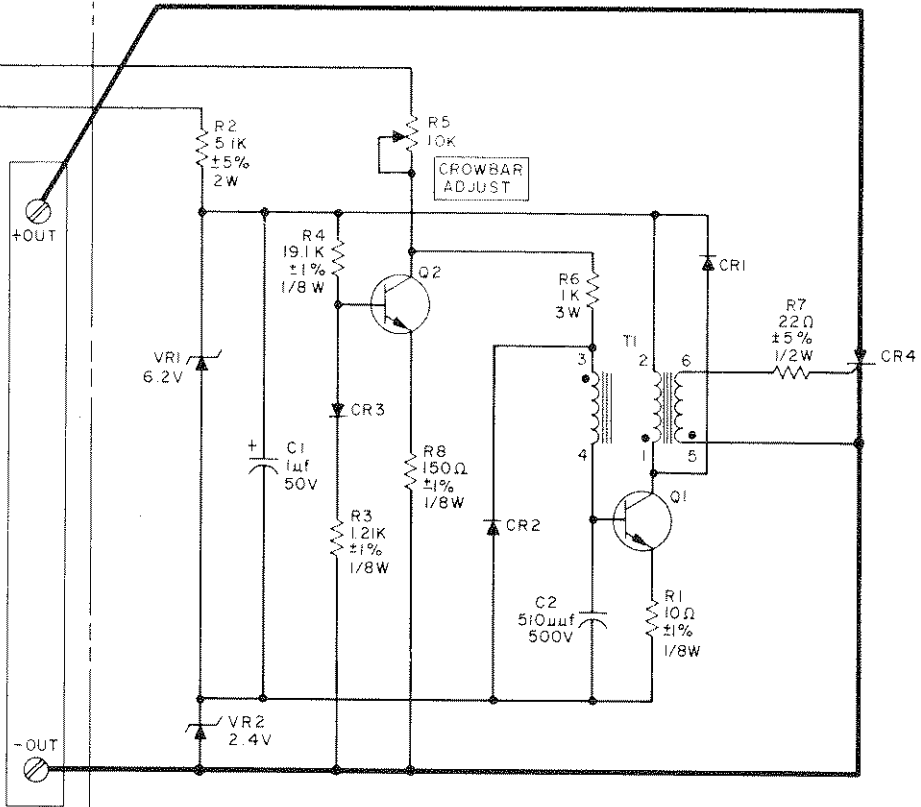


CIRCUIT PATENTS APPLIED FOR. LICENSE TO USE
MUST BE OBTAINED IN WRITING FROM HEWLETT-
PACKARD CO HARRISON DIVISION.

Figure A-1. Model 6206B and Model 6294A Overvoltage Protection "Crowbar"


CURRENT INPUT CKT.

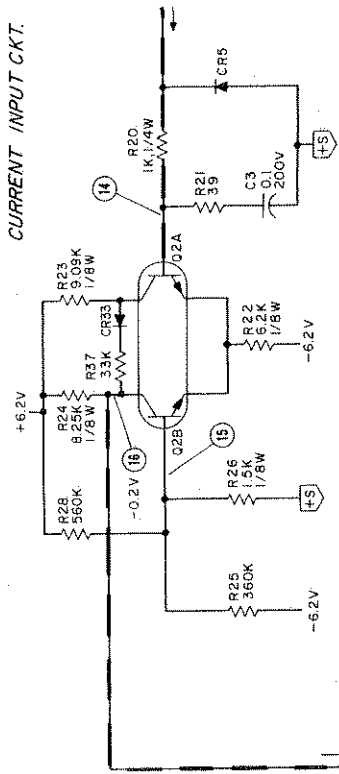


CURR
SAMP
VOLT.
TO MI
CIRC

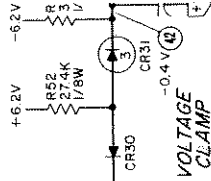


VOLTAGE CLAMP

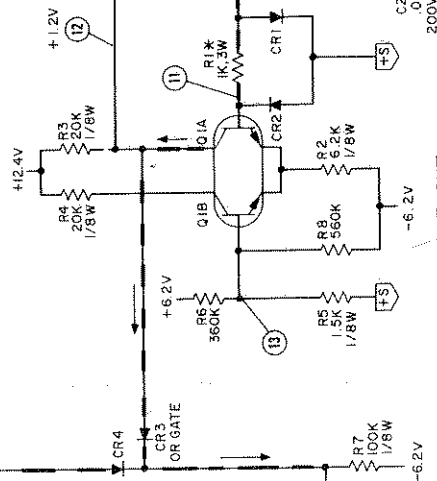


VOLTAGE INPUT CKT.

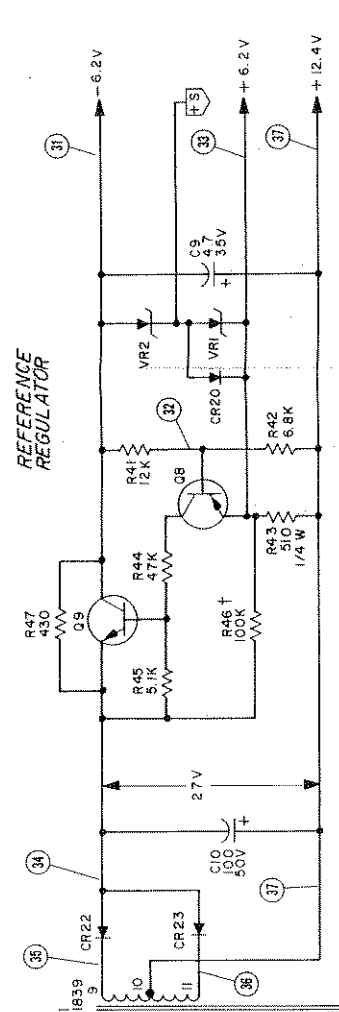

REFERENCE REGULATOR

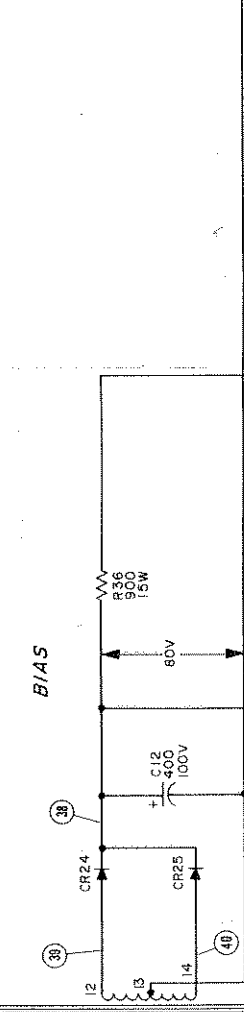

BIAS

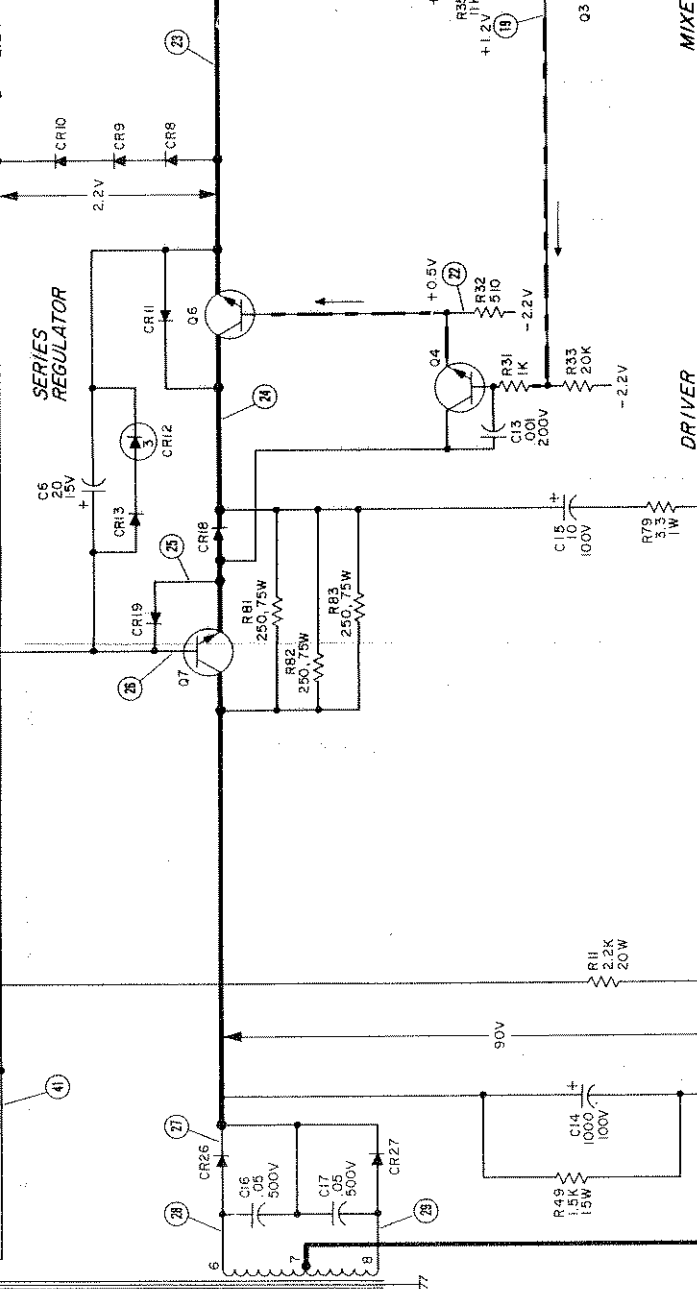


SERIES REGULATOR


DRIVER

MIXER AMPLIFIER

METER CKT.

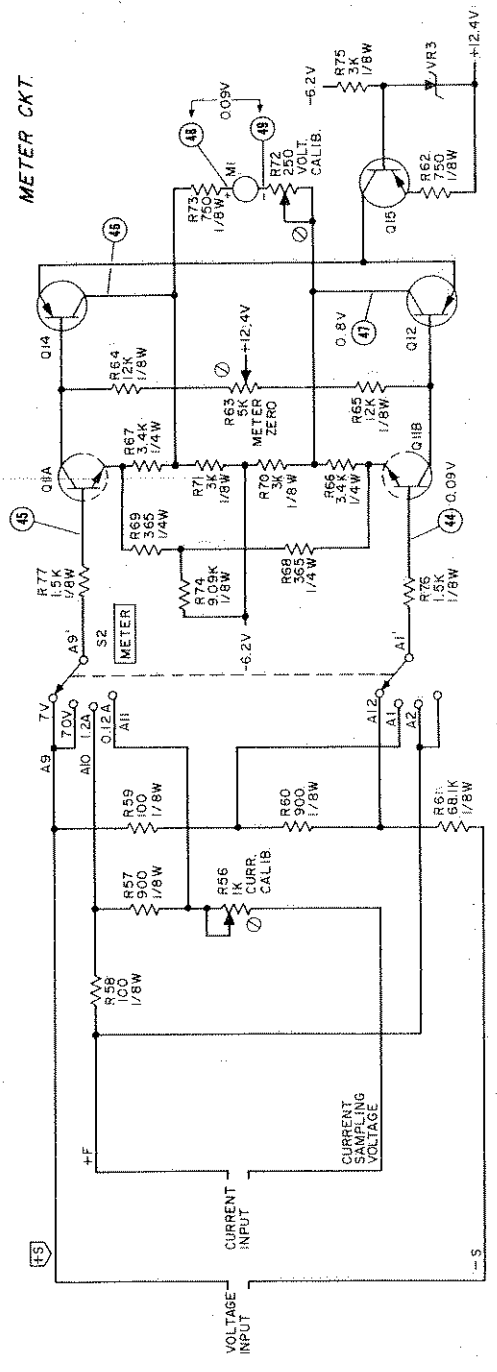

- NOTES:
1. ALL RESISTORS ARE IN OHMS, 1/2W ±5% UNLESS OTHERWISE NOTED.
 2. ALL 1/8W AND 1/4W RESISTORS ARE 1% IN TOLERANCE.
 3. ALL CAPACITORS ARE IN MICROFARADS UNLESS OTHERWISE NOTED.
 4. † DENOTES NOMINAL VALUE COMPONENT SELECTED FOR OPTIMUM PERFORMANCE.
 5. * DENOTES 20PPM WIRE TEMPERATURE COEFFICIENT.
 6. REAR TERMINALS ARE SHOWN IN NORMAL STRAPPING FOR USE OF FRONT PANEL CONTROLS.
 7. — DENOTES VOLTAGE FEEDBACK SIGNAL.
 8. — DENOTES CURRENT FEEDBACK SIGNAL.
 9. POTENTIOMETER R16A & B IS A DUAL SHAFT FRONT PANEL CONTROL.
 10. TRANSFORMER SHOWN STRAPPED FOR 115VAC OPERATION. SEE INSTRUCTION MANUAL FOR 230VAC.
 11. DC VOLTAGES WERE MEASURED UNDER THE FOLLOWING CONDITIONS:
A. SIMPSON MODEL 269 OR EQUIVALENT.
B. 115VAC INPUT.
C. VOLTAGES REFERENCED TO +S UNLESS OTHERWISE NOTED.
D. VOLTAGES ARE TYPICAL ±10% UNLESS OTHERWISE NOTED.
E. ALL READINGS TAKEN IN CONSTANT VOLTAGE OPERATION AT MAXIMUM RATED OUTPUT WITH NO LOAD CONNECTED. CURRENT CONTROLS SHOULD BE TURNED FULLY CLOCKWISE.
 12. □ DENOTES FRONT PANEL MARKING.

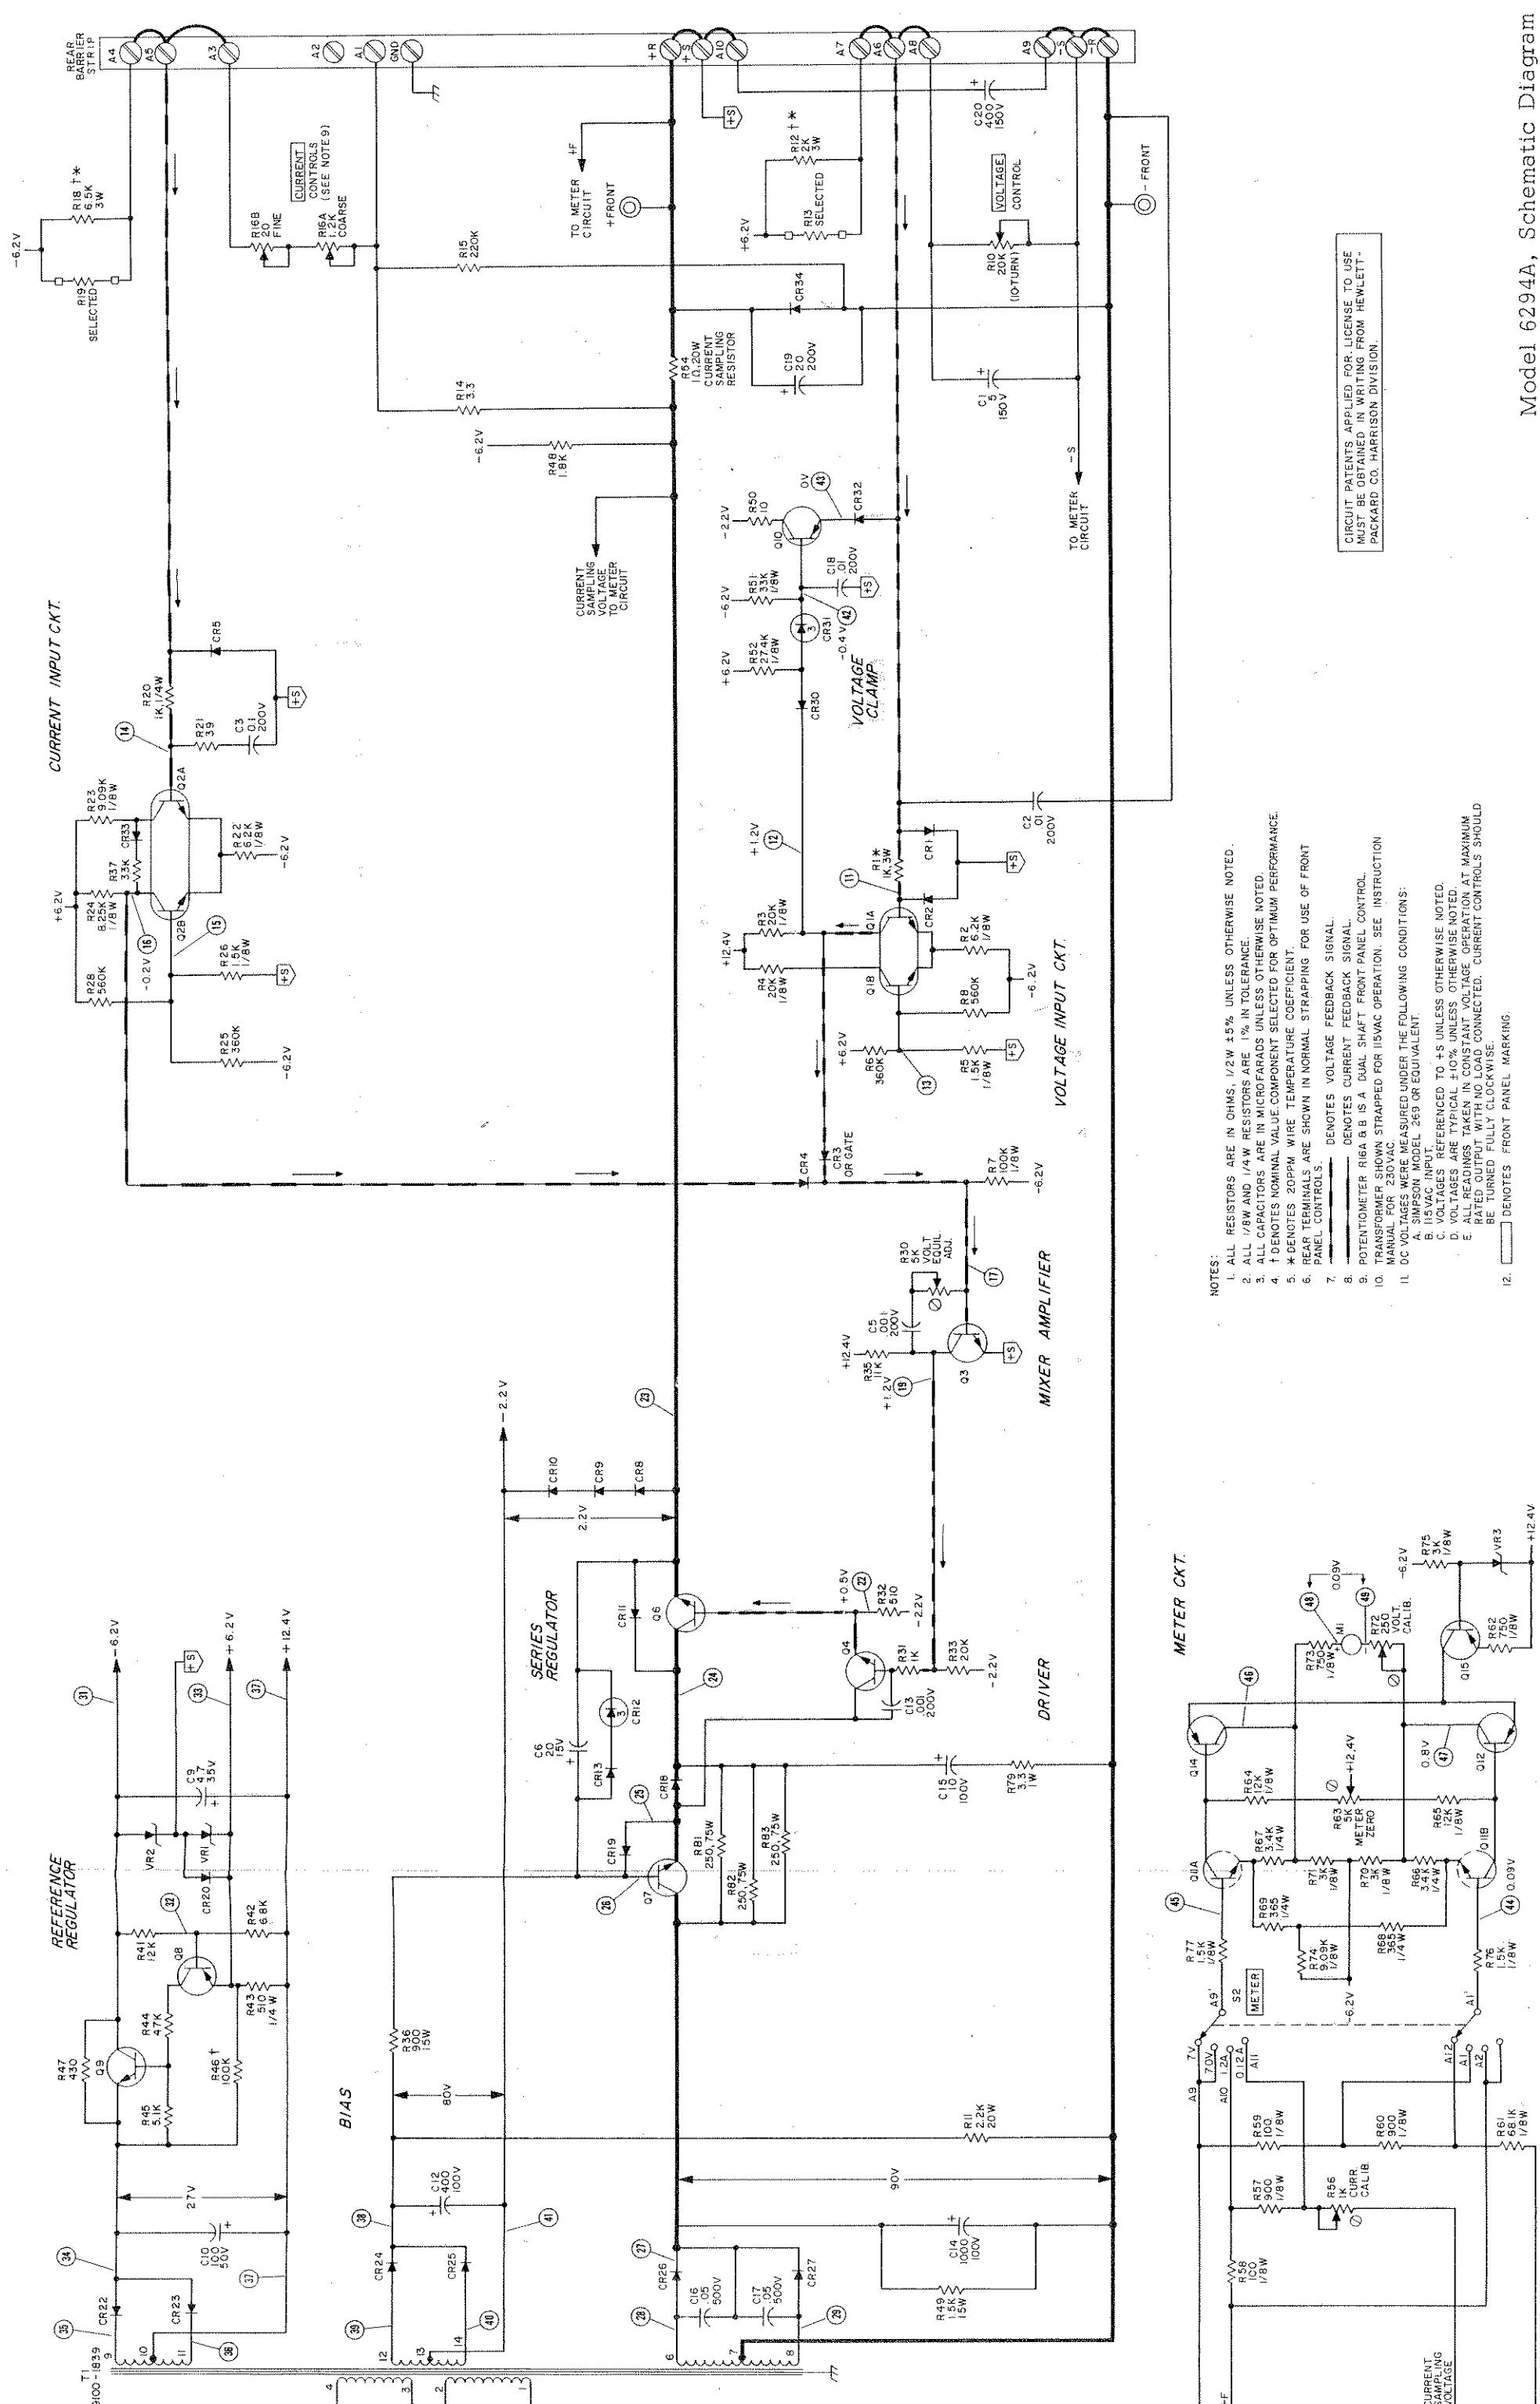

CIRCUIT PATENTS APPLIED FOR LICENSE TO USE MUST BE OBTAINED IN WRITING FROM HEWLETT-PACKARD CO. HARRISON DIVISION.

- NOTES:
1. ALL RESISTORS ARE IN OHMS. 1/2W ±5% UNLESS OTHERWISE NOTED.
 2. ALL 1/8W AND 1/4W RESISTORS ARE 1% IN TOLERANCE UNLESS OTHERWISE NOTED.
 3. ALL CAPACITORS ARE IN MICROFARADS UNLESS OTHERWISE NOTED.
 4. † DENOTES NOMINAL VALUE COMPONENT SELECTED FOR OPTIMUM PERFORMANCE.
 5. * DENOTES 20PPM WIRE TEMPERATURE COEFFICIENT.
 6. REAR TERMINALS ARE SHOWN IN NORMAL STRAPPING FOR USE OF FRONT PANEL CONTROLS.
 7. _____ DENOTES VOLTAGE FEEDBACK SIGNAL.
 8. _____ DENOTES CURRENT FEEDBACK SIGNAL.
 9. POTENTIOMETER R6A & B IS A DUAL SHAFT FRONT-PANEL CONTROL.
 10. TRANSFORMER SHOWN STRAPPED FOR 115VAC OPERATION. SEE INSTRUCTION MANUAL FOR 250VAC.
 11. DC VOLTAGES WERE MEASURED UNDER THE FOLLOWING CONDITIONS:
 A. SIMULON MODEL 259 OR EQUIVALENT.
 B. VOLTAGES ARE TYPICAL ±10% UNLESS OTHERWISE NOTED.
 C. VOLTAGES ARE TYPICAL ±10% UNLESS OTHERWISE NOTED.
 D. ALL READINGS TAKEN IN CONSTANT VOLTAGE OPERATION AT MAXIMUM RATED OUTPUT WITH NO LOAD CONNECTED. CURRENT CONTROLS SHOULD BE TURNED FULLY CLOCKWISE.
 E. _____ DENOTES FRONT PANEL MARKING.
 12. _____

Model 6294A, Schematic Diagram

