# R&S<sup>®</sup> ZNB Vector Network Analyzers User Manual







This manual describes the following vector network analyzer types and their options:

- R&S<sup>®</sup> ZNB4, order no. 1311.6010.22 (2 test ports)
- R&S<sup>®</sup> ZNB4, order no. 1311.6010.24 (4 test ports)
- R&S<sup>®</sup> ZNB8, order no. 1311.6010.42 (2 test ports)
- R&S<sup>®</sup> ZNB8, order no. 1311.6010.44 (4 test ports)

The firmware of the instrument makes use of several valuable open source software packages. For information, see the "Open Source Acknowledgement" on the user documentation CD-ROM (included in delivery).

Rohde & Schwarz would like to thank the open source community for their valuable contribution to embedded computing.

© 2012 Rohde & Schwarz GmbH & Co. KG Muehldorfstr. 15, 81671 Munich, Germany Phone: +49 89 41 29 - 0 Fax: +49 89 41 29 12 164 E-mail: info@rohde-schwarz.com Internet: http://www.rohde-schwarz.com Printed in Germany – Subject to change – Data without tolerance limits is not binding. R&S<sup>®</sup> is a registered trademark of Rohde & Schwarz GmbH & Co. KG.

Trade names are trademarks of the owners.

The following abbreviations are used throughout this guide: R&S<sup>®</sup> ZNBxx is abbreviated as R&S ZNBxx, R&S<sup>®</sup> ZNB-xxx as R&S ZNBxxx

# **Basic Safety Instructions**

#### Always read through and comply with the following safety instructions!

All plants and locations of the Rohde & Schwarz group of companies make every effort to keep the safety standards of our products up to date and to offer our customers the highest possible degree of safety. Our products and the auxiliary equipment they require are designed, built and tested in accordance with the safety standards that apply in each case. Compliance with these standards is continuously monitored by our quality assurance system. The product described here has been designed, built and tested in accordance with the EC Certificate of Conformity and has left the manufacturer's plant in a condition fully complying with safety standards. To maintain this condition and to ensure safe operation, you must observe all instructions and warnings provided in this manual. If you have any questions regarding these safety instructions, the Rohde & Schwarz group of companies will be happy to answer them.

Furthermore, it is your responsibility to use the product in an appropriate manner. This product is designed for use solely in industrial and laboratory environments or, if expressly permitted, also in the field and must not be used in any way that may cause personal injury or property damage. You are responsible if the product is used for any purpose other than its designated purpose or in disregard of the manufacturer's instructions. The manufacturer shall assume no responsibility for such use of the product.

The product is used for its designated purpose if it is used in accordance with its product documentation and within its performance limits (see data sheet, documentation, the following safety instructions). Using the product requires technical skills and, in some cases, a basic knowledge of English. It is therefore essential that only skilled and specialized staff or thoroughly trained personnel with the required skills be allowed to use the product. If personal safety gear is required for using Rohde & Schwarz products, this will be indicated at the appropriate place in the product documentation. Keep the basic safety instructions and the product documentation in a safe place and pass them on to the subsequent users.

Observing the safety instructions will help prevent personal injury or damage of any kind caused by dangerous situations. Therefore, carefully read through and adhere to the following safety instructions before and when using the product. It is also absolutely essential to observe the additional safety instructions on personal safety, for example, that appear in relevant parts of the product documentation. In these safety instructions, the word "product" refers to all merchandise sold and distributed by the Rohde & Schwarz group of companies, including instruments, systems and all accessories. For product-specific information, see the data sheet and the product documentation.

#### Safety labels on products

The following safety labels are used on products to warn against risks and dangers.

Symbol	Meaning	Symbol	Meaning
	Notice, general danger location Observe product documentation	10	ON/OFF supply voltage
	Caution when handling heavy equipment	$\bigcirc$	Standby indication
4	Danger of electric shock		Direct current (DC)

1171.0000.42 - 07

Symbol	Meaning	Symbol	Meaning
	Warning! Hot surface	$\sim$	Alternating current (AC)
	Protective conductor terminal	$\sim$	Direct/alternating current (DC/AC)
	Ground		Device fully protected by double (reinforced) insulation
r+7	Ground terminal	X	EU labeling for batteries and accumulators For additional information, see section "Waste disposal/Environmental protection", item 1.
	Be careful when handling electrostatic sensitive devices	X	EU labeling for separate collection of electrical and electronic devices For additonal information, see section "Waste disposal/Environmental protection", item 2.
	Warning! Laser radiation For additional information, see section "Operation", item 7.		

#### Signal words and their meaning

The following signal words are used in the product documentation in order to warn the reader about risks and dangers.



Indicates a hazardous situation which, if not avoided, will result in death or serious injury.

Indicates a hazardous situation which, if not avoided, could result in death or serious injury.

Indicates a hazardous situation which, if not avoided, could result in minor or moderate injury.

Indicates information considered important, but not hazard-related, e.g. messages relating to property damage. In the product documentation, the word ATTENTION is used synonymously.

These signal words are in accordance with the standard definition for civil applications in the European Economic Area. Definitions that deviate from the standard definition may also exist in other economic areas or military applications. It is therefore essential to make sure that the signal words described here are always used only in connection with the related product documentation and the related product. The use of signal words in connection with unrelated products or documentation can result in misinterpretation and in personal injury or material damage.

1171.0000.42 - 07

#### Operating states and operating positions

The product may be operated only under the operating conditions and in the positions specified by the manufacturer, without the product's ventilation being obstructed. If the manufacturer's specifications are not observed, this can result in electric shock, fire and/or serious personal injury or death. Applicable local or national safety regulations and rules for the prevention of accidents must be observed in all work performed.

- Unless otherwise specified, the following requirements apply to Rohde & Schwarz products: predefined operating position is always with the housing floor facing down, IP protection 2X, use only indoors, max. operating altitude 2000 m above sea level, max. transport altitude 4500 m above sea level. A tolerance of ±10 % shall apply to the nominal voltage and ±5 % to the nominal frequency, overvoltage category 2, pollution severity 2.
- 2. Do not place the product on surfaces, vehicles, cabinets or tables that for reasons of weight or stability are unsuitable for this purpose. Always follow the manufacturer's installation instructions when installing the product and fastening it to objects or structures (e.g. walls and shelves). An installation that is not carried out as described in the product documentation could result in personal injury or even death.
- 3. Do not place the product on heat-generating devices such as radiators or fan heaters. The ambient temperature must not exceed the maximum temperature specified in the product documentation or in the data sheet. Product overheating can cause electric shock, fire and/or serious personal injury or even death.

#### **Electrical safety**

If the information on electrical safety is not observed either at all or to the extent necessary, electric shock, fire and/or serious personal injury or death may occur.

- 1. Prior to switching on the product, always ensure that the nominal voltage setting on the product matches the nominal voltage of the AC supply network. If a different voltage is to be set, the power fuse of the product may have to be changed accordingly.
- 2. In the case of products of safety class I with movable power cord and connector, operation is permitted only on sockets with a protective conductor contact and protective conductor.
- 3. Intentionally breaking the protective conductor either in the feed line or in the product itself is not permitted. Doing so can result in the danger of an electric shock from the product. If extension cords or connector strips are implemented, they must be checked on a regular basis to ensure that they are safe to use.
- 4. If there is no power switch for disconnecting the product from the AC supply network, or if the power switch is not suitable for this purpose, use the plug of the connecting cable to disconnect the product from the AC supply network. In such cases, always ensure that the power plug is easily reachable and accessible at all times. For example, if the power plug is the disconnecting device, the length of the connecting cable must not exceed 3 m. Functional or electronic switches are not suitable for providing disconnection from the AC supply network. If products without power switches are integrated into racks or systems, the disconnecting device must be provided at the system level.
- 5. Never use the product if the power cable is damaged. Check the power cables on a regular basis to ensure that they are in proper operating condition. By taking appropriate safety measures and carefully laying the power cable, ensure that the cable cannot be damaged and that no one can be hurt by, for example, tripping over the cable or suffering an electric shock.

1171.0000.42 - 07

- 6. The product may be operated only from TN/TT supply networks fuse-protected with max. 16 A (higher fuse only after consulting with the Rohde & Schwarz group of companies).
- 7. Do not insert the plug into sockets that are dusty or dirty. Insert the plug firmly and all the way into the socket provided for this purpose. Otherwise, sparks that result in fire and/or injuries may occur.
- 8. Do not overload any sockets, extension cords or connector strips; doing so can cause fire or electric shocks.
- For measurements in circuits with voltages V<sub>rms</sub> > 30 V, suitable measures (e.g. appropriate measuring equipment, fuse protection, current limiting, electrical separation, insulation) should be taken to avoid any hazards.
- 10. Ensure that the connections with information technology equipment, e.g. PCs or other industrial computers, comply with the IEC60950-1/EN60950-1 or IEC61010-1/EN 61010-1 standards that apply in each case.
- 11. Unless expressly permitted, never remove the cover or any part of the housing while the product is in operation. Doing so will expose circuits and components and can lead to injuries, fire or damage to the product.
- 12. If a product is to be permanently installed, the connection between the protective conductor terminal on site and the product's protective conductor must be made first before any other connection is made. The product may be installed and connected only by a licensed electrician.
- 13. For permanently installed equipment without built-in fuses, circuit breakers or similar protective devices, the supply circuit must be fuse-protected in such a way that anyone who has access to the product, as well as the product itself, is adequately protected from injury or damage.
- 14. Use suitable overvoltage protection to ensure that no overvoltage (such as that caused by a bolt of lightning) can reach the product. Otherwise, the person operating the product will be exposed to the danger of an electric shock.
- 15. Any object that is not designed to be placed in the openings of the housing must not be used for this purpose. Doing so can cause short circuits inside the product and/or electric shocks, fire or injuries.
- 16. Unless specified otherwise, products are not liquid-proof (see also section "Operating states and operating positions", item 1). Therefore, the equipment must be protected against penetration by liquids. If the necessary precautions are not taken, the user may suffer electric shock or the product itself may be damaged, which can also lead to personal injury.
- 17. Never use the product under conditions in which condensation has formed or can form in or on the product, e.g. if the product has been moved from a cold to a warm environment. Penetration by water increases the risk of electric shock.
- 18. Prior to cleaning the product, disconnect it completely from the power supply (e.g. AC supply network or battery). Use a soft, non-linting cloth to clean the product. Never use chemical cleaning agents such as alcohol, acetone or diluents for cellulose lacquers.

#### Operation

1. Operating the products requires special training and intense concentration. Make sure that persons who use the products are physically, mentally and emotionally fit enough to do so; otherwise, injuries or material damage may occur. It is the responsibility of the employer/operator to select suitable personnel for operating the products.

1171.0000.42 - 07

- 2. Before you move or transport the product, read and observe the section titled "Transport".
- 3. As with all industrially manufactured goods, the use of substances that induce an allergic reaction (allergens) such as nickel cannot be generally excluded. If you develop an allergic reaction (such as a skin rash, frequent sneezing, red eyes or respiratory difficulties) when using a Rohde & Schwarz product, consult a physician immediately to determine the cause and to prevent health problems or stress.
- 4. Before you start processing the product mechanically and/or thermally, or before you take it apart, be sure to read and pay special attention to the section titled "Waste disposal/Environmental protection", item 1.
- 5. Depending on the function, certain products such as RF radio equipment can produce an elevated level of electromagnetic radiation. Considering that unborn babies require increased protection, pregnant women must be protected by appropriate measures. Persons with pacemakers may also be exposed to risks from electromagnetic radiation. The employer/operator must evaluate workplaces where there is a special risk of exposure to radiation and, if necessary, take measures to avert the potential danger.
- 6. Should a fire occur, the product may release hazardous substances (gases, fluids, etc.) that can cause health problems. Therefore, suitable measures must be taken, e.g. protective masks and protective clothing must be worn.
- 7. Laser products are given warning labels that are standardized according to their laser class. Lasers can cause biological harm due to the properties of their radiation and due to their extremely concentrated electromagnetic power. If a laser product (e.g. a CD/DVD drive) is integrated into a Rohde & Schwarz product, absolutely no other settings or functions may be used as described in the product documentation. The objective is to prevent personal injury (e.g. due to laser beams).
- 8. EMC classes (in line with EN 55011/CISPR 11, and analogously with EN 55022/CISPR 22, EN 55032/CISPR 32)
  - Class A equipment:

Equipment suitable for use in all environments except residential environments and environments that are directly connected to a low-voltage supply network that supplies residential buildings Note: Class A equipment is intended for use in an industrial environment. This equipment may cause radio disturbances in residential environments, due to possible conducted as well as radiated disturbances. In this case, the operator may be required to take appropriate measures to eliminate these disturbances.

Class B equipment:
 Equipment suitable for use in residential environments and environments that are directly connected to a low-voltage supply network that supplies residential buildings

#### **Repair and service**

1. The product may be opened only by authorized, specially trained personnel. Before any work is performed on the product or before the product is opened, it must be disconnected from the AC supply network. Otherwise, personnel will be exposed to the risk of an electric shock.

1171.0000.42 - 07

2. Adjustments, replacement of parts, maintenance and repair may be performed only by electrical experts authorized by Rohde & Schwarz. Only original parts may be used for replacing parts relevant to safety (e.g. power switches, power transformers, fuses). A safety test must always be performed after parts relevant to safety have been replaced (visual inspection, protective conductor test, insulation resistance measurement, leakage current measurement, functional test). This helps ensure the continued safety of the product.

#### Batteries and rechargeable batteries/cells

If the information regarding batteries and rechargeable batteries/cells is not observed either at all or to the extent necessary, product users may be exposed to the risk of explosions, fire and/or serious personal injury, and, in some cases, death. Batteries and rechargeable batteries with alkaline electrolytes (e.g. lithium cells) must be handled in accordance with the EN 62133 standard.

- 1. Cells must not be taken apart or crushed.
- 2. Cells or batteries must not be exposed to heat or fire. Storage in direct sunlight must be avoided. Keep cells and batteries clean and dry. Clean soiled connectors using a dry, clean cloth.
- 3. Cells or batteries must not be short-circuited. Cells or batteries must not be stored in a box or in a drawer where they can short-circuit each other, or where they can be short-circuited by other conductive materials. Cells and batteries must not be removed from their original packaging until they are ready to be used.
- 4. Cells and batteries must not be exposed to any mechanical shocks that are stronger than permitted.
- 5. If a cell develops a leak, the fluid must not be allowed to come into contact with the skin or eyes. If contact occurs, wash the affected area with plenty of water and seek medical aid.
- 6. Improperly replacing or charging cells or batteries that contain alkaline electrolytes (e.g. lithium cells) can cause explosions. Replace cells or batteries only with the matching Rohde & Schwarz type (see parts list) in order to ensure the safety of the product.
- 7. Cells and batteries must be recycled and kept separate from residual waste. Rechargeable batteries and normal batteries that contain lead, mercury or cadmium are hazardous waste. Observe the national regulations regarding waste disposal and recycling.

#### Transport

- 1. The product may be very heavy. Therefore, the product must be handled with care. In some cases, the user may require a suitable means of lifting or moving the product (e.g. with a lift-truck) to avoid back or other physical injuries.
- 2. Handles on the products are designed exclusively to enable personnel to transport the product. It is therefore not permissible to use handles to fasten the product to or on transport equipment such as cranes, fork lifts, wagons, etc. The user is responsible for securely fastening the products to or on the means of transport or lifting. Observe the safety regulations of the manufacturer of the means of transport or lifting. Noncompliance can result in personal injury or material damage.
- 3. If you use the product in a vehicle, it is the sole responsibility of the driver to drive the vehicle safely and properly. The manufacturer assumes no responsibility for accidents or collisions. Never use the product in a moving vehicle if doing so could distract the driver of the vehicle. Adequately secure the product in the vehicle to prevent injuries or other damage in the event of an accident.

1171.0000.42 - 07

#### Waste disposal/Environmental protection

- 1. Specially marked equipment has a battery or accumulator that must not be disposed of with unsorted municipal waste, but must be collected separately. It may only be disposed of at a suitable collection point or via a Rohde & Schwarz customer service center.
- Waste electrical and electronic equipment must not be disposed of with unsorted municipal waste, but must be collected separately.
   Rohde & Schwarz GmbH & Co. KG has developed a disposal concept and takes full responsibility for take-back obligations and disposal obligations for manufacturers within the EU. Contact your Rohde & Schwarz customer service center for environmentally responsible disposal of the product.
- 3. If products or their components are mechanically and/or thermally processed in a manner that goes beyond their intended use, hazardous substances (heavy-metal dust such as lead, beryllium, nickel) may be released. For this reason, the product may only be disassembled by specially trained personnel. Improper disassembly may be hazardous to your health. National waste disposal regulations must be observed.
- 4. If handling the product releases hazardous substances or fuels that must be disposed of in a special way, e.g. coolants or engine oils that must be replenished regularly, the safety instructions of the manufacturer of the hazardous substances or fuels and the applicable regional waste disposal regulations must be observed. Also observe the relevant safety instructions in the product documentation. The improper disposal of hazardous substances or fuels can cause health problems and lead to environmental damage.

For additional information about environmental protection, visit the Rohde & Schwarz website.

# Instrucciones de seguridad elementales

#### ¡Es imprescindible leer y cumplir las siguientes instrucciones e informaciones de seguridad!

El principio del grupo de empresas Rohde & Schwarz consiste en tener nuestros productos siempre al día con los estándares de seguridad y de ofrecer a nuestros clientes el máximo grado de seguridad. Nuestros productos y todos los equipos adicionales son siempre fabricados y examinados según las normas de seguridad vigentes. Nuestro sistema de garantía de calidad controla constantemente que sean cumplidas estas normas. El presente producto ha sido fabricado y examinado según el certificado de conformidad de la UE y ha salido de nuestra planta en estado impecable según los estándares técnicos de seguridad. Para poder preservar este estado y garantizar un funcionamiento libre de peligros, el usuario deberá atenerse a todas las indicaciones, informaciones de seguridad y notas de alerta. El grupo de empresas Rohde & Schwarz está siempre a su disposición en caso de que tengan preguntas referentes a estas informaciones de seguridad.

Además queda en la responsabilidad del usuario utilizar el producto en la forma debida. Este producto está destinado exclusivamente al uso en la industria y el laboratorio o, si ha sido expresamente autorizado, para aplicaciones de campo y de ninguna manera deberá ser utilizado de modo que alguna persona/cosa pueda sufrir daño. El uso del producto fuera de sus fines definidos o sin tener en cuenta las instrucciones del fabricante queda en la responsabilidad del usuario. El fabricante no se hace en ninguna forma responsable de consecuencias a causa del mal uso del producto.

1171.0000.42 - 07

Se parte del uso correcto del producto para los fines definidos si el producto es utilizado conforme a las indicaciones de la correspondiente documentación del producto y dentro del margen de rendimiento definido (ver hoja de datos, documentación, informaciones de seguridad que siguen). El uso del producto hace necesarios conocimientos técnicos y ciertos conocimientos del idioma inglés. Por eso se debe tener en cuenta que el producto solo pueda ser operado por personal especializado o personas instruidas en profundidad con las capacidades correspondientes. Si fuera necesaria indumentaria de seguridad para el uso de productos de Rohde & Schwarz, encontraría la informaciones de seguridad elementales, así como la documentación del producto, y entréguelas a usuarios posteriores.

Tener en cuenta las informaciones de seguridad sirve para evitar en lo posible lesiones o daños por peligros de toda clase. Por eso es imprescindible leer detalladamente y comprender por completo las siguientes informaciones de seguridad antes de usar el producto, y respetarlas durante el uso del producto. Deberán tenerse en cuenta todas las demás informaciones de seguridad, como p. ej. las referentes a la protección de personas, que encontrarán en el capítulo correspondiente de la documentación del producto y que también son de obligado cumplimiento. En las presentes informaciones de seguridad se recogen todos los objetos que distribuye el grupo de empresas Rohde & Schwarz bajo la denominación de "producto", entre ellos también aparatos, instalaciones así como toda clase de accesorios. Los datos específicos del producto figuran en la hoja de datos y en la documentación del producto.

#### Señalización de seguridad de los productos

Símbolo	Significado	Símbolo	Significado
	Aviso: punto de peligro general Observar la documentación del producto	10	Tensión de alimentación de PUESTA EN MARCHA / PARADA
18 kg	Atención en el manejo de dispositivos de peso elevado	$\bigcirc$	Indicación de estado de espera (standby)
	Peligro de choque eléctrico		Corriente continua (DC)
	Advertencia: superficie caliente	$\sim$	Corriente alterna (AC)
	Conexión a conductor de protección	$\sim$	Corriente continua / Corriente alterna (DC/AC)
	Conexión a tierra		El aparato está protegido en su totalidad por un aislamiento doble (reforzado)
-+-7	Conexión a masa	X	Distintivo de la UE para baterías y acumuladores Más información en la sección "Eliminación/protección del medio ambiente", punto 1.


Las siguientes señales de seguridad se utilizan en los productos para advertir sobre riesgos y peligros.

1171.0000.42 - 07

Símbolo	Significado	Símbolo	Significado
	Aviso: Cuidado en el manejo de dispositivos sensibles a la electrostática (ESD)		Distintivo de la UE para la eliminación por separado de dispositivos eléctricos y electrónicos Más información en la sección "Eliminación/protección del medio ambiente", punto 2.
	Advertencia: rayo láser Más información en la sección "Funcionamiento", punto 7.		

#### Palabras de señal y su significado

En la documentación del producto se utilizan las siguientes palabras de señal con el fin de advertir contra riesgos y peligros.

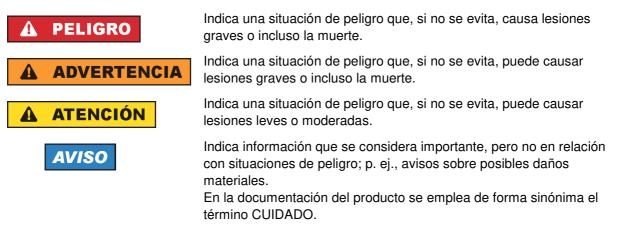

Las palabras de señal corresponden a la definición habitual para aplicaciones civiles en el área económica europea. Pueden existir definiciones diferentes a esta definición en otras áreas económicas o en aplicaciones militares. Por eso se deberá tener en cuenta que las palabras de señal aquí descritas sean utilizadas siempre solamente en combinación con la correspondiente documentación del producto y solamente en combinación con el producto correspondiente. La utilización de las palabras de señal en combinación con productos o documentaciones que no les correspondan puede llevar a interpretaciones equivocadas y tener por consecuencia daños en personas u objetos.

#### Estados operativos y posiciones de funcionamiento

El producto solamente debe ser utilizado según lo indicado por el fabricante respecto a los estados operativos y posiciones de funcionamiento sin que se obstruya la ventilación. Si no se siguen las indicaciones del fabricante, pueden producirse choques eléctricos, incendios y/o lesiones graves con posible consecuencia de muerte. En todos los trabajos deberán ser tenidas en cuenta las normas nacionales y locales de seguridad del trabajo y de prevención de accidentes.

- Si no se convino de otra manera, es para los productos Rohde & Schwarz válido lo que sigue: como posición de funcionamiento se define por principio la posición con el suelo de la caja para abajo, modo de protección IP 2X, uso solamente en estancias interiores, utilización hasta 2000 m sobre el nivel del mar, transporte hasta 4500 m sobre el nivel del mar. Se aplicará una tolerancia de ±10 % sobre el voltaje nominal y de ±5 % sobre la frecuencia nominal. Categoría de sobrecarga eléctrica 2, índice de suciedad 2.
- 2. No sitúe el producto encima de superficies, vehículos, estantes o mesas, que por sus características de peso o de estabilidad no sean aptos para él. Siga siempre las instrucciones de instalación del fabricante cuando instale y asegure el producto en objetos o estructuras (p. ej. paredes y estantes). Si se realiza la instalación de modo distinto al indicado en la documentación del producto, se pueden causar lesiones o, en determinadas circunstancias, incluso la muerte.
- 3. No ponga el producto sobre aparatos que generen calor (p. ej. radiadores o calefactores). La temperatura ambiente no debe superar la temperatura máxima especificada en la documentación del producto o en la hoja de datos. En caso de sobrecalentamiento del producto, pueden producirse choques eléctricos, incendios y/o lesiones graves con posible consecuencia de muerte.

#### Seguridad eléctrica

Si no se siguen (o se siguen de modo insuficiente) las indicaciones del fabricante en cuanto a seguridad eléctrica, pueden producirse choques eléctricos, incendios y/o lesiones graves con posible consecuencia de muerte.

- Antes de la puesta en marcha del producto se deberá comprobar siempre que la tensión preseleccionada en el producto coincida con la de la red de alimentación eléctrica. Si es necesario modificar el ajuste de tensión, también se deberán cambiar en caso dado los fusibles correspondientes del producto.
- 2. Los productos de la clase de protección I con alimentación móvil y enchufe individual solamente podrán enchufarse a tomas de corriente con contacto de seguridad y con conductor de protección conectado.
- 3. Queda prohibida la interrupción intencionada del conductor de protección, tanto en la toma de corriente como en el mismo producto. La interrupción puede tener como consecuencia el riesgo de que el producto sea fuente de choques eléctricos. Si se utilizan cables alargadores o regletas de enchufe, deberá garantizarse la realización de un examen regular de los mismos en cuanto a su estado técnico de seguridad.
- 4. Si el producto no está equipado con un interruptor para desconectarlo de la red, o bien si el interruptor existente no resulta apropiado para la desconexión de la red, el enchufe del cable de conexión se deberá considerar como un dispositivo de desconexión.
  El dispositivo de desconexión se debe poder alcanzar fácilmente y debe estar siempre bien accesible.
  Si, p. ej., el enchufe de conexión a la red es el dispositivo de desconexión, la longitud del cable de conexión no debe superar 3 m).
  Los interruptores selectores o electrónicos no son aptos para el corte de la red eléctrica. Si se
- integran productos sin interruptor en bastidores o instalaciones, se deberá colocar el interruptor en el nivel de la instalación.5. No utilice nunca el producto si está dañado el cable de conexión a red. Compruebe regularmente el
- S. No utilice nunca el producto si esta danado el cable de conexión a red. Compruebe regularmente el correcto estado de los cables de conexión a red. Asegúrese, mediante las medidas de protección y de instalación adecuadas, de que el cable de conexión a red no pueda ser dañado o de que nadie pueda ser dañado por él, p. ej. al tropezar o por un choque eléctrico.

1171.0000.42 - 07

- Solamente está permitido el funcionamiento en redes de alimentación TN/TT aseguradas con fusibles de 16 A como máximo (utilización de fusibles de mayor amperaje solo previa consulta con el grupo de empresas Rohde & Schwarz).
- Nunca conecte el enchufe en tomas de corriente sucias o llenas de polvo. Introduzca el enchufe por completo y fuertemente en la toma de corriente. La no observación de estas medidas puede provocar chispas, fuego y/o lesiones.
- 8. No sobrecargue las tomas de corriente, los cables alargadores o las regletas de enchufe ya que esto podría causar fuego o choques eléctricos.
- En las mediciones en circuitos de corriente con una tensión U<sub>eff</sub> > 30 V se deberán tomar las medidas apropiadas para impedir cualquier peligro (p. ej. medios de medición adecuados, seguros, limitación de tensión, corte protector, aislamiento etc.).
- Para la conexión con dispositivos informáticos como un PC o un ordenador industrial, debe comprobarse que éstos cumplan los estándares IEC60950-1/EN60950-1 o IEC61010-1/EN 61010-1 válidos en cada caso.
- 11. A menos que esté permitido expresamente, no retire nunca la tapa ni componentes de la carcasa mientras el producto esté en servicio. Esto pone a descubierto los cables y componentes eléctricos y puede causar lesiones, fuego o daños en el producto.
- 12. Si un producto se instala en un lugar fijo, se deberá primero conectar el conductor de protección fijo con el conductor de protección del producto antes de hacer cualquier otra conexión. La instalación y la conexión deberán ser efectuadas por un electricista especializado.
- 13. En el caso de dispositivos fijos que no estén provistos de fusibles, interruptor automático ni otros mecanismos de seguridad similares, el circuito de alimentación debe estar protegido de modo que todas las personas que puedan acceder al producto, así como el producto mismo, estén a salvo de posibles daños.
- 14. Todo producto debe estar protegido contra sobretensión (debida p. ej. a una caída del rayo) mediante los correspondientes sistemas de protección. Si no, el personal que lo utilice quedará expuesto al peligro de choque eléctrico.
- 15. No debe introducirse en los orificios de la caja del aparato ningún objeto que no esté destinado a ello. Esto puede producir cortocircuitos en el producto y/o puede causar choques eléctricos, fuego o lesiones.
- 16. Salvo indicación contraria, los productos no están impermeabilizados (ver también el capítulo "Estados operativos y posiciones de funcionamiento", punto 1). Por eso es necesario tomar las medidas necesarias para evitar la entrada de líquidos. En caso contrario, existe peligro de choque eléctrico para el usuario o de daños en el producto, que también pueden redundar en peligro para las personas.
- 17. No utilice el producto en condiciones en las que pueda producirse o ya se hayan producido condensaciones sobre el producto o en el interior de éste, como p. ej. al desplazarlo de un lugar frío a otro caliente. La entrada de agua aumenta el riesgo de choque eléctrico.
- 18. Antes de la limpieza, desconecte por completo el producto de la alimentación de tensión (p. ej. red de alimentación o batería). Realice la limpieza de los aparatos con un paño suave, que no se deshilache. No utilice bajo ningún concepto productos de limpieza químicos como alcohol, acetona o diluyentes para lacas nitrocelulósicas.

1171.0000.42 - 07

#### Funcionamiento

- El uso del producto requiere instrucciones especiales y una alta concentración durante el manejo. Debe asegurarse que las personas que manejen el producto estén a la altura de los requerimientos necesarios en cuanto a aptitudes físicas, psíquicas y emocionales, ya que de otra manera no se pueden excluir lesiones o daños de objetos. El empresario u operador es responsable de seleccionar el personal usuario apto para el manejo del producto.
- 2. Antes de desplazar o transportar el producto, lea y tenga en cuenta el capítulo "Transporte".
- 3. Como con todo producto de fabricación industrial no puede quedar excluida en general la posibilidad de que se produzcan alergias provocadas por algunos materiales empleados —los llamados alérgenos (p. ej. el níquel)—. Si durante el manejo de productos Rohde & Schwarz se producen reacciones alérgicas, como p. ej. irritaciones cutáneas, estornudos continuos, enrojecimiento de la conjuntiva o dificultades respiratorias, debe avisarse inmediatamente a un médico para investigar las causas y evitar cualquier molestia o daño a la salud.
- 4. Antes de la manipulación mecánica y/o térmica o el desmontaje del producto, debe tenerse en cuenta imprescindiblemente el capítulo "Eliminación/protección del medio ambiente", punto 1.
- 5. Ciertos productos, como p. ej. las instalaciones de radiocomunicación RF, pueden a causa de su función natural, emitir una radiación electromagnética aumentada. Deben tomarse todas las medidas necesarias para la protección de las mujeres embarazadas. También las personas con marcapasos pueden correr peligro a causa de la radiación electromagnética. El empresario/operador tiene la obligación de evaluar y señalizar las áreas de trabajo en las que exista un riesgo elevado de exposición a radiaciones.
- 6. Tenga en cuenta que en caso de incendio pueden desprenderse del producto sustancias tóxicas (gases, líquidos etc.) que pueden generar daños a la salud. Por eso, en caso de incendio deben usarse medidas adecuadas, como p. ej. máscaras antigás e indumentaria de protección.
- 7. Los productos con láser están provistos de indicaciones de advertencia normalizadas en función de la clase de láser del que se trate. Los rayos láser pueden provocar daños de tipo biológico a causa de las propiedades de su radiación y debido a su concentración extrema de potencia electromagnética. En caso de que un producto Rohde & Schwarz contenga un producto láser (p. ej. un lector de CD/DVD), no debe usarse ninguna otra configuración o función aparte de las descritas en la documentación del producto, a fin de evitar lesiones (p. ej. debidas a irradiación láser).
- Clases de compatibilidad electromagnética (conforme a EN 55011 / CISPR 11; y en analogía con EN 55022 / CISPR 22, EN 55032 / CISPR 32)
  - Aparato de clase A:

Aparato adecuado para su uso en todos los entornos excepto en los residenciales y en aquellos conectados directamente a una red de distribución de baja tensión que suministra corriente a edificios residenciales.

Nota: Los aparatos de clase A están destinados al uso en entornos industriales. Estos aparatos pueden causar perturbaciones radioeléctricas en entornos residenciales debido a posibles perturbaciones guiadas o radiadas. En este caso, se le podrá solicitar al operador que tome las medidas adecuadas para eliminar estas perturbaciones.

 Aparato de clase B:
 Aparato adecuado para su uso en entornos residenciales, así como en aquellos conectados directamente a una red de distribución de baja tensión que suministra corriente a edificios residenciales.

1171.0000.42 - 07

#### Reparación y mantenimiento

- 1. El producto solamente debe ser abierto por personal especializado con autorización para ello. Antes de manipular el producto o abrirlo, es obligatorio desconectarlo de la tensión de alimentación, para evitar toda posibilidad de choque eléctrico.
- 2. El ajuste, el cambio de partes, el mantenimiento y la reparación deberán ser efectuadas solamente por electricistas autorizados por Rohde & Schwarz. Si se reponen partes con importancia para los aspectos de seguridad (p. ej. el enchufe, los transformadores o los fusibles), solamente podrán ser sustituidos por partes originales. Después de cada cambio de partes relevantes para la seguridad deberá realizarse un control de seguridad (control a primera vista, control del conductor de protección, medición de resistencia de aislamiento, medición de la corriente de fuga, control de funcionamiento). Con esto queda garantizada la seguridad del producto.

#### Baterías y acumuladores o celdas

Si no se siguen (o se siguen de modo insuficiente) las indicaciones en cuanto a las baterías y acumuladores o celdas, pueden producirse explosiones, incendios y/o lesiones graves con posible consecuencia de muerte. El manejo de baterías y acumuladores con electrolitos alcalinos (p. ej. celdas de litio) debe seguir el estándar EN 62133.

- 1. No deben desmontarse, abrirse ni triturarse las celdas.
- 2. Las celdas o baterías no deben someterse a calor ni fuego. Debe evitarse el almacenamiento a la luz directa del sol. Las celdas y baterías deben mantenerse limpias y secas. Limpiar las conexiones sucias con un paño seco y limpio.
- Las celdas o baterías no deben cortocircuitarse. Es peligroso almacenar las celdas o baterías en estuches o cajones en cuyo interior puedan cortocircuitarse por contacto recíproco o por contacto con otros materiales conductores. No deben extraerse las celdas o baterías de sus embalajes originales hasta el momento en que vayan a utilizarse.
- 4. Las celdas o baterías no deben someterse a impactos mecánicos fuertes indebidos.
- 5. En caso de falta de estanqueidad de una celda, el líquido vertido no debe entrar en contacto con la piel ni los ojos. Si se produce contacto, lavar con agua abundante la zona afectada y avisar a un médico.
- En caso de cambio o recarga inadecuados, las celdas o baterías que contienen electrolitos alcalinos (p. ej. las celdas de litio) pueden explotar. Para garantizar la seguridad del producto, las celdas o baterías solo deben ser sustituidas por el tipo Rohde & Schwarz correspondiente (ver lista de recambios).
- Las baterías y celdas deben reciclarse y no deben tirarse a la basura doméstica. Las baterías o acumuladores que contienen plomo, mercurio o cadmio deben tratarse como residuos especiales. Respete en esta relación las normas nacionales de eliminación y reciclaje.

#### Transporte

1. El producto puede tener un peso elevado. Por eso es necesario desplazarlo o transportarlo con precaución y, si es necesario, usando un sistema de elevación adecuado (p. ej. una carretilla elevadora), a fin de evitar lesiones en la espalda u otros daños personales.

1171.0000.42 - 07

- 2. Las asas instaladas en los productos sirven solamente de ayuda para el transporte del producto por personas. Por eso no está permitido utilizar las asas para la sujeción en o sobre medios de transporte como p. ej. grúas, carretillas elevadoras de horquilla, carros etc. Es responsabilidad suya fijar los productos de manera segura a los medios de transporte o elevación. Para evitar daños personales o daños en el producto, siga las instrucciones de seguridad del fabricante del medio de transporte o elevación utilizado.
- 3. Si se utiliza el producto dentro de un vehículo, recae de manera exclusiva en el conductor la responsabilidad de conducir el vehículo de manera segura y adecuada. El fabricante no asumirá ninguna responsabilidad por accidentes o colisiones. No utilice nunca el producto dentro de un vehículo en movimiento si esto pudiera distraer al conductor. Asegure el producto dentro del vehículo debidamente para evitar, en caso de un accidente, lesiones u otra clase de daños.

#### Eliminación/protección del medio ambiente

- Los dispositivos marcados contienen una batería o un acumulador que no se debe desechar con los residuos domésticos sin clasificar, sino que debe ser recogido por separado. La eliminación se debe efectuar exclusivamente a través de un punto de recogida apropiado o del servicio de atención al cliente de Rohde & Schwarz.
- Los dispositivos eléctricos usados no se deben desechar con los residuos domésticos sin clasificar, sino que deben ser recogidos por separado.
   Rohde & Schwarz GmbH & Co.KG ha elaborado un concepto de eliminación de residuos y asume plenamente los deberes de recogida y eliminación para los fabricantes dentro de la UE. Para desechar el producto de manera respetuosa con el medio ambiente, diríjase a su servicio de atención al cliente de Rohde & Schwarz.
- 3. Si se trabaja de manera mecánica y/o térmica cualquier producto o componente más allá del funcionamiento previsto, pueden liberarse sustancias peligrosas (polvos con contenido de metales pesados como p. ej. plomo, berilio o níquel). Por eso el producto solo debe ser desmontado por personal especializado con formación adecuada. Un desmontaje inadecuado puede ocasionar daños para la salud. Se deben tener en cuenta las directivas nacionales referentes a la eliminación de residuos.
- 4. En caso de que durante el trato del producto se formen sustancias peligrosas o combustibles que deban tratarse como residuos especiales (p. ej. refrigerantes o aceites de motor con intervalos de cambio definidos), deben tenerse en cuenta las indicaciones de seguridad del fabricante de dichas sustancias y las normas regionales de eliminación de residuos. Tenga en cuenta también en caso necesario las indicaciones de seguridad especiales contenidas en la documentación del producto. La eliminación incorrecta de sustancias peligrosas o combustibles puede causar daños a la salud o daños al medio ambiente.

Se puede encontrar más información sobre la protección del medio ambiente en la página web de Rohde & Schwarz.

1171.0000.42 - 07

# Quality management and environmental management

#### Sehr geehrter Kunde,

Sie haben sich für den Kauf eines Rohde & Schwarz Produktes entschieden. Sie erhalten damit ein nach modernsten Fertigungsmethoden hergestelltes Produkt. Es wurde nach den Regeln unserer Qualitäts- und Umweltmanagementsysteme entwickelt, gefertigt und geprüft. Rohde & Schwarz ist unter anderem nach den Managementsystemen ISO 9001 und ISO 14001 zertifiziert.

#### **Der Umwelt verpflichtet**

- Energie-effiziente,RoHS-konforme ProdukteKontinuierliche
- Weiterentwicklung nachhaltiger Umweltkonzepte
- ISO 14001-zertifiziertes
   Umweltmanagementsystem

#### Dear customer,

You have decided to buy a Rohde & Schwarz product. This product has been manufactured using the most advanced methods. It was developed, manufactured and tested in compliance with our quality management and environmental management systems. Rohde & Schwarz has been certified, for example, according to the ISO 9001 and ISO 14001 management systems.

#### **Environmental commitment**

- Energy-efficient products
- Continuous improvement in environmental sustainability
- ISO 14001-certified environmental management system



Certified Environmental System

#### Cher client,

Vous avez choisi d'acheter un produit Rohde & Schwarz. Vous disposez donc d'un produit fabriqué d'après les méthodes les plus avancées. Le développement, la fabrication et les tests de ce produit ont été effectués selon nos systèmes de management de qualité et de management environnemental. La société Rohde & Schwarz a été homologuée, entre autres, conformément aux systèmes de management ISO 9001 et ISO 14001.

#### **Engagement écologique**

- Produits à efficience énergétique
- Amélioration continue de la durabilité environnementale
- Système de management environnemental certifié selon ISO 14001







# CE

Certificate No.: 2011-50

This is to certify that:

Equipment type	Stock No.	Designation
ZNB4	1311.6010.22/24	VECT.NETW.ANALYZER 2/4 PORT
ZNB8	1311.6010.42/44	VECT.NETW.ANALYZER 2/4 PORT

complies with the provisions of the Directive of the Council of the European Union on the approximation of the laws of the Member States

- relating to electrical equipment for use within defined voltage limits (2006/95/EC)
- relating to electromagnetic compatibility (2004/108/EC)

Conformity is proven by compliance with the following standards:

EN 61010-1: 2001 EN 61326-1: 2006 EN 61326-2-1: 2006 EN 55011: 2007 + A2: 2007, class A EN 61000-3-2: 2006 + A1:2009 + A2:2009 EN 61000-3-3: 2008

For the assessment of electromagnetic compatibility, the limits of radio interference for Class A equipment as well as the immunity to interference for operation in industry have been used as a basis.

#### ROHDE & SCHWARZ GmbH & Co. KG Mühldorfstr. 15, D-81671 München

Munich, 2011-11-08

Central Quality Management GF-QP / Chadzelek

1311.6010.42

CE

#### E-1

# **Customer Support**

## Technical support - where and when you need it

For quick, expert help with any Rohde & Schwarz equipment, contact one of our Customer Support Centers. A team of highly qualified engineers provides telephone support and will work with you to find a solution to your query on any aspect of the operation, programming or applications of Rohde & Schwarz equipment.

## Up-to-date information and upgrades

To keep your instrument up-to-date and to be informed about new application notes related to your instrument, please send an e-mail to the Customer Support Center stating your instrument and your wish. We will take care that you will get the right information.

Europe, Africa, Middle East	Phone +49 89 4129 12345 customersupport@rohde-schwarz.com
North America	Phone 1-888-TEST-RSA (1-888-837-8772) customer.support@rsa.rohde-schwarz.com
Latin America	Phone +1-410-910-7988 customersupport.la@rohde-schwarz.com
Asia/Pacific	Phone +65 65 13 04 88 customersupport.asia@rohde-schwarz.com
China	Phone +86-800-810-8228 / +86-400-650-5896 customersupport.china@rohde-schwarz.com



# Contents

1	Documentation Map	9
1.1	Getting Started Guide	9
1.2	User Manual	9
1.3	Help System	9
1.4	Documentation CD-ROM	9
2	Release Notes for Firmware V1.70	10
3	Concepts and Features	12
3.1	Basic Concepts	12
3.1.1	Global (Persistent) Settings	12
3.1.2	Recall Sets	13
3.1.3	Traces, Channels and Diagrams	13
3.1.4	Sweep Control	15
3.1.5	Data Flow	18
3.2	Screen Elements	20
3.2.1	Control Elements of the Screen	20
3.2.2	Display Elements in the Diagram	25
3.2.3	Dialogs	35
3.2.4	Display Formats and Diagram Types	36
3.3	Measurement Results	44
3.3.1	S-Parameters	44
3.3.2	Impedance Parameters	46
3.3.3	Admittance Parameters	48
3.3.4	Wave Quantities and Ratios	50
3.3.5	Unbalance-Balance Conversion	53
3.3.6	Stability Factors	59
3.3.7	Delay, Aperture, Electrical Length	60
3.4	Operations on Traces	61
3.4.1	Limit Check	61
3.4.2	Trace Files	66
3.5	Calibration	69
3.5.1	Calibration Types	70

3.5.2	Calibration Standards and Calibration Kits	78
3.5.3	Calibration Pool	83
3.5.4	Calibration Labels	84
3.5.5	Automatic Calibration	84
3.5.6	Scalar Power Calibration	92
3.5.7	SMARTerCal	
3.6	Offset Parameters and Embedding	100
3.6.1	Offset Parameters	
3.6.2	Embedding and Deembedding	106
3.7	Optional Extensions and Accessories	111
3.7.1	Time Domain (R&S ZNB-K2)	112
3.7.2	Frequency Conversion Measurements (R&S ZNB-K4/-K14)	117
3.7.3	Bias Tees (R&S ZNB-B1)	126
3.7.4	Internal Second Source (R&S ZNB-B2)	126
3.7.5	OCXO Frequency Reference (R&S ZNB-B4)	126
3.7.6	GPIB Interface (R&S ZNB-B10)	
3.7.7	Handler I/O (Universal Interface , R&S ZN-B14)	127
3.7.8	Receiver Step Attenuators (R&S ZNB <n>-B31/32/33/34)</n>	127
3.7.9	DC Inputs (R&S ZNB-B81)	127
3.7.10	External Power Meters	130
3.7.11	External Generators	131
3.7.12	External Switch Matrices	134
4	GUI Reference	142
4.1	File Settings	
4.1.1	File > Recall Sets	142
4.1.2	File > Print	147
4.1.3	File > Trace Data	149
4.1.4	File > More	149
4.2	Trace Settings	150
4.2.1	Meas Settings	150
4.2.2	Format Settings	
4.2.3	Scale Settings	
4.2.4	Trace Config Settings	

4.2.5	Lines Settings	223
4.2.6	Marker Settings	237
4.3	Stimulus Settings	254
4.3.1	Stimulus > Stimulus	255
4.3.2	Stimulus > Power	257
4.3.3	Stimulus > Time Domain X-Axis	258
4.4	Channel Settings	
4.4.1	Power Bandwidth Average Settings	
4.4.2	Sweep Settings	
4.4.3	Calibration	278
4.4.4	Channel Config	359
4.4.5	Trigger	
4.4.6	Offset Embed	
4.5	Display Settings	407
4.5.1	Display > Diagram	408
4.5.2	Display > Split	412
4.5.3	Display > Config	414
4.5.4	Define User Color Scheme (Dialog)	416
4.5.5	Display > View Bar	419
4.5.6	Display > Touchscreen	420
4.6	System Settings	420
4.6.1	System > Setup > Setup	421
4.6.2	System Configuration (Dialog)	421
4.6.3	Info (Dialog)	427
4.6.4	Service Function (Dialog)	429
4.6.5	System > Setup > Reference	429
4.6.6	System > Setup > Remote Settings	430
4.6.7	Remote LXI (Dialog)	433
4.6.8	System > Setup > External Devices	434
4.6.9	External Power Meters (Dialog)	436
4.6.10	External Generators (Dialog)	438
4.6.11	External Matrices (Dialog)	441
4.6.12	Switch Matrix RF Connections (Dialog)	

User Manual 1173.9163.02 – 13

4.6.13	System > Print	448
4.6.14	Additional System Functions	448
4.7	Applic Menu	449
4.8	Help Menu	451
4.9	Control Menu	451
5	Remote Control	453
5.1	Introduction to Remote Control	453
5.1.1	Starting a Remote Control Session	454
5.1.2	GPIB Explorer	454
5.1.3	Switchover to Remote Control	456
5.1.4	Combining Manual and Remote Control	458
5.2	Messages	459
5.2.1	Device Messages (Commands and Device Responses)	459
5.2.2	SCPI Command Structure and Syntax	459
5.2.3	SCPI Parameters	463
5.3	Basic Remote Control Concepts	465
5.3.1	Traces, Channels, and Diagram Areas	465
5.3.2	Active Traces in Remote Control	466
5.3.3	Initiating Measurements, Speed Considerations	467
5.3.4	Addressing Traces and Channels	468
5.4	Command Processing	469
5.4.1	Input Unit	469
5.4.2	Command Recognition	469
5.4.3	Data Base and Instrument Hardware	470
5.4.4	Status Reporting System	470
5.4.5	Output Unit	471
5.4.6	Command Sequence and Command Synchronization	471
5.5	Status Reporting System	472
5.5.1	Overview of Status Registers	473
5.5.2	Structure of an SCPI Status Register	474
5.5.3	Contents of the Status Registers	476
5.5.4	Application of the Status Reporting System	482
5.5.5	Reset Values of the Status Reporting System	485

5.6	LXI Configuration	486
5.6.1	LXI Classes and LXI Functionality	486
5.6.2	LXI Browser Interface	487
5.6.3	LAN Configuration	488
6	Command Reference	492
6.1	Special Terms and Notation	492
6.1.1	Upper/Lower Case	493
6.1.2	Special Characters	493
6.1.3	Parameters	493
6.1.4	Numeric Suffixes	493
6.2	Common Commands	494
6.3	SCPI Command Reference	495
6.3.1	CALCulate Commands	496
6.3.2	CONFigure Commands	591
6.3.3	CONTrol Commands	598
6.3.4	DIAGnostic Commands	607
6.3.5	DISPlay Commands	608
6.3.6	FORMat Commands	631
6.3.7	HCOPy Commands	633
6.3.8	INITiate Commands	637
6.3.9	INSTrument Commands	640
6.3.10	MEMory	641
6.3.11	MMEMory Commands	643
6.3.12	OUTPut Commands	671
6.3.13	PROGram Commands	674
6.3.14	[SENSe:] Commands	676
6.3.15	SOURce Commands	788
6.3.16	STATus Commands	820
6.3.17	SYSTem Commands	823
6.3.18	TRACe Commands	
6.3.19	TRIGger Commands	857
6.4	R&S ZVR/ZVAB Compatible Commands	863
7	Programming Examples	887

7.1	Basic Tasks	887
7.1.1	Typical Stages of a Remote Control Program	
7.1.2	Channel, Trace and Diagram Handling	
7.2	Condensed Programming Examples	
7.2.1	Path Independent RC Programs	
7.2.2	Trace and Diagram Handling	
7.2.3	Using Markers	906
7.2.4	Data Handling	908
7.2.5	Calibration	912
8	Error Messages and Troubleshooting	917
8.1	Errors during Firmware Operation	917
8.1.1	Asynchronous Errors	918
8.1.2	Errors during Measurement	918
8.1.3	Obtaining Technical Support	919
8.2	Errors during Firmware Installation/Update	920
9	Annexes	922
9.1	Interfaces and Connectors	922
9.1.1	Rear Panel Connectors	922
9.1.2	LAN Interface	924
9.1.3	GPIB Interface	924
9.1.4	Universal Interface	928
9.2	Maintenance	935
9.2.1	Storing and Packing the Instrument	936
9.2.2	Replacing Fuses	936
9.3	Showroom Mode	936
	Glossary: Frequently Used Terms	937
	List of Commands	943

# 1 Documentation Map

The R&S ZNB documentation is delivered as a printed Getting Started guide and a documentation CD-ROM providing the complete user documentation. In addition, a help system is embedded in the instrument.

## 1.1 Getting Started Guide

The Getting Started guide describes everything that is needed to put the instrument into operation and helps you to get familiar with the R&S ZNB. It gives an introduction to the instrument's operating concept and provides simple measurement examples. A printed Getting Started guide is delivered with each R&S ZNB.

### 1.2 User Manual

The User Manual complements the Getting Started guide, providing a detailed description of the instrument's capabilities, examples and reference information for manual and remote control. The User Manual is available on the documentation CD-ROM; the most recent version is available for download on the R&S ZNB product pages on the R&S internet.

## 1.3 Help System

The help system is embedded in the instrument, offering quick, context-sensitive reference to the information needed for operation and programming. It comprises the complete information of the Getting Started guide and the User Manual.

You can use the help also if you control the instrument from an external monitor. Furthermore you can transfer the help to your PC and use it as a standalone help.

## 1.4 Documentation CD-ROM

The CD-ROM contains the complete user documentation for the R&S ZNB:

- the help system
- the quick start guide in printable form
- the user manual in printable form
- brochures and data sheets in printable form
- the service manual in printable form
- links to different useful sites in the R&S internet

User Manual 1173.9163.02 - 13

## 2 Release Notes for Firmware V1.70

Version V1.70 of the R&S ZNB firmware provides the following new features:

- Support for External Switch Matrices R&S ZV-Z81 and R&S ZV-Z82:
  - Auto-detection, registration and remote operation of matrices connected via USB or LAN
  - Guided RF connection setup
  - Multiple path handling during calibration and measurement
  - Configuration of matrix port properties just as easy as configuration of native VNA port properties
  - Redesign of various GUI widgets to support the increased number of ports
- Full n-Port Calibration with Reduced Number of Through Connections
- Automatic calibration with Multiple Port Assignments
- Characterization of CalUnits with more than 4 ports (R&S ZV-Z58 and R&S ZV-Z59)
- MultiCal support:
  - Multiple manual system error corrections on the same channel
  - Wizard-guided setup and simultaneous data acquisition for multiple manual system error corrections
- SMARTerCal with complementary power flatness calibration (see chapter 3.5.7.3, "Combining SMARTerCal with Scalar Power Calibration", on page 99)
- "Save Sweep Data" on page 423 for system error corrections can be activated via system setup
- chapter 9.3, "Showroom Mode", on page 936: load a user-defined recall set whenever the device is (re-)started or the PRESET key is pressed
- "Clear Test" function for limit tests (line, circle, ripple)

#### New remote control features:

- Existing command SOURce<Ch>: LPORt<LogPt> now allows to assign logical port numbers to single-ended ports
- [SENSe:]CORRection:COLLect:AUTO:CKIT:PORTs creates CalUnit characterizations with manual port assignment
- Existing command [SENSe<Ch>:]CORRection:DATA:PARameter<Sfk>? can now query individual settings
- SOURce<Ch>: POWer<PhyPt>: CORRection: DATA: PARameter<Wv>: COUNt? queries the number of available power calibrations, SOURce<Ch>: POWer<PhyPt>: CORRection: DATA: PARameter<Wv>: COUNt? queries the respective settings
- SYSTem: COMMunicate: RDEVice: PMETer<Pmtr>: SPCorrection[:STATe] enables/disables the built-in S-parameter correction on certain R&S®NRP-Z power sensors

#### Product improvements:

Improved user assistance for automatic calibrations (Cal Unit)

User Manual 1173.9163.02 - 13

 "Preset User Cal" on page 358: load a user-defined calibration whenever the PRESET key is pressed

#### Bug fixes:

- For certain polar diagrams the "Draw Circle" softtool did not display the correct unit
- Limit lines disappeared during minimization/maximization of diagrams
- Sorting behavior in tables after cell editing
- Better performance when moving the zoom rectangle in "Overview Select" mode
- "Print to File..." rendered some markers invisible
- Marker couldn't be moved with the rotary knob when its current position was out of the frequency range
- TRM calibration with sexless cal kits didn't work

#### Software version

To check your R&S ZNB firmware version, press "Help > About...".

# 3 Concepts and Features


The following chapter provides an overview of the analyzer's capabilities and their use. This includes a description of the basic concepts that the analyzer uses to organize, process and display measurement data, of the screen contents, possible measured quantities, calibration methods and typical test setups.

For a systematic explanation of all menus, functions and parameters refer to chapter 4, "GUI Reference", on page 142.

## 3.1 Basic Concepts

The analyzer provides a variety of functions to perform a particular measurement and to customize and optimize the evaluation of results. To ensure that the instrument resources are easily accessible and that user-defined configurations can be conveniently implemented, stored and reused the instrument uses a hierarchy of structures:

- Global resources can be used for all measurements, irrespective of the current measurement session or recall set.
- A recall set comprises a set of diagrams with all displayed information that can be stored to a recall set file.
- The diagrams show traces which are assigned to channels. See chapter 3.1.3, "Traces, Channels and Diagrams", on page 13.

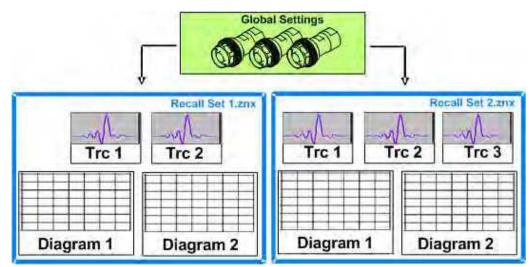

#### 3.1.1 Global (Persistent) Settings

The analyzer provides global settings that are mostly hardware-related and can be used for all measurements, irrespective of the current measurement session or recall set. The settings are stored in independent files and do not enter into any of the recall set files. The following list contains examples of global settings:

Calibration kits

User Manual 1173.9163.02 - 13

- Connector types
- Cal pool data including system error correction and power correction data
- Directories for trace data, limit lines calibration data etc.
- Color schemes and printer settings
- System configurations, to be accessed via "SYSTEM > SETUP"
- External power meter and generator configurations

The data related to global settings are not affected by a "Preset" of the analyzer. Some of them are preset when a new measurement session is started ("session settings"). In addition, it is possible to reset many of the global settings using the buttons in the "System Config" dialog.

#### 3.1.2 Recall Sets

A recall set comprises a set of diagrams with all displayed information that can be stored to a recall set file (\*.znx) and reused. Each recall set is displayed in an independent tab. Tap the tab to change between different recall sets; tap the "+" tab to create a new recall set.

#### 管 Setl \* 🐹 管 Set2 🗷 💽

The recall set file contains the following information:

- General settings related to the recall set
- The trace settings for all traces in the diagrams
- The channel settings for all channels associated to the traces
- The display settings for each diagram

The "File" menu is used to organize recall sets.


#### 3.1.3 Traces, Channels and Diagrams

The analyzer arranges, displays or stores the measured data in traces which are assigned to channels and displayed in diagrams. To understand the menu structure of the instrument and quickly find the appropriate settings, it is important to understand the exact meaning of the three terms.

- A trace is a set of data points that can be displayed together in a diagram. The trace settings specify the mathematical operations used in order to obtain traces from the measured or stored data and to display them.
- A channel contains hardware-related settings which specify how the network analyzer collects data.
- A diagram is a rectangular portion of the screen which is used to display traces. Diagrams which belong to the same recall set are arranged in a common window. The settings for diagrams are described in chapter 3.2.2, "Display Elements in the Diagram", on page 25.

A diagram can contain a practically unlimited number of traces, assigned to different channels. diagrams and channels are completely independent from each other.

**Basic Concepts** 

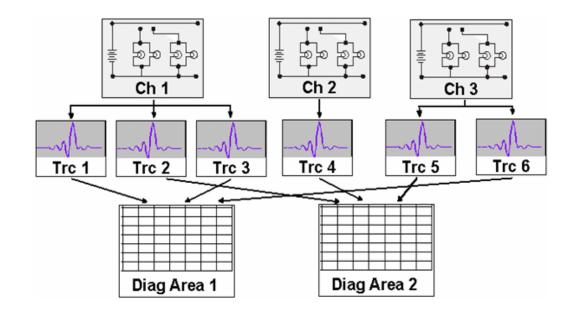

#### 3.1.3.1 Trace Settings

The trace settings specify the mathematical operations used in order to obtain traces from the measured or stored data. They can be divided into several main groups:

- Selection of the measured quantity (S-parameters, wave quantities, ratios, impedances,...)
- Conversion into the appropriate display format and selection of the diagram type
- Scaling of the diagram and selection of the traces associated to the same channel
- Readout and search of particular values on the trace by means of markers
- Limit check

The "Trace" menu provides all trace settings. They complement the definitions of the "Channel" menu. Each trace is assigned to a channel. The channel settings apply to all traces of the channel.



If a trace is selected in order to apply the trace settings, it becomes the active trace. In manual control there is always exactly one active trace, irrespective of the number of channels and traces defined. The active channel contains the active trace. In remote control, each channel contains an active trace.

See also chapter 5.3, "Basic Remote Control Concepts", on page 465.

#### 3.1.3.2 Channel Settings

A channel contains hardware-related settings which specify how the network analyzer collects data. The channel settings can be divided into three main groups:

- Control of the measurement process ("Sweep", "Trigger", "Average")
- Description of the test setup ("Power" of the internal source, IF filter "Bandwidth" and "Step Attenuators", "Port Configuration")

User Manual 1173.9163.02 - 13

Correction data ("Calibration", "Offset")

The "Channel" menu provides all channel settings.

#### 3.1.3.3 Active and Inactive Traces and Channels

A window can display several diagrams simultaneously, each with a variable number of traces. One of these traces is active at each time. The **active trace** is highlighted in the trace list on top of the active diagram (Trc3 in the figure below):

Trc1 S21 dB MagTrc3 S21 dB MagTrc4 S21 dB MagTrc5 S21 dB Mag

Tapping a trace in the list selects the trace as the active trace. Alternatively, use the functions of the "TRACE > TRACE CONFIG > Traces" tab. If a previously inactive area is selected as the active area, the trace that was active last time when the area was active will again become the active trace.

The **active channel** is the channel which belongs to the active trace. The channels of all traces in a diagram are listed at the bottom of the diagram, together with the "Stimulus" values and the display colors of all traces. The active channel is highlighted (Ch1 in the example below).

Ch1 Start 100 kHz —	Pwr -10 dBm Bw 10 kHz	Stop 3 GHz
Ch2 Start 100 kHz —	Pwr -10 dBm Bw 10 kHz	Stop 3 GHz
Ch3 Freq 1 GHz 🗕	Pwr -10 dBm Bw 10 kHz	Stop 1 s
Ch4 Start 100 kHz	Pwr -10 dBm Bw 10 kHz	Stop 3 GHz
Trc4 Start -1 ns —	Time Domain	Stop 4 ns

Tapping a trace in the trace list selects the channel associated to the trace as the active channel. Channels with no traces are not indicated in the diagrams but can be accessed via the "Channel Manager" dialog.

#### 3.1.4 Sweep Control

A sweep is a series of consecutive measurements taken over a specified sequence of stimulus values. It represents the basic measurement cycle of the analyzer.

The analyzer can perform sweeps at constant power but variable frequency (frequency sweeps), sweeps at constant frequency but variable power (power sweeps), and sweeps at constant power and frequency that are repeated in time (Time/CW Mode sweeps). The sweeps are further specified by the number of measurement points and the total measurement time.

By default sweeps are repeated continuously. Alternatively, a measurement may also consist of a single sweep or of a specified number of sweeps.



After changing the channel settings or selecting another measured quantity, the analyzer needs some time to initialize the new sweep. This preparation period increases with the number of points and the number of partial measurements involved. It is visualized by a "Preparing Sweep" symbol in the status bar:

Ch1: Avg (Preparing) 22.02.2011 10:11:51

All analyzer settings can still be changed during sweep initialization. If necessary, the analyzer terminates the current initialization and starts a new preparation period. During the first sweep after a change of the channel settings, the asterisk symbol in the status bar remains yellow:

Ch1: Avg + Ch1 22.02.2011 Ch1: None + P1 10:16:39

The asterisk turns grey after the first sweep has been completed.

#### 3.1.4.1 Partial Measurements and Driving Mode

Depending on the measurement task and the measured quantities, the measurement at each sweep point can consist of one or several "partial measurements" with definite hardware settings.

- If a single S-parameter is measured (e.g. the reflection coefficient S<sub>11</sub>), the analyzer can operate at fixed hardware settings. In particular, a fixed source port and receive port is used. Each sweep point requires a single partial measurement.
   See also chapter 3.3.1, "S-Parameters", on page 44.
- For a complete two-port S-parameter measurement (e.g. S<sub>11</sub>, S<sub>21</sub>, S<sub>12</sub>, S<sub>22</sub>) the analyzer needs to interchange the roles of the source and receive ports. Each sweep point requires two partial measurements.

To enhance the accuracy, it is possible to insert a delay time before each partial measurement.

In the default configuration, the R&S ZNB performs a partial measurement at all sweep points (partial sweep) before the hardware settings are changed and the next partial measurement is carried out in an additional sweep ("Alternated" driving mode). It is possible though to reverse the order of partial measurements and sweeps ("Chopped" mode; see "CHANNEL > CHANNEL CONFIG > Mode > Driving Mode").

#### Advantages of alternated and chopped driving mode

If the settling time between adjacent frequency points is smaller than the settling time between the partial measurements (which is generally true), then the "Alternated" measurement is faster than a normal sweep so that a smaller sweep times can be set. On the other hand, an "Alternated" measurement provides a result only during the last partial sweep.



Use the "Alternated" mode to increase the accuracy of measurements on DUTs with long level settling times (e.g. quartzes, SAW filters). To measure DUTs with short settling times and obtain a trace from the beginning of the sweep, use "Chopped" mode. In "Auto" mode, the analyzer will optimize the display update: Fast sweeps are performed in "Alternated" mode, slower sweeps in "Chopped" mode.

As an alternative to activating the "Alternate" mode, it is possible to insert a "Meas. Delay" before each partial measurement and thus improve the accuracy. The delay slows down the measurement.

#### Relation to trigger settings

In triggered measurements, "Alternated" has no effect if the triggered measurement sequence is identical to a single sweep point. The following table shows how the analyzer performs a sweep comprising m sweep points, assuming that each of them requires n partial measurements.

Triggered Meas. Sequence	Alternate On	Alternate Off
Sweep	Trigger event starts n partial sweeps over all sweep points.	Trigger event starts m complete measurements at consecutive sweep points.
Sweep Segment	Trigger event starts n partial sweeps over the next segment.	Trigger event starts complete meas- urements at all consecutive sweep points in the segment.
Point	All partial measurements of each sweep point are carried out one after another.	All partial measurements of each sweep point are carried out one after another.
Partial Measurement	Each partial measurement is carried out for all sweep points.	All partial measurements of each sweep point are carried out one after another

#### 3.1.4.2 Stimulus and Sweep Types

The function of the "START", "STOP", "CENTER" and "SPAN" keys depends on the sweep type.

Table 3-1: Function of STIMULUS keys

Sweep type	START [unit]	STOP [unit]	CENTER [unit]	SPAN [unit]
Lin. Frequency	Start Frequency [Hz]	Stop Frequency [Hz]	Center Frequency [Hz]	Frequency Span [Hz]
Log. Frequency				
Segmented Frequency				
Power	Start Power [dBm]	Stop Power [dBm]	CW Frequency [Hz]	CW Frequency [Hz]
CW Mode	CW Frequency [Hz]	CW Frequency [Hz]	CW Frequency [Hz]	CW Frequency [Hz]
Time	CW Frequency [Hz]	Stop Time [s]	CW Frequency [Hz]	CW Frequency [Hz]

The ranges of numerical values must be compatible with the instrument model. The conditions for the stimulus range depend on the sweep type:

Lin. Frequency/Log. Frequency/Segmented Frequency

The supported frequency range depends on the instrument type; for an overview refer to chapter 6.3.14.10, "[SENSe:]FREQuency...", on page 736.

The stop frequency must be greater than the start frequency; the span must be  $\geq 1$  Hz. If a stop frequency smaller than the current start frequency is set, then the start frequency is adjusted and vice versa. A sweep must contain at least two different sweep points.

Power

Start and stop power are both entered in absolute units (dBm). Start and stop power must be different; the stop power must be larger than the start power. If a stop power smaller than the start power is set, then the start power is adjusted automatically and vice versa.

The power corresponds to the actual source power at the test ports (channel base power  $P_b$ ). After a port power calibration, this source power is available at the calibrated reference plane.

CW Mode

The stimulus keys define the fixed stimulus frequency (CW Frequency) of the measurement. The other sweep parameters (e.g. the Number of Points) are set via "CHANNEL > SWEEP > Sweep Params".

• Time

The "Stop" key defines the total sweep time (Stop Time). The remaining stimulus keys define the fixed stimulus frequency (CW Frequency) of the measurement. The other sweep parameters (e.g. the Number of Points) are set via "CHANNEL > SWEEP > Sweep Params".

The sweep time is entered in seconds and must be positive.




The selected sweep range applies to all source and receive ports of the analyzer. In arbitrary mode (with option R&S ZNB-K4), you can define port-specific frequencies and powers; see chapter 4.4.4.4, "Define Port Settings (Dialog)", on page 363.

#### 3.1.5 Data Flow

The analyzer processes the raw measurement data in a sequence of stages in order to obtain the displayed trace. The following diagram gives an overview.

The diagram consists of an upper and a lower part, corresponding to the data processing stages for the entire channel and for the individual traces. All stages in the diagram are configurable. Note that the channel data flow for S-parameters (and quantities derived from S-parameters such as impedances, admittances, stability factors etc.) differs from the channel data flow for wave quantities (and derived quantities such as ratios).

**Basic Concepts** 

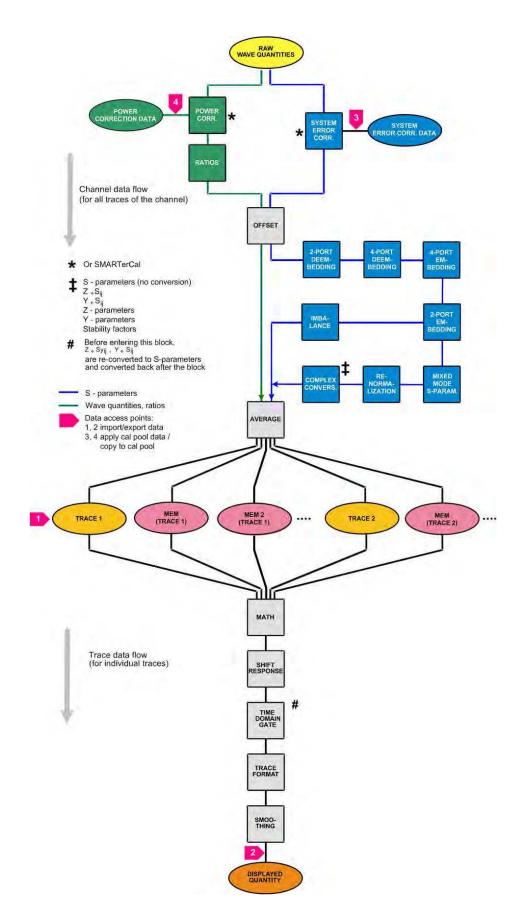

User Manual 1173.9163.02 - 13


# 3.2 Screen Elements

This section describes the operating concept of the network analyzer, including the alternative navigation tools for touchscreen, mouse and hardkey operation, the trace settings, markers and diagrams. For a description of the different quantities measured by the analyzer refer to chapter 3.3, "Measurement Results", on page 44.

# 3.2.1 Control Elements of the Screen

The main window of the analyzer provides all control elements for the measurements and contains the diagrams for the results. There are several alternative ways for accessing an instrument function:

- Using the icons in the toolbar above the diagram area (for frequent actions)
- Using the control elements of the softtool panel (recommended, provides all settings)
- Using the menus and submenus of the menu bar (alternative to the previous method)
- Using the hardkey panel (preselection of the most important softool panels)

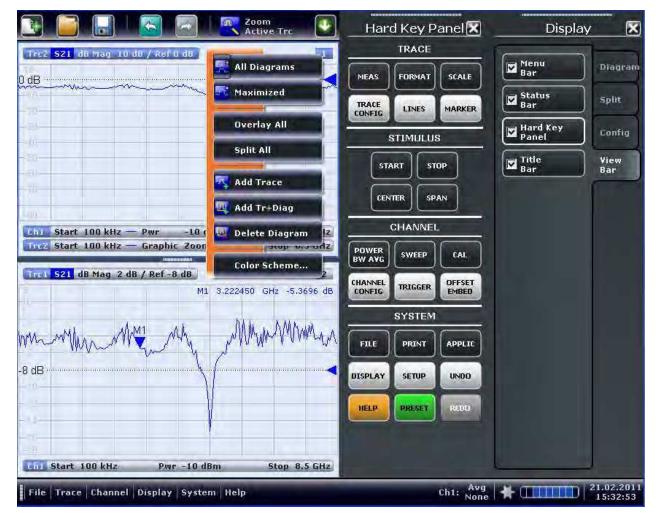

For further reference:

- Refer to chapter 3.2.2, "Display Elements in the Diagram", on page 25 to obtain information about the results in the diagram.
- Refer to chapter 4.5, "Display Settings", on page 407 and learn how to customize the screen.

### 3.2.1.1 Title Bar

The main application window of the vector network analyzer application provides a title bar, in analogy to every Windows<sup>®</sup> application. The title bar contains the name of the application and the standard minimize, maximize, and close buttons. The appearance depends on the "Control Panel" settings of the operating system.

#### 🚸 Rohde & Schwarz VNA. 📃 🗖 🗙



You can display or hide the title bar using "SYSTEM > DISPLAY > View Bar" or "APPLIC > External Tools". The title bar is displayed together with the taskbar across the bottom of the screen which you can use to change between the VNA application and external tools.

### 3.2.1.2 Toolbar

The toolbar above the diagram area contains the most frequently used control elements of the user interface. All controls are also accessible from the R&S ZNB's softtool panels.

The toolbar is divided into two parts.

The icons in the left part initiate frequently used actions: Add a new recall set ("FILE > Recall Sets > New..."), open/recall a recall set file ("FILE > Recall Sets > New..."), save active recall set to a file ("FILE > Recall Sets > Save..."), undo/redo the last action ("System > Undo / Redo"). The "Undo" and "Redo" icons are equivalent to the corresponding front panel keys.



 The icons in the middle part control the graphical zoom function, unzoom, zoom, and enable zoom overview ("TRACE > Scale > Zoom").

1:1 🔍 截

 The icons in the right part allow to add a new trace and (possibly) a new diagram ("TRACE > Trace Config > Trace"), add a marker ("TRACE > Marker > Markers"), and delete a marker, trace, or diagram.

New New Trace 🔽 New 📗 Delete



You can hide the toolbar using "SYSTEM > DISPLAY > View Bar".

#### 3.2.1.3 Softtool Panel

Softtool panels display groups of related settings. They can be opened by pressing a front panel key, the hard key panel, or a menu command from the menu bar or from a context menu. Tapping a control element in the softtool panels activates a setting. You can also enter values and open dialogs with extended settings.

A softtool panel consists of a title (e.g. "Display") with a close/re-open icon and the control element area below. The title keeps being displayed when the softtoool panel is closed, which allows to re-open closed softtools at any time. Most softtool panels are subdivided into different tabs (e.g. "Diagram", "Split", "Config", "View Bar").

Display	X
Color Scheme	Diagran
Light Backgro 🗘	
Define User Color	Split
Frequency Info	Config
M Info	View
Channel Info	Bar
Trace Info	
Info Table	
Show	
Position	
Bottom 😂	ł.
Font Size	
100 %	

Softtool panels may contain different types of control elements:

- A button with a double arrow (e.g. "Color Scheme" in the example above) opens a list of alternative settings.
- A button with three dots (e.g. "User Define..." in the example above) opens a dialog which provides several related settings.
- A button with a checkmark (e.g. "Frequency Info" in the example above) enables or disables.
- A button with a light background (e.g. "Font Size" in the example above) is an input fields for numbers or characters.
- A labeled button with no additional symbols directly initiates an action.

#### 3.2.1.4 Menu Bar

All analyzer functions are arranged in drop-down menus. The menu bar is located across the bottom of the diagram:

File Trace Channel Display System Help

Menus can be controlled with the touchscreen or a mouse, like the menus in any Windows<sup>®</sup> application. A short tap (left mouse click) expands a menu or submenu. If a menu

command has no submenu assigned, a short tap (left mouse click) opens a dialog or directly activates the menu command. When a (sub)menu is selected, the R&S ZNB displays the corresponding softtool panel.

#### **Overview of menu functions**

- The "File" menu provides standard Windows<sup>®</sup> functions that can be used to create, save, recall or print recall sets, to copy the current screen or to shut down the application.
- The "Trace" menu provides all trace settings, the limit check settings, and the marker functions including marker search.
- The "Channel" menu provides all channel settings and activates, modifies or stores different channels.
- The "Display" menu provides all display settings and the functions for activating, modifying and arranging different diagrams.
- The "System" menu provides functions that can be used to return to a defined instrument state, reverse operations, access service functions and define various systemrelated settings.
- The "Help" menu provides assistance with the network analyzer and its operation.



You can hide the menu bar using "SYSTEM > DISPLAY > View Bar".

## 3.2.1.5 Menu Structure

All menus show an analogous structure.



- A menu command with a right arrow expands a submenu with further related settings. **Example:** "Meas" expands a submenu to select the measured and displayed quantity.
- A menu command with three dots appended calls up a dialog providing several related settings.
  - **Example:** "Balanced Ports..." opens a dialog to define balanced port configurations.
- A menu command with no arrow or dots initiates an immediate action.

# www.valuetronics.com

**Example:** "S21" selects the forward transmission coefficient  $S_{21}$  as measured quantity.

### 3.2.1.6 Hardkey Panel

The hardkey panel (see "SYSTEM > DISPLAY > View Bar") shows the setup keys which you also find at the front panel of the R&S ZNB. Most keys open a particular tab of the softtool panel providing related control elements. For a short description refer to section "Front Panel Tour" in the Help or in the Getting Started guide.

The hardkey panel corresponds to the TRACE, STIMULUS, CHANNEL, and SYSTEM keypads:



The hardkey panel is particularly useful if the analyzer is controlled from an external monitor or Remote Desktop. Alternatively the settings are accessible from the menu bar or from the context menus.

The hardkey panel is hidden by default to gain screen space for the diagrams. You can display it using "SYSTEM > DISPLAY > View Bar"

# 3.2.1.7 Status Bar

The status bar shows the active channel and drive port (P1, P2 ...), the statistics for the sweep average (if sweep average is on, otherwise "Avg None"), the progress of the sweep, the LXI status symbol (if enabled; see "SYSTEM > SETUP > Remote Settings"), and the current date and time. A green LXI status symbol indicates that a LAN connection has been established; a red symbol indicates that no LAN cable is connected.

# Ch1: Avg

The status bar also shows when the R&S ZNB prepares a sweep with new channel settings; see chapter 3.1.4, "Sweep Control", on page 15.



The progress bar slowly oscillates from left to right and back if the sweep is too fast to be monitored, e.g. because the number of sweep points is low. You can hide the status bar using "SYSTEM > DISPLAY > View Bar".

# 3.2.2 Display Elements in the Diagram

The central part of the screen is occupied by one or several diagrams.

A "diagram" is a rectangular portion of the screen used to display traces. Diagrams are independent of trace and channel settings. A diagram can contain a practically unlimited number of traces which may be assigned to different channels.

Most diagram settings are arranged in the "Display" menu. To assign traces and channels to diagrams, use the control elements in the "TRACE > TRACE CONFIG > Traces" and "CHANNEL > CHANNEL CONFIG > Channels" softtool panels.


Diagrams may contain:

- A title (optional)
- The current number of the diagram
- Measurement results, in particular traces and marker values (optional)
- An indication of the basic channel and trace settings
- Context menus providing settings which are related to a particular display element
- Error messages



The examples in this section have been taken from Cartesian diagrams. All other diagram types provide the same display elements.

Screen Elements

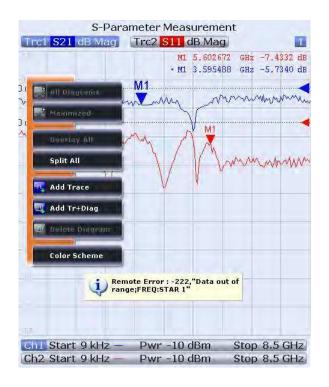

#### 3.2.2.1 Title

An optional title across the top of the diagram may be used for a brief description of the diagram contents.


S-Parameter Measurement



Select "SYSTEM > DISPLAY > Diagram > Show Title" to display or hide the title.

## 3.2.2.2 Traces

A trace is a set of data points displayed together in the diagram. The individual data points are connected so that each trace forms a continuous line.

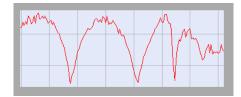

The trace can be complemented by the following display elements, plotted with the same color:

 Reference value (for all traces): The reference value is indicated with a triangle at the right edge of the diagram and a dashed, horizontal line. The value and position of the triangle can be changed in order to modify the diagram scale and shift the trace vertically.

• Measured quantity (for the active trace): The measured quantity is indicated in the trace list; see "Trace List and Trace Settings" on page 27.

A trace can be either a data trace, a memory trace, or a mathematical trace; see "Trace Types" on page 27.

#### **Trace Types**

The analyzer uses traces to display the current measurement result in a diagram but is also capable of storing traces to the memory, recalling stored traces, and defining mathematical relations between different traces. There are three basic trace types:

- Data traces show the current measurement data and are continuously updated as the measurement goes on. Data traces are dynamic traces.
- Memory traces are generated by storing the data trace to the memory. They represent the state of the data trace at the moment when it was stored. Memory traces are static traces which can be stored to a file and recalled.
- Mathematical traces are calculated according to a mathematical relation between constants and the data or memory traces of the active recall set. A mathematical trace that is based on the active data trace is dynamic.

It is possible to generate an unlimited number of memory traces from a data trace and display them together. Markers and marker functions are available for all trace types.



The trace type of each trace in a diagram is indicated in the trace list. MEM<no> at the beginning of the trace name denotes a memory trace, "Math" denotes a mathematical trace. You can also hide each trace ("Invisible") without deleting it.

 S21
 dB Mag
 10 dB / Ref
 0 dB
 Ch1
 Math

 Mem3[Trc1]
 S21
 dB Mag
 10 dB / Ref
 0 dB
 Ch1

 Trc5
 S21
 dB Mag
 10 dB / Ref
 0 dB
 Ch2
 Invisible

#### **Trace List and Trace Settings**

The main properties of all traces assigned to the diagram are displayed in the trace list in the upper part of the diagram.



Each line in the trace list describes a single trace. The active trace is highlighted ("Trc5" in the example above). The lines are divided into several sections with the following contents (from left to right):

- The trace name appears in the first section. The default names for new traces are Trc<n> where <n> is a current number. A "Mem..." preceding the trace name indicates a memory trace. Tap and hold the section for some seconds (or right-click) and call the "Trace Manager" from the context menu to change the trace name.
- The **measured quantity** (e.g. an S-parameter or a ratio) appears on a colored background. The source port for wave quantities and ratios is indicated in brackets.
- The format section shows how the measured data is presented in the graphical display ("TRACE > FORMAT").

- The next sections show the value of the vertical or radial diagram divisions ("Scale Div.") and the reference value ("Ref").
- The **channel** section shows the channel that each trace is assigned to. It is omitted if the all traces in the diagram are assigned to the same channel.
- The type section indicates "Invisible" if a trace is hidden and "Math" if the trace is a
  mathematical trace. "GAT" indicates that a time gate is active for the trace. Use the
  "TRACE > TRACE CONFIG > Mem Math" functions to display and hide data and
  memory traces, and to define mathematical traces.

Tap and hold any of the sections in the trace list (except the type section) to open a context menu and access the most common tasks related to the section.

#### Example:

The following context menu is assigned to the measured quantity section in the trace list:





A label "Cal Off" appears at the end of the trace line if the system error correction no longer applies to the trace.

#### 3.2.2.3 Markers

Markers are tools for numerical readout of measured data and for selecting points on the trace. A marker is displayed with a symbol (e.g. a triangle, a crossbar or a line) on the trace, which may be a data trace or a memory trace. At the same time, the coordinates are displayed in a marker info field or in a table. Each marker can be defined as a normal marker (M), reference marker (R), or delta marker ( $\Delta M$ ).

- АМ1 М2	1.997507 2.252498 6.571545	GHz 0	.7210 dB .1854 dB	12
m <del>R</del>	Mund	M	MWW	- Mm

- A (normal) marker ("M1, M2 ...") determines the coordinates of a measurement point on the trace. Up to 10 different normal markers can be assigned to a trace.
- The reference marker ("R") defines the reference value for all delta markers.
- A delta marker ("ΔM1, ΔM2 ...") indicates the coordinates relative to the reference marker.

A special set of markers M1 to M4 is provided for bandfilter search mode.

The most common tasks to be performed with markers can be achieved using the "Marker" menu functions:

- Determine the coordinates of a measurement point on the trace. In polar diagrams where no x-axis is displayed, markers can be used to retrieve the stimulus value of specific points.
- Determine the difference between two trace points or the relative measurement result ("Delta Mode").
- Convert a complex measurement result into other formats.

Markers also play an important role in performing the following advanced tasks:

- Change the sweep range and the diagram scale ("Marker Function").
- Search for specific points on the trace ("Marker Search", "Target Search", "Bandfilter Search").

### **Activating and Moving Markers**

To select one of several markers as an active marker, do one of the following:

- Tap the marker symbol.
- Tap the marker line in the marker info field.

To change the position of the active marker on the trace use one of the following methods:

- Drag-and-drop the marker symbol to the desired position.
- Tap the "Marker <n>" or "Ref. Marker" softkey to call up the entry bar for the new stimulus value.
- Tap and hold the diagram or select "Mkr. Properties" to call up the "Marker Properties" dialog and select the new stimulus value.
- Use the "Search" functions to place the marker to a specific point on the trace.



If the marker position is defined explicitly by entering a numeric value, the marker position can be outside the sweep range. If it is just varied using the rollkey, the mouse or the cursor keys, it always remains within the sweep range. If the position of a marker outside the sweep range is varied, it is automatically moved to the start or stop value of the sweep range, whichever is closer.

### Marker Info Field

The coordinates of all markers defined in a diagram can be displayed in the info field, which by default is located in the upper right corner.



The info field contains the following information:

- "M1, M2, ..." denote the marker numbers. Markers are displayed with the same color as the associated trace.
- The marker coordinates are expressed in one of the marker formats selected via "TRACE > MARKER > Marker Properties > Marker Format". The formats of the markers assigned to a trace are independent of each other and of the trace format settings.
- The active marker has a dot placed in front of the marker line.
- "R" denotes the reference marker. A "Δ" sign placed in front of the marker line indicates that the marker is in delta mode.

## Customizing the marker info field

To change the position, appearance or contents of the marker info field use one of the following methods:

- Tap and hold the info field to open a context menu providing frequently used marker settings.
- The info field may be moved to several positions in the upper and lower part of the active diagram. Drag-and-drop it to the desired position.
- To change the format of the active marker, select "TRACE > MARKER > Marker Properties > Marker Format".
- To express the coordinates of the active marker relative to the reference marker, activate the delta mode "TRACE > MARKER > Markers > Delta Mode".



# Info Table

If you wish to reserve the full diagram area for the traces, you can drag-and-drop the marker info field in to the info table.

M1	Trc1	5.100040	GHz	-15.2736	dB	Bandstop Trc1	Ref to Max	Track
M2	Trc1	4.568776	GHz	-4.7532	dB	Bandwidth	991.256235	MHz
• M3	Trc1	5.560033	GHz	-4.7532	dB	Center	5.040094	GHz
M4	Trc1	5.040094	GHz	-11.1110	dB	Lower Edge	4.568776	GHz
						Upper Edge	5.560033	GHz
						Quality Factor	5.085	U
						Loss	15.2736	dB

The table is hidden by default. To display the table, select "DISPLAY > Config > Info Table: Show".

Tap and hold on the marker info field to open a **context menu**:

	-
_	Markers
	All Markers Off
	Marker Properties
	e de la constante de
	Мах
J	Min

The settings correspond to the most common functions in the "TRACE > MARKER > Markers", "TRACE > MARKER > Marker Properties", and "TRACE > MARKER > Marker Search" menus.

#### **Marker Coupling**

The concept of marker coupling means that corresponding markers on different traces (i.e. markers with the same number or reference markers) are positioned to the same stimulus values but keep their independent format and type settings.

When a trace with markers is selected as the active trace and marker coupling is switched on, the following happens:

- The active trace and all associated markers are left unchanged. The active trace markers become the master markers of the recall set.
- Markers on the other traces which have no corresponding master marker are removed but remember their properties and can be re-activated after the coupling is released.
- The remaining markers on the other traces become slave markers and are moved to the position of the corresponding master markers. "Missing" slave markers are created so that each trace has the same number of markers placed at the same position.
- If the position of a master marker is outside the sweep range of the slave trace, the slave marker is displayed at the edge of the diagram. The marker info field indicates an invalid measurement result:

M1	5.732428 0	GHz -5.0957	dB
M2	2.940895 0	GHz	
• M3	4.750000 0	GHz -6.7854	dB

While marker coupling is active, it is possible to:

- Move a master marker and thus change the position of all corresponding slave markers.
- Activate another trace in order to make the associated markers the new master markers.

Marker coupling makes sense only if the master and the slave traces use the same stimulus variable. Channels with a different stimulus variable (sweep type) are not coupled.

#### **Marker Search Functions**

The search functions are tools for searching measurement data according to specific criteria. A search consists of analyzing the measurement points of the current trace (or

of a user-defined subrange termed the "Search Range") in order to find one of the following:

- Absolute or relative (local) maxima and minima (minimum/maximum search).
- Trace points with a specific response value (target search).
- Trace segments with a shape that is characteristic for bandpass or bandstop filters (bandfilter search); see "Bandfilter Search" on page 32.

When the search is activated, the active marker is moved to the (next) point that meets the search criteria. If the trace contains no markers, a marker M1 is created and used for the search. The search result is displayed in the marker info field. If no search result can be found, the marker remains at its original position.

Some search functions can be activated repeatedly in order to find all possible search results. Moreover the analyzer provides a "Tracking" mode where the search is repeated after each sweep.

### **Bandfilter Search**

In a bandfilter search, the R&S ZNB locates trace segments with a bandpass or bandstop shape and determines characteristic filter parameters.

Bandpass and bandstop regions can be described with the same parameter set:

- A bandpass region contains a local maximum around which the magnitude of the trace falls off by more than a specified bandwidth factor.
- A bandstop region contains a local minimum around which the magnitude of the trace increases by more than a specified bandwidth factor.

The analyzer locates bandpass and bandstop regions and determines their position ("Center" frequency) and shape ("Bandwidth, lower and upper edge", quality factor. For a meaningful definition of the bandwidth factor, the trace format must be "dB Mag".

Bandstop Trc1	Ref to Max	Track
Bandwidth	653.8226535340	MHz
Center	5.007709480401	GHz
Lower Edge	4.691457457576	GHz
Upper Edge	5.345280111110	GHz
Quality Factor (3dB)	10.741	U
Quality Factor (BW)	7.647	U
Loss	15.2808	dB


The info field contains the following search results:

- "Bandwidth" is the n-dB bandwidth of the bandpass/bandstop region, where n is a selectable bandwidth factor. The bandwidth is equal to the difference between the "Upper Edge" and the "Lower Edge".
- "Center" is calculated as the geometric mean value of the "Lower Edge" (LBE) and "Upper Edge" (UBE) positions:

$$f_{Center} = \sqrt{(f_{LBE} * f_{UBE})}$$

- "Lower Band Edge" is the closest frequency below the center frequency where the trace is equal to the center value minus n dB.
- "Upper Band Edge" is the closest frequency above the center frequency where the trace is equal to the center value minus n dB.

- The "Quality Factor (3 dB)" is the ratio between the "Center" frequency and the 3-dB "Bandwidth"; it does not depend on the selected bandwidth factor.
- The "Quality Factor (BW)" is the ratio between the "Center" frequency and the "Bandwidth" displayed above. This result is available only if the selected bandwidth factor is different from 3 dB.

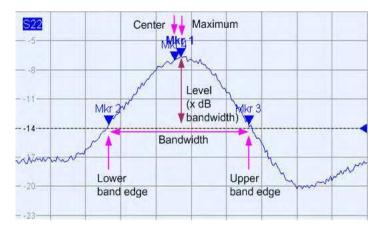

### 3.2.2.4 Channel List and Channel Settings

The main properties of all channels assigned to the traces in the diagram are displayed in the channel list below the diagram.

Ch1 Start 100 kHz —	Pwr -10 dBm Bw 10 kHz	Stop 3 GHz
Ch2 Start 100 kHz —	Pwr -10 dBm Bw 10 kHz	Stop 3 GHz
Ch3 Freq 1 GHz 🗕	Pwr -10 dBm Bw 10 kHz	Stop 1 s
Ch4 Start 100 kHz	Pwr -10 dBm Bw 10 kHz	Stop 3 GHz
Trc4 Start -1 ns —	Time Domain	Stop 4 ns

Each line in the channel list describes a single channel. The channel of the active trace is highlighted. The lines are divided into several sections with the following contents (from left to right):

 The "channel name" appears in the first section. The default names for new channels are Ch<n> where <n> is a current number. If a time domain transform is active, the R&S ZNB displays an additional line to indicate the stimulus range of the displayed time-domain trace.

Tap and hold the section and call the "Channel Manager" from the context menu to change the channel name.

- The measurement mode identifier section (optional) indicates a special test mode of the channel, e.g. the measurement at arbitrary port frequencies ("Arb Port <n>").
- **Start** indicates the lowest value of the sweep variable (e.g. the lowest frequency measured), corresponding to the left edge of a Cartesian diagram.

- The color legend shows the display color of all traces assigned to the channel. The colors are different, so the number of colors is equal to the numbers of traces assigned to the channel.
- The values behind the color legend show the constant stimulus value, which is either the power of the internal signal source (for frequency sweeps and time sweeps) or the CW frequency (for power sweeps), and the measurement bandwidth ("BW").
- **Stop** indicates the highest value of the sweep variable (e.g. the highest frequency measured), corresponding to the right edge of a Cartesian diagram.

Tap and hold any of the sections in the trace list (except the color legend) to open a context menu and access the most common tasks related to the section.

#### Example:

The following context menu is assigned to the channel name section:



The settings in the context menus correspond to the most common functions in the "CHANNEL > CONFIG > Channels", "STIMULUS", "CHANNEL > SWEEP > Sweep Params" and "CHANNEL > POWER BW AVG" menus.

### 3.2.2.5 Context Menus

To provide access to the most common tasks and speed up the operation, the analyzer offers context menus (right-click menus) for the following display elements:

- Diagram
- Marker info field
- Trace list (separate context menus for trace name section, measured quantity section, format section, scale section, and channel section)
- Channel list (separate context menus for channel name section, sweep range section, additional parameter section)

To open a context menu associated with a display element, tap and hold the element for some seconds. Right-click the display element if you use a mouse.

#### Example:


The following context menu is assigned to the channel name section in the channel list:



Except from some particular screen configurations, anything that can be done from the context menu can also be done from the menu bar, the front panel keys or softtool panels. Use whatever method is most convenient.

# 3.2.3 Dialogs

Dialogs provide groups of related settings and allow to make selections and enter data in an organized way. All softkeys with three dots behind their labeling (as in "Balanced Ports...") call up a dialog. The dialogs of the analyzer have an analogous structure and a number of common control elements.

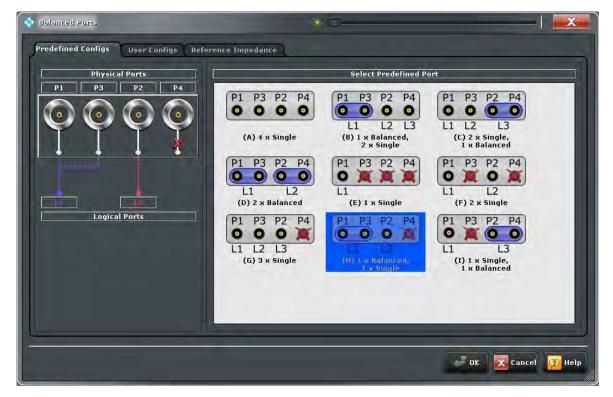

Dialogs are controlled in the usual way. For an introduction refer to section "Working with Dialogs" in the Help or in the Getting Started guide.

## 3.2.3.1 Immediate vs. Confirmed Settings

In some dialogs, the settings take effect immediately so that the effect on the measurement is observable while the dialog is still open. This is especially convenient when a numeric value is incremented or decremented, or when display elements are added or removed.

# www.valuetronics.com

Screen Elements

T	Name 🛧	On	Me	as Type	Chan	nel	Diag	gram 🛛	Scale
1	Tre1	V	821	DAT	Ch1	\$	1	\$	\$
2	Trc2	V	S21	DAT	Ch2	\$	1	\$	\$
				-	-	-			

In most dialogs, however, it is possible to cancel an erroneous input before it takes effect. The settings in such dialogs must be confirmed explicitly.

The two types of dialogs are easy to distinguish:

- Dialogs with immediate settings provide a "Close" button but no "OK" button.
   Example: "Trace Manager" dialog
- Dialogs with confirmed settings provide both an "OK" button and a "Cancel" button. Example: "Balanced Ports" dialog



Immediate settings can be undone using the UNDO key or "System > Undo".

# 3.2.4 Display Formats and Diagram Types

A display format defines how the set of (complex) measurement points is converted and displayed in a diagram. The display formats in the "TRACE > FORMAT" menu use the following basic diagram types:

- Cartesian (rectangular) diagrams are used for all display formats involving a conversion of the measurement data into a real (scalar) quantity, i.e. for "dB Mag", "Phase", "Delay", "SWR", "Lin Mag", "Real", "Imag" and "Unwrapped Phase".
- Polar diagrams are used for the display format "Polar" and show a complex quantity as a vector in a single trace.
- Smith charts are used for the display format "Smith". They show a complex quantity like polar diagrams but with grid lines of constant real and imaginary part of the impedance.
- Inverted Smith charts are used for the display format "Inverted Smith". They show a complex quantity like polar diagrams but with grid lines of constant real and imaginary part of the admittance.




The analyzer allows arbitrary combinations of display formats and measured quantities ("TRACE > MEAS"). Nevertheless, in order to extract useful information from the data, it is important to select a display format which is appropriate to the analysis of a particular measured quantity; see chapter 3.2.4.6, "Measured Quantities and Display Formats", on page 43.

## 3.2.4.1 Cartesian Diagrams

Cartesian diagrams are rectangular diagrams used to display a scalar quantity as a function of the stimulus variable (frequency / power / time).

- The stimulus variable appears on the horizontal axis (x-axis), scaled linearly (sweep types "Lin Frequency", "Power", "Time", "CW Mode") or logarithmically (sweep type "Log Frequency").
- The measured data (response values) appears on the vertical axis (y-axis). The scale
  of the y-axis is linear with equidistant grid lines although the y-axis values may be
  obtained from the measured data by non-linear conversions.

The following examples show the same trace in Cartesian diagrams with linear and logarithmic x-axis scaling.

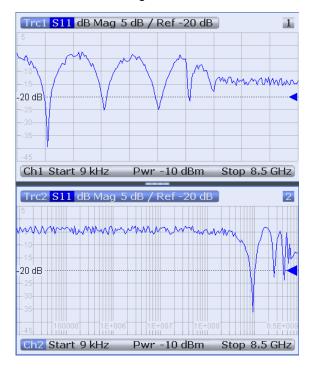

## 3.2.4.2 Conversion of Complex into Real Quantities

The results in the "TRACE > MEAS" menu can be divided into two groups:

- "S-Parameters", "Ratios", "Wave Quantities", "Impedances", "Admittances", "Z-Parameters", "Y-Parameters", and "Imbalances" are complex.
- "Stability" factors, "Power Sensor" results, and "DC" results are real.

The following table shows how the response values in the different Cartesian diagrams are calculated from the complex measurement values z = x + j y (where x, y, z are functions of the sweep variable). The formulas also hold for real results, which are treated as complex values with zero imaginary part (y = 0).

# www.valuetronics.com

Trace Format	Description	Formula	
Lin Mag	Magnitude of z, unconverted	$ z  = sqrt (x^2 + y^2)$	
dB Mag	Magnitude of z in dB	dB Mag(z) = 20 * log z  dB	
Phase	Phase of z	$\varphi$ (z) = arctan (y/x)	
Real	Real part of z	Re(z) = x	
Imag	Imaginary part of z	lm(z) = y	
SWR	(Voltage) Standing Wave Ratio	SWR = (1 +  z ) / (1 -  z )	
Delay	Group delay, neg. derivative of the phase response	$-d \phi(z) / d\Omega (\Omega = 2\pi * f)$	




An extended range of formats and conversion formulas is available for markers. To convert any point on a trace, create a marker and select the appropriate marker format. Marker and trace formats can be selected independently.

# 3.2.4.3 Polar Diagrams

Polar diagrams show the measured data (response values) in the complex plane with a horizontal real axis and a vertical imaginary axis. The grid lines correspond to points of equal magnitude and phase.


- The magnitude of the response values corresponds to their distance from the center. Values with the same magnitude are located on circles.
- The phase of the response values is given by the angle from the positive horizontal axis. Values with the same phase are on straight lines originating at the center.

The following example shows a polar diagram with a marker used to display a pair of stimulus and response values.

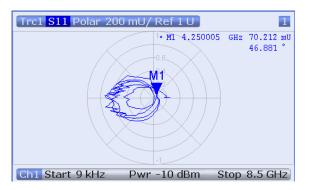

# Example: Reflection coefficients in polar diagrams

If the measured quantity is a complex reflection coefficient ( $S_{11}$ ,  $S_{22}$  etc.), then the center of the polar diagram corresponds to a perfect load  $Z_0$  at the input test port of the DUT (no reflection, matched input), whereas the outer circumference ( $|S_{ii}| = 1$ ) represents a totally reflected signal.

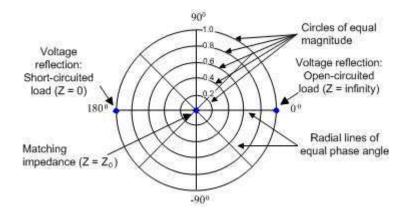

Examples for definite magnitudes and phase angles:

- The magnitude of the reflection coefficient of an open circuit (Z = infinity, I = 0) is one, its phase is zero.
- The magnitude of the reflection coefficient of a short circuit (Z = 0, U = 0) is one, its phase is -180 deg.

### 3.2.4.4 Smith Chart

The Smith chart is a circular diagram that maps the complex reflection coefficients  $S_{ii}$  to normalized impedance values. In contrast to the polar diagram, the scaling of the diagram is not linear. The grid lines correspond to points of constant resistance and reactance.

- Points with the same resistance are located on circles.
- Points with the same reactance produce arcs.

The following example shows a Smith chart with a marker used to display the stimulus value, the complex impedance Z = R + j X and the equivalent inductance L.




A comparison of the Smith chart, the inverted Smith chart and the polar diagram reveals many similarities between the two representations. In fact the shape of a trace does not change at all if the display format is switched from "Polar" to "Smith" or "Inverted Smith" – the analyzer simply replaces the underlying grid and the default marker format.

#### Smith chart construction

In a Smith chart, the impedance plane is reshaped so that the area with positive resistance is mapped into a unit circle.

Screen Elements

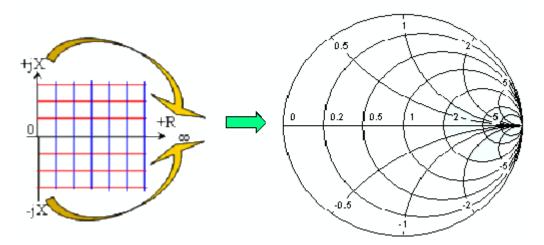

The basic properties of the Smith chart follow from this construction:

- The central horizontal axis corresponds to zero reactance (real impedance). The center of the diagram represents  $Z/Z_0 = 1$  which is the reference impedance of the system (zero reflection). At the left and right intersection points between the horizontal axis and the outer circle, the impedance is zero (short) and infinity (open).
- The outer circle corresponds to zero resistance (purely imaginary impedance). Points outside the outer circle indicate an active component.
- The upper and lower half of the diagram correspond to positive (inductive) and negative (capacitive) reactive components of the impedance, respectively.

#### Example: Reflection coefficients in the Smith chart

If the measured quantity is a complex reflection coefficient  $\Gamma$  (e.g. S<sub>11</sub>, S<sub>22</sub>), then the unit Smith chart can be used to read the normalized impedance of the DUT. The coordinates in the normalized impedance plane and in the reflection coefficient plane are related as follows (see also: definition of matched-circuit (converted) impedances):

$$Z / Z_0 = (1 + \Gamma) / (1 - \Gamma)$$

From this equation it is easy to relate the real and imaginary components of the complex resistance to the real and imaginary parts of  $\Gamma$ :

$$R = \operatorname{Re}(Z/Z_0) = \frac{1 - \operatorname{Re}(\Gamma)^2 - \operatorname{Im}(\Gamma)^2}{\left[1 - \operatorname{Re}(\Gamma)\right]^2 + \operatorname{Im}(\Gamma)^2},$$


$$X = \operatorname{Im}(Z/Z_0) = \frac{2 \cdot \operatorname{Im}(\Gamma)}{\left[1 - \operatorname{Re}(\Gamma)\right]^2 + \operatorname{Im}(\Gamma)^2}$$

According to the two equations above, the graphical representation in a Smith chart has the following properties:

Real reflection coefficients are mapped to real impedances (resistances).

# www.valuetronics.com

- The center of the Γ plane (Γ = 0) is mapped to the reference impedance Z<sub>0</sub>, whereas the circle with |Γ| = 1 is mapped to the imaginary axis of the Z plane.
- The circles for the points of equal resistance are centered on the real axis and intersect at Z = infinity. The arcs for the points of equal reactance also belong to circles intersecting at Z = infinity (open circuit point (1, 0)), centered on a straight vertical line.

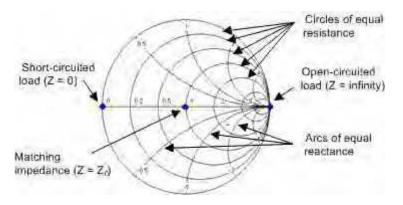

Examples for special points in the Smith chart:


- The magnitude of the reflection coefficient of an open circuit (Z = infinity, I = 0) is one, its phase is zero.
- The magnitude of the reflection coefficient of a short circuit (Z = 0, U = 0) is one, its phase is -180 deg.

## 3.2.4.5 Inverted Smith Chart

The inverted Smith chart is a circular diagram that maps the complex reflection coefficients  $S_{ii}$  to normalized admittance values. In contrast to the polar diagram, the scaling of the diagram is not linear. The grid lines correspond to points of constant conductance and susceptance.

- Points with the same conductance are located on circles.
- Points with the same susceptance produce arcs.

The following example shows an inverted Smith chart with a marker used to display the stimulus value, the complex admittance Y = G + j B and the equivalent inductance L.

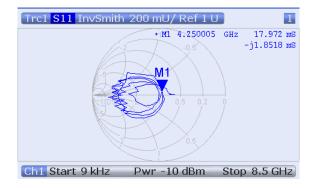




A comparison of the inverted Smith chart with the Smith chart and the polar diagram reveals many similarities between the different representations. In fact the shape of a trace does not change at all if the display format is switched from "Polar" to "Inverted Smith" or "Smith" – the analyzer simply replaces the underlying grid and the default marker format.

#### Inverted Smith chart construction

The inverted Smith chart is point-symmetric to the Smith chart:

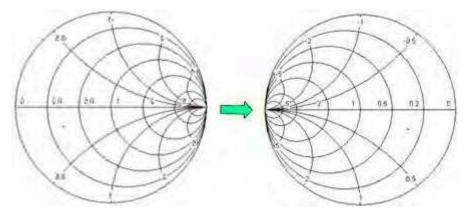

The basic properties of the inverted Smith chart follow from this construction:

- The central horizontal axis corresponds to zero susceptance (real admittance). The center of the diagram represents Y/Y<sub>0</sub> = 1, where Y<sub>0</sub> is the reference admittance of the system (zero reflection). At the left and right intersection points between the horizontal axis and the outer circle, the admittance is infinity (short) and zero (open).
- The outer circle corresponds to zero conductance (purely imaginary admittance).
   Points outside the outer circle indicate an active component.
- The upper and lower half of the diagram correspond to negative (inductive) and positive (capacitive) susceptive components of the admittance, respectively.

#### Example: Reflection coefficients in the inverted Smith chart

If the measured quantity is a complex reflection coefficient G (e.g.  $S_{11}$ ,  $S_{22}$ ), then the unit inverted Smith chart can be used to read the normalized admittance of the DUT. The coordinates in the normalized admittance plane and in the reflection coefficient plane are related as follows (see also: definition of matched-circuit (converted) admittances):

$$Y / Y_0 = (1 - \Gamma) / (1 + \Gamma)$$


From this equation it is easy to relate the real and imaginary components of the complex admittance to the real and imaginary parts of  $\Gamma$ :

$$G = \operatorname{Re}(Y/Y_0) = \frac{1 - \operatorname{Re}(\Gamma)^2 - \operatorname{Im}(\Gamma)^2}{\left[1 + \operatorname{Re}(\Gamma)\right]^2 + \operatorname{Im}(\Gamma)^2}$$

$$B = \operatorname{Im}(Y/Y_0) = \frac{-2 \cdot \operatorname{Im}(\Gamma)}{\left[1 + \operatorname{Re}(\Gamma)\right]^2 + \operatorname{Im}(\Gamma)^2} ,$$

According to the two equations above, the graphical representation in an inverted Smith chart has the following properties:

- Real reflection coefficients are mapped to real admittances (conductances).
- The center of the Γ plane (Γ = 0) is mapped to the reference admittance Y<sub>0</sub>, whereas the circle with |Γ| = 1 is mapped to the imaginary axis of the Y plane.
- The circles for the points of equal conductance are centered on the real axis and intersect at Y = infinity. The arcs for the points of equal susceptance also belong to circles intersecting at Y = infinity (short circuit point (-1, 0)), centered on a straight vertical line.

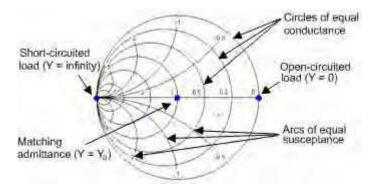

Examples for special points in the inverted Smith chart:

- The magnitude of the reflection coefficient of a short circuit (Y = infinity, U = 0) is one, its phase is –180 deg.
- The magnitude of the reflection coefficient of an open circuit (Y = 0, I = 0) is one, its phase is zero.

#### 3.2.4.6 Measured Quantities and Display Formats

The analyzer allows any combination of a display format and a measured quantity. The following rules can help to avoid inappropriate formats and find the format that is ideally suited to the measurement task.

- All formats are suitable for the analysis of reflection coefficients S<sub>ii</sub>. The formats "SWR", "Smith" and "Inverted Smith" lose their original meaning (standing wave ratio, normalized impedance or admittance) if they are used for transmission S-parameters, ratios and other quantities.
- The complex "Impedances", "Admittances", "Z-parameters", and "Y-parameters" are generally displayed in one of the Cartesian diagrams with linear vertical axis scale or in a polar diagram.
- The real "Stability Factors", "DC Inputs", and the "PAE" are generally displayed in a linear Cartesian diagram ("Lin Mag" or "Real"). In complex formats, real numbers represent complex numbers with zero imaginary part.

The following table gives an overview of recommended display formats.

	Complex dimensionless quan- tities: S-parameters and ratios	Complex quantities with dimensions: Wave quantities, Z-parameters, Y- parameters, impedances, admittan- ces	Real quantities: Stability Factors, DC 1 4, PAE
Lin Mag	ON	ON (default for Z-parameters, Y-param- eters, impedances, admittances)	ON (default)
dB Mag	ON (default)	ON (default for wave quantities)	-
Phase	ON	ON	-
Real	ON	ON	ON
Imag	ON	ON	-
Unwrapped Phase	ON	ON	-
Smith	ON (reflection coefficients S <sub>ii</sub> )	-	-
Polar	ON	-	-
Inverted Smith	ON (reflection coefficients S <sub>ii</sub> )	-	-
SWR	ON (reflection coefficients $S_{ii}$ )	-	-
Delay	ON (transmission coefficients $S_{ij}$ )	-	-

The default formats are activated automatically when the measured quantity is changed.


# 3.3 Measurement Results

This section gives an overview of the measurement results of the network analyzer and the meaning of the different measured quantities. All quantities can be selected in the "TRACE > MEAS >" softtool panels.

The definitions in this and the following sections apply to general n-port DUTs. An analyzer with a smaller number of test ports provides a subset of the n-port quantities.

# 3.3.1 S-Parameters

S-parameters are the basic measured quantities of a network analyzer. They describe how the DUT modifies a signal that is transmitted or reflected in forward or reverse direction. For a 2-port measurement the signal flow is as follows.

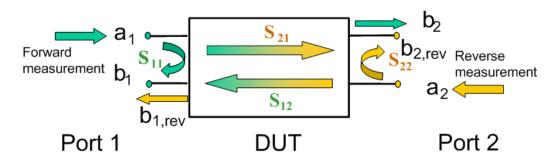

The figure above is sufficient for the definition of S-parameters but does not necessarily show the complete signal flow. In fact, if the source and load ports are not ideally matched, part of the transmitted waves are reflected off the receiver ports so that an additional  $a_2$  contribution occurs in forward measurements, and an  $a_1$  contribution occurs in reverse measurements. The 7-term calibration types Txx take these additional contributions into account.

The scattering matrix links the incident waves  $a_1$ ,  $a_2$  to the outgoing waves  $b_1$ ,  $b_2$  according to the following linear equation:

 $\begin{bmatrix} \boldsymbol{b}_1 \\ \boldsymbol{b}_2 \end{bmatrix} = \begin{bmatrix} \boldsymbol{S}_{11} & \boldsymbol{S}_{12} \\ \boldsymbol{S}_{21} & \boldsymbol{S}_{22} \end{bmatrix} * \begin{bmatrix} \boldsymbol{a}_1 \\ \boldsymbol{a}_2 \end{bmatrix}$ 

The equation shows that the S-parameters are expressed as  $S_{\text{out}>\text{c} \text{ in}>}$ , where <out> and <in> denote the output and input port numbers of the DUT.

#### Meaning of 2-port S-parameters

The four 2-port S-parameters can be interpreted as follows:

- S<sub>11</sub> is the input reflection coefficient, defined as the ratio of the wave quantities b<sub>1</sub>/ a<sub>1</sub>, measured at PORT 1 (forward measurement with matched output and a<sub>2</sub> = 0).
- S<sub>21</sub> is the forward transmission coefficient, defined as the ratio of the wave quantities b<sub>2</sub>/a<sub>1</sub> (forward measurement with matched output and a<sub>2</sub> = 0).
- S<sub>12</sub> is the reverse transmission coefficient, defined as the ratio of the wave quantities b<sub>1</sub> (reverse measurement with matched input, b<sub>1,rev</sub> in the figure above and a<sub>1</sub> = 0) to a<sub>2</sub>.
- S<sub>22</sub> is the output reflection coefficient, defined as the ratio of the wave quantities b<sub>2</sub> (reverse measurement with matched input, b<sub>2,rev</sub> in the figure above and a<sub>1</sub> = 0) to a<sub>2</sub>, measured at PORT 2.

### Meaning of squared amplitudes

The squared amplitudes of the incident and outgoing waves and of the matrix elements have a simple meaning:

a <sub>1</sub>   <sup>2</sup>	Available incident power at the input of a two-port (= the power provided by a generator with a source impedance equal to the reference impedance $Z_0$ )			
a <sub>2</sub>   <sup>2</sup>	Available incident power at the output			
b <sub>1</sub>   <sup>2</sup>	Reflected power at the input of a two-port			
b <sub>2</sub>   <sup>2</sup>	Reflected power at the output			
10*log S <sub>11</sub>   <sup>2</sup> (= 20*log S <sub>11</sub>  )	Reflection loss at the input			
10*log S <sub>22</sub>   <sup>2</sup>	Reflection loss at the output			
10*log S <sub>21</sub>   <sup>2</sup>	Insertion loss at the input			
10*log S <sub>12</sub>   <sup>2</sup>	Insertion loss at the output			

#### Table 3-2: Squared S-parameters

#### 3.3.1.1 Multiport S-Parameters

The multiport S-parameters extend the standard 2-port S-parameters to a larger number of incoming and outgoing waves. For a 4-port DUT,

<b>b</b> <sub>1</sub>	<b>S</b> <sub>11</sub>	$S_{12}$		S <sub>14</sub>	a₁
<b>b</b> <sub>2</sub>	<b>S</b> <sub>21</sub>	$S_{22}$	<b>S</b> <sub>23</sub>	<b>S</b> <sub>24</sub>	a <sub>2</sub>
<b>b</b> <sub>3</sub>	S <sub>31</sub>	$S_{32}$	<b>S</b> <sub>33</sub>	S <sub>24</sub> S <sub>34</sub>	a₃
b₄	<b>S</b> 41		<b>S</b> 43	<b>S</b> 44	a₄

where again  $a_i$  (i = 1 to 4) denote the incident,  $b_i$  (i = 1 to 4) denote the outgoing waves, and the S-parameters are expressed as  $S_{\text{out}>\text{c} \text{ in}>\text{.}}$ 

The indices of the S-parameters described so far number the output and input ports of a DUT; the parameters are referred to as single-ended S-parameters. The S-parameter description can also be used to differentiate between different propagation modes of the waves at the output and input ports. This results in the so-called mixed mode S-parameters. The analyzer measures either single-ended or mixed mode S-parameters.

# 3.3.2 Impedance Parameters


An impedance is the complex ratio between a voltage and a current. The analyzer provides two independent sets of impedance parameters:

- Converted impedances (each impedance parameter is obtained from a single Sparameter)
- Z-parameters (complete description of the n-port DUT)

#### 3.3.2.1 Converted Impedances

The converted impedance parameters describe the input impedances of a DUT with fully matched outputs. In the figures below the indices i and j number the analyzer/DUT ports,  $Z_{0i}$  is the reference impedance at the DUT port i.

Measurement Results

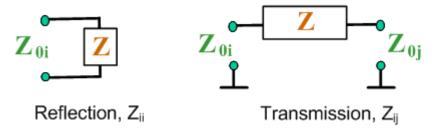

The analyzer converts a single measured S-parameter to determine the corresponding converted impedance. As a result, converted Z-parameters cannot completely describe general n-port DUTs:

- A reflection parameter Z<sub>ii</sub> completely describes a one-port DUT. For n-port DUTs (n>1) the reflection parameters Z<sub>ii</sub> describe the input impedances at ports i (i = 1 to n) under the condition that each of the other ports is terminated with its reference impedance (matched-circuit parameters).
- A two-port transmission parameter Z<sub>ij</sub> (i ≠ j) can describe a pure serial impedance between the two ports.

#### **Relation with S-parameters**

The converted impedances  $Z_{ii}$  are calculated from the reflection S-parameters  $S_{ii}$  according to:

$$Z_{ii} = Z_{0i} \frac{1 + S_{ii}}{1 - S_{ii}}$$

The transmission parameters are calculated according to:

$$Z_{ij} = 2 \cdot \frac{\sqrt{Z_{0i} \cdot Z_{0j}}}{S_{ij}} - (Z_{0i} + Z_{0j}), \quad i \neq j,$$

The converted admittances are defined as the inverse of the impedances.

Examples:

- Z<sub>11</sub> is the input impedance of a 2-port DUT that is terminated at its output with the reference impedance Z<sub>0</sub> (matched-circuit impedance measured in a forward reflection measurement).
- The extension of the impedances to more ports and mixed mode measurements is analogous to S-parameters. Z<sub>dd44</sub> is the differential mode input impedance at port 4 of a DUT that is terminated at its other ports with the reference impedance Z<sub>0</sub>.



You can also read the converted impedances in a reflection coefficient measurement from the Smith chart.

## 3.3.2.2 Z-Parameters


The Z-parameters describe the impedances of a DUT with open output ports (i = 0). The analyzer provides the full set of Z-parameters including the transfer impedances (i.e. the complete nxn Z-matrix for an n port DUT).

This means that Z-parameters can be used as an alternative to S-parameters (or Y-parameters) in order to completely characterize a linear n-port network.

### 2-Port Z-Parameters

In analogy to S-parameters, Z-parameters are expressed as  $Z_{\text{out}>\text{c} \text{ in}>}$ , where <out> and <in> denote the output and input port numbers of the DUT.

The Z-parameters for a two-port are based on a circuit model that can be expressed with two linear equations:

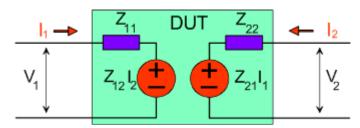

```
V_1 = Z_{11}I_1 + Z_{12}I_2V_2 = Z_{21}I_1 + Z_{22}I_2
```

# Meaning of Z-parameters

The four 2-port Z-parameters can be interpreted as follows:

- Z<sub>11</sub> is the input impedance, defined as the ratio of the voltage V<sub>1</sub> to the current I<sub>1</sub>, measured at port 1 (forward measurement with open output, I<sub>2</sub> = 0).
- Z<sub>21</sub> is the forward transfer impedance, defined as the ratio of the voltage V<sub>2</sub> to the current I<sub>1</sub> (forward measurement with open output, I<sub>2</sub> = 0).
- Z<sub>12</sub> is the reverse transfer impedance, defined as the ratio of the voltage V<sub>1</sub> to the current I<sub>2</sub> (reverse measurement with open input, I<sub>1</sub> = 0).
- $Z_{22}$  is the output impedance, defined as the ratio of the voltage V<sub>2</sub> to the current I<sub>2</sub>, measured at port 2 (reverse measurement with open input, I<sub>1</sub> = 0).

Z-parameters can be easily extended to describe circuits with more than two ports or several modes of propagation.

# 3.3.3 Admittance Parameters

An admittance is the complex ratio between a current and a voltage. The analyzer provides two independent sets of admittance parameters:

 Converted admittances (each admittance parameter is obtained from a single Sparameter)

• Y-parameters (complete description of the n-port DUT)

## 3.3.3.1 Converted Admittances

The converted admittance parameters describe the input admittances of a DUT with fully matched outputs. The converted admittances are the inverse of the converted impedances.

The analyzer converts a single measured S-parameter to determine the corresponding converted admittance. As a result, converted Y-parameters cannot completely describe general n-port DUTs:

- A reflection parameter Y<sub>ii</sub> completely describes a one-port DUT. For n-port DUTs (n>1) the reflection parameters Y<sub>ii</sub> describe the input admittances at ports i (i = 1 to n) under the condition that each of the other ports is terminated with its reference impedance (matched-circuit parameters).
- A two-port transmission parameter Y<sub>ij</sub> (i ≠ j) can describe a pure serial impedance between the two ports.

### **Relation with S-parameters**

The converted admittances  $Y_{ii}$  are calculated from the reflection S-parameters  $S_{ii}$  according to:

$$Y_{ii} = \frac{1}{Z_{0i}} \frac{1 - S_{ii}}{1 + S_{ii}} = 1/Z_{ii}$$

The transmission parameters are calculated according to:

$$Y_{ij} = \frac{S_{ij}}{2 \cdot \sqrt{Z_{0i} \cdot Z_{0j}} - S_{ij} \cdot (Z_{0i} + Z_{0j})} = 1/Z_{ij}, \quad i \neq j, \quad i, j = 1, ..., 99$$

Examples:

- Y<sub>11</sub> is the input admittance of a 2-port DUT that is terminated at its output with the reference impedance Z<sub>0</sub> (matched-circuit admittance measured in a forward reflection measurement).
- The extension of the admittances to more ports and mixed mode measurements is analogous to S-parameters. Y<sub>dd22</sub> is the differential mode input admittance at port 2 of a DUT that is terminated at its other ports with the reference impedance Z<sub>0</sub>.

You can also read the converted admittances in a reflection coefficient measurement from the inverted Smith chart.

# www.valuetronics.com

### 3.3.3.2 Y-Parameters

The Y-parameters describe the admittances of a DUT with output ports terminated in a short circuit (V = 0). The analyzer provides the full set of Y-parameters including the transfer admittances (i.e. the complete n x n Y-matrix for an n port DUT).

This means that Y-parameters can be used as an alternative to S-parameters (or Zparameters) in order to completely characterize a linear n-port network.

## 2-Port Y-Parameters

In analogy to S-parameters, Y-parameters are expressed as  $Y_{\text{out} > \text{c} \text{ in} >}$ , where <out> and <in> denote the output and input port numbers of the DUT. In analogy to Z-parameters, the Y-parameters for a two-port are based on a circuit model that can be expressed with two linear equations:

$$\begin{split} I_1 &= Y_{11}V_1 + Y_{12}V_2 \\ I_2 &= Y_{21}V_1 + Y_{22}V_2 \end{split}$$

### **Meaning of Y-parameters**

The four 2-port Y-parameters can be interpreted as follows:

- Y<sub>11</sub> is the input admittance, defined as the ratio of the current I<sub>1</sub> to the voltage V<sub>1</sub>, measured at port 1 (forward measurement with output terminated in a short circuit, V<sub>2</sub> = 0).
- Y<sub>21</sub> is the forward transfer admittance, defined as the ratio of the current I<sub>2</sub> to the voltage V<sub>1</sub> (forward measurement with output terminated in a short circuit, V<sub>2</sub> = 0).
- Y<sub>12</sub> is the reverse transfer admittance, defined as the ratio of the current I<sub>1</sub> to the voltage V<sub>2</sub> (reverse measurement with input terminated in a short circuit, V<sub>1</sub> = 0).
- Y<sub>22</sub> is the output admittance, defined as the ratio of the current I<sub>2</sub> to the voltage V<sub>2</sub>, measured at port 2 (reverse measurement with input terminated in a short circuit, V<sub>1</sub> = 0).

Y-parameters can be easily extended to describe circuits with more than two ports or several modes of propagation.

# 3.3.4 Wave Quantities and Ratios

The elements of the S-, Z- and Y-matrices represent fixed ratios of complex wave amplitudes. As long as the assumption of linearity holds, the S-, Z- and Y-parameters are independent of the source power.

The network analyzer provides two additional sets of measurement parameters which have a unambiguous meaning even if the DUT is measured outside its linear range:

- "Wave Quantities" provide the power of any of the transmitted or received waves.
- "Ratios" provide the complex ratio of any combination of transmitted or received wave quantities.

1

In contrast to S-, Z- and Y-parameters, wave quantities and ratios are not system-error corrected. A power calibration can be applied to wave quantities and ratios.

## 3.3.4.1 Wave Quantities

A wave quantity measurement provides the power of any of the transmitted or received waves. The power can be displayed in voltage units (e.g. "V" or "dBmV") or equivalent power units (e.g. "W" or "dBm").




## Examples for using wave quantities

The wave quantities provide the power at the different receive ports of the analyzer. This is different from an S-parameter measurement, where the absolute power of a linear device is cancelled. Wave quantities are therefore suitable for the following measurement tasks:

- Analysis of non-linearities of the DUT.
- Use of the analyzer as a selective power meter.
   To increase the accuracy or correct a possible attenuation in the source signal path, it is recommended to perform a power calibration.

The notation for wave quantities includes the direction and the test port number. Additionally, the source port must be specified. The letter a indicates a transmitted wave, b a received wave.

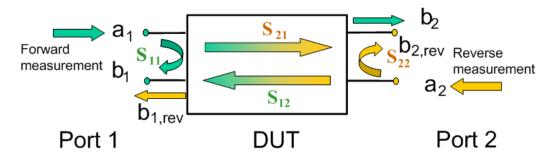

Examples:

- a<sub>1</sub> Src Port 1 is the outgoing wave at test port 1. In a standard S-parameter measurement, this wave is fed to the input port (port 1) of the DUT (forward measurement).
- b<sub>1</sub> Src Port 1 is the incoming wave at test port 1. In a standard S-parameter measurement, this is the reflected wave at port 1 of the DUT (forward measurement).

## 3.3.4.2 Ratios

A ratio measurement provides the complex ratio of any combination of transmitted or received wave amplitudes. Ratios complement the S-parameter measurements, where only ratios of the form  $b_i/a_j$  (ratio of the incoming wave to the outgoing wave at the test ports i and j of the DUT) are considered.



## Examples for using ratios

A measurement of ratios is particularly suitable for the following test scenarios:

- The test setup or some of its components (e.g. active components or non-reciprocal devices) do not allow a system error correction so that a complete S-parameter measurement is not possible.
- The test setup contains frequency-converting components so that the transmitted and the received waves are at different frequencies.
- A ratio of two arbitrary waves that is not an element of the S-matrix (e.g. a ratio of the form a<sub>i</sub>/a<sub>i</sub>) is needed.

The notation for ratios includes the two waves with their directions and test port numbers. Additionally, the source port must be specified. In analogy to wave quantities, the letter a indicates an outgoing wave, b an incoming wave.

Examples:

- b<sub>2</sub>/a<sub>1</sub> Src Port 1 is the ratio of the outgoing wave b<sub>2</sub> at port 2 and the incident wave a<sub>1</sub> at port 1; this corresponds to the S-parameter S<sub>21</sub> (forward transmission coefficient).
- b<sub>1</sub>/a<sub>1</sub> Src Port 1 is the ratio of the wave quantities b<sub>1</sub> and a<sub>1</sub>, measured at PORT 1; this corresponds to the S-parameter S<sub>11</sub> (input reflection coefficient).

#### 3.3.4.3 Detector Settings

The "Detector" settings select the algorithm that is used to calculate the displayed measurement points from the raw data. The "Detector" can be selected in the "More Ratios" and "More Wave Quantities" dialogs.

Numerator			minator	
\$ b 1	1¢`	( ÷	a (1	÷
roperties				
Source Port	Ra	tio		
Port 1	() <b>‡</b> ) =	b1/a1		
Detector	hie	as Time		
Normal	1=			
etector	tie internet	urie Weiersen		

The following detectors are available:

 Normal selects the default detector mode where each measurement point is displayed without modification as soon as it is recognized to be valid. The analyzer then proceeds to the next sweep point. Normal detector mode ensures that the measurement is performed at maximum speed and that a meaningful complex result is obtained.

- AVG Real Imag collects all valid results at each sweep point during the "Meas. Time" set in the "More Ratios" or "More Wave Quantities" dialog and calculates the complex arithmetic mean value of these results. This yields the complex average of the wave quantities or ratios. Averaging tends to remove statistical fluctuations (e.g. noise contributions) from the measured signal.
- AVG Mag Phase collects all valid results at each sweep point during the "Meas. Time" set in the "More Ratios" or "More Wave Quantities" dialog and calculates the root mean square (RMS) of the linear magnitude of these results. This yields the magnitude of the measurement point. Note that the phase is not evaluated in this process so that complex conversions (e. g. the calculation of real and imaginary values) do not really make sense.



## **Combining different detectors**

The detector setting in the "More Ratios" menu affects the ratio of a numerator and a denominator wave quantity. This does not place any restrictions on the measurement functionality of the analyzer, because ratios can also be formed by measuring the numerator and denominator individually and using the trace functions. A possible application is the comparison of different detector settings for a particular trace.




## Error Messages

The analyzer generates a warning if the selected measurement time for the "AVG..." detectors is too long. At the same time, bit no. 15 in the ... INTegrity:HARDware status register is set. Reduce the measurement time and/or reduce the IF bandwidth until the warning disappears. A warning also appears if the measurement time for the "AVG..." detectors is too short. Increase the measurement time and/or increase the IF bandwidth until the warning disappears.

# 3.3.5 Unbalance-Balance Conversion

Unbalance-balance conversion is the simulation of one or more unbalance-balance transformers (baluns) integrated in the measurement circuit in order to convert the DUT ports from an unbalanced state into a balanced state and virtually separate the differential and common mode signals. The analyzer measures the unbalanced state but converts the results and calculates mixed mode parameters, e.g. mixed mode S-parameters. No physical transformer is needed.

To perform balanced measurements, a pair of physical analyzer ports is combined to form a logical port. The balanced port of the DUT is directly connected to the analyzer ports. For a two-port analyzer, a single balanced port can be defined.

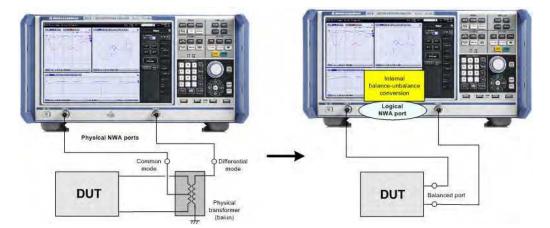


Unbalance-balance conversion avoids the disadvantages of real transformers:

- There is no need to fabricate test fixtures with integrated baluns for each type of DUT.
- The measurement is not impaired by the non-ideal characteristics of the balun (e.g. error tolerances, limited frequency range).
- Calibration can be performed at the DUT's ports. If necessary (e.g. to compensate for the effect of a test fixture), it is possible to shift the calibration plane using length offset parameters.
- Differential and common mode parameters can be evaluated with a single test setup.


## 3.3.5.1 Balanced Port Configurations

Defining a logical port requires two physical analyzer ports. The ports of an analyzer are equivalent and can be freely combined. Moreover, it is possible to assign arbitrary, independent reference impedance values to each unbalanced port and to the differential and common mode of each logical port. The following types of balanced devices can be measured with 2-port, 3-port and 4-port analyzers:

2-port analyzers: Reflection measurements on 1 balanced port

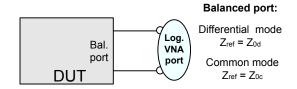


3-port analyzers: Reflection and transmission measurements on 1 balanced port

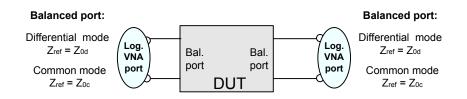

4-port analyzers: Reflection and transmission measurements on 1 or 2 balanced ports

# www.valuetronics.com

**Measurement Results** 

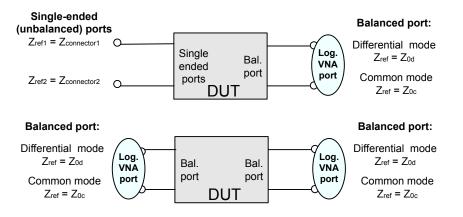

A balanced port configuration is defined by simply selecting the pairs of physical ports that are combined to form balanced ports and defining the two reference impedances for the differential and common mode at each balanced port. All this is done in a single "Balanced Ports" dialog. The most commonly used balanced port configurations and impedances are predefined and can be selected in the "Measurement Wizard".

Depending on the test setup, the analyzer provides different types of mixed mode parameters; refer to the following sections for details.

#### 3.3.5.2 Mixed Mode Parameters

Mixed mode parameters are an extension of normal mode parameters (e.g. S-parameters, impedances and admittances) for balanced measurements. The analyzer can measure mixed mode parameters as soon as a balanced port configuration is selected.


Mixed mode parameters are used to distinguish the following three port modes:

- s: Single-ended (for unbalanced ports)
- d: Differential mode (for balanced ports)
- c: Common mode (for balanced ports)

The notation of a general S-parameter is  $S_{\text{mout}>\text{min}>\text{out}>\text{in}>}$ , where <mout> and <min> denote the output and input port modes, <out> and <in> denote the output and input port numbers.

#### Meaning of 2-port mixed mode S-parameters

The mixed mode 2-port S-parameters can be interpreted as follows:

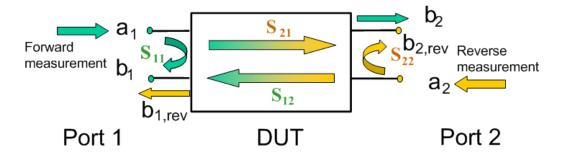

# www.valuetronics.com


- S<sub><mout><min>11</sub> is the mixed mode input reflection coefficient, defined as the ratio of the wave quantities b<sub>1</sub> (mode mout) to a<sub>1</sub> (mode min), measured at PORT 1 (forward measurement with matched output and a<sub>2</sub> = 0).
- S<sub><mout><min>21</sub> is the mixed mode forward transmission coefficient, defined as the ratio of the wave quantities b<sub>2</sub> (mode mout) to a<sub>1</sub> (mode min) (forward measurement with matched output and a<sub>2</sub> = 0).
- S<sub><mout><min>12</sub> is the mixed mode reverse transmission coefficient, defined as the ratio of the wave quantities b<sub>1</sub> (mode mout) (reverse measurement with matched input, b<sub>1</sub>' in the figure above and a<sub>1</sub> = 0) to a<sub>2</sub> (mode min).
- S<sub><mout><min>22</sub> is the mixed mode output reflection coefficient, defined as the ratio of the wave quantities b<sub>2</sub> (mode mout) (reverse measurement with matched input, b<sub>2</sub>' in the figure above and a<sub>1</sub> = 0) to a<sub>2</sub> (mode min), measured at PORT 2.

If <mout> is different from <min>, the S-parameters are called mode conversion factors.


#### Mixed Mode Parameters for Different Test Setups

Which types of mixed mode parameter are available depends on the measured device and the port configuration of the analyzer. The following examples of mixed more parameters can all be obtained with a 4-port analyzer.

- 1. DUT with only single-ended ports: No balanced port definition necessary, the analyzer provides single-ended multiport parameters.
- 2. DUT with one balanced port: Only reflection and mode conversion measurements with differential and common mode parameters.

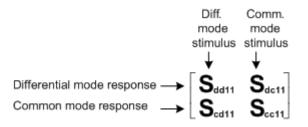

3. DUT with one balanced and one single-ended port.

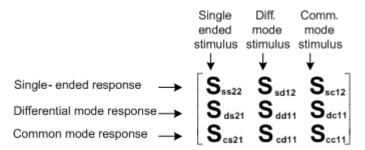


4. DUT with two balanced ports or one balanced and two single-ended ports. Both device types are fully characterized by 4x4 mixed mode S-matrices.

#### 3.3.5.3 Imbalance Parameters


An ideal unbalance-balance transformer (balun) converts an unbalanced signal into a balanced one and vice versa. When it is driven with an unbalanced signal at its physical port k, unbalanced signals with equal amplitude and opposite phase appear at the physical ports m and n.


This means that the ratio  $-S_{km}/S_{kn}$  of the physical transmission coefficients of an ideal balun equals to 1. This ratio is called imbalance; it is a measure for the deviation of the balun from ideality. The definition of the imbalance of a DUT with one or two balanced ports and physical port numbers k < I, m < n is given below.

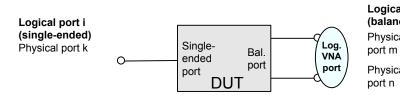

Logical port j (balanced) Physical Physical

The imbalance of a DUT with a single ended logical input port i and a balanced logical output port j is defined as  $Imb_{ij} = -S_{km}/S_{kn}$  and  $Imb_{ji} = -S_{mk}/S_{nk}$ .

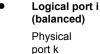

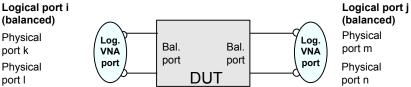

The imbalance of a DUT with a balanced logical input port i and a balanced logical output port j is defined as  $Imb_{ij} = -(S_{km} - S_{kn})/(S_{lm} - S_{ln})$  and  $Imb_{ji} = -(S_{mk} - S_{nk})/(S_{ml} - S_{ln})$ S<sub>nl</sub>).

In general the imbalance is a quantity with two numeric indices numbering the logical output port and the logical input port of the DUT during the measurement (Imb<sub><out><in></sub>).

#### 3.3.5.4 **Reference Impedances**

Changing the reference impedances of the analyzer ports is often referred to as renormalization of port impedances. Renormalization means that the measurement results measured at 50  $\Omega$  (75  $\Omega$ ) are converted into results at arbitrary port impedance.

- Renormalization of the physical port impedances affects e.g. S-parameters and wave guantities in "Power" representation.
- Renormalization of the balanced port impedances affects all measured quantities ("Trace > Measure") that the analyzer provides for balanced ports.

The default reference impedance of a physical port is equal to the reference impedance of the connector type assigned to the port (50  $\Omega$  or 75  $\Omega$ ). It can be defined as a complex value. For balanced ports it is possible to define separate complex reference impedances for differential and for common mode.

The default values for the balanced port reference impedances are derived from the default reference impedance of the physical analyzer ports ( $Z_0 = 50 \Omega$ ):

- The default value for the differential mode is Z<sub>0d</sub> = 100 Ω = 2\*Z<sub>0</sub>.
- The default value for the common mode is  $Z_{0c} = 25 \Omega = Z_0/2$

Renormalization can be based on two alternative waveguide circuit theories whose conversion formulas may yield different results if the reference impedance of at least one test port has a non-zero imaginary part.

#### Conversion formula for wave quantities and S-parameters

Renormalization transforms the "raw" S-matrix  $S_0$  for the default reference impedances  $Z_{0i}$  (with physical port number index i = 1,2,...,n) into a "renormalized" S-matrix  $S_1$  for the modified reference impedances  $Z_{1i}$ . In terms of raw and renormalized wave quantities  $a_{0i}$ ,  $b_{0i}$  and  $a_{1i}$ ,  $b_{1i}$ ,  $S_0$  and  $S_1$  are defined as follows:

$$\begin{pmatrix} b_{01} \\ b_{02} \\ \dots \\ b_{0n} \end{pmatrix} = S_0 \cdot \begin{pmatrix} a_{01} \\ a_{02} \\ \dots \\ a_{0n} \end{pmatrix}; \quad \begin{pmatrix} b_{11} \\ b_{12} \\ \dots \\ b_{1n} \end{pmatrix} = S_1 \cdot \begin{pmatrix} a_{11} \\ a_{12} \\ \dots \\ a_{1n} \end{pmatrix}.$$

The renormalized wave quantities  $(a_1 \text{ and } b_1)$  and the S-matrix  $S_1$  can be calculated from  $S_0$  and the reference impedances  $Z_{0i}$ ,  $Z_{1i}$  according to two alternative waveguide circuit theories.

#### 1. Travelling waves

In the model of Marks and Williams ("A General Waveguide Circuit Theory"), the wave quantities a and b are transformed as follows:

$$\begin{pmatrix} a_{1i} \\ b_{1i} \end{pmatrix} = \frac{1}{2Z_{0i}} \frac{|Z_{0i}|}{|Z_{1i}|} \sqrt{\frac{\operatorname{Re}(Z_{1i})}{\operatorname{Re}(Z_{0i})}} \cdot \begin{pmatrix} Z_{0i} + Z_{1i} & Z_{0i} - Z_{1i} \\ Z_{0i} - Z_{1i} & Z_{0i} + Z_{1i} \end{pmatrix}} \cdot \begin{pmatrix} a_{0i} \\ b_{0i} \end{pmatrix}$$

The renormalized S-matrix S1 is calculated as

$$S_{1} = P^{-1} (S_{0} - \gamma) (E - \gamma S_{0})^{-1} P$$

with the unit matrix E and two additional matrices with the elements

$$\gamma_{ii} = \frac{Z_{1i} - Z_{0i}}{Z_{1i} + Z_{0i}}$$

$$P_{ii} = \frac{2Z_{0i}}{Z_{0i} + Z_{1i}} \left| \frac{Z_{1i}}{Z_{0i}} \right| \sqrt{\frac{\operatorname{Re}(Z_{0i})}{\operatorname{Re}(Z_{1i})}}$$

2. Power waves

In the model of Kurokawa ("Power Waves and the Scattering Matrix"), the wave quantities a and b are transformed as follows:

$$\begin{pmatrix} a_{1i} \\ b_{1i} \end{pmatrix} = \frac{1}{2\sqrt{\operatorname{Re}(Z_{0i})\operatorname{Re}(Z_{1i})}} \cdot \begin{pmatrix} \overline{Z_{0i}} + Z_{1i} & Z_{0i} - Z_{1i} \\ \overline{Z_{0i}} - \overline{Z_{1i}} & Z_{0i} + \overline{Z_{1i}} \end{pmatrix} \cdot \begin{pmatrix} a_{0i} \\ b_{0i} \end{pmatrix}$$

The renormalized S-matrix S1 is calculated as

$$S_1 = A^{-1} \left( S_0 - \overline{\Gamma} \right) \left( E - \Gamma S_0 \right)^{-1} \overline{A}$$

with the unit matrix E and two additional matrices with the elements

$$\Gamma_{ii} = \frac{Z_{1i} - Z_{0i}}{Z_{1i} + \overline{Z}_{0i}}$$
$$A_{ii} = \frac{1 - \overline{\Gamma_{ii}}}{|1 - \Gamma_{ii}|} \sqrt{|1 - \Gamma_{ii}\overline{\Gamma_{ii}}|}$$

# 3.3.6 Stability Factors

The stability factors K,  $\mu$ 1 and  $\mu$ 2 are real functions of the (complex) S-parameters, defined as follows:

$$K := \frac{1 - |S_{11}|^2 - |S_{22}|^2 + |S_{11} \cdot S_{22} - S_{12} \cdot S_{21}|^2}{2 \cdot |S_{12} \cdot S_{21}|}$$

$$\mu_1 := \frac{1 - |S_{11}|^2}{|S_{22} - \overline{S_{11}} \cdot (S_{11} \cdot S_{22} - S_{12} \cdot S_{21})| + |S_{12} \cdot S_{21}|}$$

$$\mu_2 := \frac{1 - |S_{22}|^2}{|S_{11} - \overline{S_{22}} \cdot (S_{11} \cdot S_{22} - S_{12} \cdot S_{21})| + |S_{12} \cdot S_{21}}$$

where  $\overline{S}$  denotes the complex conjugate of S.

Stability factors are calculated as functions of the frequency or another stimulus parameter. They provide criteria for linear stability of two-ports such as amplifiers. A linear circuit is said to be unconditionally stable if no combination of passive source or load can cause the circuit to oscillate.

- The K-factor provides a necessary condition for unconditional stability: A circuit is unconditionally stable if K>1 and an additional condition is met. The additional condition can be tested by means of the stability factors µ<sub>1</sub> and µ<sub>2</sub>.
- The μ<sub>1</sub> and μ<sub>2</sub> factors both provide a necessary and sufficient condition for unconditional stability: The conditions μ<sub>1</sub>>1 or μ<sub>2</sub>>1 are both equivalent to unconditional sta-

bility. This means that  $\mu_1$  and  $\mu_2$  provide direct insight into the degree of stability or potential instability of linear circuits.

References: Marion Lee Edwards and Jeffrey H. Sinsky, "A New Criterion for Linear 2-Port Stability Using a Single Geometrically Derived Parameter", IEEE Trans. MTT, vol. 40, No. 12, pp. 2303-2311, Dec. 1992.

# 3.3.7 Delay, Aperture, Electrical Length

The group delay  $\tau_g$  represents the propagation time of wave through a device.  $\tau_g$  is a real quantity and is calculated as the negative of the derivative of its phase response. A nondispersive DUT shows a linear phase response, which produces a constant delay (a constant ratio of phase difference to frequency difference).

The group delay is defined as:

$$\tau_g = -\frac{d\phi_{rad}}{d\omega} = -\frac{d\phi_{deg}}{360^\circ df}$$

where

 $\Phi_{rad}$ ,  $\Phi_{deq}$ = phase response in radians or degrees

 $\omega$  = angular velocity in radians/s

f = frequency in Hz

In practice, the analyzer calculates an approximation to the derivative of the phase response, taking a small frequency interval  $\Delta f$  and determining the corresponding phase change  $\Delta \Phi$ . The delay is thus computed as:

$$\tau_{g,meas} = -\frac{\Delta \phi_{deg}}{360^{\circ} \cdot \Delta f}$$

The aperture  $\Delta f$  must be adjusted to the conditions of the measurement.

If the delay is constant over the considered frequency range (non-dispersive DUT, e.g. a cable), then  $\tau_g$  and  $\tau_{g,meas}$  are identical and

$$\tau_{g} = \frac{d \left(360^{\circ} f \cdot \Delta t\right)}{360^{\circ} d f} = \Delta t = \frac{L_{mech} \cdot \sqrt{\varepsilon}}{c}$$

where  $\Delta t$  is the propagation time of the wave across the DUT, which often can be expressed in terms of its mechanical length  $L_{mech}$ , the permittivity  $\varepsilon$ , and the velocity of light c. The product  $L_{mech} \cdot \text{sqrt}(\varepsilon)$  is termed the electrical length of the DUT and is always larger or equal than the mechanical length ( $\varepsilon > 1$  for all dielectrics and  $\varepsilon = 1$  for the vacuum).

# 3.4 Operations on Traces

The R&S ZNB can perform more complex operations on the measured traces. Some of the operations, e.g. the time domain transform, require additional software options; see chapter 3.7, "Optional Extensions and Accessories", on page 111.

The R&S ZNB can also check whether the measured values comply with specified limits and export trace data, using different file formats.

# 3.4.1 Limit Check

A limit line is a set of data to specify the allowed range for some or all points of a trace. Typically, limit lines are used to check whether a DUT conforms to the rated specifications (conformance testing).

- The "upper" limit line defines the maximum value for the trace points.
- The "lower" limit line defines the minimum value for the trace points.
- The "ripple" limit defines the maximum difference between the largest and the smallest response value of the trace. A ripple limit test is suitable e.g. to check whether the passband ripple of a filter is within acceptable limits, irrespective of the actual transmitted power in the passband.
- The "circle" limit defines the acceptable values as a circular area within a polar diagram.

A limit check consists of comparing the measurement results to the limit lines and display a pass/fail indication. An acoustic warning and a TTL signal at the "USER PORT" on the rear panel (for test automatization) can be generated in addition if a limit is exceeded.

Upper and lower limit lines are both defined as a combination of segments with a linear dependence between the measured quantity and the sweep variable (stimulus variable). Similar to this segmentation, ripple limits may be defined in several ranges. The limit lines (except circle limits) can be stored to a file and recalled. Data or memory traces can be used to define the segments of an upper or lower limit line. Moreover it is possible to modify the upper and lower limit lines globally by adding an offset to the stimulus or response values.

## 3.4.1.1 Rules for Limit Line Definition


The analyzer places very few restrictions on the definition of limit line segments.

The following rules ensure a maximum of flexibility:

- Segments do not have to be sorted in ascending or descending order (e.g. the "Start Stimulus" value of segment no. n doesn't have to be smaller than the "Start Stimulus" value of segment no. n+1).
- Overlapping segments are allowed. The limit check in the overlapping area is related to the tighter limit (the pass test involves a logical AND operation).
- Gaps between segments are allowed and equivalent to switching off an intermediate limit line segment.

• Limit lines can be partially or entirely outside the sweep range, however, the limits are only checked at the measurement points.

The following figure shows a limit line consisting of 3 upper and 2 lower limit line segments. To pass the limit check, the trace must be confined to the shaded area.

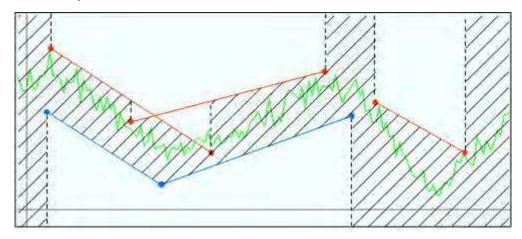

As a consequence of the limit line rules, a DUT will always pass the limit check if no limit lines are defined.


When the sweep axis is changed from linear frequency sweep to logarithmic sweeps, straight limit lines are transformed into exponential curves. The sweep points are redistributed along the x-axis, so the number of failed points may change.



While "Show Limit Line" is active, the diagrams display all limit line segments.

**Exception:** In a segmented frequency sweep with point-based x-axis, gaps between the segments are minimized. To facilitate the interpretation, the R&S ZNB displays only the limit line segments which provides the limit check criterion (the "tighter" limit line at each point). In the example below, this rule results in a single, continuous lower limit line.

**Operations on Traces** 

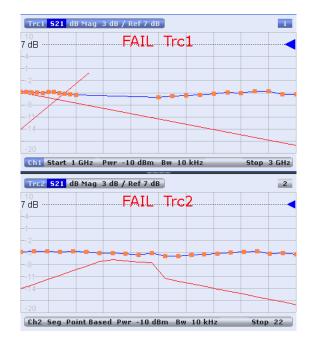


#### 3.4.1.2 Rules for Ripple Test Definition

The analyzer places very few restrictions on the definition of ripple limit ranges.

The following rules ensure a maximum of flexibility:

- Ranges do not have to be sorted in ascending or descending order (e.g. the "Start Stimulus" value of range no. n doesn't have to be smaller than the "Start Stimulus" value of range no. n+1).
- Overlapping ranges are allowed. The limit check in the overlapping area is related to the tighter limit (the pass test involves a logical AND operation).
- Gaps between ranges are allowed and equivalent to switching off an intermediate ripple limit range.
- Ripple limit ranges can be partially or entirely outside the sweep range, however, the limits are only checked at the measurement points.

The following figure shows a ripple limit test involving 3 active ranges.

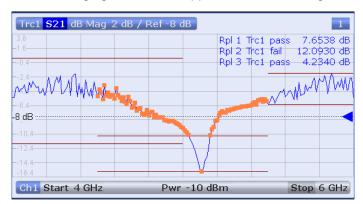

The limit line rules for logarithmic sweeps and segmented frequency sweeps with point based x-axis also apply to ripple limit lines (see chapter 3.4.1.1, "Rules for Limit Line Definition", on page 61).

## 3.4.1.3 Circle Limits

A circle limit is a special type of **upper** limit line which is defined by its center coordinate in the diagram and its radius. Depending on the diagram type, circle limit can serve different purposes:

 With a circle limit line centered around the origin of a polar diagram, you can check whether the magnitude of the measurement results exceeds a limit, defined by the radius of the limit line.



 With a circle limit line adjusted to the right border of a Smith diagram (Z = infinity), you can check whether the imaginary part of the impedance (Im(Z), reactance) falls below a limit.



 With a circle limit line centered around the left border of an inverted Smith diagram (Y = infinity), you can check whether the imaginary part of the admittance (Im(Y), susceptance) falls below a limit.



#### 3.4.1.4 File Format for Limit Lines

The analyzer uses a simple ASCII format to export limit line data. By default, the limit line file has the extension \*.limit and is stored in the directory shown in the "Export Limit Line" and "Import Limit Line" dialogs. The file starts with a preamble containing the channel and trace name and the header of the segment list. The following lines contain the entries of all editable columns of the list.

#### Example of a limit line file

The limit line:

	Туре		Start Stimulus	Stop Stimulus	Start Response	Stop Response
1	Upper :	¢	9 kHz	8.5 GHz	0 dB	0 dB
2	Lower 3	¢	9 kHz	6 GHz	-20 dB	-10 dB
3	Off :	ŧ	6 GHz	8.5 GHz	-10 dB	-10 dB

is described by the limit line file:

G	
Q	D

#### Compatibility with other instruments

Network analyzers of the R&S ZVA/ZVB family use the same file format. Limit line files can be interchanged without restriction.

#### 3.4.1.5 File Format for Ripple Limits

The analyzer uses a simple ASCII format to export ripple limit data. By default, the ripple limit file has the extension \*.ripple and is stored in the directory shown in the "Save Ripple Limits" and "Recall Ripple Limits" dialogs. The file starts with a preamble containing the channel and trace name and the header of the range list. The following lines contain the entries of all editable columns of the list.

#### Example of a ripple limit file

The ripple limit list:

Range On/Off 🔺	Start Stimulus	Stop Stimulus	Ripple Limit
1	3 GHz	5 GHz	12 dB
2	4.5 GHz	5.5 GHz	5 dB
3	5.5 GHz	6 GHz	4.3826 dB

#### is described by the ripple limit file:

# Version 1.00
#
# Channel 1
# Trace 1
bo:Range On/Off,Start Stimulus[MHZ],Stop Stimulus[MHZ],Ripple Limit[dB],
true, 3.000000000000000000000000000000000000
true,4.50000000000000E+003,5.50000000000000E+003,5.0000000000000E+000,
false, 5. 50000000000000000000000000000000000
115C, 3. 30000000000000000000000000000000000



#### Compatibility with other instruments

Network analyzers of the R&S ZVA/ZVB family use the same file format. Ripple limit files can be interchanged without restriction.

# 3.4.2 Trace Files

The R&S ZNB can store one or several data or memory traces to a file or load a memory trace from a file.

Trace files are ASCII files with selectable file format. The analyzer provides several types of trace files:

- Touchstone (\*.s<n>p) files
- ASCII ("\*.csv") files
- Matlab ("\*.dat") files are ASCII files which can be imported and processed in Matlab.

The trace file formats complement each other; see chapter 3.4.2.3, "Finding the Best File Format", on page 69.

#### 3.4.2.1 Touchstone Files

All Touchstone files contain a header, a comment section, and the actual trace data:

```
# HZ S RI R 50.0000
! Rohde & Schwarz ZNB
! Measurement: S11
! 2003-07-07
!
60297750.000000 0.498113 -0.054290
80297000.000000 0.504888 -0.081229
The header consists of the following data elements:
```

- # specifies beginning of header line (required at top of file).
- <Frequency unit>: HZ / KHZ / MHZ / GHZ allowed for imported files. The analyzer always uses HZ for exported data.
- <Data file type>: at present only S for S-parameter files is supported.
- <Data format>: RI for Re/Im, MA for lin. Mag-Phase, DB for dB Mag-Phase. The data format for export files can be selected in the Export Data dialog.
- <Normalizing impedance>: Impedance system in which the data was defined. The analyzer uses 50.0000 Ω.

Comment lines start with the exclamation mark (!) and may contain any text used for documentation of the trace data file. Any number of comment lines may be inserted before or after the header line.

The trace data section corresponds to a set of single-ended S-parameters. It depends on the number of ports <n> and the data format.

For real and imaginary values (data format = Real-Imag) the trace data for each stimulus frequency is arranged as follows:

1-port files (\*.s1p)

Freq  $Re(S_{11})$   $Im(S_{11})$ 

 $S_{11}$  can be replaced by an any S-parameter, so the  $\star$ .  $\mathtt{slp}$  format is suitable for exporting an arbitrary data trace representing an S-parameter.

• **2-port files** (\*.s2p)

• 3-port files (\*.s3p)

 $\begin{array}{lll} \mbox{Freq} & \mbox{Re}(S_{11}) & \mbox{Im}(S_{11}) & \mbox{Re}(S_{12}) & \mbox{Im}(S_{12}) & \mbox{Re}(S_{13}) & \mbox{Im}(S_{13}) \\ \mbox{Re}(S_{21}) & \mbox{Im}(S_{21}) & \mbox{Re}(S_{22}) & \mbox{Im}(S_{22}) & \mbox{Re}(S_{23}) & \mbox{Im}(S_{23}) \\ \mbox{Re}(S_{31}) & \mbox{Im}(S_{31}) & \mbox{Re}(S_{32}) & \mbox{Im}(S_{32}) & \mbox{Re}(S_{33}) & \mbox{Im}(S_{33}) \\ \mbox{(values arranged in 3 lines)} \end{array}$ 

• 4-port files (\*.s4p)

The stimulus frequencies are arranged in ascending order. If a "lin. Mag-Phase (MA)" or "dB Mag-Phase (DB)" data format is selected the real and imaginary S-parameter values  $Re(S_{ij})$ ,  $Im(S_{ij})$  are replaced by lin  $Mag(S_{ij})$ , phase(S<sub>ij</sub>) or dB  $Mag(S_{ij})$ , phase(S<sub>ij</sub>), respectively.

According to Touchstone file specifications, no more than four pairs of network data are allowed per data line. The entries in the data lines are separated by white space, and a data line is terminated by a new line character. All data sets are arranged in increasing order of frequency.



When exporting traces to a Touchstone file, it is recommended to set the analyzer to single sweep mode (Channel – Sweep – Single (All Chans)). This will ensure that a complete sweep is exported.

#### **Conditions for Touchstone file export**

For a one-port Touchstone file, the reflection coefficient for the specified port (e.g. S<sub>11</sub> for port no. 1) must be measured. If a full one-port ("Refl OSM") calibration is available, it is also possible to export transmission parameters that are related to the calibrated port. If a full n-port (TOSM, TNA, TRL ...) calibration is available for a group of n ports, or if a complete set of <n><sup>2</sup> S-parameters is available, all S-parameters may be exported.

**Example 1:** Refl OSM calibration at port 1; the active channel contains the traces  $S_{11}$ ,  $S_{21}$ , and  $S_{12}$ ; Touchstone export via "s1p Port 2...". Export of  $S_{12}$  or  $S_{21}$  is allowed.

For a multiport Touchstone file \*.s<n>p, either a full multiport system error correction or a complete set of <n><sup>2</sup> S-parameters must be available. Export of system error corrected, incomplete S-parameter sets is possible, too. If the port configuration contains balanced ports, the Touchstone file will contain the converted single-ended S-parameters.

Touchstone files cannot be used to export mathematical traces.

### 3.4.2.2 ASCII (\*.csv) Files

An ASCII file contains a header and the actual trace data:

freq;reTrc1\_S21;imTrc1\_S21;reMem2[Trc1]\_S21;imMem2[Trc1]\_S21;

40499497.487437;0.000000;0.000000;0.000000;0.000000;

80698994.974874;0.494927;-0.065174;0.500833;-0.074866;

120898492.462312;0.497959;-0.111724;0.488029;-0.107375;

...

The header consists of the following data elements:

- <Stimulus> stimulus variable: freq for Frequency sweep, power for Power sweep, time for Time sweep, trigger for CW Mode sweep.
- <reTrace1> first response value of first trace: re<Trace\_Name>, mag<Trace\_Name> or db<Trace\_Name> for output format Re/Im, lin. Mag-Phase or dB Mag-Phase, respectively. The data format for export files can be selected in the Export Data dialog.
- <imTrace1> second response value of first trace: im<Trace\_Name> for output format Re/Im, ang<Trace\_Name> for output formats lin. Mag-Phase or dB Mag-Phase. The data format for export files can be selected in the Export Data dialog.
- <reTrace2> first response value of second trace: re<Trace\_Name>, mag<Trace\_Name> or db<Trace\_Name> for output format Re/Im, lin. Mag-Phase or dB Mag-Phase, respectively. The data format for export files can be selected in the Export Data dialog.
- <imTrace2>... second response value of second trace: im<Trace\_Name> for output format Re/Im, ang<Trace\_Name> for output formats lin. Mag-Phase or dB Mag-Phase. The data format for export files can be selected in the Export Data dialog. first response value of second trace. HZ / KHZ / MHZ / GHZ allowed for imported files. The analyzer always uses HZ for exported data. second response value of first trace: im<Trace\_Name> for output format Re/Im, ang<Trace\_Name> for output formats lin. Mag-Phase or dB Mag-Phase. The data format for exported data. second response value of first trace: im<Trace\_Name> for output format Re/Im, ang<Trace\_Name> for output formats lin. Mag-Phase or dB Mag-Phase. The data format for export files can be selected in the Export Data dialog.

The trace data is arranged as described in the header. Different values are separated by semicolons, commas or other characters, depending on the selected "Decimal Separator" in the "Export ... Data" dialogs. A semicolon is inserted before the end of each line.

The stimulus values are arranged in ascending order.

### 3.4.2.3 Finding the Best File Format

The file format depends on how you want to use the exported data.

Use a **Touchstone** file format to export single-ended S-parameter data traces to a file that can be evaluated with applications such as Agilent's Microwave Design System (MDS) and Advanced Design System (ADS), and to convert mixed mode parameters back to single-ended parameters. The data must be acquired in a frequency sweep. Note the conditions for Touchstone file export in section "Select Ports".

Use the ASCII (\*.csv) format if you want to do one of the following:

- Import the created file into a spreadsheet application such as Microsoft Excel.
- Export an arbitrary number of traces, multiple traces with the same parameter or memory traces.
- Export traces acquired in a power sweep or CW sweep.
- Use export options.

Use a the **Matlab** (\*.dat) format if you want to import and process the trace data in Matlab.

# 3.5 Calibration

Calibration or "system error correction" is the process of eliminating systematic, reproducible errors from the measurement results (S-parameters and derived quantities; see chapter 3.1.5, "Data Flow", on page 18). The process involves the following stages:

- A set of calibration standards is selected and measured over the required sweep range. For many calibration types the magnitude and phase response of each calibration standard (i.e. its S-parameters if no system errors occur) must be known within the entire sweep range. In some calibration procedures (TRL, TNA, TRM), part of the characteristics of the standards can be auto-determined due to implicit redundancy (self-calibration).
- 2. The analyzer compares the measurement data of the standards with their known, ideal response. The difference is used to calculate the system errors using a particular error model (calibration type) and derive a set of system error correction data.
- The system error correction data is used to correct the measurement results of a DUT that is measured instead of the standards.

Calibration is always channel-specific because it depends on the hardware settings, in particular on the sweep range. The means that a system error correction data set is stored with the calibrated channel.

The analyzer provides a wide range of sophisticated calibration methods for all types of measurements. Which calibration method is selected depends on the expected system errors, the accuracy requirements of the measurement, on the test setup and on the types of calibration standards available.

Due to the analyzer's calibration wizard, calibration is a straightforward, menu-guided process. Moreover, it is possible to perform the entire calibration process automatically using a Calibration Unit (accessories R&S ZV-Z5x).



The system error correction data determined in a calibration procedure are stored on the analyzer. You can read these correction data using the remote control command [SENSe<Ch>:]CORRection:CDATa. You can also replace the correction data of the analyzer by your own correction data sets.



# Cal Off label

A label "Cal Off" appears in the trace line if the system error correction no longer applies to the trace:

Trc1S22dB Mag10 dB / Ref 0 dBCal OffTrc3S21dB Mag10 dB / Ref 0 dBCal Off

This may happen for one of the following reasons:

- The sweep range is outside the calibrated frequency range.
- The measurement result is a wave quantity or ratio which is never system error corrected (see chapter 3.1.5, "Data Flow", on page 18).
- The channel calibration is not sufficient for the measured quantity (e.g. a one-port calibration has been performed, but the measured quantity is a transmission parameter).
- The system error correction has been switched off deliberately ("User Cal Active" is disabled).

The analyzer provides other labels to indicate the status of the current calibration; see chapter 3.5.4, "Calibration Labels", on page 84.

# 3.5.1 Calibration Types

The analyzer provides a wide range of calibration types for one, two or more ports. The calibration types differ in the number and types of standards used, the error terms, i.e. the type of systematic errors corrected and the general accuracy. The following table gives an overview.

Table 3-3: Overview of calibr	ation types
-------------------------------	-------------

Calibration Type	Standards	Parameters	Error Terms	General Accuracy	Application
Reflection Normali- zation	Open or Short	S <sub>11</sub> (or S <sub>22</sub> ,)	Reflection tracking	Low to medium	Reflection measure- ments on any port.
Transmission Nor- malization	Through	S <sub>12</sub> , S <sub>21</sub> (or S <sub>13</sub> ,)	Transmission track- ing	Medium	Transmission meas- urements in any direction and between any combi- nation of ports.

Calibration Type	Standards	Parameters	Error Terms	General Accuracy	Application
Reflection OSM	Open, Short, Match <sup>1)</sup>	S <sub>11</sub> (or S <sub>22</sub> ,)	Reflection tracking, Source match Directivity,	High	Reflection measure- ments on any port.
One Path Two Ports	Open, Short, Match <sup>1)</sup> (at source port), Through <sup>2)</sup>	S <sub>11</sub> , S <sub>21</sub> (or S <sub>22</sub> ,)	Reflection tracking, Source match, Directivity, Transmission track- ing	Medium to high	Unidirectional trans- mission measure- ments in any direc- tion and between any combination of ports.
TOSM or UOSM (2-port, 3-port or 4- port)	Open, Short, Match <sup>1)</sup> (at each port), Through <sup>2)</sup> (between all combinations of 2 ports)	All	Reflection tracking, Source match, Directivity, Load match, Transmission track- ing,	High	Reflection and transmission meas- urements; classical 12-term error cor- rection model.
TOM (2-port, 3-port or 4- port)	Open, Match (at both ports), Through	All	Reflection tracking, Source match, Directivity, Load match, Transmission track- ing	High	Reflection and transmission meas- urements.
TSM (2-port, 3-port or 4- port)	Short, Match (at both ports), Through	All	Reflection tracking, Source match, Directivity, Load match, Transmission track- ing	High	Reflection and transmission meas- urements.
TRM (2-port, 3-port or 4- port)	Reflect (equal at both ports), Match, Through	All	Reflection tracking, Source match, Directivity, Load match, Transmission track- ing	High	Reflection and transmission meas- urements, espe- cially in test fixtures.
TRL (2-port, 3-port or 4- port)	Reflect (at both ports), Through, Line1, Line2/3 (optional), combination with TRM (optional)	All	Reflection tracking, Source match, Directivity, Load match, Transmission track- ing	High, high directivity	Reflection and transmission meas- urements, espe- cially for planar cir- cuits. Limited band- width.
TNA (2-port, 3-port or 4- port)	Through, Attenua- tion, Symmetric net- work	All	Reflection tracking, Source match, Directivity, Load match, Transmission track- ing	High, lowest requirements on standards	Reflection and transmission meas- urements, espe- cially for planar cir- cuits.

1) Or any other 3 known one-port standards. To be used in a guided calibration, the known standards must be declared to be Open, Short, and Match irrespective of their properties.

2) Or any other known two-port standard. See remark above.



The calibration type must be selected in accordance with the test setup. Select the calibration type for which you can obtain or design the most accurate standards and for which you can measure the required parameters with best accuracy.

## 3.5.1.1 Normalization (Refl Norm..., Trans Norm...)

A normalization is the simplest calibration type since it requires the measurement of only one standard for each calibrated S-parameter:

- One-port (reflection) S-parameters (S<sub>11</sub>, S<sub>22</sub>, ...) are calibrated with an Open or a Short standard providing the reflection tracking error term.
- Two-port (transmission) S-parameters (S<sub>12</sub>, S<sub>21</sub>, ...) are calibrated with a Through standard providing the transmission tracking error term.

Normalization means that the measured S-parameter at each sweep point is divided by the corresponding S-parameter of the standard. A normalization eliminates the frequency-dependent attenuation and phase shift in the measurement path (reflection or transmission tracking error). It does not compensate for directivity or mismatch errors. This limits the accuracy of a normalization.

#### 3.5.1.2 Reflection OSM Calibration

A reflection OSM (full one-port) calibration requires a Short, an Open and a Match standard to be connected to a single test port. The three standard measurements are used to derive all three reflection error terms:

- The Short and Open standards are used to derive the source match and the reflection tracking error terms.
- The Match standard is used to derive the directivity error.

A reflection OSM calibration is more accurate than a normalization but is only applicable for reflection measurements.

#### 3.5.1.3 One Path Two Ports Calibration

A one path two ports calibration combines a reflection OSM (full one-port) calibration with a transmission normalization. The fully calibrated port is termed the node port. This calibration type requires a Short, an Open and a Match standard to be connected to a single test port plus a Through standard between this calibrated source port and a second load port. The four standard measurements are used to derive the following error terms:

- The Short and Open standards are used to derive the source match and the reflection tracking error terms at the source port.
- The Match standard is used to derive the directivity error at the source port.
- The through standard provides the transmission tracking error term.

A one-path two-port calibration requires only four standards to be connected (instead of 7 for a full two-port TOSM calibration). It is suitable when only the forward (e.g.  $S_{11}$  and  $S_{21}$ ) or reverse S-parameters (e.g.  $S_{22}$  and  $S_{12}$ ) are needed, and if the DUT is well matched, especially at the load port. It is also the best calibration method for test setups with unidirectional signal flow, e.g. a pulsed measurement using an external generator.

## 3.5.1.4 TOSM and UOSM Calibration

A TOSM (Through – Open – Short – Match) calibration requires the same standards as the one path two ports calibration, however, all measurements are performed in the forward and reverse direction. TOSM is also referred to as SOLT (Short – Open – Load = Match – Through) calibration. The four standards are used to derive 6 error terms for each signal direction:

- In addition to the source match and reflection tracking error terms provided by the one-path two-port calibration, TOSM also provides the load match.
- The directivity error is determined at both source ports.
- The transmission tracking is determined for each direction.

TOSM calibration is provided for 2-port, 3-port or 4-port measurements. The number of required standard measurements and of error terms increases as shown in the following table.

Number of ports	Number of standards to be connected	Number of standard measurements	Number of error terms <sup>*)</sup>
2	2 * 3	2 * 3	2 * 3
	+1 = 7	+2 * 1 = 8	+ 2 * 2 = 10
3	3 * 3	3 * 3	3 * 3
	+ 2 + 1 = 12	+2 * (2 + 1) = 15	+ 2 * 2 * 3 = 21
4	4 * 3	4 * 3	4 * 3
	+3 + 2 + 1 = 18	+2 * (3 + 2 + 1) = 24	+ 2 * 2 * 6 = 36

\*) No isolation terms are available.

An Open, Through and Match measurement is required at each port; in addition, a Through must be measured between any combination of ports and in both directions. Therefore the number N of standard measurements for an n-port TOSM calibration is equal to

$$N = 3 \cdot n + 2 \cdot \binom{n}{2} = 3 \cdot n + 2 \cdot \frac{n!}{2! \cdot (n-2)!} = n \cdot (n+2).$$

The analyzer automatically performs each through measurement in both directions, so the number of connected standards is smaller than the number of measurements.

#### **TOSM** with unknown Through, UOSM

The network analyzer supports different connector types at its test ports in order to measure DUTs with different port connectors. To perform a TOSM calibration, the DUT must

be replaced by a Through connection, which generally involves an adapter between the two connector types.

An adapter represents a Through standard with unknown characteristics (in particular, with unknown delay time/transmission phase). The analyzer can perform a TOSM calibration with an unknown Through, provided that it is reciprocal ( $S_{21} = S_{12}$ ). The modified TOSM calibration is referred to as UOSM (Unknown through – Open – Short – Match) calibration. It can be selected as follows:

- If different connector types are assigned to the test ports, the analyzer automatically replaces TOSM -> UOSM.
- If the same connector types are used but the appropriate through standard is not defined, the analyzer also replaces TOSM -> UOSM.
- UOSM can be selected explicitly in the "Calibration Presetting" dialog.

After acquiring the calibration sweep data for the unknown Through, the analyzer automatically determines its delay time/transmission phase.

#### 3.5.1.5 TOM Calibration

A TOM (Through – Open – Match) calibration requires a low-reflection, low-loss Through standard with an electrical length that may be different from zero, an Open, and a Match. The characteristics of all standards must be fully known; the Match may have non-ideal characteristics.

#### 3.5.1.6 TSM Calibration

A TSM (Through – Short – Match) calibration requires a low-reflection, low-loss Through standard with an electrical length that may be different from zero, a Short, and a Match. The characteristics of all standards must be fully known; the Match may have non-ideal characteristics.

TSM calibration can replace TOM calibration if no appropriate "Open" standard is available, especially in the high frequency domain.

#### 3.5.1.7 TRM Calibration

A TRM (Through – Reflect – Match) calibration requires a low-reflection, low-loss Through standard with an electrical length that may be different from zero, a Reflect, and a Match. The magnitude of the reflection coefficient of the Reflect standard can be unknown but must be nonzero; its phase must be roughly known (90 deg). The magnitude and phase of the reflection coefficient must be the same at both test ports.

TRM calibration is especially useful for DUTs in test fixtures.

#### 3.5.1.8 TRL Calibration

A TRL (Through – Reflect – Line) calibration requires the two-port standards Through and Line, which are both assumed to be ideally matched. Beyond that, the Through must

be lossless, and its length must be exactly known. The length of the Line standard must be known approximately.

Furthermore, a reflecting one-port standard (Reflect) is needed. The magnitude of the reflection coefficient of the Reflect standard can be unknown but must be nonzero; its phase must be roughly known (90 deg). The magnitude and phase of the reflection coefficient must be the same at both test ports.

TRL calibration is especially useful for DUTs in planar line technology (e.g. test fixtures, on-wafer measurements) where it is difficult to design and connect accurately modeled Open, Short or Match standards. If TRL is not practicable, TNA may be an alternative.

#### TRL with several lines and with TRM

The system of equations solved to derive the error terms is such that singularities occur whenever the length difference  $\Delta L$  between the Through and the Line is an integer multiple of half of the wave length:

$$\Delta L \neq n \ \frac{\lambda}{2}$$

As a rule, singularities are avoided with sufficient accuracy if the phase shift resulting from the (electric) length difference between the Through and the Line standard is between 20° and 160°. This corresponds to a ratio of 1:8 for the start and stop frequency of the calibrated sweep range.



To shift the calibrated sweep range to smaller or larger frequencies, you can use a longer or shorter Line. To extend the calibrated range, use one of the following methods:

- Perform TRL calibration with two or three different Line standards. With an appropriate length of the Lines, the ratio for the start and stop frequency of the calibrated sweep range can increase to approx. 1:64 (for 2 lines) or 1:512 (for 3 lines).
- In the low-frequency domain where TRL becomes inaccurate, replace TRL by TRM calibration.

The methods can be combined or used separately. The list of measured standards in the "Calibration" dialog for TRL calibration is extended if the calibration kit in use contains the necessary standards:

- A 2-line (3-line) calibration requires two (three) different Lines of matching gender. The lines must be measured between any combination of two ports.
- A TRM extension at low frequencies requires either a Match or a Sliding Match standard. The standard must be measured at each port.

The complete list of measured standards for a two-port calibration is shown below.

- For a TRL calibration with 1 Line, the Reflect standard at both ports, the Through, and one Line standard must be measured.
- For a TRL calibration with 2 Lines, a second Line standard must be measured in addition.

• For a TRM calibration, The Reflect and Match standards at both ports and the Through must be measured. See also chapter 3.5.2.3, "Sliding Match Standards", on page 82.

The TRL calibration is valid as soon as the standards for a "TRL calibration with 1 line" have been measured. The TRL extensions are applied automatically if the necessary standards have been measured.

<u>P1</u>	0	<u>P2</u>	0	<u>P1</u>	©≓0 <u>P</u> 2
	) Ω (f) ) Ω Ideal Kit		Ω (f) Ω Ideal Kit		Ω (f) Ω Ideal Kit
M	Match (m)	M	Match (m)	Ţ	Through (mm)
R	Reflect (m)	R	Reflect (m)	¢	Line 1 (mm)
ł	Sliding M Pos 1	ł	Sliding M Pos 1	C	Line 2 (mm)
+	Sliding M Pos 2	ŧ	Sliding M Pos 2	Ű	Line 3 (mm)
+	Sliding M Pos 3	÷	Sliding M Pos 3		

#### Example: TRL calibration with two and three Lines

If several Lines with different lengths are measured, the analyzer automatically divides the calibrated range into segments. The calibration data of the longest line is applied to the lowest segment, the calibration data of the shortest line to the highest segment.

The calibration sweep segments for two Lines with electric lengths  $I_{long}$  and  $I_{short}$  ( $I_{long} > I_{short}$ ) are obtained as follows (the Through standard is assumed to be of length  $I_{thr}$ ):

- The longer Line can be used up to a frequency f<sub>long</sub> where its transmission phase is equal to 160 deg. This frequency is equal to "f<sub>long</sub> = 4\*c<sub>0</sub>/[9\*(I<sub>long</sub>-I<sub>thr</sub>)]".
- The shorter Line can be used from a frequency f<sub>short</sub> where its transmission phase is equal to 20 deg. This frequency is equal to "f<sub>short</sub> = c<sub>0</sub>/[18\*(I<sub>short</sub> I<sub>thr</sub>)]".
- The border between the two frequency segments f<sub>div</sub> is calculated as the geometric mean of f<sub>long</sub> and f<sub>short</sub>, i.e. "f<sub>div</sub> = sqrt(f<sub>long</sub> \* f<sub>short</sub>)".

The formulas are also applied if "flong < fshort".

For a TRL calibration using three Lines with different length, the allowed frequency ranges are calculated in an analogous manner in order to obtain three (ideally overlapping) frequency ranges. The borders between two adjacent frequency ranges are calculated as the geometric mean of the frequency limits  $f_{long}$  and  $f_{short}$  of the two ranges.

A second or third line in the list does not mean that you have to measure two or three line standards. If the calibrated frequency range is small enough, the calibration is valid as soon as the analyzer has acquired correction data for a single line line standard. The Match and Sliding Match standards are not necessary for TRL calibration, however, they must be measured if TRL is combined with TRM calibration.

#### Low-frequency extension with TRM

TRL calibration becomes inaccurate if the electrical length difference between Line and Through standard corresponds to a phase shift below 20°. In practice this means that

TRL is only practicable above a threshold frequency  $f_{TRM}$  which depends on the lengths of the longest line and through standards. The threshold frequency is given by:

 $f_{TRM} = c_0 / [18^* (I_{long} - I_{thr})]^{"}$ 

where  $I_{long}$  denotes the electrical length of the longest of the used Line standards,  $I_{thr}$  the length of the Through. The analyzer assumes  $I_{thr} << I_{long}$  and calculates  $f_{TRM} = c_0/(18*I_{long})$ . At frequencies below  $f_{TRM}$ , TRL calibration is automatically replaced by TRM, provided that the necessary calibration data has been acquired. For a line with  $I_{long} = 16.666$  cm, the threshold frequency is  $f_{TRM} = 100$  MHz.

#### Accuracy conditions for the Line(s)

The length error of the Line, converted into a transmission phase error, must be below the minimum difference to the singularity points 0 deg or 180 deg multiplied by two. Suppose that an approximately known Line standard causes a transmission phase 30 deg at the start frequency and of 160 deg at the stop frequency of the sweep. Its length error must cause a phase difference below (180 deg – 160 deg)\*2 = 40 deg.

### 3.5.1.9 TNA Calibration


A TNA (Through – Network – Attenuation) calibration requires two-port standards only. Again, the Through standard must be ideally matched and lossless. The Symmetric Network must have the same properties as the Reflect standard used for a TRL calibration, i.e. the magnitude of its reflection coefficient can be unknown but must be nonzero; its phase must be roughly known (±90 deg). The magnitude and phase of the reflection coefficient must be the same at both test ports. The Attenuation standard must be well matched on both sides and cause an attenuation different from 0 dB; the exact value of the transmission coefficient is not important.

As with TRL, TNA calibration is especially useful for planar DUTs. If TNA is not practicable, TRL may be an alternative.

#### 3.5.1.10 Full n-Port Calibration with Reduced Number of Through Connections

The analyzer can calculate the error terms for an full n-port calibration (TOSM, UOSM, TOM, TSM, TRM, TRL, TNA) after n-1 Through measurements, provided that the Throughs connect all ports to be calibrated. The correction values for the unmeasured Throughs can then be calculated from the measured ones.

To establish a sufficient set of Through connections, you can select an arbitrary analyzer port as the "center" and measure all Through connections to this port ("star-shaped calibration"). You can also connect all ports in increasing order, e.g.  $1 \rightarrow 2$ ,  $2 \rightarrow 3$ ,  $3 \rightarrow 4$ ...

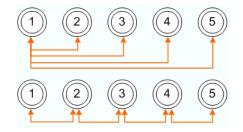

[For the mathematically inclined: the graph constructed from the calibration ports as nodes and the measured Throughs as edges must be connected.]

Compared to the full number of n(n-1)/2 Through measurements this is a significant reduction in time and effort, in particular if n is large.

The "Reduced Through" logic is implemented for all full n-port calibration types.

- During manual calibration, you can apply the calibration as soon as a sufficient set of Through connections have been measured. However, you can measure additional Through connections in order to improve the accuracy.
- An Automatic Calibration always proposes a minimum number of Through connections, which is particularly helpful if Multiple Port Assignments are used.

# 3.5.2 Calibration Standards and Calibration Kits

A calibration kit is a set of physical calibration standards for a particular connector type. The magnitude and phase response of the calibration standards (i.e. their S-parameters) must be known or predictable within a given frequency range.

The standards are grouped into several types (Open, Through, Match,...) corresponding to the different input quantities for the analyzer's error models. The standard type also determines the equivalent circuit model used to describe its properties. The circuit model depends on several parameters that are stored in the cal kit file associated with the calibration kit.

As an alternative to using circuit models, it is possible to describe the standards by means of S-parameter tables stored in a file.

The analyzer provides a large number of predefined cal kits but can also import cal kit files and create new kits:

- A selection of predefined kits is available for all connector types. The parameters of these kits are displayed in the "Add/Modify Standards" dialog, however, it is not possible to change or delete the kits.
- Imported and user-defined kits can be changed in the "Calibration Kits" dialog and its various sub-dialogs.

Calibration kits and connector types are global resources; the parameters are stored independently and are available irrespective of the current recall set.

## 3.5.2.1 Calibration Standard Types

The following table gives an overview of the different standards and their circuit models (offset and load models).

Table 3-4: Calibration standard types

Standard Type	Characteristics	Ideal Standard	Offset Model	Load Model
Open	Open circuit (one-port)	∞ Ω		
Short	Short circuit (one-port)	0 Ω		
Offset short	Short circuit with added electrical length offset, for waveguide calibration (one-port)	0 Ω	Z	Z
Match	Matched broadband termination (one-port)	Z <sub>0</sub> (characteristic impedance of the connector type)		
Sliding match	One-port standard consisting of an air line with a movable, low-reflection load element (sliding load)	-	-	-
Reflect	Unknown mismatched standard (one-port)	$\Omega \propto \Omega$		
Through	Through-connection with minimum loss (two-port)	-		_
Line1, Line 2	Line(s) for TRL calibration with minimum loss (two- port)	-	Z	-
Attenuation	Fully matched standard in both directions (two-port; the reflection factor at both ports is zero)	-	-	-
Symm. network	Unknown mismatched reflection-symmetric stand- ard (two-port)	-	Z	Z

#### **Offset parameters**

The offset parameters have the following physical meaning:

 The "Delay" is the propagation time of a wave traveling through the standard. The "Electrical Length" is equal to the "Delay" times the speed of light in the vacuum and is a measure for the length of transmission line between the standard and the actual calibration plane. For a waveguide with permittivity ε<sub>r</sub> and mechanical length L<sub>mech</sub> the following relations hold:

Delay = 
$$\frac{L_{mech} \cdot \sqrt{\varepsilon_r}}{c}$$
; Electrical Length =  $L_{mech} \cdot \sqrt{\varepsilon_r}$ 

The default delay is 0 s, the default step width is 1 ns, corresponding to a step width of 299.792 mm for the electrical length. The relations hold for one-port and 2-port standards.

• Z<sub>0</sub> is the "Characteristic Impedance" of the standard. If the standard is terminated with Z<sub>0</sub>, then its input impedance is also equal to Z<sub>0</sub>. Z<sub>0</sub> is not necessarily equal to the reference impedance of the system (depending on the "Connector Type") or the terminal impedance of the standard. The characteristic impedance of the standard is only used in the context of calibration.

The default characteristic impedance is equal to the reference impedance of the system.

The "Loss" is the energy loss along the transmission line due to the skin effect. For
resistive lines and at RF frequencies the loss is approximately proportional to the
square root of the frequency.

In Agilent mode the "Offset Loss" is expressed in units of  $\Omega$ /s at a frequency of 1 GHz. The following formula holds for two-port standards:

Offset Loss / 
$$[\Omega / s] = \frac{Loss / [dB] \cdot Z_0 / [\Omega]}{4.3429 / [dB] \cdot delay / [s]}$$

The conversion formula for one-port standards has an additional factor  $\frac{1}{2}$  on the righthand side. The reason for this factor is that the Loss in dB accounts for the attenuation along the forward **and** the reverse path (no matter how often the wave actually propagates through the line), whereas the "Offset Loss" is proportional to the attenuation of the line.

To determine an offset loss value experimentally, measure the delay in seconds and the loss in dB at 1 GHz and use the formula above.

The default "Loss" or "Offset Loss" is zero.



The impedance for waveguides is frequency-dependent. If a waveguide line type is selected in the "Cal Connector Types" dialog, the "Char. Imp." field is disabled and indicates "varies" instead of a definite impedance value. Moreover no "Loss" or "Offset Loss" can be set.

#### Offset parameters and standard types

Offset parameters are used to describe all types of standards except the Sliding Match and the Attenuation.

- The Sliding Match is a one-port standard with variable load parameters (sliding load) and unspecified length. The reference impedance is fixed and equal to the characteristic impedance of the connector type. No load and offset parameters need to be set.
- The Attenuation is a two-port standard which is fully matched in both directions (the reflection factor at both ports is zero). No load and offset parameters need to be set.

#### Load parameters and standard types

Load parameters are used to describe all types of standards except a Through, a Sliding Match, a Line, and an Attenuation.

- The Through standard is a through-connection between two ports with minimum loss which is taken into account by the offset parameters.
- The Sliding Match is a one-port standard with variable load parameters (sliding load), so there is no fixed load model.
- The Line standard is a line of variable length with minimum loss which is taken into account by the offset parameters.
- The Attenuation is a two-port standard which is fully matched in both directions (the reflection factor at both ports is zero). No load and offset parameters need to be set.

#### 

V-Z21 typical

3.5.2.2 Cal Kit Parameter Types

The analyzer uses three types of parameters to describe the calibration standards. The parameter type is the same for all standards in a kit and therefore annexed to the kit name:

- **Universal** parameters (no label) describe calibration kit models with highly standardized components so that the parameters are valid for all calibration kits of the model.
- Typical parameters (labeled "typical") approximately describe a calibration kit model. To correct for deviations between the standards, each kit of the model is individually measured and delivered with an additional, kit-specific parameter set. Therefore each typical parameter set "<kit\_name> typical" is complemented by an additional parameter set "<kit\_name>" containing optimized parameters for an individual kit.
- **Ideal** parameters (labeled "Ideal Kit") describe an idealized calibration kit for each connector type; see below.



Make sure to use universal or individual parameter sets if you need to obtain high-precision results. The precision of the calibration kit parameters determine the accuracy of the system error correction and of the measurements. The R&S ZNB displays a warning if you use a typical or ideal parameter set to calibrate a channel.

Calibration kits can be obtained as network analyzer accessories; refer to the data sheet for the relevant ordering information. The name of all parameter sets is equal to the name of the corresponding calibration kit model.

## Ideal parameters

All ideal kits contain the standards listed below.

Table 3-5: Ideal standard parameters

Standard (Gender)	R (Load)	Electrical Length (Offset)
Open (f, m)	$\Omega \propto$	0 mm (Delay: 0 s)
Short (f, m)	0 Ω	0 mm
Offset Short (f, m)	0 Ω	10 mm
Match (f, m)	$Z_0$ (characteristic impedance of the connector type)	0 mm
Sliding Match (f, m)	-	0 mm
Reflect (f, m)	$\Omega \propto$	0 mm
Through (ff, mm, mf)	-	0 mm
Line (ff, mm, mf)	-	10 mm
Attenuation (ff, mm , mf)	-	0 mm
Symm. Network (ff, mm, mf)	-	0 mm

The following additional parameters are used:

• Characteristic impedance: Z<sub>0</sub> (characteristic impedance of the connector type)

- Loss: 0 dB / sqrt(GHz) or (0 GΩ / s) in Agilent mode
- All inductance and capacitance parameters are set to zero.

### 3.5.2.3 Sliding Match Standards

The Sliding Match is a one-port standard consisting of an air line with a movable, lowreflection load element (sliding load). This standard is used because a no perfect Match is available over a wide frequency range. However, a series of measurements at a given frequency with equal mismatch and varying phase yields reflection factors that are located on a circle in the Smith chart. The center of this circle corresponds to perfect match. The network analyzer determines and further corrects this match point following I. Kása's circle-fitting algorithm.

To obtain the reflection coefficient for a perfectly matched calibration standard, the Sliding Match must be measured at least at 3 positions which should be unequally spaced to avoid overlapping data points. Increasing the number of positions to 4 - 6 can improve the accuracy. Moreover it is recommended to use the predefined load positions of the standard.

A calibration is valid (and can be applied to the calibrated channel) if either the Match or three positions of the Sliding Match have been measured. However, it is often desirable to acquire calibration data from both standards.

The analyzer combines the data in an appropriate manner:

- The Match results are used up to the lower edge of the specified frequency range of the Sliding Match (Min Freq).
- The Sliding Match results are used for frequencies above the Min Freq. In general, the Sliding Match will provide better results than the Match within its specified frequency range.

## 3.5.2.4 Cal Kit Files

Calibration kit files can be used to store the parameters of a particular calibration kit, to re-load the data and to exchange calibration kits from one network analyzer to another.

#### Cal kit file contents

Cal kit files are independent of the current recall set and contain the following information:

- Name and label of the calibration kit
- Connector type including all connector type parameters (name, polarity, offset model, reference impedance)
- Type, gender and label of all standards in the kit together with the circuit model parameters (offsets, load) or S-parameter tables (.s<n>p file) that are necessary to determine its magnitude and phase response.

By default cal kit files are stored in the

C:\Users\Public\Documents\Rohde-Schwarz\Vna\Calibration directory.

• To **export** cal kit data, the analyzer uses a specific binary file format \*.calkit.

Three different import file formats are supported: R&S ZVA-specific binary cal kit files (\*.calkit), R&S ZVR-specific binary cal kit files (\*.ck), cal kit files in Agilent-specific ASCII formats (\*.csv, \*.prn.



#### Importing older R&S ZVR cal kit files

On loading some older R&S ZVR-specific \*.ck files, e.g. the R&S ZV-Z23 cal kit file, the R&S ZNB generates the message "File does not comply with instrument calibration kit file format". The files must be converted using an R&S ZVR network analyzer equipped with a firmware version V3.52 or higher.

Proceed as follows:

- On the R&S ZVR, press "CAL > CAL KITS > MODIFY KITS > INSTALL NEW KIT" to import the \*.ck file.
- Press "CREATE INST FILE" in the same submenu to export the \*.ck file in a R&S ZNB-compatible format.
- Import the converted file into the R&S ZNB.

#### \*.csv cal kit files: VNA Cal Kit Manager 2.1

The "VNA Cal Kit Manager" is a free, Windows<sup>®</sup>-based software tool intended to import, edit, and export \*csv cal kit files. The software is available for download at http://www.vnahelp.com/products.html. The decimal separator used by the "VNA Cal Kit Manager V2.1" depends on the language version of the Windows<sup>®</sup> operating system: Cal kit files generated on an English operating system contain dots, the ones generated on a German system contain commas.

The network analyzer expects the dot as a separator and displays an error message when a \*.csv file with commas is loaded. Please install the

VNA Cal Kit Manager V2.1 on an appropriate (e.g. English) Windows<sup>®</sup> version to avoid trouble.

#### \*.prn cal kit files: PNA Cal Kit Editor

The network analyzer can import and process cal kit files created with the "PNA Cal Kit Editor". The files use the extension \*.prn; the data format is identical to the \*.csv format.

The decimal separator used by the "PNA Cal Kit Editor" depends on the language version of the Windows<sup>®</sup> operating system: Cal kit files generated on an English operating system contain dots, the ones generated on a German system contain commas.

The network analyzer expects the dot as a separator and displays an error message when a \*.prn file with commas is loaded. Please install the "PNA Cal Kit Editor" on an appropriate (e.g. English) Windows<sup>®</sup> version to avoid trouble.

# 3.5.3 Calibration Pool

The calibration pool is a collection of correction data sets (cal groups) that the analyzer stores in a common directory

C:\Users\Public\Documents\Rohde-Schwarz\Vna\Calibration\Data. Cal groups in the pool can be applied to different channels and recall sets. Each cal group is stored in a separate file named <CalGroup\_name>.cal. The cal group name can be changed in the "Calibration Manager" dialog.

Since V1.70 one of the available cal groups can be set as "Preset User Cal", i.e. the user correction data that shall be restored after a user-defined preset.

If a new channel is created, the channel calibration of the active channel is also applied to the new channel. See also Calibration Labels.

# 3.5.4 Calibration Labels

The following labels in the trace list inform you about the status or type of the current system error correction.

Label	Meaning
Cal	The system error correction is applied without interpolation. This means that a set of measured correction data is available at each sweep point.
Cal int	The system error correction is applied, however, the correction data for at least one sweep point is interpolated from the measured values. This means that the channel settings have been changed so that a current sweep point is different from the calibrated sweep points. It is not possible to disable interpolation.
Cal Off	The system error correction is no longer applied (e.g. "User Cal Active" is disabled). See also "Cal Off label" on page 70.

Table 3-6: Calibration labels (system error correction)

# 3.5.5 Automatic Calibration

A calibration unit is an integrated solution for automatic system error correction of vector network analyzers. Rohde & Schwarz offers a wide range of calibration units for different frequency ranges and connector types. For R&S ZNB analyzers, the calibration unit R&S ZV-Z51 is recommended, however, all of the calibration units listed below can be used. The connector types of the calibration unit should be selected according the connectors of the DUT.

Calibration



Calibration unit	Frequency range	Connector type	No. of ports	Order no.
R&S ZV-Z51	300 kHz to 8 GHz	3.5 mm (f)	4	1164.0515.30
R&S ZV-Z51	300 kHz to 8 GHz	type N (f)	4	1164.0515.70
R&S ZV-Z52	10 MHz to 24 GHz	3.5 mm (f)	4	1164.0521.30
R&S ZV-Z53	300 kHz to 24 GHz	3.5 mm (f)	2	1164.0473.32
R&S ZV-Z53	300 kHz to 18 GHz	type N (f)	2	1164.0473.72
R&S ZV-Z54	10 MHz to 40 GHz	2.92 mm (f)	2	1164.0467.92
R&S ZV-Z55	10 MHz to 50 GHz	2.4 mm (f)	2	1164.0480.42

The units contain calibration standards that are electronically switched when a calibration is performed. The calibration kit data for the internal standards are also stored in the calibration unit, so that the analyzer can calculate the error terms and apply the calibration without any further input.

#### Advantages of automatic calibration

Automatic calibration is generally faster and more secure than manual calibration, because:

- There is no need to connect several standards manually. The number of connections to be performed quickly increases with the number of ports.
- Invalid calibrations due to operator errors (e.g. wrong standards or improper connections) are almost excluded.
- No need to handle calibration kit data.
- The internal standards don't wear out because they are switched electronically.

Limitations: Some calibration types (TOM, TSM, TRM, TRL, TNA) are not available.

# NOTICE

#### Safety instructions

Please observe the safety instructions in the "Technical Information" provided with the calibration unit to avoid any damage to the unit and the network analyzer. Safety-related aspects of the connection and operation of the units are also reported in the following sections.

#### 3.5.5.1 Connecting the Calibration Unit

The calibration units provide the following connectors:

- A USB type B connector at the rear is used to power-supply and control the unit. A USB cable for connection to the network analyzer is provided with the calibration unit.
- Two or four RF connectors numbered 1 to 4 are to be connected to the test ports 1 to 4 of the analyzer. The connector type is equal for all ports. Depending on the calibration unit model, it is either type N (f), 3.5 mm (f), 2.92 mm (f) or 2.4 mm (f).

#### To connect the unit,

- 1. Switch on and start up your network analyzer.
- To protect your equipment against ESD damage use the wrist strap and grounding cord supplied with the instrument and connect yourself to the GND connector at the front panel.
- Connect the USB type A connector of the USB cable to any of the USB type A connectors of the analyzer. Connect the USB type B connector of the USB cable to the USB type B connector of the calibration unit.
- Wait until the operating system has recognized and initialized the new hardware. When the unit is connected for the first time, this may take longer than in normal use.

The unit is ready to be used, see chapter 3.5.5.2, "Performing an Automatic Calibration", on page 87.



### Safety aspects

- The calibration unit is intended for direct connection to R&S ZNB network analyzers following the procedure described above. You can also connect the unit before switching on the analyzer. Do not connect the unit to other USB hosts, e.g. a PC, or insert any USB hubs between the analyzer and the unit, as this may cause damage to the unit or the host.
- You can connect several calibration units to the different USB ports of the analyzer. You can also connect cal units and other devices (mouse, USB memory stick etc.) simultaneously.
- An unused calibration unit may remain connected to the USB port while the network analyzer is performing measurements. It must be disconnected during a firmware update.
- It is safe to connect or disconnect the calibration unit while the network analyzer is operating. Never connect or disconnect the unit while data is being transferred between the analyzer and the unit. Never connect the unit during a firmware update.

### 3.5.5.2 Performing an Automatic Calibration

After connection and initialization, you can use the calibration unit as follows:

- 1. Connect n analyzer ports (n = 1 to 4, depending on your analyzer and calibration unit model and the number of ports to be calibrated) to n arbitrary ports of the calibration unit. Terminate all unused ports of the unit (no. n + 1 to 2 ot 4) with a 50  $\Omega$  match.
- Perform the automatic calibration for the selected number of ports using the "Calibration Unit" wizard (CHANNEL > CAL > Start Cal (Cal Unit); see chapter 4.4.3.2, "Calibration Unit Wizard", on page 280).
- Remove the test cables from the unit, connect your DUT instead and perform calibrated measurements.



The assignment between the analyzer ports and the cal unit ports can be detected automatically. If auto-detection fails (e.g. because of a high attenuation in the signal path), you can either enter the port assignment manually or connect matching port numbers and select "Default Port Assignment".



#### Accuracy considerations

To ensure an accurate calibration, please observe the following items:

- Unused ports of the calibration unit must be terminated with a 50  $\Omega$  match.
- No adaptors must be inserted between the calibration unit and the test ports of the analyzer.
- After connecting the unit to the USB port, allow for a sufficient warm-up time before starting the calibration. Refer to the "Specifications" of the calibration unit for details.
- To ensure best accuracy the analyzer automatically reduces the source power to 10 dBm. If the test setup contains a large attenuation, deactivate "Auto Power Reduction for Cal Unit" in the "Calibration" tab of the "System Config" dialog and ensure an input power of –10 dBm at the ports of the calibration unit (please also refer to the "Specifications" of the calibration unit).

# NOTICE

### Maximum RF input power

The maximum RF input power of the calibration unit is beyond the RF output power range of the analyzer, so there is no risk of damage if the device is directly connected to the test ports. If you use an external power amplifier, make sure that the maximum RF input power of the calibration unit quoted in the data sheet is never exceeded.

The available calibration types depend on the number of ports. For a single calibrated port, the reflection calibration types are available ("Refl Norm Open", "Refl Norm Short", "Refl OSM").

For 2 and more ports, the analyzer provides the following additional calibration types:

- A single full n-port (TOSM or UOSM) calibration for n calibrated ports.
- n full one-port calibrations for n calibrated ports.
- (n 1) one path two port calibrations for n calibrated ports (all possible 2-port combinations from the "Node Port" to any other port). The node port is the source port for each one path two port calibration (fully calibrated port).
- (n 1) transmission normalizations (bidirectional, forward or reverse) for n calibrated
  ports (all possible 2-port combinations from the first port to any other port). "Forward"
  transmission normalization means that the signal direction is from the ports with the
  lower numbers to the port with the higher numbers.

#### Example:

Select ports no. 1, 2, 3. A forward transmission normalization calibrates the S-parameters  $S_{21}$ ,  $S_{31}$ , and  $S_{32}$ . A reverse transmission normalization calibrates the S-parameters  $S_{12}$ ,  $S_{13}$ , and  $S_{23}$ . A bidirectional transmission normalization calibrates all six transmission S-parameters.

#### 3.5.5.3 Characterization of Calibration Units

Each calibration unit is delivered with factory characterization data which ensure an accurate calibration for all standard applications. For specific modifications of the test setup, e.g. the connection of additional adapters to a calibration unit, a modified set of characterization data (suitable for the cal unit with adapters) may be desirable. The R&S ZNB provides a characterization wizard which you can use to generate your own characterization data sets for (modified) R&S cal units. The characterization data can be stored in the cal unit and used for automatic calibration whenever needed.

A cal unit characterization can be performed in a frequency sweep. The network analyzer must be properly calibrated, with the reference plane at the input ports of the (modifed) cal unit to be characterized.

The procedure involves the following steps:

- 1. Perform a calibration of your network analyzer, using the test setup and the calibration type you wish to perform with your calibration unit.
- 2. Connect the calibration unit to the network analyzer.
- Access the "Characterize Cal Unit" dialog ("CHANNEL > CAL > Cal Devices > Characterize Cal Unit") and start the characterization wizard.
- 4. Step through the wizard, following the instructions in the dialogs.

#### Dependency between calibration types and characterization data

A cal unit characterization provides full one-port (OSM) data at the selected ports plus two-port (Through) data between any pair of selected ports. The measurement of Through data is optional, however, it is required for some calibration types. The following table gives an overview.

Calibration type	Characterization data required	
Refl Norm Open	OSM CalPort 1, OSM CalPort2 (all calibrated ports)	
Refl Norm Short		
Refl OSM		
UOSM		
TOSM		
Trans Norm Both	OSM CalPort 1, OSM CalPort2 (all calibrated ports), Through (between all pairs of ports)	
Trans Norm Forward		
One Path Two Ports		

### 3.5.5.4 Multiple Port Assignments

With multiple port assignments, it is possible to calibrate a number of test ports that exceeds the number of ports of the calibration unit or cal unit characterization in use. E.g. you can use a 2-port calibration unit to perform a full 4-port calibration.



The multiple port assignment method considerably extends the range of applications of the calibration units. However, the method entails some loss of convenience because you have to re-connect the calibration unit between the different calibration stages (assignments). It may also cause a loss of accuracy because only a subset of all possible through connections is measured.

To calibrate n test ports with an m-port calibration unit (m<n), the calibration unit has to be reconnected at least n/m times. Each of these (re-)connections is described by its "port assignment", i.e. the mapping of calibration unit ports to test ports. Then for each assignment an automatic calibration is performed. Finally the analyzer combines the calibration data and calculates the required n-port error terms.

This is possible if and only if

- the port assignments "cover" the calibrated test ports
- the overlap between assignments allows a(n ordered) "chain of measured through connections" between any (ordered) pair of test ports requiring a Through measurement

For Full n-Port calibrations, the R&S ZNB applies the "reduced through" logic to calculate the correction terms for those test port pairs that are not covered by a single assignment and hence cannot be measured directly (see chapter 3.5.1.10, "Full n-Port Calibration with Reduced Number of Through Connections", on page 77). Depending on the calibration type, a "minimal" valid and complete solution can be described as follows:

Calibration type	Minimal solution	Default solution (minimal)
Full One Port	Each calibrated test port must appear in exactly one port assignment.	Subdivide the n test ports into groups of m ports with increasing port numbers. Create a separate port assignment for each group.
One Path Two Port	<ul> <li>The node port must be included in all port assignments</li> <li>Each of the n-1 other calibrated test ports must appear in exactly one port assignment</li> <li>Additional condition: The calibration unit port assigned to the node port must be the same in all assignments. This minimizes the number of port reconnections between the calibration stages.</li> </ul>	Assign the node port to port 1 of the calibration unit. Subdivide the remaining n–1 test ports into groups of m–1 ports. Create a separate port assignment for each group; leave port 1 of the calibration unit connected to the node port and connect the ports of each of the port groups to the remaining m–1 ports of the calibration unit.
Full n-Port	<ul> <li>the two generic conditions stated above (with "unordered Throughs")</li> <li>the number of assignments must be as small as possible</li> <li>Additional condition: The cal unit port assigned to a given test port must be the same in all assignments. Again, this minimizes the number of port re-connec- tions between the calibration stages.</li> </ul>	Same as for One Path Two Port calibrations, using the test port with the lowest number as "node port". (Every other calibrated port could serve as "node port")



In case that an External Switch Matrices is used, an additional Through measurement might be required if all test ports are part of the same submatrix. Using manual calibration, any additional Through connection (besides the n-1 required ones) can be measured. An automatic calibration automatically measures the required Through connections

Among the minimal ones, the "star-shaped" solutions with fixed (but arbitrary) "node port" are also optimal w.r.t. the (average) length of the "Chain of Throughs" and hence the accuracy of the calculated Throughs. Additional port assignments may improve the accuracy, provided that they add more measured through connections.

#### Example:

The following examples show minimal port assignments for a Full 9-Port calibration using a four-port calibration unit:

Test Port	Assignment 1	Assignment 2	Assignment 3
1	Cal Unit Port 1	Cal Unit Port 1	Cal Unit Port 1
2	Cal Unit Port 2	-	-
3	Cal Unit Port 3	-	-
4	Cal Unit Port 4	-	-
5	-	Cal Unit Port 2	-
6	-	Cal Unit Port 3	-
7	-	Cal Unit Port 4	-
8	-	-	Cal Unit Port 2
9	-	-	Cal Unit Port 3

Table 3-7: Full n-port: Star-shaped optimum solution

Table 3-8: Full n-port: Line-shaped optimum solution

Test Port	Assignment 1	Assignment 2	Assignment 3
1	Cal Unit Port 1	-	-
2	Cal Unit Port 2	-	-
3	Cal Unit Port 3	-	-
4	Cal Unit Port 4	Cal Unit Port 4	-
5	-	Cal Unit Port 1	-
6	-	Cal Unit Port 2	-
7	-	Cal Unit Port 3	Cal Unit Port 3
8	-	-	Cal Unit Port 1
9	-	-	Cal Unit Port 2

# 3.5.6 Scalar Power Calibration

The purpose of a scalar power calibration is to ensure accurate source power levels and power readings at a particular position (calibration plane) in the test setup. Scalar power calibration is essentially different from the system error correction described in chapter 3.5, "Calibration", on page 69.

A power calibration is required for accurate measurement of wave quantities or ratios (see section chapter 3.1.5, "Data Flow", on page 18). For best accuracy, choose a calibration method according to the table below.



#### **Calibration of S-parameters**

S-parameters are not affected by a scalar power calibration. S-parameters are ratios of incident and outgoing waves: for linear DUTs, they do not depend on the absolute power. For measurements on non-linear DUTs, a SMARTerCal is recommended.

A SMARTerCal is also appropriate for frequency conversion measurements. For detailed information refer to chapter 3.5.7, "SMARTerCal", on page 98.

Measurement	System error correction	Scalar Power calibration	SMARTerCal Not necessary	
S-parameter meas. on linear DUTs	Yes	Not necessary		
S-parameter meas. on non-lin- ear DUTs	Not possible > Use SMARTerCal	Yes Power (source) and meas. receiver, suppor- ted in combination with SMARTerCal	Yes <sup>1)</sup>	
Meas. of wave quantities or ratios on linear DUTs> Use SMARTerCal		Not necessary	Yes	
Meas. of wave quantities or ratios on non-linear DUTs Not possible > Use SMARTerCal		Yes Power (source) and meas. receiver, suppor- ted in combination with SMARTerCal	Yes	
Power sweep, e.g. for compres- sion point measurement		Power (source): Yes Meas. receiver: not necessary	Not necessary	
Frequency conversion meas- urements on linear DUTs> Use SMARTerCal		Not necessary	Yes	
Frequency conversion meas- urements on non-linear DUTs Not possible > Use SMARTerCal		Yes Power (source) and meas. receiver, suppor- ted in combination with SMARTerCal	Yes	

Table 3-9: Recommended calibration methods for various measurements

1) SMARTerCal is a multi-port calibration type. For one-port measurements, perform a two-port SMARTerCal for a port pair including the measurement port.

In general, a power calibration involves two stages:

 Source power calibration: An external power meter is connected to the calibration plane. The analyzer uses the power meter readings to calibrate its reference receiver.

Subsequently, it modifies its source power so that the calibrated reference receiver reading corresponds to the desired source power value (flatness calibration).

2. **Measurement receiver calibration:** The analyzer uses the calibrated source signal to adjust the power reading at the receive port.

### 3.5.6.1 Source Power Calibration

A source power calibration ensures an accurate power of the generated wave at an arbitrary calibration plane in the measurement path. Typically the calibration plane corresponds to the input of the DUT.

In a frequency sweep, the power at the calibration plane is maintained at a constant "Cal Power" value. The source power calibration eliminates frequency response errors in the signal path between the source and the calibration plane. It is possible to introduce an arbitrary attenuation or gain into the signal path so that the cal power is not restricted to the power range of the source. A typical application for a power calibration in a frequency sweep is the measurement of the gain of an amplifier across a frequency range but at a fixed input power.


In a power sweep, the power calibration ensures that the power at the calibration plane is either constant or a linear function of the stimulus power. A typical application for a power calibration in a power sweep is the measurement of the gain of an amplifier across a power range but at a fixed frequency. The correction data acquired in a frequency or power sweep is re-used if a "Time" or "CW Mode" sweep is activated.

#### **Calibration procedure**

The source power calibration requires an external power meter, to be connected via GPIB bus, USB or LAN interface. Use the USB-to-IEC/IEEE Adapter (option R&S ZVAB-B44) to control devices equipped with a GPIB interface. The power sensor can be connected directly at the calibration plane or to any other point in the test setup where the signal power is known to be proportional to the power at the calibration plane.

The source power calibration involves several steps:

1. **Reference receiver calibration:** The analyzer performs a first calibration sweep at the source power that is likely to produce the target power ("Cal Power") at the calibration plane. A known attenuation or gain at the source port and in the signal path between the source port and the calibration plane can be taken into account:

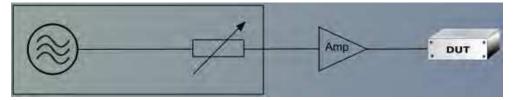

The power which the external power meter measured at the calibration plane is displayed in the calibration sweep diagram, together with the reference receiver reading. The difference between the two traces is used to correct the reference receiver reading, i.e. the reference receiver is calibrated by the external power meter results.


- 2. Internal source power flatness calibration: In the following steps, the calibrated reference receiver is used to adjust the source power. To this end, the R&S ZNB performs a series of calibration sweeps at varying source power until the number of "Total Readings" is reached or until the deviation between the calibrated reference receiver power and the cal power is below a specified "Tolerance". The external power meter is no longer used for these repeated calibration sweeps; everything is based on the previously calibrated reference receiver. This speeds up the calibration procedure but does not impair its accuracy.
- After the flatness calibration, the R&S ZNB performs an additional verification sweep in order to demonstrate the accuracy of the calibration.

After the source power calibration, one can expect the power at the calibration plane to be within the range of uncertainty of the power meter. The reference receiver reading corresponds to the calibrated source power. After a change of the sweep points or sweep range, the analyzer interpolates or extrapolates the calibration data; see chapter 3.5.6.3, "Power Calibration Labels", on page 95.

## 3.5.6.2 Measurement Receiver Calibration

A measurement receiver calibration ensures that the power readings at a specified receive port of the analyzer (b-waves) agree with the source power level calibrated at an arbitrary calibration plane. Typically, the calibration plane is at the input of the receiver so that the calibration eliminates frequency response errors in the calibrated receiver.

In contrast, the reference receiver calibration, which is automatically performed together with the (source) power calibration, ensures correct power readings for the generated waves (a-waves).

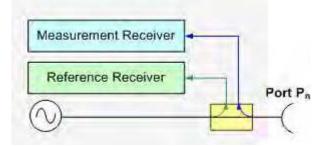

A measurement receiver calibration generally improves the accuracy of power (wave quantity) measurements. The correction data acquired in a frequency or power sweep is re-used if a "Time" or "CW Mode" sweep is activated.

#### Calibration procedure

The measurement receiver calibration is based on a received wave  $b_n$  with known power. The calibration involves a connection to a (previously source power-calibrated) source port.

The received wave to calibrate can be generated by a different analyzer port  $P_m$  (m  $\neq$  n) or by an external generator. Alternatively, it is possible to connect an Open or Short

standard to port  $P_n$ : The measurement receiver is calibrated using the reflected wave  $a_n$ .

The measurement receiver calibration involves a single calibration sweep. The calibration sweep is performed with current channel settings but with a maximum IF bandwidth of 10 kHz. Smaller IF bandwidths are maintained during the calibration sweep; larger bandwidths are restored after the sweep. The analyzer measures the power at each sweep point, compares the result with the nominal power of the source, and compiles a correction table.

An acoustic signal indicates the end of the calibration sweep. At the same time, a checkmark symbol next to the calibrated source indicates the status of the measurement receiver calibration. After a change of the sweep points or sweep range, the analyzer interpolates or extrapolates the calibration data.

#### 3.5.6.3 Power Calibration Labels

Power calibration labels in the trace list for wave quantities and ratios inform you about the status and type of the current scalar power calibration. The labels appear in the following instances:

- For a-waves, if a source power calibration is available.
- For b-waves, if a measurement receiver power calibration is available.
- For ratios between a- and b-waves, if both a source power and a measurement receiver power calibration is available.



## **Calibration of S-parameters**

S-parameters and derived quantities (e.g. impedances, admittances, stability factors) are assumed to be linear; otherwise they must be corrected by a SMARTerCal.

Therefore, a scalar power calibration is not applied to S-parameters and derived quantities; no power calibration labels appear in the trace list.

Label	Meaning
PCal	A scalar power calibration is available and applied without interpolation or extrapolation (see below).
	This means that a set of measured correction data is available at each sweep point.
PCai	The power calibration is applied, however, the correction data for at least one sweep point is interpolated from the measured values. This means that the channel settings have been changed so that a current sweep point is different from the calibrated sweep points. It is not possible to disable interpolation.
PCao	The power calibration is applied, however, the source power (channel base power) was changed.

#### Table 3-10: Power calibration labels

Label	Meaning
PCax	The power calibration is applied, however the calibration data is extrapolated. The cur- rent stimulus range exceeds the calibrated stimulus range. The power calibration data of the first calibrated sweep point is used for all smaller stimulus values; the power calibration data of the last calibrated sweep point is used for all larger stimulus values.
PCal Off	The power calibration is no longer applied (e.g. deliberately turned off in the "Calibration > Use Cal " softtool panel).

A lower label in the list has priority over the higher labels (e.g. if the power calibration is interpolated and the source power is changed, then the label PCao is displayed).


### Interpolation and extrapolation

The analyzer can interpolate and extrapolate power correction data so that a source or receiver power calibration can be reused after a change of the frequency sweep range:

- At new sweep points within the calibrated sweep range, interpolation is applied to calculate the correction data. A label "PCai" in the trace list indicates an interpolated power calibration.
- At new sweep points outside the calibrated sweep range, the correction values are extrapolated: Sweep points below the lowest calibrated frequency are assigned the correction value of the lowest frequency. Sweep points above the highest calibrated frequency are assigned the correction value of the highest frequency. A label "PCax" in the trace list indicates an extrapolated power calibration.

## 3.5.6.4 Extended Test Setups

The power calibration data can be modified to account for an additional two-port device in the test setup. The known transmission coefficients of the two-port can be entered manually or automatically ("CHANNEL > CAL > Pwr Cal Settings > Transm. Coefficients"). The R&S ZNB supports two different test scenarios.

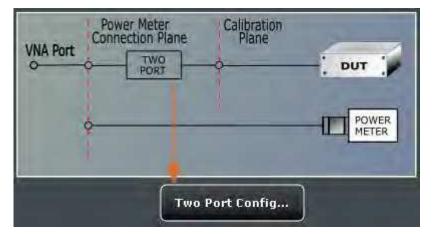

#### A: Two-port at DUT (during measurement)

Test and measurement procedure:

- Perform the calibration without the additional two-port. During the calibration the analyzer decreases the power sensor values by the 2-port transmission coefficients to move the calibration plane of the power calibration towards the input of the DUT. The calibration plane corresponds to the output of the 2-port which is placed inbetween the network analyzer port and the DUT.
- 2. Perform the measurement with the additional two-port.

**Practical example:** On-wafer measurements. The power sensor cannot be directly connected to the input of the DUT. The transmission coefficients of the wafer probe are used for the power meter correction.

VNA Port	Calibration Plane
	O-TWO PORT POWER METER
	Two Port Config

#### B: Two-port at power meter (during calibration)

Test and measurement procedure:

- Perform the calibration with the additional two-port between the analyzer port and the power sensor. During the calibration the analyzer increases the power sensor values by the 2-port transmission coefficients to move the calibration plane of the power calibration towards the input of the DUT. The calibration plane corresponds to the input of the additional 2-port.
- 2. Perform the measurement without the additional two-port.

**Practical example:** An adapter or attenuator with known attenuation is needed to connected the power sensor to the test port of the network analyzer. The transmission coefficients of the adapter are used for the power meter correction.

# 3.5.7 SMARTerCal

A SMARTerCal (smarter calibration) is a combination of a full n-port system error correction (TOSM, UOSM, TRL, TNA ...) for two or more ports with a (scalar) receiver power calibration at a **single** port. The two calibration methods serve different purposes:

- The system error correction requires a set of calibration standards; it provides vector error-corrected S-parameters. For equal port frequencies, the n-port calibration types provide the full set of error terms. For frequency conversion measurements, a source match correction and (optional) load match correction is calculated.
- The receiver power calibration requires an external power meter; it corrects the power readings of the reference and measurement receivers according to the measured absolute power at the calibration plane. This does **not** include a re-adjustment of the actual source power (flatness calibration).

**Example:** Channel base power: -10 dBm; the test setup involves a 3-dB attenuation between the source port and the calibration plane. After the power calibration is applied, the analyzer indicates an output power (a-wave) of -13 dBm, although the actual source power remains at -10 dBm.

The SMARTerCal is also applied to ratios and wave quantities. For measurements on linear DUTs, SMARTerCal is sufficient. Non-linear measurements can be further improved by a combination of a SMARTerCal plus a scalar power calibration. See Combining SMARTerCal with Scalar Power Calibration.

For an overview of measurements and recommended calibration methods refer to table 3-9.

## 3.5.7.1 Calibration Procedure

A SMARTerCal is a fully menu-guided process which is performed like a regular system error correction. The calibration wizard defines the calibrated ports and the calibration type; it also initiates the calibration sweeps for all calibration standards. The calibration sweep for the external power meter is performed in analogy to a sweep for a one-port calibration standard, however, the analyzer uses the "Reference Receiver Cal Power" setting from the scalar power calibration ("CHANNEL > CAL > Pwr Cal Settings > Cal Power..."). The order of the system error correction and power calibration sweeps is arbitrary; ensure that you always connect the proper equipment.

The R&S ZNB also supports a SMARTerCal based on the calibration units R&S ZV-Z5x. The calibration units provide the n-port system error correction data (TOSM or UOSM); a subsequent power calibration sweep completes the calibration.

#### 3.5.7.2 Calibration Types

The names of the SMARTerCal calibration types consist of a prefix "P" (indicating the additional power calibration) plus the system error correction type. The R&S ZNB supports the SMARTerCal equivalent of all full n-port system error corrections; an overview is shown below.

Calibration

Table 3-11: SMARTerCal calibration types

SMARTerCal Type	Based on	Manual calibration	Calibration unit
PTOSM	TOSM		
PUOSM	UOSM		
PTRL	TRL		
РТОМ	ТОМ		
PTSM	TSM		
PTRM	TRM		
PTNA	TNA		

The selection criteria for the SMARTerCal calibration types are identical to the criteria for system error corrections. For an overview refer to chapter 3.5.1, "Calibration Types", on page 70.

#### 3.5.7.3 Combining SMARTerCal with Scalar Power Calibration

As described in chapter 3.5.7, "SMARTerCal", on page 98, the power meter results of a SMARTerCal are only used to calibrate the receivers of the R&S ZNB. To obtain definite source power levels, you can combine the SMARTerCal with an additional scalar source power calibration.

The scalar source power calibration and the SMARTerCal may be performed in any order. As a result of the combined calibration, the R&S ZNB measures vector error-corrected S-parameters; the scalar power correction is applied to wave quantities and ratios. Notice that this provides different values e.g. of  $S_{21}$  and the ratio  $b_2/a_1$ . The flatness calibration step of the scalar source calibration ensures accurate input powers at the DUT.

A combined SMARTerCal and scalar power calibration is also appropriate for frequency conversion measurements on non-linear DUTs. For linear measurements, where the actual input power at the DUT is not critical, a SMARTerCal is sufficient.

#### 3.5.7.4 Calibration Labels

The status and type of the SMARTerCal is indicated in the trace list, in analogy to a system error correction (see chapter 3.5.4, "Calibration Labels", on page 84). The calibration labels for a SMARTerCal consist of a prefix "S" plus the system error correction labels.

Label	Meaning
SCal	The SMARTer Cal is applied without interpolation. This means that a set of measured correction data is available at each sweep point.
SCal int	The SMARTer Cal is applied, however, the correction data for at least one sweep point is interpolated from the measured values. This means that the channel settings have been changed so that a current sweep point is different from the calibrated sweep points. It is not possible to disable interpolation.

Table 3-12: Calibration labels (SMARTerCal)

Offset Parameters and Embedding

Label	Meaning
Cal Off	The SMARTer Cal is no longer applied (e.g. "User Cal Active" is disabled). See also "Cal Off label" on page 70.

The receiver power calibration included in the SMARTerCal is not indicated separately. If a SMARTerCal is combined with an additional scalar source power calibration (see chapter 3.5.7.3, "Combining SMARTerCal with Scalar Power Calibration", on page 99), the trace list may contain an addition power calibration label according to chapter 3.5.6.3, "Power Calibration Labels", on page 95.


Trc1 a1(P1) Lin Mag 100 µW/ Ref 1 mW Cal Off PCal

# 3.6 Offset Parameters and Embedding

The R&S ZNB functionality described in this section complements the calibration, compensating for the effect of known transmission lines or matching networks between the calibrated reference plane and the DUT.

# 3.6.1 Offset Parameters

Offset parameters compensate for the known length and loss of a (non-dispersive and perfectly matched) transmission line between the calibrated reference plane and the DUT.

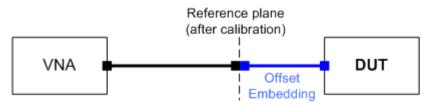

The analyzer can also auto-determine length and loss parameters, assuming that the actual values should minimize the group delay and loss across the sweep range.

#### 3.6.1.1 Definition of Offset Parameters

The **delay** is the propagation time of a wave traveling through the transmission line. The **electrical length** is equal to the delay times the speed of light in the vacuum and is a measure for the length of the transmission line between the standard and the actual calibration plane. For a line with permittivity  $\varepsilon_r$  and **mechanical length**  $L_{mech}$  the delay and the electrical length are calculated as follows:

$$Delay = \frac{L_{mech} \cdot \sqrt{\varepsilon_r}}{c}; \quad Electrical \ Length = L_{mech} \cdot \sqrt{\varepsilon_r}$$

User Manual 1173.9163.02 - 13

In the "CHANNEL > OFFSET EMBED > Offset" tab, "Electrical Length, Mechanical Length" or "Delay" are coupled parameters. When one of them is changed, the other two follow.

For a non-dispersive DUT, the delay defined above is constant over the considered frequency range and equal to the negative derivative of the phase response with respect to the frequency (see mathematical relations). The length offset parameters compensate for a constant delay, which is equivalent to a linear phase response.

#### 3.6.1.2 Definition of Loss Parameters

The **loss** "L" is the attenuation of a wave when traveling through the offset transmission line. In logarithmic representation, the loss can be modeled as the sum of a constant and a frequency-dependent part. The frequency dependence is essentially due to the skin effect; the total loss can be approximated by an expression of the following form:

$$Loss(f) = \left[Loss(f_{ref}) - Loss_{DC}\right] \sqrt{\frac{f}{f_{ref}} + Loss_{DC}}$$

The "Loss at DC" Loss<sub>DC</sub>, the reference "Frequency for Loss"  $f_{ref}$ , and the loss at the reference frequency Loss( $f_{ref}$ ) are empirical parameters for the transmission lines connected to each port which can be entered in the "CHANNEL > OFFSET EMBED > DC Loss" tab. For a lossless transmission line, Loss<sub>DC</sub> = Loss( $f_{ref}$ ) = 0 dB. In practice, the frequency-dependent loss often represents the dominant contribution so that Loss<sub>DC</sub> can be set to zero.

Experimentally, the two loss values  $Loss_{DC}$  and  $Loss(f_{ref})$  are determined in two separate measurements at a very low frequency (f --> 0) and at f =  $f_{ref}$ .

#### 3.6.1.3 Auto Length

The "Auto Length" function ("CHANNEL > OFFSET EMBED > Offset > Auto Length") adds an electrical length offset to a test port with the condition that the residual delay of the active trace (defined as the negative derivative of the phase response) is minimized across the entire sweep range. If "Delay" is the selected trace format, the entire trace is shifted in vertical direction and centered around zero. In phase format, the "Auto Length" corrected trace shows the deviation from linear phase.

#### Length and delay measurement, related settings

"Auto Length" is suited for length and delay measurements on transmission lines.

- 1. Connect a (non-dispersive) cable to a single analyzer port no. n and measure the reflection factor S<sub>nn</sub>.
- 2. Select "Auto Length".

The delay is displayed in the "CHANNEL > OFFSET EMBED > Offset > Auto Length" tab. The cable length, depending on the velocity factor, can be read in the "Mechanical Length" field. It is also possible to determine cable lengths using a transmission measurement. Note that "Auto Length" always provides the **single** cable length and the delay for a propagation in **one** direction.

The analyzer provides alternative ways for delay measurements:

- Measure the reflection factor and select "TRACE > FORMAT > Delay". This yields the delay for propagation in forward and reverse direction and should be approx. twice the "Auto Length" result. For transmission measurements, both results should be approx. equal.
- Measure the reflection factor and select "TRACE > FORMAT > Phase". Place a marker to the trace and activate "TRACE > TRACE CONFIG > Trace Statistics > Phase / El Length". This yields the delay in one direction and should be approx. equal to the "Auto Length" result.

The measurement results using trace formats and trace statistics functions depend on the selected delay aperture and evaluation range. Auto Length is particularly accurate because it uses all sweep points. For non-dispersive cables, aperture and evaluation range effects are expected to vanish.

Use "Zero Delay at Marker" to set the delay at a special trace point to zero.

### Preconditions for Auto Length, effect on measured quantities and exceptions

"Auto Length" is enabled if the measured quantity contains the necessary phase information as a function of frequency, and if the interpretation of the results is unambiguous:

- A frequency sweep must be active.
- The measured quantity must be an S-parameter, ratio, wave quantity, a converted impedance or a converted admittance.

The effect of "Auto Length" on S-parameters, wave quantities and ratios is to eliminate a linear phase response as described above. The magnitude of the measured quantity is not affected. Converted admittances or impedances are calculated from the corresponding "Auto Length" corrected S-parameters. Y-parameters, Z-parameters and stability factors are not derived from a single S-parameter, therefore "Auto Length" is disabled.

#### Auto Length for logical ports

The "Auto Length" function can be used for balanced port configurations as well. If the active test port is a logical port, then the same length offset must be assigned to both physical ports that are combined to form the logical port. If different length offsets have been assigned to the physical ports before, they are both corrected by the same amount.

#### 3.6.1.4 Auto Length and Loss

The "Auto Length and Loss" function ("CHANNEL > OFFSET EMBED > One Way Loss > Auto Length and Loss") determines all offset parameters such that the residual group delay of the active trace (defined as the negative derivative of the phase response) is

minimized and the measured loss is minimized as far as possible across the entire sweep range.

"Auto Length and Loss" involves a two-step procedure:

- An "Auto Length" correction modifies the phase of the measured quantity, minimizing the residual group delay. The magnitude of the measured quantity is not affected.
- The "Auto Loss" correction modifies the magnitude of the measured quantity, leaving the (auto length-corrected) phase unchanged.

## Preconditions for Auto Length and Loss, effect on measured quantities and exceptions

"Auto Length and Loss" is enabled if the measured quantity contains the necessary phase information as a function of the frequency, and if the interpretation of the results is unambiguous:

- A frequency sweep must be active.
- The measured quantity must be an S-parameter, ratio, wave quantity, a converted impedance or a converted admittance.

The effect of "Auto Length and Loss" on S-parameters, wave quantities and ratios is to eliminate a linear phase response and account for a loss as described above. Converted admittances or impedances are calculated from the corresponding "Auto Length and Loss" corrected S-parameters. Y-parameters, Z-parameters and stability factors are not derived from a single S-parameter, therefore "Auto Length and Loss" is disabled.

#### **Calculation of loss parameters**

The loss is assumed to be given in terms of the DC loss  $Loss_{DC}$ , the reference frequency  $f_{ref}$ , and the loss at the reference frequency  $Loss(f_{ref})$ . The formula used in the Auto Loss algorithm is similar to the formula for manual entry of the loss parameters (see chapter 3.6.1.2, "Definition of Loss Parameters", on page 101).

The result is calculated according to the following rules:

- The reference frequency f<sub>ref</sub> is kept at its previously defined value (default: 1 GHz).
- The DC loss c is zero except for wave quantities and for S-parameters and ratios with maximum dB magnitude larger than -0.01 dB.
- "Auto Length and Loss" for a wave quantity centers the corrected dB magnitude as close as possible around 0 dBm.
- "Auto Length and Loss" for S-parameters and ratios centers the corrected dB magnitude as close as possible around 0 dB.

The resulting offset parameters are displayed in the "CHANNEL > EFFSET EMBED > Offset" tab.

#### Auto Length and Loss for logical ports

The "Auto Length and Loss" function can be used for balanced port configurations as well. If the active test port is a logical port, then the same offset parameters must be assigned to both physical ports that are combined to form the logical port. If different offset

parameters have been assigned to the physical ports before, they are both corrected by the same amount.

#### 3.6.1.5 Fixture Compensation

Fixture compensation is an automated length offset and loss compensation for test fixtures with up to four ports (for 4-port analyzers). The analyzer performs a one-port reflection measurement at each port, assuming the inner contacts of the test fixtures to be terminated with an open or short circuit.

Fixture compensation complements a previous system error correction and replaces a possible manual length offset and loss correction. For maximum accuracy, it is recommendable to place the reference plane as close as possible towards the outer test fixture connectors using a full n-port calibration. The fixture compensation is then carried out in a second step, it only has to compensate for the effect of the test fixture connections.

The following features can further improve the accuracy of the fixture compensation:

- "Direct Compensation" provides a frequency-dependent transmission factor (instead of a global electrical length and loss).
- "Open and Short" causes the analyzer to calculate the correction data from two subsequent sweeps. The results are averaged in order to compensate for errors due to non-ideal terminations.

#### Auto Length and Loss vs. Direct Compensation

"Auto Length and Loss" compensation is a descriptive correction type: The effects of the test fixture connection are traced back to quantities that are commonly used to characterize transmission lines.

Use this correction type if your test fixture connections have suitable properties in the considered frequency range:

- The electrical length is approximately constant.
- The loss varies essentially due to the skin effect.

"Direct Compensation" provides a frequency-dependent transmission factor. The phase of the transmission factor is calculated from the square root of the measured reflection factor, assuming a reciprocal test fixture. The sign ambiguity of this calculated transmission factor is resolved by a comparison with the phase obtained in an Auto Length calculation. This compensation type is recommended for test fixture connections that do not have the properties described above.

A "Direct Compensation" resets the offset parameters to zero.

#### Open / Short vs. Open and Short compensation

A non-ideal open or short termination of the test fixture connections during fixture compensation impairs subsequent measurements, causing an artificial ripple in the measured reflection factor of the DUT. If you observe this effect, an "Open and Short" compensation may improve the accuracy.

"Open and Short" compensation is more time-consuming because it requires two consecutive fixture compensation sweeps for each port, the first with an open, the second with a short circuit. The analyzer automatically calculates suitable averages from both fixture compensation sweeps in order to compensate for the inaccuracies of the individual "Open and Short" compensations.

## 3.6.1.6 Application and Effect of Offset Parameters

Offset and loss parameters can be particularly useful if the reference plane of the calibration cannot be placed directly at the DUT ports, e.g. because the DUT has non-coaxial ports and can only be measured in a test fixture. Offset parameters can also help to avoid a new complete system error correction if a cable with known properties has to be included in the test setup.

- A positive length offset moves the reference plane of the port towards the DUT, which is equivalent to deembedding the DUT by numerically removing a (perfectly matched) transmission line at that port.
- A negative offset moves the reference plane away from the DUT, which is equivalent to embedding the DUT by numerically adding a (perfectly matched) transmission line at that port.

The offset parameters are also suited for length and delay measurements; see chapter 3.6.1.3, "Auto Length", on page 101. In contrast to the embedding/deembedding functions (see chapter 3.6.2, "Embedding and Deembedding", on page 106) the parameters cannot compensate for a possible mismatch in the test setup.

Each offset parameter is assigned to a particular port. The delay parameters affect the phase of all measured quantities related to this port; the loss parameters affect their magnitude. An offset at port 1 affects the S-parameters  $S_{11}$ ,  $S_{21}$ ,  $S_{12}$ ,  $S_{31}$ ... Some quantities (like the Z-parameters) depend on the whole of all S-parameters, so they are all more or less affected when one S-parameter changes due to the addition of an offset length.



To account for the propagation in both directions, the phase shift of a reflection parameter due to a given length offset is twice the phase shift of a transmission parameter. If, at a frequency of 300 MHz, the electrical length is increased by 250 mm ( $\lambda$ /4), then the phase of S<sub>21</sub> increases by 90 deg, whereas the phase of S<sub>11</sub> increases by 180 deg.

Equivalent relations hold for the loss.

If the trace is displayed in "Delay" format, changing the offset parameters simply shifts the whole trace in vertical direction.

The sign of the phase shift is determined as follows:

- A positive offset parameter causes a positive phase shift of the measured parameter and therefore reduces the calculated group delay.
- A negative offset parameter causes a negative phase shift of the measured parameter and therefore increases the calculated group delay.

### 3.6.1.7 Offset Parameters for Balanced Ports

The offset parameters can be used for balanced port configurations:


- Offset parameters must be assigned to both physical ports of a logical port.
- "Auto Length" corrects the length offset of both physical ports of a logical port by the same amount.

# 3.6.2 Embedding and Deembedding

The R&S ZNB can define virtual networks to be added to/removed from the measurement circuit for a DUT with single ended or balanced ports. This concept is referred to as embedding and deembedding.

#### 3.6.2.1 Embedding a DUT

To be integrated in application circuits, high-impedance components like Surface Acoustic Wave (SAW) filters are often combined with a matching network. To obtain the characteristics of a component with an added matching network, both must be integrated in the measurement circuit of the network analyzer. The figure below shows a DUT with a single-ended and a balanced port that is combined with a real matching circuit and a physical unbalance-balance transformer (balun) in order to be evaluated in a 2-port measurement.

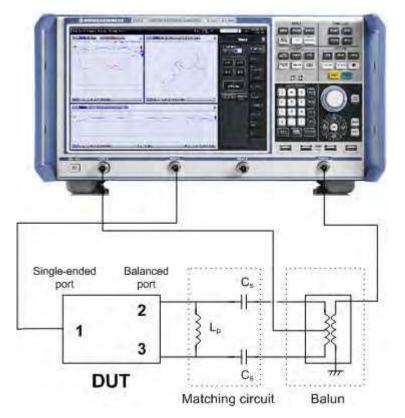

The idea of virtual embedding is to simulate the matching network and avoid using physical circuitry so that the analyzer ports can be directly connected to the input and output ports of the DUT. The matching circuit is taken into account numerically. The analyzer measures the DUT alone but provides the characteristics of the DUT, including the desired matching circuit.

This method provides a number of advantages:


- The measurement uncertainty is not impaired by the tolerances of real test fixtures.
- There is no need to fabricate test fixtures with integrated matching circuits for each type of DUT.
- Calibration can be performed at the DUT's ports. If necessary (e.g. for compensating for the effect of a test fixture) it is possible to shift the calibration plane using length offset parameters.

#### 3.6.2.2 Deembedding a DUT

Deembedding and embedding are inverse operations: A deembedding problem is given if an arbitrary real network connected to the DUT is to be virtually removed in order to obtain the characteristics of the DUT alone. Deembedding is typically used for DUTs which are not directly accessible because they are inseparably connected to other components, e.g. for MMICs in a package or connectors soldered to an adapter board.

To be numerically removed, the real network must be described by a set of S-parameters or by an equivalent circuit of lumped elements. Deembedding the DUT effectively extends the calibration plane towards the DUT ports, enabling a realistic evaluation of the DUT without the distorting network. Deembedding can be combined with length offset parameters; see chapter 3.6.1, "Offset Parameters", on page 100.

The simplest case of single port deembedding can be depicted as follows:

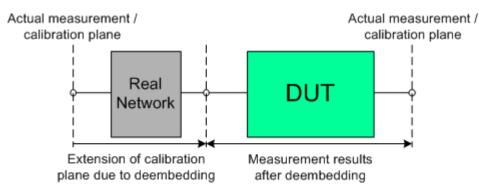

The embedding/deembedding function in the "Virtual Transform" menu has the following characteristics:

- Embedding and deembedding can be combined with balanced port conversion: the (de-)embedding function is available for single ended and balanced ports.
- A combination of four-port and two-port networks (not necessarily both) can be applied to balanced ports; two-port networks can be applied to single ended ports.
- Transformation networks can be defined by a set of S-parameters stored in a Touchstone file or by an equivalent circuit with lumped elements.


User Manual 1173.9163.02 - 13

• The same networks are available for embedding and deembedding.

#### 3.6.2.3 Combining Several (De-)Embedding Networks


The tabs in the "Offset Embed" softool allow you to select a combination of 4-port and 2-port networks to be numerically added/removed at balanced (logical) ports, and to select 2-port networks at single ended (physical) ports.

The different steps for deembedding and embedding are carried out in the following order:

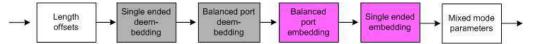


This means that the real networks are removed before virtual networks are added. For a single balanced port with all single ended and balanced port (de-)embedding networks enabled, the 4 (de-)embedding steps are carried out in the following order:

1. Initial situation: DUT embedded in 2-port and 4-port networks (only 1 port shown)

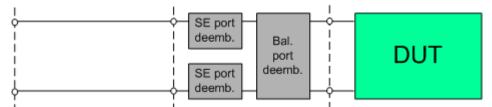


#### 2. Single ended deembedding

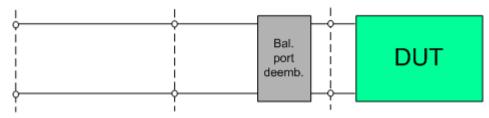

3. Balanced port deembedding



4. Balanced port embedding

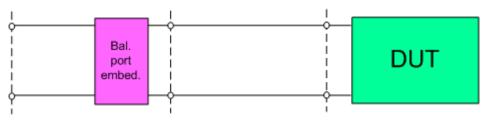

User Manual 1173.9163.02 - 13

5. Single ended port embedding




#### 3.6.2.4 Circuit Models for 2-Port Networks

The lumped element 2-port transformation networks for (de-)embedding consist of the following two basic circuit blocks:

- A capacitor C connected in parallel with a resistor.
- An inductor L connected in series with a resistor.


The 2-port transformation networks comprise all possible combinations of 2 basic blocks, where one block represents a serial, the other a shunt element. In the default setting the resistors are not effective, since the serial Rs are set to 0  $\Omega$ , the shunt Rs are set to 10 M $\Omega$ .

The first network is defined by its S-parameters stored in an imported two-port Touchstone file (\*.s2p). No additional parameters are required.

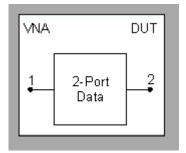

The following networks are composed of a serial C or L (as seen from the test port), followed by a shunt C or L. They are named


Serial C, Shunt C / Serial C, Shunt L / Serial L, Shunt C / Serial L, Shunt L.

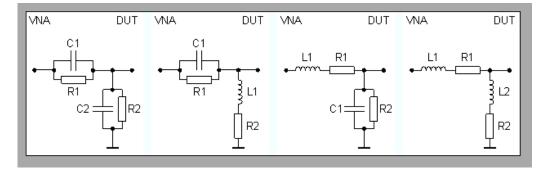

The following networks are composed of a shunt C or L (as seen from the analyzer port), followed by a serial C or L. They are named

Offset Parameters and Embedding

Shunt C, Serial C / Shunt C, Serial L / Shunt L, Serial C / Shunt L, Serial L.

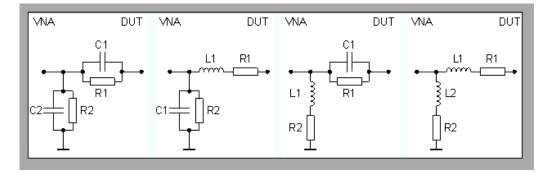


#### 3.6.2.5 Circuit Models for 4-Port Networks

The lumped element 4-port transformation networks for (de-)embedding consist of the following two basic circuit blocks:

- A capacitor C connected in parallel with a resistor.
- An inductor L connected in series with a resistor.

The transformation networks comprise various combinations of 3 basic circuit blocks, where two blocks represent serial elements, the third a shunt element. In the default setting the resistors are not effective, since the serial Rs are set to 0  $\Omega$ , the shunt Rs are set to 10 M $\Omega$ . Moreover, the serial elements can be replaced by imported 2-port S-parameters, or the entire transformation network can be described by imported 4-port S-parameters.


The first network is defined by its S-parameters stored in an imported four-port Touchstone file (\*.s4p). No additional parameters are required.

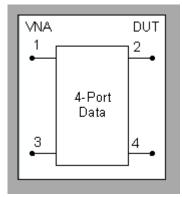

The following networks are composed of a shunt C or L and two serial elements, described by means of imported 2-port S-parameters. They are named


Serial 2-port, Shunt C / Serial 2-port, Shunt L /
Shunt L, Serial 2-port / Shunt C, Serial 2-port.

**Optional Extensions and Accessories** 

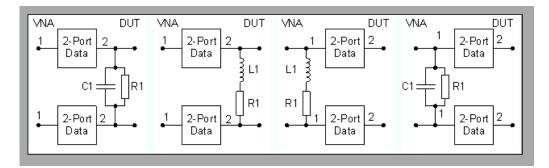


The following networks are composed of two serial Cs or Ls (as seen from the analyzer test port), followed by a shunt C or L. They are named

Serial Cs, Shunt C / Serial Cs, Shunt L / Serial Ls, Shunt C / Serial Ls, Shunt L.

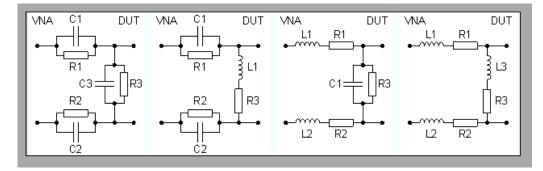

The following networks are composed of a shunt C or L (as seen from the analyzer test port), followed by two serial Cs or Ls. They are named

Shunt C, Serial Cs / Shunt C, Serial Ls / Shunt L, Serial Cs / Shunt L, Serial Ls.

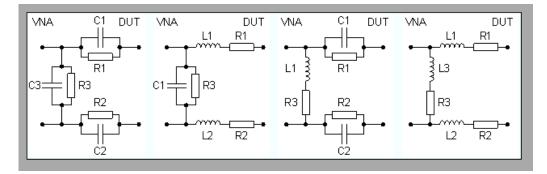

# 3.7 Optional Extensions and Accessories

The network analyzer can be upgraded with a number of hardware and software options, providing enhanced flexibility and an extended measurement functionality. The available options are listed in the "Info" dialog ("SETUP > Setup > Info..."). For a complete list of options, accessories, and extras refer to the product brochure of your analyzer or to the "Ordering Information" section of the R&S ZNB product pages on the internet.

The following sections provide an introduction to the software and hardware options described in this documentation. The use of external power meters and generators does not require any additional hardware or software options; it is described at the end of the chapter.

# 3.7.1 Time Domain (R&S ZNB-K2)

The network analyzer measures and displays complex S-parameters and other quantities as a function of the frequency. The measurement results can be filtered and mathematically transformed in order to obtain the time domain representation, which often gives a clearer insight into the characteristics of the DUT.

Time domain transforms can be calculated in band pass or low pass mode. For the latter the analyzer offers the impulse and step response as two alternative transformation types. A wide selection of windows can be used to optimize the time domain response and suppress sidelobes due to the finite sweep range. Moreover, it is possible to eliminate unwanted responses by means of a time gate and transform the gated result back into the frequency domain.

For a detailed discussion of the time domain transformation including many examples refer to the application note 1EZ44\_OE which is posted on the R&S internet.

#### 3.7.1.1 Chirp z-Transformation

The Chirp z-transformation that the analyzer uses to compute the time domain response is an extension of the (inverse) Fast Fourier Transform (FFT). Compared to the FFT, the number of sweep points is arbitrary (not necessarily an integer power of 2), but the computation time is increased by approx. a factor of 2. This increased computation time is usually negligible compared to the sweep times of the analyzer.

The following properties of the Chirp z-transformation are relevant for the analyzer settings:

- The frequency points must be equidistant.
- The time domain response is repeated after a time interval which is equal to  $\Delta t = 1/\Delta f$ , where  $\Delta f$  is the spacing between two consecutive sweep points in the frequency domain. For a sweep span of 4 GHz and 201 equidistant sweep points,  $\Delta f = 4$  GHz/200 = 2 \* 10<sup>7</sup> Hz, so that  $\Delta t = 50$  ns.  $\Delta t$  is termed measurement range (in time domain) or unambiguous range.

Additional constraints apply if the selected Chirp z-transformation is a lowpass transformation.

#### 3.7.1.2 Band Pass and Low Pass Mode

The analyzer provides two essentially different types of time domain transforms:

Band pass mode : The time domain transform is based on the measurement results
obtained in the sweep range between any set of positive start and stop values. The
sweep points must be equidistant. No assumption is made about the measurement

point at zero frequency (DC value). The time domain result is complex with a generally undetermined phase depending on the delay of the signal.

 Low pass mode : The measurement results are continued towards f = 0 (DC value) and mirrored at the frequency origin so that the effective sweep range (and thus the response resolution) is more than doubled. Together with the DC value, the condition of equidistant sweep points implies that the frequency grid must be harmonic. Due to the symmetry of the trace in the frequency domain, the time domain result is harmonic.

See also chapter 3.7.1.4, "Harmonic Grid", on page 114.

Two different types of response are available in low pass mode; see below.

Transform type	Band pass	Low pass
Advantages	Easiest to use: works with any set of equidis- tant sweep points	Higher response resolution (doubled) Includes information about DC value Real result Impulse and step response
Restrictions	No step response Undetermined phase	Needs harmonic grid
Use for	Scalar measurements where the phase is not needed DUTs that don't operate down to f = 0 (e.g. pass band or high pass filters)	Scalar measurements where the sign is of interest DUT's with known DC value


Table 3-13: Comparison of band pass and low pass modes

#### Impulse and step response

In low pass mode, the analyzer can calculate two different types of responses:

- The impulse response corresponds to the response of a DUT that is stimulated with a short pulse.
- The step response corresponds to the response of a DUT that is stimulated with a voltage waveform that transitions from zero to unity.

The two alternative responses are mathematically equivalent; the step response can be obtained by integrating the impulse response:

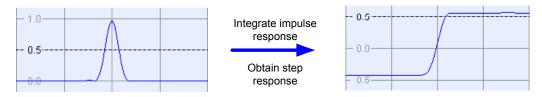

The step response is recommended for impedance measurements and for the analysis of discontinuities (especially inductive and capacitive discontinuities). The impulse response has an unambiguous magnitude and is therefore recommended for most other applications.

### 3.7.1.3 Windows in the Frequency Domain

The finite sweep range in a frequency domain measurement with the discontinuous transitions at the start and stop frequency broadens the impulses and causes sidelobes (ringing) in the time domain response. The windows offered in the "Define Transform" dialog can reduce this effect and optimize the time domain response. The windows have the following characteristics:


Window	Sidelobe suppres- sion	Relative impulse width	Best for
No Profiling (Rect- angle)	13 dB	1	-
Low First Sidelobe (Hamming)	43 dB	1.4	Response resolution: separation of closely spaced responses with comparable ampli- tude
Normal Profile (Hann)	32 dB	1.6	Good compromise between pulse width and sidelobe suppression
Steep Falloff (Boh- man)	46 dB	1.9	Dynamic range: separation of distant responses with different amplitude
Arbitrary Sidelobes (Dolph-Chebychev)	User defined between 10 dB and 120 dB	1.2 (at 32 dB side- lobe suppression)	Adjustment to individual needs; tradeoff between sidelobe suppression and impulse width

Table 3-14: Properties of frequency windows

#### 3.7.1.4 Harmonic Grid

A harmonic grid is formed by a set of equidistant frequency points  $f_i$  (i = 1...n) with spacing  $\Delta f$  and the additional condition that  $f_1 = \Delta f$ . In other words, all frequencies  $f_i$  are set to harmonics of the start frequency  $f_1$ .

If a harmonic grid, including the DC value (f = 0), is mirrored to the negative frequency range, the result is again an equidistant grid.

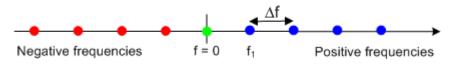

The point symmetry with respect to the DC value makes harmonic grids suitable for lowpass time domain transformations.


#### Visualization of the harmonic grid algorithms

The R&S ZNB provides three different algorithms for harmonic grid calculation. The three harmonic grids have the following characteristics:


 Keep "Stop Frequency and Number of Points" means that the stop frequency and the number of sweep points is maintained. The sweep points are re-distributed across the range between the minimum frequency of the analyzer and the stop frequency; the step width may be increased.

User Manual 1173.9163.02 - 13

**Optional Extensions and Accessories** 

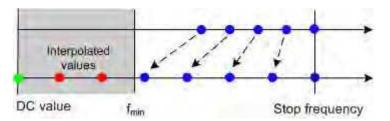


 Keep "Frequency Gap and Number of Points" means that the number of sweep points and their relative spacing is maintained. If the start frequency of the sweep is sufficiently above the f<sub>min</sub>, the entire set of sweep points is shifted towards lower frequencies so that the stop frequency is decreased.

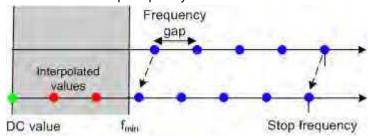

If the start frequency of the sweep is close to  $f_{min}$ , then the sweep points may have to be shifted towards higher frequencies. If the last sweep point of the calculated harmonic grid exceeds the maximum frequency of the analyzer, then an error message is displayed, and another harmonic grid algorithm must be used.

 Keep "Stop Frequency and Approximate Frequency Gap" means that the stop frequency is maintained and the number of sweep points is increased until the range between f<sub>min</sub> and the stop frequency is filled. The frequency gap is approximately maintained.

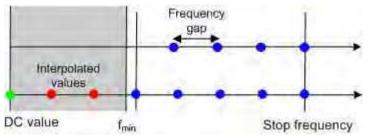

The figures above are schematic and do not comply with the conditions placed on the number of sweep points and interpolated/extrapolated values.

The harmonic grids can not be calculated for any set of sweep points. If the minimum number of sweep points is smaller than 5, then the interpolation/extrapolation algorithm for additional sweep points will not work. The same is true if the number of sweep points or stop frequency exceeds the upper limit. Besides, the ratio between the sweep range and the interpolation range between f = 0 and  $f = f_{min}$  must be large enough to ensure accurate results. If the sweep range for the harmonic grid exceeds the frequency range of the current system error correction, a warning is displayed.

#### Finding the appropriate algorithm

The three types of harmonic grids have different advantages and drawbacks. Note that for a bandpass transformation the grid parameters have the following effect:

- A wider sweep range (i.e. a larger bandwidth) increases the time domain resolution.
- A smaller frequency gap extends the unambiguous range.
- A larger number of points increases the sweep time.

With default analyzer settings, the difference between the grid types are small. The following table helps you find the appropriate grid.

#### Table 3-15: Properties of grid types

Grid type: Keep	Sweep time	Time domain resolution	Unambig- uous range	Algorithm fails if
Stop freq. and no. of points		1	ŧ	-
Freq. gap and no. of points		<b>&gt;</b>	<b>&gt;</b>	Stop frequency beyond upper fre- quency limit
Stop freq. and approx. freq. gap	1	1		Number of sweep points beyond limit

#### 3.7.1.5 Time Gates

A time gate is used to eliminate unwanted responses that appear on the time domain transform. An active time gate acts on the trace in time domain as well as in frequency domain representation.

The properties of the time gates are analogous to the properties of the frequency domain windows. The following table gives an overview:

Window	Sidelobe suppression	Passband ripple	Best for	
Steepest Edges (Rectangle)	13 dB	0.547 dB	Eliminate small distortions in the vicinity of the useful signal, if demands on amplitude accuracy are low	
Steep Edges (Hamming)	43 dB	0.019 dB	Good compromise between edge steepness ar sidelobe suppression	
Normal Gate (Hann)	32 dB	0.032 dB	Good compromise between edge steepness and sidelobe suppression	
Maximum Flat- ness (Bohman)	46 dB	0 dB	Maximum attenuation of responses outside the gate span	
Arbitrary Gate Shape (Dolph- Chebychev)	User defined between 10 dB and 120 dB	0.071 dB	Adjustment to individual needs; tradeoff between sidelobe suppression and edge steep- ness	

Table 3-16: Properties of time gates


User Manual 1173.9163.02 - 13

#### **Time-Gated Frequency Domain Trace**

The trace in the frequency domain depends on the state of the "Time Gate":

- If the gate is disabled, the frequency domain (FD) trace corresponds to the measured sweep results prior to the time-domain transformation.
- If the gate is enabled, the displayed frequency domain trace is calculated from the time domain (TD) trace which is gated and transformed back into the frequency domain.

The analyzer uses fixed "No Profiling (Rectangle)" window settings to transform the measured trace into time domain. The TD trace is gated using the selected time gate. The gated trace is transformed back into frequency domain using a "No Profiling (Rectangle)" window.

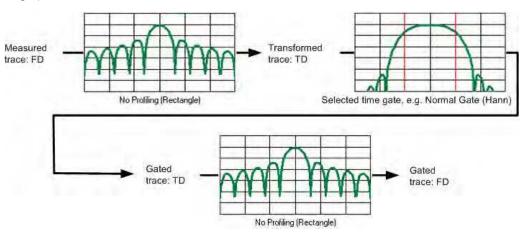

The shape, width and position of the time gate affect the gated frequency domain trace. The window type selection in the "Define Transform" dialog is ignored. The selected window is used again when the TD trace is displayed ("Time Domain: On").


The rectangular "No Profiling (Rectangle) "windows minimize numerical inaccuracies near the boundaries of the measured frequency span. In the limit where the effect of the time gate vanishes (e.g. a gate of type "Notch" and a very small width), the time gated trace is equal to the original measured trace.

# 3.7.2 Frequency Conversion Measurements (R&S ZNB-K4/-K14)

With option R&S ZNB-K4, the frequencies, source powers and receiver levels of the analyzer test ports can be configured independently. The source and receive frequencies of the ports are always equal. Arbitrary port settings represent a major extension to the analyzer's measurement functionality; in particular they allow you to perform measurements on frequency-converting DUTs.

The following figure shows a transmission measurement on a mixer.

**Optional Extensions and Accessories** 

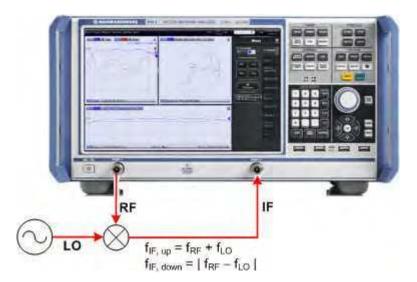

To perform the measurement, the port frequencies must be set appropriately. In the port configuration table ("CHANNEL > CHANNEL CONFIG > Port Config > Port Settings... > Arb Frequency"), the (source) frequency of Port 1 is set to the desired RF frequency (here: the channel base frequency/sweep range  $f_b$ ). An external generator provides a fixed stimulus signal at 1 GHz. To measure the up-converted IF signal, the (receive) frequency at Port 2 is set to  $f_b$  + 1 GHz. Independent source powers for Port 1 and Gen1 may be configured in addition, if so desired.

#	Info	RF Off	Gen	Freq. Conversion		Frequency Result
Port 1	ZNB8	F		fb	(aire)	1 GHz 3 GHz
🔵 Port 2	ZNB8	F		fb + 1 GHz		2 GHz 4 GHz
Gen 1	SMR20	Г	E	1 GHz		1 GHz 1 GHz

In the example above, the transmission parameter  $S_{21}$  corresponds to the mixer's conversion gain.



#### **Option R&S ZNB-B2, Internal Second Source**

A four-port R&S ZNB with internal second source allows you to perform the mixer measurement outlined above (and many other measurements) without an additional external generator. The signal of the first internal source is fed to the analyzer ports Port 1 and Port 2, the signal of the second source is fed to Port 3 and Port 4.

To obtain independent RF and LO signals, make sure that they originate from different port groups. E.g. you can use Port 1 and Port 3 as source ports for the RF and LO signals and measure the IF signal at Port 2.

If External Switch Matrices are part of the RF connection configuration, operation with Internal Second Source is *not* supported.

### 3.7.2.1 Calibration Options

In arbitrary mode, the R&S ZNB automatically calibrates the source and receive frequency ranges of all ports, according to the frequency conversion settings in the "Port

Settings" dialog or in the dedicated configuration dialogs ("Mixer Meas", "Intermodulation Wizard").

- The SMARTerCal is the recommended calibration method for frequency conversion measurements.
- For measurements on non-linear DUTs, an additional scalar power calibration is recommended; for details refer to chapter 3.5.7, "SMARTerCal", on page 98.
- A load match correction (optional) involves an additional reverse sweep. It can provide a significant improvement of the transmission S-parameter measurements if the load ports are poorly matched.

Select the appropriate correction type according to your accuracy and speed requirements. Notice that none of the correction types provides the phase information for transmission S-parameters.

#### 3.7.2.2 Scalar Mixer Measurements (with option R&S ZNB-K4)

Scalar Mixer measurements are included in option R&S ZNB-K4.

RF mixers convert an RF signal at one frequency into a signal at another frequency. The frequency that is to be shifted is applied at the RF input and the frequency shifting signal (from a local oscillator, LO) is applied to the RF mixer's LO port, resulting in an output signal at the mixer's Intermediate Frequency (IF) port. For a given RF signal, an ideal mixer would produce only two IF outputs: one at the frequency sum of the RF and LO (IF = RF + LO), and another at the frequency difference between the RF and LO (IF = IRF - LO|). Filtering can be used to select one of these IF outputs and reject the unwanted one.



#### Meaning of S-parameters

The frequency-converting property of the mixer (i.e. the fact that incident and transmitted waves are at different frequencies) causes a loss of phase information. While a scalar measurement is active, the reverse transmission parameter  $S_{12}$  is unavailable; the magnitude of the forward transmission parameter  $S_{21}$  describes the conversion gain. The conversion gain measurement can be improved by a source match (included in the SMARTerCal) and load match correction (optional). The phase information, including the group delay, is meaningless.


In the scalar mixer mode the analyzer provides the following functionality:

- Configuration of the RF and LO signals and measurement of the generated IF signal.
- System error correction and power calibration of the signal sources and of the IF receiver. A SMARTerCal is recommended for this purpose; see chapter 3.7.2.1, "Calibration Options", on page 118.
- The mixer mode can be used to test important performance parameters of RF mixers such as frequency ranges, conversion loss, compression, and isolation.

#### **Two-Stage Mixer Measurements**

The scalar mixer measurement is also suited for measuring a system of two mixers with frequency multipliers at their RF and LO inputs. The RF and LO input frequencies of the

first mixer are both multiplied by an integer fraction; the converted output signal  $f_{int}$  is fed to the second mixer, together with the multiplied second LO signal. The analyzer measures the output signal of the second mixer at its IF input port. The general test setup is shown below; the mixer system under test (MUT) is enclosed in a blue rectangle.

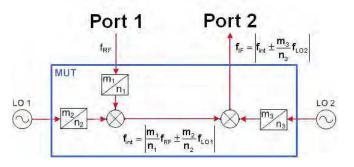


The figure above also shows the possible output frequencies of the two mixers. The actual values of  $f_{int}$  and  $f_{IF}$  depend on the RF and LO frequencies and of the measured conversion (lower sideband or upper sideband with up- or down-conversion). The analyzer automatically calculates all frequencies and sets its receiver according to the settings made.

A test setup with two mixers requires 3 independent source ports plus one receive port. An R&S ZNB with 4 ports and option ZNB-B2 (Internal Second Source) requires one external generator. An R&S ZNB with 4 ports but without option R&S ZNB-B2 requires two external generators.

A standard mixer measurement with a single mixer stage and no frequency multipliers corresponds to the figure above with the second mixer and LO 2 omitted and  $m_1 = n_1 = m_2 = n_2 = 1$ .

#### **Mixer Diagrams**

The mixer signal diagrams show the parameters of the mixer input signals (RF, LO) and of the mixing product (IF signal, output).

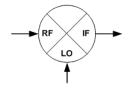


- The RF signal is the stimulus signal that the analyzer generates with the current channel settings. After a reset the frequency and power of the RF signal is as defined in the Channel – Stimulus menu. The RF signal parameters can be changed in the "Power" and "Frequencies" dialogs.
- The Local Oscillator (LO) signal is an additional RF signal that is either generated by the network analyzer (at one of the ports that are not used for the RF and IF signals) or by an external generator. A test setup with two mixers involves two independent LO signals at both mixers.
- The IF signal is the mixer output signal (mixing product), which is at one of the following conversion frequencies: IF = LO + RF or IF = |LO – RF|, i.e. LO – RF (for LO > RF) or IF = RF – LO (for RF > LO). The IF frequency is selected in the "Frequen-

cies" dialog. A test setup with two mixers involves two independent conversion settings.


The signal description above with the swept RF signal and the LO signal at a fixed frequency corresponds to the default configuration. In the "Frequencies" dialog, you can select any of the signals as a "Sweep/CW" signal. You can set the frequency range for this signal via "Start/Stop" or "CW Frequency". A second signal is at a "Fixed" frequency, and the third at the calculated sum or difference frequency ("Auto").

The labeling of the complete diagrams depends on the sweep type.

The following mixer signal diagram corresponds to a frequency sweep:

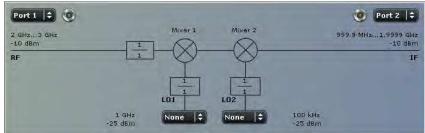


- RF signal (left side): Analyzer port number (e.g. Port 1), frequency sweep range (or fixed frequency, if the LO signal is swept), CW power, frequency conversion settings (1 / 1 denotes no conversion).
- LO signals (1 or 2, from below): Signal source (analyzer port or external generator), fixed power and frequency (or frequency sweep range, if the RF signal is at fixed frequency), frequency conversion settings.
- IF signal (right side): Analyzer port number (e.g. Port 2), frequency range = (sweep range + LO) or |sweep range – LO|, expected fixed power.
- The following mixer signal diagram corresponds to a power sweep:

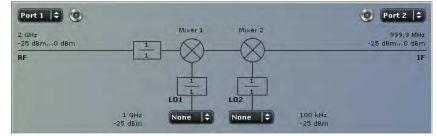

- RF signal (left side): Analyzer port number (e.g. Port 1), power sweep range or fixed power, CW frequency, frequency conversion settings (1 / 1 denotes no conversion).
- LO signals (1 or 2, from below): Signal source (analyzer port or external generator), fixed power or power sweep range, CW frequency, frequency conversion settings.
- IF signal (right side): Analyzer port number (e.g. Port 2), fixed frequency = (RF + LO) or |RF LO|, expected power range.
- The following mixer signal diagram corresponds to a **Time or CW mode sweep**:

User Manual 1173.9163.02 - 13

**Optional Extensions and Accessories** 

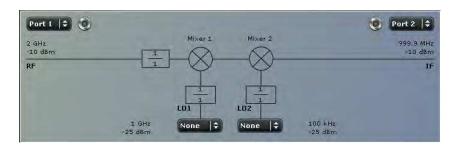

- RF signal (left side): Analyzer port number (e.g. Port 1), fixed power, CW frequency, frequency conversion settings (1 / 1 denotes no conversion).
- LO signals (1 or 2, from below): Signal source (analyzer port or external generator), fixed power, CW frequency, frequency conversion settings.
- IF signal (right side): Analyzer port number (e.g. Port 2), fixed frequency = (RF + LO) or |RF LO|, expected fixed power.



The ports in the mixer signal diagrams are physical ports. To measure mixers with differential inputs, define a logical port configuration and enter one of the physical ports that belong to the logical port. The analyzer will implicitly account for the logical port settings.

#### 3.7.2.3 Intermodulation Measurements (R&S ZNB-K14)

The intermodulation measurement requires options R&S ZNB-K14 and ZNB-K4. The "Intermodulation Wizard" facilitates the measurement configuration and selection of results (see chapter 4.4.4.8, "Channel Config > Intermod", on page 372).


An intermodulation measurement is performed with two RF signals of equal power but different frequencies termed the upper and lower tone. The purpose of the measurement is to test the properties of a DUT that is supplied with a signal that covers a frequency band, typically a modulated RF channel. To simulate this scenario, the frequency difference ("tone distance") between the upper and lower signal is chosen to be small compared to the frequencies of the two tones:

 $f_L \approx f_U \text{ or } \Delta f = f_U - f_L \ll f_L$ 

A nonlinear behavior of the DUT causes emissions at frequencies which correspond to sums and differences of the upper and lower tone frequencies and their integer multiples. These intermodulation products can be in the vicinity of the upper and lower tone frequencies, provided that their order is odd.


The analyzer measures the intermodulation products of  $k^{th}$  order IMk (where k = 3, 5, 7, 9) at the lower tone frequency minus (k – 1)/2 times the tone distance and at the upper tone frequency plus (k – 1)/2 times the tone distance; see also "Intermodulation Measurement Results" on page 124. For a two-port R&S ZNB analyzer, a test setup with an external generator and a combiner is required.

**Optional Extensions and Accessories** 

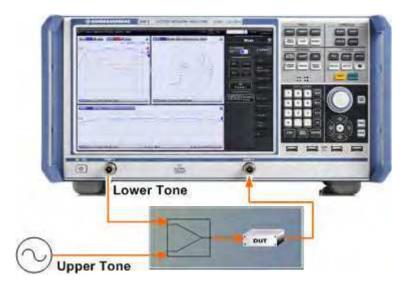

The lower tone signal is generated at port 1, the upper tone is provided by the external generator. Both signals are combined externally and fed to the DUT input. The intermodulation quantities can be measured at the DUT output (transmitted wave b2). It is possible to interchange the ports no. 1 and 2.

With a four-port R&S ZNB that is equipped with an Internal Second Source (option R&S ZNB-B2), you can use any combination of analyzer ports that are supplied by different internal sources (see "Option R&S ZNB-B2, Internal Second Source" on page 118) to generate the lower and upper tones. In the following example, port 3 replaces the exernal generator; an external combiner is still required.

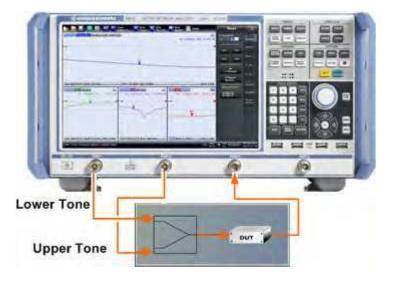

A

Operation with Internal Second Source is *not* supported if External Switch Matrices are part of the RF connection configuration.

The intermodulation distortion measurement can be extended to frequency-converting DUTs. E.g. it is possible to feed the two-tone source signal to the RF input of a mixer and


 Image: Contract of the second seco

measure the intermodulation distortion of the IF output signal, after conversion with an additional LO signal.

#### Intermodulation Measurement Results


The intermodulation measurement provides two different types of results:

• In the swept measurement, the analyzer performs a frequency or power sweep of the two-tone stimulus signal and displays the selected intermodulation quantities as a function of the lower-tone frequency or power.

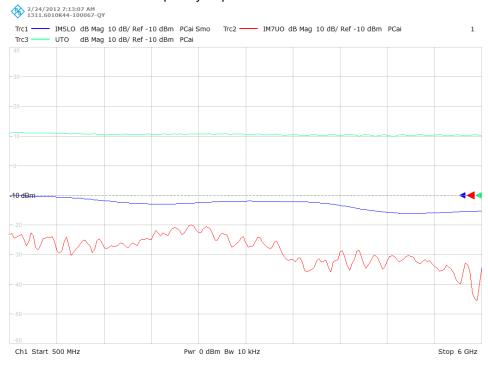

User Manual 1173.9163.02 - 13

• In the intermodulation spectrum measurement ("CW Mode Spectrum"), the frequency and power of the lower and upper tones is kept constant; the analyzer displays all intermodulation products in the vicinity of the signals up to a selectable order.

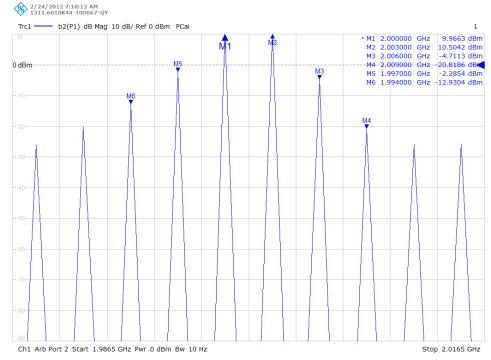

#### Intermodulation Quantities

A nonlinear DUT that is supplied with a two-tone signal with the lower/upper frequencies  $f_L$  and  $f_U$  causes emissions at frequencies which correspond to sums and differences of the upper and lower tone frequencies and their integer multiples:

 $f_U - f_L, f_U + f_L, 2^* f_U - f_L, 2^* f_U + f_L, f_U + 2^* f_L, 2^* f_L - f_U \dots$ 

The order of these intermodulation products is defined by the number of  $f_L$  and  $f_U$  terms. The analyzer measures the intermodulation products of k<sup>th</sup> order IMk (where k = 3, 5, 7, 9) at the lower tone frequency minus (k – 1)/2 times the tone distance and at the upper tone frequency plus (k – 1)/2 times the tone distance. Intermodulation products can be measured at the DUT output (transmitted wave  $b_n$ ).

The intermodulation suppression IMk<sub>rel</sub> is the ratio of the power of an intermodulation product to the power of the lower tone fundamental wave in dB, measured at the DUT output.

For each intermodulation product, an output intercept point IPkout is defined as follows:

$$IPk_{out} = P_{L,out} + IMk_{rel} / (k - 1)$$

In this formula,  $P_{L, out}$  denotes the lower tone power in dBm, measured at the DUT output. In analogy, the input intercept point IPk<sub>in</sub> is defined as:

$$IPk_{in} = P_{L,in} + IMk_{rel} / (k - 1)$$

The intermodulation suppression generally decreases with increasing stimulus power. The intercept point is equal to the lower tone power for which the intermodulation suppression would reach 0 dB. Output and input intercept point differ by the attenuation of the lower tone signal upon transmission through the DUT. The intercept point is a mathematical concept. For most DUTs, it is beyond the nominal power operating range.



#### Filter settings

Intermodulation measurements require frequency-selective filter settings. When an intermodulation result is selected, the analyzer checks whether the IF bandwidth of the active channel is 1/100 of the distance between the upper and the lower tone ("Tone Distance") or less. If not, the analyzer displays a tooltip.

Selectivity is automatically set to high, but can be changed manually.

# 3.7.3 Bias Tees (R&S ZNB-B1)

The hardware option R&S ZNB-B1, "Bias Tees", provides two or four additional BNC inputs labeled BIAS 1 ... 4 (for two-port or four-port R&S ZNB analyzers). The inputs can be used to apply an external DC voltage (bias) to the test ports. The bias tees have an impact on the start frequency of the network analyzers; for details refer to the data sheet and to [SENSe:] Commands.

### 3.7.4 Internal Second Source (R&S ZNB-B2)

The hardware option R&S ZNB-B2, "Internal Second Source", is available for four-port network analyzers R&S ZNB4 and R&S ZNB8. If the option is installed, the signal of the first internal source is fed to the analyzer ports Port 1 and Port 2, the signal of the second source is fed to Port 3 and Port 4. The second source signal can be used as an additional stimulus signal, e.g for mixer measurements; see chapter 3.7.2, "Frequency Conversion Measurements (R&S ZNB-K4/-K14)", on page 117.

Operation with Internal Second Source is *not* supported, if External Switch Matrices are part of the RF connection configuration.

## 3.7.5 OCXO Frequency Reference (R&S ZNB-B4)

The hardware option R&S ZNB-B4, "OCXO Frequency Reference", improves the static frequency accuracy of the R&S ZNB. For details refer to the data sheet.

## 3.7.6 GPIB Interface (R&S ZNB-B10)

The hardware option R&S ZNB-B10, "GPIB Interface", provides a GPIB bus connector according to standard IEEE 488 / IEC 625. The GPIB interface is mostly intended for remote control purposes and for the connection of external devices, e.g. power meters. For details refer to chapter 9.1.3, "GPIB Interface", on page 924.

# 3.7.7 Handler I/O (Universal Interface , R&S ZN-B14)

A network analyzer which is equipped with option R&S ZN-B14, Handler I/O (Universal Interface), can interact with an external part handler. The digital control signals on the interface connector indicate the possible start and the end of a measurement, as well as a global limit check result. Typically, the handler will insert the device to be tested into a test fixture, provide a trigger pulse to initiate the measurement, remove and replace the device after the measurement is complete and sort it into pass/fail bins. For details refer to chapter 9.1.4, "Universal Interface", on page 928.

# 3.7.8 Receiver Step Attenuators (R&S ZNB<n>-B31/32/33/34)

Receiver step attenuators are used to adjust the received signal levels to the input level range of the analyzer in order to avoid damage to the instrument, e.g. if the DUT is a power amplifier. The attenuation values can be set betweeen 0 dB and 30 dB (in 10 dB steps); see "Step Attenuators" on page 258. The following step attenuators are available.

Analyzer type	Port 1	Port 2	Port 3	Port 4
R&S ZNB4	R&S ZNB4-B31	R&S ZNB4-B32	R&S ZNB4-B33	R&S ZNB4-B33
R&S ZNB8	R&S ZNB8-B31	R&S ZNB8-B32	R&S ZNB8-B33	R&S ZNB8-B33

# 3.7.9 DC Inputs (R&S ZNB-B81)

The hardware option R&S ZNB-B81 provides four rear panel connectors labeled DC INPUT 1 ... 4 which can be used for DC measurements in different voltage ranges. The DC inputs are also needed for the measurement of the Power Added Efficiency (PAE).

#### 3.7.9.1 Power Added Efficiency


The Power Added Efficiency (PAE) is the ratio of the added RF power generated by an active two-port device (e.g. an amplifier) to the supplied DC power  $P_{DC}$ . The added RF power can be expressed as the difference between the power of the outgoing wave  $b_m$  at the output of the DUT and the power of the incident wave  $a_n$  at the input of the DUT; hence:

$$PAE = \frac{|b_m|^2 - |a_n|^2}{P_{DC}}$$

Positive PAE values indicate a gain in the RF power, negative values an attenuation. The PAE is always smaller than 1.

The PAE measurement is based on the standard test setup for forward S-parameter measurements on a 2-port DUT. An additional measurement to determine the supplied power  $P_{DC}$  is required.

**Optional Extensions and Accessories** 

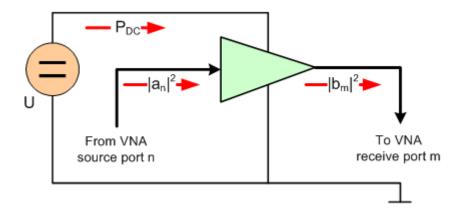

### **DC** power measurement

The DC power  $P_{DC}$  supplied to the DUT can be measured using one or two of the four DC inputs DC INPUT 1...4 at the rear panel (option R&S ZVBx-B81). The Power Added Efficiency dialog suggests different measurement types involving different test setups. The measurement types depend on the properties of the DC power supply (constant current I<sub>0</sub> or constant power U<sub>0</sub>) and an optional precision resistor R used to measure the DC current. Depending on the measurement type, one or two of the values I<sub>0</sub>, U<sub>0</sub>, and/or R must be entered as parameters of the PAE calculation.


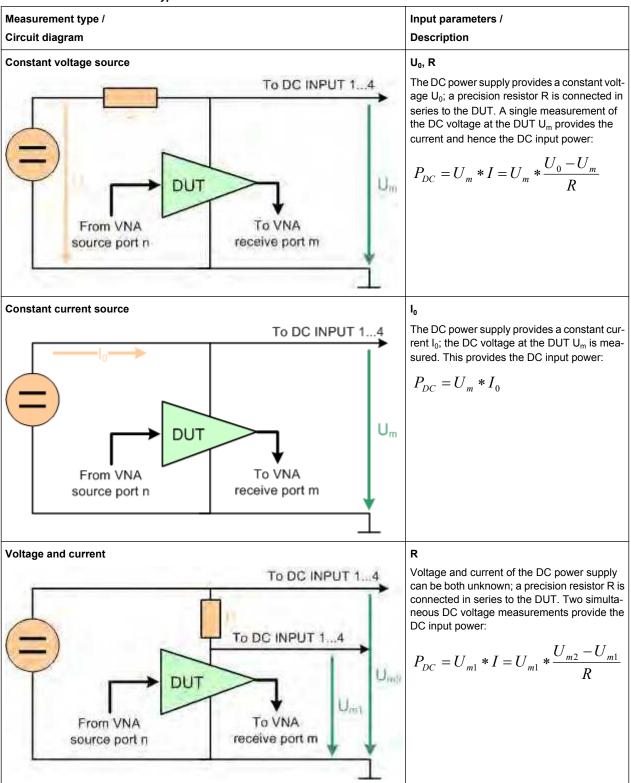


Table 3-17: PAE measurement types


### 3.7.10 External Power Meters

The connection of an external power meter to the R&S ZNB can serve different purposes.

 Extended measurement functionality: Each external power meter represents an additional receive port. External generators increase the number of RF output signals of a DUT that the analyzer can measure simultaneously. They can also provide accurate results for signals at inaccurate or unknown frequencies. A typical example is a mixer measurement with an unknown LO signal (and therefore unknown IF output frequency).

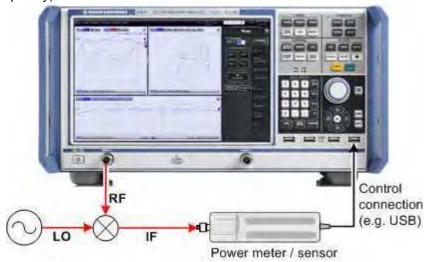

 Power calibration: An external power meter can measure the exact signal power at an arbitrary point in the test setup (reference plane) and thus provide the reference values for a power calibration. A typical example is a source power calibration for an arbitrary analyzer port.

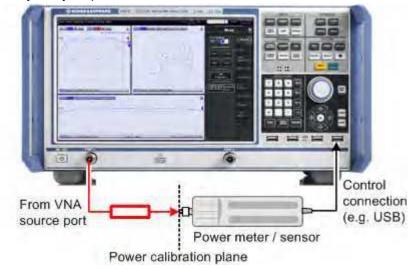

External power meters must be configured with their connection type and device address before they are available as additional receivers ("SYSTEM SETUP > External Devices > Power Meters"). Configured power meters appear in many control elements of the R&S ZNB, e.g. in the in the port configuration and in the power calibration dialogs.

# www.valuetronics.com

#### Zeroing

Zeroing calibrates the external power meter by adjusting its reading at zero signal power. For this purpose, the RF cable between the analyzer and the power sensor must be disconnected (see tips below!). R&S power sensors and power meters automatically detect the presence of any significant input power. This aborts zeroing and generates an error message. Zeroing can take a few seconds, depending on the power meter model; refer to the documentation of your external power meter for more information.



#### Repeat zeroing

- During warm-up after switching on or connecting the instrument
- After a substantial change of the ambient temperature
- After fastening the power meter to an RF connector at high temperature
- After several hours of operation
- When very low-power signals are to be measured, e.g. less than 10 dB above the lower measurement limit.

A reset of the network analyzer does not affect the last zeroing result.

### 3.7.11 External Generators

The connection of an external generator to the R&S ZNB can serve different purposes.

 Extended measurement functionality: Each external generator represents an additional source port. External generators increase the number of RF input signals for the DUT. A typical example is a mixer measurement with a 2-port analyzer, where an external generator provides the LO input signal.

**Optional Extensions and Accessories** 

**R&S® ZNB** 



 Power calibration: An external generator can provide the reference signal for a source or receiver calibration. A typical example is a receiver power calibration using a measured wave b<sub>1</sub>.



External generators must be configured with their connection type and device address before they are available as additional sources "SYSTEM SETUP > External Devices > Generators". Configured generators appear in many control elements of the R&S ZNB,

e.g. in the in the "More Ratios", "More Wave Quantities", port configuration and power calibration dialogs.

#### **Reference frequency**

To ensure frequency accuracy and frequency stability in a test setup where different devices represent the signal sources and receivers, it is generally advisable to use a common reference frequency. Accurate frequencies are particularly important if external generators are used for measurements with narrow measurement bandwidths.

A common reference frequency can be established in different ways:

- Use the analyzer as master device: Set the analyzer to "Internal" frequency reference ("SYSTEM > SETUP > Freq. Ref. > Internal") and operate all other devices in external reference mode using the reference clock signal from the REF OUT connector on the analyzer's rear panel.
- Use another device as master: Set the analyzer to "External" frequency reference and synchronize it (and all other devices) to the master's reference clock signal, fed in at the REF IN connector on the analyzer's rear panel.

#### Fast sweep mode and conditions

In list mode the external generator steps through a predefined list of frequencies or signal powers. This mode can be used to accelerate the measurements involving external generators. If "Fast Sweep" is activated in the "External Generators" dialog, the analyzer compiles a list of the stimulus values (frequencies and powers) in all channels and transfers it to the generator. The list is automatically updated and re-transferred whenever the channel settings are changed.

The analyzer uses a trigger handshake mechanism in order to control the generator's list mode:

- The generator sends an EXT GEN BLANK signal to pin no. 22 of the USER PORT connector on the rear panel of the analyzer to show that it is ready to step to the next frequency or power value in the list.
- The analyzer transmits an EXT GEN TRG signal at pin no. 21 of the USER PORT connector in order to switch the generator to the next point in the list. Afterwards the analyzer waits for the next EXT GEN BLANK signal.

If the USER PORT connection is interrupted during the measurement, the sweep is halted. It is continued after a "Restart Sweep".



If the number of sweep points exceeds the maximum number of entries in the list (depending on the generator type), the analyzer must interrupt the sweep in order to send a new list and complete the stimulus information. This generally slows down the measurement.

# www.valuetronics.com

#### Measurement process for external generators

The measurement process for **external generators** "Gen 1", "Gen2" ... differs from the measurement process for internal source ports:

- An external generator always represents a permanent signal source that is switched on for all partial measurements. In contrast, an analyzer port is switched off for partial measurements that do not require a source signal.
   Exception: Internal ports can be configured as permanent sources; see "Gen" setting in the "Define Arbitrary Frequency" dialog ("CHANNEL > CHANNEL CONFIG > Port Config > Arbitrary Frequency...").
- The external source is measured in the first partial measurement where an internal source is active. This means that no separate partial measurement for the external generator signal is needed. If no internal source is needed at all, the external source is measured in the first partial measurement.

### 3.7.12 External Switch Matrices

#### 3.7.12.1 Overview

The purpose of switch matrices is to extend the number of test ports, i.e. to convert an M-port network analyzer into an N-port network analyzer (N>M) without modifying the instrument itself.

Switch matrix R&S ZV-Z81 variant 9, for example, offers 2 VNA ports and 9 test ports ("2 to 9 matrix") and allows to through-connect its 2 VNA ports to any pair of test ports.

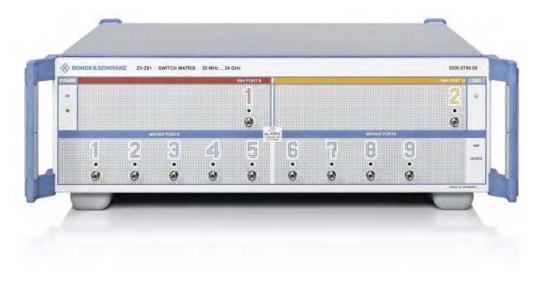


Fig. 3-1: Switch Matrix R&S ZV-Z81 variant 9

**Optional Extensions and Accessories** 



While it is allowed to connect multiple matrices to a R&S ZNB, matrix cascading is **not** supported.

Operation with Internal Second Source (R&S ZNB-B2) is *not* supported across switch matrices.

However, an M-port analyzer is always limited to measuring M signals simultaneously, i.e. during stimulation by the active test port, even though the DUT is fully connected to the switch matrix, it may not be possible to measure all b-waves simultaneously. For example, consider a DUT with 8 unbalanced ports, connected to a 2-port analyzer via the 2 to 9 matrix presented above. For each stimulus port, 7 sweeps are required to measure the resulting b-waves,  $8 \cdot 7 = 56$  sweeps in total. For "real" 8-port analyzers, a single sweep per driving port is sufficient.

Furthermore, each additional sweep requires at least one matrix switching procedure. This involves command processing and physical switching and hence might take some time to complete. For mechanical switches (such as R&S ZV-Z81 variant 66), in particular, switching is quite slow and causes mechanical wear. To optimize the measurement setup w.r.t. speed and resources, the characteristics of the available switch matrices have to be taken into account.

#### 3.7.12.2 Matrix Setup and Operation

Setting up one or more switch matrices typically involves the following steps:

- register the matrices (as managed objects), i.e. configure them into the pool of available devices
- 2. define the RF configuration:
  - a) configure the matrix-VNA-connections according to the existing (or planned) physical connections between VNA test ports and matrix VNA ports
  - assign the matrix test ports and the remaining VNA ports (i.e. those that are not connected to a matrix VNA port) to DUT test ports

After this initial setup, the R&S ZNB takes control of the attached matrices: it allows to configure the test ports and dynamically establishes the required matrix through-connections according to the current measurement task.



To make a measurement, setup a channel where all unused logical ports are disabled.

Switch matrices are global resources: their configuration is not part of a recall set. However, a recall set will contain information about the required matrices and their RF connections. At the time the recall set is loaded, the R&S ZNB checks whether the same matix setup is still active. If not, a wizard will guide the user through the matrix configuration.


#### 3.7.12.3 RF Connections and Matrix Connectivity

Depending on the design of the switch matrix and the RF connections between VNA and matrix

- certain matrix test ports may not be available for measurements
- certain transmission measurements may not be possible

#### Example:

Variant 10 of switch matrix ZV-Z82 consists of 2 separate 2 to 5 submatrices, where the matrix VNA ports of the "left" submatrix cannot be connected to the test ports of the "right" submatrix and vice versa. If none of the two VNA ports of a submatrix is connected, obviously no connection between the VNA and the submatrice's test ports can be established and hence neither reflection nor transmission measurements are possible.

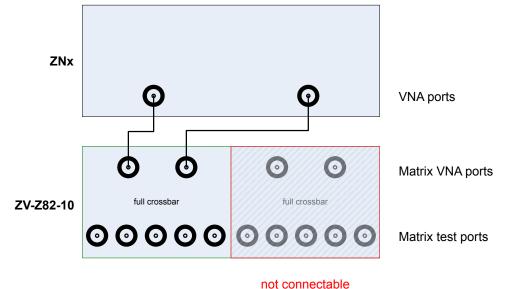

not connectat

Fig. 3-2: ZV-Z82-10: unconnected "right" submatrix

With the same switch matrix type, connecting one of two submatrix VNA ports enables reflection measurements for the corresponding matrix test ports. However, as long as a second connection between the VNA and this submatrix is missing, "intra-submatrix" transmission measurements are still impossible.

# www.valuetronics.com

**Optional Extensions and Accessories** 

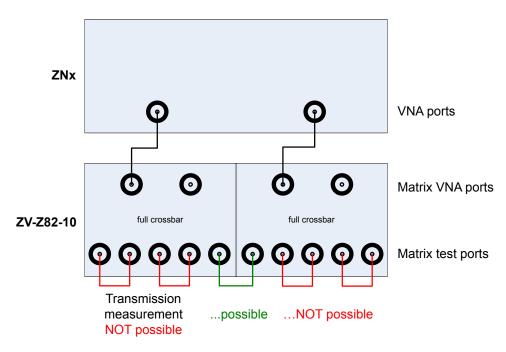


Fig. 3-3: ZV-Z82-10: partially connected submatrices

Basically the same argument holds true for variant 16 of switch matrix ZV-Z82, which consists of 4 separate 1 to 4 submatrices and that allows "inter-" but no "intra-submatrix" transmission measurements.

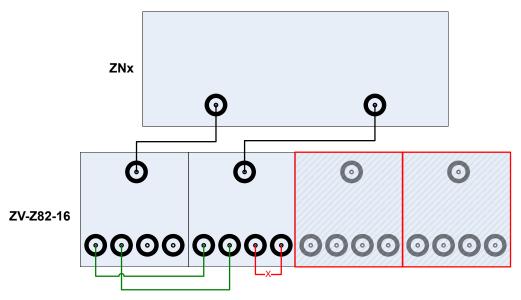


Fig. 3-4: ZV-Z82-16: limited connectivity

On the other hand, a switch matrix may offer multiple routes to a given matrix test port and hence measurements may be performed using different physical paths (where a *path* consists of the traversed VNA connections and matrix routes).

**Optional Extensions and Accessories** 

#### Example:

For switch matrix ZV-Z82-09 every test port can be reached via two different routes:

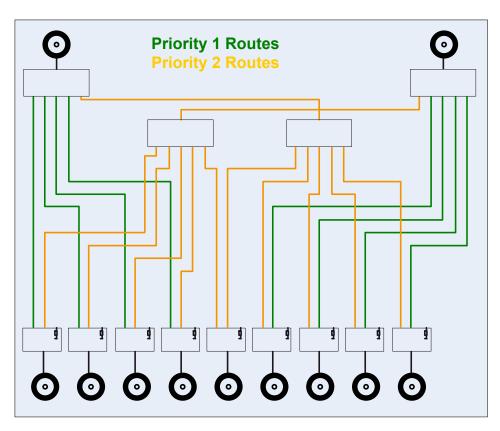


Fig. 3-5: ZV-Z81 Routes and priorities

These paths may have different characteristics - in particular if the corresponding matrix routes differ in the number of semiconductor or mechanical switching functions that have to be traversed (the rectangles in figure 3-5).



See the datasheet of the respective switch matrix for details on the available routes.

#### 3.7.12.4 Multiple Paths: Precision vs. Speed

For every supported switch matrix, the available routes are prioritized according to the number of switches they traverse (the rectangles in figure 3-5).

- To obtain highest measurement *precision*, the driving port should always use the "best possible" (highest priority) route. On the other hand this may cause additional matrix switching procedures and hence may result in a reduced measurement speed.
- If the focus is on measurement *speed*, the number of matrix switching procedures should be minimized, disregarding a possible loss in measurement precision.

User Manual 1173.9163.02 - 13

# www.valuetronics.com

As the fundamental trade-off between precision and speed cannot be resolved, the R&S ZNB allows to select which optimization should be performed.


### 3.7.12.5 Multiple Paths and Calibration




With switch matrices a signal loss of up to 25 dB is possible, so (full) calibration is a must! For a high number of test ports manual calibration is time-consuming and error-prone, so automatic calibration (with auto-detection) is recommended

During calibration, correction data are determined for all possible paths from the VNA to the related test ports. For the currently supported matrices a maximum of 2 paths per test port are available, resulting in a maximum of

2 paths per reflection measurement

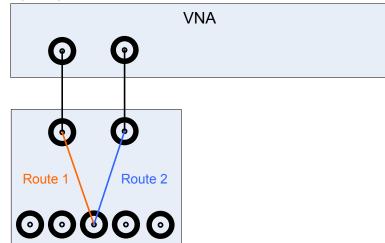


• 2 paths per transmission measurement for a 2-port VNA:

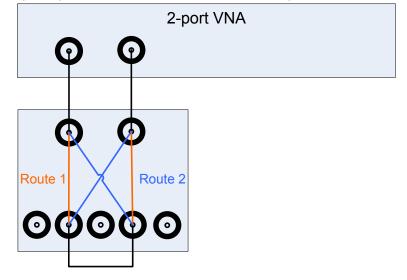

4 paths per transmission measurement for an N-port VNA with N≥4

**Optional Extensions and Accessories** 

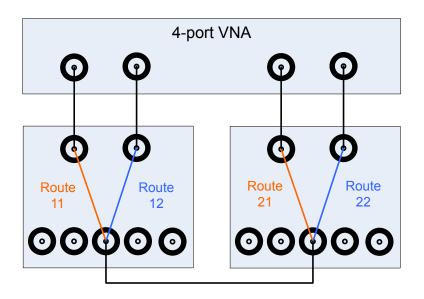

A

This kind of "multipath calibration" offers the following additional benefit:

During manual calibration the measured reflection/transmission coefficients are presented as memory traces - one per path. By comparing these traces, it should be possible to track down hardware problems (cables, connectors, matrix, ...) already during calibration.

# 4 GUI Reference

This chapter explains all functions of the analyzer and their application. It is organized according to the menus of the Graphical User Interface (GUI).

The topics in this chapter can be called up directly using the HELP key or the Help buttons in the dialogs. A link at the end of each function description leads to the corresponding remote control command.

For a general overview of the analyzer's capabilities and their use refer to chapter 3, "Concepts and Features", on page 12.

## 4.1 File Settings

The "File" menu provides standard Windows<sup>®</sup> functions to create, save, recall or print recall sets, to copy the active screen and to shut down the application.

### 4.1.1 File > Recall Sets

A **recall set** comprises a set of diagrams with all displayed information that can be stored to a VNA recall set file (\*.znx).

- The "Display" commands arrange different windows on the screen.
- The "File" commands organize recall sets.

The relation between global settings, recall sets, channels and traces is described in chapter 3.1, "Basic Concepts", on page 12.

Access: SYSTEM > FILE key or Ctrl + O



#### 4.1.1.1 Basic Recall Set Functions



To create a recall set based on the current analyzer configuration, select "Save". To open an existing recall set, select "Open Recall".

#### New

Creates a new recall set. The default names for recall sets are "Set1", "Set2" ... Recall sets are accessible via tabs in the diagram area:



Tip: To open an existing recall set, use "Open Recall...". To rename a setup, use "Save..."

SCPI command: MEMory: DEFine

#### **Open Recall**

Loads an existing recall set from a file. The analyzer opens a dialog box to select the file from all VNA recall set files (\*.znx) stored on the file system; see Recall dialog. The opened recall set replaces the active recall set.

SCPI command:

MMEMory:LOAD:STATe

#### **Recall dialog**

My Computer	Name	¥	Size	ין	Гуре	Date Modi	Windows Explorer
jetter HardCopy	Extended S-parameters.znx Set1.znx				nx File nx File	15.12.22 21.12.21	
		Í				3	

Specifies the name and location of a particular file (e.g. a VNA recall set file) to open:

- "Look in:" specifies the drive and directory in which the file to open is stored. The
  icons to the right of the pull-down list are provided for easy navigation in the file system
  (place the cursor on the icons to obtain "What's this?" help).
- "File name:" specifies a file name (e.g. a recall set file, \*.znx) to open. The file can be selected by tapping on the directory overview above.
- "Files of type:" selects a particular file type (e.g. recall set files, \*.znx) to be displayed in the directory overview.
- "Open" opens selected file and closes the dialog.
- "Cancel" closes the dialog without opening a recall set file.
- "Windows Explorer" opens the selected directory in Windows Explorer.

If the current setup includes External Switch Matrices and the recall set to be loaded does not contain a switch matrix configuration, recalling the setup will be aborted. You are requested to delete the configured RF connections (see chapter 4.6.12, "Switch Matrix RF Connections (Dialog)", on page 444) and to physically remove the switch matrix from the RF paths.



If the recall set to be loaded contains a switch matrix configuration and no differences to the current switch matrix configuration are detected, the recall set is loaded without further enquiry. Otherwise you are asked whether or not you want to adapt the configuration:



Select "Cancel" to abort the recall process or "OK" to open the Setup Recall Switch Matrix Configuration Dialog that will guide you through the required configuration changes.

#### Save

Saves and names the active recall set. The analyzer opens a dialog box to select a recall set file name (\*.znx) and location for the recall set file.

SCPI command:

MMEMory:STORe:STATe

#### Save dialog



Specifies the name and location of a particular file (e.g. a VNA recall set file) to save:

- "Look in:" specifies the drive and directory in which the data is stored. The icons to the right of the pull-down list are provided for easy navigation in the file system (place the cursor on the icons to obtain "What's this?" help).
- "File name:" specifies a file name to save the current data (e.g. the recall set). The analyzer adds the extension (e.g. \*.znx) in the "Files of type:" field.
- "Files of type:" selects a particular file type (e.g. recall set files, \*.znx) for the created file.
- "Save" saves the data (e.g. the active recall set) in the selected file and directory and closes the dialog.
- "Cancel" closes the dialog without saving the data.
- "Windows Explorer" opens the selected directory in Windows Explorer.

**Tip:** The "Save" dialog is used to store various data types (e.g. cal kit data, limit lines, sweep segment lists, ...). Depending on its use the dialog is opened with different file locations and file type filters. File locations (directories) are remembered when the dialog is closed. To restore default directories use the "Presets" tab of the "SYSTEM > SETUP > Setup > System Config" dialog. See chapter 4.6.2.1, "Presets", on page 422.

#### **Recent Files**

The buttons are labelled with the last recall sets which were stored in the current or in previous sessions. They open the corresponding recall set.

#### 4.1.1.2 Setup Recall Switch Matrix Configuration Dialog

When opening an existing recall set file it may be necessary to adapt the current system configuration to the switch matrix configuration of the recall set. The "Recall Switch Matrix Configuration" dialog guides you through this process.

File Settings

Matrix in Recall Set	Driver	Assigned Matri
V-Z81-05 (LAN, 10.10.10.10	) ZV-281-05	?
		?
east 1 Switch Matrix(es) of typ ess 'Switch Matrix' button. )	e ZV-Z81-05 must be a	dded to the actual configu

In the dialog proceed as follows:

1. **Reassign Matrices:** For each "Matrix in Recall Set", select a switch matrix of the same (driver) type as "Assigned Matrix".

	Matrix in Recall Set	Driver	Assigned Matrix	
Before you proceed, please adapt your Matrix RF Connections.	-281-05 (LAN, 10.10.10.10)	ZV-Z81-05	ZV-Z81-05 (LAN, 10.10.10.10)	
Before you proceed, please adapt your Matrix RF Connections.			ZV-Z81-05 (LAN, 10.10.10.1	
Before you proceed, please adapt your Matrix RF Connections.				
Before you proceed, please adapt your Matrix RF Connections.				
Before you proceed, please adapt your Matrix RF Connections. (Press button: 'View Matrix RF Connections'	4			
(Press button: 'View Matrix RF Connections'	_	_		
	Pofession proceed place ad	nt voue Mateix DE C		

If no switch matrix of the same type exists, tap "Switch Matrix" to open the External Matrices (Dialog) that allows you to register/configure additional switch matrices.

 Restore RF connections: The recall set's switch matrix configuration comprises the RF connections of the related switch matrices. This RF connection configuration will be loaded with the recall set, requiring you to adapt the physical RF connections accordingly.

For each "Matrix in Recall Set" select the corresponding row and tap "View Matrix RF Connections..." to view the respective matrix RF connections.



#### **Background information**

Refer to chapter 3.7.12, "External Switch Matrices", on page 134.

### View Matrix RF Connections...

This dialog presents the RF connections of a selected switch matrix as specified in the recall set you are about to load.

File Settings



It is a read-only version of the Switch Matrix RF Connections (Dialog) you can subsequently use to modify the actual configuration.

### 4.1.2 File > Print

The "File > Print" buttons allow to send the active recall set (i.e. the contents of the active diagrams) to an external printer, to a file or to the clipboard.

Access: SYSTEM > PRINT key or Ctrl + P



### Print (<Printer>)

Prints the active recall set using the current printer and printer settings.

#### SCPI command:

The HCOPy... commands provide the printer settings; see chapter 6.3.7, "HCOPy Commands", on page 633.

HCOPy[:IMMediate] initiates printing.

#### Print...

The "Printer Setup" dialog specifies how the active recall set is printed. Printer options are specified in three tabs. The lower part of the diagram shows a preview of the print.

File Settings

ntent print Charts	rinter Page Set		Print other In	
Active Diag	ram only		Setup Inf	o
Trc1	- S21 dB Mag	Trc2 — S	21 dB Mag 1	A bear
	- S21 dB Mag		21 dB Mag 1 GHz -999.0000, dB	Page Up Page Down
Trc1	- S21 dB Mag			Up Page
Trc1	- S21 dB Mag 1			Up Page Down
Trc1	- S21 dB Mag 1	M1 4.250050		Hp Page Down 1/1
Trc1	- S21 dB Mag 1	M1 4.250050		Up Page Down
Trc1	- S21 dB Mag	M1 4.250050	GHz -999.0000 dP	Page Down 1/1
Trc1	— S21 dB Mag	M1 4.250050	GHz -999.0000 db Stop 8.5 GHz	Pàge Dawn 1/1

#### Content ← Print...

The "Content > Print Charts" panel specifies how the diagrams of the active recall set are printed. Refer to the text in the dialog for a description. The "Marker" and "Setup Info" is printed on a separate page. The "Setup Info" provides a detailed list of the active channel and trace settings and information about the analyzer.

SCPI command:

The HCOPy... commands provide the printer settings; see chapter 6.3.7, "HCOPy Commands", on page 633.

### Printer ← Print...

The "Printer" settings select one of the installed printers and specify printer options. Printers can be installed using the "Start > Control Panel > Hardware and Sound > Devices and Printers" menu in the Windows<sup>®</sup> "Control Panel".

Content	Printer	Page Se	tup		
Printer				Print Options	Paper Source
	P-MU0589			Use Color	Manual
	P-MU0606	Ę.	*		O Automatic
	ff Fay R3				

#### SCPI command:

The HCOPy... commands provide the printer settings; see chapter 6.3.7, "HCOPy Commands", on page 633.

#### Page Setup ← Print...

The "Page Setup" settings are visualized in the preview page in the lower part of the dialog.

rientation	Header	Margins	
🔵 \Lambda Portrait	Logo	<b>Top</b> (25 mm	Left
O \Lambda Landscape	🔽 Date & Time	Bottom 25 mm	Right

**Tip:** The printer settings are not affected by a preset of the R&S ZNB. Use the "Remote" tab in the "System Configuration" dialog ("SYSTEM > SETUP > Setup > System Config...") to restore default settings.

SCPI command:

The HCOPy... commands provide the printer settings; see chapter 6.3.7, "HCOPy Commands", on page 633.

#### To File...

The "Save Image" dialog selects a file and file format to store the current diagrams. See also "Save dialog" on page 145.

SCPI command: HCOPy:DESTination

#### To Clipboard

Copies the current diagram to the clipboard from where you can paste it into another application.

### 4.1.3 File > Trace Data

Imports and exports trace data. The settings are identical with the "TRACE > TRACE CONFIG > Trace Data" settings; see chapter 4.2.4, "Trace Config Settings", on page 192.

#### 4.1.4 File > More

The "File > More" buttons load simulation data or close the VNA application.

Access: SYSTEM > FILE key or Ctrl + O

File	
Load Simulation Data	Recall Sets
Exit	Print
	Trace Data
	More

User Manual 1173.9163.02 - 13

# www.valuetronics.com

#### Load Simulation Data...

Imports previously stored trace data into the active diagram. The analyzer opens a dialog box to select the file from all trace files (\*.s?p, \*.csv, \*.dat) stored on the file system; see Recall dialog. The opened trace replaces the active trace.

#### Exit

Saves the active recall set and ends the analyzer session. The active recall set is automatically recalled when the analyzer application is re-started.

**Tip:** This button is equivalent to the "Close" command on the application "Control" menu (see chapter 4.9, "Control Menu", on page 451) and to the close icon **⊠** in the title bar.

### 4.2 Trace Settings

The "Trace" menu provides all trace settings, limit check settings, and the marker functions including marker search.



### **Background information**

Refer to the following sections:

- chapter 3.1.3, "Traces, Channels and Diagrams", on page 13
- chapter 3.1.3.1, "Trace Settings", on page 14
- chapter 3.1.4, "Sweep Control", on page 15

### 4.2.1 Meas Settings

The "Meas" functions select the measured and displayed results.



#### **Background information**

For a detailed description of all measurement results of the R&S ZNB refer to chapter 3.3, "Measurement Results", on page 44.



#### Efficient trace handling

To select a result and display it as a trace, you can simply drag and drop the corresponding button into a diagram area. See also section "Handling Diagrams, Traces, and Markers" in the Help or in the "Getting Started" guide.

#### 4.2.1.1 Meas > S-Params

Selects S-parameters as measured quantities.

Trace Settings



#### Background information

Refer to chapter 3.3.1, "S-Parameters", on page 44.

Access: TRACE > MEAS key or Alt + Shift + A



Some of the softkeys in the "S-Params" tab open dialogs.

- see chapter 4.2.1.2, "S-Parameter Wizard", on page 152
- see chapter 4.2.1.3, "Balanced Ports (Dialog)", on page 154

#### S-Parameter

Selects a scattering parameter (S-parameter) as measured quantity for the active trace. For a channel setup with n logical ports, one of  $n^2$  S-parameters can be selected.

The S-parameters are the basic measured quantities of a network analyzer. They describe how the DUT modifies a signal that is transmitted or reflected in forward or reverse direction.

At the GUI and remote, S-parameters are referred to as S<out>< in>, where <out> and <in> denote the output and input port numbers of the DUT, respectively.

**Note:** The indices <out> and <in> must be expressed using the same number of digits, i.e. for <out>=10 and <in>=9 you may specify S<out>< in> as S1009 or S010009, but not as S109.

SCPI command:

CALCulate<Ch>:PARameter:MEASure "<Trace\_Name>", "S11" | "S12" | "S21" | "S22" ...


Create new trace and select trace name and measurement parameter:

CALCulate<Ch>:PARameter:SDEFine "<Trace\_Name>", "S11" | "S12" | "S21" | "S22" ...

#### S11 / S12 / S21 / S22

Selects one of the four elements of the standard 2-port scattering matrix (S-parameters) as a measured quantity for the active trace.

The S-parameters are the basic measured quantities of a network analyzer. They describe how the DUT modifies a signal that is transmitted or reflected in forward or reverse direction. S-parameters are expressed as  $S_{\text{-out-< in-}}$ , where -out-> and -in-> denote the output and input port numbers of the DUT.

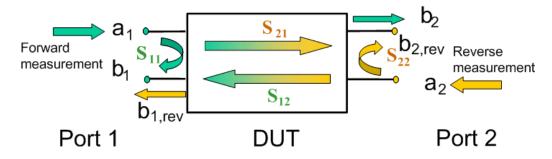

#### SCPI command:

CALCulate<Ch>:PARameter:MEASure "<Trace\_Name>", "S11" | "S12" | "S21" | "S22"

Create new trace and select trace name and measurement parameter:

CALCulate<Ch>:PARameter:SDEFine "<Trace\_Name>", "S11" | "S12" | "S21" | "S22"

#### All S-Params

Creates  $n^2$  diagrams (for an n-port vector network analyzer) and displays the full set of S-parameters, one in each diagram. The diagrams are arranged as an (n x n) matrix. The reflection coefficients  $S_{ii}$  appear in the diagrams on the main diagonal, the transmission coefficients  $S_{ij}$  (i  $\neq$  j) occupy the other diagrams. Reflection coefficients are displayed in Smith diagrams; transmission coefficients in Cartesian diagrams with logarithmic ("dB mag") scale.

See also: Format Settings

**Note:** This function is disabled if the number of used test ports is greater than 9.

SCPI command:

CALCulate<Ch>: PARameter:SDEFine CALCulate<Ch>: PARameter:DEFine:SGRoup

#### 4.2.1.2 S-Parameter Wizard

The "S-Parameter Wizard" dialog consists of a series of dialogs providing the settings for a standard multi-port S-parameter measurement in a frequency sweep.

Access: E.g. TRACE > MEAS > S-Params > S-Param Wizard ...

Trace Settings



The measurement comprises the following stages:

#### 1. Select the test setup

Choose the single-ended or balanced ports of the analyzer according to the port configuration of your DUT and connect the DUT to the selected analyzer ports. This dialog corresponds to the "Predefined Configs" tab of the "Balanced Ports" dialog; see"Predefined Configs" on page 155.

#### 2. Define port impedances

Assign reference impedances to all physical and balanced test ports selected in the previous step. The reference impedances can be complex.

**Tip:** The default reference impedance of the physical analyzer ports is  $Z_0 = 50 \Omega$ . The default reference impedances for balanced ports are derived hereof. You do not need to change these value unless you want to renormalize the port impedances; see chapter 3.3.5.4, "Reference Impedances", on page 57.

#### 3. Select the measurement parameters and the diagram areas

Choose an S-parameter or a group of S-parameters to be measured and displayed. The measurement parameters are displayed in separate diagram areas: Cartesian diagram areas are used for transmission S-parameters, Cartesian or Smith diagrams for reflection parameters. The selections to be made depend on the test setup selected in the previous stage.

**Tip:** In case of an error in a previous stage, you can always use the "Back" button and correct your settings.

#### 4. Select the sweep settings

Choose the frequency range and the number of measurement points per sweep. The sweep range is defined by two values (start and stop frequency or center frequency and span). The measurement points are equidistant across the sweep range. Increasing the number of points also increases the measurement time per single sweep.

#### 5. Select the measurement bandwidth and source power

Choose a typical measurement bandwidth and one of three typical source power values. A smaller measurement bandwidth increases the dynamic range but slows down the measurement. A smaller source power protects the input port of the analyzer from being overdriven, especially if an active DUT with high gain is measured.

#### Note:

The predefined bandwidths and source powers have been selected according to the following criteria:

- The large measurement bandwidth ("Fast Sweep") ensures that the noise of a S<sub>21</sub> trace at minimum (–40 dBm) source power and 0 dB attenuation is smaller than 0.1 dB.
- The default source power for a passive DUT ensures that the analyzer receiver is in its linear range (no compression) if a passive DUT with 0 dB attenuation is measured. The default source powers for active DUTs ensure no compression if an active DUT with 20 dB or 40 dB gain is measured. If the actual gain of the DUT is more than 50 dB, then the default source power of –40 dB is still too high and needs to be changed after finishing the wizard.

#### 6. Perform a calibration (optional)

Call the calibration wizard and perform a calibration. The default calibration type is a full n-port (TOSM) calibration, where n is the number of analyzer ports selected in the first stage of the calibration wizard. This calibration can be performed as well using automatic calibration (if a calibration unit R&S ZV-Z5x is available).

#### Tip:

You can skip the automatic calibration stage (select "Finish now without Calibration") if one of the following applies:

- A valid calibration is already assigned to the active channel
- You want to apply a valid calibration stored in the cal pool.
- You don't want to use a calibration, e.g. because the factory calibration is accurate enough for your measurement.



#### Instrument reset

In order to obtain a predictable result the measurement wizard has to reset all settings except the current calibration data. Store your recall set if you don't want to lose the current configuration.

#### 4.2.1.3 Balanced Ports (Dialog)

The "Balanced Ports" dialog selects a balanced port configuration and defines reference impedances for the balanced ports. Selecting a balanced port configuration means that one or more pairs of physical test ports are combined to form logical (balanced) ports.

Measurements do not necessarily require all of the physical and logical ports of the network analyzer. To save measurement time, it is recommended to specify the ports that are not used in the current test setup as "Unused" ports. Unused ports will not be considered for the calculation of mixed mode, Z- and Y-parameters.



Background information

Refer to the following sections:

- chapter 3.3.5, "Unbalance-Balance Conversion", on page 53
- chapter 3.3.5.1, "Balanced Port Configurations", on page 54
- chapter 3.3.5.4, "Reference Impedances", on page 57


#### **Predefined Configs**

The "Predefined Configs" tab of the "Balanced and Measured Ports" dialog provides the most commonly used balanced port configurations for the analyzer.

Access: E.g. TRACE > MEAS > S-Params > Balanced Ports...



This tab is hidden if more than 4 test ports are available (on the VNA and/or connected switch matrices).

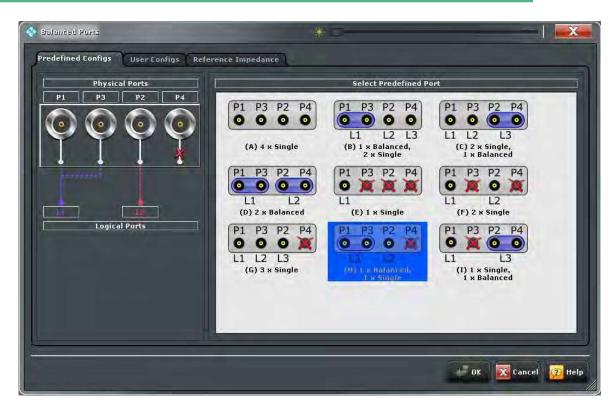

The port configurations are arranged in a scrollable list. The resulting port number assignment is shown on the left-hand side of the "Predefined Configs" tab.

• For a single-ended port, the diagram shows a single line between the physical test port and the logical port.

- For a balanced port, two physical ports are combined to form a single logical port.
- For unused ports, the physical port is crossed out; no logical port number is assigned.

#### **Select Predefined**

List of predefined port configurations.

The number of type of predefined configurations depends on the port number of the analyzer. They comprise the fully single-ended (unbalanced) case, where the logical ports correspond to the physical ports, and all balanced configurations where two adjacent physical ports are connected to a logical port. In addition configurations with one or more unused ports are provided.

SCPI command:

SOURce<Ch>:LPORt<LogPt> SOURce<Ch>:LPORt<LogPt>:CLEar

#### **User Configs**

The "User Configs" tab of the "Balanced Ports" dialog defines a new balanced port configuration.

Access: E.g. TRACE > MEAS > S-Params > Balanced Ports...



If more than 4 test ports are available (on the VNA and/or connected switch matrices) this tab is replaced by the "Logical Port Config" tab.



User Manual 1173.9163.02 - 13

# www.valuetronics.com

#### **Define Physical to Logical Port Relation**

Defines balanced, single-ended, and unused ports. In principle, it is possible to combine any pair of two physical ports into a balanced port. An analyzer with n test ports supports a maximum of n/2 (n even) or (n - 1)/2 (n odd) logical ports.

- To define a balanced port, select two physical ports and tap "Balanced".
- To dissolves a balanced port, select it and tap "Single".
- To exclude a single physical port from the measurement, select the port and tap "Unused".

#### SCPI command:

```
SOURce<Ch>:LPORt<LogPt>
SOURce<Ch>:LPORt<LogPt>:CLEar
SOURce<Ch>:GROup<Grp>
SOURce<Ch>:GROup<Grp>:CLEar
```

#### Logical Port Config

The "Logical Port Config" tab of the "Balanced Ports" dialog defines the balanced port configuration and - at the same time - the assignment of physical test ports to logical test ports.

Access: E.g. TRACE > MEAS > S-Params > Balanced Ports...



This tab is visible if an only if more than 4 test ports are available (on the VNA and/or connected switch matrices).



#### **Define Physical to Logical Port Relation**

Defines balanced, single-ended, and unused ports. In principle, it is possible to combine any pair of two physical analyzer ports into a balanced port. With n test ports a maximum of n/2 (n even) or (n - 1)/2 (n odd) logical ports is supported.

- To define a balanced port, select two physical ports and tap "Balanced".
- To dissolve balanced ports, select them and tap "Single".
- To exclude logical ports from the measurement, select them and tap "Unused".

SCPI command:

```
SOURce<Ch>:LPORt<LogPt>
SOURce<Ch>:LPORt<LogPt>:CLEar
SOURce<Ch>:GROup<Grp>
SOURce<Ch>:GROup<Grp>:CLEar
```

#### **Reference Impedance**

The "Reference Impedance" tab of the "Balanced and Measured Ports" dialog (re-)defines the port impedances for differential and common mode.

Background information Refer to chapter 3.3.5.4, "Reference Impedances", on page 57.

Access: E.g. TRACE > MEAS > S-Params > Balanced Ports...


Logical Ports	Logical Port Property (L1)
P2 0 L P3 0 L P4 0 L P5 0 L P6 0 L	Differential Mode       Real(20)     Imag(20)       100 Ω     0 Ω       4     Renormalization According to Theory of
	O Travelling Waves ● Power Waves ● Power Waves ● OK ● Cancel

Fig. 4-1: Reference Impedance Tab (>4 test ports)

The default reference impedance for a physical port is equal to the reference impedance of the connector type assigned to the port but can be defined as an arbitrary complex value (renormalization of port impedances). By changing the reference impedance, it is possible to convert the measured values at 50  $\Omega$  (75  $\Omega$ ) into values at arbitrary port impedances.

For balanced ports it is possible to define separate complex reference impedances for differential and for common mode.

**Trace Settings** 

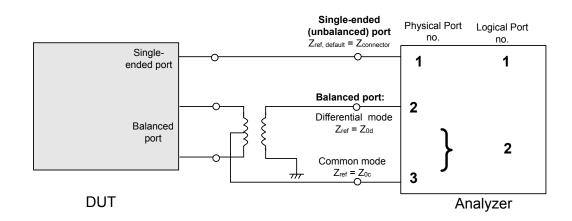

#### Common Mode / Differential Mode

Defines arbitrary reference impedances. "Common Mode" impedances are available for single-ended ports; "Differential Mode" impedances for balanced ports only.

The default values for the balanced port reference impedances are derived from the (real) default reference impedance of the physical analyzer ports ( $Z_0 = 50 \Omega$ ):

- The default value for the differential mode is Z<sub>0d</sub> = 100 Ω = 2\*Z<sub>0</sub>.
- The default value for the common mode is  $Z_{0c} = 25 \Omega = Z_0/2$ .

#### SCPI command:

SOURce<Ch>:LPORt<LogPt>
[SENSe<Ch>:]LPORt<LogPt>:ZCOMmon
[SENSe<Ch>:]LPORt<LogPt>:ZDIFferent

#### Renormalization according to Theory of

Selects the waveguide circuit theory for renormalization. The conversion formula of both theories differ only if the reference impedance of at least one test port has a non-zero imaginary part.

Refer to chapter 3.3.5.4, "Reference Impedances", on page 57.

SCPI command:

[SENSe<Ch>:]PORT<PhyPt>:ZREFerence on page 757 [SENSe<Ch>:]LPORt<LogPt>:ZCOMmon [SENSe<Ch>:]LPORt<LogPt>:ZDIFferent CALCulate<Chn>:TRANsform:IMPedance:RNORmal on page 570

#### 4.2.1.4 Meas > Ratios

Selects ratios of wave quantities as measured quantities.




#### **Background information**

Refer to chapter 3.3.4, "Wave Quantities and Ratios", on page 50.

Access: TRACE > MEAS key or Alt + Shift + A

#### b1 / a1 Source Port 1 ... b1/a2 Source Port 2

Selects predefined complex ratios of the standard 2-port wave quantities  $a_1$ ,  $a_2$ ,  $b_1$ , and  $b_2$ .

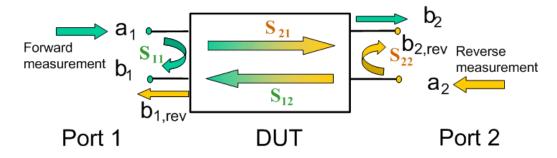

The predefined wave quantities can all be obtained with the same test setup, where a 2port DUT is connected between the analyzer ports 1 and 2. The stimulus signal is provided by the analyzer port 1 or 2 ("Source Port").

The predefined wave quantities correspond to the 2-port S-parameters:

- "b1/a1 Source Port 1" is the ratio of the wave quantities b<sub>1</sub> and a<sub>1</sub>, measured at port
   1. This ratio corresponds to the S-parameter S<sub>11</sub> (input reflection coefficient).
- "b2/a1 Source Port 1" is the ratio of the wave quantities b<sub>2</sub> and a<sub>1</sub> and corresponds to the S-parameter S<sub>21</sub> (forward transmission coefficient).
- "b2/a2 Source Port 2" is the ratio of the wave quantities b<sub>2</sub> and a<sub>2</sub>, measured at port
   2. This ratio corresponds to the S-parameter S<sub>22</sub> (output reflection coefficient).
- "b1/a2 Source Port 2" is the ratio of the wave quantities b<sub>1</sub> and a<sub>2</sub> and corresponds to the S-parameter S<sub>12</sub> (reverse transmission coefficient).

The analyzer can also measure arbitrary ratios for other source ports; see "More Ratios" on page 160.

**Tip:** In the trace list the source port is indicated in brackets. "b2/a1(P1)" denotes the ratio  $b_2/a_1$  with source port 1.

SCPI command:

CALCulate<Ch>: PARameter: MEASure "<Trace\_Name>", "B2/A1" | ... Create new trace and select trace name and measurement parameter: CALCulate<Ch>: PARameter: SDEFine "<Trace\_Name>", "B2/A1" | ...

#### **More Ratios**

Opens a dialog to select arbitrary ratios of wave quantities, e.g. for different source ports or higher port numbers.

#### 4.2.1.5 More Ratios (Dialog)

The "More Ratios" dialog provides arbitrary ratios with arbitrary source ports as measured quantities. All ratios can be calculated with different detector settings.

Trace Settings



#### Background information

Refer to the following sections:

- chapter 3.3.4.1, "Wave Quantities", on page 51
- chapter 3.3.4.2, "Ratios", on page 51

Access: TRACE > MEAS > Ratios > More Ratios...

Numerator \$  b 1		Denominat \$  a 1	or  \$
roperties			
Source Port	Rat	io	
Port 1	‡   = t	01/a1	
Detector	He	s Time	
Normal	<b>‡</b>		

The notation for ratios follows the usual scheme of the vector network analyzer:

- The a-waves are the outgoing/transmitted waves at the analyzer's test ports.
- The b-waves are the incoming/measured waves.
- The source port for the stimulus signal must be specified in addition.
- The port number range covers all test ports of the analyzer.

#### Numerator

Selects the type (left pull-down list) and the port number assignment (right pull-down list) of the wave that forms the numerator of the ratio.

SCPI command:

```
CALCulate<Ch>: PARameter: MEASure "<Trace_Name>", "B2/A1" | ...
Create new trace and select trace name and measurement parameter:
CALCulate<Ch>: PARameter: SDEFine "<Trace Name>", "B2/A1" | ...
```

#### Denominator

Selects the type (left pull-down list) and the port number assignment (right pull-down list) of the wave that forms the denominator of the ratio.

SCPI command:

CALCulate<Ch>: PARameter: MEASure "<Trace\_Name>", "B2/A1" | ... Create new trace and select trace name and measurement parameter: CALCulate<Ch>: PARameter: SDEFine "<Trace Name>", "B2/A1" | ...

#### Source Port

Selects the the source port for the stimulus signal. For an n-port analyzer the list contains all analyzer ports "Port 1" to "Port n". Generators ("Gen 1", "Gen 2" ...) must be configured explicitly in the "External Generators" dialog before they appear in the list. See also chapter 3.7.11, "External Generators", on page 131.

#### SCPI command:

CALCulate<Ch>: PARameter: MEASure "<Trace\_Name>", "<Ratio>" Create new trace and select trace name and measurement parameter: CALCulate<Ch>: PARameter: SDEFine "<Trace\_Name>", "<Ratio>" (the parameter name <Ratio> can also contain the source port)

#### Detector

Selects the algorithm that is used to calculate the displayed measurement points from the raw data.

For details refer to: chapter 3.3.4.3, "Detector Settings", on page 52.

SCPI command:

CALCulate<Ch>: PARameter: MEASure "<Trace\_Name>", "<Ratio>" CALCulate<Ch>: PARameter: SDEFine "<Trace\_Name>", "<Ratio>" (the parameter name <Ratio> can also contain the detector) [SENSe<Ch>:]SWEep:DETector:TIME

#### 4.2.1.6 Meas > Wave

Selects wave quantities as measured quantities.



#### **Background information**

Refer to chapter 3.3.4, "Wave Quantities and Ratios", on page 50.

```
Access: TRACE > MEAS key or Alt + Shift + A
```




User Manual 1173.9163.02 - 13

# www.valuetronics.com

#### a1 Source Port 1 ... b1 Source Port 2

Selects the standard 2-port wave quantities  $a_1$ ,  $a_2$ ,  $b_1$ , and  $b_2$  for different source ports.

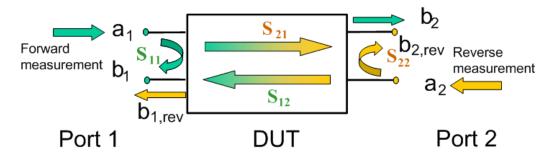

The predefined wave quantities are obtained with different source ports. "a1 Source Port 1, b1 Source Port 1" and "b1 Source Port 2" are measured at Port 1 of the analyzer. "a2 Source Port 2, b2 Source Port 1" and "b2 Source Port 2" are measured at Port 2 of the analyzer.

- "a1 Source Port 1" is the wave transmitted at test port 1. In a standard S-parameter measurement, this wave is fed to the input port (port 1) of the DUT (forward measurement).
- "b1 Source Port 1" is the wave received at test port 1. In a standard S-parameter measurement, this is the reflected wave at port 1 of the DUT (forward measurement).
- "b2 Source Port 1" is the wave received at test port 2. In a standard S-parameter measurement, this wave is transmitted at port 2 of the DUT (forward measurement).
- "a2 Source Port 2" is the wave transmitted at test port 2. In a standard S-parameter measurement, this wave is fed to the output port (port 2) of the DUT (reverse measurement).
- "b1 Source Port 2" is the wave received at test port 1. In a standard S-parameter measurement, this wave is transmitted at port 2 of the DUT (reverse measurement).
- "b2 Source Port 2" is the wave received at test port 2. In a standard S-parameter measurement, this wave is fed to the output port (port 2) of the DUT (reverse measurement).

**Tip:** In the trace list the source port is indicated in brackets. "a1(P1)" denotes the wave  $a_1$  with source port 1.

The analyzer can also measure arbitrary wave quantities for other source ports; see More Wave Quantities.

SCPI command:

CALCulate<Ch>: PARameter: MEASure "<Trace\_Name>", "A1" | ... Create new trace and select trace name and measurement parameter: CALCulate<Ch>: PARameter: SDEFine "<Trace Name>", "A1" | ...

#### **More Wave Quantities**

Opens a dialog to select arbitrary wave quantities, e.g. for different source ports or higher port numbers.

## 4.2.1.7 More Wave Quantities (Dialog)

The "More Wave Quantities" dialog provides arbitrary wave quantities with arbitrary source ports as measured quantities. All wave quantities can be calculated with different detector settings.



#### **Background information**

Refer to the following sections:

- chapter 3.3.4.1, "Wave Quantities", on page 51
- chapter 3.3.4.2, "Ratios", on page 51

Access: TRACE > MEAS > Wave Quantities > More Wave Quantities...

Wave Quantity		
\$ b 1 \$		
Properties		
Source Port	Show as	
Port 1   ‡	Power	•
Detector	Meas Time	
Normal  \$		

The notation for wave quantities follows the usual scheme of the vector network analyzer:

- The a-waves are the outgoing/transmitted waves at the analyzer's test ports.
- The b-waves are the incoming/measured waves.
- The source port for the stimulus signal must be specified in addition.
- The port number range covers all test ports of the analyzer.

## Wave Quantity

Selects the type (left pull-down list) and the port number assignment (right pull-down list) of the wave quantitiy.

SCPI command:

CALCulate<Ch>: PARameter: MEASure "<Trace\_Name>", "A1" ... Create new trace and select trace name and measurement parameter: CALCulate<Ch>: PARameter: SDEFine "<Trace Name>", "A1" ...

#### Source Port

Selects the the source port for the stimulus signal. For an n-port analyzer the list contains all analyzer ports "Port 1" to "Port n". Generators ("Gen 1", "Gen 2" ...) must be configured explicitly in the "External Generators" dialog before they appear in the list. See also chapter 3.7.11, "External Generators", on page 131.

The analyzer places no restriction on the combination of source ports and port numbers of the measured wave quantity, so it is even possible to measure  $a_2$  while the source port is Port 1 (e.g. in order to estimate the directivity of the coupler in the internal test set). SCPI command:

CALCulate<Ch>: PARameter: MEASure "<Trace\_Name>", "A1" ... Create new trace and select trace name and measurement parameter: CALCulate<Ch>: PARameter: SDEFine "<Trace\_Name>", "A1" ... (the parameter name <Ratio> can also contain the source port)

#### Show as

Selects the physical unit of the displayed trace. It is possible to display the measured "Voltage" V or convert the wave quantity into an effective power according to  $P = V^2/Re(Z_0)$ .  $Z_0$  denotes the reference impedance of the source port (for wave quantities  $a_n$ ) or of the receive port (for wave quantities  $b_n$ ).

The reference impedances are defined in the "Balanced Ports" dialog; see chapter 4.2.1.3, "Balanced Ports (Dialog)", on page 154.

SCPI command: CALCulate<Chn>:FORMat:WQUType

#### Detector

Selects the algorithm that is used to calculate the displayed measurement points from the raw data.

For details refer to: chapter 3.3.4.3, "Detector Settings", on page 52.

SCPI command:

CALCulate<Ch>:PARameter:MEASure "<Trace\_Name>", "<Ratio>" CALCulate<Ch>:PARameter:SDEFine "<Trace\_Name>", "<Ratio>" (the parameter name <Ratio> can also contain the detector) [SENSe<Ch>:]SWEep:DETector:TIME

#### 4.2.1.8 Meas Intermodulation

Selects intermodulation products and derived results as measured quantities. The intermodulation products occur at frequencies which correspond to sums and differences of the upper and lower tone frequencies and their integer multiples.

The intermodulation measurement requires options R&S ZNB-K4 and R&S ZNB-K14. The results are available as soon as the measurement has been properly configured, see chapter 4.4.4.9, "Wizard Intermodulation", on page 374.



#### **Background information**

Refer to the following sections:

- chapter 3.7.2.3, "Intermodulation Measurements (R&S ZNB-K14)", on page 122
- "Intermodulation Quantities" on page 125

Trace Settings



The labels for the intermodulation quantities in the trace list are identical to the parameters used for remote control; see CALCulate<Ch>: PARameter: SDEFine.



## ... at DUT Out/In

**Note:** The measurement of higher-order intermodulation products must be enabled explicitly in the "Define Intermodulation" dialog, see chapter 4.4.4.10, "Define Intermodulation Distortion Measurement (Dialog)", on page 376.

 The "Lower IM3 Product at DUT Out" is the third-order lower intermodulation product at the output of the DUT. This quantity corresponds to the outgoing wave quantity (b wave) at the output of the DUT, measured at the frequency of the lower tone minus the tone distance.

The lower and upper IM<n> frequencies are also displayed in the "Frequencies and Powers" dialog, see chapter 4.4.4.11, "Frequencies and Powers (Dialog)", on page 379.

- The "Upper IM3 Product at DUT Out" is the third-order upper intermodulation product at the output of the DUT. This quantity corresponds to the outgoing wave quantity (b wave) at the output of the DUT, measured at the frequency of the upper tone plus the tone distance.
- The "Major IM3 Product at DUT Out" is the lower or upper IM3 product at DUT out, whichever is larger. The "Major IM3 Product" reveals the worst-case performance of the DUT.
- "More Intermod Products" opens a dialog to select intermodulation products of higher order, see chapter 4.2.1.9, "More IM Products", on page 167.
- "Major IP3 at DUT Out" is the third-order major intercept point at the output of the DUT. This quantity corresponds to the fictitious DUT output level (Lower Tone at DUT Out), measured at the lower tone frequency, where the major third-order intermodu-

lation suppression (the ratio of the Major IM3 Product at DUT Out to the Lower Tone at DUT Out) reaches 0 dB.

- "More Intercept Points" opens a dialog to select intercept points of higher order and intercept points which are measured at the input of the DUT.
- "Lower Tone at DUT In", "Lower Tone at DUT Out", "Upper Tone at DUT In", "Upper Tone at DUT Out" is a measurement of the two fundamental waves that are used for the intermodulation measurement.
- "Noise at DUT Out" is a measure for the noise level and therefore the dynamic range of the intermodulation distortion measurement. The noise level is measured at the frequency of the lower tone minus half the tone distance.

SCPI command:

Assign a measurement result to an **existing** trace: CALCulate<Ch>: PARameter: MEASure on page 550 Create new trace and select trace name and measurement result: CALCulate<Ch>: PARameter: SDEFine on page 551

# 4.2.1.9 More IM Products

This dialog selects general intermodulation products.



# Background information

Refer to "Intermodulation Quantities" on page 125.



#### Order

Defines the order of the intermodulation product.

SCPI command:

Assign a measurement result to an **existing** trace:

CALCulate<Ch>: PARameter: MEASure on page 550 Create new trace and select trace name and measurement parameter: CALCulate<Ch>: PARameter: SDEFine on page 551

### Side

Defines the position of the intermodulation product relative to the lower and upper tones.

"Major"	Denotes the lower or upper intermodulation product, whichever is larger. The "Major" intermodulation product reveals the worst-case performance of the DUT.
"Upper"	The "Upper" intermodulation products are measured at frequencies above the upper tone.
"Lower"	The "Lower" intermodulation products are measured at frequencies below the lower tone.

SCPI command:

Assign a measurement result to an **existing** trace: CALCulate<Ch>: PARameter:MEASure on page 550 Create new trace and select trace name and measurement parameter: CALCulate<Ch>: PARameter:SDEFine on page 551

#### Relative

If "Relative" is selected, the intermodulation product is displayed in dB units relative to the measured lower tone level at the DUT output ("Lower Tone at DUT Out"). The relative result is often termed "intermodulation suppression".

SCPI command: Assign a measurement result to an **existing** trace: CALCulate<Ch>: PARameter:MEASure on page 550 Create new trace and select trace name and measurement parameter: CALCulate<Ch>: PARameter:SDEFine on page 551

# 4.2.1.10 More Intercept

This dialog selects general intercept points.



## **Background information**

Refer to "Intermodulation Quantities" on page 125.

Order	
O 3 5	C C g
Side	DUT Port
O Major	
	O Output
O Upper	Input
O Lower	
	9

## Order

Defines the order of the intercept point.

SCPI command:

Assign a measurement result to an **existing** trace: CALCulate<Ch>: PARameter:MEASure on page 550 Create new trace and select trace name and measurement parameter: CALCulate<Ch>: PARameter:SDEFine on page 551

## Side

Defines the position of the intercept point relative to the lower and upper tones.

"Major"	Denotes the lower or upper intercept point, whichever is <b>smaller</b> . The "Major" intercept point reveals the worst-case performance of the DUT.
"Upper"	The "Upper" intercept point are measured at frequencies above the upper tone.
"Lower"	The "Lower" intercept point are measured at frequencies below the lower tone.

SCPI command:

Assign a measurement result to an **existing** trace: CALCulate<Ch>: PARameter:MEASure on page 550 Create new trace and select trace name and measurement parameter: CALCulate<Ch>: PARameter:SDEFine on page 551

## **DUT Port**

Defines if the intercept point is referenced to the DUT output or input port. Both values differ by the attenuation of the lower tone signal upon transmission through the DUT; see "Intermodulation Quantities" on page 125.

SCPI command: Assign a measurement result to an **existing** trace: CALCulate<Ch>: PARameter:MEASure on page 550 Create new trace and select trace name and measurement parameter: CALCulate<Ch>: PARameter:SDEFine on page 551

# 4.2.1.11 Meas > Z <-- Sij

Selects converted impedances as measured quantities. The impedances are calculated from the measured S-parameters.



## **Background information**

Refer to the following sections:

- chapter 3.3.2, "Impedance Parameters", on page 46
- chapter 3.3.2.1, "Converted Impedances", on page 46

Access: TRACE > MEAS key or Alt + Shift + A

**Trace Settings** 



## Z <-

Selects a converted impedance parameter as a measured quantity for the active trace. For an n-port vector network analyzer, the pull-down list provides the full set of n<sup>2</sup> impedance parameters.

Converted impedance parameters are expressed as Z <- $_{out>< in>}$ , where <out> and <in> denote the output and input port numbers of the DUT.

SCPI command:

CALCulate<Ch>:PARameter:MEASure "<Trace\_Name>", "Z-S11" | "Z-S12" ...

Create new trace and select trace name and measurement parameter:

CALCulate<Ch>:PARameter:SDEFine "<Trace\_Name>", "Z-S11" | "Z-S22" | ...

## Z<-S11 / Z<-S12 / Z<-S21 / Z<-S22

Selects the 2-port converted impedance parameters. The parameters describe the impedances of a 2-port DUT, obtained in forward and reverse transmission and reflection measurements:

- Z<sub>11</sub> is the input impedance at port 1 of a 2-port DUT that is terminated at port 2 with the reference impedance Z<sub>0</sub> (matched-circuit impedance measured in a forward reflection measurement).
- Z<sub>22</sub> is the input impedance at port 2 of a 2-port DUT that is terminated at port 1 with the reference impedance Z<sub>0</sub> (matched-circuit impedance measured in a reverse reflection measurement).
- Z<sub>12</sub> and Z<sub>21</sub> denote the forward and reverse converted transfer impedances, respectively.

**Tip:** Use the "Y-Z-Params" tab to measure Z-parameters including the transfer parameters. Use the Smith chart to obtain an alternative, graphical representation of the converted impedances in a reflection measurement.

SCPI command:

CALCulate<Ch>:PARameter:MEASure "<Trace\_Name>", "Z-S11" | "Z-S12" | "Z-S21" | "Z-S22"

Create new trace and select trace name and measurement parameter:

CALCulate<Ch>:PARameter:SDEFine "<Trace\_Name>", "Z-S11" | "Z-S12" | "Z-S21" | "Z-S22"

#### **Balanced Ports...**

Opens a dialog to define a balanced port configuration. See chapter 4.2.1.3, "Balanced Ports (Dialog)", on page 154.

## 4.2.1.12 Meas > Y <-- Sij

Selects converted admittances as measured quantities. The admittances are calculated from the measured S-parameters.



# **Background information**

Refer to the following sections:

- chapter 3.3.3, "Admittance Parameters", on page 48
- chapter 3.3.3.1, "Converted Admittances", on page 49

Access: TRACE > MEAS key or Alt + Shift + A



# Y <-

Selects a converted admittance parameter as a measured quantity for the active trace. For an n-port vector network analyzer, the pull-down list provides the full set of n<sup>2</sup> admittance parameters.

Converted admittance parameters are expressed as Y <- $_{out>< in>}$ , where <out> and <in> denote the output and input port numbers of the DUT.

SCPI command:

```
CALCulate<Ch>:PARameter:MEASure "<Trace_Name>", "Y-S11" |
"Y-S12" ...
```

Create new trace and select trace name and measurement parameter:

```
CALCulate<Ch>:PARameter:SDEFine "<Trace_Name>", "Y-S11" | "Y-S22" | ...
```

# Y<-S11 / Y<-S12 / Y<-S21 / Y<-S22

Selects the 2-port converted admittance parameters. The parameters describe the admittances of a 2-port DUT, obtained in forward and reverse transmission and reflection measurements:

- Y<sub>11</sub> is the input admittance at port 1 of a 2-port DUT that is terminated at port 2 with the reference impedance Z<sub>0</sub> (matched-circuit admittance measured in a forward reflection measurement).
- Y<sub>22</sub> is the input admittance at port 2 of a 2-port DUT that is terminated at port 1 with the reference impedance Z<sub>0</sub> (matched-circuit admittance measured in a reverse reflection measurement).
- Y<sub>12</sub> and Y<sub>21</sub> denote the forward and reverse converted transfer admittances, respectively.

**Tip:** Use the "Y-Z-Params" tab to measure Y-parameters including the transfer parameters. Use the inverted Smith chart to obtain an alternative, graphical representation of the converted admittances in a reflection measurement.

SCPI command:

```
CALCulate<Ch>:PARameter:MEASure "<Trace_Name>", "Y-S11" | "Y-S12" | "Y-S21" | "Y-S22"
```

Create new trace and select trace name and measurement parameter:

CALCulate<Ch>:PARameter:SDEFine "<Trace\_Name>", "Y-S11" | "Y-S12" | "Y-S21" | "Y-S22"

## **Balanced Ports...**

Opens a dialog to define a balanced port configuration.

See chapter 4.2.1.3, "Balanced Ports (Dialog)", on page 154.

#### 4.2.1.13 Meas > Y-Z-Params

Selects Y and Z-parameters as measured quantities. Both the Y-parameters and the Zparameters can be used as an alternative to S-parameters in order to completely characterize a linear n-port network.



# Background information

Refer to the following sections:

- chapter 3.3.2, "Impedance Parameters", on page 46
- chapter 3.3.3, "Admittance Parameters", on page 48
- chapter 3.3.2.2, "Z-Parameters", on page 48
- chapter 3.3.3.2, "Y-Parameters", on page 50

Access: TRACE > MEAS key or Alt + Shift + A

Trace Settings



# Y/Z-Parameter

Selects an Y- or Z-parameter as a measured quantity for the active trace. For an n-port vector network analyzer, the pull-down list provides the full set of n<sup>2</sup> Y- and Z-parameters.

Y- and Z-parameters are expressed as  $Y/Z_{\text{out}><\text{in}>}$ , where <out> and <in> denote the output and input port numbers of the DUT.

SCPI command:

```
CALCulate<Ch>:PARameter:MEASure "<Trace_Name>", "Y11" |
"Z11" ...
Create new trace and select trace name and measurement parameter:
CALCulate<Ch>:PARameter:SDEFine "<Trace_Name>", "Y11" |
"Z11" ...
```

## Y11 / Y12 / Y21 / Y22

Selects the 2-port Y- parameters as a measured quantity for the active trace. The Yparameters describe the admittances of a DUT with output ports terminated in a short circuit (V = 0).

The four 2-port Y-parameters can be interpreted as follows:

- Y<sub>11</sub> is the input admittance, defined as the ratio of the current I<sub>1</sub> to the voltage V<sub>1</sub>, measured at port 1 (forward measurement with output terminated in a short circuit, V<sub>2</sub> = 0).
- Y<sub>21</sub> is the forward transfer admittance, defined as the ratio of the current I<sub>2</sub> to the voltage V<sub>1</sub> (forward measurement with output terminated in a short circuit, V<sub>2</sub> = 0).
- Y<sub>12</sub> is the reverse transfer admittance, defined as the ratio of the current I<sub>1</sub> to the voltage V<sub>2</sub> (reverse measurement with input terminated in a short circuit, V<sub>1</sub> = 0).

Y<sub>22</sub> is the output admittance, defined as the ratio of the current I<sub>2</sub> to the voltage V<sub>2</sub>, measured at port 2 (reverse measurement with input terminated in a short circuit, V<sub>1</sub> = 0).

SCPI command:

```
CALCulate<Ch>: PARameter:MEASure "<Trace_Name>", "Y11" | "Y12" |
"Y21" | "Y22"
Create new trace and select trace name and measurement parameter:
CALCulate<Ch>: PARameter:SDEFine "<Trace Name>", "Y11" | "Y12" |
```

```
Z11 / Z12 / Z21 / Z22
```

"Y21" | "Y22"

Selects the 2-port Z-parameters as a measured quantity for the active trace. The Z-parameters describe the impedances of a DUT with open output ports (I = 0).

The four 2-port Z-parameters can be interpreted as follows:

- $Z_{11}$  is the input impedance, defined as the ratio of the voltage V<sub>1</sub> to the current I<sub>1</sub>, measured at port 1 (forward measurement with open output, I<sub>2</sub> = 0).
- Z<sub>21</sub> is the forward transfer impedance, defined as the ratio of the voltage V<sub>2</sub> to the current I<sub>1</sub> (forward measurement with open output, I<sub>2</sub> = 0).
- Z<sub>12</sub> is the reverse transfer impedance, defined as the ratio of the voltage V<sub>1</sub> to the current I<sub>2</sub> (reverse measurement with open input, I<sub>1</sub> = 0).
- Z<sub>22</sub> is the output impedance, defined as the ratio of the voltage V<sub>2</sub> to the current I<sub>2</sub>, measured at port 2 (reverse measurement with open input, I<sub>1</sub> = 0).

SCPI command:

```
CALCulate<Ch>:PARameter:MEASure "<Trace_Name>", "Z11" | "Z12" |
"Z21" | "Z22"
```

Create new trace and select trace name and measurement parameter:

```
CALCulate<Ch>:PARameter:SDEFine "<Trace_Name>", "Z11" | "Z12" |
"Z21" | "Z22"
```

#### **Balanced Ports...**

Opens a dialog to define a balanced port configuration.

See Balanced Ports (Dialog).

## 4.2.1.14 Meas > Imbalance

Selects the imbalance of a DUT with at least one balanced port as measured quantities. The parameters are available if a balanced port configuration is active.



# **Background information**

Refer to the following sections:

- chapter 3.3.5, "Unbalance-Balance Conversion", on page 53
- chapter 3.3.5.3, "Imbalance Parameters", on page 57

Access: TRACE > MEAS key or Alt + Shift + A

User Manual 1173.9163.02 - 13

**Trace Settings** 



## Imbalance

Selects an imbalance parameter as a measured quantity for the active trace. For a balanced port configuration with k balanced ports plus m single-ended ports (2 \* k + m = n, where n is the number of analyzer ports), the pull-down list provides the full set of k \* (k – 1 + 2 \* m) imbalance parameters.

Imbalance parameters are expressed as "Imb<sub><out><in></sub>", where <out> and <in> denote the logical output and input port numbers of the DUT.

SCPI command:

```
CALCulate<Ch>:PARameter:MEASure "<Trace_Name>", "IMB21" |
"IMB12" ...
```

Create new trace and select trace name and measurement parameter:

```
CALCulate<Ch>:PARameter:SDEFine "<Trace_Name>", "IMB21" |
"IMB12" ...
```

## Imb21 / Imb12

Selects one of the standard 2-port imbalance parameters as a measured quantity for the active trace. The buttons are available if either logical port 1 or logical port 2 (or both) is defined as a balanced port.

SCPI command:

CALCulate<Ch>:PARameter:MEASure "<Trace\_Name>", "IMB21" | "IMB12"

Create new trace and select trace name and measurement parameter:

```
CALCulate<Ch>:PARameter:SDEFine "<Trace_Name>", "IMB21" |
"IMB12"
```

Balanced Ports...

Opens a dialog to define a balanced port configuration.

See chapter 4.2.1.3, "Balanced Ports (Dialog)", on page 154.

#### 4.2.1.15 Meas > Stability

Selects one of the three two port stability factors K,  $\mu_1$  or  $\mu_2$  as measured quantities. A typical application of stability factors is to assess the stability of an amplifier. Stability factors cannot be calculated in balanced port configurations.



## **Background information**

Refer to chapter 3.3.6, "Stability Factors", on page 59.



Access: TRACE > MEAS key or Alt + Shift + A

#### Stability

Selects a stability parameter as a measured quantity for the active trace. The stability factor calculation is based on 2-port reflection **and** transmission S-parameters so that the input and output port numbers must be different. The pull-down list contains all possible physical (single-ended) port combinations. For an analyzer with n ports, provides n \* (n - 1) stability parameters.

Stability parameters are expressed as " $K_{\text{cout}>\text{cin>}}$ ", " $\mu 1_{\text{cout}>\text{cin>}}$ ", and " $\mu 2_{\text{cout}>\text{cin>}}$ ", where <out> and <in> denote the logical output and input port numbers of the DUT.

SCPI command:

```
CALCulate<Ch>: PARameter: MEASure "<Trace_Name>", "KFAC21" |
"MUF121" | "MUF221" | ...
Create new trace and select trace name and measurement parameter:
CALCulate<Ch>: PARameter: SDEFine "<Trace Name>", "KFAC21" |
```

```
"MUF121" | "MUF221" | ...
```

#### μ1 21 / μ2 21 / Κ 21

Selects one of the standard 2-port stability factors as a measured quantity for the active trace. The buttons are available if none of the logical ports 1 and 2 is defined as a balanced port.

SCPI command:

```
CALCulate<Ch>: PARameter: MEASure "<Trace_Name>", "MUF121" |
"MUF221" | "KFAC21"
Create new trace and select trace name and measurement parameter:
```

```
CALCulate<Ch>:PARameter:SDEFine "<Trace_Name>", "MUF121" |
"MUF221" | "KFAC21"
```

#### **Balanced Ports...**

Opens a dialog to define a balanced port configuration. See chapter 4.2.1.3, "Balanced Ports (Dialog)", on page 154.

# 4.2.1.16 Meas > Power Sensor

Opens a configuration dialog for the measurement of wave quantities using an external power meter.

```
Meas
                      X
Show as
            (
                    Params
Power
Source Port
             =
Port 1
Power Meter
            1$
Pmtr 1
 NRP-Z11
Ser#: 900001
  Auto Zero...
                    Y- Z-
Params
                    Imbal.
                    Stability
                    Power
Sensor
```

Access: TRACE > MEAS key or Alt + Shift + A

The standard test setup for a "Power Sensor" measurement involves one analyzer source port and a power sensor. The power sensor is connected e.g. to the analyzer's USB port and provides the (scalar) wave quantity results. See examples in chapter 3.7.10, "External Power Meters", on page 130.

#### Show as

Selects the physical unit of the displayed trace. It is possible to display the measured "Voltage" V or convert the wave quantity into an effective power according to  $P = V^2/Re(Z_0)$ .  $Z_0$  denotes the reference impedance of the source port. The reference impedances are defined in the "Balanced Ports" dialog ("TRACE > MEAS > S-Params > Balanced Ports...").

SCPI command:

CALCulate<Chn>:FORMat:WQUType

## Source Port

Selects one of the available test ports of the analyzer as a source of the stimulus signal.

SCPI command:

CALCulate<Ch>: PARameter: MEASure'TraceName', 'PmtrD1 | ... CALCulate<Ch>: PARameter: SDEFine 'TraceName', 'PmtrD1 | ...

#### **Power Meter**

Shows a list of all power meters that have been properly configured. See "Configured Devices" on page 437.

SCPI command:

CALCulate<Ch>:PARameter:MEASure'TraceName', 'PmtrD1 | ... CALCulate<Ch>:PARameter:SDEFine 'TraceName', 'PmtrD1 | ...

#### Auto Zero

Initiates an automatic zeroing procedure of the power meter which must be disconnected from the RF power; see "Zeroing" on page 131. A message indicates that zeroing is finished.

SCPI command: SYSTem:COMMunicate:RDEVice:PMETer<Pmtr>:AZER0

# 4.2.1.17 Meas > DC

Selects the ranges for the DC voltages fed to the DC INPUT 1 ... 4 connectors at the rear panel as measured quantities and opens the PAE measurement dialog. The DC input connectors are available as options R&S ZNB4-B81 or R&S ZNB8-B81 (for R&S ZNB4 or R&S ZNB8 analyzers, respectively).

Access: TRACE > MEAS key or Alt + Shift + A

**Trace Settings** 



# DC 1 / DC 2 / DC 3 / DC 4

Selects a DC voltage as a measured quantity for the active trace. The DC voltages DC 1 ... 4 are measured at the rear panel connectors DC INPUT 1 ... 4. For best accuracy, it is recommended to adjust the "Ranges" to the measured signal.

## SCPI command:

CALCulate<Ch>:PARameter:MEASure "<Trace\_Name>", "DC1d1" | "DC2d1" | ...

Create new trace and select trace name and measurement parameter:

CALCulate<Ch>:PARameter:SDEFine "<Trace\_Name>", "DC1d1" | "DC2d1" | ...

#### Ranges > DC 1 ... DC 4

The four control elements configure the measurement ranges of the four DC input connectors. For best accuracy, the ranges should be adjusted to the measured signals. To protect the instrument, all ranges are pre-set to "+/- 20 V" (the widest range).

If the actual voltage of the input signal exceeds the selected range, the measurement is incorrect, and a DC overload message is displayed.

SCPI command: [SENSe<Ch>:]DC<DCInp>:RANGe

### PAE

Opens a dialog to configure the measurement of the Power Added Efficiency (PAE) of an active device.

## 4.2.1.18 Power Added Efficiency (Dialog)


The "Power Added Efficiency (PAE)" dialog configures the measurement of the PAE of an active 2-port device.



# Background information

Refer to section chapter 3.7.9.1, "Power Added Efficiency", on page 127.

Access: TRACE > MEAS > DC > PAE...

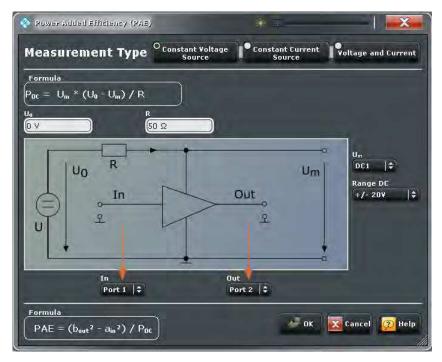

A PAE measurement involves the following steps:

- Select the "Measurement Type", according to the properties of your DC power source.
- 2. Enter the parameters for the selected measurement type.
- Establish the test setup (including the RF connection of the DUT and the DC INPUT connection(s)) as shown in the circuit diagram.
- Close the "Power Added Efficiency (PAE)" dialog and observe the result in the measurement diagram.

#### **Measurement Type**

Selects the PAE measurement type, depending on the DC power source in use (DC source providing a constant, known voltage at (possibly) variable current / DC source providing a constant, known current at (possibly) variable voltage / DC source with variable (unknown) current and power). The three measurement types involve different test setups, input parameters, and DC voltage measurements. For an overview see table 3-17.

**Note:** The measurement types for "Constant Voltage Source" and "Voltage and Current" require an additional non-zero, known precision resistor R.

SCPI command: [SENSe<Ch>:]PAE:TYPE

## Formula

Shows the formula for the calculation of the DC supply power  $P_{DC}$ , depending on the selected measurement type. The parameters R, U<sub>0</sub>, and/or I<sub>0</sub> must be entered in accordance with the properties with the DC power source and precision resistor in use.

SCPI command:

[SENSe<Ch>:]PAE:PARameters:I [SENSe<Ch>:]PAE:PARameters:R [SENSe<Ch>:]PAE:PARameters:U

### **Connector buttons**

Define the VNA test ports for the RF input and output signal (In / Out) at the DUT and the DC connector(s) used to determine the DC supply power. The "Voltage and Current" measurement type requires two simultaneous DC voltage measurements. The DC range of each DC INPUT connector in use should be selected according to the (estimated) input voltage range; see "Ranges > DC 1 ... DC 4" on page 179.

SCPI command:
[SENSe<Ch>:]PAE:DCINput:MAIN
[SENSe<Ch>:]PAE:DCINput:SECondary

# 4.2.2 Format Settings

The "Format" menu defines how the measured data is presented in the diagram area.



# Measured quantitites and display formats

The analyzer allows arbitrary combinations of display formats and measured quantities ("Trace > Measure"). Nevertheless, in order to extract useful information from the data, it is important to select a display format which is appropriate to the analysis of a particular measured quantity.

An extended range of formats is available for markers. To convert any point on a trace, create a marker and select the appropriate marker format ("TRACE > MARKER > Marker Format"). Marker and trace formats can be applied independently.



# **Background information**

Refer to the following sections:

- chapter 3.2.4, "Display Formats and Diagram Types", on page 36
- chapter 3.2.4.6, "Measured Quantities and Display Formats", on page 43

Access: TRACE > FORMAT key or Alt + Shift + B

**Trace Settings** 



## dB Mag

Selects a Cartesian diagram with a logarithmic scale of the vertical axis to display the magnitude of the complex measured quantity.

**Properties:** The stimulus variable appears on the horizontal axis, scaled linearly. The magnitude of the complex quantity C, i.e.  $|C| = \operatorname{sqrt} (\operatorname{Re}(C)^2 + \operatorname{Im}(C)^2)$ , appears on the vertical axis, scaled in dB. The decibel conversion is calculated according to dB Mag(C) = 20 \* log(|C|) dB.

**Application:** dB Mag is the default format for the complex, dimensionless S-parameters. The dB-scale is the natural scale for measurements related to power ratios (insertion loss, gain etc.).

**Tip (alternative formats):** The magnitude of each complex quantity can be displayed on a linear scale. It is possible to view the real and imaginary parts instead of the magnitude and phase. Both the magnitude and phase are displayed in the polar diagram.

SCPI command:

CALCulate<Chn>:FORMat MLOGarithmic

#### Phase

Selects a Cartesian diagram with a linear vertical axis to display the phase of a complex measured quantity in the range between –180 degrees and +180 degrees.

**Properties:** The stimulus variable appears on the horizontal axis, scaled linearly. The phase of the complex quantity C, i.e.  $\varphi$  (C) = arctan (Im(C) / Re(C)), appears on the vertical axis.  $\varphi$  (C) is measured relative to the phase at the start of the sweep (reference phase = 0°). If  $\varphi$  (C) exceeds +180° the curve jumps by -360°; if it falls below -180°, the trace jumps by +360°. The result is a trace with a typical sawtooth shape. The alternative "Phase Unwrapped" format avoids this behavior.

**Application:** Phase measurements, e.g. phase distortion, deviation from linearity.

**Tip (alternative formats):** The magnitude of each complex quantity can be displayed on a linear scale or on a logarithmic scale. It is possible to view the real and imaginary parts instead of the magnitude and phase. Both the magnitude and phase are displayed in the polar diagram. As an alternative to direct phase measurements, the analyzer provides the derivative of the phase response for a frequency sweep (Delay).

SCPI command: CALCulate<Chn>:FORMat PHASe

## Smith

Selects a Smith chart to display a complex quantity, primarily a reflection S-parameter.

**Properties:** The Smith chart is a circular diagram obtained by mapping the positive complex semi-plane into a unit circle. Points with the same resistance are located on circles, points with the same reactance produce arcs. If the measured quantity is a complex reflection coefficient ( $S_{11}$ ,  $S_{22}$  etc.), then the unit Smith chart represents the normalized impedance. In contrast to the polar diagram, the scaling of the diagram is not linear.

**Application:** Reflection measurements; see example in chapter 3.2.4.4, "Smith Chart", on page 39.

**Tip:** The axis for the sweep variable is lost in Smith charts but the marker functions easily provide the stimulus value of any measurement point. dB values for the magnitude and other conversions can be obtained by means of the "Marker Format" functions.

SCPI command:

CALCulate<Chn>:FORMat SMITh

### Polar

Selects a polar diagram to display a complex quantity, primarily an S-parameter or ratio.

**Properties:** The polar diagram shows the measured data (response values) in the complex plane with a horizontal real axis and a vertical imaginary axis. The magnitude of a complex value is determined by its distance from the center, its phase is given by the angle from the positive horizontal axis. In contrast to the Smith chart, the scaling of the axes is linear.

**Application:** Reflection or transmission measurements, see example in chapter 3.2.4.3, "Polar Diagrams", on page 38.

**Tip:** The axis for the sweep variable is lost in polar diagrams but the marker functions easily provide the stimulus value of any measurement point. dB values for the magnitude and other conversions can be obtained by means of the "Marker Format" functions.

SCPI command:

CALCulate<Chn>:FORMat POLar

#### Delay

Calculates the (group) delay from the measured quantity (primarily: from a transmission S-parameter) and displays it in a Cartesian diagram.

**Properties:** The group delay  $\tau_g$  represents the propagation time of wave through a device.  $\tau_g$  is a real quantity and is calculated as the negative of the derivative of its phase response. A non-dispersive DUT shows a linear phase response, which produces a constant delay (a constant ratio of phase difference to frequency difference).

For more information refer to chapter 3.3.7, "Delay, Aperture, Electrical Length", on page 60.

**Application:** Transmission measurements, especially with the purpose of investigating deviations from linear phase response and phase distortions. To obtain the delay a frequency sweep must be active.

**Tip:** The cables between the analyzer test ports and the DUT introduce an unwanted delay, which often can be assumed to be constant. Use the "Zero Delay at Marker" function, define a numeric length "Offset" or use the "Auto Length" function to mathematically compensate for this effect in the measurement results. To compensate for a frequency-dependent delay in the test setup, a system error correction is required.

**Note:** The delay for reflection factors corresponds to the transmission time in forward and reverse direction; see "Length and delay measurement" in chapter 3.6.1.3, "Auto Length", on page 101.

SCPI command:

CALCulate<Chn>:FORMat GDELay


## Aperture

Sets a delay aperture for the delay calculation. The aperture  $\Delta f$  is entered as an integer number of steps. An aperture step corresponds to the distance between two sweep points.

Properties: The delay at each sweep point is computed as:

$$\tau_{g,meas} = -\frac{\Delta \phi_{deg}}{360^{\circ} \cdot \Delta f}$$

where the aperture  $\Delta f$  is a finite frequency interval around the sweep point fo and the analyzer measures the corresponding phase change  $\Delta \Phi$ .

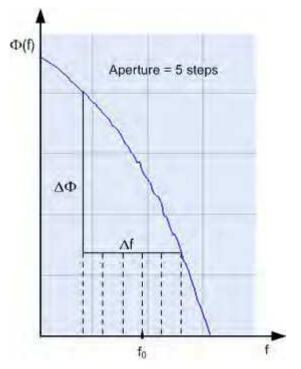

#### Calculation of $\Delta f$ and $\Delta \Phi$

With a given number of aperture steps n the delay at sweep point no. m is calculated as follows:

If n is even (n = 2k), then Δf (m) = f (m+k) − f (m–k) and ΔΦ(m) = ΔΦ (m+k) − ΔΦ (m–k).

If n is odd (n = 2k+1), then Δf (m) = f (m+k) − f (m-k-1) and ΔΦ (m) = ΔΦ (m+k) − ΔΦ (m-k-1).

The calculated phase difference (and thus the group delay) is always assigned to the frequency point no. m. For linear sweeps and odd numbers of aperture steps, the center of the aperture range is [f (m+k) + f (m-k-1)] / 2 = f (m-1/2), i.e. half a frequency step size below the sweep point f (m). This is why toggling from even to odd numbers of aperture steps and back can virtually shift the group delay curve towards higher/lower frequencies. It is recommended to use even numbers of aperture steps, especially for large frequency step sizes.

The delay calculation is based on the already measured sweep points and does not slow down the measurement.

 $\Delta$ f is constant over the entire sweep range, if the sweep type is a Lin. Frequency sweep. For Log. Frequency and Segmented Frequency sweeps, it varies with the sweep point number m.

**Application:** The aperture must be adjusted to the conditions of the measurement. A small aperture increases the noise in the group delay; a large aperture tends to minimize the effects of noise and phase uncertainty, but at the expense of frequency resolution. Phase distortions (i.e. deviations from linear phase) which are narrower in frequency than the aperture tend to be smeared over and cannot be measured.

SCPI command:

CALCulate<Chn>:GDAPerture:SCOunt

## SWR

Calculates the Standing Wave Ratio (SWR) from the measured quantity (primarily: from a reflection S-parameter) and displays it in a Cartesian diagram.

**Properties:** The SWR (or Voltage Standing Wave Ratio, VSWR) is a measure of the power reflected at the input of the DUT. It is calculated from the magnitude of the reflection coefficients Sii (where i denotes the port number of the DUT) according to:

$$SWR = \frac{1 + |S_{ii}|}{1 - |S_{ii}|}$$

The superposition of the incident and the reflected wave on the transmission line connecting the analyzer and the DUT causes an interference pattern with variable envelope voltage. The SWR is the ratio of the maximum voltage to the minimum envelope voltage along the line.

#### Interpretation of the SWR

The superposition of the incident wave I and the reflected wave R on the transmission line connecting the analyzer and the DUT causes an interference pattern with variable envelope voltage. The SWR is the ratio of the maximum voltage to the minimum envelope voltage along the line:

SWR = 
$$V_{Max}/V_{Min}$$
 = ( $|V_1|$  +  $|V_R|$ ) / ( $|V_1|$  –  $|V_R|$ ) = (1 +  $|S_{ii}|$ ) / (1 –  $|S_{ii}|$ )

**Application:** Reflection measurements with conversion of the complex S-parameter to a real SWR.

SCPI command:

CALCulate<Chn>:FORMat SWR

#### **Unwrapped Phase**

Selects a Cartesian diagram with an arbitrarily scaled linear vertical axis to display the phase of the measured quantity.

**Properties:** The stimulus variable appears on the horizontal axis, scaled linearly. The phase of the complex quantity C, i.e.  $\varphi$  (C) = arctan (Im(C) / Re(C)), appears on the vertical axis.  $\varphi$  (C) is measured relative to the phase at the start of the sweep (reference phase = 0°). In contrast to the normal Phase format, the display range is not limited to values between -180° and +180°. This avoids artificial jumps of the trace but can entail a relatively wide phase range if the sweep span is large.

Application: Phase measurements, e.g. phase distortion, deviation from linearity.

**Tip:** After changing to the "Unwrapped Phase" format, use "TRACE > SCALE – Auto Scale Trace" to re-scale the vertical axis and view the entire trace.

SCPI command:

CALCulate<Chn>:FORMat SWR

#### Lin Mag

Selects a Cartesian diagram with a linear vertical axis scale to display the magnitude of the measured quantity.

**Properties:** The stimulus variable appears on the horizontal axis, scaled linearly. The magnitude of the complex quantity C, i.e.  $|C| = sqrt (Re(C)^2 + Im(C)^2)$ , appears on the vertical axis, also scaled linearly.

**Application:** Real measurement data (i.e. the Stability Factors and the DC voltages) are always displayed in a Lin Mag diagram.

**Tip (alternative formats):** The magnitude of each complex quantity can be displayed on a logarithmic scale. It is possible to view the real and imaginary parts instead of the magnitude and phase.

SCPI command:

CALCulate<Chn>:FORMat MLINear

#### Inv Smith

Selects an inverted Smith chart to display a complex quantity, primarily a reflection Sparameter.

**Properties:** The Inverted Smith chart is a circular diagram obtained by mapping the positive complex semi-plane into a unit circle. If the measured quantity is a complex reflection coefficient ( $S_{11}$ ,  $S_{22}$  etc.), then the unit Inverted Smith chart represents the normalized admittance. In contrast to the polar diagram, the scaling of the diagram is not linear.

**Application:** Reflection measurements, see example in chapter 3.2.4.5, "Inverted Smith Chart", on page 41.

**Tip:** The axis for the sweep variable is lost in Smith charts but the marker functions easily provide the stimulus value of any measurement point. dB values for the magnitude and other conversions can be obtained by means of the "Marker Format" functions.

SCPI command:

CALCulate<Chn>:FORMat ISMith

#### Real

Selects a Cartesian diagram to display the real part of a complex measured quantity.

**Properties:** The stimulus variable appears on the horizontal axis, scaled linearly. The real part Re(C) of the complex quantity C = Re(C) + j Im(C), appears on the vertical axis, also scaled linearly.

**Application:** The real part of an impedance corresponds to its resistive portion.

**Tip (alternative formats):** It is possible to view the magnitude and phase of a complex quantity instead of the real and imaginary part. The magnitude can be displayed on a linear scale or on a logarithmic scale. Both the real and imaginary parts are displayed in the polar diagram.

SCPI command:

CALCulate<Chn>:FORMat REAL

#### Imag

Selects a Cartesian diagram to display the imaginary part of a complex measured quantity.

**Properties:** The stimulus variable appears on the horizontal axis, scaled linearly. The imaginary part Im(C) of the complex quantity C = Re(C) + j Im(C), appears on the vertical axis, also scaled linearly.

**Application:** The imaginary part of an impedance corresponds to its reactive portion. Positive (negative) values represent inductive (capacitive) reactance.

**Tip (alternative formats):** It is possible to view the magnitude and phase of a complex quantity instead of the real and imaginary part. The magnitude can be displayed on a linear scale or on a logarithmic scale. Both the real and imaginary parts are displayed in the polar diagram.

SCPI command: CALCulate<Chn>:FORMat IMAGinary

# 4.2.3 Scale Settings

The "Scale" settings define how the active trace is displayed in the diagram selected in the "Trace > Format" tab.

#### 4.2.3.1 Scale > Scale Values

Provides the functions for diagram scaling.

The "Scale" settings are closely related to the settings in the "Format" submenu and in the "Display" menu. All of them have an influence on the way the analyzer presents data on the screen.

The "Scale" settings depend on the diagram type (Trace > Format) because not all diagrams can be scaled in the same way:

- In Cartesian diagrams, all scale settings are available.
- In circular diagrams, no "Scale/Div.", no "Ref. Position", and no "Max" and "Min" values can be defined.

User Manual 1173.9163.02 - 13

The default scale is activated automatically when a display format (diagram type) is selected. Scale settings that are not compatible with the current display format are unavailable (grayed).

#### Relations between the scaling parameters

The scaling parameters "Scale / Div, Ref Value, Ref Position, Max, Min" are coupled together in the following manner:

- Max Min = Scale / Div \* <Number of graticule divisions>
- Max = Ref Value when Ref Position is 10
- Min = Ref Value when Ref Position is 0



## Alternatives and examples

The marker functions and the icons in the toolbar provide alternatives to manual diagram scaling. Refer to the following sections:

- chapter "Scaling Diagrams" in the Getting Started guide
- chapter 4.3.1, "Stimulus > Stimulus", on page 255

## Access: TRACE > SCALE key or Alt + Shift + C



#### Auto Scale Trace

Adjusts the "Scale/Div" and the "Ref Value" in order to display the entire active trace in the diagram area, leaving an appropriate display margin.

- In Cartesian diagrams, the analyzer re-calculates the values of the vertical divisions so that the trace fits onto approx. 80% of the vertical grid. The reference value is chosen to center the trace in the diagram.
- In circular diagrams ("Polar, Smith, Inverted Smith"), the analyzer re-calculates the values of the radial divisions so that the diagram is confined to approx. 80% of the

outer circumference. The reference value is set to the value of the outer circumference.

Auto scale does not affect the stimulus values and the horizontal axis.

SCPI command:

DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:Y[:SCALe]:AUTO

## Auto Scale Diagram

Adjusts the "Scale/Div" and the "Ref Value" in order to display all traces in the diagram area, leaving an appropriate display margin. This scale settings are analogous to the "Auto Scale Trace" function. The traces in the active diagram area are taken into account irrespective of their channel assignment.

## Ref Value = Marker

See "Ref Val / Max / Min = Marker" on page 253.

#### Zoom Active

Enables or disables the current scale settings, including all the numeric entries in the input fields below. See also "Using the Graphic Zoom" in the R&S ZNB Getting Started manual.

### Scale/Div

Sets the value of the vertical diagram divisions in Cartesian diagrams.

"Scale /Div" corresponds to the increment between two consecutive grid lines. The unit depends on the display format: dB for display format "dB Mag", degrees for "Phase" and "Unwrapped Phase", ns for "Delay", U (units) for all other (dimensionless) formats.

"Scale /Div" is not available (grayed) for circular diagrams ("Polar, Smith, Inverted Smith").

#### SCPI command:

DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:Y[:SCALe]:PDIVision

#### Ref Value

Sets the reference line of a Cartesian diagram or the outer circumference of a circular diagram.

- In Cartesian diagrams "Ref. Value" defines the value of the reference line, indicated by a symbol at the right edge of the diagram area. The color of the symbol corresponds to the trace color. As the "Ref. Value" is varied, the position of the reference line (Ref. Position) is left unchanged, so that the current trace is shifted in vertical direction. The unit of the "Ref. Value" depends on the display format: dB for display format "dB Mag", degrees for "Phase" and "Unwrapped Phase", ns for "Delay", U (units) for all other (dimensionless) formats.
- In circular diagrams ("Polar, Smith, Inverted Smith"), Ref. Value defines the value of the outer circumference. Changing Ref. Value enlarges or scales down the diagram, leaving the center unchanged. The unit is U (units) for all circular diagrams.

SCPI command:

DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:Y[:SCALe]:RLEVel

#### **Ref Position**

Defines the position of the reference line in a Cartesian diagram.

The reference line is indicated by a symbol at the right edge of the diagram area. The color of the symbol corresponds to the trace color. "Ref. Position "is defined on a linear scale between 0 (bottom line of the diagram) and 10 (top line of the diagram). As the "Ref. Position "is varied, the value of the reference line (Ref. Value) is left unchanged, so the current trace is shifted together with the "Ref. Position".

"Ref. Position" is not available (grayed) for polar diagrams ("Polar, Smith, Inverted Smith").

SCPI command: DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:Y[:SCALe]:RPOSition

## Max / Min

Define the upper and lower edge of a Cartesian diagram.

"Max" and "Min" are not available (grayed) for polar diagrams ("Polar, Smith, Inverted Smith").

SCPI command:

```
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:Y[:SCALe]:TOP
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:Y[:SCALe]:BOTTom
```

## 4.2.3.2 Scale > Scale Coupling

Selects common scale settings for all traces. The softkeys are available if the active recall set contains at least two traces, and if the active trace is not a reference trace ("To Trace").



# Related settings

Refer to chapter 4.2.4.2, "Trace Manager (Dialog)", on page 194.

Access: TRACE > SCALE key or Alt + Shift + C



User Manual 1173.9163.02 - 13

#### Couple ... To Trace

Applies the scale settings of the reference trace ("To Trace") to the active trace or to all traces.

SCPI command: n/a

## **Decouple Active Trace / All Traces**

Assigns independent scale settings to the active trace or to all traces.

SCPI command: n/a

## 4.2.3.3 Scale > Zoom

Provides the graphical and numerical zoom functions. A zoom magnifies a rectangular portion inside a diagram (zoom window) to fill the entire diagram area.



## Alternative settings and examples

The icons in the toolbar provide alternatives to manual zooming. Refer to the following sections:

- chapter "Using the Graphic Zoom" in the Getting Started guide
- chapter 4.3.1, "Stimulus > Stimulus", on page 255

Access: TRACE > SCALE key or Alt + Shift + C



# Zoom Reset

Disables the zoom function. SCPI command: DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM[:STATe]

#### **Zoom Select**

Enables the zoom function. With active zoom, the numerical input fields "Max", "Min", "Start", "Stop" can be used to re-define the active diagram.

User Manual 1173.9163.02 - 13

Alternatively, you can define a zoom window using the touchscreen or the mouse. After performing a graphical zoom, the numeric input fields are updated.

SCPI command:

DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM[:STATe]

#### **Overview Select**

SCPI command:

Enables the zoom function with an additional overview window. The overview window appears in the upper part of the active diagram and shows the original diagram and the zoom area. You can move the zoomed part of the trace by moving the zoom area.

DISPlay[:WINDow<Wnd>]:OVERview[:STATe] on page 619

## Max / Min / Start / Stop

Defines the coordinates of the zoom window for the active diagram. "Max" and "Min" define the response axis range, "Start" and "Stop" define the stimulus axis range. The input fields are available if "Zoom Active" is selected; they are updated after a graphical zoom.

SCPI command:

```
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM:BOTTom
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM:STARt
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM:STOP
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM:TOP
```

# 4.2.4 Trace Config Settings

The "Trace Config" settings store traces to the memory and perform mathematical operations on traces.

#### 4.2.4.1 Trace Config > Traces

Provides functions to handle traces and diagram areas, and assign traces to channels.



#### **Related information**

Refer to the following sections:

- chapter 3.1.3.3, "Active and Inactive Traces and Channels", on page 15
- See chapter "Operating the Instrument > Handling Diagrams, Traces, and Markers" in the Help system or in the R&S ZNB Getting Started guide.



In remote control each channel can contain an active trace. The active remote traces and the active manual trace are independent of each other; see chapter 5.3.2, "Active Traces in Remote Control", on page 466.

Access: TRACE > SCALE key or Alt + Shift + D

User Manual 1173.9163.02 - 13

**Trace Settings** 



#### Active Trace / Diagram / Channel

Selects an arbitrary trace / diagram / channel of the active recall set as the active trace. This function is disabled if only one trace / diagram / channel is defined.

**Tip:** You can simply tap a line in the trace list, the trace itself, a diagram, or a line in the channel list to activate the corresponding elements.

SCPI command:

The numeric suffixes <Chn> / <Ch> appended to the first-level mnemonic of a command selects a trace / channel as the active trace / channel. The numeric suffix <Wnd> appended to the DISPlay:WINDow<Wnd>:... commands selects a diagram area.

# Add Trace

Creates a new trace in the active diagram area and assigns it to the active channel. The new trace is created with the trace and channel settings of the former active trace but displayed with another color. The former and the new active trace are superimposed but can be easily separated, e.g. by changing the "Reference Position".

The new trace is named Trc <n>, where <n> is the largest of all existing trace numbers plus one. The name can be changed in the "Trace Manager" dialog.

**Tip:** To create a new trace in a new channel, use "Channel > Channel Config > Add Ch + Trace".

SCPI command:

CALCulate<Ch>: PARameter:SDEFine DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:FEED

#### Add Trace + Diag

Creates a new trace in a new diagram area and assigns the trace to the active channel. The new trace is created with the trace and channel settings of the former active trace but displayed with another color. The new trace is named Trc <n>, where <n> is the largest of all existing trace numbers plus one. The name can be changed in the "Trace Manager".

SCPI command:

```
CALCulate<Ch>: PARameter:SDEFine
DISPlay[:WINDow<Wnd>]:STATe ON
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:FEED
```

#### **Delete Trace**

Deletes the active trace and removes it from the diagram area. If the active diagram contains only one trace, the diagram is also deleted.

"Delete Trace" is disabled if the recall set contains only one trace: In manual control, each recall set must contain at least one diagram area with one channel and one trace.

Tips: Use the "Trace Manager" to hide traces in the diagrams.

Use the UNDO key to restore a trace that was unintentionally deleted.

SCPI command:

CALCulate<Ch>: PARameter: DELete CALCulate: PARameter: DELete: ALL CALCulate<Ch>: PARameter: DELete: CALL

#### 4.2.4.2 Trace Manager (Dialog)

The "Trace Manager" dialog performs operations on traces.

Access: TRACE > TRACE CONFIG > Traces > Trace Manager...

	Name 🛧	On	Meas	Туре	Chan	nel	Diag	jram 🛛	Scale
1	Tret	V	821	DAT	Ch1	\$	1	10	\$
2	Trc2	V	S21	DAT	Ch2	\$	1	\$	\$

All existing traces of the current recall set are listed in a table with several editable (white) or non-editable (gray) columns.

#### Trace Manager Table

The list contains the following columns:

- "Name" indicates the current trace name. The default names for new traces are Trc<n> where <n> is a current number. Current numbers in the trace names are necessary to make automatic assignments, e.g. decouple the channel settings in the "Coupling" dialog. To serve as an unambiguous reference (e.g. in remote control commands), trace names must be unique across all channels and diagram areas in a recall set.
- "On" indicates whether the trace is displayed on the screen ("On") or invisible.

- "Meas" indicates the measured parameter.
- "Type" indicates whether the trace is a data trace ("DAT"), displaying the current measurement data, or a memory trace ("MEM").
- "Channel" indicates the channel of each trace.
- "Area" indicates the diagram area of each trace.
- "Scale" shows which traces use common scaling and format settings.

#### **Rules for trace names**

The analyzer can define mathematical relations between different traces and calculate new mathematical traces (User Def Math). The trace names are used as operands in the mathematical expressions and must be distinguished from the mathematical operators +, -, \*, /, (, ) etc. This places some restrictions on the syntax of trace names:

- The first character of a trace name can be either one of the upper case letters A to Z, one of the lower case letters a to z, an underscore or a square bracket [ or ].
- For all other characters of a trace name, the numbers 0 to 9 can be used in addition.

The analyzer does not accept illegal trace names. If an illegal name is specified, the entry is denied.

# SCPI command:

CALCulate<Ch>:PARameter:SDEFine CONFigure:TRACe<Trc>:REName CONFigure:TRACe:CATalog? CONFigure:CHANnel<Ch>:TRACe:CATalog? CONFigure:CHANnel<Ch>:NAME CONFigure:CHANnel<Ch>:NAME:ID? CONFigure:CHANnel<Ch>:TRACe:REName

#### Add

Creates a new trace and adds it to the list in the "Trace Manager", assigning it to the channel and diagram area of the active trace.

#### SCPI command:

CALCulate<Ch>:PARameter:SDEFine DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:FEED DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:EFEed CONFigure:TRACe:WINDow? CONFigure:TRACe:WINDow:TRACe?

### Delete

Deletes the selected trace, removing it from the list in the Trace Manager and from the screen. This button is disabled if the recall set contains only one trace: In manual control, each recall set must contain at least one diagram area with one channel and one trace.

SCPI command: CALCulate<Ch>: PARameter: DELete

#### Couple / Decouple all Channels / Scales

Selects common channel or scale settings for all traces in the Trace Manager dialog.

 "Couple All ..." assigns all traces to the channel or scale settings of the active trace. All channel or scale settings except the selected ones are lost. The analyzer displays a confirmation dialog box before deleting the unused channels.

 "Decouple All ..." assigns independent channel or scale settings to all traces in the "Trace Manager". If the channel and trace names include numbers, the trace with the lowest number is assigned to the channel with the lowest number and so forth. Measurement or data traces and their associated memory traces are assigned to the same channel.

SCPI command: n/a

## 4.2.4.3 Trace Config > Mem Math

Stores traces to the memory and performs mathematical operations on traces.

Background information Refer to "Trace Types" on page 27.



Access: TRACE > SCALE key or Alt + Shift + D

## Destination

Shows the available memory traces. Some of the other softkeys (e.g. "Data to Mem") act on the selected memory trace.

SCPI command: n/a

# Data to <Destination>

Stores the current state of the active trace as a memory trace. No trace functions are applied to the stored trace. The memory trace is displayed in the active diagram area with another color, and its properties are indicated in the trace list:

#### Trc8 S21 dB Mag Mem6[Trc8] S21 dB Mag

Memory traces are named "Mem<n>[<Data\_Trace>]" where <n> counts all data and memory traces in the active recall set in chronological order, and <Data\_Trace> is the name of the associated data trace. Trace names can be changed in the "Trace Manager" dialog.

"Data to <Destination>" overwrites the memory trace selected under "Destination". If "New" is selected, a new memory trace is created.

**Tips:** You can also create memory traces using the "File > More > Import... > Import Data" dialog. Notice that it is not possible to store "Max. Hold" traces to memory ("TRACE CONFIG > Smooth Shift Hold > Hold Mode").

#### Coupling of data and memory traces

When a memory trace is generated from a data trace, it is displayed in the same diagram area and inherits all channel and trace settings from the data trace.

The following display settings of a data trace and the associated memory traces are **fully coupled**. Changing a property of one trace affects the properties of all other traces.

- All "Trace > Format" settings
- All "Trace > Scale" settings

Selection of the measured quantity ("Trace > Measure") is possible for the data trace but disabled for the memory traces.

Channel settings made for a memory trace act on the associated data trace. Some of the channel settings for a data trace (e.g. the "Stimulus" range) also affect the display of the memory traces.

**Note:** If the sweep type of a data trace is changed so that the stimulus ranges of the data traces and the memory traces become incompatible, all coupled memory traces are removed from the diagram area and deleted.

SCPI command:

CALCulate<Chn>:MATH:MEMorize TRACe:COPY

#### Data & Func to <Destination>

Stores the current state of the active data trace modified by the trace functions as a memory trace.

## Trace functions

The trace functions comprise the following mathematical operations:

- Any mathematical relation applied to the trace ("Math = Data/Mem, Math = User Def").
- A shift of the trace in horizontal or vertical direction ("TRACE CONFIG > Smooth Shift Hold > Shift Trace").

"Data to <Destination>" stores the raw trace without the trace functions, "Data & Funct to <Destination>" stores the trace after it has been transformed using the trace functions.

SCPI command:

CALCulate<Chn>:MATH:MEMorize

#### Show < Destination >

Displays or hides the active memory trace or the memory trace associated with the active data trace.

- If no memory trace is associated with the active data trace, "Show <Destination>" is disabled.
- If several memory traces are associated with the active data trace, "Show <Destination>" affects the last generated or changed memory trace.

SCPI command:

DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:SHOW

#### Show <Data>

Displays or hides the active data trace in the diagram area. If "Trace Math" is active, then the active mathematical trace is displayed or hidden.

SCPI command:

DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:SHOW

#### Trace Math

Activates the mathematical mode, applying the last active mathematical relation to the active data trace. The data trace is replaced by the mathematical trace. "Math" is displayed in the trace list while the mathematical mode is active.

Trc1 S21 dB Mag 10 dB / Ref 0 dB Math

"Trace Math" is enabled if the active data trace fulfils the conditions for evaluating the mathematical relation. E.g. if no "User Defined" mathematical relation is defined, a memory trace must be coupled to the active data trace, so that the R&S ZNB can evaluate one of the relations "Data / Mem" or "Data – Mem".

SCPI command:

CALCulate<Chn>:MATH:STATe

#### Data / Mem, Data – Mem

Activates the mathematical mode where the active data trace is divided by (subtracted from) the last generated memory trace. The division (subtraction) is calculated on a point-to-point basis: Each measurement point of the active trace is divided by (subtracted from) the corresponding measurement point of the memory trace. If the memory trace represents the result of a previous sweep with unchanged settings, the divided (subtracted) curve is typically centered around 1 / 0 dB (0); it shows the variation of the results in subsequent sweeps.

The result of the division is a mathematical trace and replaces the active data trace in the diagram area. The mathematical trace is updated as the measurement goes on and the analyzer provides new active trace data.

This function is disabled unless a memory trace is coupled to the active data trace. Trace coupling ensures that the two traces have the same number of points so that the mathematical trace is well-defined.

SCPI command:

```
CALCulate<Chn>:MATH:STATe
CALCulate<Chn>:MATH[:EXPRession]:SDEFine
CALCulate<Chn>:MATH:FUNCtion
```

## **User Defined**

Activates the mathematical mode and displays the mathematical trace defined in the "User Def Math" dialog. The mathematical trace replaces the active data trace in the diagram area; it is updated as the measurement goes on and the analyzer provides new active trace data.

SCPI command:

CALCulate<Chn>:MATH:STATe CALCulate<Chn>:MATH[:EXPRession]:SDEFine

## 4.2.4.4 User Def Math (Dialog)

The "User Def Math" dialog defines a mathematical relation between traces and calculate a new mathematical trace. Each measurement point of the active trace is replaced by the corresponding point of the mathematical trace.

## Compatibility between traces in mathematical relations

Mathematical traces are either constant functions or functions of one or more data or memory traces. They are calculated on a point-to-point basis. Each trace point no. i of the mathematical trace is calculated from a set of constant values  $c_1, ..., c_n$  plus the trace points Trc1<sub>i</sub>, Trcm<sub>i</sub> of all traces 1 to m in the mathematical relation:

 $Math_i = Fct. (c_1, ..., c_n, Trc1_i, Trcm_i), i = 1, no. of points$ 

Different traces can be used in the same mathematical relation provided that they contain the same number of points. The analyzer places no further restriction on the compatibility of traces, e.g. the sweep points of the traces do not have to be the same.

The number of points belongs to the channel settings. Coupled data and memory traces are always compatible because they have the same channel settings.



The analyzer processes only numeric values without units in the mathematical formulas. No consistency check for units is performed.

Access: TRACE > TRACE CONFIG > Mem Math > Def Math...



## **Mathematical Expression**

The mathematical expression appears in the upper part of the dialog. The operands and operators in the expression can be selected from a keyboard and the list of "Operands":

- The keyboard supports the entry of numeric values, constants, and mathematical functions. In addition to the numbers 0 to 9, the decimal point and the constants j (complex unit), pi (approx. 3.14159) and e (approx. 2.71828), it contains the following buttons:
  - +/- changes the sign
  - The effect of the basic arithmetic operators (/, \*, -, +) and the mathematical functions is described in table 4-1.

Products of numbers and constants may be entered in abbreviated form, e.g. 2e for 2\*e.

- The Clear, Del, Back buttons are used to correct faulty entries.
- Check performs a consistency check of the displayed mathematical expression and displays a message.
- Operand contains all data traces and memory traces of the active recall set.
  - Data and memory traces are identified by their trace names.
    - "Data" denotes the active data trace.
    - "Mem" is the memory trace associated with the active data trace (or the last created/modified memory trace, if several memory traces are associated with the active data trace).
    - "StimVal" is the array of stimulus values; see footnote for table 4-1.

The trace operands denote unmodified data and memory traces. Mathematical relations for the traces are not taken into account, even if the mathematical mode is active ("User Defined: On"). The same applies to smoothing and the "Shift Trace" functions.

Basic arithmetic operations
Grouping parts of an expression
z  = sqrt ( x2 + y2 )
Exponential, e.g. z^2
$dB Mag(z) = 20 * \log z  dB$
Phase $\varphi(z)$ = arctan (Im(z) / Re(z))
x, y (Real and Imag)
Common (base 10) or natural (base e) logarithm
Smaller or larger values of all points of two traces, e.g. Min(Trc1,Trc2)
Stimulus value*)
Direct and inverse trigonometric functions.

Table 4-1: Effect of the operators on a complex quantity z = x + jy.

\*) The function StimVal can be used for all sweep types. Please note that - as with all user math operands - only the numerical value without unit is processed in the user math formula.

- In frequency sweeps StimVal provides the stimulus frequency in Hz.
- In power sweeps, StimVal provides the voltage in V that results from the source power in dBm. To obtain the correct source power in dBm (for "dB Mag" trace format), "Result is Wave Quantity" must be enabled. Note that, due to the conversion into a dBm value, the source power depends on the reference impedance of the port associated with the measured wave quantity, to be set in the "Balanced Ports" dialog.
- In time sweeps, StimVal is the stimulus time in s.
- In CW mode sweeps, StimVal is the number of the point.

SCPI command:

CALCulate<Chn>:MATH:WUNit[:STATe]

## **Result is Wave Quantity**

Controls the conversion and formatting of the mathematic expression.

- If "Result is Wave Quantity" is enabled the analyzer assumes that the result of the mathematical expression represents a voltage. Examples for voltage-type expressions are all terms proportional to a wave quantity (e.g. 1.1\*Data, if a wave quantity is measured) or to a stimulus value of a power sweep. If "Show As: Power" is selected in the "More Wave Quantities" dialog, the result is converted into a linear power before the selected trace format is applied. Otherwise no conversion is performed, and "dB Mag" results are referenced to 1 µV.
- If "Result is Wave Quantity" is disabled the analyzer assumes that the result of the mathematical expression is dimensionless. Examples for dimensionless expressions are all terms proportional to ratios of wave quantities, e.g. "Data / Mem2[Trc1]". The selected trace format is applied without previous conversion.

"Result is Wave Quantity" acts on the result of the mathematical expression only. Wave quantities and power sweep stimulus values always enter into the expression as voltages.

Effect of "Result is Wave Quantity"

In the "More Wave Quantities" dialog, the "Show as:" control element specifies whether wave quantities are displayed as voltages or equivalent powers, using the port impedances for a conversion between the two representations. "Result is Wave Quantity" is relevant for mathematical traces displayed in units of "dBm" ("Show as: Power" and trace format "dB Mag"):

If "Result is Wave Quantity" is on (checked), the mathematical trace values <W> are interpreted as voltages and first converted into equivalent powers ( $<W> --> <P> = <W>^2/Re(Z_0)$ ). Results in "dB Mag" format are calculated according to  $<P>_{log} = 10 * log (<P>/1mW)$ .

 If "Result is Wave Quantity" is off, the mathematical trace values <W> are interpreted as dimensionless quantities. Results in "dB Mag" format are calculated according to <W><sub>log</sub> = 20 \* log (<W>).

# Example:

A mathematical trace value amounts to 1 (real value); the port impedance is  $50 \Omega$ . If "Result is Wave Quantity" is on, the analyzer assumes the trace value to be 1 V, which is converted into a linear power of 20 mW, corresponding to approx. 13 dBm. With "Result is Wave Quantity" off, the trace value 1 is directly converted into a logarithmic power of 0 dBm.

Tip: See also example for CALCulate<Chn>:MATH:WUNit:STATe.

SCPI command:

CALCulate<Chn>:MATH:WUNit[:STATe]

#### Recall... / Save...

Recalls / saves a mathematical expression from / to a trace math string file. Trace math string files are ASCII files with the default extension \*.mth and contain the mathematical expression as it is written in the User Def Math... dialog. It is possible to change or create math string files using a text editor.

SCPI command:

CALCulate<Chn>:MATH:WUNit[:STATe]

## 4.2.4.5 Trace Config > All Mem All Data

Performs actions on all data or memory traces in the active recall set.



Background information

Refer to "Trace Types" on page 27.

Access: TRACE > SCALE key or Alt + Shift + D



#### All Data to Mem

Stores all data traces in the current recall set to memory traces, in accordance with the "Copy Dest" setting. No trace functions are applied to the stored traces.

If no memory trace is associated with a data trace, then a new memory trace is created. The new trace is named "Mem<n+1>[<Data\_Trace>]", where n is the largest of all existing memory trace indices. If several memory traces are associated with a data trace, the newest memory trace is replaced.

SCPI command:

TRACe:COPY

# All Data & Func to Mem

Stores the current state of the active data traces modified by the trace functions to memory traces, in accordance with the "Destination" setting.

# Trace functions

The trace functions comprise the following mathematical operations:

- Any mathematical relation applied to the trace ("Math = Data/Mem, Math = User Def").
- A shift of the trace in horizontal or vertical direction ("TRACE CONFIG > Smooth Shift Hold > Shift Trace").

"All Data to Mem" stores the raw trace without the trace functions, "All Data & Func to Mem" stores the trace after it has been transformed using the trace functions.

SCPI command:

CALCulate<Chn>:MATH:MEMorize

## Destination

Specifies whether data will be copied to existing memory traces ("Mem"), overwriting the previous values, or to "New" memory traces.

SCPI command:

n/a

## Show / Hide All Data / Mem

Displays or hides all data or memory traces. Hidden traces are not deleted.

SCPI command: DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:SHOW

#### Delete all Mem

Deletes all memory traces in the active recall set.

**Tips:** Use "TRACE CONFIG > Traces > Delete Trace" to delete a (single) data trace.

Use the "Trace Manager" to hide traces in the diagrams.

Use the UNDO key to restore a trace that was unintentionally deleted.

SCPI command:

CALCulate<Ch>:PARameter:DELete

# 4.2.4.6 Trace Config > Time Domain

Calculates and displays the results as a function of time. The functionality is part of option R&S ZNB-K2, "Time Domain Analysis". Option R&S ZNB-K2 also provides the "Time Gate" functions.



# **Background information**

Refer to chapter 3.7.1, "Time Domain (R&S ZNB-K2)", on page 112.

For a comparison of the different transformation types and windows and for application examples please also refer to the application note 1EZ44\_OE which is posted on the R&S internet.

Access: TRACE > SCALE key or Alt + Shift + D



User Manual 1173.9163.02 - 13

#### **Time Domain**

Selects the time domain representation for the active diagram area. The softkey is enabled if a linear frequency sweep ("CHANNEL > SWEEP > Sweep Type > Lin. Frequency") is active. The analyzer automatically quits time domain representation as soon as a different sweep type is selected.

The time domain results are obtained by transforming the measured frequency sweep data into the time domain using an appropriate mathematical transformation type and frequency window ("Impulse Response"). The sweep range and the output power for the active channel is still displayed below the diagram; the displayed time interval is shown in a second line:

Ch1Start 9 kHz —Stop 8.5 GHzTrc1Start -1 ns —Stop 4 ns

#### Trace settings in time domain representation

While the time domain representation is active the trace settings behave as follows:

- The "Start" and "Stop" settings in the "Time Gate" tab configure the time axis.
- All trace formats including the circular diagrams are available.
- Limit lines can be defined like the limit lines for time sweeps.
- The bandfilter search functions are available for the transformed trace.
- If marker coupling is active, then the markers in the time domain and in the frequency domain are coupled with each other.

The analyzer places no restriction on the measured quantities to be transformed into the time domain. Impedances and admittances are first converted back into the equivalent S-parameter, transformed, and restored after the transformation.

See also chapter 3.7.1.1, "Chirp z-Transformation", on page 112.

SCPI command:

CALCulate<Chn>:TRANsform:TIME:STATe

#### Type

Selects a band pass or low pass time domain transform. See chapter 3.7.1.2, "Band Pass and Low Pass Mode", on page 112.

To calculate a low pass transform the sweep points must be on a harmonic grid (otherwise the analyzer will only be able to calculate an approximate result and generate a warning). "Low Pass Settings"... opens a dialog to establish or change a harmonic grid (not available for memory traces).

See chapter 4.2.4.7, "Low Pass Settings (Dialog)", on page 206

#### SCPI command:

CALCulate<Chn>:TRANsform:TIME[:TYPE] CALCulate<Chn>:TRANsform:TIME:STIMulus

#### Impulse Response

Selects a window type which the R&S ZNB uses to filter the trace in the frequency domain. The drop-down list shows the impulse response of a constant trace over a finite sweep range (i.e. a rectangular function) that was filtered using the different available window types. The selected window is applied to the active trace.

See also chapter 3.7.1.3, "Windows in the Frequency Domain", on page 114.

**Note:** The frequency domain window is used to filter the trace prior to the time domain transformation. An independent time gate ("TRACE CONFIG > Time Gate") can be used after the transformation in order to eliminate unwanted responses.

The analyzer always uses a "No Profiling (Rectangle)" window to calculate the time-gated frequency domain trace, see "Time-Gated Frequency Domain Trace" on page 117.

SCPI command:

CALCulate<Chn>:TRANsform:TIME:WINDow

# Side Lobe Level

Defines the side lobe suppression for an "Arbitrary Sidelobes (Dolph-Chebychev)" window. The entered value is the ratio of the power of the central lobe to the power of the first side lobe in dB.

SCPI command:

CALCulate<Chn>:TRANsform:TIME:DCHebyshev

## **Resolution Enh(ancement)**

Broadens the frequency range that the analyzer considers for the time domain transform by a linear factor. A factor of 1 means that the original sweep range and the measured sweep points are used; no additional assumptions are made. With higher resolution enhancement factors, the measurement data is extrapolated using a linear prediction method. As a result, the resolution in time domain can be improved.

The ideal resolution enhancement factor depends on the properties of the DUT. In distance to fault measurements on cables, factors between 3 and 5 turned out to be a good choice.

SCPI command:

CALCulate<Chn>:TRANsform:TIME:RESolution:EFACtor

## 4.2.4.7 Low Pass Settings (Dialog)

The "Low Pass Settings" dialog defines the harmonic grid for low pass time domain transforms.



# Background information

Refer to chapter 3.7.1.4, "Harmonic Grid", on page 114.

Access: TRACE > TRACE CONFIG > Time Domain > Low Pass Settings...



## Set Harmonic Grid and Keep

The three buttons provide alternative algorithms for calculation of a harmonic grid, based on the current sweep points.

- Keep "Stop Frequency and Number of Points" calculates a harmonic grid based on the current stop frequency ("STIMULUS STOP") and the current number of sweep points ("CHANNEL SWEEP > Number of Points"). This may increase the frequency gap (the spacing between the equidistant sweep points, i.e. the sweep "Span" divided by the "Number of Points" minus one).
- Keep "Frequency Gap and Number of Points" calculates a harmonic grid based on the current stop frequency ("STIMULUS STOP") and the current frequency gap.
- Keep "Stop Frequency and Approximate Frequency Gap" calculates a harmonic grid based on the current stop frequency ("STIMULUS STOP"), increasing the number of points ("CHANNEL SWEEP > Number of Points") in such a way that the frequency gap remains approximately the same. This may increase the sweep time, due to the additional sweep points introduced.

The three grids can be calculated repeatedly in any order; the analyzer always starts from the original set of sweep points.

For more information refer to chapter 3.7.1.4, "Harmonic Grid", on page 114.

SCPI command:

CALCulate<Chn>:TRANsform:TIME:LPASs


## **DC Value**

The control elements define the measurement result at zero frequency and in the interpolation/extrapolation range between f = 0 and  $f = f_{min}$ . They are enabled after a harmonic grid has been established.

## Defining the low frequency sweep points

After calculating a harmonic grid, the analyzer must determine the value of the measured quantity at zero frequency and possibly at additional points in the range between f = 0 and  $f = f_{min}$ .

The following figure shows a scenario where the harmonic grid was calculated with fixed "Stop Frequency and Number of Points". The DC value and the values at the two additional red points must be extrapolated or interpolated according to the measured sweep points (blue dots) and the properties of the DUT.

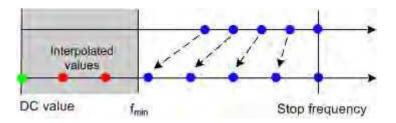

- If the properties of the DUT at f = 0 are sufficiently well known, then it is recommendable to enter the DC value manually ("Manual Entry") and let the analyzer calculate the remaining values (red dots) by linear interpolation of the magnitude and phase.
   Examples: At f = 0 the reflection factor of an open-ended cable is 1. It is –1 for a short-circuited cable and 0 for a cable with matched termination. If a cable with known termination is measured, then these real numbers should be entered as DC values. The "Extrapolate" button initiates an extrapolation of the measured trace towards f = 0 and overwrite the current DC value. This can be used for a consistency check.
- "Continuous Extrapolation" initiates an extrapolation of the measured trace towards lower frequencies, so that the missing values (green and red dots) are obtained without any additional input. The extrapolation is repeated after each sweep.

# SCPI command:

CALCulate<Chn>:TRANsform:TIME:LPASs:DCSParam CALCulate<Chn>:TRANsform:TIME:LPASs:DCSParam:CONTinuous CALCulate<Chn>:TRANsform:TIME:LPASs:DCSParam:EXTRapolate CALCulate<Chn>:TRANsform:TIME:LPFRequency

# 4.2.4.8 Trace Config > Time Gate

Defines and activates a time gate. An active time gate acts on the trace in time domain as well as in frequency domain representation. In time domain representation, you can use the time gate settings in order to eliminate unwanted responses in your signal. After switching back to the frequency domain, you will receive the frequency response of your DUT without the contribution of the unwanted responses. The time gate is independent of the frequency window used to filter the trace prior to the time domain transformation.

The "Time Gate" functionality is part of option R&S ZNB-K2, "Time Domain Analysis". Option R&S ZNB-K2 also provides the "Time Domain" functions.



# **Background information**

Refer to chapter 3.7.1.5, "Time Gates", on page 116.

Access: TRACE > SCALE key or Alt + Shift + D

User Manual 1173.9163.02 - 13



#### **Time Gate**

Enables or disables the time gate for the time domain and frequency domain traces. "Gat" is displayed in the trace list while the time gate is active.

Trc1 S21 dB Mag 10 dB / Ref 0 dB Gat

SCPI command: CALCulate<Chn>:FILTer[:GATE]:TIME:STATe

## **Axis Pair**

"Start" and "Stop" or "Center" and "Span" define the size of the time gate. The analyzer generates a warning if the selected time span exceeds the unambiguous range which is given by  $\Delta t = 1/\Delta f$ , where  $\Delta f$  is the spacing between two consecutive frequency points. Simply reduce the time span until the warning disappears.

SCPI command:

CALCulate<Chn>:FILTer[:GATE]:TIME:CENTer CALCulate<Chn>:FILTer[:GATE]:TIME:SPAN CALCulate<Chn>:FILTer[:GATE]:TIME:STARt CALCulate<Chn>:FILTer[:GATE]:TIME:STOP

#### Show Range Limits

Displays or hides two red lines indicating the start and stop of the time gate in the diagram.

# SCPI command:

CALCulate<Chn>:FILTer[:GATE]:TIME:SHOW

# **Bandpass / Notch**

The filter type defines what happens to the data in the specific time region.

A "Band Pass" filter passes all information in the specified time region and rejects everything else.

 A "Notch" filter rejects all information in the specified time region and passes everything else.

SCPI command:

CALCulate<Chn>:FILTer[:GATE]:TIME[:TYPE]

### Shape

Selects a gate shape which the R&S ZNB uses to filter the trace in the time domain. The drop-down list visualizes how the time gate will affect a constant function after transformation back into the frequency domain. The selected window is applied to the active trace. The two red vertical lines represent the "Start" and "Stop" values defining the size of the time gate.

The R&S ZNB always uses a "Steepest Edges (Rectangle)" window to calculate the timegated frequency domain trace, see "Time-Gated Frequency Domain Trace" on page 117.

See also chapter 3.7.1.5, "Time Gates", on page 116.

SCPI command:

CALCulate<Chn>:FILTer[:GATE]:TIME:SHAPe CALCulate<Chn>:FILTer[:GATE]:TIME:WINDow

# Side Lobe Level

Defines the side lobe suppression for an "Arbitrary Gate Shape (Dolph-Chebychev)" gate. The entered value is the ratio of the power of the central lobe to the power of the first side lobe in dB.

SCPI command: CALCulate<Chn>:FILTer[:GATE]:TIME:DCHebyshev

### 4.2.4.9 Trace Config > Trace Statistics

Evaluates statistical and phase information of the entire trace or of a specific evaluation range and calculates the x-dB compression point.

Access: TRACE > SCALE key or Alt + Shift + D



# **Statistical Functions**

The upper two softkeys in the "Trace Statistics" tab display or hide groups of statistical results. The values are based on all response values of the trace in the selected evaluation range ("Eval Range...").

Suppose that the trace in the evaluation range contains n stimulus values x<sub>i</sub> and n corresponding response values y<sub>i</sub> (measurement points). The statistical values are obtained as follows:

- "Min." and "Max." are the largest and the smallest of all response values y<sub>i</sub>.
- "Pk-Pk" is the peak-to-peak value and is equal to the difference "Max. Min."
- "Mean" is the arithmetic mean value of all response values:

$$Mean = \frac{1}{n} \sum_{i=1}^{n} y_i$$

SDev is the standard deviation of all response values:

Std. Dev. = 
$$\sqrt{\frac{1}{n} \sum_{i=1}^{n} (y_i - \frac{1}{n} \sum_{i=1}^{n} y_i)^2}$$

• RMS is the root mean square (effective value) of all response values:

$$RMS = \sqrt{\frac{1}{n} \sum_{i=1}^{n} |y_i|^2}$$

**Note:** To calculate the Min., Max., Pk-Pk values and the SDev, the analyzer uses formatted response values y<sub>i</sub> (see trace formats). Consequently, the mean value and the standard deviation of a trace depend on the selected trace format. In contrast, the RMS calculation is based on linear, unformatted values. The physical units for unformatted

wave quantities is 1 Volt. The RMS value has zero phase. The selected trace format is applied to the unformatted RMS value, which means that the RMS result of a trace does depend on the trace format.

SCPI command:

```
CALCulate<Chn>:STATistics[:STATe]
CALCulate<Chn>:STATistics:RESult?
CALCulate<Chn>:STATistics:MMPTpeak[:STATe]
CALCulate<Chn>:STATistics:MSTDdev[:STATe]
CALCulate<Chn>:STATistics:RMS[:STATe]
```

## Phase / El Length

Displays or hides the phase delay ("Delay") and the electrical length ("EL") of the trace in the selected evaluation range ("Eval Range..."). The parameters are only available for trace formats that contain phase information, i.e. for the formats "Phase, Unwrapped Phase", and the polar diagram formats "Polar, Smith, Inverted Smith". Moreover, the sweep type must be a "frequency sweep", and the evaluation range must contain at least 3 measurement points.

Statistics: Trc1 (S21) Phs Dly 273.3929 ps El Len 81.9611 mm

The phase parameters are obtained from an approximation to the derivative of the phase with respect to frequency in the selected evaluation range.

 "Delay" is the phase delay, which is an approximation to the group delay and calculated as follows:

$$PD = -\frac{\Delta \phi_{deg}}{360^{\circ} \cdot \Delta f}$$

where  $\Delta f$  is the width of the evaluation range and  $\Delta \Phi$  is the corresponding phase change. See also note on transmission and reflection parameters below.

 "EL" is the electrical length, which is the product of the phase delay times the speed of light in the vacuum.

If no dispersion occurs the phase delay is equal to the group delay. For more information refer to chapter 3.3.7, "Delay, Aperture, Electrical Length", on page 60.

**Note:** To account for the propagation in both directions, the delay and the electrical length of a reflection parameter is only half the delay and the electrical length of a transmission parameter. The formula for PD above is for transmission parameters. See also "Length and delay measurement" in chapter 3.6.1.3, "Auto Length", on page 101.

"Tip:" The phase evaluation can cause misleading results if the evaluation range contains a 360 deg phase jump. The trace format "Unwrapped Phase" avoids this behavior.


SCPI command:

```
CALCulate<Chn>:STATistics[:STATe]
CALCulate<Chn>:STATistics:RESult?
CALCulate<Chn>:STATistics:EPDelay[:STATe]
```

User Manual 1173.9163.02 - 13

#### Flatness / Gain / Slope

Displays or hides trace parameters that the analyzer calculates for the selected evaluation range ("Eval Range...").

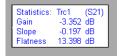

Suppose that A and B denote the trace points at the beginning and at the end of the evaluation range, respectively.

- "Gain" is the larger of the two stimulus values of points A and B.
- "Slope" is the difference of the stimulus values of point B minus point A.
- "Flatness" is a measure of the deviation of the trace in the evaluation range from linearity. The analyzer calculates the difference trace between the active trace and the straight line between points A and B. The flatness is the difference between the largest and the smallest response value of this difference trace.


SCPI command:

```
CALCulate<Chn>:STATistics[:STATe]
CALCulate<Chn>:STATistics:RESult?
CALCulate<Chn>:STATistics:SFLatness[:STATe]
```

#### **Compr Point / Value**


Displays or hides all results related to the x-dB compression point of the trace, where x is the selected compression value. To obtain valid compression point results, a power sweep must be active, and the trace format must be "dB Mag".

The x-dB compression point of an S-parameter or ratio is the stimulus signal level where the magnitude of the measured quantity has dropped by x dB compared to its value at small stimulus signal levels (small-signal value). As an approximation for the small-signal value, the analyzer uses the value at the start level of the evaluation range ("Eval Range...").

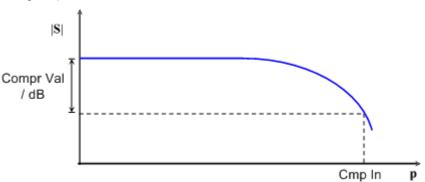

The compression point is a measure for the upper edge of the linearity range of a DUT. It is close to the highest input signal level for which the DUT shows a linear response ( $|a_n| \rightarrow x^*|a_n| \Rightarrow |b_n| \rightarrow x^*|b_n|$ , so that the magnitude of all S-parameters remains constant).

When "Compression Point" is activated, a marker labeled "Cmp" is placed to the compression point with the smallest stimulus level. Moreover the movable "Trace Statistics" info field shows the numerical results of the compression point measurement:

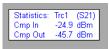

- "Cmp In" is the stimulus level at the compression point in units of dBm. "Cmp In" always corresponds to the driving port level (e.g. the level from port no. j, if a transmission parameter S<sub>ii</sub> is measured).
- "Cmp Out" is the sum of the stimulus level "Cmp In" and the magnitude of the measured response value at the compression point. The magnitude of a transmission S-parameter S<sub>ij</sub> is a measure for the attenuation (or gain) of the DUT, hence: "Cmp Out = Cmp In + <Attenuation>". The example above is based on an attenuation of –20.8 dB, hence "Cmp Out" = -24.9 dB 20.8 dB = -45.7 dBm.

The info field shows invalid results ('----') if the wrong sweep type or trace format is selected, or if the trace contains no x-dB compression points in the selected evaluation range.

SCPI command:

```
CALCulate<Chn>:STATistics:NLINear:COMP[:STATe]
CALCulate<Chn>:STATistics:NLINear:COMP:RESult?
CALCulate<Chn>:STATistics:NLINear:COMP:LEVel
CALCulate<Chn>:STATistics[:STATe]:AREA
```

### **Decimal Places**

Opens the "System Config" dialog to define the (maximum) number of fractional digits for setting values and measurement results. See also chapter 4.6.2.3, "User Interface", on page 424.

## 4.2.4.10 Evaluation Range (Dialog)

The "Evaluation Range" dialog defines the range for the "Trace Statistics" results. The evaluation range is a continuous interval of the sweep variable.

See also chapter 4.2.4.9, "Trace Config > Trace Statistics", on page 210.

Access: TRACE > TRACE CONFIG > Trace Statistics > Eval Range...

	Define Evaluation Range
	Range 1
	Start
Display Config	(100 kHz
🕳 Range Limit	Stop
Lines On	8.5 GHz

## **Evaluation Range**

Selects a predefined evaluation range. Up to ten different ranges are available for each recall set. "Full Span" means that the search range is equal to the entire sweep range. The statistical and phase evaluation and the compression point measurement take into account all measurement points with stimulus values x<sub>i</sub> between the "Start" and "Stop" value of the evaluation range:

"Start  $\leq x_i \leq \text{Stop}$ "

**Note:** The evaluation ranges are identical to the marker search ranges. For more information see chapter 4.2.6.4, "Search Range (Dialog)", on page 245.

SCPI command:

CALCulate<Chn>:STATistics:DOMain:USER CALCulate<Chn>:STATistics:DOMain:USER:STARt CALCulate<Chn>:STATistics:DOMain:USER:STOP

#### **Range Limit Lines on**

Displays or hides the range limit lines in the diagram area. Range limit lines are two vertical lines at the Start and Stop values of the active evaluation range ("Range 1" to "Range 10").

## SCPI command:

CALCulate<Chn>:STATistics:DOMain:USER:SHOW

## 4.2.4.11 Trace Config > Smooth Shift Hold

Provides various functions to modify the entire measured trace.



#### Trace functions and exported data

The analyzer can export the raw complex (unformatted) data or formatted data. The unformatted data are independent of all "Smooth Shift Hold" settings; see "Formatted Values" on page 221.

Access: TRACE > SCALE key or Alt + Shift + D



## Smoothing

Activates the smoothing function for the active trace, which may be a data or a memory trace. With active smoothing function, each measurement point is replaced by the arithmetic mean value of all measurement points located in a symmetric interval centered on the stimulus value. The width of the smoothing interval is referred to as the "Smoothing Aperture" and can be adjusted according to the properties of the trace.

**Tip:** The sweep average is an alternative method of compensating for random effects on the trace by averaging consecutive traces. Compared to smoothing, the sweep average requires a longer measurement time but does not have the drawback of averaging out quick variations of the measured values. See chapter 4.4.1.3, "Power Bw Avg > Average", on page 261.

SCPI command: CALCulate<Chn>:SMOothing[:STATe]

#### Aperture

Defines how many measurement points are averaged to smooth the trace if smoothing is switched on. The "Smoothing Aperture" is entered as a percentage of the total sweep span.

An aperture of n % means that the smoothing interval for each sweep point i with stimulus value  $x_i$  is equal to  $[x_i - \text{span}^n/200, x_i + \text{span}^n/200]$ , and that the result of i is replaced by the arithmetic mean value of all measurement points in this interval. The average is calculated for every measurement point. Smoothing does not significantly increase the measurement time.

Tips: Finding the appropriate aperture

A large smoothing aperture enhances the smoothing effect but may also average out quick variations of the measured values and thus produce misleading results.

To avoid errors, observe the following recommendations.

- Start with a small aperture and increase it only as long as you are certain that the trace is still correctly reproduced.
- As a general rule, the smoothing aperture should be small compared to the width of the observed structures (e.g. the resonance peaks of a filter). If necessary, restrict the sweep range or switch smoothing off to analyze narrow structures.

SCPI command:

CALCulate<Chn>:SMOothing:APERture on page 562

## Hold

Selects the Max Hold (peak hold) or Min Hold function for the active trace, or disables both functions (Hold Off). With enabled Max Hold or Min Hold function, the displayed trace shows the maximum or minimum values that the analyzer acquired since the start of the measurement. The max hold and min hold trace is real, it is based on the magnitude of the trace values (the phase values are discarded).

The max hold or min hold process can be restarted any time using "Restart". It is also restarted automatically when the channel or trace settings are changed so that the previous measurement results are no longer compatible.

**Note:** A memory trace is unformatted by definition. Therefore, "Data --> Mem" stores the last measured trace instead of the real Max Hold or Min Hold trace.

SCPI command:

CALCulate<Chn>:PHOLd

### Shift Trace > Stimulus

Shifts the active trace in horizontal direction, leaving the positions of all markers unchanged. The unit of the offset value depends on the sweep type.

## Note:

"Shift Stimulus Value" can be used in Cartesian as well as in polar diagrams. The visible effect depends on the diagram type:

- In Cartesian diagrams, the trace is shifted relative to the markers and the x-axis.
- In polar diagrams, the trace is not affected, however, markers change their position.

SCPI command:

DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:X:OFFSet

# Shift Trace > Mag / Phase / Real / Imag

Modifies all points of the active trace by means of an added and/or a multiplied complex constant.

The units of the constants are adjusted to the format of the active trace. Setting all values to zero ("Shift Reset") restores the original trace.

The trace points are modified according to the following formula:

$$M_{new} = M_{old} \cdot 10^{<\text{Magnitude} > /20 \text{ dB}} a \cdot e^{j \cdot <\text{Phase} > /180^\circ} + <\text{Real} > +j <\text{Imag} >$$

The formula and the different constants are adjusted to the different display formats of a trace:

 The "Mag(nitude)" factor shifts a dB Mag trace in vertical direction, leaving the phase of a complex parameter unchanged.

- The "Phase" factor rotates a trace that is displayed in a polar diagram around the origin, leaving the magnitude unchanged.
- The "Real" added constant shifts a real trace in vertical direction, leaving the imaginary part unchanged.
- The "Imag(inary)" added constant shifts a imaginary trace in vertical direction, leaving the real part unchanged.

**Tip:** Shifting the trace by means of constant values is a simple case of trace mathematics. Use the "User Defined Math" dialog to define more complicated mathematical operations. See chapter 4.2.4.4, "User Def Math (Dialog)", on page 199.

SCPI command: DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:Y:OFFSet

# 4.2.4.12 Trace Config > Trace Data

Stores one or several data or memory traces to a file or loads a memory trace from a file.



# **Background information**

Refer to chapter 3.4.2, "Trace Files", on page 66.





## Import...

Calls up a dialog to load a memory trace from a trace file. See chapter 4.2.4.13, "Import Complex Data (Dialog)", on page 219.

SCPI command: MMEMory:LOAD:TRACe

#### Export...

Calls up a dialog to store data or memory traces to a trace file of the selected file format. See chapter 4.2.4.14, "Export Data (Dialog)", on page 220

SCPI command:

MMEMory:STORe:TRACe on page 668 MMEMory:STORe:TRACe:CHANnel MMEMory:STORe:TRACe:PORTs

# s?p Free Config...

For four-port R&S ZNB analyzers only: Opens a dialog to define the port assignment for the created Touchstone (\*.s < n > p) file. See chapter 4.2.4.16, "Select Ports (Dialog)", on page 222.

### 4.2.4.13 Import Complex Data (Dialog)

The "Import Complex Data" dialog loads a memory trace from a trace file. Trace files are ASCII files with selectable file format. The loaded trace data is used to generate a memory trace which is coupled to the active data trace.



# **Background information**

Refer to chapter 3.4.2, "Trace Files", on page 66.



On loading data from a trace file with several traces, the analyzer displays a dialog to select one of the traces stored in the file (see chapter 4.2.4.15, "Select Parameters (Dialog)", on page 222). E.g. for an \*.s2p Touchstone file, the box offers all four 2-port S-parameters (see chapter 3.4.2.1, "Touchstone Files", on page 66).

User Manual 1173.9163.02 - 13

Coupling between the imported memory trace and the active data trace implies that the stimulus values of the imported data and of the active trace must be compatible. Compatibility means that the "Sweep Type" of the two traces must match; the position and number of the sweep points do not have to be the same.

The analyzer checks for compatibility before importing data. The "Select Parameter" box remains empty if the selected files contains no compatible data.

"Import Complex Data" is a standard "Open File" dialog with an additional button.

#### Import Data to New Mem

Qualifies whether the loaded data overwrite the active memory trace (box unchecked, analogous to "Data -> Mem" with selected memory trace) or whether they are used to generate a new memory trace (box checked, analogous to "Data -> Mem" with selected "New" memory trace).

SCPI command: MMEMory:LOAD:TRACe

# 4.2.4.14 Export Data (Dialog)

The "Export Data" dialog stores data or memory traces to a trace file. Trace files are ASCII files with selectable file format.

Data export can serve many purposes, e.g.:

- To process and evaluate measurement data in an external application.
- To store measurement data and re-import it in a future measurement session.



#### Background information

Refer to the following sections:

- chapter 3.4.2, "Trace Files", on page 66.
- chapter 3.4.2.3, "Finding the Best File Format", on page 69

Access: TRACE > TRACE CONFIG > Trace Data > Export...



User Manual 1173.9163.02 - 13

"Export Data" is a standard "Save File" dialog with a number of additional buttons to specify the export options. Many options depend on the selected export file format ("Files of Type"). The displayed option buttons change accordingly.

The export options are remembered when the dialog is closed.

### Ask before Overwriting

Activates a message box to be displayed before an older trace file with the same file name and directory is overwritten.

## Add Ref Impedances

For ASCII (\*.csv) or Matlab (\*.dat) files only: Includes the reference impedances  $Z_0$  for all analyzer ports in the file header.

# **Formatted Values**

For ASCII (\*.csv) or Matlab (\*.dat) files only: Selects the format for the exported trace data.

Check box cleared (off): Export the raw complex (unformatted) measurement values, represented by the real and imaginary parts, the linear magnitude and phase, or dB magnitude and phase.

The exported complex trace values are the values at the beginning of the trace data flow. None of the following stages (trace mathematics, shift, time domain gate, trace formatting and smoothing) affects the exported data. "Save" writes the raw stimulus values (frequency/power/time, according to the sweep type) and the raw, complex measurement points to a file. See chapter 3.1.5, "Data Flow", on page 18. Export of complex data is available for all trace file types.

 Check box selected (on): Export the the values as they are displayed in the diagram, e.g. export the logarithmic magnitude, if trace format "dB Mag" is selected. The trace file does not necessarily contain the full (complex) information about the trace. For trace formats involving Cartesian diagrams (dB Mag, Real, Imag...), the stimulus value and a single real response value is exported. For circular diagrams, both the real and imaginary part of the response value is exported.

The trace values are the fully processed values as they appear in the diagram area. They correspond to the results in the marker info field. All possible stages of the trace data flow (e.g. trace formats, trace mathematics, time domain transform, shift, smoothing) are taken into account. Some trace functions (e.g. time scale, shift stimulus) also affect the stimulus values.

Export of formatted data is not available for Touchstone files.

#### **Output Format**

For Touchstone file export only: Selects the the format of the exported raw, complex measurement values. The exported values can be represented by the real and imaginary parts, the linear magnitude and phase, or dB magnitude and phase; see also "Formatted Values" on page 221.

Export of formatted data is not available for Touchstone files.

### Contents

Selects only the active trace or all traces of the active channel (including all data and memory traces) or all traces in all channels for data export to an ASCII (\*.csv) or Matlab (\*.dat) file.

For Touchstone file export, it is possible to export the traces in the active channel or in all channels. See also "Conditions for Touchstone file export" on page 67.

## **Decimal Separator**

For ASCII (\*.csv) files only: Selects either the "Point" or the "Comma" (if needed to process the exported data with an external application) as a separator for decimal numbers.

#### **Field Separator**

For ASCII (\*.csv) or Matlab (\*.dat) files only: Defines the separator that the analyzer uses to separate different numbers in each line of the file.

#### Save

Stores the trace data, according to the selected options.

Tip: Note the conditions described in "Conditions for Touchstone file export" on page 67.

SCPI command:

MMEMory:STORe:TRACe on page 668
MMEMory:STORe:TRACe:CHANnel

## 4.2.4.15 Select Parameters (Dialog)

The "Select Parameters" dialog provides a selection of measurement results (e.g. Sparameters) or traces, e.g. for trace import, import of power correction coefficients, limit line import.

Access: The dialog may be called from several dialogs, e.g. "TRACE > TRACE CONFIG > Trace Data > Import...".



# 4.2.4.16 Select Ports (Dialog)

The "Select Ports" dialog defines the port assignment for the created Touchstone (\* . s < n > p) file.



#### Touchstone files and file export

Note the conditions described in "Conditions for Touchstone file export" on page 67.

Access: TRACE > TRACE CONFIG > Trace Data > s?p Free Config...

User Manual 1173.9163.02 - 13



# **Port State**

Selects the subset of ports considered for the S-parameter export.

**Example:** With active ports no. 1 and 2, it is possible to export the S-parameters  $S_{11}$ ,  $S_{12}$ ,  $S_{21}$ ,  $S_{22}$ .

SCPI command: MMEMory:STORe:TRACe:PORTs

### Port Assign

Selects the port number assignment in the created \*.s<n>p file. By default, analyzer and \*.s<n>p port numbers are identical. You can interchange the port assignment in order to change the order of the S-parameters in the created 'Touchstone file. Each of the analyzer port numbers must be assigned to one \*.s<n>p port number.

### Checks and messages in the dialog

After each port or channel selection, the R&S ZNB checks the channel data for compatibility with the trace export conditions. If data from "All Channels" are exported, every single channel must contain a compatible set of traces; see "Conditions for Touchstone file export" on page 67.

The "OK" button is available only if no error message is displayed in the dialog.

# 4.2.5 Lines Settings

The commands in the "Lines" tab define limits for the measurement results, visualize them in the diagrams and activate/deactivate the limit check. The analyzer provides upper, lower, and ripple limits. Besides the menu provides a horizontal line for each trace.




# **Background information**

Refer to chapter 3.4.1, "Limit Check", on page 61.

# 4.2.5.1 Lines > Limit Test

Defines limits for the measurement results, visualizes them in the diagrams and activates/ deactivates the limit check. The analyzer provides upper and lower limits, and a circle test.

Limit lines are available for all Cartesian diagram types (TRACE > FORMAT). For Smith and Polar diagrams, the circle test is available.

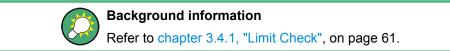

Access: TRACE > SCALE key or Alt + Shift + E



### **Show Limit Line**

Shows or hides the limit line associated with the active trace in a Cartesian diagram area.



The limit line colors are defined in the "Define User Color Scheme" dialog ("SYSTEM > DISPLAY > Config > Define User Color..."). You can choose between various options:

- Display upper and lower limit lines with different colors.
- Assign the same color to traces and associated limit lines.
- Assign different colors to limit line segments with disabled limit check.

User Manual 1173.9163.02 - 13

**Note:** Display of the limit line and limit check are independent of each other: Hiding the limit line does not switch off the limit check.

SCPI command:

CALCulate<Chn>:LIMit:DISPlay[:STATe]

## Limit Check

Switches the limit check of the active trace on or off.

When the limit check is switched on, a movable "PASS" or "FAIL" message is displayed in the diagram. If the limit check fails at a measurement point, the point is marked with a colored square. The "Limit Fail Trace" color is defined in the "Define User Color Scheme" dialog ("Display > Display Config. > Define User Color..."). An acoustic signal ("Global Beep") and a TTL signal indicating pass or fail can be generated in addition.



The appearance of the limit fail symbols is defined in the "Define User Color Scheme" dialog ("SYSTEM > DISPLAY > Config > Define User Color..."). You can choose between various options:

- Change the trace color between failed measurement points.
- Show or hide the colored squares.

**Note:** Limit check and display of the limit lines are independent of each other: With disabled limit check, the limit line can still be displayed. If no limit lines are defined for the active trace, the limit check can be switched on but will always PASS the trace.

SCPI command:

CALCulate<Chn>:LIMit:STATe CALCulate<Chn>:LIMit:LOWer:STATe CALCulate<Chn>:LIMit:UPPer:STATe CALCulate<Chn>:LIMit:FAIL? CALCulate<Chn>:LIMit:STATe:AREA

## Limit Fail Beep

Activates or deactivates the fail beep. The fail beep is a low-tone acoustic signal that is generated each time the analyzer detects an exceeded limit. No fail beep can be generated if the limit check is switched off.

SCPI command:

CALCulate<Chn>:LIMit:SOUNd[:STATe]

# Clear Test

Resets the limit check results.

SCPI command: CALCulate<Chn>:LIMit:CLEar

# **Global Check**

Activates or deactivates the global limit check including upper/lower limits and ripple limits. The global limit check is a composite limit check over all traces of the current recall set. The result of the global check appears in a semi-transparent popup box whenever "Global Limit Check" is selected.



- "PASS "represents pass for all traces with enabled limit check. A trace without limit lines or with disabled individual limit check always passes the global check.
- "FAIL" means that the limit check for one or more traces failed.

SCPI command:

CALCulate:CLIMits:FAIL?

# TTL 1 / 2 Pass

Assigns the active trace to the low-voltage (3.3 V) TTL output signals at the "USER PORT" connector (see chapter 9.1.1.1, "USER PORT", on page 922). To generate the signals, the limit check of the active trace must be switched on.

- If "TTL 1 Pass" is selected and the active trace passes the limit check (including upper/lower limits and ripple limits), then the TTL signal is applied to pin 13 of the "USER PORT" connector.
- If "TTL 2 Pass" is selected and the active trace passes the limit check (including upper/lower limits and ripple limits), then the TTL signal is applied to pin 14 of the "USER PORT" connector.

If the active trace exceeds the limits, then no TTL signal is generated. It is possible to activate both pass/fail signals for the same trace or assign several traces to a signal.

### Monitoring several traces

If a channel contains several traces, is possible to assign them one after another to each pass/fail signal. The procedure divides the traces of the channel into four groups that are either assigned to signal 1, to signal 2, to both signals, or to none of them.

If several traces with independent limit check are assigned to a pass/fail signal, then the TTL signal is generated only if all traces are within limits. It is switched off as soon as one trace exceeds the limits.

# **Application: Graduated limit check**

The two pass/fail signals can be used to distinguish three quality levels of a DUT. The test is performed with a looser and a tighter set of limit lines that are assigned to two traces with identical channel and trace settings. The limit check for the two traces is monitored by means of the signals "TTL Out Pass 1 /TTL Out Pass 2", respectively.

- If the DUT is passed in both limit checks, the quality is good.
- If the DUT is failed in the limit check with tighter limits, the quality is still sufficient.
- If the DUT is failed in both limit checks, the quality is poor.

Instead of using two traces, it is possible to consider two groups of traces that are assigned to "TTL 1 Pass" and "TTL 2 Pass".

SCPI command:

CALCulate<Chn>:LIMit:TTLout<Pt>[:STATe]

# 4.2.5.2 Define Limit Lines (Dialog)

The "Define Limit Lines" dialog defines the limit lines for the active trace on a segmentby-segment basis. In each segment the limit line is defined as a straight line connecting two points.



# Creating limit lines with minimum effort

Choose one of the following methods to efficiently create and handle limit lines:

- To define limit lines with only a few segments, use "Add Segment" and edit each segment in the segment table individually.
- Select a data or memory trace as a limit line ("Import Trace...") or import a trace stored in a file ("Import File...").
- Save your limit lines to a file so you can re-use or modify them later sessions ("Save Limit Line..., Recall Limit Line...").



### Background information

Refer to chapter 3.4.1, "Limit Check", on page 61.

Access: TRACE > LINES > Limit Test > Define Limit Line...

	Type	*	Start Stimulus	Stop Stimulus	Start Response	Stop Response
1	Upper	\$	100 kHz	3 GHz	-10 dB	-10 dB
2	Lower	\$	100 kHz	1 GHz	-20 dB	-15 dB
3	Lower	\$	2 GHz	3 GHz	-15 dB	-20 dB
	044	V a	alata 🌆 Get	Receille 1		
+	Add	X D	elete Get Trace			-

The "Define Limit Lines" dialog contains a table to edit the individual segments of the limit lines. The buttons below the table extend or shorten the segment list.

#### Segment List

Defines the individual limit line segments.

The table contains an automatically assigned current number for each segment plus the following editable columns:

- "Type" indicates whether the segment belongs to an "Upper" or a "Lower" limit line, or if the limit check at the segment is switched "Off". Switching off the limit check does not delete the segment but changes its screen color.
- "Start Stimulus" is the stimulus (x-axis) value of the first point of the segment.
- "Stop Stimulus" is the stimulus (x-axis) value of the last point of the segment.
- "Start Response" is the response (y-axis) value of the first point of the segment.
- "Stop Response" is the response (y-axis) value of the last point of the segment. The limit line segment is calculated as a straight line connecting the two points (<Start Stimulus>, <Start Response>) and (<Stop Stimulus>, <Stop Response>); see chapter 3.4.1.1, "Rules for Limit Line Definition", on page 61.

SCPI command:

```
CALCulate<Chn>:LIMit:SEGMent:COUNt?
CALCulate<Chn>:LIMit:SEGMent<Seg>:TYPE
CALCulate<Chn>:LIMit:SEGMent<Seg>:STIMulus:STARt
CALCulate<Chn>:LIMit:SEGMent<Seg>:STIMulus:STOP
CALCulate<Chn>:LIMit:SEGMent<Seg>:AMPLitude:STARt
CALCulate<Chn>:LIMit:SEGMent<Seg>:AMPLitude:STOP
CALCulate<Chn>:LIMit:CONTrol[:DATA]
CALCulate<Chn>:LIMit:CONTrol:SHIFt
CALCulate<Chn>:LIMit:DATA
CALCulate<Chn>:LIMit:LOWer[:DATA]
CALCulate<Chn>:LIMit:LOWer[:DATA]
CALCulate<Chn>:LIMit:LOWer[:DATA]
CALCulate<Chn>:LIMit:LOWer[:DATA]
CALCulate<Chn>:LIMit:UPPer[:DATA]
CALCulate<Chn>:LIMit:UPPer[:DATA]
```

# Add / Insert / Delete / Delete All

The first four buttons below the segment list extend or shorten the list. The analyzer places no restriction on the number of segments in a limit line.

- Add adds a new segment to the end of the list. The new segment extends from the "Stop Stimulus" value of the last segment to the end of the sweep range. Its response values are equal to the "Stop Response" value of the last segment.
- Insert adds a new segment before the active segment (marked by a blue background in the first column of the segment list). The new segment extends from the "Stop Stimulus" value of the segment before the active segment to the "Start Stimulus" value of the active segment. Its response values are equal to the "Start Response" value of the active segment. The segment numbers in the list are adapted. If no segment is active, "Insert" is equivalent to "Add".
- Delete removes the selected segment from the list.
- Delete All clears the entire segment list so it is possible to define or load a new limit line.

SCPI command:

CALCulate<Chn>:LIMit:DELete:ALL

# Recall / Save Limit Line...

The buttons open an Open File / Save File dialog to load a limit line from a limit line file or store the current limit line configuration to a file.

Limit line files are ASCII files with the default extension \* .limit and a special file format. See chapter 3.4.1.4, "File Format for Limit Lines", on page 65.

SCPI command:

MMEMory:LOAD:LIMit MMEMory:STORe:LIMit

### Import Trace / File...

The buttons open a dialog to load a limit line from a data or memory trace in the active recall set or from a trace which has been stored to a file (see chapter 4.2.4.12, "Trace Config > Trace Data", on page 218).

Imported traces are polygonal curves with n points and n - 1 segments. The number of points n is set via "CHANNEL > SWEEP > Sweeps > Number of Points". The n - 1 segments are appended to the current segment table for further editing. Existing limit line segments are not overwritten.

The import dialogs contain a list of all available traces or files and the following file import settings.

- "Offsets" contains two input fields to define constant offset values for all imported segments. The "Response" offset shifts all segments in vertical direction, the "Stimulus" offset shifts them in horizontal direction. The offsets are added to the start and stop values of all segments.
- "Type" defines whether the imported segments belong to the "Upper" or "Lower" limit line. A third option is to import the segments but disable the limit check ("Off").

SCPI command:

CALCulate<Chn>:LIMit:LOWer:FEED CALCulate<Chn>:LIMit:UPPer:FEED

# 4.2.5.3 Lines > Ripple Test

Defines ripple limits for the measurement results, visualizes them in the diagrams and activates/deactivates the ripple limit check. A ripple test is a special type of limit test where the maximum **difference** between the largest and the smallest response value of the trace must not exceed the specified limit.

Ripple limit lines are available for all Cartesian diagram types (TRACE > FORMAT). For polar diagrams, the functions of the "Ripple Test" softool except the "Global Check" are grayed. The ripple limit lines are hidden and the limit check is disabled when a Cartesian trace format is replaced by a polar diagram.

# Background information

Refer to chapter 3.4.1, "Limit Check", on page 61.

Lines X Show Ripple Limit Test Ripple Fail Ripple Fail Ripple Fail Show Results All Traces Def. Ripple Test. Global Check TL1 TL2 Pass

Access: TRACE > SCALE key or Alt + Shift + E

Some of the softkeys are coupled to the softkeys in the "Limit Test" tab and provide identical results:

- Global Check
- TTL 1 / 2 Pass

# **Show Ripple Limits**

Shows or hides the ripple limit lines associated with the active trace in a Cartesian diagram area. The vertical positions of the ripple lines are re-calculated after each sweep; only their stimulus range and distance (the ripple limit) is fixed.

Note:



Display of the ripple limit line and limit check are independent of each other: Hiding the limit line does not switch off the limit check.


SCPI command:

CALCulate<Chn>:RIPPle:DISPlay[:STATe]

### **Ripple Check**

Switches the ripple limit check of the active trace on or off.

When the limit check is switched on, a movable info field shows the pass/fail information and the measured ripple in each ripple limit range. If the ripple limit check fails at a measurement point, the point is marked with a colored square. The "Limit Fail Trace" color is defined in the "Define User Color Scheme" dialog ("Display > Display Config. > Define User Color..."). An acoustic signal ("Global Beep") and a TTL signal indicating pass or fail can be generated in addition.

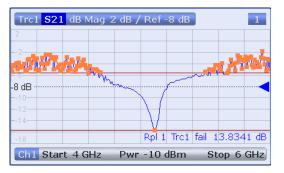

**Note:** Ripple limit check and display of the ripple limit lines are independent of each other: With disabled limit check, the limit line can still be displayed. If no limit lines are defined for the active trace, the limit check can still be switched on but the info field will display a warning ("No ripple defined!").

SCPI command:

```
CALCulate<Chn>:RIPPle:STATe
CALCulate<Chn>:RIPPle:FAIL?
CALCulate<Chn>:RIPPle:SEGMent<Seg>:RESult?
CALCulate<Chn>:RIPPle:STATe:AREA
```

User Manual 1173.9163.02 - 13

### Ripple Fail Beep

Activates or deactivates the fail beep. The fail beep is a low-tone acoustic signal that is generated each time the analyzer detects an exceeded ripple limit. No fail beep can be generated if the ripple limit check is switched off.

SCPI command:

CALCulate<Chn>:RIPPle:SOUNd[:STATe]

## Show Results All Traces

Shows or hides the info fields for all traces in the active recall set for which a limit check is enabled, irrespective of the active trace. If "Show Results All Traces" is disabled (and the ripple check is on), the info field for the active trace is displayed only.

SCPI command: No command; display configuration only.

# Clear Test

Resets the limit check results. SCPI command: CALCulate<Chn>:RIPPle:CLEar

# 4.2.5.4 Define Ripple Test (Dialog)

The "Define Ripple Test" dialog defines the ripple limits for the active trace on a rangeby-range basis. A separate ripple limit can be assigned to each range.



# Defining ripple limits with minimum effort

Choose one of the following methods to efficiently create and handle ripple limit ranges:

- To configure a limit test with only a few ranges, use "Add" and edit each range in the table individually.
- Use the "Align All" button to create non-overlapping, contiguous ranges of equal width.
- Save your ripple ranges to a file so you can re-use or modify them later sessions ("Save Ripple Test..., Recall Ripple Test...").



# **Background information**

Refer to chapter 3.4.1, "Limit Check", on page 61.

Access: TRACE > LINES > Ripple Test > Def. Ripple Test...

I     GHz     2     GHz     10     dB       IV     2     GHz     4     GHz     12     dB       IV     4     GHz     6     GHz     15,1203     dB	Î	Range On/Off \land	Start Stimulus	Stop Stimulus	Ripple Limit	
₩ 4 GHz 6 GHz 15,1203 dB	1	<b>v</b>	1 GHz	2 GHz	10 dB	
		<b>v</b>	2 GHz	4 GHz	12 dB	
Recall	<b>b</b>	<b>v</b>	4 GHz	6 GHz	15,1203 dB	
		🔺 Add 🛛 👋 I	Delete Recall	Test Align All		

The "Define Ripple Test" dialog contains a table to edit the individual ranges of the ripple check ranges. The buttons below the table extend, shorten, or re-order the range list and save/recall ripple test data.

#### Range List

Defines the individual ripple limit ranges.

The table contains an automatically assigned current number for each range plus the following editable columns:

- "Range On/Off" enables or disables the ripple limit check in each range. Disabling the ripple limit check does not delete the range but hides the entry in the info field.
- "Start Stimulus" is the smallest stimulus (x-axis) value of the range.
- "Stop Stimulus" is the largest stimulus (x-axis) value of the range.
- "Ripple Limit" is the maximum allowed difference between the largest and the smallest trace value in the range.

The ripple limit range is displayed as two parallel, horizontal lines in the diagram. "Stop Stimulus" – "Start Stimulus" is the length of both lines (if the range is within the sweep range); "Ripple Limit" is their vertical distance. See chapter 3.4.1.2, "Rules for Ripple Test Definition", on page 63.

SCPI command:

CALCulate<Chn>:RIPPle:SEGMent<Seg>[:STATe] CALCulate<Chn>:RIPPle:SEGMent<Seg>:STIMulus:STARt CALCulate<Chn>:RIPPle:SEGMent<Seg>:STIMulus:STOP CALCulate<Chn>:RIPPle:SEGMent<Seg>:LIMit CALCulate<Chn>:RIPPle:SEGMent:COUNt?

# Add / Insert / Delete / Delete All / Align All

The first four buttons below the range list extend, shorten, or re-order the list.

- Add adds a new range to the list. The new range is and inserted after the previously selected range. The current range numbers are adapted; the start and stop stimulus values are set so that an overlap is avoided. Moreover, the ripple limit is estimated according to the measured ripple of the trace in the created range. The analyzer places no restriction on the number of ranges assigned to each trace.
- Insert adds a new range before the active range (marked by a blue background in the first column of the range list). The new range extends from the "Stop Stimulus"

value of the range before the active range to the "Start Stimulus" value of the active range. Its ripple limit is estimated according to the measured ripple of the trace in the created range. The range numbers in the list are adapted.

If no range is active, "Insert" is equivalent to "Add".

- **Delete** removes the selected range from the list.
- Delete All clears the entire range list so it is possible to define or load a new ripple limit line.
- Align All subdivides the entire sweep range into contiguous ripple limit ranges of equal width. The ripple limits are estimated according to the measured ripple of the trace in the created ranges.

SCPI command:

CALCulate<Chn>:RIPPle:CONTrol:DOMain CALCulate<Chn>:RIPPle:DATA CALCulate<Chn>:RIPPle:DELete:ALL

#### Recall / Save Ripple Test...

The buttons open an Open File / Save File dialog to load a ripple limit line from a ripple limit file or store the current ripple limit configuration to a file.

Ripple limit files are ASCII files with the default extension \*.ripple and a special file format. See chapter 3.4.1.5, "File Format for Ripple Limits", on page 65.

SCPI command:

MMEMory:LOAD:RIPPle MMEMory:STORe:RIPPle

# 4.2.5.5 Circle Test

Defines circular limit lines for the measurement results in circular diagrams ("Polar", "Smith", "Inverted Smith"), visualizes them in the diagram and activates/deactivates the circle limit check.

Most of the control elements in the "Circle Test" tab are unavailable unless the active diagram is a circular diagram.



# **Background information**

Refer to chapter 3.4.1.3, "Circle Limits", on page 64.

Access: TRACE > SCALE key or Alt + Shift + E



Some of the softkeys are coupled to the softkeys in the "Limit Test" tab and provide identical results:

- Global Check
- TTL 1 / 2 Pass

### **Show Limit Circle**

Shows or hides the limit line associated with the active trace in a polar diagram area.



The limit line colors are defined in the "Define User Color SCheme" dialog ("Display > Config > Define User Color..."). You can choose between various options:

- Assign the same color to traces and associated limit lines.
- Assign different colors to limit line segments with disabled limit check.

**Note:** Display of the limit line and limit check are independent of each other: Hiding the limit line does not switch off the limit check.

SCPI command: CALCulate<Chn>:LIMit:CIRCle:DISPlay[:STATe]

# Limit Check

Switches the limit check of the active trace on or off.

When the limit check is switched on, a movable "PASS" or "FAIL" message is displayed in the diagram. If the limit check fails at a measurement point, the point is marked with a colored square. The "Limit Fail Trace" color is defined in the "Define User Color Scheme" dialog ("Display > Display Config. > Define User Color..."). An acoustic signal ("Global Beep") and a TTL signal indicating pass or fail can be generated in addition.



The appearance of the limit fail symbols is defined in the "Define User Color SCheme" dialog ("Display > Config > Define User Color..."). You can choose between various options:

- Change the trace color between failed measurement points.
- Show or hide the colored squares.

**Note:** Limit check and display of the limit lines are independent of each other: With disabled limit check, the limit line can still be displayed. If no limit lines are defined for the active trace, the limit check can be switched on but will always PASS the trace.

SCPI command:

CALCulate<Chn>:LIMit:CIRCle[:STATe] CALCulate<Chn>:LIMit:CIRCle:FAIL?

#### Limit Fail Beep

Activates or deactivates the fail beep. The fail beep is a low-tone acoustic signal that is generated each time the analyzer detects an exceeded limit. No fail beep can be generated if the limit check is switched off.

SCPI command:

CALCulate<Chn>:LIMit:CIRCle:SOUNd[:STATe]

### Clear Test

Resets the limit check results.

SCPI command:

CALCulate<Chn>:LIMit:CIRCle:CLEar

# **Draw Circle**

Activates touchscreen operation; tap the diagram at one border of the limit circle and draw the circle to the required size and position.

SCPI command: n/a

## Radius / Center X/Y

Defines the limit circle by its radius and its center on the x-axis and y-axis.

SCPI command:

CALCulate<Chn>:LIMit:CIRCle:DATA

# 4.2.5.6 Lines > Horizontal Line

Shows or hides the horizontal line associated to the active trace in a Cartesian diagram area. The horizontal line (or display line) can be moved to particular trace points in order to retrieve the response values. It also shows which parts of a trace are above or below a definite response value.

Access: TRACE > SCALE key or Alt + Shift + E



## **Response Value**

Defines/shows the response value of the horizontal line.

**Tip:** Use the R&S ZNB's drag-and-drop functionality to move the horizontal line to a particular position. The response value appears in the numeric entry field. SCPI command:

CALCulate<Chn>:DLINe

## **Horizontal Line**

Displays or hides the horizontal line. SCPI command: CALCulate<Chn>:DLINe:STATe

# 4.2.6 Marker Settings

The marker settings are used to position markers on a trace and define their properties. Markers are also convenient tools for searching special points on traces and for scaling diagrams.



# **Background information**

Refer to the following sections:

- chapter 3.2.2.3, "Markers", on page 28
- chapter "Using Marker Functions" in the Help or in the Getting Started guide

User Manual 1173.9163.02 - 13

# www.valuetronics.com

# 4.2.6.1 Marker > Markers

Creates markers and configures their properties. Markers are available for all diagram types (TRACE > FORMAT). A first marker labeled "M1" is automatically created when the MARKER key is pressed.

The "Mkr 1 ... Mkr 10" and "Ref Mkr" softkeys create markers or remove them from the display. A removed marker remembers its properties (stimulus value, format, delta mode, number) and will be restored with these properties when "Mkr <n>" or "Ref Mkr" is selected again. The marker properties are definitely lost when the associated trace is deleted.



# **Related information**

Refer to the following sections:

- chapter 3.2.2.3, "Markers", on page 28
- See chapter "Operating the Instrument > Handling Diagrams, Traces, and Markers" in the Help system or in the R&S ZNB Getting Started guide.

Access: TRACE > MARKER key or Alt + Shift + G



User Manual 1173.9163.02 - 13

# www.valuetronics.com

# Mkr Stimulus / On / Delta Mode

The functions on top of the softkey panel act on all markers; see "Mkr 1 ... Mkr 10" on page 239.

SCPI command:

```
CALCulate<Chn>:MARKer<Mk>:X
CALCulate<Chn>:MARKer<Mk>[:STATe]
CALCulate<Chn>:MARKer<Mk>:REFerence:X
CALCulate<Chn>:MARKer<Mk>:REFerence[:STATe]
CALCulate<Chn>:MARKer<Mk>:DELTa[:STATe]
```

# Mkr 1 ... Mkr 10

Creates the markers numbered 1 to 10 and assigns them to the active trace. When a marker is created, a triangle labeled "M<n>" is positioned on the trace and the marker coordinates are displayed in the movable info field.

The stimulus position of an active marker can be entered in the "Mkr <n> Stimulus" entry field. The default position is the center of the sweep range. You can also simply drag and drop markers to change their x-axis position.

See also "Activating and Moving Markers" on page 29.

SCPI command:

CALCulate<Chn>:MARKer<Mk>[:STATe] CALCulate<Chn>:MARKer<Mk>:Y? CALCulate<Chn>:MARKer[:STATe]:AREA

#### Ref Mkr

Creates a reference marker and assigns it to the active trace. When a marker is created, a triangle labeled "R" is positioned on the trace and the marker coordinates are displayed in the info field.

The stimulus position of the active reference marker can be entered in the "Ref Marker Stimulus" entry field. The default position is the start of the sweep range or the position of the last active marker.

The reference marker defines the reference value for all markers that are in "Delta Mode".

SCPI command:

CALCulate<Chn>:MARKer<Mk>:REFerence[:STATe] CALCulate<Chn>:MARKer<Mk>:REFerence:Y?

# All Markers Off

Removes all markers from the active trace. Markers on other traces are not affected. The removed markers remember their properties (stimulus value, format, delta mode, number) when they are restored. The marker properties are definitely lost when the associated trace is deleted.

**Tip:** To delete a single marker, drag it into vertical direction to release it from the trace and drop it onto the "Delete" icon.

SCPI command:

CALCulate<Chn>:MARKer<Mk>:AOFF

## **Coupled Markers**

Couples the markers of all traces in the active recall set to the markers of the active trace. While marker coupling is active, the active trace markers assume the role of master markers; the other markers behave as slave markers, following any change of position of the master marker. Coupled markers allow you to compare different measurement results (assigned to different traces) at the same stimulus value (i.e., at the same measurement point).

See also "Marker Coupling" on page 31. SCPI command: CALCulate<Chn>:MARKer<Mk>:COUPled[:STATe]

## 4.2.6.2 Marker > Marker Props

Modifies the properies of a marker created previously (see chapter 4.2.6.1, "Marker > Markers", on page 238). The functions (except "Export Markers...") are unavailable if the active trace contains no markers.

Access: TRACE > MARKER key or Alt + Shift + G



### **Marker Name**

Assigns a (new) name to the active marker. Marker names may exceed the length of the input box and contain letters, numbers, blanks and special characters.

SCPI command:

CALCulate<Chn>:MARKer<Mk>:NAME CALCulate<Chn>:MARKer<Mk>:REFerence:NAME

## **Marker Format**

Selects an output format for the (complex) active marker value in the movable marker info field. The default marker format is the format of the associated trace.

All marker formats are always available, irrespective of the measured quantity. The output values are calculated by a simple conversion of a complex measurement result; the marker format defines the conversion rules. This flexibility in the calculation must be kept in mind when interpreting the results and physical units displayed. See also chapter 3.2.4.6, "Measured Quantities and Display Formats", on page 43.

# Short description of marker formats

The formats of the markers assigned to a trace are independent of each other and of the trace format settings. The following table gives an overview on how a complex marker value z = x + jy is converted.

Marker Format	Description	Formula
Default (Trace)	Marker format identical with trace format	-
Lin Mag	Magnitude of z, unconverted	$ z  = sqrt (x^2 + y^2)$
dB Mag	Magnitude of z in dB	$ z  = $ sqrt ( $x^2 + y^2$ ) dB Mag(z) = 20 * log z  dB
Phase	Phase of z	$\varphi(z) = \arctan(y/x)$
Delay	Group delay, neg. derivative of the phase response*)	- d φ (z) / d ω
Real	Real part of z	Re(z) = x
Imag	Imaginary part of z	lm(z) = y
SWR	(Voltage) Standing Wave Ratio	SWR = (1 +  z ) / (1 -  z )
dB Mag Phase	Magnitude of z in dB and phase in two lines	20 * log z  dB arctan ( lm(z) / Re(z) )
Lin Mag Phase	Magnitude of z (unconverted) and phase in two lines	z  arctan ( Im(z) / Re(z) )
Real Imag	Real and imaginary part of z in two lines	ху

# SCPI command:

CALCulate<Chn>:MARKer<Mk>:FORMat

## Marker Style

Defines how the selected marker is displayed on the screen.

SCPI command: n/a

# Discrete

Discrete mode means that a marker can be set to discrete sweep points only. If discrete mode is switched off, the marker can be positioned on any point of the trace, and its response values are obtained by interpolation.

# SCPI command:

CALCulate<Chn>:MARKer<Mk>:MODE CALCulate<Chn>:MARKer<Mk>:REFerence:MODE

### Fixed

Freezes the current response value of the selected marker. The marker can still be shifted horizontally but the vertical position remains fixed if the other marker settings are changed. Markers must be inside the sweep range and have a valid response value when they are fixed.

SCPI command:

CALCulate<Chn>:MARKer<Mk>:TYPE CALCulate<Chn>:MARKer<Mk>:REFerence:TYPE

## Marker Info

Displays the marker coordinates above the marker symbol.

SCPI command: n/a

## Ref Mkr -> Mkr

Places the reference marker to the position of the active marker. "Ref. Mkr -> Mkr" is not active if the active marker is a reference marker.


SCPI command: n/a

## **Export Markers**

Calls up a "Save As"... dialog to store the current marker values to a marker file.

The analyzer uses a simple ASCII format to export marker values. By default, the marker file extension is \*.txt. The file contains all traces in the active recall set together with their names and measured quantities. Below each trace, the file shows a list of all markers with their names, stimulus and response values.

The following example of a marker file describes a recall set with two traces, "Trc1" and its memory trace "Mem2[Trc1]". "Trc1" has a reference marker "R" and three normal markers "M1, M2, M3" assigned, the memory trace has no markers.

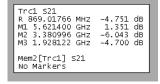

SCPI command:

MMEMory:STORe:MARKer

# **Decimal Places**

Opens the "System Config" dialog to define the (maximum) number of fractional digits for setting values and measurement results. See also chapter 4.6.2.3, "User Interface", on page 424.

# 4.2.6.3 Marker > Marker Search

The "Marker Search" functions use markers to locate specific points on the trace. The functions are unavailable if the active trace contains no markers (e.g. after "All Markers Off").

The marker search extends over a configurable range of stimulus values ("Search Range..."). In the default configuration, the search range is equal to the entire sweep range.

Background information Refer to "Marker Search Functions" on page 31.



Access: TRACE > MARKER key or Alt + Shift + G

## Max / Min

Sets the active marker to the absolute maximum or minimum in the search range, i.e. to the largest or smallest of all response values. If a complex trace format (e.g. a polar diagram) is active, the marker is set to the measurement point with the maximum or minimum magnitude.

"Max" and "Min"also overwrite the current "Search Mode" (--> "Search Min" and "Search Max") and the "Peak Type" for the peak search functions.

SCPI command:

```
CALCulate<Chn>:MARKer<Mk>:FUNCtion:EXECute
CALCulate<Chn>:MARKer<Mk>:FUNCtion:RESult?MINimum | MAXimum
```

User Manual 1173.9163.02 - 13

# www.valuetronics.com

## Center = Marker

Sets the center of the sweep range equal to the stimulus value of the active marker, leaving the span unchanged. The active marker appears in the center of the diagram. This function is useful to focus on the sweep segment of particular interest, e.g. after a maximum or minimum search.

SCPI command:

CALCulate<Chn>:MARKer<Mk>:FUNCtion:CENTer

# Next Peak / Peak Type

Sets the active marker to the next maximum or minimum in the search range, depending on the "Peak Type" setting.

- If "Max" is active, then the marker is set to the next maximum. The next maximum is the maximum with the largest response value that is below the current marker response value.
- If "Min" is active, then the marker is set to the next minimum. The next minimum is the minimum with the smallest response value that is above the current marker response value.
- If "Min or Max" is active, then the marker is set to the next minimum or maximum, whichever has the smallest distance from the current marker response value.

SCPI command:

CALCulate<Chn>:MARKer<Mk>:FUNCtion:EXECute NPEak CALCulate<Chn>:MARKer<Mk>:FUNCtion:RESult?

# Peak Left / Right

Sets the active marker to the next maximum or minimum to the left or right of the current marker position, depending on the "Peak Type" setting.

- If "Max" is active, then the marker is set to the next maximum.
- If "Min" is active, then the marker is set to the next minimum.
- If "Min or Max" is active, then the marker is set to the next minimum or maximum, whichever is closer.

SCPI command:

CALCulate<Chn>:MARKer<Mk>:FUNCtion:EXECute LPEak | RPEak CALCulate<Chn>:MARKer<Mk>:FUNCtion:RESult?

## **Search Mode**

Indicates the current search mode, depending on the last executed search function.

SCPI command:

CALCulate<Chn>:MARKer<Mk>:FUNCtion:EXECute?

## Tracking

Causes the active minimum/maximum/peak and target search of the active marker to be repeated after each sweep: When tracking mode is active the marker typically changes its horizontal and its vertical position as the measurement goes on.

Tracking mode properties

Tracking modes are available for all search modes. The tracking modes for minimum/ maximum/peak search and target search are coupled; tracking for bandfilter search can be activated separately. Tracking is marker-specific but can be switched on for several markers simultaneously.

Switching between "Max", "Min", peak search does not affect the tracking mode. Tracking (for marker search and target search) is switched off though when one of the following actions is performed:

- Redefinition of the active marker position by means of the functions in the "Marker" menu or drag-and-drop of the active marker symbol.
- Activation of bandfilter search mode.

SCPI command:

CALCulate<Chn>:MARKer<Mk>:SEARch:TRACking

# 4.2.6.4 Search Range (Dialog)

The "Search Range" dialog confines the minimum/maximum/peak and target search to a subrange of the sweep. The search range is a continuous interval of the sweep variable.

See also chapter 4.2.4.9, "Trace Config > Trace Statistics", on page 210.

Access: TRACE > MARKER > Marker Search > Search Range...

Marker 1   ‡ On	Search Range Range 1   ‡
	start 100 kHz
- Dange Limit	stop 8.5 GHz

It is possible to define up to ten different search ranges for each recall set and assign them to the markers no. 1 to 10.

## Select Marker

Selects one of the ten markers that can be assigned to the trace. If a selected marker does not exist, it is created as soon as "On" is checked. A created marker is displayed in the center of the search range.

## Search Range

Selects the search range to be assigned to the selected marker. "Full Span" means that the search range is equal to the sweep range. Besides, it is possible to store up to 10 customized search ranges.


The search ranges are bordered by the "Start" and "Stop" values. "Start" must be smaller than "Stop", otherwise the second value is automatically adjusted.

## Search range properties

The ten search ranges are valid for the entire recall set. Each of them can be assigned to any marker in the recall set, irrespective of the trace and channel that the marker belongs to.

The default search range of any new marker is "Full Span". The analyzer provides the greatest flexibility in defining search ranges. In particular, two search ranges may overlap or even be identical. The search is confined to the part of the search range that belongs to the sweep range.

The following example shows how search ranges can be used to search a trace for several local maxima.

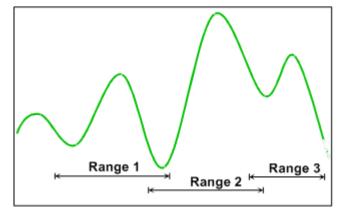

**Note:** The search ranges are identical to the evaluation ranges for trace statistics. For more information see chapter 4.2.4.10, "Evaluation Range (Dialog)", on page 214.

SCPI command:

CALCulate<Chn>:MARKer<Mk>:FUNCtion:DOMain:USER CALCulate<Chn>:MARKer<Mk>:FUNCtion:DOMain:USER:STARt CALCulate<Chn>:MARKer<Mk>:FUNCtion:DOMain:USER:STOP

#### **Range Limit Lines on**

Displays or hides the range limit lines in the diagram area. Range limit lines are two vertical lines at the Start and Stop values of the active search range ("Range 1" to "Range 10").

SCPI command:

CALCulate<Chn>:MARKer<Mk>:FUNCtion:DOMain:USER:SHOW

## 4.2.6.5 Marker > Target Search

The "Target Search" functions use markers to locate trace points with a specific response value ("Target Value"). The functions are unavailable if the active trace contains no markers (e.g. after "All Markers Off").

Access: TRACE > MARKER key or Alt + Shift + G

**Trace Settings** 



Some of the "Target Search" functions are equal to the corresponding "Marker Search" functions. Refer to the following sections:

- chapter 4.2.6.4, "Search Range (Dialog)", on page 245
- "Search Mode" on page 244
- "Tracking" on page 244

#### Target Value

Specifies the target value for the search. The Target Value is entered with the unit of the active trace.

SCPI command:

CALCulate<Chn>:MARKer<Mk>:TARGet

#### **Target Search**

Activates the search and sets the active marker to the defined target value. If the target value occurs at several stimulus values, the marker is placed to the search result with the smallest stimulus value. The other measurement points with the same target value can be located using the "Search Right" function.

If the target is not found (e.g. because the active trace doesn't contain the target value), then the active marker is not moved away from its original position.

SCPI command:

```
CALCulate<Chn>:MARKer<Mk>:FUNCtion:EXECute TARGet
CALCulate<Chn>:MARKer<Mk>:FUNCtion:RESult?
```

#### Search Left

Activates the search to the left of the active marker position and sets the active marker to the defined target value. The target search range is between the "Start" value of the search range and the active marker position.

If the target value occurs at several stimulus values, the marker is placed to the search result with the largest stimulus value (i.e. the one which is closest to the active marker position). The other measurement points with the same target value can be located using "Search Left" repeatedly.

If the target is not found (e.g. because the active trace doesn't contain the target value), then the active marker is not moved away from its original position.

SCPI command:

CALCulate<Chn>:MARKer<Mk>:FUNCtion:EXECute LTARget CALCulate<Chn>:MARKer<Mk>:FUNCtion:RESult?

## Search Right

Activates the search to the right of the active marker position and sets the active marker to the defined target value. The target search range is between the active marker position and the "Stop" value of the search range.

If the target value occurs at several stimulus values, the marker is placed to the search result with the smallest stimulus value (i.e. the one which is closest to the active marker position). The other measurement points with the same target value can be located using "Search Right" repeatedly.

If the target is not found (e.g. because the active trace doesn't contain the target value), then the active marker is not moved away from its original position.

SCPI command:

CALCulate<Chn>:MARKer<Mk>:FUNCtion:EXECute RTARget CALCulate<Chn>:MARKer<Mk>:FUNCtion:RESult?

# 4.2.6.6 Marker > Bandfilter Search

The "Bandfilter Search" functions search for trace segments with a bandpass or bandstop shape and determine characteristic filter parameters.



Background information

Refer to "Bandfilter Search" on page 32.



Bandfilter search mode can be used for a broad range of measured quantities (TRACE > MEAS), provided that the display format is dB Mag. To obtain real filter parameters, the measured quantity must be a transmission S-parameter and a frequency sweep must be performed. For other quantities (e.g reflection parameters), the "Bandfilter Search" functions are still useful to analyze general trace properties. In some display formats (e.g. "Phase") the bandfilter search is disabled.

Access: TRACE > MARKER key or Alt + Shift + G

Trace Settings




Many of the "Bandfilter Search" functions are equal to the corresponding "Marker Search" functions. Refer to the following sections:

- chapter 4.2.6.4, "Search Range (Dialog)", on page 245
- "Search Mode" on page 244
- "Tracking" on page 244

## Bandwidth

Specifies the minimum excursion of the bandpass and bandstop peaks.

- A bandpass peak must fall off on both sides by the specified <Bandwidth> value to be considered a valid peak.
- A bandstop peak must be <Bandwidth> below the maximum level in the search range (bandpass value) to be considered a valid peak.

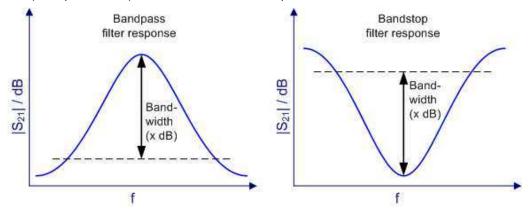


SCPI command:

CALCulate<Chn>:MARKer<Mk>:TARGet

## Bandpass Ref to Max

Activates the search for a bandpass region on the active trace and activates bandfilter "Tracking". The located bandpass region is the tallest peak in the search range with with a minimum excursion as specified by the "Bandwidth" parameter.

If "Bandpass Ref to Max" is selected the analyzer uses (or creates) the four markers "M1" to "M4" to locate the **bandpass region**.

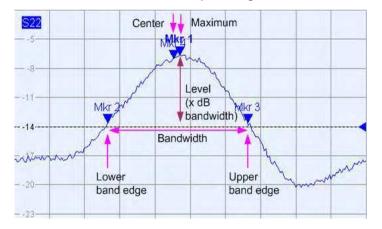

- "M1" indicates the maximum of the peak ("Max").
- "M2" indicates the point on the left edge of the peak where the trace value is equal to the maximum minus the bandwidth factor ("Lower Edge").
- "M3" indicates the point on the right edge of the peak where the trace value is equal to the maximum minus the bandwidth factor ("Upper Edge").
- "M4" indicates the center of the peak, calculated as the geometric mean value of the "Lower Edge" (LBE) and "Upper Edge" (UBE) positions:

$$f_{Center} = \sqrt{(f_{LBE} * f_{UBE})}$$

The bandfilter search results are displayed in the movable bandfilter info field.

SCPI command:

```
CALCulate<Chn>:MARKer<Mk>:FUNCtion:BWIDth:MODE BPASs
CALCulate<Chn>:MARKer<Mk>:FUNCtion:EXECute BFILter
CALCulate<Chn>:MARKer:SEARch:BFILter:RESult[:STATe]:AREA
```

## **Bandpass Ref to Mkr**

Activates the search for a bandpass region on the active trace and activates bandfilter "Tracking", starting at the position of the active marker. A bandpass region is the closest peak in the search range with a minimum excursion as specified by the "Bandwidth" parameter.

In contrast to a "Bandpass Ref to Max", the "Bandpass Ref to Mkr" does not change the position of the active markers. The bandfilter search results are displayed in the movable bandfilter info field.


# SCPI command:

CALCulate<Chn>:MARKer<Mk>:FUNCtion:BWIDth:MODE BPRMarker CALCulate<Chn>:MARKer<Mk>:FUNCtion:EXECute BFILter

## Bandstop Ref to Max

Activates the search for a bandstop region on the active trace and activates bandfilter "Tracking". A bandstop region is the lowest peak (local minimum) in the search range, provided that its level is at least <Bandwidth> below the maximum (passband value).

If "Bandstop Ref to Max" is selected the analyzer uses (or creates) the four markers "M1" to "M4" to locate the **bandstop region**.

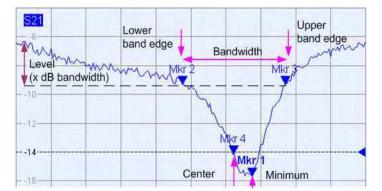

- "M1" indicates the minimum of the peak ("Min").
- "M2" indicates the point on the left edge of the peak where the trace value is equal to the maximum in the search range (passband value) minus the bandwidth factor ("Lower Edge").
- "M3" indicates the point on the right edge of the peak where the trace value is equal to the maximum in the search range (passband value) minus "x dB Bandwidth" (Upper Edge).
- "M4" indicates the center of the peak, calculated as the geometric mean value of the "Lower Edge" (LBE) and "Upper Edge" (UBE) positions:

$$f_{Center} = \sqrt{(f_{LBE} * f_{UBE})}$$

The bandfilter search results are displayed in the movable bandfilter info field.

SCPI command:

CALCulate<Chn>:MARKer<Mk>:FUNCtion:BWIDth:MODE BSTop CALCulate<Chn>:MARKer<Mk>:FUNCtion:EXECute BFILter

## **Result Off**

Hides the movable info field with the results of a bandpass or a bandstop search and disables bandfiter "Tracking". The info field is displayed again (and tracking re-enabled) when a new bandfilter search is performed.

SCPI command:

CALCulate<Chn>:MARKer<Mk>:BWIDth CALCulate<Chn>:MARKer:SEARch:BFILter:RESult[:STATe]

# Search / Search Mode

Enables a bandpass or bandstop search (left/right icon) for an arbitrary search mode. The search modes have the following effect:

- Bandpass Ref to Max / Bandstop Ref to Max: The bandpass / bandstop is the tallest / lowest peak in the search range. For a detailed description refer to "Bandpass Ref to Max" on page 249 and "Bandstop Ref to Max" on page 250.
- "Bandpass / Bandstop Ref to Marker:" The bandpass / bandstop is the tallest / lowest peak in the search range. The response value for the lower and upper band edges is calculated as the response value at the active marker position plus / minus x dB,

where x is equal to the <Bandwidth> value. To be valid the peak must be above / below the response value for the band edges.

- "Bandpass / Bandstop Absolute Level:" The bandpass / bandstop is the tallest/lowest peak in the search range. To be valid, the peak must be above / below –x dB, where x is numerically equal to the <Bandwidth> value. The Lower Band Edge and Upper Band Edge values are given by the frequencies where the trace is equal to –x dB.
- "None" Bandfilter search switched off, result off.

SCPI command:

CALCulate<Chn>:MARKer<Mk>:FUNCtion:BWIDth:MODE CALCulate<Chn>:MARKer<Mk>:BWIDth CALCulate<Chn>:MARKer:SEARch:BFILter:RESult[:STATe]

## Tracking

Causes the active bandfilter search to be repeated after each sweep: When tracking mode is active the markers typically change their horizontal and vertical positions as the measurement goes on.

# Tracking mode properties

Tracking modes are available for all search modes. The tracking modes for minimum/ maximum/peak search and target search are coupled; tracking for bandfilter search can be activated separately. Bandfilter tracking is activated automatically when one of the bandfilter search modes is selected.

SCPI command:

Bandfilter tracking and marker/target search tracking are controlled with the same command:

CALCulate<Chn>:MARKer<Mk>:SEARch:TRACking

# 4.2.6.7 Marker > Set by Marker

The "Set by Marker" functions use the active marker to define the sweep range, scale the diagram and introduce an electrical length offset. The functions are unavailable if the active trace contains no markers (e.g. after "All Markers Off").



# Examples

Refer to chapter "Using Marker Functions" in the Help or in the Getting Started guide.

Access: TRACE > MARKER key or Alt + Shift + G

Trace Settings



# Center / Start / Stop / Span = Marker

The following functions use the stimulus value of the active marker to define the sweep range.

- Center = Marker sets the center of the sweep range equal to the stimulus value of the active marker, leaving the span unchanged. The active marker appears in the center of the diagram.
- Start = Marker sets the beginning (start) of the sweep range equal to the stimulus value of the active marker, leaving the end (stop) value unchanged. The active marker appears at the left edge of the diagram.
- Stop = Marker sets the end (stop) of the sweep range equal to the stimulus value of the active marker, leaving the beginning (start) unchanged. The active marker appears at the right edge of the diagram.
- Span = Marker sets the span of the sweep range equal to the absolute value of the first coordinate of the active delta marker, i.e. to the difference between the delta marker and the reference marker positions. The function is available only if the active marker is in "Delta Mode". The reference marker appears at the right, the delta marker at the left edge of the diagram or vice versa, depending on which of the two markers has the smaller stimulus value.

SCPI command:

CALCulate<Chn>:MARKer<Mk>:FUNCtion:CENTer CALCulate<Chn>:MARKer<Mk>:FUNCtion:STARt CALCulate<Chn>:MARKer<Mk>:FUNCtion:STOP CALCulate<Chn>:MARKer<Mk>:FUNCtion:SPAN

## Ref Val / Max / Min = Marker

The following functions use the response value of the active marker to scale the y-axis of the diagram:

- Ref Val = Marker sets the reference value equal to the response value of the active marker, leaving the values of the vertical divisions ("Scale / Div") unchanged.
- Max = Marker sets the upper edge of the diagram equal to the response value of the active marker, leaving the values of the vertical divisions ("Scale / Div") unchanged.

• **Min = Marker** sets the lower edge of the diagram equal to the response value of the active marker, leaving the values of the vertical divisions ("Scale / Div") unchanged.

SCPI command: n/a

# Zero Delay at Marker

Corrects the measurement result by adding or subtracting a constant group delay. This function must be applied to a trace which is displayed in group delay format. The trace is shifted in vertical direction so that the delay at the marker position vanishes.

The delay represents the propagation time of the wave across the DUT, so this operation corresponds to a electrical length compensation, i.e. to a shift of the reference plane by adding to or subtracting from the test port a simulated lossless transmission line of variable length. The correction must be carried out on the "Delay" trace but has an impact on all trace formats.

A standard application of "Zero Delay at Marker" is correction of the constant delay caused by the interconnecting cables between the analyzer test ports and the DUT (line stretch).

**Note:** "Zero Delay at Marker" modifies the "Offset" parameters and therefore influences the entire channel.

SCPI command: n/a

## 4.2.6.8 Marker > Info Field

Displays or hides the marker info field and selects it contents. The functions are selfexplanatory.



**Background information** 

Refer to "Marker Info Field" on page 29

```
Marker

Markers

Markers

Marker

Marker

Props

Marker

Stimulus

Info Off

Marker

Search
```

Access: TRACE > MARKER key or Alt + Shift + G

# 4.3 Stimulus Settings

The "Channel > Stimulus" settings define the sweep range in the current channel, depending on the sweep type.

In Cartesian diagrams, the sweep range corresponds to the diagram width and defines the scaling of the x-axis. In polar diagrams and Smith charts the stimulus axis is lost but the marker functions easily provide the stimulus value of any measurement point.



All stimulus settings except the "Time Domain X-Axis" settings are channel settings. "Time Domain X-Axis" applies to the active trace which must be transformed into time domain.



# **Background information**

Refer to the following sections:

- chapter 3.1.3, "Traces, Channels and Diagrams", on page 13
- chapter "Setting the Sweep Range" in the Help or in the Getting Started guide
- chapter "Using Marker Functions" in the Help or in the Getting Started guide

# 4.3.1 Stimulus > Stimulus

Defines the sweep range in the current channel, depending on the sweep type.



# Related Settings

Refer to the following sections:

- chapter 3.1.4.2, "Stimulus and Sweep Types", on page 17
- chapter 4.4.2.2, "Sweep > Sweep Type", on page 266

Access: STIMULUS keys or Alt + Shift + J



User Manual 1173.9163.02 - 13


# www.valuetronics.com

# Start / Stop / Center / Span Frequency (Power / Time)

Defines the sweep range:

- "Start ..." is the lowest value of the sweep variable (e.g. the lowest frequency measured) and corresponds to the left edge of the Cartesian diagram.
- "Stop ..." is the highest value of the sweep variable (e.g. the highest frequency measured) and corresponds to the right edge of the Cartesian diagram.
- "Center..." corresponds to the center of the Cartesian diagram, i.e. (Start ... + Stop ...)/
   2.
- "... Span" corresponds to the diagram width, i.e. (Stop ... Start ...).

For a frequency sweep the "Start Frequency" and "Stop Frequency" or the "Center Frequency" and "Frequency Span" are alternative settings.

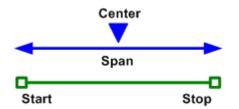

For the other sweep types, some of the input fields are unavailable; see table 3-1.

SCPI command:

```
[SENSe<Ch>:]FREQuency:STARt
[SENSe<Ch>:]FREQuency:STOP
[SENSe<Ch>:]FREQuency:CENTer
[SENSe<Ch>:]FREQuency:SPAN
SOURce<Ch>:POWer<PhyPt>:STARt
SOURce<Ch>:POWer<PhyPt>:STOP
[SENSe<Ch>:]SWEep:TIME
[SENSe<Ch>:]SWEep:POINts
SYSTem:FREQuency? (query frequency range of the network analyzer)
```

#### Power

Determines the output power at the test ports for the sweep types "Power", "CW Mode", and "Time". The setting has no effect for "Power" sweeps, where the source power is varied over a continuous range.

SCPI command:

SOURce<Ch>: POWer<PhyPt>[:LEVel][:IMMediate][:AMPLitude]

### **CW Frequency**

Sets the fixed frequency for the sweep types "Power", "CW Mode", and "Time".

SCPI command:

```
[SENSe<Ch>:]FREQuency:FIXed
[SENSe<Ch>:]FREQuency[:CW]
SOURce<Ch>:FREQuency<PhyPt>:FIXed
SOURce<Ch>:FREQuency<PhyPt>[:CW]
```

## **Zoom Stimulus**

Magnifies a rectangular portion of the diagram (zoom window) to fill the entire diagram area. See also chapter 4.2.3.3, "Scale > Zoom", on page 191 or chapter "Operating the Instrument > Using the Graphic Zoom" in the Help system or in the R&S ZNB Getting Started guide.

### SCPI command:

```
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM:BOTTom
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM:STARt
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM:STOP
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM:TOP
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM[:STATe]
```

# 4.3.2 Stimulus > Power

Defines the power of the internal signal source in the current channel, depending on the sweep type.



Access: STIMULUS keys or Alt + Shift + J

Most of the "Power" settings are also available in the "Stimulus" tab. Refer to the following sections:

- "Power" on page 256
- "Start / Stop / Center / Span Frequency (Power / Time)" on page 256

# **RF Off All Channels**

"RF Off" switches the internal power source for all channels off (if checked) or on. Switching off the RF power helps to prevent overheating of a connected DUT while no measurement results are taken. **Tip:** Switching off the internal RF sources while an external generator is used can improve the measurement accuracy. "RF Off All Channels" also deactivates external generators, so you have to use the settings in the "Arb Frequency" tab of the "Define Port Settings" dialog (with option R&S ZNB-K4).

SCPI command: OUTPut<Ch>[:STATe]

## **Step Attenuators**

Defines an attenuation factor for the received waves at each analyzer port. Attenuation factors are port and channel-specific. They are used to adjust the received signal level at port 2 to the input level range of the analyzer in order to avoid damage to the instrument, e.g. if the DUT is a power amplifier. At least one of the options R&S ZNB<n>-B31/32/33/34 must be installed to use this feature; see chapter 3.7.8, "Receiver Step Attenuators (R&S ZNB<n>-B31/32/33/34)", on page 127.

SCPI command:

[SENSe<Ch>:]POWer:ATTenuation

# 4.3.3 Stimulus > Time Domain X-Axis

Defines the stimulus axis for a active trace which is transformed into time domain. All settings are unavailable if "TRACE CONFIG > Time Domain" is disabled for the active trace.



# Related information

Refer to the following sections:

- chapter 3.7.1, "Time Domain (R&S ZNB-K2)", on page 112
- chapter 4.2.4.6, "Trace Config > Time Domain", on page 204

Access: STIMULUS keys or Alt + Shift + J



User Manual 1173.9163.02 - 13


# www.valuetronics.com

## Time Start / Stop / Center / Span

Defines the display range for the time domain trace.

- "Time Start" is the lowest displayed time and corresponds to the left edge of the Cartesian diagram.
- "Time Stop" is the highest displayed time and corresponds to the right edge of the Cartesian diagram.
- "Time Center" corresponds to the center of the Cartesian diagram, i.e. (Time Start + Time Stop)/2.
- "Time Span" corresponds to the diagram width, i.e. (Time Stop Time Start).

"Time Start" and "Time Stop" or "Time Center" and "Time Span" are alternative settings.

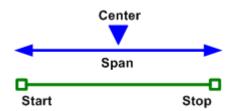

#### SCPI command:

CALCulate<Chn>:TRANsform:TIME:STARt CALCulate<Chn>:TRANsform:TIME:STOP CALCulate<Chn>:TRANsform:TIME:CENTer CALCulate<Chn>:TRANsform:TIME:SPAN

# Time / Distance

"Time" and "Distance" switch over between the x-axis scaling in time units or distance units.

The interpretation of time and distance depends on the measurement type. For reflection measurements, the time axis represents the propagation time of a signal from the source to the DUT and back. For transmission measurement, it represents the propagation time from the source through the device to the receiver.

The distance calculation is consistent with this picture:

- For reflection measurements (S-parameters S<sub>ii</sub> or ratios with equal port indices) the distance between the source and the DUT is half the propagation time multiplied by the velocity of light in the vacuum times the velocity factor of the receiving port defined via "OFFSET EMBED > Offset" (*Distance = 1/2 \* <Time> \* c<sub>0</sub> \* <Velocity Factor>*). The factor 1/2 accounts for the return trip from the DUT to the receiver.
- For transmission measurements, the distance is calculated as the propagation time times the velocity of light in the vacuum times the velocity factor of the receiving port defined via "OFFSET EMBED > Offset" (*Distance* = <*Time*> \* c<sub>0</sub> \* <*Velocity Factor*>).

SCPI command:

CALCulate<Chn>:TRANsform:TIME:XAXis

# 4.4 Channel Settings

The "Channel" menu provides all channel settings and activates, modifies and stores different channels.

# **Background information**

Refer to the following sections:

- chapter 3.1.3, "Traces, Channels and Diagrams", on page 13
- chapter 3.1.3.2, "Channel Settings", on page 14
- chapter 3.1.4, "Sweep Control", on page 15

# 4.4.1 Power Bandwidth Average Settings

The "Power Bw Avg" menu defines the power of the internal signal source(s), sets the step attenuators and the IF bandwidths, and configures the sweep average.

## 4.4.1.1 Power Bw Avg > Power

Defines the power of the internal signal source(s). The settings are identical with the "Stimulus > Power" settings; see chapter 4.3.2, "Stimulus > Power", on page 257.

## 4.4.1.2 Power Bw Avg > Bandwidth

Sets the measurement bandwidth and the shape of the IF filter. The settings apply to all filters in the active channel. A system error correction (calibration) remains valid when the filter settings are changed.



# Optimizing the filter settings

A high selectivity and a small filter bandwidth both suppress the noise level around the measurement frequency and thus increase the dynamic range. On the other hand the time needed to acquire a single measurement point increases with smaller filter bandwidths and high selectivity. For small bandwidths, the filter settling time, which is inversely proportional to the bandwidth, is responsible for the predominant part of the measurement time.

The characteristics of the high selectivity filter makes it particularly suitable for isolating unexpected spurious responses or known mixer products.



# Segmented sweeps

In "Segmented Frequency" sweeps, the filter settings can be selected independently for each segment. see chapter 4.4.2.3, "Define Segments (Dialog)", on page 271.

Access: CHANNEL > POWER BW AVG key or Alt + Shift + L

**Channel Settings** 



# Bandwidth

Sets the measurement bandwidth of the IF filter. Values can be set between 1 Hz and 10 MHz. The entered value is rounded up to  $1.5 \times 10^{n}$  Hz,  $2 \times 10^{n}$  Hz,  $3 \times 10^{n}$  Hz,  $5 \times 10^{n}$  Hz,  $7 \times 10^{n}$  Hz,  $10 \times 10^{n}$  Hz (n = 1 to 6). Values exceeding the maximum bandwidth are rounded down.

Option R&S ZNB-K17, "Increased Bandwidth", provides bandwidths up to 10 MHz.

SCPI command:

[SENSe<Ch>:]BANDwidth[:RESolution]
[SENSe<Ch>:]BWIDth[:RESolution]

## Selectivity

Selects the shape of the IF filter:

- Filters with "Normal" selectivity provide the shortest settling time (recommended for fast measurements).
- "Medium" selectivity filters have steeper edges but require longer settling times.
- "High" selectivity filters have the steepest edges and the longest settling times. This
  filter type is suitable for isolating adjacent signals which are separated by a small
  frequency spacing.

SCPI command:

```
[SENSe<Ch>:]BANDwidth[:RESolution]:SELect
[SENSe<Ch>:]BWIDth[:RESolution]:SELect
```

# 4.4.1.3 Power Bw Avg > Average

Define the number of consecutive sweeps to be averaged and enables/disables the sweep average.



# Effects of sweep average, alternative settings

An average over several sweeps reduces the influence of random effects in the measurement and therefore minimizes the noise level. The effect increases with the average factor, however, obtaining an averaged result requires several sweeps and therefore increases the measurement time.

Smoothing is an alternative method of compensating for random effects on the trace by averaging adjacent measurement points. Compared to the sweep average, smoothing does not significantly increase the measurement time but can eliminate narrow peaks and thus produce misleading results.

The sweep average is not frequency selective. To eliminate a spurious signal in the vicinity of the measurement frequency from the trace, alternative techniques (e.g. a smaller filter bandwidth) must be used.

1

In contrast to the sweep count (for single sweep mode), averaging is always channelspecific. Both features are completely independent from each other.

The average factor is also valid for calibration sweeps: The calculation of system correction data is based on the averaged trace.



## Access: CHANNEL > POWER BW AVG key or Alt + Shift + L

#### Factor / On / Reset

"Factor" defines the number of averaged traces, "On" enables or disables the sweep average, "Reset" starts a new average cycle. The average cycle is also re-started when the "Mode" is changed.

## Calculation of the average trace

Let c be the average factor and assume that n sweeps have been measured since the start of the average cycle (start of the measurement or "Reset"). The following two situations are distinguished:

 n ≤ c: At each sweep point, the average trace no. n is calculated from the average trace no. n – 1 and the current trace no. n according to the following recurrence:

$$Avg(n) = \frac{n-1}{n} Avg(n-1) + \frac{1}{n} Curr(n) \qquad (n = 1 \dots c)$$

The average trace represents the arithmetic mean value over all n sweeps.

 n > c: At each sweep point, the average trace no. n is calculated from the average trace no. n – 1 and the current trace no. n according to:

$$Avg(n) = \frac{c-1}{c}Avg(n-1) + \frac{1}{c}Curr(n) \qquad (n > c)$$

The formulas hold for an average factor n = 1 where the average trace becomes equal to the current trace.

SCPI command:

```
[SENSe<Ch>:]AVERage:COUNt
[SENSe<Ch>:]AVERage[:STATe]
[SENSe<Ch>:]AVERage:CLEar
```

# Mode

Selects one of the following averaging algorithms:

- Auto: Automatic selection of the averaging mode, depending on the trace format.
- Reduce Noise: Averaging of the real and imaginary parts of each measurement result, provides the most effective noise suppression for the "Real" and "Imag" formats and for polar diagrams.
- Flatten Noise: Averaging of the (linear) magnitude and phase values, provides the most effective noise suppression for the "dB Mag", "Phase", "Unwr. Phase", and "Lin Mag" formats.

Changing the mode resets the average cycle.

SCPI command:

[SENSe<Ch>:]AVERage:MODE on page 677

# 4.4.2 Sweep Settings

The "Sweep" menu defines the scope of the measurement in the active channel. This includes the sweep type with various parameters, the trigger conditions and the periodicity of the measurement.



# Background information

Refer to the following sections:

- chapter 3.1.4, "Sweep Control", on page 15
- chapter 3.1.4.2, "Stimulus and Sweep Types", on page 17

# 4.4.2.1 Sweep > Sweep Params

Controls the scope and timing of the measurement in the active channel.



# Segmented sweeps

In "Segmented Frequency" sweeps, the sweep parameters can be set independently for each segment. see chapter 4.4.2.3, "Define Segments (Dialog)", on page 271.



# System error correction

In general, the system error correction is no longer valid after a change of the sweep parameters. The status of the calibration is shown in the trace list. If the number of points is changed, the analyzer interpolates the correction data. The calibration label "Cal Int" is displayed. See also chapter 3.5.4, "Calibration Labels", on page 84.

Access: CHANNEL > SWEEP key or Alt + Shift + M



## Number of Points

Sets the total number of measurement points per sweep. The minimum number of points is 1 (measurement at a single frequency/power/time value). The maximum depends on the analyzer type.

Together with the sweep range defined with the "Stimulus" settings, this parameter defines the grid of sweep points. The sweep points are equidistantly distributed over the entire sweep range: The step width between two consecutive sweep points is constant on a linear scale (sweep types "Lin. Frequency", "Time" and "CW Mode") or on a logarithmic scale (sweep types "Log. Frequency" and "Power").

The sweep points for "Lin Frequency" sweeps may alternatively be defined using the "Frequency Step Size".

#### Tip: Measurement time and screen resolution

A large number of points improve the resolution of the trace but increases the measurement time. The overall measurement time is composed of the hardware settling time at the beginning of the sweep plus the sum of the measurement times at each individual sweep point. This implies that the measurement time increases roughly linearly with the number of points.

See also chapter 3.1.4, "Sweep Control", on page 15.

SCPI command: [SENSe<Ch>:]SWEep:POINts

#### **Freq Step Size**

Sets the distance between two consecutive frequency sweep points.

The step size is an alternative to the "Number of Points" setting:

- If the sweep range is defined by means of the "Start" and "Stop" variables, both the "Stop" value and the "Number of Points" can vary as the "Freq Step Size" is changed. The "Stop" value is changed as little as possible so that the condition "Freq Step Size" = "(Stop – Start) / (Number of Points – 1)" can be fulfilled. Changing the Start and Stop values modifies the "Freq Step Size".
- If the sweep range is defined by means of the "Center" and "Span" variables, both the "Span" value and the "Number of Points" can vary as the "Freq Step Size" is changed. The "Span" is reduced as little as possible so that the condition "Freq Step Size" = "(Stop – Start) / (Number of Points – 1)" can be fulfilled. Changing the "Span" modifies the "Freq Step Size".

**Note:** This setting is valid for linear frequency sweeps only. It does not apply to logarithmic and segmented sweeps, power, time or CW Mode sweeps. Increasing the "Freq Step Size" generally increases the measurement time.

SCPI command:

[SENSe<Ch>:]SWEep:STEP

# Sweep Time / Auto

Varies the measurement time for a sweep or delays the start of each sweep.

- "Sweep Time" is the total measurement time for the sweep. The minimum possible sweep time is equal to the estimated value in "Auto" mode. Setting a larger sweep time is equivalent to defining a Meas Delay before each partial measurement.
- "Auto" minimizes the sweep time. The "Meas. Delay" is set to 0 s. "Sweep Time" indicates the estimated sweep time, depending on the current measurement settings. The "Sweep Time" and "Meas. Delay" values are maintained until changed explicitly if "Auto" is switched off.

If a time sweep is active, "Sweep Time" is not available. The analyzer uses the previously defined sweep time settings.

SCPI command:

```
[SENSe<Ch>:]SWEep:TIME
[SENSe<Ch>:]SWEep:TIME:AUTO
```

# Meas Delay

Adds a delay time before the start of the partial measurements. See chapter 3.1.4.1, "Partial Measurements and Driving Mode", on page 16.

- If "All Partial Meas'ments" is selected, the delay time is added before each partial measurement. For a complete 2 port S-parameter measurement, the delay must be added twice per sweep point.
- If "First Partial Meas'ment" is selected, the delay time is added once per sweep point only, irrespective of the measured quantities and the number of partial measurements. The sweep time increases by the measurement delay times the number of sweep points.

"Meas Delay" is not available while a time sweep or CW mode sweep is active. However, the analyzer takes into account a previously defined measurement delay.

**Tip:** A delay time before the start of each partial measurement increases the accuracy, in particular for measurements on DUTs with long settling times (e.g. quartz oscillators, SAW filters). Select "First Partial Meas'ment" if the DUT does not require an additional settling time due to the interchange of source and receive ports.

As an alternative to increasing the delay (and thus the total sweep time), it is possible to select "Alternated" sweep; see "Driving Mode" on page 369.

```
SCPI command:
```

```
[SENSe<Ch>:]SWEep:DWEL1
[SENSe<Ch>:]SWEep:DWEL1:IPOint
```

## 4.4.2.2 Sweep > Sweep Type

Defines the sweep variable (frequency/power/time) and the position of the sweep points across the sweep range.

```
Access: CHANNEL > SWEEP key or Alt + Shift + M
```

Sweep	
O Lin Freq	Sweep Params
Log Freq	Sweep Type
C Segmented	Sweep Control
• Power	
CW Mode	
• Time	
Define Segments	

## Lin Freq

In a "Lin Freq" sweep the stimulus frequency is swept in equidistant steps over the continuous frequency range. The frequency range (sweep range) is defined with the STIM-ULUS settings. The step width between two consecutive sweep points is constant and given by  $\langle \text{Span} \rangle/(n - 1)$  where n is the specified "Number of Points" (n > 1). The internal generator power can be set via "POWER BW AVG > Power".

"Lin Freq" is the default sweep type. In a Cartesian diagram the measurement result is displayed as a trace over a linear frequency scale (as known e.g. from spectrum analyzers). The following example shows a "Lin Freq" sweep with a stimulus range between 4 GHz and 6 GHz, the forward transmission parameter S<sub>21</sub> as measured quantity, and a "dB Mag" scaled y-axis.

**Channel Settings** 




#### SCPI command:

[SENSe<Ch>:]SWEep:TYPE LINear

## Log Freq

In a "Log Freq" sweep the stimulus frequency is swept on a logarithmic scale over the continuous frequency range. The frequency range (sweep range) is defined with the STIMULUS settings. The sweep points are calculated from the "Span" and the specified "Number of Points" (n > 1) with the condition that the step width is constant on the logarithmic scale. The internal generator power can be set via "POWER BW AVG > Power".

"Log Freq" sweeps are suitable for the analysis of a DUT over a large frequency range, e.g. over several octaves. In a Cartesian diagram the measurement result is displayed as a trace over a logarithmic frequency scale. The following example shows a "Log Freq" sweep with a stimulus range between 1 MHz and 6 GHz, the forward transmission parameter  $S_{21}$  as measured quantity, and a "dB Mag" scaled y-axis.

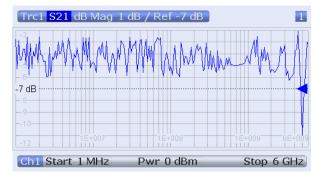

**Tip:** In "Log Freq" representation, limit lines and ripple limit lines appear as exponential curves; see chapter 3.4.1.1, "Rules for Limit Line Definition", on page 61.

# SCPI command:

[SENSe<Ch>:]SWEep:TYPE LOGarithmic

## Segmented

In a "Segmented" frequency sweep the sweep range can be composed of several continuous frequency sub-ranges or single frequency points. The sub-ranges are termed sweep segments and defined in the "Define Segments" dialog. Sweep segments may overlap. The segment list must contain at least 2 distinct frequency points before a segmented frequency sweep can be started. Instrument settings such as the internal generator power, the measurement (IF) bandwidth, the selectivity of the measurement filter, the frequency band of the local oscillator, and the measurement time can be set independently for the individual segments.

Due to this flexibility, segmented frequency sweeps are suitable for any detailed analysis of a DUT at specified frequencies. In a Cartesian diagram the measurement result is displayed as a trace over a linear frequency scale ranging from the lowest to the highest frequency point of all segments. The following example shows a segmented frequency sweep with 2 segments in the stimulus ranges between 1 GHz and 6 GHz and between 4 GHz and 5 GHz, respectively. The forward transmission parameter S<sub>21</sub> is measured, and a "dB Mag" scaled y-axis is used. In the frequency range between the sweep segments the trace is displayed as a straight line.



**Tip:** You can change to point based x-axis to improve the display of a segmented frequency sweep (see "Seg x-Axis" on page 270).


SCPI command: [SENSe<Ch>:]SWEep:TYPE SEGMent


## Power

In a "Power" sweep the internal generator power is swept in linear, equidistant steps over a continuous power range. The generator power range (sweep range) is defined via "STIMULUS > START" and "STIMULUS > STOP". The fixed frequency can be defined via "CHANNEL > SWEEP > Sweep Params > CW Frequency".

"Power" sweeps are particularly suitable for the analysis of non-linear effects (saturation, compression) on active and passive DUTs (e.g. power amplifiers, mixers).

In a Cartesian diagram the measurement result is displayed as a trace over a dB-linear power scale. The following example shows a "Power" sweep in the source power range between –25 dBm and 0 dBm, performed at a CW frequency of 1 GHz.

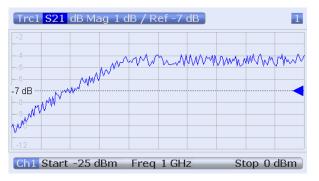

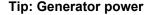

User Manual 1173.9163.02 - 13

# www.valuetronics.com

The power range for a power sweep replaces the fixed internal source power which is defined via "POWER BW AVG > Power". The power is the output power at all test ports which supply the stimulus signals for the active channel.

SCPI command:

[SENSe<Ch>:]SWEep:TYPE POWer

### CW Mode

"CW Mode" sweeps, like "Time" sweeps, are performed at constant frequency and stimulus power. The measurement is triggered according to the current trigger settings; each trigger event triggers the first partial measurement of a measurement point. The time interval between two consecutive measurements depends on the trigger settings and the sweep parameters (especially the number of points). Any trigger mode is allowed.

The frequency ("CW Frequency") and internal source power ("Power") are fixed. Both can be defined in the "CHANNEL > SWEEP > Sweep Params" tab.

A "CW Mode" sweep corresponds to the analysis of a signal over the time with a time scale and resolution that is determined by the trigger events. In a Cartesian diagram the measurement result is displayed as a trace over a linear time scale (like e.g. in an oscilloscope). The diagram is similar to the "Time" diagram. The following example shows a "CW Mode" sweep with a DUT that does not markedly change its transmission characteristics over the time.

Trc1 S21 dB Ma	g 1 dB / Ref -7 dB	Smo 1
-2		
6		
-7 dB		
9		
10		
-12		
Ch1 Freq 1 GHz	Pwr 0 dBm	Stop 201

#### Tip: Sweep time

The time interval between two consecutive trigger pulses must not be smaller than the minimum measurement time per measurement point. See "Sweep Time / Auto" on page 265.

SCPI command:

[SENSe<Ch>:]SWEep:TYPE POINt

## Time

"Time" sweeps are performed at constant frequency and stimulus power. A single sweep extends over a specified period of time. The sweep time is defined via "STIMULUS > STOP"; see chapter 3.1.4.2, "Stimulus and Sweep Types", on page 17. The time intervals between two consecutive sweep points are calculated according to <Stop>/(n - 1) where n is the selected "Number of Points". The frequency ("CW Frequency") and internal source power ("Power") are fixed. Both can be defined in the "CHANNEL > SWEEP > Sweep Params" tab.

A "Time" sweep corresponds to the analysis of a signal over the time; the function of the analyzer is analogous to an oscilloscope. In a Cartesian diagram the measurement result is displayed as a trace over a linear time scale. The following example shows a "Time" sweep with a DUT that does not markedly change its transmission characteristics over the time.

Trc1 S21 dB Mag 1	dB / Ref -7 dB Sr	no 1
-2		
5		
6		
-7 dB		
9		
-12		
Ch1 Freq 1 GHz	Pwr 0 dBm	Stop 1 s

## Tip: Sweep time

The minimum sweep time depends on the number of measurement points, the measurement bandwidth, the delay time before each partial measurement and the number of partial measurements required for each measurement point. The analyzer estimates this time, taking into account the current measurement settings.

If the total sweep time entered via "STIMULUS > STOP" is smaller than the estimated minimum sweep time, the entered value is increased automatically.

# Equidistance of sweep points

The analyzer tries to keep the time intervals between any two consecutive time sweep points equal: The time sweep samples are equidistant. Equidistance also holds for sweeps which range over several channels.

SCPI command:

[SENSe<Ch>:]SWEep:TYPE CW


# Seg x-Axis

Scales the x-axis for a segmented frequency sweep:

- In frequency based mode, the x-axis covers the frequency ranges of all sweep segments, including possible gaps between the segments. Equal frequency spacings correspond to equal distances on the x-axis.
- In point based mode, the x-axis shows all sweep points with equal spacings. Gaps between sweep segments are minimized; no diagram space is "wasted" on unused frequency ranges. Point based mode is indicated in the channel line.

The example below shows a segmented frequency sweep with two segments. The first segment ranges from 1 GHz to 1.4 GHz; the second segment from 2 GHz to 3 GHz. Both segments contain 11 sweep points. In point based mode (lower diagram), all sweep points are equidistant.

**Channel Settings** 

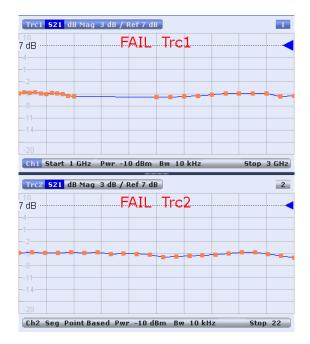

**Tip:** Overlapping limit line and ripple limit line segments are not displayed when a pointbased x-xis is active; see chapter 3.4.1.1, "Rules for Limit Line Definition", on page 61. SCPI command:

[SENSe<Ch>:]FREQuency:SEGMent:AXIS

# 4.4.2.3 Define Segments (Dialog)

The "Define Segments" dialog defines all channel settings for a "Segmented" frequency sweep and imports or exports segmented sweep settings.

The dialog contains a table to edit the individual segments of the sweep range. Sweep segments may have common points or even overlap.

See also "Segmented" on page 267.

Access:CHANNEL > SWEEP > Sweep Type > Define Segments...

	On V	Start 100 kHz	Stop 5 GHz	Points	
2	ম	6 GHz	8.5 GHz	51	-
3	N	7 GHz	8.5 GHz	51	

## **Table Columns**

The table in the upper part of the "Define Segments" dialog contains an automatically assigned current number for each segment plus the following editable or non-editable columns:

- "On" provides check boxes to activate or deactivate each individual segment.
   "Sweep" points in inactive segments are not measured and not listed in the "Point List".
- "Start" is the stimulus (x-axis) value of the first point of the segment. If the segment contains more than one "Point", then "Start" must be smaller than the "Stop" value. If a "Start" value equal to or larger than the current "Stop" value is set, "Stop" is adjusted to the new "Start" value plus 1 Hz.
- "Stop" is the stimulus (x-axis) value of the last point of the segment. If the segment contains more than one "Point", then "Stop" must be larger or equal than the "Start" value. If a "Stop" value equal to or smaller than the current "Start" value is set, "Start" is adjusted to the new "Stop" value minus 1 Hz.
- "Points" is the number of sweep points in the segment. A single segment can consist
  of only one point. If "Points" is set to 1, then the "Stop" frequency is set equal to the
  "Start" frequency.
- The remaining columns show the channel settings for each segment. They are displayed only if they are selected in the "Displayed Columns" dialog.

#### Note: Limitations for overlapping segments

When overlapping sweep segments are created, the marker functions, trace evaluation functions, trace search functions and band filter functions are still available. It is possible, however, that these tools show an unexpected behavior when used in overlapping sweep segments. The reason is that the assignment of markers to traces in overlapping segments is ambiguous. To avoid any problem, it is recommended to turn off the sweep segments that overlap with the one that needs to be analyzed in detail with the aid of a marker function.

#### SCPI command:

[SENSe<Ch>:]SEGMent:COUNt? [SENSe<Ch>:]SEGMent<Seg>[:STATe] [SENSe<Ch>:]SEGMent<Seg>:FREQuency:STARt [SENSe<Ch>:]SEGMent<Seg>:FREQuency:CENTer? [SENSe<Ch>:]SEGMent<Seg>:FREQuency:SPAN? [SENSe<Ch>:]SEGMent<Seg>:SWEep:POINts

#### Add / Insert / Delete / Delete All

The four buttons below the segment list extend or shorten the list.

- "Add" adds a new segment to the end of the list.
- The added segment covers a possible frequency gap between the preceeding segment and the upper frequency limit of the analyzer. The start frequency of the new segment is set equal to the stop frequency of the preceeding segment (minus 1 Hz, if this value is already equal to the upper frequency limit). The stop frequency is equal to the upper frequency limit. The number of points is 51.
- "Insert" inserts a new segment before the active segment. The segment numbers of all segments after the new segment are incremented by one.

# www.valuetronics.com

The new segment covers a possible frequency gap between the two adjacent segments. If there is no gap, the stop frequency of the inserted segment is set to the start frequency of the next segment; the start frequency is equal to the stop frequency minus 1 Hz. A new segment which is inserted before segment no. 1 starts at the lower frequency limit of the analyzer. The number of points is 51.

- "Delete" removes the selected segment from the list.
- "Delete All" clears the entire segment list so it is possible to define or load a new segmented sweep range.

#### SCPI command:

```
[SENSe<Ch>:]SEGMent<Seg>:ADD
[SENSe<Ch>:]SEGMent<Seg>:INSert
[SENSe<Ch>:]SEGMent<Seg>:DELete[:DUMMy]
[SENSe<Ch>:]SEGMent<Seg>:DELete:ALL
```

# Show Point List...

Opens a list of all active sweep points and their channel settings. All columns except Pnt # and Frequency are displayed only if they are explicitly selected; see chapter 4.4.2.4, "Displayed Columns (Dialog)", on page 274.

	Pnt #	Segm Name	Frequency	Power	Bandw	Sel	LO	Se	*
1,	1	Low Frequency	100 kHz	-10 dBm	10 kHz	-10 dBm	Auto	2.	
2	2	Low Frequency	250.05 MHz	-10 dBm	10 kHz	-10 dBm	Auto	2.	
3	3	Low Frequency	500 MHz	-10 dBm	10 kHz	-10 dBm	Auto	2.	
4	4	Total Range	100 kHz	-300 dBm	10 kHz	-300 dBm	Auto	4.	
5	5	Total Range	750.075 MHz	-300 dBm	10 kHz	-300 dBm	Auto	4.	
6	6	Total Range	1.50005 GHz	-300 dBm	10 kHz	-300 dBm	Auto	4.	
7	7	Total Range	2.250025 GHz	-300 dBm	10 kHz	-300 dBm	Auto	4.	
8	8	Total Range	3 GHz	-300 dBm	10 kHz	-300 dBm	Auto	4.	
9	9	Medium Frequency	1.5 GHz	-300 dBm	10 kHz	-300 dBm	Auto	2.	
10	10	Medium Frequency	1.75 GHz	-300 dBm	10 kHz	-300 dBm	Auto	2.	Ŧ
4		M <del>.</del>			-		-	F	

#### Import... / Export...

The buttons open standard dialogs to import and export sweep segment settings.

- "Import..." loads a sweep segment list from a sweep segment file.
- "Export..." stores the current sweep segments to a sweep segment file.

## Sweep segment files

The analyzer uses a simple ASCII format to export sweep segment data. By default, the sweep segment file extension is \*.SegList. The file starts with two comment lines containing the version and a third line reproducing the header of the segment list. The following lines contain the entries of all columns of the segment list, including the "Displayed Columns" that may be hidden in the "Define Segments" dialog.

#### Example:

The segmented sweep range

	Name 🔷	On	Start	Stop	Points	Pwr (Pb)	Bar
1	Low Frequency	V	9 kHz	9.001 kHz	5	0 dBm	10 kHz
2	Total range	V	9 kHz	8.5 GHz	5	0 dBm	10 kHz
3	Medium frequency	V	4 GHz	5 GHz	5	0 dBm	10 kHz

is described by the following sweep segment file:

₩ version 1.00

**Note:** The sweep segment file actually contains more columns listing all channel settings of the individual sweep segments. The headings of the additional columns read: *IF Bandwidth [Hz]; enIF Selectivity; en IF Sideband; Meas Delay [µs]; boSweep Time Auto* 

SCPI command: MMEMory:LOAD:SEGMent MMEMory:STORe:SEGMent

## 4.4.2.4 Displayed Columns (Dialog)

The "Displayed Columns" dialog selects the segment-specific channel settings that the analyzer displays in the "Define Segments" and in the "Point List" dialogs.

All settings can be adjusted in the "Define Segments" dialog. By default, the first sweep segment is created with the channel settings defined for unsegmented sweep types. When any further sweep segment created, it uses the channel settings of the previously active segment.



## **Related information**

Refer to the following sections:

- chapter 4.4.2.3, "Define Segments (Dialog)", on page 271
- "Show Point List..." on page 273

Access:CHANNEL > SWEEP > Sweep Type > Define Segments... > Displayed Columns...



# www.valuetronics.com

# Table Columns

Each selected (checked) option adds a column to the segment list.

- "Name" adds a column to assign a name to each segment. A segment name is a string that may contain letters, numbers and special characters.
- "Power (Pb)" defines the internal source power for each individual sweep segment. See "Power" on page 256.
- "Meas Bandwidth" defines the IF filter bandwidth for each individual sweep segment. See "Bandwidth" on page 261.
- "Selectivity" defines the selectivity of the IF filter used for each sweep segment. See "Selectivity" on page 261.
- "LO <> RF" defines whether the analyzer measures the segment with a local oscillator frequency LO below or above the RF input frequency. The parameter replaces the "Spur Avoidance" settings for a particular segment; see "Image Suppr." on page 369.
- "Segment Bits" enables the definition of a segment-dependent four-bit binary value to control four independent output signals at the USER PORT connector (lines 16, 17, 18, 19; see chapter 9.1.1.1, "USER PORT", on page 922). The output signals are 3.3 V TTL signals which can be used to differentiate between up to 16 independent analyzer states.

Setting the segment bits does not change the analyzer state.

 "Time" defines the sweep time for each segment. The default configuration for a new segment is equal to the sweep time setting for unsegmented sweeps; see "Sweep Time / Auto" on page 265.

When "Time" is checked two new columns appear in the table. The first column reads "Segment Time" or "Meas Delay", depending on the selected radio button below the "Time" checkbox. The second column reads "Auto" and is used to activate automatic sweep time setting.

"Segment Time" is the total measurement time for the sweep segment. The minimum segment sweep time to be set is equal to the estimated value in "Auto" mode. "Meas Delay" sets a delay time allowing the DUT to settle before the hardware settings of the analyzer are changed and a new partial measurement is started. Changing the "Meas Delay" modifies the "Segment Time" and vice versa.

"Auto" minimizes the sweep time. If this option is checked, the columns "Segment Time" or "Meas Delay" cannot be edited. "Segment Time" indicates the estimated sweep time, depending on the current measurement settings, the "Meas Delay" is 0

**Channel Settings** 

s. The segment sweep time and point delay values are maintained until changed explicitly if "Auto" is switched off.

SCPI command:

```
[SENSe<Ch>:]SEGMent<Seq>:POWer[:LEVel]
[SENSe<Ch>:]SEGMent<Seq>:POWer[:LEVel]:CONTrol
[SENSe<Ch>:]SEGMent<Seg>:POWer[:LEVel]:CONTrol
[SENSe<Ch>:]SEGMent<Seg>:BWIDth[:RESolution]
[SENSe<Ch>:]SEGMent<Seg>:BWIDth[:RESolution]:CONTrol
[SENSe<Ch>:]SEGMent<Seq>:BWIDth[:RESolution]:SELect
[SENSe<Ch>:]SEGMent<Seg>:BWIDth[:RESolution]:SELect:CONTrol
[SENSe<Ch>:]SEGMent<Seg>:DEFine
[SENSe<Ch>:]SEGMent<Seg>:DEFine:SELect
[SENSe<Ch>:]SEGMent<Seg>:INSert
[SENSe<Ch>:]SEGMent<Seg>:INSert:SELect
[SENSe<Ch>:]SEGMent<Seg>:SWEep:DWEL1
[SENSe<Ch>:]SEGMent<Seg>:SWEep:DWEL1:CONTrol
[SENSe<Ch>:]SEGMent<Seg>:SWEep:TIME
[SENSe<Ch>:]SEGMent<Seg>:SWEep:TIME:CONTrol
[SENSe<Ch>:]SEGMent<Seg>:SWEep:TIME:SUM?
CONTrol:AUXiliary:C[:DATA]
```

## 4.4.2.5 Sweep > Sweep Control

Selects the number of sweeps per measurement cycle. The sweep mode ("Continuous" or "Single") and the number of sweeps apply to the active channel or to all channels, depending on the "Restart Manager" settings (see chapter 4.4.2.6, "Restart Manager (Dialog)", on page 277).

Sweep X Continuous Sweep Params O Single Sweep Sweeps Sweep Control Restart Sweep Restart All Channels Continous All Channels O Hold

Access: CHANNEL > SWEEP key or Alt + Shift + M

#### **Continuous / Single**

Activate either continuous or single sweep mode for the active channel.

 In "Continuous" mode, the analyzer measures continuously, repeating the current sweep.

 In "Single" sweep mode, the measurement is stopped after the number of selected "Sweeps". "Restart Sweep" initiates a new measurement cycle.

**Tip:** Use "All Channels Continuous" or "All Channels on Hold" to select a common sweep control mode for all channels.

SCPI command:

INITiate<Ch>:CONTinuous
See also:
CONFigure:CHANnel<Ch>:MEASure[:STATe]
CONFigure:CHANnel:MEASure:ALL[:STATe]

#### Sweeps

Selects the number of sweeps to be measured in single sweep mode: either one or a group of consecutive sweeps. The setting applies to the active channel.

In the "Restart Manager" dialog (accessible in R&S ZVAB compatibility mode), it is possible to define individual numbers of sweeps for all channels in the active recall set.

SCPI command:

[SENSe<Ch>:]SWEep:COUNt [SENSe:]SWEep:COUNt:ALL

#### **Restart Sweep**

Stops the current measurement and restarts a measurement cycle. In "Single" sweep mode a new single sweep sequence is started.

SCPI command:

INITiate<Ch>[:IMMediate][:DUMMy]
INITiate[:IMMediate]:ALL on page 639
See also "Remote Language" on page 431

## All Channels Continuous / on Hold

Selects a common sweep control mode for all channels of the active recall set.

- "All Channels Continuous:" The R&S ZNB continuously repeats the sweeps in all channels.
- "All Channels on Hold:" The R&S ZNB performs single sweeps, according to the channel-specific number of "Sweeps".

In R&S ZVAB compatibility mode the buttons are unavailable, however, you can use the "Restart Manager" dialog instead.

SCPI command: INITiate:CONTinuous:ALL

## 4.4.2.6 Restart Manager (Dialog)

The "Restart Manager" dialog defines whether the active sweep mode ("Continuous" or "Single") and the "Number of Sweeps" are valid for all channels in the active recall set or for the active channel only.

This dialog is relevant / accessible in the "ZVR" or "ZVABT" compatibility modes only.



#### Related information

Refer to chapter 4.4.2.5, "Sweep > Sweep Control", on page 276.

Access:CHANNEL > SWEEP > Sweep Control > Restart Manager...



#### **Sweep All Channels**

Apply the sweep control settings to all channels in the active recall set. The number of sweeps in a "Single" sweep sequence is equal to the selected number of "Sweeps" times the number of channels. The sequence starts with the first sweep in channel no. 1.

**Tip:** In remote control, it is possible to retrieve the results acquired in any of the sweeps within a single sweep group.

SCPI command:

INITiate<Ch>[:IMMediate]:SCOPe ALL
[SENSe<Ch>:]SWEep:COUNt

#### **Sweep Active Channel**

Apply the sweep control settings to the active channel only. The number of sweeps in a "Single" sweep sequence is equal to the number of "Sweeps" in the active channel.

The table lists all channels in the active recall set and allows you to define individual numbers of sweeps for all channels. When a new channel is selected, the analyzer uses its specific number of sweeps.

SCPI command:

INITiate<Ch>[:IMMediate]:SCOPe SINGle
[SENSe<Ch>:]SWEep:COUNt

# 4.4.3 Calibration

The "Calibration" menu provides all functions that are necessary to perform a system error correction, a scalar power calibration or a smarter calibration.

# 4.4.3.1 Calibration > Start Cal

Provides access to all functions for automatic or manual calibration. Calibration of the R&S ZNB is a fully menu-guided process.



Background information

Refer to the following sections:

- chapter 3.5, "Calibration", on page 69
- chapter 3.5.5, "Automatic Calibration", on page 84
- chapter 3.5.6, "Scalar Power Calibration", on page 92
- chapter 3.5.7, "SMARTerCal", on page 98
- chapter 3.1.5, "Data Flow", on page 18



Access: CHANNEL > CAL key or Alt + Shift + P



Since V1.70 it is possible to set up and perform multiple calibrations in a single manual calibration procedure. However, this "Multiple Cal in Calibration Wizard" feature is disabled by default and has to be activated in the Calibration tab of the "System Config" dialog.

The "Calibration" buttons open the following wizards/screens:

- Calibration > Start... (Cal Unit): Calibration Unit Wizard This button is active only if a calibration unit is connected to the analyzer.
- Calibration > Start... (Manual):
  - either Calibration Presetting Wizard
  - or Multiple Calibration Presetting Wizard

depending on the Multiple Cal in Calibration Wizard setting

• Scalar Power Cal > Power Cal...: Power Cal Screen

Channel Settings

- Smarter Cal > Start... (Cal Unit): SMARTerCal (Cal Unit) Wizard
- Smarter Cal > Start... (Manual):
  - either SMARTerCal (Manual) Wizard if disabled (default)
  - or Multiple SMARTerCal (Manual) Wizard if enabled

depending on the Multiple Cal in Calibration Wizard setting

The **Repeat...** buttons open the last dialogs of the calibration wizards from where you can directly (re-)start the calibration sweeps, maintaining the calibration settings of the active channel calibration. They provide a convenient means of repeating or correcting a calibration. See also "Save Sweep Data" on page 423.

# 4.4.3.2 Calibration Unit Wizard

The "Calibration Unit" guides you through the setup and execution of an automatic calibration.

The wizard proceeds through the following steps:

- 1. **Ports:** Select the calibrated ports, the cal unit characterization, and the calibration type.
- Connections: Define the port assignment(s) between the R&S ZNB and the calibration unit.
- 3. **Calibration:** Acquire measurement data for all standards required for the selected calibration type. Calculate the system error correction data (error terms) from the measurement data of the standards and apply the result to the active channel.



# **Background information**

Refer to chapter 3.5.5, "Automatic Calibration", on page 84.



- A successful calibration will supersede the previous calibration, discarding all previous system error correction data.
   To keep older correction data you can transfer them into a "Cal Pool" using the "Calibration Manager".
- The system error correction data determined in a calibration procedure is stored in the analyzer. You can read these correction data using the remote control command [SENSe<Ch>:] CORRection:CDATa.

If external switch matrices are involved, use [SENSe<Ch>:]CORRection: SMATrix:CDATa instead.

## Step 1: Ports

Selects the calibrated analyzer ports, the cal unit characterization, and the calibration type.

**Channel Settings** 



Background and related information

Refer to the following sections:

- chapter 3.5.1, "Calibration Types", on page 70
- chapter 3.5.5.3, "Characterization of Calibration Units", on page 89
- "Step 1: Ports" on page 310 (for SMARTerCal)

Access: CHANNEL > CAL > Start Cal > Start... (Cal Unit)



Fig. 4-2: Calibration Setup (>4 ports)

#### Ports

Selects the test port(s) to be calibrated.

SCPI command:

The port parameters in many calibration commands define the calibrated port(s).

#### Cal Unit

Displays the connected calibration units. The R&S ZNB auto-detects all calibration units which are connected to one of its USB ports. If several cal units are connected, one of them must be selected for calibration (active cal unit).

The calibration unit R&S ZV-Z51 is suited for R&S ZNB network analyzers. A warning is displayed if the current sweep range of the network analyzer exceeds the characterized frequency range of the calibration unit.

See also chapter 3.5.5.1, "Connecting the Calibration Unit", on page 86.

SCPI command:

SYSTem:COMMunicate:RDEVice:AKAL:ADDRess:ALL? SYSTem:COMMunicate:RDEVice:AKAL:ADDRess

#### Characterization

Displays all characterizations which are stored in the active cal unit. The "Factory" characterization is available for all calibration units; it ensures an accurate calibration for all standard applications. To account for a modified test setup (e.g. the connection of additional adapters to the calibration unit), you can generate modified sets of characterization data using the cal unit characterization wizard; see chapter 4.4.3.14, "Characterize Cal Unit (Dialog)", on page 343. By default, the R&S ZNB uses the last generated cal unit characterization.

**Tip:** If the characterization wizard is password-protected, the "Characterization" button is unavailable. Use this functionality to prevent inadvertent activatin of inappropriate characterizations. See "Authentication / Set Password" on page 344.

See also chapter 3.5.5.3, "Characterization of Calibration Units", on page 89.

#### SCPI command:

[SENSe<Ch>:]CORRection:COLLect:AUTO:CONFigure SYSTem:COMMunicate:RDEVice:AKAL:CKIT:CATalog? SYSTem:COMMunicate:RDEVice:AKAL:CKIT:STANdard:CATalog? SYSTem:COMMunicate:RDEVice:AKAL:SDATa?

#### Query further cal unit properties:

SYSTem:COMMunicate:RDEVice:AKAL:DATE?
SYSTem:COMMunicate:RDEVice:AKAL:FRANge?
SYSTem:COMMunicate:RDEVice:AKAL:PORTs?
SYSTem:COMMunicate:RDEVice:AKAL:WARMup[:STATe]?

#### Calibration Type / Source

Selects the calibration type for the selected physical port(s). For an overview refer to table 3-3.

The reflection calibration types can be used for any combination of physical ports: Reflection calibrations are simply repeated for each selected port. A transmission calibration type requires at least two physical ports. For the unidirectional transmission calibration types ("Trans Norm", "One Path Two Ports"), the direction (**"Source"** port) must be specified in addition.

**Note:** The transmission normalizations and the "One Path Two Ports Calibration" type require two-port (Through) characterization data for the cal unit, which may not be available on older calibration units or in user-defined cal unit characterization files. If a tooltip indicates missing two-port characterization data, simply perform a new characterization of your cal unit. In the first dialog of the "Characterization" wizard, select "Take All OSM and Through" to make sure the necessary two-port data is acquired. See also chapter 4.4.3.15, "Characterization Wizard", on page 345.

SCPI command:

[SENSe<Ch>:]CORRection:COLLect:AUTO:TYPE
[SENSe<Ch>:]CORRection:COLLect:AUTO:PORTs:TYPE
[SENSe<Ch>:]CORRection:COLLect:AUTO:CONFigure

## **Calibrate all Channels**

Check this box to apply the acquired correction data to all channels in the active recall set. Leave it unchecked (preset setting) to apply them only to the active channel.

Note that this option is available only if the active recall set contains multiple channels.

[SENSe:]CORRection:COLLect:CHANnels:ALL

## Next

SCPI command:

Proceeds to Step 2: Connections. Next is unavailable (and a warning is displayed) if the following happens:

- The selected characterization data do not cover all the ports to be calibrated.
- The selected characterization data do not contain all standards needed for the selected calibration type.

## Step 2: Connections

Defines the port assignment(s) between the R&S ZNB and the calibration unit.



Background information

Refer to

- chapter 3.5.5.4, "Multiple Port Assignments", on page 89 for details on multiple port assignments
- "Step 2: Connections" on page 313 for SMARTerCal.

Access: CHANNEL > CAL > Start Cal > Start... (Cal Unit) > Next

*	Cal Type		Ports						
	UOSM		P1, P2	2, IP3	, P4, P5, P	6, 97			
	-	_				_	_	_	
	Cal Unit Po 3.5 mm		Cal Unit Po 3.5 mm (		Cal Unit P 3.5 mm		Cal Unit F 3.5 mm		
	Port 1	*	Port 2	\$	Port 3	\$	Port 4	\$	
2	Port 1	\$	Port 5	\$	Port 6	\$	Port 7	¢	
	Port 1	÷	Port 5	¢	Port 6	¢	Port 7	<b></b>	

Fig. 4-3: Multiple Port Assignments

#### Cal Type / Ports (Table)

Shows the previously selected calibration type and calibrated port(s) that were selected in the "Ports" page of the dialog.

#### SCPI command:

The port parameters in many calibration commands define the calibrated port(s).

## Cal Unit Ports (Table Header)

Shows the connector type and gender at each calibrated analyzer port.

The test port connectors are automatically set according to the connector type of the selected calibration unit.

SCPI command: n/a

#### Port Assignments (Table Rows)

Displays the port assignments and allows to edit them.

The R&S ZNB always proposes an optimum solution (minimum number of assignments) that additionally minimizes the physical port reconnections required between calibration stages. For user-modified assignments it provides assistive information indicating insufficient, or redundant entries.

SCPI command:

```
[SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment<Asg>:DEFine
[SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment<Asg>:DEFine:TPORt
[SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment:COUNt?
```

#### **Detect Port Assignment**

Starts a procedure by which the R&S ZNB (with a little help from the attached calibration unit) auto-detects the connected ports. The automatic assignment replaces the configured one.

In case auto-detection fails

- an error report is shown as a warning dialog
- the undetected port connections are overlayed by warning signs
- the calibration may be invalid



If auto-detection fails because of a high attenuation in the signal path, you can either enter the port assignment manually or connect matching port numbers and select "Default Port Assignment".

SCPI command: [SENSe:]CORRection:COLLect:AUTO:PORTs:CONNection?

## Default Port Assignment

Restores the default port assignments.

SCPI command:

```
[SENSe:]CORRection:COLLect:AUTO:PORTs:CONNection?
[SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment:DEFine:DEFault
on page 731
```

#### Start

Proceeds to Step 3: Calibration .

If the configured port assignments are invalid, this action is disabled.


## Step 3: Calibration

During the calibration phase the R&S ZNB displays a "Cal Unit" screen that guides the user through the actual calibration, whose setup was prepared during the previous wizard steps.

In each step

- the calibration unit has to be (re-)connected according to the depicted port assignment; auto-detection is possible
- the related test ports are calibrated with the same calibration type that was selected for in the Step 1: Ports page
- a subsweep is performed for every required test port (pair), for every possible path (if external switch matrices are involved) and for every required standard

When these steps have been completed, the resulting system error correction can be calculated and applied.

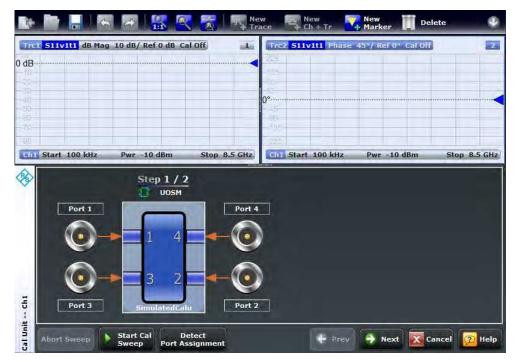

In the upper part of the "Cal Unit" screen, the R&S ZNB shows the calibration sweep diagrams for the currently measured S-parameter, the lower part visualizes the active port assignment and the measurement progress.

#### **Calibration Sweep Diagrams**

In absence of switch matrices, each diagram contains a single S-parameter trace and a typical result trace for the measured standard type. If switch matrices are involved, a sweep is performed for every possible signal path and for each of these paths a separate S-parameter trace is shown (see Multiple Paths and Calibration).



Fig. 4-4: Multiple traces due to multiple paths

The purpose of the typical result traces "Trc1" and "Trc2" is to avoid connection errors and to track hardware problems: if the correct standard type is measured, and everything is properly connected, then the measured traces are expected to be similar to the typical trace.

The S-Parameter traces are labeled P[*j\_i*]\_<standard type> S*ij*, where *j* indicates the input (test) port and *i* indicates the output port, e.g. P[1\_2]\_Through S21.

If switch matrices are involved, the label also indicates

- which VNA port b is switched to the input port j and
- which VNA port a is switched to the output port i

Instead of a single Sij trace we have multiple traces Sijvativbtj. E.g. S21v1t1v3t2 means that S21 is measured with VNA port 1 connected to the input port and VNA port 3 connected to the output port.

SCPI command:

n/a

## Start Cal Sweep / Abort Sweep

Starts the calibration sweep for the related port assignment or aborts it

SCPI command:

[SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment<Asg>:ACQuire

#### **Detect Port Assignment**

Starts a procedure by which the R&S ZNB (with a little help from the attached calibration unit) auto-detects the connected ports. The automatic assignment replaces the configured one.

In case auto-detection fails

an error report is shown as a warning dialog

Channel Settings

- the undetected port connections are overlayed by warning signs
- the calibration may be invalid

🚸 Warning 🛛 🗙	Step 1 / 1
Port 1: is not detected.	
Port 2: is not detected.	Port 1 Port 4
Port 3: is not detected.	
Port 4: is not detected.	
Calibration may be invalid.	
<i>и</i> ок	Port 3 Port 2 Port 2

If auto-detection fails because of a high attenuation in the signal path, you can either enter the port assignment manually or connect matching port numbers and select "Default Port Assignment".

SCPI command:

[SENSe:]CORRection:COLLect:AUTO:PORTs:CONNection?

#### Prev/Next

Navigates between the port assignments. Only available if multiple port assignments are required.

#### Apply/Cancel

Apply the calculated system error correction to the active channel (or to all channels in the active recall set, if all channels were calibrated).

The Apply button is enabled as soon as calibration sweeps have been successfully performed for all required port assignments.

#### SCPI command:

```
[SENSe<Ch>:]CORRection:COLLect:AUTO
[SENSe<Ch>:]CORRection:COLLect:AUTO:PORTs
[SENSe<Ch>:]CORRection:COLLect:AUTO:TYPE
[SENSe<Ch>:]CORRection:COLLect:AUTO:SAVE on page 734
Extended cal unit settings:
MMEMory:AKAL:FACTory:CONVersion
MMEMory:AKAL:USER:CONVersion
SYSTem:COMMunicate:AKAL:CONNection
SYSTem:COMMunicate:AKAL:MMEMory[:STATe]
```

## 4.4.3.3 Calibration Presetting Wizard

The "Calibration Presetting" wizard guides you through the setup and execution of a manual system error correction.

The wizard proceeds through the following steps:

- 1. Ports and Type: Select the ports to be calibrated and the calibration type to be used.
- Connectors and Cal Kits: Select the connector type and gender for all ports to be calibrated. If necessary, load or modify a calibration kit.
- Calibration: Acquire measurement data for the required ports or port pairs and the required standards. Finally, decide whether or not to apply the resulting system error correction.



## Background and related information

Refer to

- chapter 3.5, "Calibration", on page 69 for background information
- chapter 4.4.3.4, "Multiple Calibration Presetting Wizard", on page 295 for the "multiple calibration" variant of the wizard



- If the active channel is already equipped with a system error correction, the "Calibration Presetting" wizard loads the underlying setup. If the calibration setup is not changed and sweep data are available (see "Save Sweep Data" on page 423) the existing system error correction can be optimized without repeating the measurement of all standards.
- When you apply the acquired system error correction, the active calibration is replaced and discarded.
   To persist any kind of calibration you can transfer it to the "Cal Pool" using the
- Calibration Manager Dialog.
   The active system error correction data can be read (and modified) using the remote control command [SENSe<Ch>:]CORRection:CDATa.

#### Step 1: Ports and Type

Allows to select the test ports to be calibrated and the calibration type to be used



#### **Background information**

Refer to chapter 3.5.1, "Calibration Types", on page 70.

Access: CHANNEL > CAL > Start Cal > Start... (Manual)

**Channel Settings** 



Fig. 4-5: Calibration Presetting: Ports and Type (>4 ports available)

#### Ports

Selects the test port(s) to be calibrated.

SCPI command:

The port parameters in many calibration commands define the calibrated port(s).

#### Type / Source

Selects the calibration type. The green arrow symbols give a preview of the type and the number of calibration sweeps involved:

- Curved arrows (example: "Refl Norm Open") denote one or more reflection measurements at each port.
- Straight, horizontal arrows (example: "Trans Norm") denote one or more transmission measurements between each pair of two ports.
- The full n-port calibration types (n > 1, e.g. TOSM, TRL...) are symbolized by a closed square symbol. The number of arrows increases the complexity but can also improve the accuracy of the calibration.

The reflection calibration types can be used for any set of test ports: reflection calibrations are simply repeated for each port. A transmission calibration type requires at least two physical ports. For the unidirectional transmission calibration types ("Trans Norm", "One Path Two Ports"), the (**"Source"** port) must be specified in addition. For an overview refer to table 3-3.

# SCPI command:

[SENSe<Ch>:]CORRection:COLLect:METHod:DEFine

## **Calibrate all Channels**

Check this box to apply the acquired correction data to all channels in the active recall set. Leave it unchecked (preset setting) to apply them only to the active channel.

Note that this option is available only if the active recall set contains multiple channels.

SCPI command: [SENSe:]CORRection:COLLect:CHANnels:ALL

# Select/Deselect All

Selects/deselects all ports.

These buttons are only shown if more than 4 ports are available.

# Next

Proceeds to Step 2: Connectors and Cal Kits.

# Step 2: Connectors and Cal Kits

Selects the connector type and gender for all ports and allows you to import a calibration kit.



## **Background information**

Refer to chapter 3.5.2, "Calibration Standards and Calibration Kits", on page 78



# Messages in the dialog

An information (or error message) is displayed if one of the following happens:

- One of the selected calibration kits is described by ideal kit parameters or typical values.
- One of the selected calibration kits does not contain all standards that are required for the previously selected calibration type.
- Different connector types are defined at the ports but the selected calibration type requires uniform connectors.
- A cal kit standard does not cover the entire calibrated frequency range.

Access: CHANNEL > CAL > Start Cal > Start... (Manual) > Next

**Channel Settings** 

	/pe ans Norm	Ports P1(Source	ce), P2		
Port	Connector	Gender	Cal Kit		
			2.92 mm Ideal Kit 🗘		
0 P2	2.92 mm \$	Female \$	2.92 mm Ideal Kit		

Fig. 4-6: Calibration Presetting: Connectors and Cal Kits (>4 ports)

The upper part of the panel shows the port(s) and the calibration type selected in Step 1: Ports and Type. The lower part gives access to the connector and cal kit settings.

#### **Connector / Gender**

Defines the connector types and genders of the ports to be calibrated. For symmetric (sexless) connector types (e.g. 7 mm / PC7), "Gender" is unavailable.

If "Same Connector All Ports" is active, the connector types at all ports (but not their gender) are always adjusted to the current selection. If "Same Gender All Ports" is active, the genders at all ports are always adjusted to the current selection.

User-defined connectors can be added or removed in the Cal Connector Types (Dialog).

#### SCPI command:

```
[SENSe<Ch>:]CORRection:COLLect:CONNection<PhyPt>
[SENSe<Ch>:]CORRection:COLLect:SCONnection<PhyPt>
[SENSe<Ch>:]CORRection:CONNection
[SENSe<Ch>:]CORRection:CONNection:CATalog?
[SENSe<Ch>:]CORRection:CONNection:DELete
```

# Cal Kit

Selects a cal kit for the connector at each selected physical port. The drop-down list contains all available calibration kits for the selected connector type. The assignment of a calibration kit to a connector type must be the same for all physical ports: If a calibration kit is changed, the R&S ZNB automatically assigns the new kit to all ports with the same connector type.

Use "Import Cal Kit..." to add new kits to the list.

SCPI command:

[SENSe:]CORRection:CKIT:SELect

#### **Use Sliding Match**

Available for cal kits which contain a Sliding Match standard; see chapter 3.5.2.3, "Sliding Match Standards", on page 82.

If selected, the Sliding Match appears in the list of measured standards whenever the selected calibration type requires a Match. For a valid calibration, either the Match or at least three positions of the Sliding Match must be measured.

SCPI command: n/a

n/a

# Same Connector / Gender All Ports

Assigns the same connector type or gender to all selected physical ports. For some multiport calibration types, the port connector types must be equal, e.g. because they require a Through standard with known characteristics.

SCPI command:

[SENSe<Ch>:]CORRection:COLLect:CONNection:PORTs [SENSe<Ch>:]CORRection:COLLect:CONNection:GENDers

#### **Import Cal Kit**

Opens the Import Calibration Kit dialog to load and (if desired) activate a cal kit file. See chapter 3.5.2.4, "Cal Kit Files", on page 82.

By default cal kit files are stored in the

C:\Users\Public\Documents\Rohde-Schwarz\Vna\Calibration directory.

Three different import file formats are supported: R&S ZVA-specific binary cal kit files (\*.calkit), ZVR-specific binary cal kit files (\*.ck), cal kit files in Agilent-specific ASCII formats (\*.csv, \*.prn.

#### SCPI command:

MMEMory:LOAD:CKIT MMEMory:LOAD:CKIT:SDATa

## Back

Go back to Step 1: Ports and Type.

#### Start


Start Step 3: Calibration.

## Step 3: Calibration

Allows to acquire error correction data for every required port (pair) and calibration standard, where "required" depends on the selected ports and calibration type. On "Apply" the R&S ZNB calculates the system error correction (error terms) from the measurement data of the standards and applies the result to the active channel.



The "Reduced Through" logic helps to keep the number of transmission measurements as small as possible (see chapter 3.5.1.10, "Full n-Port Calibration with Reduced Number of Through Connections", on page 77).

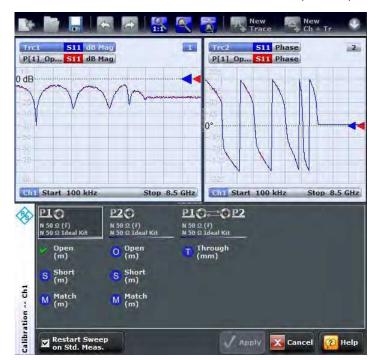

Access: CHANNEL > CAL > Start Cal > Start... (Manual) > Next > Next

In the upper part of the calibration screen, the R&S ZNB shows the calibration sweep diagrams for the currently measured S-parameter, the lower part displays the calibrated ports and standards and visualizes the measurement progress.

#### **Calibration Sweep Diagrams**

In absence of switch matrices, each diagram contains a single S-parameter trace and a typical result trace for the measured standard type. If switch matrices are involved, a sweep is performed for every possible signal path and for each of these paths a separate S-parameter trace is shown (see Multiple Paths and Calibration).



Fig. 4-7: Multiple traces due to multiple paths

The purpose of the typical result traces "Trc1" and "Trc2" is to avoid connection errors and to track hardware problems: if the correct standard type is measured, and everything is properly connected, then the measured traces are expected to be similar to the typical trace.

The S-Parameter traces are labeled P[*j\_i*]\_<standard type> S*ij*, where *j* indicates the input (test) port and *i* indicates the output port, e.g. P[1\_2]\_Through S21.

If switch matrices are involved, the label also indicates

- which VNA port b is switched to the input port j and
- which VNA port a is switched to the output port i

Instead of a single Sij trace we have multiple traces Sijvativbtj. E.g. S21v1t1v3t2 means that S21 is measured with VNA port 1 connected to the input port and VNA port 3 connected to the output port.

SCPI command:

n/a

# **Ports and Standards**

Shows the calibrated port(s) and standards and visualizes the measurement progress.

A green checkmark indicates that the calibration data of a standard has been acquired successfully. A green checkmark after the port symbol indicates that the minimum number of calibration measurements for the port has been performed.

#### Tip: Optional calibration measurements

For most calibration and standard types, the "Calibration" dialog shows only mandatory calibration measurements. Note the following exceptions:

- If a sliding match measurement is selected in the "Calibration Presetting" dialog, either the Match or at least three positions of the Sliding Match must be measured. See chapter 3.5.2.3, "Sliding Match Standards", on page 82.
- For a TRL calibration, at least one line standard must be measured between any pair of calibrated ports. See chapter 3.5.1.8, "TRL Calibration", on page 74.

#### SCPI command:

[SENSe<Ch>:]CORRection:COLLect[:ACQuire]:SELected See also: [SENSe<Ch>:]CORRection:COLLect:LOAD:SELected

#### **Restart Sweep on Std Meas**

If this function is active, a new standard measurement initiates a new sweep, starting at the beginning ("Start") of the sweep range: The sweep points for the calibration sweep are in ascending order, like for an ordinary measurement.

If "Restart Sweep on Std Meas" is not active, the new standard measurement is started at the current sweep point; the current sweep is continued as a calibration sweep.

#### Note:

Since software version 1.70 this function has a secondary effect in idle mode (i.e. while the calibration sweep is NOT running):

- If active, only the selected trace is refreshed.
- If inactive, the R&S ZNB permanently refreshes all traces of all diagrams which may put a heavy load on the connected switch matrices (if any).

Hence it is recommended (and default) to activate it, in particular if one of the matrices uses mechanical switches that will be worn off fast (apart from making noise).

#### Apply

Is enabled as soon as sufficient data have been acquired for the calibrated ports and standards. The button starts the calculation of the system error correction and closes the calibration wizard. The current instrument settings is stored with the correction data.

To avoid incompatibilities, older calibration data is deleted unless it has been transferred into a "Cal Pool" using the Calibration Manager Dialog.

#### Note: Checks during the calculation of correction data

Incompatibilities between the selected calibration type, the standards and the channel settings may cause the calibration to be inaccurate. The analyzer auto-detects potential sources of errors and displays appropriate, self-explanatory notice boxes.

## SCPI command:

```
[SENSe<Ch>:]CORRection:COLLect:SAVE:SELected[:DUMMy]
[SENSe<Ch>:]CORRection:COLLect:SAVE:SELected:DEFault
[SENSe<Ch>:]CORRection:COLLect:DELete
[SENSe<Ch>:]CORRection:DATA:PARameter<Sfk>?
[SENSe<Ch>:]CORRection:DATA:PARameter<Sfk>:PORT<PhyPt>?
[SENSe<Ch>:]CORRection:DATE?
[SENSe<Ch>:]CORRection:SSTate?
[SENSe<Ch>:]CORRection:STIMulus?
[SENSe<Ch>:]CORRection:STIMulus?
```

# 4.4.3.4 Multiple Calibration Presetting Wizard

The "Multiple Cal" version of the Calibration Presetting Wizard wizard guides you through the setup and simultaneous manual acquisition of multiple system error corrections.

The wizard proceeds through the following steps:

 Ports and Type: Define the sets of ports to be calibrated and the calibration types to be used for the individual sets

- 2. **Connectors and Cal Kits:** Select the connector type and gender for all ports to be calibrated. If necessary, load or modify a calibration kit.
- Calibration: Acquire measurement data for the required ports or port pairs and the required standards. Finally, decide whether or not to apply the resulting system error correction.



# Background and related information

Refer to

- chapter 3.5, "Calibration", on page 69 for background information.
- The "Multiple Cal in Calibration Wizard" feature is disabled by default and has to be activated in the Calibration tab of the "System Config" dialog. chapter 4.4.3.3, "Calibration Presetting Wizard", on page 287 for the "single calibration" variant of the wizard



- If the active channel is already calibrated, the wizard will attempt to load the calibration. If the calibration setup is unchanged and sweep data are available (see "Save Sweep Data" on page 423) the existing system error correction can be optimized without repeating the measurement of all standards.
- When you apply the acquired system error correction, the active calibration is replaced and discarded.
   To persist any kind of calibration you can transfer it to the "Cal Pool" using the Calibration Manager Dialog.
- The active system error correction data can be read (and modified) using the remote control command [SENSe<Ch>:]CORRection:CDATa.

## Step 1: Ports and Type

The first page of the wizard presents the list of already configured calibrations and allows to

- "Add" new calibrations
- "Delete" or "Modify" existing calibrations

Access: CHANNEL > CAL > Start Cal > Start... (Manual)

**Channel Settings** 



### **Calibrate all Channels**

Check this box to apply the acquired correction data to all channels in the active recall set. Leave it unchecked (preset setting) to apply them only to the active channel.

Note that this option is available only if the active recall set contains multiple channels.

SCPI command:

[SENSe:]CORRection:COLLect:CHANnels:ALL

## Add

Adds a new system error correction.

The "Add" button opens the Define Calibration (Dialog) dialog without pre-selected ports.

#### Delete

Deletes the selected calibration from the list of configured calibrations.

## Modify

Edits the selected system error correction: opens the Define Calibration (Dialog) dialog with the corresponding ports and calibration type pre-selected.

#### Next

Proceeds to Step 2: Connectors and Cal Kits.

Inactive as long as no calibration is defined.

#### **Define Calibration (Dialog)**

The "Define Calibration" dialog allows to select the test ports to be calibrated and the calibration type to be used.



## Background information

Refer to chapter 3.5.1, "Calibration Types", on page 70 for background information.



Access: CHANNEL > CAL > Start Cal > Start... (Manual) > Add/Modify

Fig. 4-8: Define Calibration (>4 ports available)

#### Ports

Selects the test port(s) to be calibrated.

SCPI command:

The port parameters in many calibration commands define the calibrated port(s).

#### Type / Source

Selects the calibration type. The green arrow symbols give a preview of the type and the number of calibration sweeps involved:

- Curved arrows (example: "Refl Norm Open") denote one or more reflection measurements at each port.
- Straight, horizontal arrows (example: "Trans Norm") denote one or more transmission measurements between each pair of two ports.
- The full n-port calibration types (n > 1, e.g. TOSM, TRL...) are symbolized by a closed square symbol. The number of arrows increases the complexity but can also improve the accuracy of the calibration.

The reflection calibration types can be used for any set of test ports: reflection calibrations are simply repeated for each port. A transmission calibration type requires at least two physical ports. For the unidirectional transmission calibration types ("Trans Norm", "One Path Two Ports"), the (**"Source"** port) must be specified in addition. For an overview refer to table 3-3.

#### SCPI command:

[SENSe<Ch>:]CORRection:COLLect:METHod:DEFine

# Select/Deselect All

Selects/deselects all ports.

These buttons are only shown if more than 4 ports are available.

## Step 2: Connectors and Cal Kits

Selects the connector type and gender for all ports and allows you to import a calibration kit.



# **Background information**

Refer to chapter 3.5.2, "Calibration Standards and Calibration Kits", on page 78 for background information.



## Messages in the dialog

An information (or error message) is displayed if one of the following happens:

- One of the selected calibration kits is described by ideal kit parameters or typical values.
- One of the selected calibration kits does not contain all standards that are required for the previously selected calibration type.
- Different connector types are defined at the ports but the selected calibration type requires uniform connectors.
- A cal kit standard does not cover the entire calibrated frequency range.

#### Access: CHANNEL > CAL > Start Cal > Start... (Manual) > Next

		and Cal Kits onnector typ	e and gender	r for ports. If nece	essary, chani	ge the Cal Kit or lo	ad an appropriate	¢
$\Rightarrow$	Cal Ty	pe	Ports					
1	Te	SM	P1, P2					
2	🚺 TO:	SM	P1, P3					
3	🚺 то	SM	P1, P4					
			-					
$\Leftrightarrow$	Port	Connector	Gender	Cal Kit				
1	Ø P1	2.92 mm 🖨	Female \$	3652-1	*			
2	O P2	2.92 mm 🖨	Female \$	3652-1	\$			
	ame Co	nnector	- Same Gend	er )		No. of Positions		port
a	Il Ports		Same Gend all Ports	Use S	liding Match	(3	Cal	Kit

The upper part of the panel shows the previously configured calibration(s). Select the appropriate one to get access to the related ports.

#### **Connector / Gender**

Defines the connector types and genders of the ports to be calibrated. For symmetric (sexless) connector types (e.g. 7 mm / PC7), "Gender" is unavailable.

If "Same Connector All Ports" is active, the connector types at all ports (but not their gender) are always adjusted to the current selection. If "Same Gender All Ports" is active, the genders at all ports are always adjusted to the current selection.

User-defined connectors can be added or removed in the Cal Connector Types (Dialog).

SCPI command:

[SENSe<Ch>:]CORRection:COLLect:CONNection<PhyPt>
[SENSe<Ch>:]CORRection:COLLect:SCONnection<PhyPt>
[SENSe<Ch>:]CORRection:CONNection
[SENSe<Ch>:]CORRection:CONNection:CATalog?
[SENSe<Ch>:]CORRection:CONNection:DELete

#### Cal Kit

Selects a cal kit for the connector at each selected physical port. The drop-down list contains all available calibration kits for the selected connector type. The assignment of a calibration kit to a connector type must be the same for all physical ports: If a calibration kit is changed, the R&S ZNB automatically assigns the new kit to all ports with the same connector type.

Use "Import Cal Kit..." to add new kits to the list.

SCPI command:

[SENSe:]CORRection:CKIT:SELect

#### **Use Sliding Match**

Available for cal kits which contain a Sliding Match standard; see chapter 3.5.2.3, "Sliding Match Standards", on page 82.

If selected, the Sliding Match appears in the list of measured standards whenever the selected calibration type requires a Match. For a valid calibration, either the Match or at least three positions of the Sliding Match must be measured.

SCPI command:

n/a

#### Same Connector / Gender All Ports

Assigns the same connector type or gender to all selected physical ports. For some multiport calibration types, the port connector types must be equal, e.g. because they require a Through standard with known characteristics.

SCPI command:

[SENSe<Ch>:]CORRection:COLLect:CONNection:PORTs
[SENSe<Ch>:]CORRection:COLLect:CONNection:GENDers

## **Import Cal Kit**

Opens the Import Calibration Kit dialog to load and (if desired) activate a cal kit file. See chapter 3.5.2.4, "Cal Kit Files", on page 82.

#### By default cal kit files are stored in the

- C:\Users\Public\Documents\Rohde-Schwarz\Vna\Calibration directory.
- Three different import file formats are supported: R&S ZVA-specific binary cal kit files (\*.calkit), ZVR-specific binary cal kit files (\*.ck), cal kit files in Agilent-specific ASCII formats (\*.csv, \*.prn.

SCPI command:

MMEMory:LOAD:CKIT MMEMory:LOAD:CKIT:SDATa

#### Back

Go back to Step 1: Ports and Type.

## Start


Start Step 3: Calibration.

#### Step 3: Calibration

Allows to acquire error correction data for every required port (pair) and calibration standard, where "required" depends on the selected ports and calibration types. On "Apply" the R&S ZNB calculates the system error correction (error terms) from the measurement data of the standards and applies the result to the active channel.



The possibility to "share" measurements between the calibrations and the "Reduced Through" logic help to keep the number of measurements as small as possible (see chapter 3.5.1.10, "Full n-Port Calibration with Reduced Number of Through Connections", on page 77).

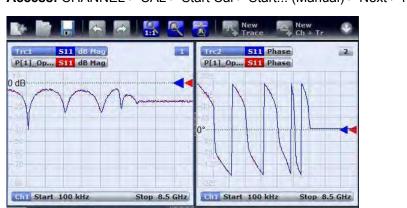

P10 == 0 P2

N 50 Q (F) N 50 Q Ideal Kit

Through (mm)

X Cancel

Help

Access: CHANNEL > CAL > Start Cal > Start... (Manual) > Next > Next

User Manual 1173.9163.02 - 13

Calibration -- Chi

P10

N 50 Ω (f) N 50 Ω Ideal Kit

> Open (m)

S Short (m)

M Match

Restart Sw on Std. Mea P20 N 50 Ω (F) N 50 Ω Ideal Kit

O Open (m)

S Short (m)

M Match

eep

# www.valuetronics.com

In the upper part of the measurement screen, the R&S ZNB shows the calibration sweep diagrams for the currently measured S-parameter, the lower part displays the calibrated ports and standards and visualizes the measurement progress.

#### **Calibration Sweep Diagrams**

In absence of switch matrices, each diagram contains a single S-parameter trace and a typical result trace for the measured standard type. If switch matrices are involved, a sweep is performed for every possible signal path and for each of these paths a separate S-parameter trace is shown (see Multiple Paths and Calibration).



Fig. 4-9: Multiple traces due to multiple paths

The purpose of the typical result traces "Trc1" and "Trc2" is to avoid connection errors and to track hardware problems: if the correct standard type is measured, and everything is properly connected, then the measured traces are expected to be similar to the typical trace.

The S-Parameter traces are labeled P[*j\_i*]\_<standard type> S*ij*, where *j* indicates the input (test) port and *i* indicates the output port, e.g. P[1\_2]\_Through S21.

If switch matrices are involved, the label also indicates

- which VNA port b is switched to the input port j and
- which VNA port a is switched to the output port i

Instead of a single Sij trace we have multiple traces Sijvativbtj. E.g. S21v1t1v3t2 means that S21 is measured with VNA port 1 connected to the input port and VNA port 3 connected to the output port.

SCPI command:

n/a

## **Ports and Standards**

Shows the calibrated port(s) and standards and visualizes the measurement progress.

A green checkmark indicates that the calibration data of a standard has been acquired successfully. A green checkmark after the port symbol indicates that the minimum number of calibration measurements for the port has been performed.

#### Tip: Optional calibration measurements

# www.valuetronics.com

For most calibration and standard types, the "Calibration" dialog shows only mandatory calibration measurements. Note the following exceptions:

- If a sliding match measurement is selected in the "Calibration Presetting" dialog, either the Match or at least three positions of the Sliding Match must be measured. See chapter 3.5.2.3, "Sliding Match Standards", on page 82.
- For a TRL calibration, at least one line standard must be measured between any pair of calibrated ports. See chapter 3.5.1.8, "TRL Calibration", on page 74.

SCPI command:

[SENSe<Ch>:]CORRection:COLLect[:ACQuire]:SELected See also: [SENSe<Ch>:]CORRection:COLLect:LOAD:SELected

#### **Restart Sweep on Std Meas**

If this function is active, a new standard measurement initiates a new sweep, starting at the beginning ("Start") of the sweep range: The sweep points for the calibration sweep are in ascending order, like for an ordinary measurement.

If "Restart Sweep on Std Meas" is not active, the new standard measurement is started at the current sweep point; the current sweep is continued as a calibration sweep.

#### Note:

Since software version 1.70 this function has a secondary effect in idle mode (i.e. while the calibration sweep is NOT running):

- If active, only the selected trace is refreshed.
- If inactive, the R&S ZNB permanently refreshes all traces of all diagrams which may put a heavy load on the connected switch matrices (if any).

Hence it is recommended (and default) to activate it, in particular if one of the matrices uses mechanical switches that will be worn off fast (apart from making noise).

#### Apply

Is enabled as soon as sufficient data have been acquired for the calibrated ports and standards. The button starts the calculation of the system error correction and closes the calibration wizard. The current instrument settings is stored with the correction data.

To avoid incompatibilities, older calibration data is deleted unless it has been transferred into a "Cal Pool" using the Calibration Manager Dialog.

#### Note: Checks during the calculation of correction data

Incompatibilities between the selected calibration type, the standards and the channel settings may cause the calibration to be inaccurate. The analyzer auto-detects potential sources of errors and displays appropriate, self-explanatory notice boxes.

#### SCPI command:

```
[SENSe<Ch>:]CORRection:COLLect:SAVE:SELected[:DUMMy]
[SENSe<Ch>:]CORRection:COLLect:SAVE:SELected:DEFault
[SENSe<Ch>:]CORRection:COLLect:DELete
[SENSe<Ch>:]CORRection:DATA:PARameter<Sfk>?
[SENSe<Ch>:]CORRection:DATA:PARameter<Sfk>:PORT<PhyPt>?
[SENSe<Ch>:]CORRection:DATE?
[SENSe<Ch>:]CORRection:SSTate?
[SENSe<Ch>:]CORRection:STIMulus?
```

[SENSe<Ch>:]CORRection:STIMulus:PORT<PhyPt>?

# 4.4.3.5 Power Cal Screen

The "Power Cal" screen shows the current source ("Power") and receive ("Meas. Receiver") ports and allows you to perform scalar source power calibrations (flatness calibrations) or measurement receiver calibrations, based on the current power calibration settings. If the active recall set contains several channels, an "Info" box lets you decide whether the R&S ZNB acquires calibration data for the active channel or for all channels.

Start 100 kHz		Pwr -10	) dBm Bw 10 kHz		St	op 8.5
P1 O	<u>P30</u>	<u>P2</u> 0	<u>P4</u> 0	<u>61</u>	<u>62</u>	
- 10 dBm Offset: 0 dB	-10 dBm Offset: 0 dB	-10 dBm Offset: 0 dB	-10 dBm Offset: 0 dB	SMB100A::GPIB0::2 -10 dBm Offset: 0 dB	SME03::GPIB2::22:: -10 dBm Offset: 0 dB	
O Power	O Power	O Power	O Power	O Power	O Power	
Meas, Receiver	Meas. Receiver	Meas. Receiver	Meas. Receiver			

Access: CHANNEL > CAL > Start Cal > Power Cal...

#### **Screen Elements**

From top to bottom, the screen consists of the following elements.

#### **Calibration Sweep Diagram**

The calibration sweep diagram in the upper part of the screen shows the progress of the calibration and the accuracy of a completed calibration ("Verification"). The diagram is scaled in "dB Mag" format.

The diagram title indicates the ongoing calibration type and reading. The traces in the diagram vary according to the calibration stage.

While no calibration is performed, or during a source power calibration ("Power"), the following traces are displayed:

- A limit line (double horizontal) represents the target power of the source power calibration ("Cal Power").
- "Pmtr<n>" shows the reading of the power meter Pmtr <n> in use. This trace is only shown during the first calibration sweeps; the following sweeps are based on the reference receiver result.
- "a<m>" shows the source power reading of the analyzer (wave quantity, reference receiver) at the calibrated source port P<m>.

After successful power calibration the trace a<m> should be close to the cal power.

User Manual 1173.9163.02 - 13

# www.valuetronics.com

During a measurement receiver calibration ("Meas. Receiver"), the following traces are displayed:

- The trace b<n> shows the current power reading of the analyzer at the calibrated receive port P<n>.
- The trace a<m> shows the (previously calibrated) power at the calibrated reference plane (source port P<m>).

After successful measurement receiver calibration, the b<n> trace should be close to the a<m> trace. Due to the previous power calibration, both traces should be close to the cal power.

SCPI command:

SOURce<Ch>:POWer<PhyPt>:CORRection[:ACQuire]:VERification: RESult?

## **Port Overview**

Shows all source ports together with the possible power calibrations. Either a source power calibration (flatness calibration, "Power") or a measurement receiver calibration ("Meas. Receiver") can be performed at each analyzer port P1 ... PN.

- If external generators are configured, they appear as additional source ports G1 ... Gm in the port overview. A source power calibration is available at each generator port.
- If a SMARTerCal is active, (additional) receiver power calibrations are not allowed and the R&S ZNB only offers the possibility to perform "Source Flatness" calibrations of the related test ports:



See chapter 3.5.7.3, "Combining SMARTerCal with Scalar Power Calibration", on page 99 for details.

Select a "Power" or "Meas. Receiver" symbol to open the "Power Cal" dialog and perform a calibration sweep. A green checkmark indicates that the calibration data has been acquired successfully.

See also "Power Cal – Power (Dialog)" on page 306 and "Power Cal – Meas. Receiver (Dialog)" on page 308.

SCPI command:

n/a, see SOURce<Ch>: POWer<PhyPt>:CORRection[:ACQuire]
[SENSe<Ch>:]CORRection:POWer<PhyPt>:ACQuire
SOURce<Ch>:POWer:CORRection:DATA:PARameter<Wv>?
SOURce<Ch>:POWer<PhyPt>:CORRection:DATA:PARameter<Wv>:COUNt?

## Apply

Is enabled as soon as a new set of power calibration data has been acquired for either a "Power" source or a "Meas. Receiver". The button applies all available source and/or measurement receiver calibrations to the active channel, aborts the verification sweeps, and closes the port overview section. The power calibration state is indicated in the trace list, see chapter 3.5.6.3, "Power Calibration Labels", on page 95. Use the functions in the "Use Cal" panel to activate, deactivate, or store power calibrations.

SCPI command:

```
SOURce<Ch>:POWer<PhyPt>:CORRection[:ACQuire]
[SENSe<Ch>:]CORRection:POWer<PhyPt>:ACQuire
SOURce<Ch>:POWer:CORRection:DATA
SOURce<Ch>:POWer:CORRection:DATA:PORT<PhyPt>
[SENSe<Chn>:]CORRection:PSTate?
```

# Power Cal – Power (Dialog)

The "Power Cal – Power" dialog guides you through the power calibration for a particular source port (flatness and reference receiver calibration). Measurement receiver calibration is described in "Power Cal – Meas. Receiver (Dialog)" on page 308.



**Background information** 

Refer to chapter 3.5.6.1, "Source Power Calibration", on page 93.

# Access: CHANNEL > CAL > Start Cal > Power Cal... > Power



# **Port Overview**

The dialog shows all source ports of the network analyzer. The selected port is displayed with the current cal power settings (see chapter 4.4.3.17, "Modify Cal Power (Dialog)", on page 349); moreover, a circuit diagram visualizes the purpose of the flatness and reference receiver calibration. A power meter must be connected to the calibrated port.

SCPI command:

SOURce<Ch>: POWer<PhyPt>: CORRection[:ACQuire]

#### Start Cal Sweep

Start the calibration sweep(s) for the selected port and power calibration settings and close the dialog. The calibration is performed as described in "Calibration procedure" on page 93.

Open the "Pwr Cal Settings" softtool panel if you wish to modify the calibration procedure. SCPI command:

SOURce<Ch>: POWer<PhyPt>:CORRection[:ACQuire]
SOURce<Ch>: POWer<PhyPt>:CORRection:COLLect[:ACQuire]

## Power Cal – Source Flatness (Dialog)

The "Power Cal –Source Flatness" dialog guides you through the source power calibration for a single port. The source flatness data complement the active SMARTerCal.

# **Background information**

Refer to chapter 3.5.6.1, "Source Power Calibration", on page 93 and chapter 3.5.7.3, "Combining SMARTerCal with Scalar Power Calibration", on page 99.

Access: CHANNEL > CAL > Start Cal > Power Cal... > Source Flatness



#### **Port Overview**

The dialog shows the selected source port with its current cal power settings (see chapter 4.4.3.17, "Modify Cal Power (Dialog)", on page 349); moreover, a circuit diagram visualizes the purpose of the flatness and reference receiver calibration. A power meter must be connected to the calibrated port.

SCPI command:

SOURce<Ch>:POWer<PhyPt>:CORRection[:ACQuire]

## Start Cal Sweep

Start the calibration sweep(s) for the selected port and power calibration settings and close the dialog. The calibration is performed as described in "Calibration procedure" on page 93.

Open the "Pwr Cal Settings" softtool panel if you wish to modify the calibration procedure.

SCPI command:

```
SOURce<Ch>:POWer<PhyPt>:CORRection[:ACQuire]
SOURce<Ch>:POWer<PhyPt>:CORRection:COLLect[:ACQuire]
```

## Power Cal – Meas. Receiver (Dialog)

The "Power Cal – Meas. Receiver" dialog guides you through the power calibration for a particular receiver port.

"Meas. Receiver" calibrates the **measurement** receiver only; the "reference" receiver is calibrated together with the source. To ensure accurate source signal powers, a source power calibration is required prior to the measurement receiver calibration.



## **Background information**

Refer to chapter 3.5.6.2, "Measurement Receiver Calibration", on page 94.



### Access: CHANNEL > CAL > Start Cal > Power Cal... > Meas. Receiver

## **Port Overview**

The dialog shows all receiver ports of the network analyzer. The selected port is displayed with the current cal power settings (see chapter 4.4.3.17, "Modify Cal Power (Dialog)", on page 349); moreover, a circuit diagram visualizes the purpose of the measurement receiver calibration.

"Source Port" defines the type of measurement receiver calibration:

 If the source port is equal to the calibrated port P<sub>n</sub>, the measurement receiver is calibrated by the wave a<sub>n</sub> which is reflected back by a connected Open or Short standard. A reference receiver power calibration must be active to ensure accurate source powers a<sub>n</sub>.

Connect the Open or Short standard to the calibrated port; no additional external test setup is required.

 If the source port and the calibrated port P<sub>n</sub> are different, the measurement receiver is calibrated by the wave b<sub>n</sub> from the other port. A source power calibration for b<sub>n</sub> must be active.

Connect the source port to the calibrated port, including any external devices that you used for the source power calibration.

SCPI command:

[SENSe<Ch>:]CORRection:POWer<PhyPt>:ACQuire

### Start Cal Sweep

Start the calibration sweep for the selected port and power calibration settings and close the dialog. The calibration is performed as described in "Calibration procedure" on page 94. No additional calibration settings are needed.

SCPI command:

```
[SENSe<Ch>:]CORRection:POWer<PhyPt>:ACQuire
[SENSe<Ch>:]CORRection:POWer:DATA
[SENSe<Ch>:]CORRection:POWer:DATA:PORT<PhyPt>
```

### 4.4.3.6 SMARTerCal (Cal Unit) Wizard

The "SMARTerCal (Cal Unit)" wizard guides you through the setup and execution of an automatic SMARTerCal.

The guided SMARTerCal is analogous to a regular automatic calibration with an additional power calibration sweep at a single analyzer port. It consists of the following steps:

- 1. **Ports:** Select the calibrated ports, the cal unit characterization, and the calibration type.
- Connectors: Define the port assignment between the R&S ZNB and the calibration unit and select one of the calibrated ports for power calibration.
- SMARTerCal: Acquire measurement data for all standards that are required for the selected calibration type. Calculate the system error correction data (error terms) from the measurement data of the standards and apply the result to the active channel.

Acquire the power calibration data at the selected port and use this result to correct the absolute receiver powers at all calibrated ports.



## Background and related information

- Refer to chapter 3.5.7, "SMARTerCal", on page 98 for backgound information
- Use the Power Cal Screen to perform an additional source flatness calibration (see chapter 3.5.7.3, "Combining SMARTerCal with Scalar Power Calibration", on page 99).

When you apply the acquired SMARTerCal, the active calibration is replaced and discarded.

To persist any kind of calibration you can transfer it to the "Cal Pool" using the Calibration Manager Dialog.

• The system error correction data determined in a calibration procedure is stored in the analyzer. You can read these correction data using the remote control command [SENSe<Ch>:]CORRection:CDATa.

If external switch matrices are involved, use [SENSe<Ch>:]CORRection: SMATrix:CDATa instead.

## Step 1: Ports

Selects the calibrated analyzer ports, the cal unit characterization, the calibration type and the power meter connection.



## **Background information**

Refer to the following sections:

- chapter 3.5.7.2, "Calibration Types", on page 98
- chapter 3.5.5.3, "Characterization of Calibration Units", on page 89

Access: CHANNEL > CAL > Start Cal > SMARTerCal – Start... (Cal Unit)



Fig. 4-10: SMARTerCal setup (#Ports > 4)

## Ports

Selects the test port(s) to be calibrated.

It is possible to select any combination of two or more test ports. If you're only interested in a single port P, perform a two-port SMARTerCal for a port pair including P (as Power Port).

SCPI command:

The port parameters in many calibration commands define the calibrated port(s).

## Cal Unit

Displays the connected calibration units. The R&S ZNB auto-detects all calibration units which are connected to one of its USB ports. If several cal units are connected, one of them must be selected for calibration (active cal unit).

The calibration unit R&S ZV-Z51 is suited for R&S ZNB network analyzers. A warning is displayed if the current sweep range of the network analyzer exceeds the characterized frequency range of the calibration unit.

See also chapter 3.5.5.1, "Connecting the Calibration Unit", on page 86.

#### SCPI command:

```
SYSTem:COMMunicate:RDEVice:AKAL:ADDRess:ALL?
SYSTem:COMMunicate:RDEVice:AKAL:ADDRess
```

#### Characterization

Displays all characterizations which are stored in the active cal unit. The "Factory" characterization is available for all calibration units; it ensures an accurate calibration for all standard applications. To account for a modified test setup (e.g. the connection of additional adapters to the calibration unit), you can generate modified sets of characterization data using the cal unit characterization wizard; see chapter 4.4.3.14, "Characterize Cal Unit (Dialog)", on page 343. By default, the R&S ZNB uses the last generated cal unit characterization.

**Tip:** If the characterization wizard is password-protected, the "Characterization" button is unavailable. Use this functionality to prevent inadvertent activatin of inappropriate characterizations. See "Authentication / Set Password" on page 344.

See also chapter 3.5.5.3, "Characterization of Calibration Units", on page 89.

#### SCPI command:

[SENSe<Ch>:]CORRection:COLLect:AUTO:CONFigure SYSTem:COMMunicate:RDEVice:AKAL:CKIT:CATalog? SYSTem:COMMunicate:RDEVice:AKAL:CKIT:STANdard:CATalog? SYSTem:COMMunicate:RDEVice:AKAL:SDATa?

#### Query further cal unit properties:

```
SYSTem:COMMunicate:RDEVice:AKAL:DATE?
SYSTem:COMMunicate:RDEVice:AKAL:FRANge?
SYSTem:COMMunicate:RDEVice:AKAL:PORTs?
SYSTem:COMMunicate:RDEVice:AKAL:WARMup[:STATe]?
```

#### **Calibration Type**

Selects the calibration type for the selected physical port. For an overview refer to chapter 3.5.7.2, "Calibration Types", on page 98. The calibration types PUOSM and PTOSM are compatible with all port combinations.

SCPI command:

```
[SENSe<Ch>:]CORRection:COLLect:AUTO:TYPE
[SENSe<Ch>:]CORRection:COLLect:AUTO:PORTs:TYPE
[SENSe<Ch>:]CORRection:COLLect:AUTO:CONFigure
```

#### **Power Meter**

Shows a list of all power meters that have been properly configured and are available for the scalar source power calibration of a single source port. The last configured power meter is selected by default. See "Configured Devices" on page 437.

SCPI command:

[SENSe:]CORRection:COLLect:PMETer:ID

#### **Power Port**

Selects the port for the scalar source power calibration.

## **Calibrate all Channels**

Check this box to apply the acquired correction data to all channels in the active recall set. Leave it unchecked (preset setting) to apply them only to the active channel.

Note that this option is available only if the active recall set contains multiple channels.

SCPI command: [SENSe:]CORRection:COLLect:CHANnels:ALL

## Select/Deselect All

Selects/deselects all ports.

These buttons are only shown if more than 4 ports are available.

## Next

Proceeds to Step 2: Connections. Next is unavailable (and a warning is displayed) if the following happens:

- Less than two ports have been selected
- The selected characterization data do not cover all the ports to be calibrated.
- The selected characterization data do not contain all standards needed for the selected calibration type.

## Step 2: Connections

Defines the port assignment(s) between the R&S ZNB and the calibration unit.



## **Related information**

Refer to chapter 3.5.5.4, "Multiple Port Assignments", on page 89 for details on multiple port assignments

Access: CHANNEL > CAL > Start Cal > SMARTerCal – Start... (Cal Unit) > Next

8	Cal Type PTOSM		Ports P1, P2, F	73	, P4, P5		
	Cal Unit Port 3.5 mm (f)		Unit Port .5 mm (f)		Cal Unit Por 3.5 mm (f)	Cal Unit Port 3.5 mm (f)	
	Port 1	\$ Por		0.010	Port 3	Port 4	\$
	Port 1	\$ Por	t 5	\$	None	\$ None	\$
	Default						

Fig. 4-11: Multiple port assignments

### Cal Type / Ports (Table)

Shows the previously selected calibration type and calibrated port(s) that were selected in the "Ports" page of the dialog.

SCPI command:

The port parameters in many calibration commands define the calibrated port(s).

## Cal Unit Ports (Table Header)

Shows the connector type and gender at each calibrated analyzer port.

The test port connectors are automatically set according to the connector type of the selected calibration unit.

SCPI command: n/a

## Port Assignments (Table Rows)

Displays the port assignments and allows to edit them.

The R&S ZNB always proposes an optimum solution (minimum number of assignments) that additionally minimizes the physical port reconnections required between calibration stages. For user-modified assignments it provides assistive information indicating insufficient, or redundant entries.

SCPI command:

```
[SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment<Asg>:DEFine
[SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment<Asg>:DEFine:TPORt
[SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment:COUNt?
```

## Default Port Assignment

Restores the default port assignments.

SCPI command:

```
[SENSe:]CORRection:COLLect:AUTO:PORTs:CONNection?
[SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment:DEFine:DEFault
on page 731
```

## Start

Proceeds to Step 3: Calibration.

If the configured port assignments are invalid, this action is disabled.


## Step 3: Calibration

During the calibration phase the R&S ZNB displays a "SMARTerCal" screen that guides the user through the actual SMARTerCal, whose setup was prepared during the previous wizard steps.

A SMARTerCal involves several steps:

- For each port assignment, connect the calibration unit to the related set of test ports and perform an automatic system error correction.
- In the final step, replace the calibration unit by the power meter and start the power calibration sweep.

During the system error correction steps, the upper part of the "Cal Unit" screen displays the calibration sweep diagrams for the currently measured S-parameter and the lower part visualizes the active port assignment and the measurement progress.

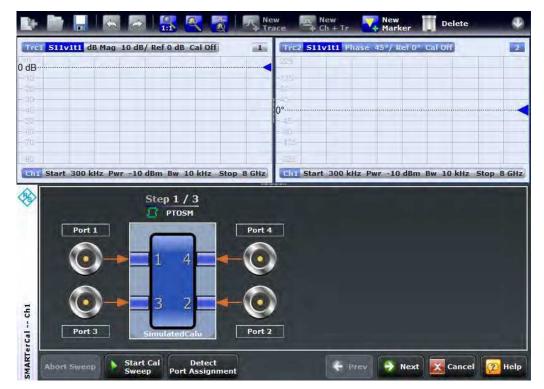

User Manual 1173.9163.02 – 13

## www.valuetronics.com

During the final power calibration step, the upper part of the screen displays power trace diagrams and the lower part displays the power meter connection.

Incl. Pimtra (Pi	)v1t1 dB Mag	10 dB/ Ref 0 dB	Trc2 Pm	tr1(P1)v1t1	Phase 45°/	Ref 0°	12
dBm			 - 110				
(D			-125				
20			-90				
30			-45-				
(0			<del>0°</del>				
50-			1-46- - 166-				
50 70			- 435				
()= ()=			- TEL				
un			-285				
Port		Step 3 / 3 PUOSM Pmtr 1 POWER					
Port		PUOSM Pmtr 1					

Use "Next"/"Prev" to navigate between the calibration steps

### **Detect Port Assignment**

Starts a procedure by which the R&S ZNB (with a little help from the attached calibration unit) auto-detects the connected ports. The automatic assignment replaces the configured one.

In case auto-detection fails

- an error report is shown as a warning dialog
- the undetected port connections are overlayed by warning signs
- the calibration may be invalid



If auto-detection fails because of a high attenuation in the signal path, you can either enter the port assignment manually or connect matching port numbers and select "Default Port Assignment".

SCPI command:
[SENSe:]CORRection:COLLect:AUTO:PORTs:CONNection?

#### Start Cal Sweep

Starts the necessary calibration sweeps.

**Note:** The power calibration sweep is performed at the "Reference Receiver Cal Power" setting from the scalar power calibration; see "Reference Receiver Cal Power" on page 351.

A subsweep is performed for every required test port (pair), for every possible path (if external switch matrices are involved) and - during system errof correction - for every required standard.

## SCPI command:

```
[SENSe<Ch>:]CORRection:COLLect:AUTO
[SENSe<Ch>:]CORRection:COLLect:AUTO:TYPE
[SENSe<Ch>:]CORRection:COLLect:AUTO:PORTs
[SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment<Asg>:ACQuire
[SENSe<Ch>:]CORRection:COLLect:AUTO:POWer
```

#### Apply

Is enabled as soon as sufficient data have been acquired for the calibrated ports and standards and for the power meter. The button starts the calculation of the calibration data and closes the calibration wizard.

The results are applied to the active channel (or to all channels in the active recall set, if all channels are calibrated). The current instrument settings are stored with the correction data.

To avoid incompatibilities, older calibration data is deleted unless it has been transferred into the "Cal Pool" using the "Calibration Manager".

Use the Power Cal Screen to perform an additional source flatness calibration (see chapter 3.5.7.3, "Combining SMARTerCal with Scalar Power Calibration", on page 99).

#### Note: Checks during the calculation of correction data

Incompatibilities between the selected calibration type, the standards and the channel settings may cause the calibration to be inaccurate. The analyzer auto-detects potential sources of errors and displays appropriate, self-explanatory notice boxes.

### SCPI command:

```
[SENSe<Ch>:]CORRection:COLLect:AUTO
[SENSe<Ch>:]CORRection:COLLect:AUTO:TYPE
[SENSe<Ch>:]CORRection:COLLect:AUTO:PORTs
[SENSe<Ch>:]CORRection:COLLect:AUTO:SAVE
[SENSe<Ch>:]CORRection:COLLect:AUTO:SAVE
```

## 4.4.3.7 SMARTerCal (Manual) Wizard

The "SmarterCal (Manual)" wizard guides you through the setup and execution of a manual SMARTerCal.

The wizard proceeds through the following steps:

- 1. **Ports and Type:** Select the ports to be calibrated, the calibration type to be used and the power meter connection.
- Connectors and Cal Kits: Select the connector type and gender for all ports to be calibrated. If necessary, load or change a calibration kit.
- 3. Calibration:
  - a) Acquire error correction data for the required ports and port pairs and the required standards.
  - b) Acquire source power calibration data at the "Power Port"
  - c) Finally, decide whether or not to apply the resulting calibration.



#### **Background and related information**

- Refer to chapter 3.5.7, "SMARTerCal", on page 98 for background information
- See chapter 4.4.3.8, "Multiple SMARTerCal (Manual) Wizard", on page 327 for the "MultiCal" variant of the wizard.
- Use the Power Cal Screen to perform an additional source flatness calibration (see chapter 3.5.7.3, "Combining SMARTerCal with Scalar Power Calibration", on page 99).

User Manual 1173.9163.02 - 13

## www.valuetronics.com



If the active channel is already calibrated, the wizard will attempt to load the calibration. If the calibration setup is unchanged and sweep data are available (see "Save Sweep Data" on page 423) the existing system error correction can be optimized without repeating the measurement of all standards.

When you apply the acquired SMARTerCal, the active calibration is replaced and discarded.

To persist any kind of calibration you can transfer it to the "Cal Pool" using the Calibration Manager Dialog.

The active system error correction data can be read (and modified) using the remote control command [SENSe<Ch>:]CORRection:CDATa.
 If external switch matrices are involved, use [SENSe<Ch>:]CORRection: SMATrix:CDATa instead.

## Step 1: Ports and Type

Selects the calibrated analyzer ports, the calibration type and specifies the power meter connection.



## **Background information**

Refer to chapter 3.5.7.2, "Calibration Types", on page 98.



## **Repeated calibration**

If the active channel contains a valid calibration, a modified version of the calibration wizard is opened. In this modified wizard, you can view the properties of the old calibration and decide whether you wish to overwrite it or start a new calibration. Make your choice to proceed to the dialog shown below.

Access: CHANNEL > CAL > Start Cal > SMARTerCal – Start... (Manual)

User Manual 1173.9163.02 - 13

## www.valuetronics.com



Fig. 4-12: SMARTerCal: Ports and Type (>4 ports available)

## Ports

Selects the test port(s) to be calibrated.

It is possible to select any combination of two or more test ports. If you're only interested in a single port P, perform a two-port SMARTerCal for a port pair including P (as Power Port).

SCPI command:

The port parameters in many calibration commands define the calibrated port(s).

### Туре

Selects the calibration type to be performed. SMARTerCal is based on a full n-port calibration (n > 1). The names of the SMARTerCal calibration types consist of a prefix "P" (indicating the additional power calibration) plus the system error correction type.

All calibration types can be used for all possible port combinations.

SCPI command:

[SENSe<Ch>:]CORRection:COLLect:METHod:DEFine

## **Power Meter**

Shows a list of all power meters that have been properly configured and are available for the scalar source power calibration of a single source port. The last configured power meter is selected by default. See "Configured Devices" on page 437.

SCPI command:

[SENSe:]CORRection:COLLect:PMETer:ID

### **Power Port**

Selects the port for the scalar source power calibration.

## **Calibrate all Channels**

Check this box to apply the acquired correction data to all channels in the active recall set. Leave it unchecked (preset setting) to apply them only to the active channel.

Note that this option is available only if the active recall set contains multiple channels.

SCPI command:

[SENSe:]CORRection:COLLect:CHANnels:ALL

### Select/Deselect All

Selects/deselects all ports.

These buttons are only shown if more than 4 ports are available.

## Next

Proceeds to "Step 2: Connectors and Cal Kits" on page 321. Inactive (and a warning is displayed) as long as and.

## Step 2: Connectors and Cal Kits

Selects the connector type and gender for all ports and allows you to import a calibration kit.



## **Background information**

Refer to chapter 3.5.2, "Calibration Standards and Calibration Kits", on page 78



## Messages in the dialog

An information (or error message) is displayed if one of the following happens:

- One of the selected calibration kits is described by ideal kit parameters or typical values.
- One of the selected calibration kits does not contain all standards that are required for the previously selected calibration type.
- Different connector types are defined at the ports but the selected calibration type requires uniform connectors.
- A cal kit standard does not cover the entire calibrated frequency range.
- The selected power meter does not cover the entire calibrated frequency range.

Access: CHANNEL > CAL > Start Cal > SMARTerCal – Start... (Manual) > Next

## www.valuetronics.com

ртоям	Ports P1, P2	
Port Connect	or Gender Cal Kit 🕈 Female 🗘 3652-1 🗘	
🔘 P2 2.92 mm	\$ Female  \$ 3652-1   \$	

Fig. 4-13: SMARTerCal (Manual): Connectors and Cal Kits (>4 ports)

The upper part of the panel shows the previously configured port(s) and calibration type. The lower part gives access to the connector and cal kit settings.

#### **Connector / Gender**

Defines the connector types and genders of the ports to be calibrated. For symmetric (sexless) connector types (e.g. 7 mm / PC7), "Gender" is unavailable.

If "Same Connector All Ports" is active, the connector types at all ports (but not their gender) are always adjusted to the current selection. If "Same Gender All Ports" is active, the genders at all ports are always adjusted to the current selection.

User-defined connectors can be added or removed in the Cal Connector Types (Dialog).

SCPI command:

```
[SENSe<Ch>:]CORRection:COLLect:CONNection<PhyPt>
[SENSe<Ch>:]CORRection:COLLect:SCONnection<PhyPt>
[SENSe<Ch>:]CORRection:CONNection
[SENSe<Ch>:]CORRection:CONNection:CATalog?
[SENSe<Ch>:]CORRection:CONNection:DELete
```

## Cal Kit

Selects a cal kit for the connector at each selected physical port. The drop-down list contains all available calibration kits for the selected connector type. The assignment of a calibration kit to a connector type must be the same for all physical ports: If a calibration kit is changed, the R&S ZNB automatically assigns the new kit to all ports with the same connector type.

Use "Import Cal Kit..." to add new kits to the list.

SCPI command:

[SENSe:]CORRection:CKIT:SELect

#### Same Connector / Gender All Ports

Assigns the same connector type or gender to all selected physical ports. For some multiport calibration types, the port connector types must be equal, e.g. because they require a Through standard with known characteristics.

SCPI command:

[SENSe<Ch>:]CORRection:COLLect:CONNection:PORTs
[SENSe<Ch>:]CORRection:COLLect:CONNection:GENDers

#### Use Sliding Match

Available for cal kits which contain a Sliding Match standard; see chapter 3.5.2.3, "Sliding Match Standards", on page 82.

If selected, the Sliding Match appears in the list of measured standards whenever the selected calibration type requires a Match. For a valid calibration, either the Match or at least three positions of the Sliding Match must be measured.

SCPI command: n/a

## **Import Cal Kit**

Opens the Import Calibration Kit dialog to load and (if desired) activate a cal kit file. See chapter 3.5.2.4, "Cal Kit Files", on page 82.

By default cal kit files are stored in the

C:\Users\Public\Documents\Rohde-Schwarz\Vna\Calibration directory.

Three different import file formats are supported: R&S ZVA-specific binary cal kit files (\*.calkit), ZVR-specific binary cal kit files (\*.ck), cal kit files in Agilent-specific ASCII formats (\*.csv, \*.prn.

## SCPI command:

MMEMory:LOAD:CKIT MMEMory:LOAD:CKIT:SDATa

## Back

Go back to Step 2: Connectors and Cal Kits.


#### Start

Start Step 3: Calibration.

## Step 3: Calibration

Allows to acquire error correction data for every required port (pair) and calibration standard (where "required" depends on the selected ports and calibration type) as well as power correction data from the power meter. The order of the system error correction and power calibration sweeps is arbitrary; ensure that you always connect the proper equipment.

On "Apply" the R&S ZNB calculates the system error correction (error terms) from the measurement data of the standards and uses the power meter result to correct the absolute receiver powers and applies the SMARTerCal results to the active channel.

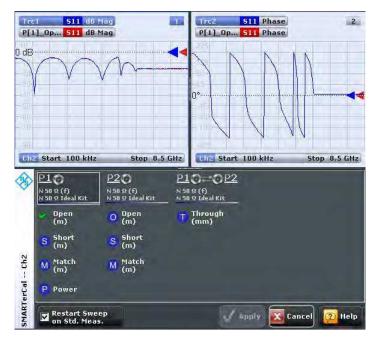

Access: CHANNEL > CAL > Start Cal > SMARTerCal - Start... (Manual) > Next > Next

The upper part of the calibration screen presents

- calibration sweep diagrams for the currently measured S-parameter during standards measurement,
- power trace diagrams during the power calibration sweep

The lower part displays the calibrated port (pairs) with their related measurements and visualizes the measurement progress.

### **Calibration Sweep Diagrams**

In absence of switch matrices, each diagram contains a single S-parameter trace and a typical result trace for the measured standard type. If switch matrices are involved, a sweep is performed for every possible signal path and for each of these paths a separate S-parameter trace is shown (see Multiple Paths and Calibration).



Fig. 4-14: Multiple traces due to multiple paths

The purpose of the typical result traces "Trc1" and "Trc2" is to avoid connection errors and to track hardware problems: if the correct standard type is measured, and everything is properly connected, then the measured traces are expected to be similar to the typical trace.

The S-Parameter traces are labeled P[*j\_i*]\_<standard type> S*ij*, where *j* indicates the input (test) port and *i* indicates the output port, e.g. P[1\_2]\_Through S21.

If switch matrices are involved, the label also indicates

- which VNA port b is switched to the input port j and
- which VNA port a is switched to the output port i

Instead of a single S*ij* trace we have multiple traces S*ijvativbtj*. E.g. S21v1t1v3t2 means that S21 is measured with VNA port 1 connected to the input port and VNA port 3 connected to the output port.

SCPI command:

n/a

## **Power Sweep Diagrams**

The Pmtr<n>(P<m>) traces are displayed during the "Power" calibration sweep.

SCPI command:

n/a

## Ports, Standards and Power

Shows the calibrated port(s) with their associated standard and power meter ("Power") measurements.

A green checkmark indicates that the calibration data of a standard or power meter has been acquired successfully. A green checkmark after the port symbol indicates that the minimum number of calibration measurements for the port has been performed.

## Tip: Optional calibration measurements

For most calibration and standard types, the "Calibration" dialog shows only mandatory calibration measurements. Note the following exceptions:

- If a sliding match measurement is selected in the "Calibration Presetting" dialog, either the Match or at least three positions of the Sliding Match must be measured. See chapter 3.5.2.3, "Sliding Match Standards", on page 82.
- For a PTRL calibration, at least one line standard must be measured between any pair of calibrated ports. See chapter 3.5.1.8, "TRL Calibration", on page 74.

**Note:** The power calibration sweep is performed at the "Reference Receiver Cal Power" setting from the scalar power calibration; see "Reference Receiver Cal Power" on page 351.

SCPI command:

[SENSe<Ch>:]CORRection:COLLect[:ACQuire]:SELected SOURce<Ch>:POWer<PhyPt>:CORRection[:ACQuire] See also: [SENSe<Ch>:]CORRection:COLLect:LOAD:SELected

## **Restart Sweep on Std Meas**

If this function is active, a new standard measurement initiates a new sweep, starting at the beginning ("Start") of the sweep range: The sweep points for the calibration sweep are in ascending order, like for an ordinary measurement.

If "Restart Sweep on Std Meas" is not active, the new standard measurement is started at the current sweep point; the current sweep is continued as a calibration sweep.

## Note:

Since software version 1.70 this function has a secondary effect in idle mode (i.e. while the calibration sweep is NOT running):

- If active, only the selected trace is refreshed.
- If inactive, the R&S ZNB permanently refreshes all traces of all diagrams which may put a heavy load on the connected switch matrices (if any).

Hence it is recommended (and default) to activate it, in particular if one of the matrices uses mechanical switches that will be worn off fast (apart from making noise).

#### Apply

Is enabled as soon as sufficient data have been acquired for the calibrated ports and standards and for the power meter. The button starts the calculation of the calibration data and closes the calibration wizard. The current instrument settings are stored with the correction data.

To avoid incompatibilities, older calibration data is deleted unless it has been transferred into the "Cal Pool" using the "Calibration Manager".

Use the Power Cal Screen to perform an additional source flatness calibration (see chapter 3.5.7.3, "Combining SMARTerCal with Scalar Power Calibration", on page 99).

#### Note: Checks during the calculation of correction data

Incompatibilities between the selected calibration type, the standards and the channel settings may cause the calibration to be inaccurate. The analyzer auto-detects potential sources of errors and displays appropriate, self-explanatory notice boxes.

#### SCPI command:

```
[SENSe<Ch>:]CORRection:COLLect:SAVE:SELected[:DUMMy]
[SENSe<Ch>:]CORRection:COLLect:SAVE:SELected:DEFault
[SENSe<Ch>:]CORRection:COLLect:DELete
[SENSe<Ch>:]CORRection:DATA:PARameter<Sfk>?
[SENSe<Ch>:]CORRection:DATA:PARameter<Sfk>:PORT<PhyPt>?
[SENSe<Ch>:]CORRection:DATE?
[SENSe<Ch>:]CORRection:SSTate?
[SENSe<Ch>:]CORRection:STIMulus?
[SENSe<Ch>:]CORRection:STIMulus?
```

## 4.4.3.8 Multiple SMARTerCal (Manual) Wizard

The "Multiple Cal" version of the SMARTerCal (Manual) Wizard wizard guides you through the setup and simultaneous manual acquisition of multiple SMARTerCals.

The wizard proceeds through the following steps:

- 1. **Ports and Type:** Define the port sets to be calibrated with their respective calibration type and power meter connections.
- Connectors and Cal Kits: Select the connector type and gender for all ports to be calibrated and assign one of the ports to the power meter. If necessary, load or change a calibration kit.
- 3. Calibration:
  - a) Acquire error correction data for the required ports and port pairs and the required standards.
  - b) Acquire source power calibration data at the specified "Power Ports"
  - c) Finally, decide whether or not to apply the resulting calibration.



#### **Background and related information**

- Refer to chapter 3.5.7, "SMARTerCal", on page 98 for background information.
- The "Multiple Cal in Calibration Wizard" feature is disabled by default and has to be activated in the Calibration tab of the "System Config" dialog.
   See chapter 4.4.3.7, "SMARTerCal (Manual) Wizard", on page 318chapter 4.4.3.8, "Multiple SMARTerCal (Manual) Wizard", on page 327 for the "SingleCal" version of the wizard.
- Use the Power Cal Screen to perform an additional source flatness calibration (see chapter 3.5.7.3, "Combining SMARTerCal with Scalar Power Calibration", on page 99).



- If the active channel is already calibrated, the wizard will attempt to load the calibration. If the calibration setup is unchanged and sweep data are available (see "Save Sweep Data" on page 423) the existing system error correction can be optimized without repeating the measurement of all standards.
- When you apply the acquired SMARTerCals, the active calibration is replaced and discarded.

To persist any kind of calibration you can transfer it to the "Cal Pool" using the Calibration Manager Dialog.

• The active system error correction data can be read (and modified) using the remote control command [SENSe<Ch>:]CORRection:CDATa.

## Step 1: Ports and Type

The first page of the wizard presents the list of already configured SMARTERCals and allows to

"Add" new SMARTerCals

"Delete" or "Modify" existing SMARTerCals

Access: CHANNEL > CAL > Start Cal > SMARTerCal – Start... (Manual)

	ARTerCal (Nanua	1)			* (11)	
Por	ts and Type Select the ports t	o be calibrated and	the type of the calibra	tion.		¢
<b>(</b>	Cal Type	Ports	Power Meter	Power Port		
	T PTOSM	P1, P2	Pmtr 1	Port 1		
	T PTOSM	P1, P3	Pmtr 1	Port 1		
3	PTOSM	P1, P4	Pmtr 1	Port 1		
	alibrate all Channels			📌 Add	X Delete	Modify
	alibrate all Channels			Add	Delete	

## **Calibrate all Channels**

Check this box to apply the acquired correction data to all channels in the active recall set. Leave it unchecked (preset setting) to apply them only to the active channel.

Note that this option is available only if the active recall set contains multiple channels. SCPI command:

[SENSe:]CORRection:COLLect:CHANnels:ALL

## Add

Adds a new SMARTerCal.

The "Add" button opens the Define Calibration (Dialog) ddialog without pre-selected ports.

#### Delete

Deletes the selected SMARTerCal from the list of configured SMARTerCals.

## Modify

Edits the selected SMARTerCal: opens the Define Calibration (Dialog) dialog with the corresponding ports and calibration type pre-selected.

#### Next

Proceeds to Step 2: Connectors and Cal Kits.

Inactive as long as no calibration is defined.

## **Define Calibration (Dialog)**

Selects the calibrated analyzer ports, the calibration type and specifies the power meter connection.



## **Background information**

Refer to chapter 3.5.7.2, "Calibration Types", on page 98.

Access: CHANNEL > CAL > Start Cal > SMARTerCal – Start... (Manual) > Add/Modify



Fig. 4-15: Define SMARTerCal Dialog (>4 ports)

## Ports

Selects the test port(s) to be calibrated.

It is possible to select any combination of two or more test ports. If you're only interested in a single port P, perform a two-port SMARTerCal for a port pair including P (as Power Port).

SCPI command:

The port parameters in many calibration commands define the calibrated port(s).

### Туре

Selects the calibration type to be performed. SMARTerCal is based on a full n-port calibration (n > 1). The names of the SMARTerCal calibration types consist of a prefix "P" (indicating the additional power calibration) plus the system error correction type.

All calibration types can be used for all possible port combinations.

#### SCPI command:

[SENSe<Ch>:]CORRection:COLLect:METHod:DEFine

## **Power Meter**

Shows a list of all power meters that have been properly configured and are available for the scalar source power calibration of a single source port. The last configured power meter is selected by default. See "Configured Devices" on page 437.

SCPI command:

[SENSe:]CORRection:COLLect:PMETer:ID

## Step 2: Connectors and Cal Kits

Selects the connector type and gender for all ports and allows you to import a calibration kit.



## Background information

Refer to chapter 3.5.2, "Calibration Standards and Calibration Kits", on page 78



## Messages in the dialog

An information (or error message) is displayed if one of the following happens:

- One of the calibration kits is described by ideal kit parameters or typical values.
- One of the selected calibration kits does not contain all standards that are required for the previously selected calibration type.
- Different connector types are defined at the ports but the selected calibration type requires uniform connectors.
- A cal kit standard does not cover the entire calibrated frequency range.
- The selected power meter does not cover the entire calibrated frequency range.

Access: CHANNEL > CAL > Start Cal > SMARTerCal – Start... (Manual) > Next > Next

Cal Ty	/pe rosm	Ports P1, P2				
	OSM	P1, P3				
🔲 PT	OSM	P1, P4				
Port	Connector	Gender	Cal	Kit		 
1 P1	2.92 mm ≑	Female \$ 3	652-1	\$		
O P2	2.92 mm 🗘	Female \$ 3	652-1	\$		

The upper part of the panel shows the previously configured SMARTerCals. The lower part gives acces to the connector and cal kit settings.

## **Connector / Gender**

Defines the connector types and genders of the ports to be calibrated. For symmetric (sexless) connector types (e.g. 7 mm / PC7), "Gender" is unavailable.

If "Same Connector All Ports" is active, the connector types at all ports (but not their gender) are always adjusted to the current selection. If "Same Gender All Ports" is active, the genders at all ports are always adjusted to the current selection.

User-defined connectors can be added or removed in the Cal Connector Types (Dialog).

### SCPI command:

```
[SENSe<Ch>:]CORRection:COLLect:CONNection<PhyPt>
[SENSe<Ch>:]CORRection:COLLect:SCONnection<PhyPt>
[SENSe<Ch>:]CORRection:CONNection
[SENSe<Ch>:]CORRection:CONNection:CATalog?
[SENSe<Ch>:]CORRection:CONNection:DELete
```

## Cal Kit

Selects a cal kit for the connector at each selected physical port. The drop-down list contains all available calibration kits for the selected connector type. The assignment of a calibration kit to a connector type must be the same for all physical ports: If a calibration kit is changed, the R&S ZNB automatically assigns the new kit to all ports with the same connector type.

Use "Import Cal Kit..." to add new kits to the list.

SCPI command: [SENSe:]CORRection:CKIT:SELect

### Same Connector / Gender All Ports

Assigns the same connector type or gender to all selected physical ports. For some multiport calibration types, the port connector types must be equal, e.g. because they require a Through standard with known characteristics.

SCPI command:

[SENSe<Ch>:]CORRection:COLLect:CONNection:PORTs
[SENSe<Ch>:]CORRection:COLLect:CONNection:GENDers

#### **Use Sliding Match**

Available for cal kits which contain a Sliding Match standard; see chapter 3.5.2.3, "Sliding Match Standards", on page 82.

If selected, the Sliding Match appears in the list of measured standards whenever the selected calibration type requires a Match. For a valid calibration, either the Match or at least three positions of the Sliding Match must be measured.

SCPI command: n/a

## Import Cal Kit

Opens the Import Calibration Kit dialog to load and (if desired) activate a cal kit file. See chapter 3.5.2.4, "Cal Kit Files", on page 82.

By default cal kit files are stored in the

C:\Users\Public\Documents\Rohde-Schwarz\Vna\Calibration directory.

Three different import file formats are supported: R&S ZVA-specific binary cal kit files (\*.calkit), ZVR-specific binary cal kit files (\*.ck), cal kit files in Agilent-specific ASCII formats (\*.csv, \*.prn.

#### SCPI command:

MMEMory:LOAD:CKIT MMEMory:LOAD:CKIT:SDATa

#### Back

Go back to Step 2: Connectors and Cal Kits.

Start Start Step 3: Calibration.


## Step 3: Calibration

Allows to acquire error correction data for every required port (pair) and calibration standard (where "required" depends on the selected ports and calibration type) as well as power correction data from the power meter. The order of the system error correction and power calibration sweeps is arbitrary; ensure that you always connect the proper equipment.

Access: CHANNEL > CAL > Start Cal > SMARTerCal – Start... (Manual) > Next > Next



The possibility to "share" measurements between the calibrations and the "Reduced Through" logic help to keep the number of measurements as small as possible (see chapter 3.5.1.10, "Full n-Port Calibration with Reduced Number of Through Connections", on page 77).

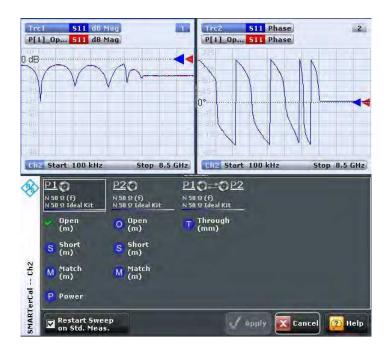

The upper part of the calibration screen presents

- calibration sweep diagrams for the currently measured S-parameter during standards measurement,
- power trace diagrams during the power calibration sweep

The lower part displays the calibrated port (pairs) with their related measurements and visualizes the measurement progress.

## **Power Sweep Diagrams**

The Pmtr<n>(P<m>) traces are displayed during the "Power" calibration sweep.

SCPI command:

n/a

### Ports, Standards and Power

Shows the calibrated port(s) with their associated standard and power meter ("Power") measurements.

A green checkmark indicates that the calibration data of a standard or power meter has been acquired successfully. A green checkmark after the port symbol indicates that the minimum number of calibration measurements for the port has been performed.

## Tip: Optional calibration measurements

For most calibration and standard types, the "Calibration" dialog shows only mandatory calibration measurements. Note the following exceptions:

- If a sliding match measurement is selected in the "Calibration Presetting" dialog, either the Match or at least three positions of the Sliding Match must be measured. See chapter 3.5.2.3, "Sliding Match Standards", on page 82.
- For a PTRL calibration, at least one line standard must be measured between any pair of calibrated ports. See chapter 3.5.1.8, "TRL Calibration", on page 74.

**Note:** The power calibration sweep is performed at the "Reference Receiver Cal Power" setting from the scalar power calibration; see "Reference Receiver Cal Power" on page 351.

SCPI command:

[SENSe<Ch>:]CORRection:COLLect[:ACQuire]:SELected SOURce<Ch>:POWer<PhyPt>:CORRection[:ACQuire] See also: [SENSe<Ch>:]CORRection:COLLect:LOAD:SELected

## **Restart Sweep on Std Meas**

If this function is active, a new standard measurement initiates a new sweep, starting at the beginning ("Start") of the sweep range: The sweep points for the calibration sweep are in ascending order, like for an ordinary measurement.

If "Restart Sweep on Std Meas" is not active, the new standard measurement is started at the current sweep point; the current sweep is continued as a calibration sweep.

### Note:

Since software version 1.70 this function has a secondary effect in idle mode (i.e. while the calibration sweep is NOT running):

- If active, only the selected trace is refreshed.
- If inactive, the R&S ZNB permanently refreshes all traces of all diagrams which may put a heavy load on the connected switch matrices (if any).

Hence it is recommended (and default) to activate it, in particular if one of the matrices uses mechanical switches that will be worn off fast (apart from making noise).

### Apply

Is enabled as soon as sufficient data have been acquired for the calibrated ports and standards and for the power meter. The button starts the calculation of the calibration data and closes the calibration wizard. The current instrument settings are stored with the correction data.

To avoid incompatibilities, older calibration data is deleted unless it has been transferred into the "Cal Pool" using the "Calibration Manager".

Use the Power Cal Screen to perform an additional source flatness calibration (see chapter 3.5.7.3, "Combining SMARTerCal with Scalar Power Calibration", on page 99).

Note: Checks during the calculation of correction data

Incompatibilities between the selected calibration type, the standards and the channel settings may cause the calibration to be inaccurate. The analyzer auto-detects potential sources of errors and displays appropriate, self-explanatory notice boxes.

#### SCPI command:

```
[SENSe<Ch>:]CORRection:COLLect:SAVE:SELected[:DUMMy]
[SENSe<Ch>:]CORRection:COLLect:SAVE:SELected:DEFault
[SENSe<Ch>:]CORRection:COLLect:DELete
[SENSe<Ch>:]CORRection:DATA:PARameter<Sfk>?
[SENSe<Ch>:]CORRection:DATA:PARameter<Sfk>:PORT<PhyPt>?
[SENSe<Ch>:]CORRection:DATE?
[SENSe<Ch>:]CORRection:SSTate?
[SENSe<Ch>:]CORRection:STIMulus?
[SENSe<Ch>:]CORRection:STIMulus?
```

## 4.4.3.9 Calibration > Cal Devices

Provides access to all functions for calibration kit management and cal unit characterization.



## Background information

Refer to the following sections:

- chapter 3.5.2, "Calibration Standards and Calibration Kits", on page 78
- chapter 3.5.5.3, "Characterization of Calibration Units", on page 89

## Access: CHANNEL > CAL key or Alt + Shift + P



The "Cal Devices" buttons open the following dialogs:

- Cal Connector Types...: See chapter 4.4.3.10, "Cal Connector Types (Dialog)", on page 336
- Cal Kits...: See chapter 4.4.3.11, "Calibration Kits (Dialog)", on page 338
- Characterize Cal Unit...: See chapter 4.4.3.14, "Characterize Cal Unit (Dialog)", on page 343

User Manual 1173.9163.02 - 13

# www.valuetronics.com

## 4.4.3.10 Cal Connector Types (Dialog)

The "Cal Connector Types" dialog displays and modifies the list of available connector types. Cal connector types must be selected in accordance with the connectors of the measured DUT.

Access: CHANNEL > CAL > Calibration > Cal Connector Types ...

	Conn. Type 🔺	Sexless	Char. Imp.	Line Type	f.	Rel. Permittivity ɛr	Cutoff Freq. fc
	逼 N 50 Ω		50 Ω	TEM	\$	1.001	
	📔 Ν 75 Ω		75 <u>Ω</u>	TEM	\$	1.001	-
	🦲 7 mm		50 Ω	TEM	ŧ	1.001	-
	🧯 3.5 mm		50 Q	TEM	\$	1.001	
	🤷 2.92 mm		50 Ω	TEM	\$	1.001	
i.	실 2.4 mm		50 Q	TEM	\$	1.001	
1	🦲 1.85 mm		50 Ω	TEM	\$	1.001	
1	7-16		50 Ω	TEM	¢	1.001	
	🧕 Type F (75)		75 Ω	TEM	\$	1.001	-
0	User Conn 1		varies	Waveguide	\$	1.001	0 Hz

The list shows the available connector types with their name ("Conn Type"), polarity ("Sexless"). The remaining columns in the list are described below.

$\mathbf{\mathcal{F}}$	
1	$\left( \right)$
$\sim$	

### Storing connector type settings

Calibration kits and connector types are global resources; the parameters are stored independently and available for all recall sets. The connector type settings are always stored together with the associated calibration kit parameters. The "Calibration Kits" provides buttons to export and import cal kit and connector settings.



After assigning a calibration kit to a user-defined connector type, you can still change its name, offset model and reference impedance. Switching between sexed and sexless will delete all kits assigned to the connector type.

### Char. Imp.

The characteristic impedance or reference impedance ("Char. Imp.")  $Z_0$  for the connectors is a critical value that has an impact on various parameter conversions.  $Z_0$  enters into:

- The calculation of the S-parameters for the calibration standards associated with the connector type, provided that they are derived from a circuit model (see chapter 4.4.3.13, "View / Modify Cal Kit Standards (Dialog)", on page 341).
- The calculation of the (default) reference impedances for balanced ports (see "Reference Impedance" on page 158).

User Manual 1173.9163.02 - 13

# www.valuetronics.com

The calculation of impedance and admittance parameters (see chapter 3.3.2, "Impedance Parameters", on page 46 and chapter 3.3.3, "Admittance Parameters", on page 48).

SCPI command:

[SENSe<Ch>:]CORRection:CONNection

## Line Type / Rel. Permittivity / Cutoff Frequency f<sub>c</sub>

"Line Type" describes the wave propagation mode (offset model) in the transmission lines of the standards associated with the connector type.

- If the calibration kit standards contain lines with transverse electric propagation mode (TEM, e.g. coax cables), then the "Relative Permittivity ε<sub>r</sub>" of the dielectric can be defined. The default permittivity is the value for air. TEM-type lines have no cutoff frequency.
- If the calibration kit standards contain waveguides, then the lowest frequency where a wave propagation is possible ("Cutoff Frequency f<sub>c</sub>") can be defined. The default cutoff frequency if 0 Hz (propagation at all frequencies). No relative permittivity is needed for waveguides.

**Note:** The impedance for waveguides is frequency-dependent. If a waveguide line type is selected, various dialogs (e.g. "Add Standard...") will indicate "varies" instead of a definite impedance value.

#### Impact of line type parameters

The line type parameters are used for the calculation of the S-parameters for the calibration standards associated with the connector type, provided that they are derived from a circuit model (see chapter 4.4.3.13, "View / Modify Cal Kit Standards (Dialog)", on page 341).

- For TEM-type lines, the relative permittivity ε<sub>r</sub> is needed for the conversion of a ZVRtype "Loss" (in units of dB/sqrt(GHz)) into an Agilent-type "Offset Loss" (in units of GΩ/s) and vice versa (see chapter 4.4.3.13, "View / Modify Cal Kit Standards (Dialog)", on page 341). The "Electrical Length" and "Delay" values in the "View / Modify Cal Kit Standards" dialog are directly entered and therefore independent of ε<sub>r</sub>.
- For waveguides, the low frequency cutoff frequency f<sub>c</sub> is important because no wave propagation is possible at frequencies below f<sub>c</sub>. If a standard is measured in order to acquire calibration data, the analyzer checks the low frequency cutoff. If the start frequency of the sweep range is below f<sub>c</sub>, an error message is generated.

The offset model parameters are not used except in the context of calibration. The offset parameter definitions are based on independent  $\varepsilon_r$  values; see chapter 4.4.6.1, "Offset Embed > Offset", on page 392.

SCPI command:

[SENSe<Ch>:]CORRection:CONNection

## Add / Delete

Adds or deletes a user-defined connector type. The parameters of a user-defined connector type can be modified in the table. Deleting a connector type will also delete all calibration or adapter kits assigned to it.

SCPI command:

```
[SENSe<Ch>:]CORRection:CONNection
[SENSe<Ch>:]CORRection:CONNection:CATalog?
[SENSe<Ch>:]CORRection:CONNection:DELete
```

## 4.4.3.11 Calibration Kits (Dialog)

The "Calibration Kits" dialog shows the available calibration kits for the different connector types. It is also used for cal kit and cal kit file management.



## **Related information**

Refer to the following sections:

- See also chapter 3.5.2, "Calibration Standards and Calibration Kits", on page 78
- chapter 3.5.2.4, "Cal Kit Files", on page 82
- chapter 3.5.2.2, "Cal Kit Parameter Types", on page 81
- chapter 4.4.3.10, "Cal Connector Types (Dialog)", on page 336

Access:CHANNEL > CAL > Calibration > Cal Kits ...

Conn. Type         Kit Name         Label           1         N 50.Ω         1         N 50.Ω 1 deal kit         Label           2         N 75 Ω         2         3653         Label	Agilent Model
2 Ν 75 Ω	
	🗹 📄 Copy
3 7 mm 3 🧕 ZY-Z121	
4 3.5 mm 4 🧧 ZCAN 50 Ω	Delet
5 2.92 mm 5 🥃 ZY-Z21 typical	
6 2.4 mm 6 🧧 850328/E	Standards
7 1.85 mm 7 🧧 85032F	
8 7-16 8 🧧 850548	
9 Type F (75) 9 🧕 850540	
10 User Conn 1	

The contents of the "Available Cal Kits" table vary, depending on the selected "Connector Type". The table may also contain kits with ideal or typical parameter values; see Cal Kit Parameter Types. The "Agilent Model" is an optional scheme to characterize the offset parameters of the standards; see "Offset Parameters" on page 342.



## Cal kit labels

Assigning a label to user-defined calibration kits is optional. However, the label is displayed in many dialogs and can provide useful information about the kit, e.g. its serial number. It is even possible to assign several calibration kits with the same name, distinguished by their label, to a common connector type. See also chapter 6.3.14.6, "[SENSe:]CORRection:CKIT... with Labels", on page 689.

## Add / Copy / Delete / Standards...

The buttons in the right part of the dialog are used to manage calibration kits:

- "Add" creates a new cal kit file for the selected connector type.
- "Copy" creates a new cal kit file based on the contents of an existing cal kit file.
- "Delete" deletes an imported or user-defined cal kit file.
- "Standards..." opens the "Kit Standards" dialog. This dialog shows the contents of the cal kit file. For user-defined or imported kits, you can modify the contents. See chapter 4.4.3.12, "Kit Standards (Dialog)", on page 339.

## SCPI command:

The following two commands create new calibration kits and modify calibration kits:

[SENSe:]CORRection:CKIT:<ConnType>:SELect
[SENSe:]CORRection:CKIT:<StandardType>

[SENSe:]CORRection:CKIT:DELete

Query connector types and calibration kits:

[SENSe<Ch>:]CORRection:CONNection:CATalog?

[SENSe:]CORRection:CKIT:CATalog?

### Import / Export

The buttons below the "Connector Type" list are used to store cal kit data to a file and to re-load previously stored cal kit files. By default, calibration kit files are stored in the C:\Users\Public\Documents\Rohde-Schwarz\Vna\Calibration directory; see chapter 3.5.2.4, "Cal Kit Files", on page 82.

#### SCPI command:

MMEMory:LOAD:CKIT on page 648
MMEMory:STORe:CKIT on page 664

## 4.4.3.12 Kit Standards (Dialog)

The "Kit Standards" shows the calibration standards in a selected calibration kit. It is also used to modify the contents of a user-defined kit.



## Related information

Refer to the following sections:

- chapter 3.5.2.4, "Cal Kit Files", on page 82
- chapter 4.4.3.11, "Calibration Kits (Dialog)", on page 338
- chapter 3.5.2.1, "Calibration Standard Types", on page 79

Access: CHANNEL > CAL > Calibration > Cal Kits ... > Standards ...

User Manual 1173.9163.02 - 13

# www.valuetronics.com

		Туре 🧖	•	Gend	er	Label	Min	Freq	Ma	k Freq	.51	p File	Por	t				28	📥 Add
		Open	÷	m	=		0 Hz		1000	GHz			any	=					
		Open	<b>\$</b> 1	f	\$		0 Hz		1000	GHz			any	=					Cop
8		Short	\$	m	-		0 Hz		1000	GHz			any	=				=	- 111
8		Short	•	F	\$		0 Hz		1000	GHz			any	=					X Delet
			\$		=		0 Hz		1000	GHz			any	=					Carolina State
			\$ 1		\$		0 Hz		1000	GHZ			any	\$					View / Modify
R.		Sliding Match			-		0 Hz		1000	GHz			any	\$					Read .
ł.		Sliding Match	\$		\$		0 Hz		1000	GHz			any	9				-	File
10	Port	: Standards																	
		Туре		*	Genc	ler 📔	Label	Min	Freq	Max	Freq	.\$2	o File	Port	1	Port	t 2		🕂 Add
		Through		÷   n	n - m	=		0 Hz		1000 0	Hz			any	=	any	¢		
		Through		\$ n	n – f	\$		0 Hz		1000 0	Hz			any	\$	any	\$	=	D Lopy
1		Through		1 ÷ f		\$		0 Hz		1000 0	Hz			any	=	any	\$		
et j		Line 1			n - m	=		0 Hz		1000 0	Hz			any	=	any	\$		Delet
		Line 1			n - f	=		0 Hz		1000 0				any	=	any	\$		View /
		Line 1				\$		0 Hz		1000 0				any	÷	any	\$		Modify
(a		Attenuation			n - m	\$		0 Hz		1000 0				any	\$	any	\$		Read .s
		Attenuation		‡ n	n-f	+		0 Hz		1000 0	iHz			any	\$	any	÷	÷.	File

One port and two port standards are listed in two separate tables. Most of the buttons on the right side are available only if the "Kit Standards" dialog was opened for a user-defined calibration kit.

## **Table Columns**

The standard table contain the following information:

- "Type" and "Gender" describe the calibration standard type; for an overview see chapter 3.5.2.1, "Calibration Standard Types", on page 79.
- "Label" is a user defined name of the standard. The label can help you identify a standard or distinguish different standards with similar parameters.
- "Min Freq" and "Max Freq" define the rated frequency range of the standard. During calibration, the analyzer checks whether the sweep range is within the validity range of all measured standards and possibly generates a warning.
- ".s1p File" and ".s2p File" define whether the characteristics of the standard are described by a Touchstone file rather than by a circuit model from which the R&S ZNB can calculate the S-parameters. See "Read .s<n>p File..." on page 341 and chapter 4.4.3.13, "View / Modify Cal Kit Standards (Dialog)", on page 341.
- "Port" defines whether the standard can be connected to any analyzer port or to just one port (for one-port standards) or a pair of ports (for two-port standards). Standards with unrestricted port assignment ("any") are stored with their gender. When a connector type and calibration kit is selected for the calibration, the analyzer checks whether the kit contains the necessary standard types and whether the standards have the right gender.

Standards with restricted port assignment are always assumed to have the gender that is appropriate for the calibrated port. The **port assignment** is stored in the cal-

ibration kit file, instead of the gender. During the calibration, the analyzer checks whether the cal kit contains the necessary standard types for the required ports.

SCPI command:

[SENSe:]CORRection:CKIT:<StandardType>
[SENSe:]CORRection:CKIT:<ConnType>:SELect

## Add / Copy / Delete / View / Modify...

The buttons in the right part of the dialog are used to manage standards:

- "Add" adds a new standard to the calibration kit. The properties of the standard can be edited in the table.
- "Copy" creates a new standard based on the properties of an existing standard.
- "Delete" deletes the selected standard.
- "View / Modify ..." opens the "View / Modify Cal Kit Standards" dialog. This dialog shows the circuit model for the selected standard. For user-defined standard, you can modify the circuit model parameters. See chapter 4.4.3.13, "View / Modify Cal Kit Standards (Dialog)", on page 341.

SCPI command:

[SENSe:]CORRection:CKIT:<StandardType>
[SENSe:]CORRection:CKIT:<ConnType>:SELect

### Read .s<n>p File...

Opens a file selection dialog where you can select a Touchstone file containing the reflection or transmission S-parameters for the standard. The R&S ZNB uses the imported S-parameters rather than the circuit model to characterize the standard, if ".s<n>p File" is checked in the standard table. The appropriate file type (\*.s1p for one-port standards and \*.s2p for two-port standards) is selected automatically.

SCPI command:
[SENSe:]CORRection:CKIT:CATalog?

## 4.4.3.13 View / Modify Cal Kit Standards (Dialog)

The "View / Modify Cal Kit Standards" dialog shows the circuit model for a selected calibration standard. It is also used to define or edit the circuit model (offset and load) parameters for a user-defined standard.




## Related information

Refer to the following sections:

- chapter 3.5.2.4, "Cal Kit Files", on page 82
- chapter 4.4.3.12, "Kit Standards (Dialog)", on page 339
- chapter 3.5.2.1, "Calibration Standard Types", on page 79

Access: CHANNEL > CAL > Calibration > Cal Kits ... > Standards ... > View / Modify

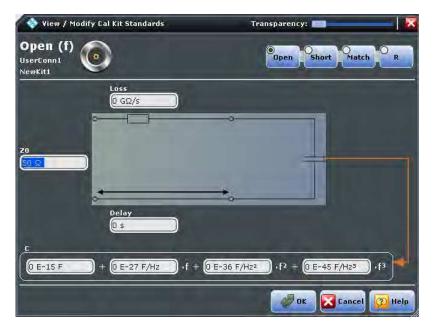

The diagram in the "View / Modify Cal Kit Standards" dialog depends on the standard type for which the dialog was opened. Moreover, it is possible to modify the circuit model using the buttons in the upper right of the dialog.

## **Offset Parameters**

The entries on the left-hand side specify the offset parameters for the transmission lines of the selected calibration standard.

The offset parameters depend on whether or not the circuit model is defined in "Agilent Mode" (see chapter 4.4.3.10, "Cal Connector Types (Dialog)", on page 336):

- If "Agilent Mode" is active, then the standard is characterized by its "Delay" (in s), its characteristic impedance Z<sub>0</sub> (in Ω) and its "Offset Loss" (in GΩ).
- If "Agilent Mode" is switched off, then the standard is characterized by the R&S ZVRcompatible parameters "Electrical Length" (in m), its "Char. Impedance" (in Ω) and its "Loss" (in dB/sqrt(GHz)). The loss is zero and not editable as long as the electrical length is zero.

Both parameter sets are closely related. The "Electrical Length" is proportional to the "Delay";  $Z_0$  corresponds to the "Char. Impedance". Moreover the analyzer converts an Agilent-type "Offset Loss" into a ZVR-type Loss and vice versa using the "Relative Permittivity"  $\varepsilon_r$  for the selected connector type.

See also description of the offset parameters in chapter 3.5.2.1, "Calibration Standard Types", on page 79.

SCPI command:

[SENSe:]CORRection:CKIT:<ConnType>:SELect

## Load Parameters

The entries on the right-hand side or across the bottom of the "View / Modify Cal Kit Standards" dialog specify the load parameters for a particular calibration standard describing its terminal impedance.

The circuit model for the load consists of capacitance C which is connected in parallel to an inductance L and a resistance R, both connected in series.

- "R" is the constant resistive contribution. It is possible to select a special value ("Open" for ∞ Ω so that the inductance coefficients are irrelevant, "Short" for 0 Ω, Match for the reference impedance of the current connector type) or set any resistance R.
- The fringing capacitance C and the residual inductance L are both assumed to be frequency-dependent and approximated by the first four terms of the Taylor series around f = 0 Hz.

See also description of the load parameters for the different standard types in chapter 3.5.2.1, "Calibration Standard Types", on page 79.

SCPI command:

[SENSe:]CORRection:CKIT:<ConnType>:SELect

## 4.4.3.14 Characterize Cal Unit (Dialog)

The "Characterize Cal Unit" dialog displays the properties of the connected cal units, provides control elements for characterization file management, and starts the characterization wizard.



## Background information

Refer to chapter 3.5.5.3, "Characterization of Calibration Units", on page 89.

A C

A cal unit characterization can be performed in a frequency sweep. The "Characterize Cal Unit" dialog is unavailable while a power, CW Mode, or time sweep is active. The analyzer always uses a fixed source power of –10 dBm to acquire the characterization data.

Access: CHANNEL > CAL > Cal Devices > Characterize Cal Unit...

**Channel Settings** 



#### **Calibration Unit**

Displays the connected calibration units. The R&S ZNB auto-detects all calibration units which are connected to one of its USB ports. If several cal units are connected, one of them must be selected for characterization (active cal unit).

SCPI command:

SYSTem:COMMunicate:RDEVice:AKAL:ADDRess:ALL? SYSTem:COMMunicate:RDEVice:AKAL:ADDRess

#### Authentication / Set Password

Set a password to protect the characterization dialog and the "Start Characterization" wizard from unauthorized access and operation. "Set Password" opens a dialog to enter the password and activate password protection at the next time the "Characterize Cal Unit" dialog is opened. Enter an empty string (no password) to deactivate password protection.

**Tip:** A password also blocks a switchover of the active characterization during calibration; see "Characterization" on page 282.

SCPI command: [SENSe:]CORRection:COLLect:AUTO:CKIT:PASSword

#### **Characterization Data**

Displays all characterizations which are stored in the active cal unit. The "Factory" characterization is available for all calibration units; it ensures an accurate calibration for all standard applications.

The properties of the selected characterization are shown below the list. "Delete" deletes the selected characterization file; "Start Characterization" opens the characterization wizard to create a new characterization.

SCPI command:

```
SYSTem:COMMunicate:RDEVice:AKAL:CKIT:CATalog?
SYSTem:COMMunicate:RDEVice:AKAL:CKIT:STANdard:CATalog?
SYSTem:COMMunicate:RDEVice:AKAL:SDATa?
```

## 4.4.3.15 Characterization Wizard

The "Characterization" wizard guides you through the automatic characterization of a calibration unit.

The guided characterization consists of the following steps:

- 1. **Characterization:** Select the characterized ports and cal unit standards and initiate the characterization sweeps.
- 2. Save Characterization Data: Save the characterization data to an internal file on the calibration unit.

#### **Step 1: Characterization**

Selects the calibration type as well as the characterized cal unit ports and initiates the necessary characterization sweeps.



## Characterization procedure

To acquire accurate characterization data, the test setup must be properly calibrated before you start the characterization wizard. Use the calibration type that you wish to perform with your new cal unit characterization; see chapter 3.5.5.3, "Characterization of Calibration Units", on page 89.

Access: CHANNEL > CAL > Cal Devices > Characterize Cal Unit... > Start Characterization...

**Channel Settings** 



#### **Test Port Assignment**

Defines the assignment between test ports and cal unit ports. In the default "Manual" assignment, VNA ports and cal unit port numbers match. If you decide to use a different assignment, you can auto-detect the actual assignment ("Automatic") or select the analyzer port numbers manually. Auto-detection may fail e.g. because of a high attenuation in the signal path.

## SCPI command:

[SENSe<Ch>:]CORRection:COLLect:AUTO
[SENSe<Ch>:]CORRection:COLLect:AUTO:PORTs
[SENSe:]CORRection:COLLect:AUTO:PORTs:CONNection?
[SENSe:]CORRection:COLLect:AUTO:CKIT:PORTs

## Take OSM ... / Take All OSM and Through

Starts a calibration sweep for the selected port(s). "Take All OSM and Through" initiates a series of calibration sweeps; the R&S ZNB acquires a full set of one-port and two-port data. This is required for the transmission normalizations and for a "One Path Two Ports" calibration; see "Dependency between calibration types and characterization data" on page 89.

SCPI command:

[SENSe<Ch>:]CORRection:COLLect:AUTO
[SENSe<Ch>:]CORRection:COLLect:AUTO:PORTs
[SENSe:]CORRection:COLLect:AUTO:PORTs:CONNection?

## Next

Proceeds to the second dialog in the characterization wizard ("Save Characterization Data"). Next is available as soon as the R&S ZNB has acquired characterization data for a single port.

#### **Step 2: Save Characterization Data**

Saves the characterization data to an internal file on the calibration unit.

Access: CHANNEL > CAL > Cal Devices > Characterize Cal Unit... > Start Characterization...



## Comment / Filename / Finish

Selects a characterization file name to reference the characterization data set in the "Characterize Cal Unit" and "Calibration Unit" dialogs and a comment, to be written into the characterization file. A file name is required before you can "Finish" the characterization wizard and store the data.

SCPI command: [SENSe:]CORRection:COLLect:AUTO:CKIT

## 4.4.3.16 Calibration > Pwr Cal Settings


Provides access to all functions for power meter and power calibration data handling (transmission coefficients). Power calibration of the R&S ZNB is a fully menu-guided process.

# www.valuetronics.com



## Efficient power calibration procedure

- For standard applications, open the "Start Cal" tab and select "Scalar Power Cal > Power Cal..." to perform the necessary calibration sweeps with default power calibration settings. You do not need any of the buttons in the "Pwr Cal Settings" tab.
- Select "Cal Power ..." if you use an amplifier between the source port and the DUT.
- Select "Transmission Coefficients ..." if you want to modify the power calibration procedure.

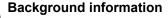

Refer to chapter 3.5.6, "Scalar Power Calibration", on page 92.

Calibration	X
Cal Power	Start Cal
Transm. Coefficients	Cal Devices
Switch off Other Sources	Pwr Cal Settings
Flatness Cal	Use Cal
Max Iterations	
Tolerance	
Convergence	
Power Meter Pmtr 1 +	
NRP-Z11 Ser#: 900001	fin 1
Power Meters	
Auto Zero	

Access: CHANNEL > CAL key or Alt + Shift + P

The "Calibration" buttons open the following dialogs:

- Cal Power...: See chapter 4.4.3.17, "Modify Cal Power (Dialog)", on page 349
- Transmission Coefficients...: See chapter 4.4.3.18, "Power Meter Transmission Coefficients (Dialog)", on page 352
- Power Meters...: See chapter 3.7.10, "External Power Meters", on page 130

## Switch Off All Other Sources

Ensures that the power at all sources except the calibrated source is switched off during the calibration. This is advisable especially if the measurement involves a combination of different signals.

SCPI command:

SOURce<Ch>:POWer<PhyPt>:CORRection:OSOurces[:STATe]

#### Flatness Cal > Total Readings

Sets a limit for the number of calibration sweeps. See also "Calibration procedure" on page 93.

SCPI command:

SOURce<Ch>:POWer<PhyPt>:CORRection:NREadings
SOURce<Ch>:POWer<PhyPt>:CORRection:COLLect:AVERage[:COUNt]

#### Flatness Cal > Tolerance

Defines the maximum deviation of the measured power from the cal power. The calibration procedure is stopped if the number of "Total Readings" is reached or if the measured power is within the "Tolerance".

SCPI command:

SOURce<Ch>: POWer<PhyPt>: CORRection: COLLect: AVERage: NTOLerance

#### Flatness Cal > Convergence

Modifies the amount of power correction for each of the flatness calibration sweeps. The power correction in each sweep, as controlled by the calibrated reference receiver (a-wave receiver), is multiplied by the selected convergence factor. With a convergence factor larger (smaller) than 1, the source power correction after each flatness calibration step is larger (smaller) than the measured deviation from the desired power.

For analyzer test ports, a convergence factor 1 is appropriate. Convergence factors different from 1 may be indicated for external generator ports which show a nonlinear behavior. In general, it is recommendable to start the calibration with a convergence factor 1 and choose smaller values (0.8 ... 0.4) in case that the iteration fails. Inappropriate convergence factors can slow down the flatness calibration or even prevent convergence.

SCPI command:

SOURce<Ch>: POWer<PhyPt>: CORRection:COLLect:CFACtor

#### **Power Meter**

Shows a list of all power meters that have been properly configured and are available for the power calibration of a source port. The last configured power meter is selected by default. See "Configured Devices" on page 437.

SCPI command: SOURce:POWer:CORRection:PMETer:ID

#### Auto Zero

Initiates an automatic zeroing procedure of the power meter; see "Zeroing" on page 131.

SCPI command:

SYSTem:COMMunicate:RDEVice:PMETer<Pmtr>:AZERo

## 4.4.3.17 Modify Cal Power (Dialog)

The "Modify Cal Power" dialog adjusts the target power for the power calibration (cal power), in particular for test setups with external attenuators or amplifiers, and defines the target power for the reference receiver calibration.

The diagram in the center of the dialog visualizes the settings and results below.



## **Related information**

The settings in the "Modify Cal Power" dialog are also used to define port-specific source powers in arbitrary mode (with option R&S ZNB-K4); refer to chapter 4.4.4.6, "Modify Cal Power (Dialog)", on page 368.

Access: CHANNEL > CAL > Pwr Cal Settings > Cal Power...

🚸 Modify Cal Power Ch1	-	*	(	X
Port Cal Power				
P1 - 10 dBm Offset: 0 dB - 10 dBm Offset: 0 dB	P20 -10 dBm Offset: 0 dB	<u>P40</u> -10 dBm Offset: 0 dB		
	4	Amp	TUG	
Channel Base Power Pb (-10 dBm) 0 dBm	and the second se	ll Power Offset dB	Power Result	
Reference Receiver Cal Power				
			Close	😥 Help

#### **Port Overview**

The dialog shows all source ports of the network analyzer. Each port is displayed with the current "Power Result" at the input of the DUT (in dBm) and offset (i.e. the "Cal Power Offet" in dB).

Configured external generators ("G1" ...) are included in the source port overview.

SCPI command:

```
SOURce<Ch>:POWer<PhyPt>[:LEVel][:IMMediate]:OFFSet
SOURce<Ch>:POWer<PhyPt>:CORRection:LEVel:OFFSet
```

## **Port Power Offset**

Defines a port-specific offset to the channel base power. The actual output power at the port is equal to the channel base power  $P_b$  ("CHANNEL > POWER BW AVG > Power > ...") plus the "Port Power Offset". It is equal to the "Port Power Offset" (converted into dBm) if "0 dBm" is selected instead of  $P_b$ .

For power sweep and the selection  $P_b$ , the actual port power varies across the sweep; for other configurations the port power is constant.

SCPI command:

SOURce<Ch>:POWer<PhyPt>[:LEVel][:IMMediate]:OFFSet SOURce<Ch>:POWer<PhyPt>:GENerator<Gen>:OFFSet

## **Cal Power Offset**

For power calibrations only (not supported in the current firmware version): Specifies a gain (positive values) or an attenuation (negative values) in the signal path between the source port and the calibrated reference plane. With a "Cal Power Offset" of n dB, the target power at the reference plane (cal power) is equal to the actual output power at the port plus n dB. The "Cal Power Offset" has no impact on the source power.

## Example: Use of an amplifier in the signal path

Assume that a DUT requires a constant input power of +25 dBm, and that the measurement path contains an amplifier with a 30 dB gain. After a reset of the analyzer the channel power  $P_b$  is -10 dBm. With a "Port Power Offset" of +5 dB at the calibrated source port and a "Cal Power Offset" of +30 dB, the source power calibration ensures that the constant input power of +25 dBm is maintained across the entire sweep range. The actual output power of the analyzer is -5 dBm.

Notice that a power calibration with an appropriate "Cal Power Offset" will automatically prevent excess input levels at the DUT.

#### SCPI command:

SOURce<Ch>:POWer<PhyPt>:CORRection:LEVel:OFFSet SOURce<Ch>:POWer<PhyPt>:CORRection:GENerator<Gen>:LEVel:OFFSet

#### **Reference Receiver Cal Power**

Defines the source power which the R&S ZNB uses to perform the first calibration sweep of the source power calibration. In this first sweep, the power meter reading is used to calibrate the reference receiver of the calibrated port; the following calibration sweeps are based solely on the reference receiver (see "Calibration procedure" on page 94).

The reference receiver cal power is also used for the power calibration step in a SMAR-TerCal; see chapter 3.5.7, "SMARTerCal", on page 98.

The accuracy of the source power calibration depends on the the power meter's measurement accuracy, therefore it is advantageous to select a reference receiver cal power at which the power meter provides a maximum accuracy. Otherwise your can use equal port cal power and reference receiver cal power values.

#### Note: Risk of damage due to high power settings

If an external device (e.g. an amplifier) is connected between the calibrated test port and the power meter, ensure that the reference receiver cal power does not exceed the maximum input power of this device.

SCPI command:

SOURce<Ch>:POWer<PhyPt>:CORRection:PPOWer SOURce<Ch>:POWer<PhyPt>:CORRection:PSELect

## 4.4.3.18 Power Meter Transmission Coefficients (Dialog)

The "Power Meter Transmission Coefficients" dialog allows you to modify the scalar power calibration data in order to account for an additional two-port device in the test setup with known transmission coefficients. Configuration of the transmission coefficients and activation are independent from each other.



Power M Connectio	A STREET		• No Coefficier
	WO ORT	DUT	O Two Port at DUT
¢		POWER	• Two Port at Power Met
	+		
	Two Port Config	<b>.</b>	

Access: CHANNEL > CAL > Pwr Cal Settings > Transm. Coefficients...

## **Test Setup**

Selects a test setup with an additional two port in front of the DUT (during the measurement) or in front of the power meter (during power calibration). "No Coefficients" disables the transmission coefficients but does not delete the entries in the "Two Port Configuration" dialog.

SCPI command:

SOURce<Ch>:POWer<PhyPt>:CORRection:TCOefficient[:STATe]
SOURce<Ch>:POWer<PhyPt>:CORRection:TCOefficient:CALibration

#### Two Port Config...

Opens the "Two Port Configuration" dialog to define transmission coefficients for the "Two Port at DUT" and the "Two Port at Power Meter" test setups. The button is disabled if "No Coefficients" is active. See chapter 4.4.3.19, "Two Port Configuration (Dialog)", on page 352.

## 4.4.3.19 Two Port Configuration (Dialog)

The "Two Port Configuration" dialog defines the transmission characteristics of an additional two-port in the calibrated frequency range.

Access: CHANNEL > CAL > Pwr Cal Settings > Transm. Coefficients... > Two Port Config...

**Channel Settings** 

	Frequency	Transm. Coefficients	* 👘 Insert
1	100 kHz	-5.55 dB	
2	42.5995 MHz	-5.77 dB	Delete
3	85.099 MHz	-5.92 dB	
4	127.5985 MHz	-5.39 dB	Delete Al
5	170.098 MHz	-5.78 dB	
6	212.5975 MHz	-5.54 dB	
7	255.097 MHz	-5.64 dB	<b>*</b>

#### Transmission Coefficients; Insert / Delete / Delete All

The required two-port information is a list of transmission coefficients at different frequency values (power loss list). The buttons in the dialog provide different ways of creating and modifying the list. Use "Insert", "Delete", "Delete All" to edit the list manually.

In a power, time or CW mode sweep, one point at the fixed CW frequency is sufficient. In a frequency sweep it is possible to enter several coefficients to account for a frequencydependent attenuation. Transmission coefficients are interpolated between the frequency points and extrapolated, if necessary. If no transmission coefficient is defined at all, the R&S ZNB assumes a 0 dB attenuation across the entire frequency range, which is equivalent to an ideal through connection or no "No Coefficients".

#### SCPI command:

SOURce<Ch>:POWer<PhyPt>:CORRection:TCOefficient:INSert<ListNo>
SOURce<Ch>:POWer<PhyPt>:CORRection:TCOefficient:DEFine<ListNo>
SOURce<Ch>:POWer<PhyPt>:CORRection:TCOefficient:COUNt?
SOURce<Ch>:POWer<PhyPt>:CORRection:TCOefficient:DELete<ListNo>[:
DUMMy]

SOURce<Ch>:POWer<PhyPt>:CORRection:TCOefficient:DELete<ListNo>: ALL

## Get Trace...

Opens a selection box containing all traces in the active recall set. The "dB Mag" values of the selected trace are used to define the transmission coefficients. Notice that if you combine different channels with different sweep points, the analyzer may have to interpolate or extrapolate the transmission coefficients.

#### SCPI command:

SOURce<Ch>: POWer<PhyPt>:CORRection:TCOefficient:FEED
on page 810R&S ZNB

## Import File...

Imports the transmission coefficients from a trace file. The imported file must be either in Touchstone (\*.s < n > p) or in \*.csv format; see also chapter 3.4.2, "Trace Files", on page 66.

SCPI command:

MMEMory:LOAD:CORRection:TCOefficient

## Recall ... / Save ...

You can save the displayed power loss list to a power meter correction list file with extension (\*.pmcl) and re-load it in later sessions.

SCPI command:

MMEMory:LOAD:CORRection:TCOefficient MMEMory:STORe:CORRection:TCOefficient

## 4.4.3.20 Calibration > Use Cal

Provides access to all functions for automatic or manual calibration and for calibration kit management. Calibration is a fully menu-guided process.



## **Background information**

Refer to the following sections:

chapter 3.5, "Calibration", on page 69

#### Access: CHANNEL > CAL key or Alt + Shift + P



The "Use Cal" buttons open the following dialogs:

- Active Power Cals...: See chapter 4.4.3.21, "Active Power Cals (Dialog)", on page 356
- Cal Manager...: See chapter 4.4.3.22, "Calibration Manager Dialog", on page 357

User Manual 1173.9163.02 - 13

# www.valuetronics.com

## **User Cal Active**

Activates or deactivates the system error correction in the active channel. "User Cal Active" is available only if a valid system error correction is available for the active channel; see "Channel State" in chapter 4.4.3.22, "Calibration Manager Dialog", on page 357.

**Note:** A label "Cal Off" appears behind the trace list if the system error correction is switched off; see also chapter 3.5.4, "Calibration Labels", on page 84. The calibration status of each channel and trace appears in the setup information ("SYSTEM > SETUP > Info... > Setup").

SCPI command:
[SENSe<Ch>:]CORRection[:STATe]

## Load Match Correction

Enables the load match correction for frequency conversion measurements. The load match correction prevents a possible impairment of the transmission S-parameter measurements due to the influence of the waves reflected at the receive (load) ports.

The load match correction is performed as follows:

- The correction is based on the system error corrected a- and b-waves of the source and load ports. An appropriate calibration is a prerequisite for the load match correction; see chapter 3.7.2.1, "Calibration Options", on page 118.
- A reverse sweep is automatically performed during the measurement.
- The correction is calculated under the assumption that the reverse transmission factors (e.g. S<sub>12</sub> for a transmission measurement between port 1 and port 2 with drive port no. 1) is zero.

The load match correction can provide a significant improvement of the transmission Sparameter measurements if the load ports are poorly matched. With sufficiently matched load ports, you can disable the correction to gain speed.

**Note:** Disable the load match correction if your test setup or DUT is not suited for reverse sweeps.

SCPI command:

[SENSe<Ch>:]FREQuency:CONVersion:GAIN:LMCorrection

## All Power Cals On / Off

Activates or deactivates all scalar power calibrations in the active channel. "All Power Cals On" is available only if a valid power calibration is available for the active channel, but not active; see "Channel State" in chapter 4.4.3.22, "Calibration Manager Dialog", on page 357.

**Note:** A label "PCal Off" appears behind the trace list of a wave quantity or a ratio if the power calibration is switched off; see also chapter 3.5.6.3, "Power Calibration Labels", on page 95. The calibration status of each channel and trace appears in the setup information ("SYSTEM > SETUP > Info... > Setup").

SCPI command:

[SENSe<Ch>:]CORRection:PCAL

## Recall Last Cal Set

Loads and activates the recall set for which the last calibration was performed. If the last calibrated setup is already active, nothing is changed. The calibrated setups are automatically stored in the

C:\Users\Public\Documents\Rohde-Schwarz\Vna\Calibration\ RecallSets directory. A message box pops up if the directory is empty, e.g. because no calibration was performed yet.

SCPI command:

n/a

## 4.4.3.21 Active Power Cals (Dialog)

The "Active Power Cals" shows the power calibrations for the active channel, enables and disables power calibrations.

210	<u>P3</u> 0	<u>P2</u> 0	<u>P4</u>
10 dBm )ffset: 0 dB	-10 dBm Offset: 0 dB	-10 dBm Offset: 0 dB	-10 dBm Offset: 0 dB
Power	Power	Power	Power
Receiver	Receiver	Receiver	Receiver
G1() SMB100A::TCP1P0:: -10 dBox Dffset: 0 dB			
Power			

Access: CHANNEL > CAL > Power Cal > Active Power Cals...

## **Port Overview**

Shows all source ports together with the possible power calibrations. Either a source power calibration ("Power") or a measurement receiver calibration ("Meas. Receiver") can be performed at each analyzer port P1 ... PN.

If external generators are configured, they appear as additional source ports G1 ... Gm in the port overview. A source power calibration is available at each generator port.

Power calibrations can be enabled or disabled after the necessary calibration data has been acquired; see chapter 4.4.3.5, "Power Cal Screen", on page 304.

## SCPI command:

```
SOURce<Ch>:POWer<PhyPt>:CORRection:STATe
SOURce<Ch>:POWer<PhyPt>:CORRection:GENerator<Gen>[:STATe]
[SENSe<Ch>:]CORRection:POWer<PhyPt>[:STATe]
[SENSe<Ch>:]CORRection:PCAL
```

## 4.4.3.22 Calibration Manager Dialog

The "Calibration Manager" dialog stores user correction data to the cal pool and assigns stored correction data to channels.

See chapter 3.5.3, "Calibration Pool", on page 83 for background information.

Access: CHANNEL > CAL > Calibration > Cal Manager ...



A warning appears before a calibration in the pool is overwritten by the new calibration. To continue the calibration confirm by using button "Overwrite current File?" or "Resolve Pool Link" on page 358.

Verwrite Warning	* =
	New calibration will overwrite
	Ch1 : TOSM12
	in the calibration pool.
Continue Calibration	)
	erwrite
Pool Link?	rrent File? Cancel 😥 Help

## **Channel State**

The "Channel State" table shows all channels in the active recall set together with their current calibration. Channels can use either the active channel calibration (if available), a previously stored user correction data or the factory system error correction (indicated as '--').

**Note:** If a new calibration is performed for a channel assigned to a cal group (marked as "<CalGroup>"), the correction data overwrites the cal group data, so the new calibration will affect all channels assigned to the cal group.

SCPI command: n/a

. ...

#### Add / Add All / Replace / Apply / Apply to All

The buttons between the tables are used to modify the calibration pool and apply calibration data sets (cal groups) to channels:

- "Add" copies the correction data of the selected channel to the cal pool, generating a new pool member (cal group).
- "Add All" copies the correction data of all channels to the cal pool, generating new pool members (cal groups).
- "Replace" overwrites a cal group with new correction data.
- "Apply" assigns the selected cal group to the selected channel.
- "Apply to All" assigns the selected cal group to all channels in the "Channel State" table.

SCPI command:

MMEMory:STORe:CORRection MMEMory:LOAD:CORRection MMEMory:LOAD:CORRection:MERGe

## Pool / Delete from Pool

The "Pool" table shows all correction data sets <CalGroup\_name>.cal in the directory C:\Users\Public\Documents\Rohde-Schwarz\Vna\Calibration\Data. The name of a pool data set can be modified directly in the corresponding table cell. "Delete from Pool" deletes a cal group file.

SCPI command:

MMEMory:DELete:CORRection

#### **Preset User Cal**

Selects a calibration from the pool that shall be restored during a user-defined preset.

This is particularly useful for scenarios involving External Switch Matrices, as with switch matrices user correction is indispensable.

SCPI command:

SYSTem:PRESet:USER:CAL

## **Resolve Pool Link**

Deletes the link between the selected channel <Channel> and the cal group <Cal Group>. The cal group data continues to be used as a channel calibration ("Channel Cal") for the "<Channel>", the "Channel State" list displays "<Channel> ... Channel Cal".

SCPI command:

MMEMory:LOAD:CORRection:RESolve

#### **Channel Properties**

Displays the basic channel settings and the properties of the system error correction for the selected channel in the "Channel State" table.

```
Channel Settings
```

In addition it is stated whether or not Cal Sweep Data are available for the selected calibration (see "Save Sweep Data" on page 423).

```
SCPI command:
```

```
[SENSe<Ch>:]CORRection:DATE?
[SENSe<Ch>:]CORRection:DATA:PARameter<Sfk>?
[SENSe<Ch>:]CORRection:DATA:PARameter<Sfk>:PORT<PhyPt>?
[SENSe<Ch>:]CORRection:DATA:PARameter:COUNt? on page 719
[SENSe<Ch>:]CORRection:SSTate?
```

## 4.4.4 Channel Config


The "Channel Config" functions select, create and delete channels, configure the source and receive ports of the R&S ZNB, and optimize the measurement process.

## 4.4.4.1 Channel Config > Channels

Creates and deletes channels and selects a channel as the active channel.



You can monitor the channel activity using the OUTPut<Ch>:UPORt[:VALue] command and the output signals at pins 8 to 11 of the "USER PORT" connector.

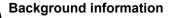

Refer to chapter 3.1.3.3, "Active and Inactive Traces and Channels", on page 15.

Access: CHANNEL > CHANNEL CONFIG key or Alt + Shift + O



## Active Channel

Selects an arbitrary channel of the active recall set as the active channel. This function is disabled if the current recall set contains only one channel.

If one or several traces are assigned to the selected channel, one of these traces becomes the active trace.

The order of all channels in a recall set is given by the channels' creation time. By default, the channels are named Ch1, Ch2, ... so that Ch < n - 1 > precedes Ch < n >. This order is always maintained, even if channels are renamed, invisible (because no traces are assigned to them) or distributed over several diagram areas.

**Tip:** You can simply tap a line in the channel list to activate the corresponding channel. SCPI command:

The numeric suffix <Ch> appended to the first-level mnemonic of a command selects a channel as the active channel.

## **Delete Channel**

Deletes the current channel including all traces assigned to the channel and removes all display elements related to the channel from the diagram area. "Delete Channel" is disabled if the recall set contains only one channel: In manual control, each recall set must contain at least one diagram area with one channel and one trace.

Tips: Use the "Undo" function to restore a channel that was unintentionally deleted.

SCPI command:

CONFigure:CHANnel<Ch>[:STATe] OFF

#### Add Ch + Trace

Creates a new channel and a new trace, which is displayed in the active diagram area. The new channel settings (including a possible channel calibration) are identical to the previous channel settings; the trace is created with the trace settings of the former active trace but displayed with another color. The former and the new active trace are superimposed but can be easily separated, e.g. by changing the "Reference Position".

The new channel is named Ch<n>, where <n> is the largest of all existing channel numbers plus one. The name can be changed in the "Channel Manager" dialog.

**Tips:** To create a new trace in the active channel, use "TRACE > TRACE CONFIG > Traces > Add Trace". To create a new channel and a new trace and display it in a new diagram area, use "Add Ch + Tr + Diag".

SCPI command:

CONFigure:CHANnel<Ch>[:STATe] ON CALCulate<Ch>:PARameter:SDEFine DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:FEED CONFigure:TRACe<Trc>:CHANnel:NAME? CONFigure:TRACe<Trc>:CHANnel:NAME:ID?

#### Add Ch + Tr + Diag

Creates a new channel and a new trace, which is displayed in a new diagram area. The new channel settings (including a possible channel calibration) are identical to the previous channel settings; the trace is created with the trace settings of the former active trace but displayed with another color.

The new channel is named Ch<n>, where <n> is the largest of all existing channel numbers plus one. The name can be changed in the "Channel Manager" dialog. **Tips:** To create a new trace in the active channel, use "TRACE > TRACE CONFIG > Traces > Add Trace". To create a new channel and a new trace and display it in the active diagram area, use "Add Ch + Trace".

SCPI command:

```
CONFigure:CHANnel<Ch>[:STATe] ON
CALCulate<Ch>:PARameter:SDEFine
DISPlay[:WINDow<Wnd>]:STATe ON
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:FEED
```

## 4.4.4.2 Channel Manager (Dialog)

The "Channel Manager" dialog performs the actions in the "CHANNEL > CHANNEL CONFIG > Channels" tab systematically and renames channels.

**Background information** Refer to chapter 3.1.3.3, "Active and Inactive Traces and Channels", on page 15.

Access: CHANNEL > CHANNEL CONFIG > Channels > Channel Manager...



#### **Channel table**

The channel table contains several editable (white) or non-editable (gray) columns.

- "Name" indicates the current channel name(s). The default names for new channels are Ch<n> where <n> is a current number.
- "Traces" indicates the names of all traces assigned to the channel.

SCPI command:

```
CONFigure:CHANnel:CATalog?
CONFigure:CHANnel<Ch>:NAME
CONFigure:CHANnel<Ch>:NAME:ID?
```

## Add / Delete

The buttons below the channel table add and delete channels.

"Add" adds a new channel to the list. The new channel is named Ch<n>, where <n> is the largest of all existing channel numbers plus one.

 "Delete" deletes the channel selected in the table. This button is disabled if the setup contains only one channel: In manual control, each setup must contain at least one diagram area with one channel and one trace.

SCPI command:

CONFigure:CHANnel<Ch>[:STATe]

## 4.4.4.3 Channel Config > Port Config

Configures the source and receive ports of the R&S ZNB for measurements on frequency-converting DUTs, defining arbitrary port frequencies and powers. While the arbitrary mode is active, "Arb" and the selected stimulus axis are displayed in the channel line.

The arbitrary port configuration is part of option R&S ZNB-K4, "Frequency Conversion Measurements".



## **Background information**

Refer to chapter 3.7.2, "Frequency Conversion Measurements (R&S ZNB-K4/-K14)", on page 117.

Access: CHANNEL > CHANNEL CONFIG key or Alt + Shift + O



The "Port Config" buttons open the following dialogs:

- Arbitrary Freq...: See chapter 4.4.4.4, "Define Port Settings (Dialog)", on page 363
- Balanced Ports...: See chapter 4.2.1.3, "Balanced Ports (Dialog)", on page 154

#### Stimulus Axis > Frequency / Power

Selects either the channel base frequency / power or one of the port frequencies / powers as the stimulus axis in all diagrams of the active recall set. The selected stimulus axis is displayed in the channel line. Select the axis according to your port configuration and measurement results.

## Example:

Port 1 provides the RF input signal for a mixer; the IF output signal is measured at Port 2. The port frequency of Port 1 is equal to the channel base frequency  $f_B$ , the port frequency of Port 2 is set to the IF frequency  $P_b + f_{LO}$ . To view the received wave  $b_2$  over the entire IF frequency range, select "Port 2" as a frequency stimulus axis.

The lists include external generator and power meter ports. The "Frequency" list is disabled while the frequency conversion is switched off.

SCPI command:

[SENSe<Ch>:]SWEep:AXIS:FREQuency [SENSe<Ch>:]SWEep:AXIS:POWer

## 4.4.4.4 Define Port Settings (Dialog)

The "Define Port Settings" dialog configures the source and receive ports of the R&S ZNB for arbitrary frequencies, source and receiver levels. The source and receive frequencies of the ports are always equal.

If any of the port frequencies are changed from their preset values, the frequency conversion mode (arbitrary mode, with option R&S R&S ZNB-K4) is activated on pressing "Apply" or "OK" in the dialog. An "Arb" label appears in the channel line. "Reset Port Settings" plus "Apply" or "OK" de-activates the arbitrary mode.



#### Related information

Refer to the following sections:

- chapter 3.7.2, "Frequency Conversion Measurements (R&S ZNB-K4/-K14)", on page 117
- chapter 4.6.9, "External Power Meters (Dialog)", on page 436
- chapter 4.6.10, "External Generators (Dialog)", on page 438

Access: CHANNEL > CHANNEL CONFIG > Port Config > Port Settings...

#### Arb Frequency

Defines port-specific frequencies and other port-specific source settings.



#### Channel base frequency

After a reset ("Reset Port Settings"), all port frequencies are set to the channel base frequency  $f_b$ . For frequency sweeps,  $f_b$  corresponds to the unmodified sweep range. For power, time, and CW mode sweeps, it is equal to the CW frequency.  $f_b$  is defined by the "Stimulus" parameters.

rb Freque	Arbi	trary Powe	Receiv	er Level		
#	Info	RF Off	Gen	Freq. Conve	ersion	Frequency Result
🕽 Part 1	ZNB8	Г	1	fb	· ····	1 GHz 3 GHz
) Port 2	ZNB8	Г		fb + 1 GHz		2 GHz 4 GHz
🕽 Port 3	ZNB8	Г	100	fb		1 GHz 3 GHz
Port 4	ZNB8	Г		fb	6	1 GHz 3 GHz
Gen 1	SMR20		E	1 GHz		1 GHz 1 GHz
Gen 2	SMIQ068	Г	Г	fb	()	I GHz 3 GHz
Pmtr 1	NRP-Z11			fb	(	I GHz 3 GHz

## Non-editable table columns

In addition to the test ports ("Port 1" ... ), the source ports include all configured external generators ("Gen 1" ...). The receive ports include all configured external power meters ("Pmtr 1" ...). Each port is displayed with its port number, device type ("Info"), and "Frequency Result", according to the current channel base frequency and "Freq. Conversion" settings.

SCPI command:

n/a

## RF Off

Turns the RF signal at a source port (analyzer test port or generator port) on or off.

The column is disabled (grayed) while the RF power is switched off globally for the active channel. The settings are restored as soon as the RF power is switched on again. While the RF power is switched off, the port can still be used as a receive port.

SCPI command:

SOURce<Ch>:POWer<PhyPt>:STATe SOURce<Ch>:POWer<PhyPt>:GENerator<Gen>:STATe

#### Gen

Qualifies whether the RF signal source at the port is switched on for all partial measurements (box checked, permanent signal source) or only for the partial measurements that require the port as a drive port. "Gen" has no effect unless the RF source at the port is switched on ("RF Off" is not checked).

**Note:** If External Switch Matrices are part of the RF connection configuration, operation with Internal Second Source (R&S ZNB-B2) is *not* supported. In this case the "Gen" flag is only enabled for generator ports.

Switching on the signal source permanently eliminates the power settling times of the DUT but may introduce measurement inaccuracies, e.g. due to crosstalk between two ports. Therefore, "Gen" must be switched off to perform a system error correction.

An **external generator** always represents a permanent signal source that is switched on for all partial measurements. "Gen" qualifies whether or not the generator is actually

available as a signal source in the test setup. The analyzer provides two alternative, independent ways of selecting a generator as a signal source:

- "Gen: On" in the "Port Configuration" dialog, especially if the generator is not assigned to a particular measurement result or drive port.
- Selection as a source for a particular measurement result or for a power calibration, see e.g. "More Wave Quantities" dialog.

SCPI command:

SOURce<Ch>:POWer<PhyPt>:PERManent[:STATe]
SOURce<Ch>:POWer<PhyPt>:GENerator<Gen>:PERManent[:STATe]

## Frequency

Opens an input box to define a port-specific stimulus frequency range (for frequency sweeps) or CW frequency (for power, time and CW Mode sweeps); see chapter 4.4.4.5, "Modify Frequency Conversion (Dialog)", on page 367.

In the default configuration the channel base frequency  $f_b$  is used. The result is displayed in the "Frequency Result" column. A red "Frequency" field indicates that the hardware limits are exceeded, e.g. if the default sweep range of the analyzer is beyond the frequency range of the external generator.

#### **Arbitrary Power**

Configures the source ports of the R&S ZNB for port-specific powers.



## Channel base power

After a reset ("Reset Port Settings"), all source port powers are set to the channel base power  $P_b$ . For power sweeps,  $P_b$  corresponds to the unmodified sweep range. For frequency, time, and CW mode sweeps, it is equal to the fixed "Power".  $f_b$  is defined by the "Stimulus" parameters.



User Manual 1173.9163.02 - 13

# www.valuetronics.com

## Non-editable table columns

In addition to the test ports ("Port 1" ... ), the source ports include all configured external generators ("Gen 1" ...). Each port is displayed with its port number, device type ("Info"), and "Power Result", according to the current channel base power and "Power Conversion" settings.

SCPI command: n/a

## **Power Conversion**

Opens an input box to define a port-specific source power range (for power sweeps) or fixed power (for frequency, time and CW Mode sweeps); see chapter 4.4.4.6, "Modify Cal Power (Dialog)", on page 368.

In the default configuration the channel base power  $P_b$  is used. The result is displayed in the "Power Result" column.

## Slope

Defines a linear factor to modify the port-specific source power as a function of the stimulus frequency. The "Slope" is added to the power conversion; it increases the power at each sweep point by the following amount: <Power Result> --> <Power Result> + <Slope> \* f, where f denotes the port frequency.

SCPI command:

SOURce<Ch>:POWer<PhyPt>[:LEVel][:IMMediate]:SLOPe

## **Receiver Level**

Defines a port-specific IF gain.

#	Info	Attenua	ition		
Port 1 Meas(b1)	ZNBB	10 dB	\$		
Part 2 Meas(b2)	ZNB8	0 dB	\$		
) Port 3 Meas(63)	ZNBB	0 dB	\$		
🕽 Port 4 Meas(b4)	ZNB8	0 dB	\$		

#### Attenuation

Sets the attenuation in the receiver path (measurement receiver, b-waves).

SCPI command:
[SENSe<Ch>:]POWer:IFGain<PhyPt>:MEASure

## **Reset Port Settings**

Cancels the "Freq. Conversion" and "Power Conversion" settings of all ports. After "Reset Port Settings", "Apply" or "OK" de-activate the arbitrary mode.

SCPI command:

[SENSe<Ch>:] FREQuency:CONVersion FUNDamental

#### Apply / OK

Activates or deactivates frequency conversion (arbitrary) mode, depending on the current port configuration.

- If individual port frequencies are selected, the arbitrary mode is activated.
- If individual port powers but no individual frequencies are selected, the current mode is maintained.
- If all port frequencies are equal to the channel base frequency, and all port powers are equal to the channel base power (e.g. after "Reset Port Settings"), the arbitrary mode is deactivated.


SCPI command:

[SENSe<Ch>:] FREQuency: CONVersion ARBitrary | FUNDamental

## 4.4.4.5 Modify Frequency Conversion (Dialog)

The "Modify Frequency Conversion" dialog defines a port-specific stimulus frequency range (for frequency sweeps) or CW frequency (for power, time and CW Mode sweeps).

**Access:** CHANNEL > CHANNEL CONFIG > Port Config > Arbitrary Frequency... > Freq Conversion...

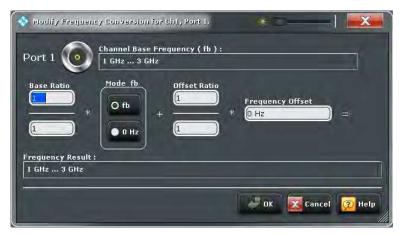

#### Frequency conversion formula

The port frequencies are calculated as a multiple of the channel base frequency  $f_b$  plus an offset:

 $f_{port} = a * f_b + b * < Offset >$ 

The conversion formula has been modeled according to the needs of a typical frequencyconverting measurement where mixer products, intermodulation products, or harmonics occur:

With a base ratio a = 1, an offset ratio b = ±1, and a frequency offset equal to the LO frequency, the formula is appropriate for mixer measurements: If the RF signal is at

the channel base frequency, the port frequency is at the frequency of the upper and lower sideband (IF frequency).

- Integer offset ratios b > 1 are suited for the measurement of higher-order intermodulation products.
- With zero offset and integer a, the port frequency corresponds to the a<sup>th</sup> harmonic of the channel base frequency.

SCPI command:

```
SOURce<Ch>:FREQuency<PhyPt>:CONVersion:ARBitrary:IFRequency
SOURce<Ch>:FREQuency<PhyPt>:CONVersion:ARBitrary:EFRequency<Gen>
[SENSe<Ch>:]FREQuency:CONVersion:ARBitrary:PMETer<Pmtr>
```

## 4.4.4.6 Modify Cal Power (Dialog)

The "Modify Cal Power" dialog defines port-specific source powers. The general purpose of the port power settings is to ensure a definite signal power at the input of the DUT, considering all possible sources of power variations in the test setup.


The diagram in the center of the dialog visualizes the settings and results below.



## **Related information**

The settings in the "Modify Cal Power" dialog are also used to define the target power for the scalar power calibration; refer to chapter 4.4.3.17, "Modify Cal Power (Dialog)", on page 349.

Access: CHANNEL > CHANNEL CONFIG > Port Config > Arbitrary Power > Power Conversion > ...

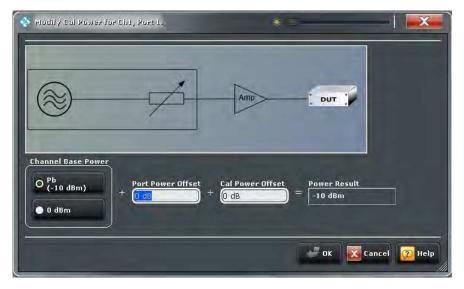

The control elements in the "Modify Cal Power" dialog are described in the following sections:

- "Port Power Offset" on page 350
- "Cal Power Offset" on page 351

## 4.4.4.7 Channel Config > Mode

Optimizes the measurement process. The settings are valid for all channels in the active recall set.

Access: CHANNEL > CHANNEL CONFIG key or Alt + Shift + O



#### **Driving Mode**

Determines the order of partial measurements and sweeps.

- In "Auto" mode, the analyzer optimizes the display update: Fast sweeps are performed in "Alternated" mode, slower sweeps in "Chopped" mode.
- In "Alternated" mode, a partial measurement is performed at all sweep points (partial sweep) before the hardware settings are changed and the next partial measurement is carried out in an additional sweep. This is usually faster than "Chopped" mode.
- In "Chopped" sweep mode, the analyzer completes the necessary sequence of partial measurements at each sweep point and obtains the result (measurement point) before proceeding to the next sweep point. A trace is obtained from the beginning of the sweep.

The "Driving Mode" setting is also used during a system error correction. For channels which require a single partial measurement only, the driving mode settings are equivalent. See also chapter 3.1.4.1, "Partial Measurements and Driving Mode", on page 16.

SCPI command:

[SENSe<Ch>:]COUPle

## Image Suppr.

The "Image Suppr." settings define whether the analyzer measures with a local oscillator frequency LO below or above the RF input frequency. This feature can be used to elim-


inate known spurious components in the input signal that can distort the measurement, especially in the low frequency range.

- In "Auto" mode, the analyzer auto-selects the local oscillator frequency, depending on the receiver (RF) frequency and the test port. This mode systematically avoids known spurious signals provided that no frequency conversion occurs in the test setup.
- "LO > RF" means that the LO frequency is always above the measured RF frequency. This mode is appropriate for avoiding single, known spurious signals.
- "LO < RF" means that the LO frequency is always below the measured RF frequency. This mode is appropriate for avoiding single, known spurious signals.


**Tip:** In the presence of several spurious signals, setting the "Image Suppr." parameter globally may not be sufficient. To improve the result, perform a "Segmented Frequency" sweep and assign independent LO frequencies to the individual sweep segments.

## Application example

Consider the following test setup with strongly reflecting DUT (e.g. a bandpass in its stop band) that is measured in transmission.  $a_1$  is generated at a frequency RF. The reflected wave  $b_1$  falls into the receiver mixer of the analyzer port 1, where a small fraction of the mixer product RF + 2\*IF can be reflected back towards the DUT. If this spurious wave  $a'_1$  passes the DUT, then it is received as  $b'_2$  at port 2, together with the wanted signal  $b_2$ .

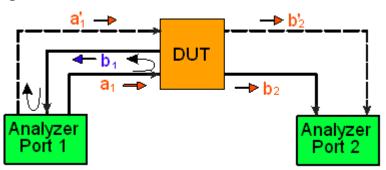

LO > RF implies that LO = RF + IF. The mixer at port 2 converts both the wanted signal  $b_2$  and the spurious signal  $b'_2$  which is at the frequency RF' = IF + LO, to the same IF frequency. The response of an ideal, infinitely steep bandpass filter with a pass band between B<sup>-</sup> and B<sup>+</sup> looks as follows:

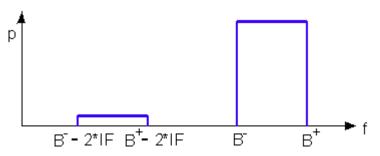

For a wide bandpass, the spurious response flattens the filter edges.

The spurious signal can be eliminated by dividing the sweep range into two segments with different LO settings:

- In the low-frequency segment, ranging up to the center frequency of the bandpass filter, the frequency of the local oscillator is set to LO < RF. This ensures that the spurious signal b'<sub>2</sub> is not measured at port 2.
- In the high-frequency segment, starting at the center frequency of the bandpass filter, the frequency of the local oscillator is set to LO > RF. If the center frequency is larger than B<sup>+</sup> – 2<sup>\*</sup>IF, then there is no distortion from b'<sub>2</sub>.

SCPI command:

[SENSe<Ch>:]FREQuency:SBANd

#### AGC Mode

Configures the Automatic Gain Control in the receiver path (measurement receiver, bwaves). The AGC mode can be set either globally (i.e. for all analyzer ports) or manually (see "Manual Config..." on page 371).

- "Auto" means that the analyzer adapts its receiver step attenuator settings to the RF input level (Automatic or Adaptive Gain Control, AGC). The A/D converter is always operated at optimum input level. Compared to the two other settings, "Auto" may slightly slow down the measurement.
- "Low Dist(ortion)" corresponds to a lower internal A/D converter input level. This setting allows for a high RF overdrive reserve and is appropriate for high RF input levels. The reference receiver AGC is always set automatically.
- "Low Noise" corresponds to a higher internal A/D converter input level. This setting
  increases the dynamic range and is appropriate for low RF input levels. The reference
  receiver AGC is always set automatically.
- "Manual" enables the manual configuration of the AGC, see "Manual Config..." on page 371..

The "Low Dist" or "Low Noise" settings are appropriate whenever the characteristics of the input path must be constant, e.g. because:

- Interfering signal contributions originating from the receiver (noise, nonlinear contributions) must not change during the measurement.
- A large interfering signal in the vicinity of the measured signal must not overdrive the receiver.

SCPI command:

[SENSe<Ch>:]POWer:GAINcontrol:GLOBal

## Manual Config...

The "Manual Configuration" dialog defines port-specific AGC settings.

In manual mode ("Auto" unchecked) the AGC settings can be performed separately for each drive port. In addition, each sweep segment can be configured separately. "Segmented AGC" enables these segment-specific settings.

If the analyzer is equipped with option R&S R&S ZNB-B24 ("Extended Power Range") not only the b-waves but also the a-waves can be configured separately.

**Note:** The increase in measurement speed for settings "Low Dist" and "Low Noise" is not achieved if one of the b-waves of a drive port is set to "Auto".

Channel Settings

C	Range Segment 3	: 1 GHz	. 8.5 GHz , -1	0 dB	m						1÷	+
-	Drive Port	Auto	a		b1		b2		b3	_	b4	
į.	Port 1	Г	Low Dist	\$	Low Noise	\$	Low Dist	\$	Low Dist	\$	Low Noise	;
	Port 2	Г	Low Dist	\$	Low Dist	\$	Low Dist	\$	Low Dist	\$	Low Dist	1:
	Port 3	Г	Low Noise	10	Low Dist	\$	Low Dist	=	Low Dist	+	Low Dist	1:
i i	Port 4	V		=		\$		=		\$		1

#### SCPI command:

[SENSe<Ch>:]POWer:GAINcontrol
[SENSe<Ch>:]SEGMent<Seg>:POWer:GAINcontrol

#### Segmented AGC

"Segmented AGC" enables the segment specific settings. It is available for segmented sweep type only.

# SCPI command: [SENSe<Ch>:]SEGMent<Seg>:POWer:GAINcontrol:CONTrol

## 4.4.4.8 Channel Config > Intermod

Controls the intermodulation measurement including power calibration. The intermodulation measurement requires options R&S ZNB-K4 and R&S ZNB-K14. The results can be selected using the "TRACE > MEAS > Intermod" softtool panel, see chapter 4.2.1.8, "Meas Intermodulation", on page 165.

A "Intermodulation Wizard" leads through the measurement configuration.



## **Background information**

Refer to chapter 3.7.2.3, "Intermodulation Measurements (R&S ZNB-K14)", on page 122.

Access: CHANNEL > CHANNEL CONFIG key or Alt + Shift + O

**Channel Settings** 



The "Intermod" buttons open the following dialogs:

- Wizard Intermod...: See chapter 4.4.4.9, "Wizard Intermodulation", on page 374
- Define Intermod...: See chapter 4.4.4.10, "Define Intermodulation Distortion Measurement (Dialog)", on page 376
- Frequencies Powers...: See chapter 4.4.4.11, "Frequencies and Powers (Dialog)", on page 379
- Generators...: See chapter 4.6.10, "External Generators (Dialog)", on page 438
- Intermod Pwr Cal...: See chapter 4.4.4.12, "Intermodulation Power Calibration (Dialog)", on page 380

## **Reset Frequency Conv Intermod**

Disables the intermodulation measurement mode and switches back to normal mode (no frequency conversion). The intermodulation settings are maintained, however, the intermodulation traces are eliminated, and the default trace  $(S_{21})$  is displayed.

SCPI command:

[SENSe<Ch>:]FREQuency:IMODulation:CONVersion


#### **CW Mode Spectrum**

In CW spectrum mode, the intermodulation measurement is performed at fixed frequency of the lower tone ("CW Frequency") and the upper tone ("CW Frequency" + "Tone Distance"). The analyzer displays intermodulation products up to a selectable order ("IM Order") around the lower and upper tone frequencies. The channel settings differ from the swept intermodulation measurement, therefore a new channel is created when the spectrum measurement is activated ("Add CW Mode").

The following example shows an intermodulation spectrum with the following settings:

- CW Frequency: 2 GHz (lower tone, position of marker M1)
- Tone Distance: 3 MHz (defines the upper tone, position of marker M2)

 Max. IM Order: 9. The peaks correspond to the intermodulation products lower IM9, lower IM7, lower IM5 (marker M6), lower IM3 (marker M5), lower tone, upper tone, upper IM3 (marker M3), upper IM5 (marker M4), upper IM7, upper IM9.

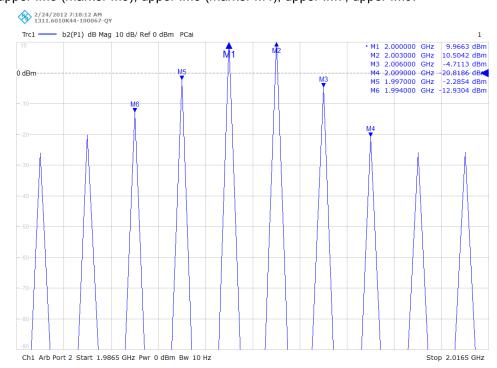

## Add CW Mode

Activates a new channel for the spectrum measurement. The "CW Frequency" plus half the "Tone Distance" defines the center of the diagram; the "Max IM Order" defines its width; see example above.

SCPI command:

```
[SENSe<Ch>:]FREQuency[:CW]
[SENSe<Ch>:]FREQuency:IMODulation:SPECtrum:MORDer
[SENSe<Ch>:]FREQuency:IMODulation:SPECtrum[:STATe]
```


## 4.4.4.9 Wizard Intermodulation

Opens a dialog that leads through a intermodulation measurement configuration.

The measurement is performed in 4 steps:

 Configure intermodulation measurement, see chapter 4.4.4.10, "Define Intermodulation Distortion Measurement (Dialog)", on page 376.

**Channel Settings** 

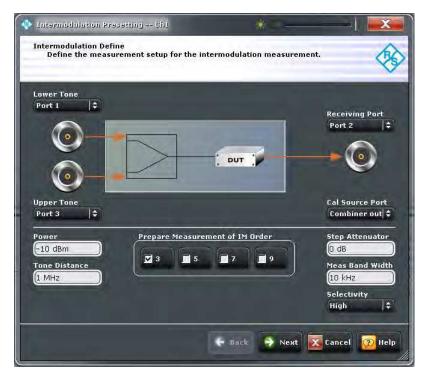

 Define the (frequency or power) sweep ranges for the lower tone, see chapter 4.4.4.11, "Frequencies and Powers (Dialog)", on page 379.

009	requency MHz	Stop Frequer 3 GHz		Power -10 dBm	CW Fragu	(BDCY
reu	ency Range Device	Frequency	1	Range		
1	CONTRACTOR OF	Lower Tone	3.009 M	Hz 3.002 GHz		
2	O Port 3	Upper Tone	3.009 M	Hz 3.002 GHz		
3		Lower IM3 Prod				
4	Port 2	Upper IM3 Prod	3.009 M	Hz 3.002 GHz		

 Select the measurement results, see chapter 4.2.1.8, "Meas Intermodulation", on page 165,

**Channel Settings** 



• Finish wizard or perform power calibration, see chapter 4.4.4.12, "Intermodulation Power Calibration (Dialog)", on page 380.




## 4.4.4.10 Define Intermodulation Distortion Measurement (Dialog)

The dialog configures the intermodulation measurement (except for power and frequency settings). The "OK" button is available as soon as a valid configuration has been defined.

User Manual 1173.9163.02 - 13

# www.valuetronics.com

Using two internal sources for the lower and upper tone requires option R&S ZNB-B2 (Internal Second Source). Alternatively an external generator can be used, see chapter 3.7.2.3, "Intermodulation Measurements (R&S ZNB-K14)", on page 122.

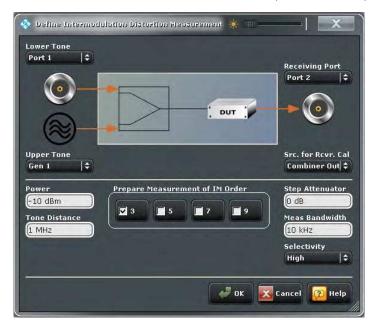

#### Lower Tone

Selects an analyzer port as a source of the lower tone signal. SCPI command: [SENSe<Ch>:]FREQuency:IMODulation:LTONe

#### **Upper Tone**

Selects an analyzer port or external generator as a source of the upper tone signal. The source must be different from the lower tone source. This means that you cannot combine coupled generator ports for the lower and upper tones (e.g. port 3/4 or port 1/2 on a fourport analyzer with option R&S ZNB-B2, "Internal Second Source"). If no internal second source is available, the upper tone must be provided by a (previously configured) external generator.

**Note:** If External Switch Matrices are part of the RF connection configuration, operation with Internal Second Source (R&S ZNB-B2) is *not* supported. In this case only external generators can be used as upper tone generator.

SCPI command:
[SENSe<Ch>:]FREQuency:IMODulation:UTONe

#### **Receiving Port**

Selects the receiving port for the signal from the output of the DUT. SCPI command: [SENSe<Ch>:]FREQuency:IMODulation:RECeiver

#### Src for Rcvr Cal

Selects the signal source for power calibration of the receiving port. In general, the combiner output signal is most convenient and provides the simplest calibration procedure.

If the combiner output signal is inappropriate, it is possible to select any free analyzer or generator port. This can happen e.g. if a filter at the combiner output is used to cut off the intermodulation products originating from the combiner so that the bandwidth of the "Combiner Out" signal does not fully cover the required receiver frequency range. In the power calibration procedure, this entails an extra source power calibration step for the additional source port.

SCPI command:

SOURce<Ch>: POWer: CORRection: IMODulation: PORT

#### Power

Power of the lower and of the upper tone. Both powers are always kept equal. For power sweeps, the start and stop power must be set in the "Frequencies and Powers" dialog.

SCPI command:

SOURce<Ch>:POWer<PhyPt>[:LEVel][:IMMediate][:AMPLitude]

#### **Tone Distance**

Defines the frequency difference between the upper and the lower tone. The tone distance is kept constant across the entire sweep.

SCPI command:

[SENSe<Ch>:]FREQuency:IMODulation:TDIStance

#### **Prepare Measurement of IM Order**

Selects the order(s) of the measured intermodulation products. Each order requires an additional measurement at a different frequency, therefore the measurement time increases with the number of selected orders. If a higher-order IM is selected, its frequency may exceed the upper or lower frequency limit of the analyzer. Use the "Fit Frequency Range" button in the "Frequencies and Powers" dialog to restrict the sweep range as required.

SCPI command:

[SENSe<Ch>:]FREQuency:IMODulation:ORDer<Im>[:STATe]

#### **Step Attenuator**

Defines the value for the receiver step attenuator at the receiving port. The setting is identical with the "Stimulus > Power" settings; see chapter 4.3.2, "Stimulus > Power", on page 257.

SCPI command:

[SENSe<Ch>:] POWer:ATTenuation

## Meas Bandwidth

Defines the bandwidth of the IF filter at the receiving port. The setting is identical with the "Channel > Power BW AVG > Bandwidth" setting; see chapter 4.4.1.2, "Power Bw Avg > Bandwidth", on page 260.

SCPI command:

[SENSe<Ch>:]BWIDth[:RESolution]

## Selectivity

Defines the selectivity of the IF filter of the receiving port. The setting is identical with the "Channel > Power BW AVG > Bandwidth" setting; see chapter 4.4.1.2, "Power Bw Avg > Bandwidth", on page 260.

SCPI command:

[SENSe<Ch>:]BWIDth[:RESolution]:SELect

## 4.4.4.11 Frequencies and Powers (Dialog)

The "Frequencies Powers" dialog defines the (frequency or power) sweep ranges for the lower tone. The frequency of the upper tone is equal to the lower tone frequency plus the "Tone Distance" defined in the "Define Intermodulation Measurement" dialog. Its power is equal to the lower tone power.

O Port 1 Lower Tone O Port 3 Upper Tone O Port 2 Lower IM3 Pr	3.009 MHz 8.5 GHz 3.009 MHz 8.5 GHz	
O Port 2 Lower IM3 Pr		
	9.009 MUS2 8.9 GHZ	
	od 9 kHz 8.497 GHz	
🕖 😨 Port 2 Upper IM3 Pro	od 3.009 MHz 8.5 GHz	

User Manual 1173.9163.02 - 13

# www.valuetronics.com

#### Start/Stop / Power/CW

The sweep range settings depend on the active sweep type (frequency or power sweep). The frequency and power settings for the lower tone are identical with the "Channel Stimulus" settings, see chapter 4.3, "Stimulus Settings", on page 254.

SCPI command:

```
[SENSe<Ch>:]FREQuency:STARt on page 753
[SENSe<Ch>:]FREQuency:STOP on page 753
[SENSe<Ch>:]FREQuency[:CW] on page 746
SOURce<Ch>:POWer<PhyPt>:STARt on page 819
SOURce<Ch>:POWer<PhyPt>:STOP on page 819
SOURce<Ch>:POWer<PhyPt>[:LEVel][:IMMediate][:AMPLitude]
on page 816
```

#### **Frequency Range**

The "Frequency Range" table shows the frequency ranges for the lower and upper tone and for the highest-order measured IM product, depending on the current frequency settings. E.g. the lower IM3 product is measured at the lower tone frequency minus the tone difference. An red background in the "Range" column indicates that the frequency range exceeds the upper or lower frequency limit of the analyzer.

#### **Fit Frequency Range**

If one of the ranges exceeds the analyzer limits, the "Fit Frequency Range" button restricts the lower tone sweep range so that the analyzer can measure all selected IM products.

#### 4.4.4.12 Intermodulation Power Calibration (Dialog)

The "Intermodulation Measurement Power Calibration" dialog controls the power calibration for the intermodulation measurement. A power calibration ensures accurate levels at the input of the DUT (source power calibration for the lower and upper tone) and an accurate power measurement of the intermodulation quantities (receiver calibration). The necessary calibration steps are automatically performed across the entire frequency or power range of the intermodulation measurement.



User Manual 1173.9163.02 - 13

#### Start Cal Sweep

Starts the intermodulation power calibration. An external combiner and a power meter are required for the calibration setup (see chapter 4.6.9, "External Power Meters (Dialog)", on page 436). The lower and upper tone source are combined via the external combiner.

The calibration is performed in three steps:

 Source power calibration for the lower tone signal. The external power meter is connected to the combiner output. It measures the source power at the calibration plane (input of the DUT). During the lower tone source power calibration, the upper tone is switched off.

If a frequency conversion measurement is active, a second source power calibration is performed at the converted lower tone frequency (receiver frequency). This second source power calibration is the basis for the receiver calibration in step 3.

- Source power calibration for the upper tone signal. The setup of step 1 is maintained. During the upper tone source power calibration, the lower tone is switched off. For frequency conversion measurements, no new source power calibration at the receiver frequency is performed.
- Receiver power calibration for the measured intermodulation product(s). The combiner output is connected to the receiving port. The receiving port is calibrated at the frequency of the intermodulation product(s) using the signal from the lower tone signal calibrated in the first step. If a frequency conversion measurement is active, a second receiver power calibration is performed at the converted lower tone frequency.

If a free analyzer or generator port is used for the receiver power calibration (see "Src for Rcvr Cal" on page 378), an additional source power calibration for this port is required. The additional calibration step is performed prior to step 3; the external power meter must be connected to the calibrated port.

The progress of the calibration is monitored in the calibration sweep diagram, in close analogy to an ordinary power sweep; see "Calibration Sweep Diagram" on page 304.

SCPI command:

SOURce<Ch>:POWer<PhyPt>:CORRection:IMODulation:LTONe[:ACQuire]
on page 802

SOURce<Ch>: POWer<PhyPt>: CORRection: IMODulation:UTONe[:ACQuire]
on page 804

SOURce<Ch>:POWer<PhyPt>:CORRection[:ACQuire]

[SENSe<Ch>:]CORRection:POWer<PhyPt>:IMODulation:ACQuire on page 727

#### Apply

Applies the power calibration results and closes the calibration wizard.

#### 4.4.4.13 Channel Config > Pwr Cal Settings

Provides access to all functions for power meter and power calibration data handling (transmission coefficients). The settings are identical with the "CHANNEL > CAL > Pwr Cal Settings" settings; see chapter 4.4.3.16, "Calibration > Pwr Cal Settings", on page 347.

#### 4.4.4.14 Channel Config > Mixer Mode

Controls the measurement of the mixing products generated by mixer under test (MUT) that is supplied with two independent RF signals. The scalar mixer mode is included in option R&S ZNB-K4. An extension to a two-stage mixer system is possible.



#### **Background information**

Refer to the following sections

- chapter 3.7.2.2, "Scalar Mixer Measurements (with option R&S ZNB-K4)", on page 119
- "Two-Stage Mixer Measurements" on page 119

Access: CHANNEL > CHANNEL CONFIG key or Alt + Shift + O



The calibration for the mixer mode can be performed with the SMARTerCal Wizard, see chapter 4.4.3.7, "SMARTerCal (Manual) Wizard", on page 318.



The "Mixer Mode" buttons open the following dialogs:

- Mixer Meas...: See chapter 4.4.4.15, "Mixer Meas (Dialog)", on page 382
- Generators...: See chapter 4.6.10, "External Generators (Dialog)", on page 438

#### **Reset Frequency Conversion**

"Reset Frequency Conversion" disables all frequency conversion measurements, including e.g. an active intermodulation measurement.

A "Mix" label in the channel list indicates that a mixer measurement is active.

Ch1 Mix Freq Channel Base Start 2 GHz Pwr -10 dBm Bw 10 kHz Stop 3 GHz

SCPI command: [SENSe<Ch>:]FREQuency:CONVersion

#### 4.4.4.15 Mixer Meas (Dialog)

The "Mixer Meas" dialog selects the test ports and configures the mixer input signals.



#### Background information

Refer to the following sections

- chapter 3.7.2.2, "Scalar Mixer Measurements (with option R&S ZNB-K4)", on page 119
  - "Two-Stage Mixer Measurements" on page 119

Access: CHANNEL > CHANNEL CONFIG > Mixer Mode > Mixer Meas...

Port 1 🖨			Mix	xer 1	Port 2  +) D Hz8,4999 GHz     -10 dBm
RF			100 kHz -25 dBm		AI.
Frequency Type	Powe		Multiplication Start/CW	Stop	
and the second s	RE	=	100 kHz	8.5 GHz	
Base Freq					
Base Freq Fixed	LO	\$	100 kHz		📄 2nd Mixer
		1	100 kHz 0 Hz	8.4999 GHz	Conversion

In the upper part the "Mixer" dialog shows a diagram with the RF and LO signals, the mixing product (IF), and the current frequency and power ranges for all signals. The diagram is adjusted according to the "2nd Mixer" selection; see "Two-Stage Mixer Measurements" on page 119.

In the lower part of the dialog the frequency and power settings are performed.

#### **Port Settings**

The port selection lists contain all analyzer ports or external generators which can provide the RF signal (left side) and local oscillator (LO) signals (lower signal(s)). The fractional numbers in the rectangles indicate the frequency conversion settings from the "Frequencies" tab. The receive port for the IF signal is selected on the right side of the diagram.

**Note:** If External Switch Matrices are part of the RF connection configuration, operation with Internal Second Source (R&S ZNB-B2) is *not* supported. In this case only external generators can be used as local oscillators.

Generators must be configured explicitly in the "External Generators" dialog (tap "Config Ext Generators...") before they appear in the list. "None" means that the input signal at LO (if available) is not controlled by the analyzer.

SCPI command:

```
[SENSe<Ch>:]FREQuency:CONVersion:MIXer:RFPort
[SENSe<Ch>:]FREQuency:CONVersion:MIXer:IFPort
[SENSe<Ch>:]FREQuency:CONVersion:MIXer:LOPort<Stg>
```

#### Frequency (table)

The "Frequency" tab controls the frequency of the RF and the LO signal(s) and the analyzer (IF signal) frequency.

Frequency	Power	Multiplication	
Туре	Port	Start/CW	Stop
Base Freq	RF	2 GHz	3 GHz
Fixed	LO   \$	GHz	
Auto	IF 🔤	1 GHz	2 GHz
Auto	IF   \$	1 GHz	2 GHz

The table in the "Frequency" tab contains the following columns:

- "Type" specifies how the frequency for each signal is defined. One of the mixer input and output signals is at the analyzer's channel base frequency ("Base Freq"; the signal is swept if a frequency sweep is active; it is at fixed frequency (CW) for the other sweep types). One or two signals are at "Fixed" frequencies. The last frequency or frequency range is calculated automatically ("Auto"), depending of the other dialog settings.
- "Port" assigns the input and output ports to the predefined port frequency types. The table contains one or two LO ports, depending on whether the "2nd Mixer" is selected.
- "Start/CW" defines the start frequencies or fixed frequencies at the ports with "Base Freq" or "Fixed" frequency type and overwrites the "STIMULUS" settings. For frequency sweeps, the "Base Freq" is the frequency sweep range.
- "Stop" defines the stop value of the frequency sweep range with "Base Freq" type (for frequency sweeps only).

SCPI command:

```
[SENSe<Ch>:]FREQuency:CONVersion:MIXer:FUNDamental
[SENSe<Ch>:]FREQuency:CONVersion:MIXer:MFFixed
[SENSe<Ch>:]FREQuency:STARt etc.
```

#### Power (table)

The "Power" tab defines the power of the RF and the LO signals.

Frequency Power Multiplication							
Port	Туре		Start/CW	Stop			
RF	Base Pwr	\$	-10 dBm				
LO	Fixed	¢	-25 dBm				
IF	Base Pwr	\$	-10 dBm				

The table in the "Power" tab contains the following columns:

- "Port" contains the RF and IF ports and one or two LO ports, depending on whether the "2nd Mixer" is selected.
- "Type" specifies how the power for each signal is defined. Each of the mixer input signals RF, LO 1, and LO 2 (if present, for ) can be either at the analyzer's channel base power ("Base Pwr"; the signal is swept if a power sweep is active; it is at fixed power (CW) for the other sweep types) or at the "Fixed" power. The same applies to the IF signal.
- "Start/CW" defines the output powers at the RF, LO 1 and LO 2 ports. The "Base Pwr" setting overwrites the power settings in the STIMULUS softtool panels: For power sweeps, "Base Pwr" is the power sweep range. For the other sweep types, it is the fixed "Power" value.

The "Fixed" power settings also appear in the"Port Configuration" dialog. The "Start/ CW" power for the IF port sets the IF source power for the reverse sweep. This setting is relevant only if a Load Match Correction is active.

"Stop" shows the stop value of the power sweep range (for power sweeps only).

If a segmented frequency sweep with segment-specific powers is active, the "Base Pwr" is no longer editable but set to the minimum and maximum power of the sweep segments.

SCPI command:

```
SOURce<Ch>:FREQuency:CONVersion:MIXer:PMODe
SOURce<Ch>:FREQuency:CONVersion:MIXer:PMFixed
```

## **Multiplication (table)**

Selects the frequency conversion factors for the RF and LO 1 /LO 2 signals.

Frequency	Power	Multiplication	2	

User Manual 1173.9163.02 - 13

Each conversion factor is ratio of two integer numbers. The frequency-converting device is considered to be part of the mixer system under test (MUT). In the default configuration where the RF signal is swept and the LO signals are at fixed frequency, the conversion factors do not modify the analyzer's source signals (RF, LO 1, LO 2); they are used for the calculation of the IF frequency only.

SCPI command:

[SENSe<Ch>:]FREQuency:CONVersion:MIXer:RFMultiplier [SENSe<Ch>:]FREQuency:CONVersion:MIXer:LOMultiplier<Stg>

#### 2nd Mixer

Selects the measurement for a test setup including two mixers (instead of a single one); see Two-Stage Mixer Measurements. The signal diagram and the other control elements in the dialog are adjusted accordingly.

SCPI command:

[SENSe<Ch>:]FREQuency:CONVersion:MIXer:STAGes

#### Conversion

Selects the frequency of the IF signal.

The output signal (IF signal) of each mixer can be at the sum or at the difference of the RF and LO input frequencies.

- IF = RF LO means that the RF signal is down-converted (upper sideband). The analyzer automatically switches to IF = LO – RF if the LO frequency is above the RF input frequency.
- IF = LO RF means that the LO signal is down-converted (lower sideband). The analyzer automatically switches to IF = RF – LO if the RF input frequency is above the LO frequency.
- IF = LO + RF means that the RF input signal is up-converted.

To perform measurements at different mixer output frequencies (e.g. to analyze the isolation for IF = RF or higher-order mixing products), use the "Define Port Settings" dialog (see chapter 4.4.4.4, "Define Port Settings (Dialog)", on page 363).

The basic formulas described above are adjusted to the mixer measurement settings:

- If the RF or one of the LO signals is in Auto mode (instead of IF), the formulas above are automatically converted. Example: LO 1 in Auto mode, down-conversion (lower sideband) --> LO 1 = IF + RF.
- IF = LO RF means that the LO signal is down-converted (lower sideband). The analyzer automatically switches to IF = RF – LO if the RF input frequency is above the LO frequency.
- If two mixer stages are present, the conversion formulas are applied twice; see Two-Stage Mixer Measurements.

SCPI command:

[SENSe<Ch>:]FREQuency:CONVersion:MIXer:TFRequency<Stg>

#### Config Ext Generators...

Opens the configuration dialog for external generators; see chapter 4.6.10, "External Generators (Dialog)", on page 438. Configured generators appear in the port selection lists for the LO signals.

#### ΟΚ

Activates the scalar mixer mode and closes the dialog. A "Mix" label in the channel list indicates that a mixer measurement is active.

Ch1 Mix Freq Channel Base Start 2 GHz Pwr -10 dBm Bw 10 kHz Stop 3 GHz

Reset Frequency Conversion disables the mixer measurement. SCPI command: [SENSe<Ch>:]FREQuency:CONVersion

## 4.4.5 Trigger

The "Trigger" menu provides trigger and sweep control settings.

#### 4.4.5.1 Trigger > Trigger

Selects the source of the trigger signal and provides additional trigger settings.

#### Trigger system of the analyzer

The trigger system is used to synchronize the analyzer's actions with events that can be provided by an internal or external signal or user-generated ("Manual Trigger"). Triggered measurements are an alternative to the default mode ("Free Run", "Continuous Sweep"), where the measurement is continuously repeated without fixed time reference.

Any trigger event may start an entire sweep or a part of it. Moreover, it is possible to switch off the RF source between consecutive triggered measurement sequences, and to define a delay between trigger events and the measurement sequences.

#### **Output trigger**

The R&S ZNB provides a configurable output trigger signal to synchronize external devices with the measurement. This signal is available at the rear panel connector EXT TRIG OUT. Configuration of the output trigger signal is a remote control feature (TRIGger:CHANnel<Ch>:AUXiliary... commands; see chapter 6.3.19, "TRIGger Commands", on page 857).



The trigger settings are also valid for calibration sweeps. This means that, in external trigger mode, the external trigger signal must be available during the system error correction, too. To start the calibration sweeps without delay, use the "Free Run" trigger type.

## **Background information**

Refer to chapter 3.1.4.1, "Partial Measurements and Driving Mode", on page 16.

Access:CHANNEL > TRIGGER key or Alt + Shift + R

**Channel Settings** 



#### Free Run / External / Manual / Multiple Triggers

The four buttons select the source of the trigger event:

 In "Free Run" mode a new measurement is started immediately without waiting for a trigger event and without fixed time reference. The remaining trigger settings are not valid.

"Free Run" means that a measurement in "Continuous Sweep" mode is repeated as fast as possible.

 In "External" trigger mode the measurement is triggered by an external 5 V TTL signal applied either to the BNC connector EXT TRIG IN or to pin 2 of the USER PORT connector at the rear panel. The two trigger inputs are equivalent; no additional setting for signal routing is required. For detailed specifications of the trigger signals refer to chapter 9.1.1.1, "USER PORT", on page 922.

The "External" trigger mode can be configured using the "Sequence" and "Slope / Level" settings.

**Note:** The period of the external trigger signal should be adjusted to the triggered measurement sequence. If the analyzer receives a trigger event while the last sequence is still running, the R&S ZNB skips the trigger event and generates a message.

- In "Manual" trigger mode the trigger signal is generated on selecting the "Manual Trigger" softkey.
- In "Multiple Trigger" mode the trigger sources for different triggered measurement sequences, the trigger slope, and the trigger delay can be selected individually using the "Trigger Manager" dialog. In particular, it is possible to use two different external trigger sources.


See also chapter 4.4.5.2, "Trigger Manager (Dialog)", on page 390.

#### SCPI command:

TRIGger<Ch>[:SEQuence]:SOURce on page 863

#### Sequence

Selects the measurement cycle or sequence of actions to be triggered.

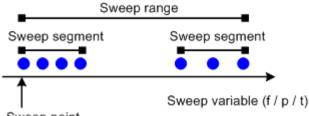

Sweep point

Measurement point comprising n partial measurements

- "Sweep" means that each trigger event starts an entire sweep, according to the current sweep configuration.
- "Point" means that each trigger event starts the measurement at the next sweep point.
- "Partial Measurement" means that each trigger event starts the next partial measurement at the current or at the next sweep point. If each measurement points requires only one partial measurement, this option is equivalent to "Point".
   See also chapter 3.1.4.1, "Partial Measurements and Driving Mode", on page 16.
- "Segment" means that each trigger event starts the next sweep segment within the current sweep. If a sweep type other than "Segmented Sweep" is active, this option is equivalent to "Sweep".

#### Relation with other sweep settings

Some sweep settings are logically incompatible with a particular selection of the triggered measurement sequence:

- If a "Time" sweep is performed, the sequence is always a sweep.
- "Alternate" sweep mode only makes sense if the triggered measurement sequence comprises more than one sweep point. If "Point" or "Partial Measurement" is selected, Alternate sweep mode is switched off and vice versa.

**Note:** The period of the trigger events should be adjusted to the triggered measurement sequence. If the analyzer receives a trigger event while the last sequence is still running, the R&S ZNB skips the trigger event and generates a message.

SCPI command:

TRIGger<Ch>[:SEQuence]:LINK

#### Delay

Specifies a delay time between the trigger event and the start of the measurement.

The Delay time entered must be zero or positive, so that the trigger event precedes the start of the measurement (post-trigger).

In "Multiple Trigger" mode the trigger delay can be selected individually using the "Trigger Manager" dialog. See chapter 4.4.5.2, "Trigger Manager (Dialog)", on page 390.

SCPI command:

TRIGger<Ch>[:SEQuence]:HOLDoff

#### Slope / Level

Specifies the "External" trigger mode in detail.

• **Rising Slope / Falling Slope** means that the rising or falling slope of every external trigger pulse can trigger a single measurement sequence.

 High Level / Low Level means that the analyzer performs a free run measurement as long as the external trigger signal is high / low. The measurement is discontinued when the trigger signal changes to low / high.

SCPI command:

TRIGger<Ch>[:SEQuence]:SLOPe

#### Manual Trigger

Generates the trigger event for "Manual" trigger mode (see Free Run / External / Manual / Multiple Triggers). "Manual Trigger" is disabled unless manual trigger mode is active.

SCPI command:

```
TRIGger<Ch>[:SEQuence]:SOURce on page 863 MANual
*TRG
```

## 4.4.5.2 Trigger Manager (Dialog)

The "Trigger Manager" dialog defines individual trigger sources and delays for the triggered measurement sequences. The settings are valid for "Multiple Trigger" mode. For detailed specifications of the trigger signals refer to chapter 9.1.1.1, "USER PORT", on page 922.



#### Background information

Refer to chapter 3.1.4.1, "Partial Measurements and Driving Mode", on page 16.

	Sequence 🔺	Source		Slope / Leve	1	Slope / Leve	12	Delay
ls.	Sweep	External 1	\$	Rising Slope	\$		=	0 s
2	Segment	Free Run	]\$		\$		=	0 s
3	Paint	External 2	=		\$	Rising Slope	\$	0 s
4	Partial Measurement	Free Run	1\$				#	0 s

Access: CHANNEL > TRIGGER > Trigger > Trigger Manager...

Fig. 4-16: Example of a multiple trigger configuration

The table in the "Trigger Manager" dialog contains several editable (white) or non-editable (gray) columns. All settings are analogous to the general trigger settings in the CHANNEL > TRIGGER > Trigger tab. Refer to the following sections:


- "Sequence" on page 388
- "Free Run / External / Manual / Multiple Triggers" on page 388
- "Slope / Level" on page 389
- "Delay" on page 389

#### Source / Slope / Level / Delay

The table defines all multiple trigger settings. The following trigger sources are available:

- Free Run selects an untriggered measurement sequence.
- **External 1** is the external trigger signal fed in at either the EXT TRIG IN connector on the rear panel or pin 2 of the USER PORT connector.
- External 2 is the external trigger signal fed in at pin 25 of the USER PORT connector on the rear panel.
- External 1 and 2 means that the measurement sequence is initiated after the analyzer has received an event from both external trigger signals.
- External 1 or 2 means that the measurement sequence is initiated after the analyzer has received an event from either external trigger 1 or external trigger 2.
- Manual means that the trigger event is generated manually, by selecting the "Manual Trigger" button in the "Trigger > Trigger" softtool.

In the example of figure 4-16 the sweep is triggered by an external trigger no. 1, while each sweep point is triggered by external trigger no. 2. With this multiple trigger configuration, the first trigger 1 event enables the overall sweep. The first trigger 2 event after the trigger 1 event initiates the measurement of the first sweep point, the second trigger 2 event initiates the measurement of the second sweep point and so on. Trigger 1 events are ignored until the last sweep point has been measured and the next sweep is started. In the figure below, dotted arrows depict ignored trigger events.

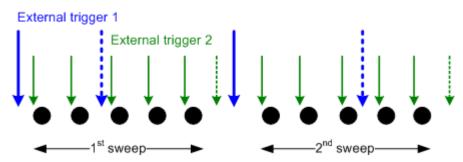

#### SCPI command:

TRIGger<Ch>[:SEQuence]:MULTiple:SOURce
TRIGger<Ch>[:SEQuence]:MULTiple:SLOPe<Num>
TRIGger<Ch>[:SEQuence]:MULTiple:HOLDoff

## 4.4.5.3 Trigger > Sweep Control

Selects the number of sweeps per measurement cycle. The settings are identical with the "Sweep > Sweep Control" settings; see chapter 4.4.2.5, "Sweep > Sweep Control", on page 276.

## 4.4.6 Offset Embed

The "Offset Embed" menu defines a length offset and a loss for the test ports. The offset parameters complement the system error correction, compensating for the known length and loss of a (non-dispersive and perfectly matched) transmission line between the calibrated reference plane and the DUT.

The "Offset Embed" menu also contains the functions for embedding/deembedding a DUT into/from a virtual matching network.



## **Background information**

Refer to the following sections:

- chapter 3.6, "Offset Parameters and Embedding", on page 100
- chapter 3.6.2, "Embedding and Deembedding", on page 106

#### 4.4.6.1 Offset Embed > Offset

Defines length offset parameters for each port.



The "Zero Delay at Marker" function overwrites the offset parameters.



# **Background information**

Refer to the following sections.

- chapter 3.6, "Offset Parameters and Embedding", on page 100
- chapter 3.6.1.1, "Definition of Offset Parameters ", on page 100
- chapter 3.6.1.3, "Auto Length", on page 101
- chapter 3.6.1.6, "Application and Effect of Offset Parameters ", on page 105
- chapter 3.6.1.7, "Offset Parameters for Balanced Ports", on page 106
- chapter 3.6.1.5, "Fixture Compensation ", on page 104

Access: CHANNEL > OFFSET EMBED key or Alt + Shift + Q

**Channel Settings** 



#### Port

Physical test port of the analyzer. You can define independent offset parameters for all ports.

SCPI command:

The <PhyPt> numeric suffix in the [SENSe<Ch>:]CORRection:... commands identifies the physical port.

#### Delay / Electrical Length / Mechanical Length

Defines the length offset at the selected port as a delay, an electrical length, or a mechanical length. The three quantities are related by:

$$Delay = \frac{L_{mech} \cdot \sqrt{\varepsilon_r}}{c}; \quad Electrical \ Length = L_{mech} \cdot \sqrt{\varepsilon_r}$$

and overwrite each other. See also chapter 3.6.1.1, "Definition of Offset Parameters ", on page 100.

**Note:** The entered parameters must correspond the actual (one-way) length of the transmission line. To account for the propagation in both directions, the phase shift of a reflection parameter due to a given length offset is twice the phase shift of a transmission parameter. For a numeric example see chapter 3.6.1.6, "Application and Effect of Offset Parameters", on page 105.

SCPI command:

```
[SENSe<Ch>:]CORRection:EDELay<PhyPt>[:TIME]
[SENSe<Ch>:]CORRection:EDELay<PhyPt>:ELENgth
[SENSe<Ch>:]CORRection:EDELay<PhyPt>:DISTance
```

#### Permittivity / Velocity Factor

Defines the permittivity ( $\epsilon_r$ ) and velocity factor of the dielectic in the transmission line between the reference plane and the DUT. The velocity factor is  $1/sqrt(\epsilon_r)$  and is a measure for the velocity of light in a dielectric with permittivity  $\epsilon_r$  relative to the velocity of light in the vacuum (velocity factor < 1). Permittivity and velocity factor are coupled parameters.


See also chapter 3.6.1.1, "Definition of Offset Parameters ", on page 100.

SCPI command:

[SENSe<Ch>:]CORRection:EDELay<PhyPt>:DIELectric


#### **Adjust Time Gate**

Activates the operating mode where the time gate is moved in the opposite direction when the "Delay" setting (or any other length offset parameter) is changed. The button is available if a time gate is active ("TRACE > TRACE CONFIG > Time Gate > Time Gate: On"). In time domain, a positive delay shifts the time gate to the left, a negative delay shifts it to the right.

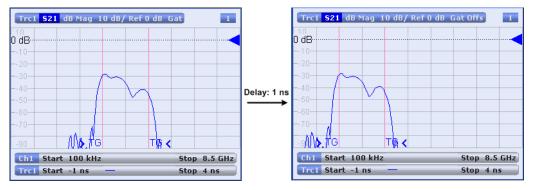


The position of the time gate is always relative to the end of the offset transmission line. As a consequence, "Adjust Time Gate" allows measurements at variable offset but fixed time gate position.

**Example:** The impedance of an antenna with possible faults is measured using a time gate and a variable length offset. If "Adjust Time Gate" is off, the time gate is at a constant distance from the the offset-corrected reference plane (end of the offset transmission line). Its absolute position is varied along with the length offset.

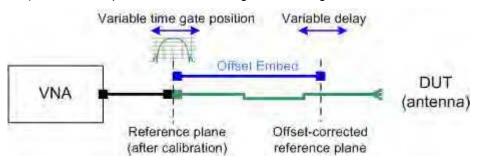

If "Adjust Time Gate" is on, the time gate is moved to left (right) when the offset-corrected reference plane is moved to the right (left). Its absolute position remains fixed. With this setting, it is possible e.g. to keep the time gate at the position of the antenna connector while the antenna is measured at different length offsets.

**Channel Settings** 

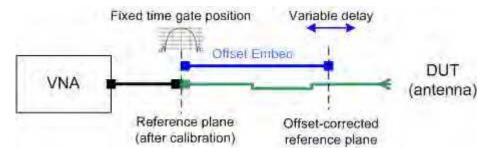

#### SCPI command:

CALCulate:FILTer[:GATE]:TIME:AOFFset

#### Auto Length

Adds an electrical length offset to the selected test port with the condition that the residual delay of the active trace (defined as the negative derivative of the phase response) is minimized across the entire sweep range. If "Delay" is the selected trace format, the entire trace is shifted in vertical direction and centered around zero. In phase format, the "Auto Length" corrected trace shows the deviation from linear phase.

If the measured quantity is a ratio, or if it is derived from a ratio, its receiving port is given as the index of the wave quantity in the numerator. If the active trace shows an S-parameter  $S_{ii}$ , then "Auto Length" adds a length offset at port i.

See also chapter 3.6.1.3, "Auto Length", on page 101.

SCPI command:
[SENSe<Ch>:]CORRection:EDELay<PhyPt>:AUTO

#### Reset Offsets

Resets all length offsets to zero.

SCPI command: n/a

#### **Fixture Compensation**

"Fixture Compensation" opens a submenu to correct the measurement result for the effects of a test fixture.

**Channel Settings** 



The "Fixture Compensation" dialog provides the following control elements:

- "Physical Port Selection" selects the ports where the analyzer performs a fixture compensation sweep in order to determine the compensation data.
- "Offset Correction" selects the type of compensation that the network analyzer calculates from the acquired compensation data. "Auto Length" or "Auto Length and Loss" implies that a global electrical length offset and loss is determined in analogy to the general offset compensation (see chapter 3.6.1.3, "Auto Length", on page 101 and chapter 3.6.1.4, "Auto Length and Loss", on page 102). With "Direct Compensation", a frequency-dependent transmission factor is calculated; see "Auto Length and Loss vs. Direct Compensation " on page 104.
- "Prompt for Measurement" interrupts the fixture compensation process after each fixture compensation sweep so that you can modify your test setup (e.g. terminate the next measured port). Disable "Prompt for Measurement" to perform all calibration sweeps without interruption.
- The "Open", "Short", and "Open and Short" buttons open the "Measure Fixture" dialog to start the fixture compensation sweeps for test fixture connections which are terminated with an open circuit, a short circuit, or both (Open and Short). See "Open / Short vs. Open and Short compensation" on page 104.

Tip: Remote control provides additional flexibility. You can:

- Measure the same port(s) repeatedly without changing the standards and attribute the results to different channels.
- Calculate the compensation data for different ports, using mixed Open and Short standards.

Refer to the program example for [SENSe<Ch>:]CORRection:COLLect: FIXTure[:ACQuire].

**Tip:** For further reference see chapter 3.6.1.5, "Fixture Compensation ", on page 104. SCPI command:

```
[SENSe<Ch>:]CORRection:COLLect:FIXTure[:ACQuire]
[SENSe<Ch>:]CORRection:COLLect:FIXTure:LMParameter:LOSS[:STATe]
[SENSe<Ch>:]CORRection:COLLect:FIXTure:LMParameter[:STATe]
```

#### Measure Fixture ← Fixture Compensation

The "Measure Fixture" dialog acts as a wizard for fixture compensation measurements, depending on the settings in the "Fixture Compensation" dialog. Proceed as indicated below the title bar. Press "Take" to start a fixture compensation sweep after establishing the required test setup.



#### SCPI command:

```
[SENSe<Ch>:]CORRection:COLLect:FIXTure:STARt
[SENSe<Ch>:]CORRection:COLLect:FIXTure[:ACQuire]
[SENSe<Ch>:]CORRection:COLLect:FIXTure:SAVE
```

#### 4.4.6.2 Offset Embed > One Way Loss

Defines loss parameters for each port.



## **Background information**

Refer to the following sections.

- chapter 3.6, "Offset Parameters and Embedding", on page 100
- chapter 3.6.1.2, "Definition of Loss Parameters ", on page 101
- chapter 3.6.1.4, "Auto Length and Loss", on page 102
- chapter 3.6.1.5, "Fixture Compensation ", on page 104

Access: CHANNEL > OFFSET EMBED key or Alt + Shift + Q

User Manual 1173.9163.02 - 13

**Channel Settings** 



For Fixture Compensation, see "Fixture Compensation" on page 395.

#### Port

Physical test port of the analyzer. You can define independent loss parameters for all ports.

SCPI command:

The <PhyPt> numeric suffix in the [SENSe<Ch>:]CORRection:... commands identifies the physical port.

#### Loss at DC / Loss at Freq / Freq for Loss

Defines the one-way loss parameters for the transmission line at the selected port. The loss can be modeled as the sum of a constant and a frequency-dependent part. The total loss is approximated by an expression of the following form:

$$Loss(f) = \left[Loss(f_{ref}) - Loss_{DC}\right] \sqrt{\frac{f}{f_{ref}} + Loss_{DC}}$$

This means that all three loss parameters enter into the calculation of the loss.

See also chapter 3.6.1.2, "Definition of Loss Parameters ", on page 101.

**Note:** The entered parameters define the loss for a signal traveling in one direction through the transmission line. To account for the propagation in both directions, the magnitude shift of a reflection parameter due to a given loss is twice the magnitude shift of a transmission parameter. See also chapter 3.6.1.6, "Application and Effect of Offset Parameters", on page 105.

SCPI command:

[SENSe<Ch>:]CORRection:LOSS<PhyPt>:OFFSet
[SENSe<Ch>:]CORRection:LOSS<PhyPt>
[SENSe<Ch>:]CORRection:LOSS<PhyPt>:FREQuency

#### Auto Length and Loss

Determines all offset parameters such that the residual group delay of the active trace (defined as the negative derivative of the phase response) is minimized and the measured loss is minimized as far as possible across the entire sweep range.

See also chapter 3.6.1.4, "Auto Length and Loss", on page 102.

**Note:** If "Auto Length and Loss" is used with a line connected to a test port, the end of the line should be left open.

SCPI command:
[SENSe<Ch>:]CORRection:LOSS<PhyPt>:AUTO

#### Reset Offsets

Resets the loss parameters to zero and the reference frequency to 1 GHz. SCPI command:

[SENSe<Ch>:]CORRection:OFFSet<PhyPt>[:STATe]

#### 4.4.6.3 Offset Embed > Physical Ports

Selects the physical (single-ended) analyzer ports for (de-)embedding: 2-port transformation networks can be numerically added or removed at the selected ports.

Access: CHANNEL > OFFSET EMBED key or Alt + Shift + Q



SCPI command:

The <PhyPt> numeric suffix in the embedding/deembedding commands identifies the physical port; see e.g. CALCulate<Ch>:TRANsform:VNETworks:SENDed: EMBedding<PhyPt>[:STATe].

#### 4.4.6.4 Offset Embed > Embed Single

Selects 2-port transformation networks for single port embedding, defines their parameters, assigns them to a port and enables embedding. 2-port networks can be applied to balanced (logical) as well as to single-ended (physical) ports.



#### Background information

Refer to the section chapter 3.6.2.3, "Combining Several (De-)Embedding Networks", on page 108.

Access: CHANNEL > OFFSET EMBED key or Alt + Shift + Q



#### Port

Physical test port of the analyzer. The transformation networks are defined such that the physical analyzer test port is connected to the left of the circuit; the DUT port is on the right side. You can define independent transformation networks for all ports.

SCPI command:

The <PhyPt> numeric suffix in the embedding/deembedding commands identifies the physical port; see e.g. CALCulate<Ch>:TRANsform:VNETworks:SENDed: EMBedding<PhyPt>[:STATe].

#### Networks

The graphical list contains all available 2-port networks.

The <u>symbol</u> selects "no network" and disables embedding. The "2-Port Data" network is defined by means of imported S-parameter data; see <u>Select File</u>.

The remaining networks are defined by lumped elements. Their parameters are displayed below the graphical list. See chapter 3.6.2.4, "Circuit Models for 2-Port Networks", on page 109.

**Tip:** Drag and drop the network symbols in horizontal or vertical direction to switch to the next symbol. The lumped elements are numbered from top to bottom.

SCPI command: CALCulate<Ch>:TRANsform:VNETworks:SENDed:EMBedding<PhyPt>[: STATe] CALCulate<Ch>:TRANsform:VNETworks:SENDed:EMBedding<PhyPt>: TNDefinition CALCulate<Ch>:TRANsform:VNETworks:SENDed:EMBedding<PhyPt>: PARameters:C<Cmp> CALCulate<Ch>:TRANsform:VNETworks:SENDed:EMBedding<PhyPt>: PARameters:L<Cmp> CALCulate<Ch>:TRANsform:VNETworks:SENDed:EMBedding<PhyPt>: PARameters:L<Cmp> CALCulate<Ch>:TRANsform:VNETworks:SENDed:EMBedding<PhyPt>: PARameters:R<Cmp>

#### Select File

"Select File..." is enabled as long as the "2-Port Data" network is selected. This network is defined by its S-parameters stored in a two-port Touchstone file (\*.s2p). No additional parameters are required.

In case the port number conventions of the loaded two-port Touchstone file differ from network analyzer conventions (see description of Port), it is possible to "Switch Gates". The analyzer will interchange the port numbers (e.g.  $S_{12} \rightarrow S_{21}$ ) when loading the file.

**Note:** The loaded file is stored in the active recall set. Recall sets contain the full (de-)embedding data so that they can be transferred to other instruments.

SCPI command:

MMEMory:LOAD:VNETworks<Ch>:SENDed:EMBedding<PhyPt>

#### 4.4.6.5 Offset Embed > Deembed Single

Selects 2-port transformation networks for single port deembedding, defines their parameters, assigns them to a port and enables deembedding. 2-port networks can be applied to balanced (logical) as well as to single-ended (physical) ports.



#### **Background information**

Refer to the section chapter 3.6.2.3, "Combining Several (De-)Embedding Networks", on page 108.

Access: CHANNEL > OFFSET EMBED key or Alt + Shift + Q

User Manual 1173.9163.02 - 13

**Channel Settings** 



#### Port

Physical test port of the analyzer. The transformation networks are defined such that the physical analyzer test port is connected to the left of the circuit; the DUT port is on the right side. You can define independent transformation networks for all ports.

#### SCPI command:

The <PhyPt> numeric suffix in the embedding/deembedding commands identifies the physical port; see e.g. CALCulate<Ch>: TRANsform: VNETworks: SENDed: DEEMbedding<PhyPt>[:STATe].

#### Networks

The graphical list contains all available 2-port networks.

The symbol selects "no network" and disables deembedding. The "2-Port Data" network is defined by means of imported S-parameter data; see Select File.

The remaining networks are defined by lumped elements. Their parameters are displayed below the graphical list. See chapter 3.6.2.4, "Circuit Models for 2-Port Networks", on page 109.

**Tip:** Drag and drop the network symbols in horizontal or vertical direction to switch to the next symbol. The lumped elements are numbered from top to bottom.

#### SCPI command:

CALCulate<Ch>:TRANsform:VNETworks:SENDed:DEEMbedding<PhyPt>[: STATe] CALCulate<Ch>:TRANsform:VNETworks:SENDed:DEEMbedding<PhyPt>: TNDefinition CALCulate<Ch>:TRANsform:VNETworks:SENDed:DEEMbedding<PhyPt>: PARameters:C<Cmp> CALCulate<Ch>:TRANsform:VNETworks:SENDed:DEEMbedding<PhyPt>: PARameters:L<Cmp> CALCulate<Ch>:TRANsform:VNETworks:SENDed:DEEMbedding<PhyPt>: PARameters:L<Cmp> CALCulate<Ch>:TRANsform:VNETworks:SENDed:DEEMbedding<PhyPt>: PARameters:R<Cmp>

#### Select File

"Select File..." is enabled as long as the "2-Port Data" network is selected. This network is defined by its S-parameters stored in a two-port Touchstone file (\*.s2p). No additional parameters are required.

In case the port number conventions of the loaded two-port Touchstone file differ from network analyzer conventions (see description of Port), it is possible to "Switch Gates". The analyzer will interchange the port numbers (e.g.  $S_{12} \rightarrow S_{21}$ ) when loading the file.

**Note:** The loaded file is stored in the active recall set. Recall sets contain the full (de-)embedding data so that they can be transferred to other instruments.

SCPI command:

MMEMory:LOAD:VNETworks<Ch>:SENDed:DEEMbedding<PhyPt>

#### 4.4.6.6 Offset Embed > Balanced Ports

Selects the balanced analyzer ports for (de-)embedding: 4-port transformation networks can be numerically added or removed at the selected ports. Balanced ports must be defined using the "Balanced Ports" dialog before they can be selected. To access the dialog press the corresponding button.



#### Background information

Refer to the following sections:

- chapter 3.3.5, "Unbalance-Balance Conversion", on page 53
- chapter 4.2.1.3, "Balanced Ports (Dialog)", on page 154

Access: CHANNEL > OFFSET EMBED key or Alt + Shift + Q



SCPI command:

The <LogPt> numeric suffix in the embedding/deembedding commands identifies the logical port;; see e.g. CALCulate<Ch>: TRANsform: VNETworks: BALanced: EMBedding<LogPt>[:STATe].


#### 4.4.6.7 Offset Embed > Embed Balanced

Selects 4-port transformation networks for balanced port embedding, defines their parameters, assigns them to a port and enables embedding. 4-port networks can be applied to balanced (logical) ports only.



#### **Background information**

Refer to the section chapter 3.6.2.3, "Combining Several (De-)Embedding Networks", on page 108.

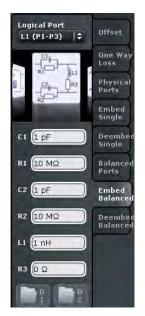

#### Access: CHANNEL > OFFSET EMBED key or Alt + Shift + Q

#### Logical Port

Logical analyzer port, as defined in the "Balanced Ports" softtool tab. The transformation networks are defined such that the physical analyzer test ports are connected to the left of the circuit; the DUT ports are on the right side. You can define independent transformation networks for all logical ports.

#### SCPI command:

The <LogPt> numeric suffix in the embedding/deembedding commands identifies the logical port; see e.g. CALCulate<Ch>: TRANsform: VNETworks: BALanced: EMBedding<LogPt>[:STATe].

#### Networks

The graphical list contains all available 4-port networks.

The symbol selects "no network" and disables embedding. The "D1" and "D2" networks are defined by means of imported S-parameter data; see D1, D2.

The remaining networks are defined by lumped elements. Their parameters are displayed below the graphical list. See chapter 3.6.2.5, "Circuit Models for 4-Port Networks", on page 110.

**Tip:** Drag and drop the network symbols in horizontal or vertical direction to switch to the next symbol. The lumped elements and S-parameter networks ("D1", "D2") are numbered from top to bottom.

#### SCPI command:

CALCulate<Ch>:TRANsform:VNETworks:BALanced:EMBedding<LogPt>[: STATe] CALCulate<Ch>:TRANsform:VNETworks:BALanced:EMBedding<LogPt>: TNDefinition CALCulate<Ch>:TRANsform:VNETworks:BALanced:EMBedding<LogPt>: PARameters:C<Cmp> CALCulate<Ch>:TRANsform:VNETworks:BALanced:EMBedding<LogPt>: PARameters:L<Cmp> CALCulate<Ch>:TRANsform:VNETworks:BALanced:EMBedding<LogPt>: PARameters:L<Cmp>

#### D1, D2

The "D1" and "D2" buttons are enabled as long as a four-port network involving two-port or four-port S-parameter data is selected. The networks are defined by their S-parameters stored in a four-port or two-port Touchstone file (\*.s4p, \*.s2p). No additional parameters are required.

In case the port number conventions of the loaded Touchstone file differ from network analyzer conventions (see description of Port), it is possible to "Switch Gates". The analyzer will interchange the port numbers (e.g.  $S_{12} \rightarrow S_{21}$ ) when loading the file.

**Note:** The loaded file is stored in the active recall set. Recall sets contain the full (de-)embedding data so that they can be transferred to other instruments.

SCPI command:

MMEMory:LOAD:VNETworks<Ch>:BALanced:EMBedding<LogPt>

#### 4.4.6.8 Offset Embed > Deembed Balanced

Selects 4-port transformation networks for balanced port deembedding, defines their parameters, assigns them to a port and enables deembedding. 4-port networks can be applied to balanced (logical) ports only.



#### **Background information**

Refer to the section chapter 3.6.2.3, "Combining Several (De-)Embedding Networks", on page 108.

Access: CHANNEL > OFFSET EMBED key or Alt + Shift + Q

User Manual 1173.9163.02 - 13

**Channel Settings** 



#### Logical Port

Logical analyzer port, as defined in the "Balanced Ports" softtool tab. The transformation networks are defined such that the physical analyzer test ports are connected to the left of the circuit; the DUT ports are on the right side. You can define independent transformation networks for all logical ports.

SCPI command:

The <LogPt> numeric suffix in the embedding/deembedding commands identifies the logical port; see e.g. CALCulate<Ch>: TRANsform: VNETworks: BALanced: DEEMbedding<LogPt>[:STATe].

#### Networks

The graphical list contains all available 4-port networks.

The <u>symbol</u> selects "no network" and disables deembedding. The "D1" and "D2" networks are defined by means of imported S-parameter data; see D1, D2.

The remaining networks are defined by lumped elements. Their parameters are displayed below the graphical list. See chapter 3.6.2.5, "Circuit Models for 4-Port Networks", on page 110.

**Tip:** Drag and drop the network symbols in horizontal or vertical direction to switch to the next symbol. The lumped elements and S-parameter networks ("D1", "D2") are numbered from top to bottom.

#### SCPI command:

CALCulate<Ch>:TRANsform:VNETworks:BALanced:DEEMbedding<LogPt>[: STATe] CALCulate<Ch>:TRANsform:VNETworks:BALanced:DEEMbedding<LogPt>: TNDefinition CALCulate<Ch>:TRANsform:VNETworks:BALanced:DEEMbedding<LogPt>: PARameters:C<Cmp> CALCulate<Ch>:TRANsform:VNETworks:BALanced:DEEMbedding<LogPt>:

PARameters:L<Cmp> CALCulate<Ch>:TRANsform:VNETworks:BALanced:DEEMbedding<LogPt>:

PARameters:R<Cmp>

#### D1, D2

The "D1" and "D2" buttons are enabled as long as a four-port network involving two-port or four-port S-parameter data is selected. The networks are defined by their S-parameters stored in a four-port or two-port Touchstone file (\*.s4p, \*.s2p). No additional parameters are required.

In case the port number conventions of the loaded Touchstone file differ from network analyzer conventions (see description of Logical Port), it is possible to "Switch Gates". The analyzer will interchange the port numbers (e.g.  $S_{12} \rightarrow S_{21}$ ) when loading the file.

**Note:** The loaded file is stored in the active recall set. Recall sets contain the full (de-)embedding data so that they can be transferred to other instruments.

SCPI command:

MMEMory:LOAD:VNETworks<Ch>:BALanced:DEEMbedding<LogPt>

# 4.5 Display Settings

The "Display" menu provides all display settings and the functions for activating, modifying and arranging different diagrams.



## **Related information**

Refer to the following sections:

- chapter 3.1.3, "Traces, Channels and Diagrams", on page 13
- chapter 3.2.2, "Display Elements in the Diagram", on page 25
- See chapter "Operating the Instrument > Handling Diagrams, Traces, and Markers" in the Help system or in the R&S ZNB Getting Started guide.

# 4.5.1 Display > Diagram

Selects a diagram as the active diagram, defines a title, deletes or adds diagrams and arranges them on the screen. Many of the functions are unavailable if the active recall set contains only one diagram.



## **Related settings**

Use the icons in the toolbar to add diagrams and traces. Use the "Zoom Active Trc" icon to zoom into a rectangular portion inside a diagram. See also chapter "Operating the Instrument > Handling Diagrams, Traces, and Markers" and "Using the Graphic Zoom" in the Help system or in the R&S ZNB Getting Started guide.

Access: SYSTEM > DISPLAY key or Alt + Shift + S



#### Active Diagram

Selects the active diagram.

Each recall set screen can display several diagrams simultaneously, each with a variable number of traces. One of these diagrams and traces is active at each time. The diagram number in the upper right corner of the active diagram is highlighted. At the same time the active trace is highlighted in the trace list on top of the active diagram (Trc3 in the figure below):

 Trc1
 S21
 dB Mag
 Trc3
 S21
 dB Mag

 Trc4
 S21
 dB Mag
 Trc5
 S21
 dB Mag

The analyzer provides several tools for activating diagrams:

- tap on a point in the diagram to activate the diagram including the last active trace in the diagram.
- tap on a trace list to activate the trace including the corresponding diagram.

Some of the functions of the "TRACE > TRACE CONFIG > Traces" tab activate a
particular trace including the corresponding diagram.

SCPI command:

The numeric suffix <Wnd> appended to the DISPlay:WINDow<Wnd>:... commands selects a diagram area.

#### Add Tr+Diag

Creates a new diagram and a new trace which is displayed in the new diagram. The trace is created with the channel settings of the previous active trace but with default trace settings. The new diagram area is numbered <n>, where <n> is the largest of all existing diagram area numbers plus one.

Tip: The function of the "Add Trace" icon in the toolbar is similar to "Add Tr+Diag".

SCPI command:

DISPlay[:WINDow<Wnd>]:STATe ON

#### **Delete Diagram**

Deletes the current diagram area including all traces displayed in the diagram area. The remaining diagrams are re-numbered; each recall set always contains diagrams with contiguous numbers. "Delete Diag Area" is disabled if the recall set contains only one diagram area: In manual control, each recall set must contain at least one diagram area with one channel and one trace.

Tip: To restore a diagram area that was unintentionally deleted, use "SYSTEM > UNDO".

SCPI command: DISPlay[:WINDow<Wnd>]:STATe OFF

#### Maximize

The toggle icons below "Maximize" arrange all diagrams in tiles or maximize the active diagram with all traces to occupy the whole screen.



For other split types use the functions in the "Split" tab.

SCPI command:

DISPlay[:WINDow<Wnd>]:MAXimize on page 618

#### Title

Defines a title and shows it in the active diagram. The title may comprise a practically unlimited number of characters and is centered in a line below the top of the diagram area.

**Display Settings** 



#### SCPI command:


# DISPlay[:WINDow<Wnd>]:TITLe:DATA DISPlay[:WINDow<Wnd>]:TITLe[:STATe]

In remote control, it is also possible to define a diagram name, and to retrieve lists of diagram areas and traces:

DISPlay[:WINDow<Wnd>]:NAME DISPlay[:WINDow<Wnd>]:CATalog? DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:CATalog?

#### **Overlay All**

Places all traces in a single diagram area which is maximized to occupy the whole screen. This function is available irrespective of the trace format and the channel settings; it is even possible to overlay Cartesian and polar diagrams.

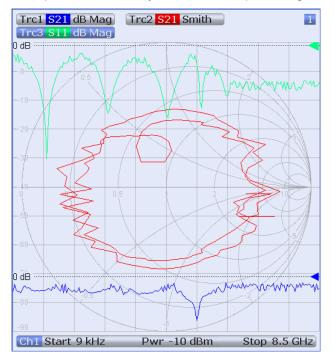

The active trace and active channel is highlighted. The scaling of the axes corresponds to the active trace.


**Tip:** To hide all traces except the active one, select "Split All" and tap and hold to maximize the active diagram.

SCPI command:

No command; display configuration only.

#### Split All

Splits the active window into as many diagrams as there are traces and assigns a single trace to each area.

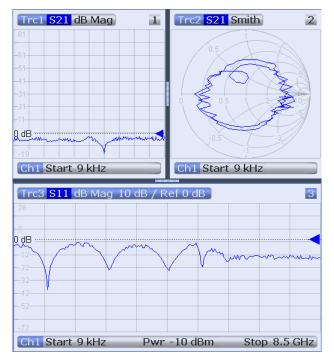

**Tip:** To vary the size and position of the diagram areas, drag and drop the separating frames or use the functions in the "Split" tab.

SCPI command:

No command; display configuration only.

#### Additional Functionality: Zoom Active Trc

The "Zoom Active Trc" icon in the toolbar magnifies a rectangular portion of the diagram (zoom window) to fill the entire diagram area. See also chapter 4.2.3.3, "Scale > Zoom", on page 191 or chapter "Operating the Instrument > Using the Graphic Zoom" in the Help system or in the R&S ZNB Getting Started guide.



SCPI command:

```
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM:BOTTom
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM:STARt
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM:STOP
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM:TOP
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM[:STATe]
```

**Display Settings** 

# 4.5.2 Display > Split

Arranges different diagrams on the screen.

Access: SYSTEM > DISPLAY key or Alt + Shift + S




Some of the "Split" settings are also available in the "Display > Diagram" tab. Refer to the following sections:

- "Overlay All" on page 410
- "Split All" on page 411

#### Dual Split / Triple Split / Quad Split

Splits the window into two (three / four) diagrams and distributes the traces among the diagrams, separating diagrams with different trace format and channel settings (e.g. Cartesian and polar diagrams), if possible. Example of four traces in "Quad Split" display:

**Display Settings** 

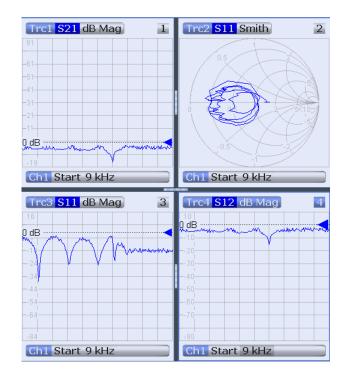

If less than two (three / four) traces are available, the new diagrams are created with a default trace. Dual (triple / quad) split corresponds to "Split Type: Tile Horizontal" with 2 (3 / 4) diagrams.

**Tip:** To vary the size and position of the diagrams, drag and drop the separating frames or use the functions in the "Diagram" tab.

SCPI command:

No command; display configuration only.

#### Split Type / Diagrams / Rows / Columns

Arranges the diagrams in rows or columns and distributes the traces among the selected number of "Diagrams". The R&S ZNB provides the following split types:

- Lineup: The diagrams are arranged side by side; each diagram occupies the entire screen height.
- **Stack:** The diagrams are arranged one on top of the other; each diagram occupies the entire screen width.
- Tile horizontal: The diagrams are arranged in horizontal rows. With 2 (3 / 4) diagrams, the result is equivalent to Dual Split (Triple Split / Quad Split); see "Dual Split / Triple Split / Quad Split" on page 412.
- Tile vertical: The diagrams are arranged in vertical rows.
- Rows + Columns: The diagrams are arranged as a rectangular matrix. The number of rows and columns is as defined in the corresponding input fields.

If the selected number of "Diagrams" exceeds the number of traces, some of the new diagrams are created with a default trace.

**Tip:** To vary the size and position of the diagrams, drag and drop the separating frames or use the functions in the "Diagram" tab.

SCPI command: DISPlay:LAYout DISPlay:LAYout:GRID

#### Additional Functionality: SCPI Commands

The analyzer provides remote control commands for efficient diagram handling. The commands listed below extend the functionality of the "Display > Diagram" and "Display > Split" softtool panels. For programming examples refer to chapter 7.2.2.6, "Creating Diagrams", on page 904.

SCPI command:

DISPlay:LAYout:APPLy DISPlay:LAYout:DEFine DISPlay:LAYout:EXECute DISPlay:LAYout:JOIN

# 4.5.3 Display > Config

Displays or hides controls and information elements of the screen and controls the appearance of the individual diagrams.

Hiding the controls and information elements leaves more space for the diagrams. All elements may be shown or hidden simultaneously.



## Related information

Refer to chapter 3.2.2, "Display Elements in the Diagram", on page 25

Display	X
Color Scheme Light Backgro	Diagram
Define User Color	Split
Frequency Info	Config
Channel Info	View Bar
Trace Info	
Info Table	
Show	t,
Position	
Bottom 😂	
Font Size	
100 %	

Access: SYSTEM > DISPLAY key or Alt + Shift + S

User Manual 1173.9163.02 - 13

#### **Color Scheme**

Controls the colors in the diagram areas. Color schemes are global settings and apply to all active recall sets.

The following predefined color schemes are optimized for the analyzer screen and for color hardcopies, respectively:

- "Dark Background" sets a black background color. The traces and information elements in the diagram areas are displayed in different colors. This setting is usually suitable for observing results on the analyzer screen.
- "Light Background" sets a light background color. The traces and information elements in the diagram areas are displayed in different colors. This setting is suitable for generating color hardcopies of the screen. All example images in this user documentation are based on this color scheme.

The following predefined color schemes can be appropriate for generating black and white hardcopies of the screen:

- "Black and White Line Styles" sets a white background color. All traces and information elements in the diagram areas are black, however, the traces are drawn in different line styles.
- "Black and White Solid" sets a white background color. All traces and information elements in the diagram areas are black. All traces are drawn with solid lines.

"User Define..." opens a dialog to modify the predefined schemes, changing the colors and styles of the individual display elements. See chapter 4.5.4, "Define User Color Scheme (Dialog)", on page 416.

SCPI command:

# SYSTem:DISPlay:COLor

#### Frequency Info

Shows or hides all frequency stimulus values in the diagrams. This comprises:

- The frequency stimulus ranges below the diagram area, if a frequency sweep is active.
- The CW frequency in the center below the diagram area, if a power, time or CW mode sweep is active.
- The frequency stimulus values in the marker info field and at the marker position.

SCPI command:

DISPlay:ANNotation:FREQuency[:STATe]

#### **Channel Info**

Shows or hides the channel lists in the lower part of the diagrams.

Ch1 Start 100 kHz —	Pwr -10 dBm Bw 10 kHz	Stop 3 GHz
Ch2 Start 100 kHz —	Pwr -10 dBm Bw 10 kHz	Stop 3 GHz
Ch3 Freq 1 GHz 🗕	Pwr -10 dBm Bw 10 kHz	Stop 1 s
Ch4 Start 100 kHz	Pwr -10 dBm Bw 10 kHz	Stop 3 GHz
Trc4 Start -1 ns —	Time Domain	Stop 4 ns

#### SCPI command:

DISPlay:ANNotation:CHANnel[:STATe]

#### **Trace Info**

Shows or hides the trace lists in the upper part of the diagrams.

Trc1 S21 dB Mag 🛛 🚺	Frc3 S21 dB Mag
Trc4 S21 dB Mag 1	Frc5 S21 dB Mag

SCPI command:

DISPlay:ANNotation:TRACe[:STATe]

#### Info Table / Position

Shows or hides the info table. The info table is a possible container for the marker info fields and may be placed to the bottom, to the left, or to the right of the screen. See also chapter 4.2.6.8, "Marker > Info Field", on page 254.

	M1	Trc1	5.100040	GHz	-15.2736	dB	Bandstop Trc1	Ref to Max	Track
	M2	Trc1	4.568776	GHz	-4.7532	dB	Bandwidth	991.256235	MHz
٠	M3	Trc1	5.560033	GHz	-4.7532	dB	Center	5.040094	GHz
	M4	Trc1	5.040094	GHz	-11.1110	dB	Lower Edge	4.568776	GHz
							Upper Edge	5.560033	GHz
							Quality Factor	5.085	U
							Loss	15.2736	dB

SCPI command: No command; display configuration only.

#### Font Size

Selects the font size of all textual information elements in the diagrams. This comprises the trace and channel lists, and the marker info fields.

SCPI command: DISPlay:RFSize

## 4.5.4 Define User Color Scheme (Dialog)

The "Define User Color Scheme" dialog modifies the predefined color schemes, changing the colors and styles of the individual display elements. User-defined color schemes can be saved to a file for later re-use.



## Related settings

Refer to "Color Scheme" on page 415

Access:SYSTEM > DISPLAY > Config > User Define ...

**Display Settings** 



#### Element

Selects the screen element to be modified. The list contains the background and all traces, text elements and lines in the diagrams.

#### SCPI command:

The <DispEl> suffix in the DISPlay:CMAP<DispEl>... commands identifies the screen element. See DISPlay:CMAP<DispEl>:RGB.

#### **Properties**

Configures the selected screen element.

- "Color" opens a standard color dialog where you can assign a color to the selected element.
- "Trace Line Style" and "Trace Line Width" are enabled if the selected element is a trace.

SCPI command:

DISPlay:CMAP<DispEl>:RGB DISPlay:CMAP:TRACe:RGB

#### Limit Test > Show Limit Fail Symbols

Displays or hides the colored squares on the trace indicating failed measurement points. Hide the squares if they cover too much of the trace. Instead of using the limit fail symbols, you can colorize the trace to highlight failed trace sections.

SCPI command: DISPlay:CMAP:LIMit:FSYMbol[:STATe]

### Limit Test > Colorize Trace when Failed

Assigns a different trace color to failed trace segments. The different color reaches from the last passed measurement point before the start of the failed segment to the last failed measurement point in the segment. This means that the beginning of the colorized trace is possibly outside the failed range.

The example below shows a lower limit line at -10 dB. Due to the rule described above, a marker placed on the colorized ("failed") trace point at 5.004050 GHz stil indicates a response value within the allowed range (-9.7222 dB > -10 dB).



SCPI command:

DISPlay:CMAP:LIMit:FCOLorize[:STATe]

#### Limit Test > Use Trc Color for Limit Lines

Assigns the trace color to all limit line segments associated with the trace. All other limit line color definitions are ignored.

SCPI command:

DISPlay:CMAP:LIMit[:STATe]

#### General > Trace Colors per Diagram

Controls the color of traces that are moved to another diagram or created together with a new diagram. If "Trace Colors per Diagram" is disabled while different diagrams are defined, the colors of all traces become different.

The R&S ZNB assigns trace colors according to a predefined scheme, starting with the colors that are easiest to distinguish. On one hand it is advantageous to use the colors at the beginning of the scheme. On the other hand, it is often desirable to use different colors in different diagram areas so that any trace that is moved from one diagram area to another can keep its color. "Trace Colors per Diagram" changes between these two alternative color modes as shown below.

Trace Colors per Diagram	Move trace to another dia- gram area (Trace Manager)	Add Tr+Diag (SYSTEM > DISPLAY > Diagram)
On	Trace color changed according to the new diagram area's color scheme	Color scheme of the new diagram area is independent, restarts with the first colors. Consequently the new trace is displayed with a color that has been already used.
Off	Trace keeps its color	Color scheme of the new diagram area continues color scheme of the previously active area. The new trace is dis- played with a new color.

See also program example for DISPlay: CMAP: TRACe: COLor[:STATe].

SCPI command:

DISPlay:CMAP:TRACe:COLor[:STATe]

#### General > Same Color all Markers

Selects a common marker color, which is independent of the trace colors.

SCPI command: DISPlay:CMAP:MARKer[:STATe]

#### General > Black White Scheme / Line Styles Scheme / Light Sheme

Modifies the user color scheme, in particular the trace and channel lines, in a predefined way. As an alternative, select predefined color schemes; see "Color Scheme" on page 415.

SCPI command: DISPlay:CMAP<DispEl>:RGB

#### **Recall / Save**

Opens standard dialogs to recall a previously saved color scheme or save the current scheme to a file. Color scheme files are non-editable files with the extension \*.ColorScheme; the default directory is

C:\Users\Public\Documents\Rohde-Schwarz\Vna\ColorSchemes.

SCPI command:

MMEMory:STORe:CMAP MMEMory:LOAD:CMAP

## 4.5.5 Display > View Bar

Displays or hides information panels and bars of the graphical user interface. Hiding the information elements leaves more space for the diagrams. All elements may be shown or hidden simultaneously.

Access: SYSTEM > DISPLAY key or Alt + Shift + S



For a detailed description of the information elements refer to the following sections:

- chapter 3.2.1.4, "Menu Bar", on page 22
- chapter 3.2.1.7, "Status Bar", on page 24
- chapter 3.2.1.6, "Hardkey Panel", on page 24
- chapter 3.2.1.1, "Title Bar", on page 21
- chapter 3.2.1.2, "Toolbar", on page 21

SCPI command:

User Manual 1173.9163.02 - 13

# www.valuetronics.com

```
SYSTem:DISPlay:BAR:MENU[:STATe]
SYSTem:DISPlay:BAR:STATus[:STATe]
SYSTem:DISPlay:BAR:HKEY[:STATe]
SYSTem:DISPlay:BAR:TITLe[:STATe]
SYSTem:DISPlay:BAR:TOOLs[:STATe]
See also: SYSTem:DISPlay:BAR:STOOls[:STATe]
```

## 4.5.6 Display > Touchscreen

Locks the touchscreen functionality of the R&S ZNB in order to prevent inadvertent entries.

```
Access: SYSTEM > DISPLAY key or Alt + Shift + S
```



- "Enabled" touchscreen control of the R&S ZNB fully enabled. All control elements are active.
- Lock diagrams drag and drop functions in the diagrams are disabled, all other control elements (e.g. the softtool panels) are still active.
- Lock screen all control elements are locked. Pressing any front panel key on the analyzer (or sending SYSTem: TSLock OFF) re-enables touchscreen control.

SCPI command:

SYSTem:TSLock

## 4.6 System Settings

The "System" menu provides functions which you can use to to return to a defined instrument state, reverse operations, access service functions and define various systemrelated settings.

## 4.6.1 System > Setup > Setup

Gives access to system-related settings and service functions and selects the language of the graphical user interface.

Access: SYSTEM > SETUP key or Alt + Shift + T



The "Setup" buttons open the following dialogs:

- System Config: See chapter 4.6.2, "System Configuration (Dialog)", on page 421
- Options: See chapter 4.6.3.2, "Options", on page 428
- Info: See chapter 4.6.3, "Info (Dialog)", on page 427
- Service Function: See chapter 4.6.4, "Service Function (Dialog)", on page 429

#### Language

Selects the language of the graphical user interface. A message box indicates that the vector network analyzer application needs to be re-started to activate a different language.

English is the preinstalled language. A setup file for additional languages ("Vector Network Analyzer Translation Setup") is available for download from Rohde & Schwarz.

SCPI command: n/a

## 4.6.2 System Configuration (Dialog)

The "System Configuration" dialog modifies the predefined color schemes, changing the colors and styles of the individual display elements. User-defined color schemes can be saved to a file for later reuse.



## Global settings

The "System Config" settings are global settings. They are not affected by an instrument reset. See chapter 3.1.1, "Global (Persistent) Settings", on page 12.

Access: SYSTEM > SETUP > Setup > System Config...

### 4.6.2.1 Presets

 System Config.

 Presets
 Colibration
 User Interface
 Channel Bits

 Preset Scope
 Remote Preset Configuration
 Global Settings

 Instrument
 Active Setup
 Image: Set Printer Page Setup

 Preset Configuration
 Corrent User Preset File
 Set Factory Preset

 Image: Set Printer Preset File
 Image: Set Preset Preset Preset Preset

 Image: Set Preset Preset File
 Image: Set Preset Preset Preset Preset Preset

Specifies the behavior of the R&S ZNB upon a preset.

#### **Preset Scope**

Qualifies whether a preset affects all open recall sets ("Instrument") or the active recall set only.

SCPI command: SYSTem:PRESet:SCOPe

#### **Remote Preset Configuration**

"Align \*RST to User Defined Preset" defines the behavior of the \*RST and SYSTem: PRESet commands.

- Off: \*RST and SYSTem: PRESet restore the factory preset settings.
- On: If a valid user preset file is available, \*RST and SYSTem: PRESet restore the user-defined settings.

SCPI command: n/a

#### **Global Settings**

The two buttons reset all directory settings (e.g. the directories for storing trace data, limit lines, calibration data...) and all settings in the "Printer Setup" dialog to default values. See "Print..." on page 147.

SCPI command: n/a

#### Preset Configuration

Specifies whether "System >Preset" will perform a factory preset or restore the settings stored in a user preset file. A user preset file is an arbitrary recall set (.znx) file, to be stored using "FILE > Setup > Save...". If the current user preset file is not found (e.g. because it was deleted or moved), "System >Preset" initiates a factory preset.

SCPI command:

SYSTem:PRESet:USER:NAME SYSTem:PRESet:USER[:STATe]

#### 4.6.2.2 Calibration

Provides general system error correction (calibration) settings.

System Config	* (====================================	
Presets Calibration User Inte	rface Channel Bits	
Auto Power Reduction for Cal Unit	De Cal	lete Pool
Save Sweep Data		ete All I Kits
Multiple Cal in Calibration Wizard		
Search Path for additional Cal Kits a	and Connector Types	
User Folder	Set to	o None
	Close	6

#### Auto Power Reduction for Cal Unit

Sets the source power at all test ports to -10 dBm while an automatic calibration using the calibration unit R&S ZV-Z5x is active. Applying this source power to the ports of the calibration unit ensures best accuracy of the automatic calibration. The source powers are reset to their original values after the calibration is completed. The automatic power reduction can be deactivated in case that the test setup introduces a large attenuation.

SCPI command:

SYSTem:COMMunicate:RDEVice:AKAL:PREDuction[:STATe]

#### Save Sweep Data

Causes the raw measurement data of the standards to be stored after a calibration is completed. This function applies to all calibrations and allows you to optimize a previous calibration without repeating the measurement of all standards.

If "Save Sweep Data" is not active, then the raw measurement data of the standards is deleted and the analyzer only stores the system error correction data. Deleting the raw data saves disk space.

This setting is automatically disabled and deactivated in case an External Switch Matrices is used in the RF configuration, since otherwise huge amounts of raw data would be generated.

SCPI command:

[SENSe<Ch>:]CORRection:COLLect[:ACQuire]:RSAVe
[SENSe<Ch>:]CORRection:COLLect[:ACQuire]:RSAVe:DEFault

#### Multiple Cal in Calibration Wizard

Enables/disables multiple calibrations in the calibration wizard, which allows to set up and perform multiple calibrations in one manual calibration procedure. See chapter 4.4.3.4, "Multiple Calibration Presetting Wizard", on page 295 and chapter 4.4.3.8, "Multiple SMARTerCal (Manual) Wizard", on page 327)

SCPI command:

SYSTem:DISPlay:DIALogs:SETup:MCAL[:STATe]

#### Delete Cal Pool / Delete All Cal Kits

Deletes all calibration data and all cal kit data. See chapter 4.4.3.22, "Calibration Manager Dialog", on page 357.

SCPI command: n/a

## Search Path for Additional Cal Kits...

Contains the name and path of a special directory for cal kit files (\*.calkit). All cal kit files in the special directory will be (re-)loaded automatically as predefined kits (i.e. readonly kits which cannot be modified) every time the VNA application is started. It is possible to select the default cal kit directory

C:\Users\Public\Documents\Rohde-Schwarz\Vna\Calibration or any other directory. "None" means that no cal kit files are loaded on start-up.

Use the special directory to make sure that you do not have to import kits manually, even after terminating the VNA application improperly, in which case previously imported cal kit files will not be stored to the recall set file.

SCPI command: MMEMory:LOAD:CKIT:UDIRectory

#### 4.6.2.3 User Interface

Provides general user interface configurations.



#### Instrument Messages / Sounds / Transparent Info Fields / Show Sweep Symbols

The buttons switch the instrument messages, acoustic messages, transparent info fields for markers and trace statistics, and sweep symbols on or off. Sounds are generated when the analyzer generates a notice/status message or a warning (alarm sounds) or during calibration. The sweep symbols are arrows pointing downward onto the trace; they are displayed if the sweep time exceeds a lower limit (e.g. for a large number of points or a small measurement bandwidth).

The settings are also valid if the instrument is remote-controlled. Transparent info fields do not hide an underlying trace.

SCPI command:

SYSTem:SOUNd:ALARm[:STATe] SYSTem:SOUNd:STATus[:STATe]

#### Use Default Tab for Hardkey

If the checkbox is selected, a front panel key or a button in the hardkey bar activates the first tab of the associated softtool. Otherwise the last used tab is activated.

SCPI command: n/a

#### **Decimal Places**

Defines the number of fractional digits for quantities with different physical units. The settings affect entries and results, e.g. the values in the marker lists.

**Note:** If your instrument is equipped with option R&S ZNB-K19, 1mHz Frequency Resolution, set "Decimal Places" of unit "Hz" to "12" inorder to utilize the high frequency resolution.

SCPI command: n/a

#### Reset Colors / Reset Dialogs / Reset Units

Resets the color settings ("SYSTEM > DISPLAY> Config"), the dialog properties and the "Decimal Places" settings. The settings are global and not affected by an instrument preset.

SCPI command: n/a

## 4.6.2.4 Channel Bits

Sets a channel-dependent eight-bit decimal value (0 ... 255) to control eight independent output signals at the USER PORT connector (lines 8, 9, 10, 11 and lines 16, 17, 18, 19).

Select Channel Ch3   \$	Channel Bits (Decimal)
Pin 16 - 19 O Channel Bits	User Control Port Usage:
Orive Ports	Pin 8 - 11 Channel Bit 0 - 3 Pin 16 - 19 Channel Bit 4 - 7 or Drive Port 1 -4

Setting the channel bits does not change the analyzer state.

#### Channel Bits (Decimal)

Entry of the eight-bit decimal value (0 ... 255) for the selected channel. The channel bits control eight output signals at the USER PORT connector. The signals are 3.3 V TTL signals which can be used to differentiate between up to 256 independent analyzer states. For an application example refer to the description of the remote-control command.

The decimal values have the following effect:

- 0 means that no output signals are enabled at any of the pins 8, 9, 10, 11 and 16, 17, 18, 19.
- 1 enables the output signal at pin 8. The signal is switched on while the R&S ZNB performs a measurement (sweep) in the selected channel. All other signals are inactive.
- 2 enables the output signal at pin 9.
- 3 enables the output signals at pins 8 and 9.
- ...
- 255 enables the output signals at all pins. See also "Pin 16 19" on page 427.

SCPI command:

OUTPut<Ch>:UPORt[:VALue]

#### Pin 16 - 19

Selects the control mechanism for the signals at pins 16, 17, 18, 19 of the USER PORT connector.

- Channel Bits: Signals are controlled by channel bits 4 to 7. No drive port indication at the USER PORT connector.
- Drive Ports: Signals indicate the active drive ports. The number of active channel bits is reduced to 4 (pins 8, 9, 10, 11).

SCPI command:

OUTPut:UPORt:ECBits


## 4.6.3 Info (Dialog)

The "Info" dialog displays information about the instrument and its operation. All functions are primarily intended for error diagnostic and service purposes; see chapter 8.1.3, "Obtaining Technical Support", on page 919. Many "Info" tabs also display softkeys for printing the contents or saving them to a file.

Access:SYSTEM > SETUP > Setup > Info...

#### 4.6.3.1 Setup

Displays the channel and trace settings of the active recall set and the main characteristics of the instrument including its IP address.

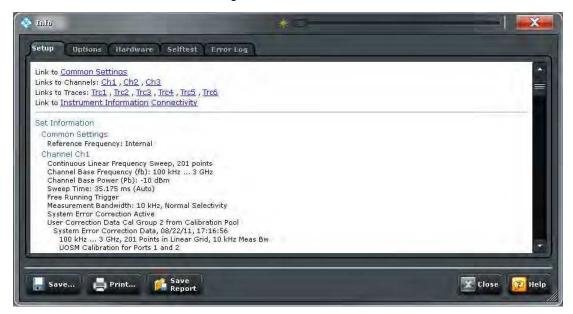

User Manual 1173.9163.02 - 13

# www.valuetronics.com

#### Save... / Print... / Save Report

The buttons across the bottom of the the "Info" dialog save the contents of the open tab to a file or create a hardcopy. "Save Report" saves the current selftest results to a zipped error log file which you may send in for fault diagnosis; see chapter 8.1.3, "Obtaining Technical Support", on page 919.

SCPI command:

DIAGnostic:DEVice:STATe SYSTem:DFPRint?

#### 4.6.3.2 **Options**

Shows the installed software and hardware options. Software options are listed with their type and name, the option key and key type, the duration of activation, and the expiry date (if applicable). You can also enable additional software options using the option key supplied with the option. Proceed according to the instructions in the dialog.

For an overview of options refer to chapter 3.7, "Optional Extensions and Accessories", on page 111.

You can enter the option key here or insert a memory st all with the option key XML file. Then press Install. The application restarts with the option key installed.
You can enter the option key here or insert a memory st all with the option key XML file. Then press Install. The application restarts with the option key installed.
Close 2

#### 4.6.3.3 Hardware

Gives an overview of the analyzer's hardware configuration and basic hardware-related instrument settings.

#### 4.6.3.4 Selftest

Displays the result of the automatic selftest of the analyzer.

### 4.6.3.5 Error Log

Contains a chronological record of errors that occurred in the current and in previous sessions. While the error log is open, additional buttons for printing, closing or clearing (delete) the log are provided. The deleted error log shows the message "No errors found".

## 4.6.4 Service Function (Dialog)

The "Service Function" dialog gives access to the service functions of the instrument. Service functions are password-protected and should be used by a Rohde & Schwarz service representative only. Refer to the service manual for more information.

Access: SYSTEM > SETUF	> > Setup >	Service	Function
------------------------	-------------	---------	----------

			- 144	
Password			Service	Level 0
Service Functio	m			
			_	Y
10				

#### Password

Entry of a password to enable the selected service function.

SCPI command:

```
SYSTem:PASSword[:CENable]
DIAGnostic:SERVice:FUNCtion
DIAGnostic:SERVice:SFUNction
```

## 4.6.5 System > Setup > Reference

Selects a reference signal for synchronization between the R&S ZNB and external devices. A common reference frequency is generally advisable to ensure frequency accuracy and frequency stability in the test setup.

Access: SYSTEM > SETUP key or Alt + Shift + T



#### State

Indicates the state of the internal phase locked loop: If the frequencies are properly synchronized, the state is "locked".

SCPI command:

n/a

## Internal / External

Selects the internal or an external reference clock signal for synchronization.

- Internal: The analyzer provides a 10 MHz internal reference clock signal which can be tapped off at the REF OUT connector at the rear of the instrument in order to synchronize other devices, e.g. signal generators or a second R&S ZNB network analyzer.
- External: The external reference clock signal must be applied to the REF IN connector at the rear of the instrument. The external reference signal must meet the specifications of the data sheet; its frequency must be specified in the "Ext Frequency" field. The internal reference signal is synchronized to the external signal. The external signal is also looped to REF OUT, so that it can be re-used to synchronize other devices.

#### SCPI command:

[SENSe<Ch>:]ROSCillator[:SOURce]

#### **Ext Frequency**

Specifies the frequency of the external reference clock signal at REF IN. SCPI command:

[SENSe<Ch>:]ROSCillator:EXTernal:FREQuency

## 4.6.6 System > Setup > Remote Settings

Configures the remote control interfaces of the R&S ZNB.

Access: SYSTEM > SETUP key or Alt + Shift + T



#### **IP Address**

Displays the current IP address of the R&S ZNB. By default, the analyzer is configured to use dynamic TCP/IP configuration (DHCP) and obtain all IP address information automatically. See chapter "Assigning an IP Address" in the Help or in the Getting Started guide.

SCPI command: n/a

#### **GPIB Address**

Defines the analyzer's GPIB address. The address must be in the range between 0 and 30.

SCPI command: SYSTem:COMMunicate:GPIB[:SELF]:ADDRess

#### Remote Language

Selects the syntax of the R&S ZNB's instrument control commands.

- The DEFAULT language corresponds to the commands reported in this documentation; see chapter 6.3, "SCPI Command Reference", on page 495.
- The ZVABT language ensures compatibility with network analyzers of the R&S ZVA/ B/T family. E.g. compared to the DEFAULT language, the command set does not include INITiate:CONTinuous:ALL and INITiate[:IMMediate]:ALL. The function of INITiate:CONTinuous INITiate[:IMMediate][:DUMMy] is modified; refer to the remote control documentation in chapter 6.3.8, "INITiate Commands", on page 637.
- The ZVR language ensures compatibility with network analyzers of the R&S ZVR family. See also chapter 6.4, "R&S ZVR/ZVAB Compatible Commands", on page 863.
- PNA, ENA, HP8510, HP8720, HP8753 ... denote command sets for network analyzers from other instruments or manufacturers.

**Note:** Remote Language settings other than DEFAULT are intended for remote control of the analyzer. A mixed approach, with part of the instrument configuration defined via the GUI, is possible but may cause unexpected results in some instances.

SCPI command:

SYSTem:LANGuage

#### **Show Errors**

Activates a information popup box (tooltip), to be displayed whenever the parser encounters an remote control command error. The tooltip is not displayed for SCPI errors no. – 113, "Undefined header".

Remote Error : -222,"Data out of range;FREQ:STAR 1"

The tooltip is to provide information that can be useful for program development and optimization; it does not necessarily indicate that a remote control script is faulty or non-executable.

SCPI command: SYSTem:ERRor:DISPlay

#### Define \*IDN? + \*OPT?

Defines a format for the ID string and the option string o fthe analyzer. The default strings are automatically adjusted to the selected "Remote Language". The strings can be queried via \*IDN? and \*OPT?, respectively.

- If the DEFAULT language is activated, the factory ID string
   "Rohde&Schwarz,ZNB<Max. Freq>-<Ports>Port,<Serial\_no>,<FW\_Version> (e.g.
   Rohde-Schwarz,ZNB8-2Port,1311.6010.42,12345,1.10.05)" is set. The option string
   is a comma-separated list of all installed software and hardware options. The bit order
   for transferred binary data is swapped (FORMat:BORDer SWAPped).
- If the PNA language is activated, Agilent-compatible ID and option strings are set. The bit order for transferred binary data is normal.
- If one of the HP xxxx languages is activated, HP xxxx-compatible ID and option strings are set. Binary data is transferred in a device-specific bit order, however, the bit order can be changed using HP xxxx-specific commands.

The ID and option strings can be changed or reset to the R&S factory ID string.



#### SCPI command:

SYSTem:IDENtify[:STRing] SYSTem:IDENtify:FACTory SYSTem:OPTions[:STRing] SYSTem:OPTions:FACTory FORMat:BORDer

User Manual 1173.9163.02 - 13

# www.valuetronics.com

## 4.6.7 Remote LXI (Dialog)

The "Remote LXI" dialog provides basic LXI functions for the analyzer and displays IP and MAC address information.



Background information Refer to the following sections:

- chapter 5.6, "LXI Configuration", on page 486
- chapter 5.6.2, "LXI Browser Interface", on page 487

LAN Config Initialize	LXI Status Enabled
P Address	
10.113.10.38	
IAC Address	
00-1A-A0-06-	7C-4D

## LAN Config Initialize

Initiates the network configuration reset mechanism (LCI) for the R&S ZNB. According to the LXI standard, an LCI must place the following parameters to a default state.

Parameter	Value
TCP/IP Mode	DHCP + Auto IP Address
Dynamic DNS	Enabled
ICMP Ping	Enabled
Password for LAN configuration	LxiWeblfc

The LCI for the network analyzer also resets the following parameters:

Parameter	Value
Hostname	<instrument-specific host="" name=""></instrument-specific>
Description	Vector Network Analyzer
Negotiation	Auto Detect
VXI-11 Discovery	Enabled

## Access:SYSTEM > SETUP > Remote Settings > LXI...

# www.valuetronics.com

The LAN settings are configured in the browser interface; see chapter 5.6.2, "LXI Browser Interface", on page 487.

SCPI command: n/a

#### LXI Status Enabled

Switches the LXI logo in the status bar on or off.

Ch1: Avg + 1:42:25 PM

SCPI command: n/a

## 4.6.8 System > Setup > External Devices

Configures external power meters, generators and switch matrices.



## **Background information**

Refer to the following sections:

- chapter 3.7.10, "External Power Meters", on page 130
- chapter 3.7.11, "External Generators", on page 131
- chapter 3.7.12, "External Switch Matrices", on page 134



#### Persistent vs. session settings

The settings in the "Setup" panel and the configuration dialogs are global settings and not affected by a "Preset" of the analyzer. The external device configuration persists even after the analyzer is turned off. Error logging is turned off whenever a measurement session is closed. See also chapter 3.1.1, "Global (Persistent) Settings", on page 12.

Access: SYSTEM > SETUP key or Alt + Shift + T



The buttons in the "External Devices" panel open the following dialogs:

- Power Meters: See chapter 4.6.9, "External Power Meters (Dialog)", on page 436
- Generators: See chapter 4.6.10, "External Generators (Dialog)", on page 438
- Switch Matrix: See chapter 4.6.11, "External Matrices (Dialog)", on page 441
- RF Connections: See chapter 4.6.12, "Switch Matrix RF Connections (Dialog)", on page 444

This button is only enabled, if an external switch matrix has been detected and/or configured.



#### **USB-to-IEC/IEEE adapter, VISA**

To control external devices equipped with a GPIB interface (but not with a USB interface) you can use the USB-to-IEC/IEEE Adapter (option R&S ZVAB-B44, order no. 1302.5544.03). Option R&S ZVAB-B44 consists of an adapter and a driver software. The driver software is installed on the network analyzer. Connect the USB port of the adapter to any of the master USB connectors on the front or rear panel of the analyzer. Connect the GPIB port of the adapter to the external device.

An appropriate Virtual Instrument Software Architecture (VISA) library which is needed to control external devices via LAN, GPIB, or USB interface is part of the VNA firmware.

#### Optimization

Allows to select between different switch matrix routing optimizations.

- Speed: switch as little as possible
- Precision: always use the best possible route in terms of quality ("priority")

Seechapter 3.7.12.4, "Multiple Paths: Precision vs. Speed", on page 139 for background information.

The selection control is only enabled, if at least one of the connected matrices has multiple routes with non-identical priorities.

#### Log Errors

Enables the transfer of error messages for external decives (e.g. connection errors) to the error log. The error log appears in the "Info" dialog; see chapter 4.6.3, "Info (Dialog)", on page 427.

SCPI command: n/a

## 4.6.9 External Power Meters (Dialog)

The "External Power Meters" dialog configures external power meters so that they can be used for measurements and power calibrations.

**Background information** 

Refer to section chapter 3.7.10, "External Power Meters", on page 130.

Access: SYSTEM > SETUP > External Devices > Power Meters...

NRP-Z11 Other USB::0x0, 90000)	
figured Devices	
State Ref Driver Interface Address	Serial #
🔲 🧟 Pmtr 1 NRP-Z1 💠 Other 🛛 🛱 USB::0x0	900001
■ Pmfr 2 NRVD   \$ GPIB0   \$ 20	

The configuration of a new external power meter involves the following steps:

- connect the power meter to your R&S ZNB using a LAN (VXI-11), GPIB, or USB interface.
- tap"Scan Instruments" and wait until the power meter appears in the table of "Known Devices".
- 3. tap **e** to copy the power meter into the list of configured devices.

If the R&S ZNB fails to detect a connected power meter,

tap "Add Device" to define the interface type and address.

The R&S ZNB can auto-detect the instrument type (driver) and the serial number of the connected power meter.

#### **Known Devices**

Table with all power meters that the analyzer detects to be on line (i.e. connected and switched on). "Scan Instruments" refreshes the table; copies a detected instrument to the table of "Configured Devices".

To appear in the table of "Known Devices", power meters (except the USB sensors R&S NRT-Zxx) must have been configured previously. See also Configured Devices.

SCPI command:

n/a

#### **Configured Devices**

Table with all power meters in use with their properties. The properties of manually configured power meters ("Add Device") may be changed in the dialog.

Once configured, power meters may be temporarily removed from the table of "Configured Devices" using the **temporarily** button. "Scan Devices" will recover the a previously configured, connected power meter. The following symbols show the status of the power meter:

- Image: The power meter is online (connected, switched on, ready to be used).
- The power meter was detected (upper table) or configured (lower table) but is not on-line (VISA communication error).
- Mean of the power meter could not be identified, no communication with the power meter is possible.

To find out why one of the configured power meters is not online, activate the transfer of error messages for external decives (see "Log Errors" on page 436) and reopen the "External Power Meters" dialog.

#### SCPI command:

```
SYSTem:COMMunicate:RDEVice:PMETer<Pmtr>:DEFine
SYSTem:COMMunicate:RDEVice:PMETer:DELete
SYSTem:COMMunicate:RDEVice:PMETer<Pmtr>:CATalog?
SYSTem:COMMunicate:RDEVice:PMETer:COUNt?
```

#### Scan Instruments

Refreshes the table of "Known Devices".

Note: Unintentional switchover to remote control

When using the NI-VISA library, ensure that the network analyzer itself is not listed as a network device in the Measurement & Automation Explorer. Otherwise, "Scan Instruments" will send an identification query (\*IDN?), causing the analyzer to close the "External Power Meters" dialog (without executing "Scan Instruments") and to activate the remote screen.

SCPI command: n/a

II/a

#### Add Device

Adds a new instrument to the list of "Configured Devices". In the "Add External Power Meter" dialog opened, you can specify the properties of the new instrument and the connection:

 "Interface" selects an interface/protocol type for the connection. In addition to the GPIB, VXI-11 and SOCKET interface types (for devices connected to the GPIB Bus

or LAN connectors on the rear panel of the analyzer, respectively; see table 4-3), the analyzer supports any "Other" interface supported by the installed VISA library. "Other" is used in particular for USB connections, e.g. for auto-detected R&S NRP-Zxx sensors.

 "Address" contains the address for the current interface type. GPIB addresses must be unique for all devices connected to the GPIB bus (range: 0 to 30), GPIB and IP addresses must agree with the entries in the VISA library. The remaining interface types require composite address formats; see table 4-3.

If an instrument is connected to the R&S ZNB, the entries in the DRIVER FOR NEW INSTRUMENT panel can be auto-detected for the specified interface type and address.

 "Identify" sends an identification query ("IDN?") to the specified device address in order to identify the type and serial number of the connected power meter and select an appropriate driver file. Power meter driver files (\*.pwm) are stored in the Resources\ExtDev subdirectory of the analyzer's program directory.

Table 4-3: Interface types for external power meters and address formats

Physical interface (connector)	Interface (protocol)	Address	Remarks
LAN	VXI-11	<ipaddress> e.g. 127.0.0.0</ipaddress>	Full VISA resource string: TCPIP[board]:: <address>[::INSTR]</address>
	SOCKET	<ipaddress>::<portno> e.g.127.0.0.0::50000</portno></ipaddress>	LAN connection with pure TCP/IP protocol; refer to your VISA user documentation.
GPIB	GPIB0 GPIB9	<address> e.g. 20</address>	Full VISA resource string: GPIB[board]:: <address>[::INSTR]</address>
LAN or USB	Other	Interface-specific, e.g. for SOCKET: TCPIP0:: <ipaddress>::<portno>::SOCKET</portno></ipaddress>	Use complete VISA resource string.

### SCPI command:

SYSTem:COMMunicate:RDEVice:PMETer<Pmtr>:DEFine
SYSTem:COMMunicate:RDEVice:PMETer<Pmtr>:SPCorrection[:STATe]

## Auto Config NRP-Zxx

Causes the analyzer to clear the lists of "Known Devices" and "Configured Devices" and automatically configure all NRP-Zxx power meters detected at any of the USB ports as Pmtr 1, Pmtr 2... No manual configuration is required.

#### SCPI command:

SYSTem:COMMunicate:RDEVice:PMETer<Pmtr>:CONFigure:AUTO[:STATe]

## 4.6.10 External Generators (Dialog)

The "External Generators" dialog configures external generators so that they can be used for measurements and power calibrations.

User Manual 1173.9163.02 - 13



#### Background information

Refer to section chapter 3.7.11, "External Generators", on page 131.

## Access: SYSTEM > SETUP > External Devices > Generators...

Exte.	rnal Gene	rotors				*0			🔜
nown	Devices								
		Alias Mo	del Int	erface Addr	ess Ser	ial#			
					_				
nfig	ured Devi	ices							
	Ref	Driver	Interfac	e Address	Serial #	Ext. Ref	Fast Sweep	Sweep End	End Power
	Gen J.	SMB100A \$	VXI-11	<b>  ‡</b>   20		F	Г	Set to selected Power	-10 dBm
		· · · · · · · · · · · · · · · · · · ·							
Sca Ins	an struments	Add Device	Delete	All				X	Close 😨 H

The configuration of a new external generator involves the following steps:

- Connect the generator to your R&S ZNB using a LAN (VXI-11), GPIB, or USB interface.
- Click "Scan Instruments" and wait until the generator appears in the table of "Known Devices".
- Click to copy the generator into the list of configured devices.

If the R&S ZNB fails to detect a connected generator,

Click "Add Device" to define the interface type and address.

The R&S ZNB can auto-detect the instrument type (driver) and the serial number of the connected generator.

#### **Known Devices**

Table with all generators that the analyzer detects to be on line (i.e. connected and switched on). "Scan Instruments" refreshes the table; copies a detected instrument to the table of "Configured Devices".

To appear in the table of "Known Devices", generators must have been configured previously. See also Configured Devices.

SCPI command: n/a

### **Configured Devices**

Table with all generators in use with their properties. The properties of manually configured generators ("Add Device", opens the "Add External Generator" dialog) may be changed in the dialog.

The following generator properties are not defined in the "Add External Generator" dialog but configurable here:

- "Ext. Ref." switches the generator to either external (box checked) or internal frequency reference. The setting does not affect the frequency reference settings of the analyzer "SYSTEM > SETUP > Freq. Ref.". Make sure to establish consistent settings in your test setup (one instrument is the master, the others use external reference frequency). See "Reference frequency" on page 133.
- "Fast Sweep" enables or disables the fast sweep mode for external generators that support a frequency and level list mode (triggered mode). See "Fast sweep mode and conditions" on page 133.
- "Sweep End" defines the output power of the external generator after the end of a sweep or sweep sequence (single sweep mode; "CHANNEL > SWEEP > Sweep Control > Single"). The minimum power value ("Set to Min. Power") depends on the generator type. "Set to Selected Power" means that the generator is commanded to transmit at the selected "End Power".

Once configured, generators may be temporarily removed from the table of "Configured Devices" using the **second second se** 

- Image and the provide the second state of the provided of the second state of the second stat
- The generator was detected (upper table) or configured (lower table) but is not on-line (VISA communication error).
- Image: The properties of the generator could not be identified, no communication with the generator is possible.

To find out why one of the configured generators is not online, activate the transfer of error messages for external decives (see "Log Errors" on page 436) and reopen the "External Generators" dialog.

SCPI command:

```
SYSTem:COMMunicate:RDEVice:GENerator<Gen>:DEFine
SYSTem:COMMunicate:RDEVice:GENerator:DELete
SYSTem:COMMunicate:RDEVice:GENerator<Gen>:CATalog?
SYSTem:COMMunicate:RDEVice:GENerator<Gen>:DEFine
SYSTem:COMMunicate:RDEVice:GENerator<Gen>:SEPMode
SYSTem:COMMunicate:RDEVice:GENerator<Gen>:SEPMode
```

#### **Scan Instruments**

Refreshes the table of "Known Devices".

Note: Unintentional switchover to remote control

When using the NI-VISA library, ensure that the network analyzer itself is not listed as a network device in the Measurement & Automation Explorer. Otherwise, "Scan Instruments" will send an identification query (\*IDN?), causing the analyzer to close the "External Generators" dialog (without executing "Scan Instruments") and to activate the remote screen.

SCPI command: n/a

#### Add Device

Adds a new instrument to the list of "Configured Devices". In the "Add External Generator" dialog opened, you can specify the properties of the new instrument and the connection:

- "Interface" selects an interface/protocol type for the connection. In addition to the GPIB, VXI-11, SOCKET, and USB-VISA interface types (for devices connected to the GPIB Bus, LAN or USB connectors of the analyzer; see table 4-4), the analyzer supports any "Other" interface supported by the installed VISA library.
- "Address" contains the address for the current interface type. GPIB addresses must be unique for all devices connected to the GPIB bus (range: 0 to 30), GPIB and IP addresses must agree with the entries in the VISA library. The remaining interface types require composite address formats; see table 4-4.
   If an instrument is connected to the R&S ZNB, the entries in the DRIVER FOR NEW INSTRUMENT panel can be auto-detected for the specified interface type and address.
- "Identify" sends an identification query ("IDN?") to the specified device address in order to identify the type and serial number of the connected generator and select an appropriate driver file. Generator driver files (\*.gen) are stored in the Resources\ExtDev subdirectory of the analyzer's program directory.

Physical interface (connector)	Interface (protocol)	Address	Remarks
LAN	VXI-11	<ipaddress> e.g. 127.0.0.0</ipaddress>	Full VISA resource string: TCPIP[board]:: <address>[::INSTR]</address>
	SOCKET	<ipaddress>::<portno> e.g.127.0.0.0::50000</portno></ipaddress>	LAN connection with pure TCP/IP protocol; refer to your VISA user documentation.
GPIB	GPIB0 GPIB9	<address> e.g. 20</address>	Full VISA resource string: GPIB[board]:: <address>[::INSTR]</address>
USB	USB-VISA	<manid>::<prodid>::<serialno> e.g.0x0AAD::0x0047::100098</serialno></prodid></manid>	<ul> <li>2733 (0x0AAD) is the manufacturer ID of Rohde &amp; Schwarz.</li> <li>71 (0x0047) is an example for a R&amp;S product ID (R&amp;S SMF100A).</li> <li>The serial number is device-specific.</li> </ul>
LAN or USB	Other	Interface-specific, e.g. for SOCKET: TCPIP0:: <ipaddress>::<portno>::SOCKET For USB-VISA: USB0::<manid>::<prodid>::<serialno>::INSTR</serialno></prodid></manid></portno></ipaddress>	Use complete VISA resource string.

Table 4-4: Interface types for external generators and address formats

#### SCPI command:

SYSTem:COMMunicate:RDEVice:GENerator<Gen>:DEFine

## 4.6.11 External Matrices (Dialog)

The "External Matrices" dialog allows to discover and register external switch matrices.

# www.valuetronics.com

### Background information

Refer to section chapter 3.7.12, "External Switch Matrices", on page 134.

Access: SYSTEM > SETUP > External Devices > Switch Matrix...

~	State	Alias Model Ir	iterface Addre	ss Serial #		
onfigure	d Devices					
*	State	Ref	Driver	Interface	Address	Serial #
		SwitchMatrix 1	Z¥-Z81-05 ‡	LAN   ‡	10.10.10.10	

The registration of a new external switch matrix typically involves the following steps:

- 1. connect the switch matrix to your R&S ZNB using LAN or USB interface
- 2. turn LAN Detection on if the matrix is connected via LAN
- tap "Scan Instruments" and wait until the switch matrix appears in the table of "Known Devices"
- 4. tap to copy the switch matrix to the list of configured devices

If "LAN Detection" fails for some reason (see below for details), the external switch matrix can also be registered manually:

- 1. tap "Add Device" to open the "Add External Switchmatrix" dialog (see figure below)
- 2. In the "Add External Switchmatrix" dialog
  - a) specify the IP address or hostname of the switch matrix
  - b) tap "Identify" to auto-detect the matrix type ("Driver") of the remote switch matrix If the device cannot be identified (e.g. because it is temporarily unavailable), select the appropriate "Driver" manually



Registering a switch matrix is only the first step. To make the external ports available to the vector network analyzer, the RF connections have to be configured, as described in chapter 4.6.12, "Switch Matrix RF Connections (Dialog)", on page 444.

#### Known Devices

Table with the discovered switch matrices.

"Scan Instruments" refreshes the table; copies a discovered switch matrix to the table of "Configured Devices".

SCPI command:

n/a

### **Configured Devices**

Table displaying the registered switch matrices.

A distinction is made between those switch matrices that are used in RF connections (see chapter 4.6.12, "Switch Matrix RF Connections (Dialog)", on page 444) and those that are not.

- Used matrices are represented by inactive rows (greyed out).
- Unused matrices are represented by active table rows (colored). Only unused matrices can be unregistered and removed from the table using the button of the respective row.

For unused switch matrices that were manually registered via "Add Device", some properties can be changed by editing the corresponding table cells.

The following symbols (greyed out for *used* devices) indicate the status of the respective switch matrix:

- The switch matrix is online (connected, switched on, ready to be used).
- The switch matrix was detected (upper table) or configured (lower table) but is not on-line.
- Image: The properties of the switch matrix could not be identified, no communication is possible.

To find out why one of the configured matrices is not online, activate the transfer of error messages for external decives (see "Log Errors" on page 436) and reopen the "External Matrices" dialog.

SCPI command:

SYSTem:COMMunicate:RDEVice:SMATrix<Matr>:DEFine SYSTem:COMMunicate:RDEVice:SMATrix:DELete

#### Scan Instruments / LAN Detection

"Scan Instruments" refreshes the table of "Known Devices".

Activate "LAN Detection" to perform a switch matrix auto-discovery procedure on the analyzer's IP subnet.

**Note:** "LAN detection" will only work for matrices sharing the same IP subnet with the R&S ZNB.

As a prerequisite, the R&S ZNB must accept incoming connections on UDP port 2473. If necessary, add a corresponding inbound rule to your firewall settings.

SCPI command:

n/a

#### Add Device

Opens the "Add External Switchmatrix" dialog that allows manual registration of an external switch matrix.

	rument
Interface	
LAN	*)
Address	
(10.10.10.10	
Identify	Driver Z¥-281-05
Serial Number	

In the "Address of New Instrument" part, you can specify the required connection properties:

- "Interface" selects the connection type; currently only "LAN" is available.
- "Address" specifies the IP address or hostname of the external switch matrix.

If a connection can be established, the entries in the DRIVER FOR NEW INSTRUMENT panel can be auto-detected: "Identify" sends an identification query ("IDN?") to the specified device address in order to get the type and serial number of the connected switch matrix and to select the appropriate driver file.

Otherwise, manually select the "Driver". Matrix driver files (\*.matrix) are stored in the Resources\ExtDev subdirectory of the analyzer's program directory.

SCPI command:

SYSTem:COMMunicate:RDEVice:SMATrix<Matr>:DEFine

#### Delete All

Unregisters all unused switch matrices.

SCPI command:

SYSTem:COMMunicate:RDEVice:SMATrix:DELete

## 4.6.12 Switch Matrix RF Connections (Dialog)

The "Switch Matrix RF Connections" dialog allows to define the RF connections between the VNA and the switch matrices and the RF connections to the (DUT) test ports.

The following configuration rules apply:


- Every VNA port must either be connected to a matrix port or directly assigned to a DUT test port
- Every matrix that was added to the connection configuration must be connected to the VNA by at least one RF connection
- Every VNA port that is not connected to a matrix must be assigned to a test port
- The test ports must numbered consecutively, starting with 1

Configuration errors are displayed in balloon popups appearing at the lower left corner of the dialog.

## Background information

Refer to section chapter 3.7.12, "External Switch Matrices", on page 134.

Access: SYSTEM > SETUP > External Devices > RF Connections...

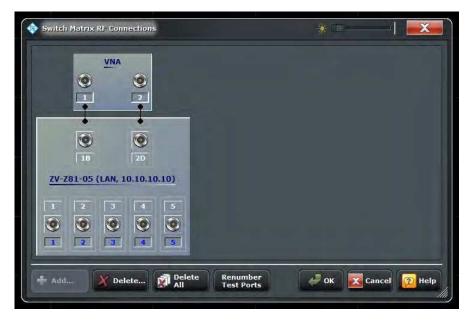

The definition of the RF connections typically involves the following steps:

- "Add" one or more switching matrices These matrices must have been registered before; see chapter 4.6.11, "External Matrices (Dialog)", on page 441 for details.
- For every matrix VNA port (the "north" ports in the graphical representation) specify the VNA port to which this matrix VNA port is physically connected or set it to "Unused" in case no such connection exists.
- For some matrix test ports and every VNA port that is not connected to a matrix, assign a test port

#### Add

Opens the "Add Switch Matrix" dialog:

🗞 Add Switch Matrix	*	💌
Select Matrix		
ZV-Z81-05 (LAN, 10.10.10.10)		
		OK Cance

Select the required matrices and tap "OK" to add them to the RF connection configuration or tap "Cancel" to quit the dialog without adding a switch matrix to the RF connection configuration

#### Note:

- This dialog is shown automatically, in case no matrix has been added to the RF connection configuration yet.
- If the RF configuration configuration already contains all registered switch matrices, the "Add" button is disabled.

SCPI command:

n.a.

#### Delete

Opens the "Delete Switch Matrix" dialog:



Select some matrices and tap "OK" to remove them from the RF connection configuration or tap "Cancel" to quit the dialog without removing a switch matrix from the RF connection configuration.

## Delete All

Opens a confirmation dialog

User Manual 1173.9163.02 - 13

# www.valuetronics.com



Either tap "OK" to remove all switch matrices from the RF connection configuration or tap "Cancel" to quit the dialog without removing a switch matrix.

SCPI command: SYSTem:COMMunicate:RDEVice:SMATrix:DELete

#### **Renumber Test Ports**

Applies a default test port assignment to the available matrix test ports and VNA ports.

You can use this function at any time to number the used test ports in ascending order, e.g. after editing port connections. Note however that in general this will not preserve any manually created test port connections.

SCPI command:

n.a.

#### **Edit Matrix VNA Port Connections**

To edit a matrix VNA port connection, tap on the corresponding port symbol.



In the "Edit" dialog select the appropriate VNA port or tap "Set Unused" to delete the VNA port association.

SCPI command:

```
SYSTem:COMMunicate:RDEVice:SMATrix<Matr>:CONFigure:MVNA
SYSTem:COMMunicate:RDEVice:SMATrix<Matr>:CONFigure:MLVNa
```

User Manual 1173.9163.02 – 13

# www.valuetronics.com

#### **Edit Test Port Connection**

To edit a test port connection, tap on the corresponding port symbol.

Port Number	for Matrix Test Port 1
1	Port 1
6-1-1	Port 2
Set Unused	Port 3
	Port 4
	Port 5
	Port 6
	Port 7
	Port 8
	Port 9
	Port 10
	Port 11
	Port 12

In the "Edit" dialog, select the appropriate test port or tap "Set Unused" to delete the test port association.

SCPI command:

```
SYSTem:COMMunicate:RDEVice:SMATrix<Matr>:CONFigure:MTESt
on page 841
SYSTem:COMMunicate:RDEVice:SMATrix<Matr>:CONFigure:MLTest
on page 841
SYSTem:COMMunicate:RDEVice:SMATrix:CONFigure:TVNA on page 842
```

## 4.6.13 System > Print

Prints the active setup (i.e. the contents of the active diagrams) to an external printer, to a file or to the clipboard. The settings are identical with the "File > Print" settings; see chapter 4.1.2, "File > Print", on page 147.

## 4.6.14 Additional System Functions

The "System" menu also provides the "Preset", "Undo", and "Redo" functions. These functions are not included in the "System" softtool panels; they are accessible via hard-keys in the SYSTEM panel.

#### Preset

Performs a preset of all instrument settings or of the active recall set, depending on the settings in the "Presets" tab of the "SYSTEM > SETUP > Setup > System Config" dialog. See chapter 4.6.2.1, "Presets", on page 422.

A preset may be a factory preset or a user-defined preset. It does not change e.g. the data related to global resources (e.g. cal pool, cal kit data), the position of dialogs, the color scheme of the diagrams, and the directory and printer settings. Many of these properties can be reset in the "System Config" dialog.

**Tip:** If you activate "Preset" by mistake, you can tap the "Undo" button in order to restore your previous instrument settings.

SCPI command: \*RST SYSTem:PRESet:SCOPe SYSTem:PRESet:USER:NAME SYSTem:PRESet:USER[:STATe] SYSTem:PRESet[:DUMMy]

#### Undo and Redo buttons

"Undo" reverses the last action, if possible. Otherwise, the "Undo" button is disabled (grayed). "Redo" reverses the action of the "Undo" command. If "Undo" has not been used before, "Redo" is disabled (grayed).



"Undo" and "Redo" are disabled if the size of the active recall set file exceeds 1 MB. **Tip:** You can also use "Undo" after a "Preset", in order to restore your old instrument settings.

# 4.7 Applic Menu

The "Applic" menu gives access to external tools which are pre-installed on the R&S ZNB. Some buttons are reserved for future applications.

Access: APPLIC key or System > External Tools menu

Applic Menu



#### **GPIB Explorer**

Opens a tool that allows you to connect to the analyzer, obtain an overview of all implemented remote control programs, test programs, compile and run test scripts. For a detailed description refer to chapter 5.1.2, "GPIB Explorer", on page 454.

#### Tool 2 ... Tool 8

Allows you to add your own external tools. Any new shortcut in the

C:\Users\Public\Documents\Rohde-Schwarz\Vna\External Tools directory will replace one of the buttons.

#### **Title Bar Task Bar**

Displays or hides the title bar and the task bar across the bottom of the screen. Typically you can use the task bar to change between the VNA application and other external tools. See also chapter 3.2.1.1, "Title Bar", on page 21.

#### Screen Keyboard

Opens the Windows "On-Screen Keyboard". This tool allows you to enter characters, in particular letters, if an input field cannot call up the analyzer's own on-screen keyboard, and if no external keyboard is connected.

#### Windows Explorer

#### Opens the WindowsExplorer and shows you the contents of the

C:\Users\Public\Documents\Rohde-Schwarz\Vna\External Tools **applica**tion shortcut directory.

## 4.8 Help Menu

The "Help" menu provides assistance with the network analyzer and its operation. Access: SYSTEM > HELP key or Help menu



#### Contents... / Index...

Opens the "Contents" or the "Index" page of the help system.

#### About...

Opens a dialog to retrieve information about the network analyzer and the current firmware version.

## 4.9 Control Menu

The control icon 🔄 in the title bar provides standard Windows<sup>®</sup> functions to control the main application window. To access this icon the "Title Bar" must be open.

Double-clicking a control icon is the same as clicking the **[2]** icon or the "Close" menu command.

-	Minimize Maximize	
×	Close	Alt+F4

#### Restore

Returns the maximized or minimized active window to its size and position. "Restore" is available after a "Maximize" or "Minimize" command only.

#### Move

Displays a four-headed arrow to move the active window with the arrow keys or with the mouse. This command is unavailable for maximized windows.

## Size

Displays a four-headed arrow to change the size of the active window using the arrow keys or the mouse.

#### Minimize

Reduces the active window to an icon.

### Maximize

Enlarges the active window to fill the available space.

# Close

Ends the analyzer session.

**Note:** The "Close" application command is equivalent to the "Exit" command in the "File" menu. Moreover "Close" has the same effect as a tap and hold on the "Control" menu icon or a tap and hold on the [3] icon in the title bar of the active window.

# 5 Remote Control

This chapter provides instructions on how to set up the analyzer for remote control, a general introduction to remote control of programmable instruments, and the description of the analyzer's remote control concept. For reference information about all remote control commands implemented by the instrument, complemented by comprehensive program examples, refer to chapter 6, "Command Reference", on page 492.

# 5.1 Introduction to Remote Control

The instrument is equipped with different interfaces for remote control:

- A GPIB bus interface according to standard IEC 625.1/IEEE 488.1. The GPIB bus connector for control of the analyzer from a controller is located on the rear panel of the instrument.
- Analyzers connected to a Local Area Network can be controlled via the RSIB, VXI-11, or HiSLIP protocols. Two connectors for LAN connection are located on the rear panel. A VISA installation on the **controller** is required.
- The network analyzer can itself act as a master and control external devices (e.g. power meters, generators) via LAN, USB, or GPIB interface.
   A VISA installation on the **analyzer** is a prerequisite for this remote control type. The Virtual Instrument Software Architecture (VISA) library is included in the VNA firmware; no additional installation is required.



# Visa library

VISA is a standardized software interface library providing input and output functions to communicate with instruments. The I/O channel (LAN or TCP/IP, USB...) is selected at initialization time by means of the channel–specific resource string (also termed address string) or by an appropriately defined VISA alias (short name). A VISA installation on the master device is a prerequisite for remote control over LAN interface and for control of external devices from the analyzer.

To control external devices via USB, the "IVI Visa Shared Components" must be installed in addition. You can easily perform the installation from the "Start" menu of your analyzer.

For more information about VISA refer to the user documentation.



# HiSLIP protocol

The HiSLIP (High Speed LAN Instrument Protocol) is a protocol for TCP-based instruments specified by the IVI foundation. Compared to its predecessor VXI-11, it provides speed and other improvements. HiSLIP is encapsulated in VISA; the resource string reads TCPIP::<R&S ZNB IP address>::hislip0.

The internal VISA library of the R&S ZNB supports HiSLIP. If the connection fails, access the Windows control panel of the controlled instrument and open port 4880 for incoming connections.

# 5.1.1 Starting a Remote Control Session

A remote control program must open a connection to the analyzer (using VISA functionality), before it can send commands to the analyzer and receive device responses (e.g. measurement data). The programming details depend on the library version used and on the programming language. For this reason, the examples in chapters "Command Reference" and "Programming Examples" are reduced to the mere SCPI syntax.

Example controller programs may be obtained from the Rohde & Schwarz support centers. In many cases, it can be preferable to integrate the controller program into postprocessing tools (e.g. Microsoft Excel) in order to list, draw, or manipulate the measured values retrieved from the analyzer.

The following tools can make remote control more comfortable and faster:

- Various software tools provide an easy-to-use graphical user interface for remote control. An example is the "GPIB Explorer" (also termed "IECWIN32") which is preinstalled on the analyzer. See chapter 5.1.2, "GPIB Explorer", on page 454.
- Instrument drivers provide an improved interface between the test software and the
  test instruments. They perform the actual control of the instrument using higher-level
  functions for operations such as configuring, reading from, writing to, and triggering
  the instrument. This reduces development time, eliminating the need to learn the
  specific command set for each instrument. In general, program development is further
  simplified by a graphical program environment.

Rohde & Schwarz offers various R&S ZNB driver types (LabView, LabWindows/CVI, IVI, VXIplug&play...) for different programming languages. The drivers are available free of charge on the product pages in the R&S internet, along with installation information.

# 5.1.2 GPIB Explorer

The GPIB Explorer is a software tool that allows you to connect to the analyzer, obtain an overview of all implemented remote control programs, test programs, compile and run test scripts. The program can be opened from the Windows<sup>®</sup> start menu: "Programs – R&S Network Analyzer – GPIB Explorer" or via "APPLIC > External Tools > GPIB Explorer". You can also start the executable file iecwin32.exe in the program directory of the network analyzer (e.g.

C:\Program Files\Rohde&Schwarz\Network Analyzer\Bin).

After the GPIB Explorer is started, the interface and protocol for the connection to the instrument can be selected in a dialog:

# www.valuetronics.com

Introduction to Remote Control

No connection to instru	ment		
-			
- Connect via			Help
NT named pipe			нер
GPIB address	20 •		
C RSIB address	127.0.0.1	• <u> </u>	Connect now
C VXI-11/VISA	TCPIP::127.0.0.1::INSTR		Connect now
📀 NT Pipe A (COM Pa	user)		
C NT Pipe B (COM Pa	nser)		
C EB200	89.10.11.23:5555	• =	
Rohde&Schwarz	✓ Service Requests V Sta	atus Registers	Cancel

The following options are provided:

- NT named pipe (not supported at present)
- GPIB address (for connection to controllers equipped with a National Instruments GPIB interface using the GPIB bus connector)
- RSIB address and VXI-11/VISA (for LAN connection, requires an appropriate IP or local host address); see chapter "Remote Operation in a LAN" in the Help or in the Getting Started guide.
- NT pipe A/B (COM Parser) (only for a GPIB Explorer installed on the analyzer, recommended for "remote" test on the instrument)
- EB200 (not supported at present)



Select "SETUP > Setup > Info..." to look up the IP address information of your analyzer. If you run the GPIB explorer on the analyzer, the local host address (loopback address) is 127.0.0.1.

After the connection is established, the GPIB explorer displays a tree view of all commands included in the current firmware version of the network analyzer. The programs can be selected for execution by a single mouse click.

No connection to instru	ment		
Connectivity			
- Connect via			Help
NT named pipe	A Commence of the second s		
GPIB address	20 🔹		
C RSIB address	127.0.0.1	·	
C VXI-11/VISA	TCFIF::127.0.0.1::INSTR		Connect now
INT Pipe A (COM Pa	user)	-	
C NT Pipe B (COM Pa	arser)		
C EB200	89.10.11.23:5555		
Rohde&Schwarz	✓ Service Requests V Sta	atus Registers	Cancel



It remote logging is enabled (SYSTem:LOGGing:REMote[:STATe] ON) the analyzer stores all received commands to the file

'C:\Users\Public\Documents\Rohde-Schwarz\Vna\RemoteLog'.

# 5.1.3 Switchover to Remote Control

On power-up, the instrument is always in the manual operating state and can be operated via the front panel controls. The instrument is switched to remote control as soon as it receives a command from the controller. If the instrument is controlled via RSIB or VXI-11 protocol, the alternative commands @REM and @LOC can be used to switch from manual to remote control and back.

While remote control is active, operation via the front panel is disabled with the exception of the "Remote" softool panel. The instrument settings are optimized for maximum measurement speed; the display is switched off:



The softkeys in the remote screen are used to modify or quit the remote state:

- "Go to Local" switches the instrument to local state.
- "Display" switches the display on or off.
- If a remote error message is displayed at the bottom of the remote screen, you can use "Clear Error Messages" to delete it.


The remaining controls are for future extensions.

### Display on and off states

Switching on the display means that the analyzer shows the measurement screen with the current recall sets, diagram areas and traces without leaving the remote state. In this operating mode, it is possible to observe the screen while a remote control script is executed and the control elements on the front panel are still disabled.

# www.valuetronics.com

Introduction to Remote Control

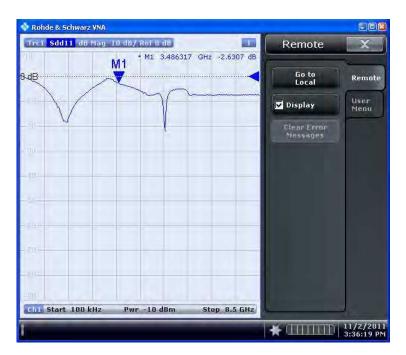

Switching on the display is ideal for program test purposes but tends to slow down the measurement. Therefore, it is recommended to switch off the display in real measurement applications where a tested program script is to be executed repeatedly.



The analyzer provides a third display option where the measurement screen is only updated when this is triggered by the remote control command SYSTem:DISPlay:UPDate ONCE.

The instrument remains in the remote state until it is reset to the manual state via the GUI or via remote control (see chapter 5.1.3.2, "Returning to Manual Operation", on page 458). You can also lock the remote (touch)screen using SYSTem:TSLock SCReen.

A tooltip across the bottom of the remote screen indicates a remote command error. You can switch off this tooltip using SYSTem:ERRor:DISPlay OFF.



# 5.1.3.1 Setting the Device Address

The GPIB address (primary address) of the instrument is factory-set to 20. It can be changed manually in the "SYSTEM > SETUP > Remote Settings" tab or via remote control. For remote control, addresses 0 through 30 are permissible. The GPIB address is maintained after a reset of the instrument settings.

SCPI commands:

SYSTem:COMMunicate:GPIB[:SELF]:ADDRess

### 5.1.3.2 Returning to Manual Operation

Return to manual operation can be initiated via the front panel or via remote control.

- Manually: tap the Local softkey in the remote screen.
- Via GPIB bus: CALL IBLOC(device%)
- Via RSIB or VXI-11 protocol: @LOC and @REM can be used to switch from remote to manual control and back.



## Local lockout

Before returning to manual control, command processing must be completed. If this is not the case, the analyzer switches back to remote control immediately.

Returning to manual control by tapping the "Go to Local" softkey can be disabled e.g. by the Local Lockout Message (via GPIB: LLO; see chapter 9.1.3.2, "Interface Messages", on page 926). This prevents unintentional switch-over, i.e. return to manual control is possible via remote control only.

Returning to manual control via the front panel keys can be enabled again, e.g. by deactivating the REN control line of the GPIB bus.

# 5.1.4 Combining Manual and Remote Control

Using a remote control script is the quickest and easiest way of performing complicated tasks which need to be repeated many times. On the other hand, it is often preferable to control a previously configured measurement manually in order to observe the result on the screen.

The analyzer provides a number of tools for combining manual and remote control:

• User Keys

The remote control commands SYSTem:USER:KEY... place up to 8 softkeys with arbitrary functionality on the remote screen. The softkeys appear in the "User Menu" tab of the "Remote" softtol. When a softkey is selected, the ESR bit no. 6 (User Request) is set, and the response for SYSTem:USER:KEY? is changed. This behavior can serve as a control mechanism in remote control scripts.

## SCPI commands:

SYSTem:USER:KEY

# 5.2 Messages

The messages transferred on the data lines of the GPIB bus or via the RSIB / VXI-11 protocol can be either interface messages or device messages. For a description of interface messages refer to the relevant sections:

- chapter 9.1.3, "GPIB Interface", on page 924
- chapter 9.1.2, "LAN Interface", on page 924

# 5.2.1 Device Messages (Commands and Device Responses)

Device messages are transferred in ASCII format. A distinction is made according to the direction in which device messages are transferred:

- Commands are messages the controller sends to the instrument. They operate the device functions and request information.
- Device responses are messages the instrument sends to the controller after a query. They can contain measurement results, instrument settings and information on the instrument status.

Commands are subdivided according to two criteria:

- 1. According to the effect they have on the instrument:
  - Setting commands cause instrument settings such as a reset of the instrument or setting the output level to some value.
  - Queries cause data to be provided for output on the GPIB bus, e.g. for identification of the device or polling the active input.
- 2. According to their definition in standard IEEE 488.2:
  - Common commands have a function and syntax that is exactly defined in standard IEEE 488.2. Typical tasks are the management of the standardized status registers, reset and selftest.
  - Instrument-control commands are functions that depend on the features of the instrument such as frequency settings. A majority of these commands has also been standardized by the SCPI consortium.

The device messages have a characteristic structure and syntax. In the SCPI reference chapter all commands are listed and explained in detail.

# 5.2.2 SCPI Command Structure and Syntax

SCPI commands consist of a so-called header and, in most cases, one or more parameters. The header and the parameters are separated by a white space (ASCII code 0 to 9, 11 to 32 decimal, e.g. blank). The headers may consist of several mnemonics. Queries are formed by directly appending a question mark to the header.

Common commands and device-specific commands differ in their syntax.

#### SCPI compatibility

The analyzers are compatible to the final SCPI version 1999.0. Not all of the commands supported by the instrument are taken from the SCPI standard (Standard Commands for Programmable Instruments), however, their syntax follows SCPI rules. The SCPI standard is based on standard IEEE 488.2 and aims at the standardization of instrument-control commands, error handling and the status registers.

The requirements that the SCPI standard places on command syntax, error handling and configuration of the status registers are explained in detail in the following sections.



#### **Reset values**

In contrast to instruments with manual control, which are designed for maximum possible operating convenience, the priority of remote control is the predictability of the device status. This means that when incompatible settings are attempted, the command is ignored and the device status remains unchanged, i.e. other settings are not automatically adapted. Therefore, GPIB bus control programs should always define an initial device status (e.g. with the command \*RST) and then implement the required settings.

### 5.2.2.1 Common Commands

Common (=device-independent) commands consist of a header preceded by an asterisk "\*" and possibly one or more parameters.

Examples:	
*RST	RESET, resets the instrument.
*ESE 253	EVENT STATUS ENABLE, sets the bits of the event status enable registers.
*ESR?	EVENT STATUS QUERY, queries the contents of the event status register.

### 5.2.2.2 Instrument-Control Commands

Instrument-control commands are based on a hierarchical structure and can be represented in a command tree. The command headers are built with one or several mnemonics (keywords). The first level (root level) mnemonic identifies a complete command system.

#### Example:

SENSe This mnemonic identifies the command system SENSe.

For commands of lower levels, the complete path has to be specified, starting on the left with the highest level, the individual mnemonics being separated by a colon ":".

#### Example:

SENSe:FREQuency:STARt 1GHZ

This command is located on the third level of the SENSe system. It defines the start frequency of the sweep.

The following rules simplify and abbreviate the command syntax:

Multiple mnemonics

Some mnemonics occur on several levels within one command system. Their effect depends on the structure of the command, i. e. on the position in the command header they are inserted in.

#### Example:

SOURce:FREQuency:CW 1GHZ

This command contains the mnemonic SOURce in the first command level. It defines the frequency for sweep types operating at fixed frequency.

TRIGger:SOURce EXTernal

This command contains the mnemonic SOURce in the second command level. It defines the trigger source "external trigger".

#### Optional mnemonics

Some command systems permit certain mnemonics to be optionally inserted into the header or omitted. These mnemonics are marked by square brackets in this manual. The full command length must be recognized by the instrument for reasons of compatibility with the SCPI standard. Some commands are considerably shortened by omitting optional mnemonics.

#### Example:

TRIGger[:SEQuence]:SOURce EXTernal

This command defines the trigger source "external trigger". The following command has the same effect:

TRIGger:SOURce EXTernal

### Note:

The short form is marked by upper case letters, the long form corresponds to the complete word. Upper case and lower case notation only serves to distinguish the two forms in the manual, the instrument itself is case-insensitive.

# Parameters

Parameters must be separated from the header by a white space. If several parameters are specified in a command, they are separated by a comma ,". For a description of the parameter types, refer to section Parameters.

### Example:

SOURce:GROup 1,1

This command defines a group of measured ports.

#### Numeric suffix

If a device features several functions or features of the same kind, e.g. several channels or test ports, the desired function can be selected by a suffix added to the command. Entries without suffix are interpreted like entries with the suffix 1.

#### Example:

#### SOURce:GROup2 1,1

This command defines a second group (group no 2) of measured ports.

# 5.2.2.3 Structure of a Command Line

A command line may consist of one or several commands. It is terminated by a <New Line>, a <New Line> with EOI or an EOI together with the last data byte. Tools like the GPIB Explorer automatically produce an EOI together with the last data byte.

Several commands in a command line must be separated by a semicolon ;". If the next command belongs to a different command system, the semicolon is followed by a colon.

Example: TRIGger: SOURce EXTernal; : SENSe: FREQuency: STARt 1GHZ

This command line contains two commands. The first command belongs to the TRIGger system and defines the trigger source (external trigger). The second command belongs to the SENSe system and defines the start frequency of the sweep.

If the successive commands belong to the same system, having one or several levels in common, the command line can be abbreviated. To this end, the second command after the semicolon starts with the level that lies below the common levels. The colon following the semicolon must be omitted in this case.

**Example:** TRIG:SOUR EXT;:TRIG:TIM 0.1

This command line is represented in its full length and contains two commands separated from each other by the semicolon. Both commands are part of the TRIGger command system, i.e. they have one level in common.

When abbreviating the command line, the second command begins with the level below TRIG. The colon after the semicolon is omitted. The abbreviated form of the command line reads as follows:

TRIG:SOUR EXT; TIM 0.1

However, a new command line always begins with the complete path.

Example:	TRIG:SOUR EXT
	TRIG:THR LOW

### 5.2.2.4 Responses to Queries

A query is defined for each setting command unless explicitly specified otherwise. It is formed by adding a question mark to the associated setting command. According to SCPI, the responses to queries are partly subject to stricter rules than in standard IEEE 488.2.

- 1. The requested parameter is transmitted without header. **Example:** TRIGger: SOURce? **Response:** IMM
- Maximum values, minimum values and all further quantities which are requested via a special text parameter are returned as numerical values.
   Example: SENSe: FREQuency: STOP? MAX Response: 800000000
- Numerical values are output without their unit. The default unit for each command is reported in the SCPI command description.
   Example: SENSe: FREQuency: STOP? MAX Response: 800000000 for 8 GHz
- 4. Boolean values are returned as 0 (for OFF) and 1 (for ON). **Example:** SWEep:TIME:AUTO? Response: 1
- 5. Text (character data) is returned in short form (see also next section). **Example:** TRIGger: SOURce? Response: IMM

# 5.2.3 SCPI Parameters

Many commands are supplemented by a parameter or a list of parameters. The parameters must be separated from the header by a "white space". Permissible parameters are numerical values, Boolean parameters, text, character strings and block data. The type of parameter required for the respective command and the permissible range of values are specified in the command description.

# 5.2.3.1 Numeric Values

Numeric values can be entered in any form, i.e. with sign, decimal point and exponent. Values exceeding the resolution of the instrument are rounded up or down. The mantissa may comprise up to 255 characters, the values must be in the value range –9.9E37 to 9.9E37. The exponent is introduced by an E or e. Entry of the exponent alone is not allowed. In the case of physical quantities, the unit can be entered. Permissible unit pre-fixes are G (giga), MA (mega), MOHM and MHZ are also permissible), K (kilo), M (milli), U (micro) and N (nano). If the unit is missing, the default unit is used.

## Example:

SOUR: RFG: FREQ 1.5GHz is equivalent to

SOUR:RFG:FREQ 1.5E9

# Special numeric values

The texts MINimum, MAXimum, DEFault, UP and DOWN are interpreted as special numeric values. A query returns the associated numerical value.

## Example:

Setting command: SENSe: FREQuency: STARt MINimum

The query SENSe: FREQuency: STARt? returns 300000 (the exact value depends on the analyzer model).

The following special values can be used:

- MIN/MAX MINimum and MAXimum denote the minimum and maximum value of a range of numeric values.
- DEF DEFault denotes the preset value. This value is set by the \*RST command.
- **UP/DOWN** UP, DOWN increases or reduces the numeric value by one step. The step width is reported in the detailed command description.
- INF/NINF Negative INFinity (NINF) represent the numerical values -9.9E37 or +9.9E37, respectively. INF and NINF are only sent as device responses.
- NAN Not a Number (NAN) represents the value 9.91E37. NAN is only sent as device response. This value is not defined. Possible causes are division by zero, subtraction or addition of infinite and the representation of missing values.



Unless it is explicitly stated in the command description you can use the special numeric parameters for all commands of the analyzer.

#### 5.2.3.2 Boolean Parameters

Boolean parameters represent two states. The **ON** state (logically true) is represented by ON or a numerical value different from 0. The **OFF** state (logically false) is represented by **OFF** or the numerical value 0. A query responds with 0 or 1.

Example: Setting command: SWEep:TIME:AUTO ON

Query: SWEep:TIME:AUTO? returns 1

## 5.2.3.3 Text Parameters

Text parameters observe the syntax rules for mnemonics, i.e. they can be entered using a short or long form. Like any parameter, they have to be separated from the header by a white space. In the case of a query, the short form of the text is provided.

Example: Setting command: TRIGger: SOURce EXTernal

Query: TRIGger: SOURce? returns EXT

### 5.2.3.4 Strings

Strings must always be entered within single or double quotation marks (' or ).

Example: CONFigure: CHANnel: NAME "Channel 4" or

CONFigure:CHANnel:NAME 'Channel 4'

#### 5.2.3.5 Block Data Format

Block data is a transmission format which is suitable for the transmission of large amounts of data. A command using a block data parameter with definite length has the following structure:

**Example:** HEADer: HEADer #45168xxxxxxx

The hash symbol # introduces the data block. The next number indicates how many of the following digits describe the length of the data block. In the example the 4 following digits indicate the length to be 5168 bytes. The data bytes follow. During the transmission of these data bytes all End or other control signs are ignored until all bytes are transmitted.

A #0 combination introduces a data block of indefinite length. The use of the indefinite format requires a NL^END message to terminate the data block. This format is useful when the length of the transmission is not known or if speed or other considerations prevent segmentation of the data into blocks of definite length.

### 5.2.3.6 Overview of Syntax Elements

:	The colon separates the mnemonics of a command. In a command line the separating sem- icolon marks the uppermost command level.
;	The semicolon separates two commands of a command line. It does not alter the path.

# www.valuetronics.com

Basic Remote Control Concepts

,	The comma separates several parameters of a command.	
?	The question mark forms a query.	
*	The asterisk marks a common command.	
· · · ·	Quotation marks introduce a string and terminate it.	
#	The hash sign # introduces binary, octal, hexadecimal and block data. Binary: #B10110 Octal: #O7612 Hexadecimal: #HF3A7 Block: #21312	
	A "white space" (ASCII-Code 0 to 9, 11 to 32 decimal, e.g. blank) separates header and parameter.	

# 5.3 Basic Remote Control Concepts

The functionality of the network analyzer's remote control commands has been defined in close analogy to the menu commands and control elements of the graphical user interface (GUI). The basic concepts of recall sets, traces, channels, and diagram areas remain valid in remote control. Moreover, all commands follow SCPI syntax rules, and SCPI-confirmed commands have been used whenever possible. These principles largely simplify the development of remote control scripts.

The GUI and the remote control command set both aim at maximum operating convenience. In manual control this generally means that the control elements are easy to find and intuitive to handle, and that the effect of each operation is easy to verify on the screen. Convenient remote control operation depends on a simple and systematic program syntax and on a predictable instrument state; the display of results is secondary.

These differences suggest the peculiarities in the analyzer's remote control concept discussed in the following sections.

# 5.3.1 Traces, Channels, and Diagram Areas

Like in manual control, traces can be assigned to a channel and displayed in diagram areas (see section Traces, Channels and Diagram Areas in Chapter 3). There are two main differences between manual and remote control:

- A trace can be created without being displayed on the screen.
- A channel must not necessarily contain a trace. Channel and trace configurations are independent of each other.

The following frequently used commands create and delete traces, channels, and diagram areas:

**Basic Remote Control Concepts** 

Create new trace and new channel (if channel <ch> does not exist yet)</ch>	CALCulate <ch>:PARameter:SDEFine '<trace name="">','&lt; Meas Parameter&gt;</trace></ch>
Delete trace	CALCulate <ch>:PARameter:DELete '<trace Name&gt;'</trace </ch>
Create or delete channel	CONFigure:CHANnel <ch>[:STATe] ON   OFF</ch>
Create or delete diagram area	DISPlay:WINDow <wnd>:STATe ON   OFF</wnd>
Display trace in diagram area	DISPlay:WINDow <wnd>:TRACe<wndtr>:FEED</wndtr></wnd>

The assignment between traces, channels, and diagram areas is defined via numeric suffixes as illustrated in the following example:

#### Example:

CALC4:PAR:SDEF 'Ch4Tr1', 'S11'

Create channel 4 (channel suffix 4) and a trace named "Ch4Tr1" to measure the input reflection coefficient S11. The trace is created but not displayed.

DISP:WIND2:STAT ON

Create diagram area no. 2 (window suffix 2).

DISP:WIND2:TRAC9:FEED 'CH4TR1'

Display the generated trace (identified by its name "Ch4Tr1") in diagram area no. 2 (window suffix 2), assigning the trace number 9 (trace suffix 9) to it.

# 5.3.2 Active Traces in Remote Control

In manual control there is always exactly one active trace, irrespective of the number of channels and traces defined. The "active channel" contains the active trace; see chapter 3.1.3.1, "Trace Settings", on page 14.

In remote control, each channel contains an active trace (unless the channel contains no trace at all), so the notion of "active channel" is meaningless. This principle actually simplifies the remote control command syntax, because it allows the active trace in a particular channel to be referenced by means of the channel suffix. No additional trace identifier is needed; there is no need either to distinguish channel and trace settings using mnemonics or suffixes.

The active traces are handled as follows:

- After a preset (\*RST), the analyzer displays a single diagram area with the default trace no. 1 named TRC1. The trace is active in manual and in remote control.
- In manual control, a new, added trace automatically becomes the active trace. To select another trace as the active trace, tap inside the trace list.
- In remote control, a new trace added via CALCulate<Ch>: PARameter: SDEFine '<trace\_name>', '<parameter>' also becomes the active trace. To select another trace as the active trace, use (CALCulate<Ch>: PARameter: SELect '<trace\_name>').
- The active traces for manual and remote control may be different.

The following program example illustrates how to create, select and reference traces. It is instructive to observe the analyzer screen in order to check the effect of each step.

#### Example:

\*RST

Reset the analyzer, creating channel no. 1 with the default trace "Trc1". The trace is displayed in diagram area no. 1.

CALC1:PAR:SDEF 'Trc2', 'S11'; DISP:WIND:TRAC2:FEED 'Trc2'

Create a new trace named "Trc2", assigned to channel no. 1 (the suffix 1 after CALC, may be omitted), and display the trace. The new trace automatically becomes the active trace for manual and for remote control. To check this, tap "Trace – Marker – Marker 1" to create a marker. The marker is assigned to "Trc2". Delete all markers ("Trace – Marker – All Markers Off").

CALC1:MARK ON

## Example:

To verify that "Trc2" is also active for remote control, use the channel suffix 1 after CALC (may be omitted) to reference the active trace in channel 1 and create a marker "Mkr 1". The marker is assigned to "Trc2".

#### Example:

CALC: PAR: SEL 'Trc1'; CALC1: MARK ON

Select the old default trace "Trc1" as the active trace for remote control. Create a new marker to verify that "Trc1" is now the active trace in channel 1.



In the SCPI command description, the numeric suffix <Ch> is used for channel settings (it denotes the configured channel), whereas <Chn> is used for trace settings (it denotes the active trace in the channel).

# 5.3.3 Initiating Measurements, Speed Considerations

After a reset the network analyzer measures in continuous mode. The displayed trace shows the result of the last sweep and is continuously updated. This provides a permanent visual control over the measurement and the effect of any analyzer settings.

In remote control, it is advisable to follow a different approach in order use the analyzer's resources to full capacity and gain measurement speed. The following principles can help to optimize a remote control program (see also programming example in chapter 7.1.1, "Typical Stages of a Remote Control Program", on page 887):

- Switch off the measurement while configuring your instrument.
- Use a minimum number of suitably positioned sweep points.
- Start a single sweep, observing proper command synchronization, and retrieve your results.

The following command sequence performs a single sweep in a single channel.

#### Example:

\*RST; :INITiate:CONTinuous:ALL OFF

Activate single sweep mode for all channels (including the channels created later). INITiate1:IMMediate; \*WAI

Start a single sweep in channel no. 1, wait until the sweep is terminated before proceeding to the next command (see chapter 5.4, "Command Processing", on page 469).



### Sweeps in several channels

It is also possible to subdivide the channels within a recall set into active and inactive channels. The analyzer will then measure in the subset of active channels only; see program example for CONFigure:CHANnel<Ch>:MEASure[:STATe].

# 5.3.4 Addressing Traces and Channels

The analyzer provides a variety of schemes for addressing traces and channels and for querying trace and channel names. The following tables give an overview.

Method	Commands / Example
Channel number <ch> as a numeric suffix</ch>	CONFigure:CHANnel <ch>[:STATe] ON</ch>
Query all channel names	CONFigure:CHANnel:CATalog? (returns the names of all channels)
Assign or query channel name of a channel numbered <ch></ch>	CONFigure:CHANnel <ch>:NAME 'ABCD' CONFigure:CHANnel<ch>:NAME? (returns 'ABCD')</ch></ch>
Query channel number assigned to a channel named 'ABCD'	CONFigure:CHANnel <ch>:NAME:ID? 'ABCD' (returns the actual channel number, the channel suffix is ignored)</ch>

#### Table 5-1: Addressing channels

#### Table 5-2: Addressing traces

Method	Commands / Example
Channel number <chn> used as a reference for the active trace in the channel</chn>	CALCulate <chn>:MARKer<mk>[:STATe] ON</mk></chn>
Trace name (string variable) used as a reference for the trace	CALCulate <ch>:PARameter:DELete '<trace Name&gt;'</trace </ch>
Trace number <trc> as a numeric suffix (exception!)</trc>	CONFigure:TRACe <trc>:NAME?</trc>
Trace number <wndtr> within a particular diagram area <wnd></wnd></wndtr>	DISPlay:WINDow <wnd>:TRACe<wndtr>:FEED</wndtr></wnd>
Query all trace names	CONFigure:TRACe:CATalog? (returns the names of all traces)

# www.valuetronics.com

Method	Commands / Example
Assign or query trace name of a trace numbered <trc></trc>	CONFigure:TRACe <trc>:NAME 'ABCD' CONFigure:TRACe<trc>:NAME? (returns 'ABCD')</trc></trc>
Query trace number assigned to a trace named 'ABCD'	CONFigure:TRACe <trc>:NAME:ID? 'ABCD' (returns the actual trace number; the trace suffix is ignored)</trc>

#### Table 5-3: Mixed commands

Method	Commands / Example
Query channel name for a trace referenced by its trace name	CONFigure:TRACe <trc>:CHANnel:NAME? 'ABCD' (returns the channel name for trace 'ABCD'; the trace suffix is ignored)</trc>
Query channel number for a trace referenced by its trace name	CONFigure:TRACe <trc>:CHANnel:NAME:ID? 'ABCD' (returns the actual channel number for trace 'ABCD'; the trace suffix is ignored)</trc>

# 5.4 Command Processing

The block diagram below shows how GPIB bus commands are serviced in the instrument.

The individual components work independently and simultaneously. They communicate with each other by means of so-called messages.

# 5.4.1 Input Unit

The input unit receives commands character by character from the controller and collects them in the input buffer. The input unit sends a message to the command recognition as soon as the input buffer is full or as soon as it receives a delimiter, <PROGRAM MESSAGE TERMINATOR>, as defined in IEEE 488.2, or the interface message DCL.

If the input buffer is full, the message data traffic is stopped and the data received up to then is processed. Subsequently the traffic is continued. If, however, the buffer is not yet full when receiving the delimiter, the input unit can already receive the next command during command recognition and execution. The receipt of a DCL clears the input buffer and immediately initiates a message to the command recognition.

# 5.4.2 Command Recognition

The command recognition stage analyzes the data received from the input unit. It proceeds in the order in which it receives the data. Only a DCL is serviced with priority, e.g. a GET (Group Execute Trigger) is only executed after the commands received before. Each recognized command is immediately transferred to the data set but not executed immediately. The command recognition detects syntax errors in the commands and transfers them to the status reporting system. The rest of a command line after a syntax error is still executed, if possible. After the syntax check, the range of the numerical parameters is checked, if required.

If the command recognition detects a delimiter or a DCL, it also requests the data set to perform the necessary instrument hardware settings. Subsequently it is immediately prepared to process further commands. This means that new commands can already be serviced while the hardware is still being set (overlapping execution).

# 5.4.3 Data Base and Instrument Hardware

The expression instrument hardware denotes the part of the instrument fulfilling the actual instrument function – signal generation, measurement etc. The controller is not included. The data base manages all the parameters and associated settings required for the instrument hardware.

Setting commands lead to an alteration in the data set. The data set management enters the new values (e.g. frequency) into the data set, however, it only passes them on to the hardware when requested by the command recognition. This can only occur at the end of a command line, therefore the order of the setting commands in the command line is not relevant.

The commands are only checked for their compatibility among each other and with the instrument hardware immediately before they are transmitted to the instrument hardware. If the instrument detects that execution is not possible, an execution error is signalled to the status reporting system. All alterations of the data set are cancelled, the instrument hardware is not reset. Due to the delayed checking and hardware setting, however, impermissible instrument states can be set for a short period of time within one command line without this leading to an error message (example: simultaneous activation of a frequency and a power sweep). At the end of the command line, however, a permissible instrument state must have been reached again.

Before passing on the data to the hardware, the settling bit in the STATUS:OPERation register is set (see chapter 5.5.3.4, "STATUS:OPERation", on page 479). The hardware executes the settings and resets the bit again as soon as the new state has settled. This fact can be used to synchronize command servicing.

Queries induce the data set management to send the desired data to the output unit.

# 5.4.4 Status Reporting System

The status reporting system collects information on the instrument state and makes it available to the output unit on request. The exact structure and function are described in chapter 5.5, "Status Reporting System", on page 472.

# 5.4.5 Output Unit

The output unit collects the information requested by the controller, which it receives from the data set management. It processes it according to the SCPI rules and makes it available in the output buffer. If the information requested is longer, it is made available in portions without this being recognized by the controller.

If the instrument is addressed as a talker without the output buffer containing data or awaiting data from the data set management, the output unit sends the error message Query UNTERMINATED to the status reporting system. No data is sent on the GPIB bus or via the Ethernet, the controller waits until it has reached its time limit. This behavior is specified by SCPI.

# 5.4.6 Command Sequence and Command Synchronization

IEEE 488.2 defines a distinction between overlapped and sequential commands:

- A sequential command is one which finishes executing before the next command starts executing. Commands that are processed quickly are usually implemented as sequential commands.
- An overlapping command is one which does not automatically finish executing before the next command starts executing. Usually, overlapping commands take longer to process and allow the program to do other tasks while being executed. If overlapping commands do have to be executed in a defined order, e.g. in order to avoid wrong measurement results, they must be serviced sequentially. This is called synchronization between the controller and the analyzer.

According to chapter 5.4.3, "Data Base and Instrument Hardware", on page 470, setting commands within one command line, even though they may be implemented as sequential commands, are not necessarily serviced in the order in which they have been received. In order to make sure that commands are actually carried out in a certain order, each command must be sent in a separate command line. Examples:

#### Example 1: Commands and queries in one message

The response to a query combined in a program message with commands that affect the queried value is not predictable. Sending

:FREQ:STAR 1GHZ;SPAN 100

:FREQ:STAR?

always returns 100000000 (1 GHz). When:

:FREQ:STAR 1GHz;STAR?;SPAN 1000000

is sent, however, the result is not specified by SCPI. The result could be the value of STARt before the command was sent since the instrument might defer executing the individual commands until a program message terminator is received. The result could also be 1 GHz if the instrument executes commands as they are received.

As a general rule, send commands and queries in different program messages.

### Example 2: Overlapping command with \*OPC

The analyzer implements INITiate[:IMMediate]... commands as overlapped commands. Assuming e.g. that INITiate[:IMMediate][:DUMMy] takes longer to execute than \*OPC, sending the command sequence

INIT; \*OPC.

results in initiating a sweep and, after some time, setting the OPC bit in the ESR. Sending the commands:

INIT; \*OPC; \*CLS

still initiates a sweep. Since the operation is still pending when the analyzer executes \*CLS, forcing it into the Operation Complete Command Idle State (OCIS), \*OPC is effectively skipped. The OPC bit is not set until the analyzer executes another \*OPC command.



### The analyzer provides only two overlapped commands,

INITiate<Ch>[:IMMediate][:DUMMy] and INITiate<Ch>[:IMMediate]:ALL. What is said below is not relevant for the other (sequential) SCPI commands.



#### Preventing overlapping execution

To prevent an overlapping execution of commands, one of the commands **\*OPC**, \*OPC? or \*WAI can be used. For a programming example refer to chapter 7.1.1.3, "Start of the Measurement and Command Synchronization", on page 888.

Command	Action after the hardware has settled	Programming the controller
*WAI	Stops further command processing until all commands sent before *WAI have been executed Note: The GPIB bus handshake is not stopped	Send *WAI directly after the command which should be terminated before the next command is executed.
*OPC?	Stops command processing until 1 is returned, i.e. until the "Operation Complete" bit has been set in the ESR. This bit indicates that the previous commands have been completed.	Send *OPC? directly after the command which should be terminated before the next command is executed.
*OPC	Sets the operation complete bit in the ESR after all pre- vious commands have been executed.	<ul> <li>Set bit 0 in the ESE</li> <li>Set bit 5 in the SRE</li> <li>Wait for service request (SRQ)</li> </ul>

# 5.5 Status Reporting System

The status reporting system stores all information on the present operating state of the instrument, and on errors which have occurred. This information is stored in the status registers and in the error queue. Both can be queried using the STATUS... commands.

#### Hierarchy of status registers

As shown in section Overview of Status Registers, the status information is of hierarchical structure.

User Manual 1173.9163.02 - 13

• STB, SRE:

The STatus Byte (STB) register and its associated mask register Service Request Enable (SRE) form the highest level of the status reporting system. The STB provides a rough overview of the instrument status, collecting the information of the lower-level registers.

The STB receives its information from:

The Event Status Register (ESR) with the associated mask register standard Event Status Enable (ESE).

The STATus:OPERation and STATus:QUEStionable registers which are defined by SCPI and contain detailed information on the instrument.

- IST, PPE: The IST flag ("Individual STatus"), like the SRQ, combines the entire instrument status in a single bit. The PPE is associated to the IST flag. It fulfills an analogous function for the IST flag as the SRE does for the service request.
- Output buffer: contains the messages the instrument returns to the controller. It is not part of the status reporting system but determines the value of the MAV bit in the STB.

All status registers have the same internal structure, see Structure of an SCPI Status Register.

For more information on the individual status registers see Contents of the Status Registers.




# SRE register

The service request enable register SRE can be used as ENABle part of the STB if the STB is structured according to SCPI. By analogy, the ESE can be used as the ENABle part of the ESR.

# 5.5.1 Overview of Status Registers

The status registers of the R&S ZNB are implemented as shown below.


Status Reporting System

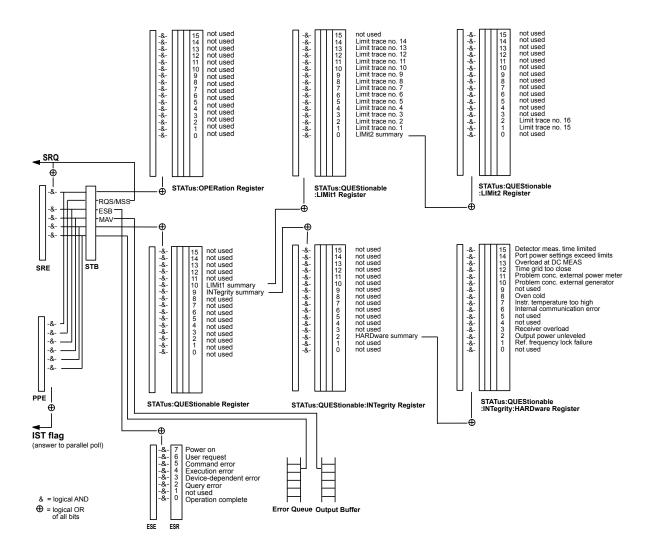

# 5.5.2 Structure of an SCPI Status Register

Each standard SCPI register consists of 5 parts which each have a width of 16 bits and have different functions. The individual bits are independent of each other, i.e. each hardware status is assigned a bit number which is valid for all five parts. Bit 15 (the most significant bit) is set to zero for all parts. Thus the contents of the register parts can be processed by the controller as positive integer.

Status Reporting System

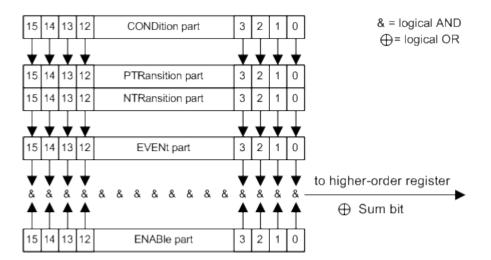

The sum bit is obtained from the EVENt and ENABle part for each register. The result is then entered into a bit of the CONDition part of the higher-order register.

The instrument automatically generates the sum bit for each register. Thus an event can lead to a Service Request throughout all levels of the hierarchy.

The five parts of an SCPI register have different properties and function as described below.

## CONDition

The CONDition part is permanently overwritten by the hardware or the sum bit of the next lower register. Its contents always reflect the current instrument state.

This register part can only be read, but not overwritten or cleared. Reading the CONDition register is nondestructive.

#### PTRansition

The two transition register parts define which state transition of the condition part (none, 0 to 1, 1 to 0 or both) is stored in the EVENt part.

The Positive TRansition part acts as a transition filter. When a bit of the CONDition part is changed from 0 to 1, the associated PTR bit decides whether the EVENt bit is set to 1:

- PTR bit = 1: the EVENt bit is set
- PTR bit = 0: the EVENt bit is not set

This status register part can be overwritten and read at will. Reading the PTRansition register is nondestructive.

## NTRansition

The Negative TRansition part also acts as a transition filter. When a bit of the CONDition part is changed from 1 to 0, the associated NTR bit decides whether the EVENt bit is set to 1.

- NTR bit = 1: the EVENt bit is set.
- NTR bit = 0: the EVENt bit is not set.

This part can be overwritten and read at will. Reading the PTRansition register is nondestructive.

# **EVENt**

The EVENt part indicates whether an event has occurred since the last reading, it is the "memory" of the condition part. It only indicates events passed on by the transition filters. It is permanently updated by the instrument. This part can only be read by the user. Reading the register clears it. This part is often equated with the entire register.

## **ENABle**

The ENABle part determines whether the associated EVENt bit contributes to the sum bit (cf. below). Each bit of the EVENt part is ANDed with the associated ENABle bit (symbol '&'). The results of all logical operations of this part are passed on to the sum bit via an OR function (symbol '+').

- ENAB bit = 0: The associated EVENt bit does not contribute to the sum bit.
- ENAB bit = 1: If the associated EVENT bit is "1", the sum bit is set to "1" as well.

This part can be overwritten and read by the user at will. Its contents are not affected by reading.

The **sum bit** is obtained from the EVENt and ENABle part for each register. The result is then entered into a bit of the CONDition part of the higher-order register. The instrument automatically generates the sum bit for each register. Thus an event can lead to a service request throughout all levels of the hierarchy.

# 5.5.3 Contents of the Status Registers

The individual status registers are used to report different classes of instrument states or errors. The following status registers belong to the general model described in IEEE 488.2:

- The STatus Byte (STB) gives a rough overview of the instrument status.
- The IST flag combines the entire status information into a single bit that can be queried in a Parallel Poll.
- The Event Status Register (ESR) indicates general instrument states.

The status registers below belong to the device-dependent SCPI register model:

- The STATUS: OPERation register contains conditions which are part of the instrument's normal operation.
- The STATus:QUEStionable register indicates whether the data currently being acquired is of questionable quality.
- The STATUS:QUEStionable:LIMit<1|2> register indicates the result of the limit check.
- The STATUS:QUEStionable:INTegrity register monitors hardware failures of the analyzer.

# 5.5.3.1 STB and SRE

The STatus Byte (STB) provides a rough overview of the instrument status by collecting the pieces of information of the lower registers. The STB represents the highest level within the SCPI hierarchy. A special feature is that bit 6 acts as the summary bit of the remaining bits of the status byte.

The STatus Byte (STB) is linked to the Service Request Enable (SRE) register on a bitby-bit basis.

- The STB corresponds to the EVENt part of an SCPI register, indicating the current instrument state. This register is cleared when it is read.
- The SRE corresponds to the ENABle part of an SCPI register. If a bit is set in the SRE and the associated bit in the STB changes from 0 to 1, a Service Request (SRQ) is generated. Bit 6 of the SRE is ignored, because it corresponds to the summary bit of the STB.

The bits in the STB are defined as follows:

Bit No.	Meaning						
2	Error Queue not empty						
	If this bit is enabled by the SRE, each entry of the error queue generates a Service Request (SRQ). Thus an error can be recognized and further pinned down by polling the error queue. The poll provides an informative error message.						
3	QUEStionable status summary bit						
	This bit is set if an EVENt bit is set in the STATus:QUEStionable register and the associated ENABle bit is set to 1.						
	The bit indicates a questionable instrument status, which can be further pinned down by polling the QUEStionable register.						
4	MAV bit (message available)						
	This bit is set if a message is available and can be read from the output buffer.						
	This bit can be used to automatically transfer data from the instrument to the controller.						
5	ESB bit						
	Sum bit of the event status register. It is set if one of the bits in the event status register is set and enabled in the event status enable register.						
	Setting of this bit implies an error or an event which can be further pinned down by polling the event status register.						
6	MSS bit (master status summary bit)						
	This bit is set if the instrument triggers a service request. This is the case if one of the other bits of this registers is set together with its mask bit in the service request enable register SRE.						
7	OPERation status register summary bit						
	This bit is set if an EVENt bit is set in the OPERation-Status register and the associated ENABle bit is set to 1.						
	The bit indicates that the instrument is currently performing an action. The type of action can be determined by polling the STATus:OPERation register.						

### **Related common commands**

The STB is read out using the command \*STB? or a Serial Poll.

The SRE can be set using command \*SRE and read using \*SRE? .

# 5.5.3.2 IST Flag and PPE

In analogy to the <u>Service Request</u> (SRQ), the IST flag combines the entire status information in a single bit. It can be queried by means of a <u>Parallel Poll</u>.

The Parallel Poll Enable (PPE) register determines which bits of the STB contribute to the IST flag. The bits of the STB are ANDed with the corresponding bits of the PPE, with bit 6 being used as well in contrast to the SRE. The IST flag results from the ORing of all results.

### **Related common commands**

The IST flag is queried using the common command \*IST?. The PPE can be set using \*PRE and read using \*PRE?.

See also Common Commands.

# 5.5.3.3 ESR and ESE

The Event Status Register (ESR) indicates general instrument states. It is linked to the Event Status Enable (ESE) register on a bit-by-bit basis.

- The ESR corresponds to the CONDition part of an SCPI register indicating the current instrument state (although reading is destructive).
- The ESE corresponds to the ENABle part of an SCPI register. If a bit is set in the ESE and the associated bit in the ESR changes from 0 to 1, the ESB bit in the STatus Byte is set.

Bit No.	Meaning					
0	Operation Complete					
	This bit is set on receipt of the command *OPC after all previous commands have been executed.					
2	Query Error					
	This bit is set if either the controller wants to read data from the instrument without having sent a query, or if it does not fetch requested data and sends new instructions to the instrument instead. The cause is often a query which is faulty and hence cannot be executed.					
3	Device-Dependent Error					
	This bit is set if a device-dependent error occurs. An error message with a number between –300 and –399 or a positive error number, which describes the error in greater detail, is entered into the error queue. See also chapter 8, "Error Messages and Troubleshooting", on page 917.					
4	Execution Error					
	This bit is set if a received command is syntactically correct, but cannot be performed for other reasons. An error message with a number between –200 and –300, which describes the error in greater detail, is entered into the error queue.					

# www.valuetronics.com

Bit No.	Meaning
5	Command Error
	This bit is set if a command which is undefined or syntactically incorrect is received. An error message with a number between -100 and -200, which describes the error in greater detail, is entered into the error queue.
6	User Request This bit is set when the instrument is switched over to manual control or when a user-defined softkey is used (see SYSTEM: USER: KEY).
7	Power On (supply voltage on)This bit is set when the instrument is switched on.

#### **Related common commands**

The Event Status Register (ESR) can be queried using ESR?. The Event Status Enable (ESE) register can be set using the command \*ESE and read using \*ESE?.

See also Common Commands.

## 5.5.3.4 STATus:OPERation

The STATus:OPERation register contains conditions which are part of the instrument's normal operation. The analyzer does not use the STATus:OPERation register.

# 5.5.3.5 STATus:QUEStionable

The STATUS: QUEStionable register indicates whether the acquired data is of questionable quality and monitors hardware failures of the analyzer. It can be queried using the commands STATus: QUEStionable: CONDition? or STATus: QUEStionable: EVENt?.

Bit No.	Meaning
9	INTegrity register summary
	This bit is set if a bit is set in the STATus:QUEStionable:INTegrity register and the associated ENABle bit is set to 1.
10	LIMit register summary
	This bit is set if a bit is set in the STATus:QUEStionable:LIMit1 register and the associated ENABle bit is set to 1.

#### STATus:QUEStionable:LIMit<1|2>

The STATUS: QUEStionable:LIMit<1|2> registers indicate the result of the limit check. They can be queried using the commands STATus:QUEStionable:LIMit<1|2>:CONDition? or STATus:QUEStionable:LIMit<1|2>[:EVENt]? STATus: QUEStionable: LIMit1 is also the summary register of the lower-level STATus:QUEStionable:LIMit2 register.

The bits in the STATUS: QUEStionable: LIMit1 register are defined as follows:

Bit No.	Meaning
0	LIMit2 register summary
	This bit is set if a bit is set in the STATus:QUEStionable:LIMit2 register and the associated ENABle bit is set to 1.
1	Failed limit check for trace no. 1
	This bit is set if any point on trace no. 1 fails the limit check.
14	Failed limit check for trace no. 14
	This bit is set if any point on trace no. 14 fails the limit check.

The bits in the STATUS: QUEStionable: LIMit2 register are defined as follows:

Bit No.	Meaning
0	Not used
1	Failed Limit Check for Trace no. 15This bit is set if any point on trace no. 15 fails the limit check.
2	Failed Limit Check for Trace no. 16This bit is set if any point on trace no. 16 fails the limit check.

#### Numbering of traces

The traces numbers 1 to 16 are assigned as follows:

- Traces assigned to channels with smaller channel numbers have smaller trace numbers.
- Within a channel, the order of traces reflects their creation time: The oldest trace has the smallest, the newest trace has the largest trace number. This is equivalent to the order of traces in the response string of the CALCulate<Ch>: PARameter: CATalog? query.
- The number of traces monitored cannot exceed 16. If a setup contains more traces, the newest traces are not monitored.

### STATus:QUEStionable:INTegrity...

The STATus:QUEStionable:INTegrity register monitors hardware failures of the analyzer. It can be queried using the commands STATus:QUEStionable:INTegrity:CONDition? Or STATus:QUEStionable:INTegrity[:EVENt]? STATus:QUEStionable:INTegrity is also the summary register of the lower-level STATus:QUEStionable:INTegrity:HARDware register.



Refer to the chapter 8, "Error Messages and Troubleshooting", on page 917 for a detailed description of hardware errors including possible remedies.

The bits in the STATUS:QUEStionable:INTegrity register are defined as follows.

User Manual 1173.9163.02 - 13

# www.valuetronics.com

Bit No.	Meaning
2	HARDware register summary This bit is set if a bit is set in the STATus:QUEStionable:INTegrity:HARDware register and the associated ENABle bit is set to 1.

The STATUS:QUEStionable:INTegrity:HARDware register can be queried using the commands STATUS:QUEStionable:INTegrity:HARDware:CONDition? or STATUS:QUEStionable:INTegrity:HARDware[:EVENt]?

The bits in the STATUS:QUEStionable:INTegrity:HARDware register are defined as follows.

Bit No.	Meaning
0	Not used
1	Reference frequency lock failure
	With external reference signal (System – External Reference active) or option ZVAB-B4 (oven quartz), the reference oscillator is phase locked to a 10 MHz signal. This bit is set if this phase locked loop (PLL) fails.
	For external reference: check frequency and level of the supplied reference signal.
2	Output power unleveled
	This bit is set if the level control at one of the ports is unsettled or unstable, possibly due to an external disturbing signal.
	Change generator level at the port; check external components.
3	Receiver overload protection tripped
	This bit is set if the analyzer detects an excessive input level at one of the ports. If this condition persists, all internal and external generators are switched off.
	Reduce RF input level at the port. Check amplifiers in the external test setup, then switch on the internal source using OUTPut ON.
	Not used
6	Internal communication error
	This bit is set if an internal error caused the analyzer to perform an automatic hardware reset. The current measurement results are possibly invalid.
	The bit is automatically cleared at the beginning of the next sweep, no action is required.
7	Instrument temperature is too high
	This bit is set if the analyzer detects that the instrument temperature is too high.
	Reduce ambient temperature, keep ventilation holes of the casing unobstructed.
8	Oven cold
	This bit is set if the oven for the optional oven quartz (OCXO, option ZVAB-B4) is not at its operating temperature.
	Wait until the oven has been heated up.
9	Unstable level control
	This bit is set if the analyzer detects an excessive source level at one of the ports. The signal is turned off and the sweep halted.
	Check signal path for the received wave, especially check external components. Then restart the sweep (INITiate <ch>[:IMMediate]).</ch>

Bit No.	Meaning					
10	Problem concerning external generator					
	This bit is set if an external generator has been configured but cannot be controlled or pro- vides error messages.					
	Check whether the generator is properly connected and switched on. Check the GPIB address; exclude address conflicts when using several external generators or other equipment.					
11	Problem concerning external power meter					
	This bit is set if an external power meter has been configured but cannot be controlled or provides error messages.					
	Check whether the power meter is properly connected and switched on. Check the GPIB address; exclude address conflicts when using several external power meters or other equipment.					
12	Time grid too close					
	This bit is set if the sweep points for a time sweep are too close, so that the analyzer cannot process the measurement data until the next sweep point starts.					
	Increase stop time, reduce no. of points, increase IF bandwidth. If possible reduce number of partial measurements, e.g. by restricting the number of ports measured.					
13	Overload at DC MEAS					
	This bit is set if the input voltage at one of the DC input connectors on the rear panel is too high.					
	Reduce the input voltage.					
14	Power settings exceed hardware limits					
	This bit is set if the source power at one of the test ports is too high or too low.					
	Reduce or increase the source power.					
15	Detector meas time has been internally limited					
	This bit is set if the selected measurement time for a detector (observation time) is too long. If desired, reduce the measurement time or select a smaller IF bandwidth.					

# 5.5.4 Application of the Status Reporting System

The purpose of the status reporting system is to monitor the status of one or several devices in a measuring system. To do this and react appropriately, the controller must receive and evaluate the information of all devices. The following standard methods described in the following sections are used:

- Service request (SRQ) initiated by the measuring device
- Serial poll of all devices in the bus system, initiated by the controller in order to find out who sent a SRQ and why
- Parallel poll of all devices
- Query of a specific instrument status by means of commands
- Query of the error queue

## 5.5.4.1 Service Request

The R&S ZNB can send a service request (SRQ) to the controller. Usually this service request causes an interrupt, to which the control program can react appropriately.

### Initiating an SRQ

As shown in section Overview of Status Registers, an SRQ is initiated if one or several of bits 2, 3, 4, 5 or 7 of the status byte are set and enabled in the SRE. Each of these bits summarizes the information of a further register, the error queue or the output buffer.

The ENABle parts of the status registers can be set such that arbitrary bits in an arbitrary status register initiate an SRQ. To use the possibilities of the service request effectively, all bits in the enable registers SRE and ESE should be set to "1".

### Example: Use \*OPC to generate an SRQ

- 1. Set bit 0 in the ESE (Operation Complete).
- 2. Set bit 5 in the SRE (ESB).
- 3. Insert **\*OPC** in the command sequence (e.g. at the end of a sweep)

As soon as all commands preceding **\*OPC** have been completed, the instrument generates an SRQ.

#### Example: Generate an SRQ when a limit is exceeded

- 1. Set bit 3 in the SRE (summary bit of the STATUS:QUEStionable register, set after STATUS:PRESet)
- 2. Set bit 10 in the STATUS:QUEStionable:ENABle register (summary bit of the STATUS:QUEStionable:LIMit1 register)
- 3. Set bit 1 in the STATUS: QUEStionable: LIMit1: ENABLe register

The R&S ZNB generates an SRQ when the event associated with bit 1 of the STATus:QUEStionable:LIMit1:ENABle register occurs, i.e. when any point on the first trace fails the limit check.

## Example: Find out which event caused an SRQ

The procedure to find out which event caused an SRQ is analogous the procedure to generate an SRQ:

- STB? (query the contents of the status byte in decimal form) If bit 3 (QUEStionable summary bit) is set, then:
- 2. STAT: QUES: EVENT? (query STATus: QUEStionable register) If bit 10 (QUEStionable:LIMit1 summary bit) is set, then:

3. Query STAT:QUES:LIMit1:EVENT? (query STATus:QUEStionable:LIMit1 register)

If bit 1 is set, then the first trace failed the limit check.



The SRQ is the only possibility for the instrument to become active on its own. Each controller program should set the instrument such that a service request is initiated in the case of malfunction. The program should react appropriately to the service request.

### 5.5.4.2 Serial Poll

In a serial poll, the controller queries the STatus Bytes of the devices in the bus system one after another. The query is made via interface messages, so it is faster than a poll by means of \*STB?.

The serial poll method is defined in IEEE 488.1 and used to be the only standard possibility for different instruments to poll the status byte. The method also works for instruments which do not adhere to SCPI or IEEE 488.2.

The serial poll is mainly used to obtain a fast overview of the state of several instruments connected to the controller.

## 5.5.4.3 Parallel Poll

In a parallel poll, up to eight instruments are simultaneously requested by the controller by means of a single command to transmit 1 bit of information each on the data lines, i.e., to set the data line allocated to each instrument to a logical "0" or "1".

In addition to the SRE register, which determines the conditions under which an SRQ is generated, there is a Parallel Poll Enable register (PPE). This register is ANDed with the STB bit by bit, considering bit 6 as well. The results are ORed, the result is possibly inverted and then sent as a response to the parallel poll of the controller. The result can also be queried without parallel poll by means of the command *\*IST*?

The parallel poll method is mainly used to find out quickly which one of the instruments connected to the controller has sent a service request. To this effect, SRE and PPE must be set to the same value.

### 5.5.4.4 Query of an Instrument Status

Each part of any status register can be read by means of queries. There are two types of commands:

- The common commands \*ESR?, \*IDN?, \*IST?, \*STB? query the higher-level registers.
- The commands of the STATus system query the SCPI registers (e.g. STATus:OPERation...)

All queries return a decimal number which represents the bit pattern of the status register. This number is evaluated by the controller program. Queries are usually used after an SRQ in order to obtain more detailed information on its cause.

### Decimal representation of a bit pattern

The STB and ESR registers contain 8 bits, the SCPI registers 16 bits. The contents of a status register is keyed and transferred as a single decimal number. To make this possible, each bit is assigned a weighted value. The decimal number is calculated as the sum of the weighted values of all bits in the register that are set to 1.

Bits	0	1	2	3	4	5	6	7	
Weight	1	2	4	8	16	32	64	128	

Example: The decimal value 40 = 32 + 8 indicates that bits no. 3 and 5 in the status register (e.g. the QUEStionable status summary bit and the ESB bit in the STB) are set.

### 5.5.4.5 Error Queue

Each error state in the instrument leads to an entry in the error queue. The entries of the error queue are detailed plain text error messages that can be queried via remote control using SYSTem:ERRor[:NEXT]? Or SYSTem:ERRor:ALL?. Each call of SYSTem:ERRor[:NEXT]? provides one entry from the error queue. If no error messages are stored there any more, the instrument responds with 0, "No error".

The error queue should be queried after every SRQ in the controller program as the entries describe the cause of an error more precisely than the status registers. Especially in the test phase of a controller program the error queue should be queried regularly since faulty commands from the controller to the instrument are recorded there as well.

# 5.5.5 Reset Values of the Status Reporting System

The table below indicates the effects of various commands upon the status reporting system of the R&S ZNB.

Event	Switching on sup- ply voltage Power-On-Status- Clear		DCL, SDC (Device Clear, Selected Device Clear)	*RST or SYS- Tem:PRE- Set:ALL	STA- Tus:PRE- Set	*CLS
Effect	0	1				
Clear STB,ESR		yes				yes
Clear SRE,ESE		yes				
Clear PPE		yes				
Clear EVENt parts of the reg- isters		yes				yes

# www.valuetronics.com

Event	Switching on sup- ply voltage Power-On-Status- Clear		DCL, SDC (Device Clear, Selected Device Clear)	*RST or SYS- Tem:PRE- Set:ALL	STA- Tus:PRE- Set	*CLS
Clear ENABle parts of all OPERation-and QUESTiona- ble registers,		yes			yes	
Fill ENABle parts of all other registers with "1".						
Fill PTRansition parts with "1" Clear NTRansition parts		yes			yes	
Clear error queue	yes	yes				yes
Clear output buffer	yes	yes	yes	1)	1)	1)
Clear command processing and input buffer	yes	yes	yes			

1) Every command being the first in a command line, i.e. immediately following a <program MESSAGE TERMINATOR> clears the output buffer.

# 5.6 LXI Configuration

LAN eXtensions for Instrumentation (LXI) is an instrumentation platform for measuring instruments and test systems that is based on standard Ethernet technology. LXI is intended to be the LAN-based successor to GPIB, combining the advantages of Ethernet with the simplicity and familiarity of GPIB.

# 5.6.1 LXI Classes and LXI Functionality

LXI-compliant instruments are divided into three classes, A, B and C, with the functionality of the classes hierarchically based one upon the other:

Class A LXI hardware trigger bus
Class B IEEE 1588 synchronization
Class C <ul> <li>Ethernet LAN interface</li> <li>Web server</li> <li>VXI-11 protocol</li> <li>IVI instrument driver</li> </ul>

- Class C instruments are characterized by a common LAN implementation, including an ICMP ping responder for diagnostics, see Ping Client.
   The instruments can be configured via the LXI Browser Interface; a LAN Configuration Initialize (LCI) mechanism resets the LAN configuration. The LXI class C instruments shall also support automatic detection in a LAN via the VXI-11 discovery protocol and programming by means of IVI drivers.
- Class B adds IEEE 1588 Precision Time Protocol (PTP) and peer-to-peer communication to the base class. IEEE 1588 allows all instruments on the same network to automatically synchronize to the most accurate clock available and then provide time stamps or time-based synchronization signals to all instruments with exceptional accuracy.
- Class A instruments are additionally equipped with the eight-channel hardware trigger bus (LVDS interface) defined in the LXI standard.

Instruments of classes A and B can generate and receive software triggers via LAN messages and communicate with each other without involving the controller.

The network analyzer complies with LXI class C. In addition to the general class C features described above, it provides the following LXI-related functionality:

 Integrated "Remote LXI" dialog for LXI activation and reset of the LAN configuration (LAN Configuration Initialize, LCI); see chapter 4.6.7, "Remote LXI (Dialog)", on page 433.



For information about the LXI standard refer to the LXI website at http://www.lxistandard.org. See also "News from Rohde & Schwarz, issue no. 190 - 2006/II".

# 5.6.2 LXI Browser Interface

The instrument's LXI browser interface works correctly with all W3C compliant browsers. Typing the instrument's host name or IP address in the address field of the browser on your PC, e.g.

"http://10.113.10.203"

opens the "Home" page (welcome page).

B TOHDE&SCHWARZ		
LXI	Instrument Properties	
Home		
Lan Configuration		
Status		7100 1 0 1
Help	Instrument Model	ZNB8 - 4 Port
neip	Manufacturer	Rohde & Schwarz GmbH & Co. KG
www.rohde-schwarz.com	Serial Number	100005
Discussion	Description	Vector Network Analyzer
Diagnostics	LXI Class	C
SCPI Remote Trace	LXI Version	1.2
	Host Name	mu604968.rsint.net
Instrument Control	MAC Address	00:1A:A0:06:7C:4D
File Download	TCP/IP Address	10.113.10.38
File Upload	Firmware Revision	0.20.23
Web Control	<b>Current Time</b>	Friday, 2010/11/26, 11:52:58
	<b>Current Time source</b>	Operating System
License Management	VISA resource string	TCPIP::10.113.10.38::INST0::INSTR
Manage Licenses	Device Indicator	INACTIVE (press to toggle)
	Status	
	No error	

The instrument home page displays the device information required by the LXI standard including the VISA resource string in read-only format. The "Device Indicator" toggle button causes the LXI symbol in the status bar of the analyzer to blink (if active) and updates the "Host Name". A green LXI status symbol indicates that a LAN connection has been established; a red symbol indicates that no LAN cable is connected. The "Device Indicator" setting is not password-protected.

#### Ch1: 4/2 2/21/2011

The navigation pane of the browser interface contains the following control elements:

- "LXI > Lan Configuration" opens the LAN Configuration pages; see chapter 5.6.3, "LAN Configuration", on page 488.
- "LXI > Status" displays information about the LXI status of the instrument.
- "Help" provides a link to the Rohde & Schwarz home page.
- The remaining tabs are for future extensions.

### 5.6.3 LAN Configuration

Comprises the following navigation entries.

•	IP Configuration	489
	Advanced Config	
	Ping Client.	

#### 5.6.3.1 IP Configuration

The LAN configuration parameters required by the LXI standard can be accessed via the navigation entry "IP Configuration".

LXI	LAN Parameters			
Home				
Lan Configuration Configuration Advanced Config		mu604968.rsint.net	_	~
Ping Client	Hostname			
Status	Domain	rsint.net		
Help				
www.rohde-schwarz.com	Description	Vector Network Analyzer		
www.runue-schwarz.com	TCP/IP Mode	DHCP + Auto IP Address 😽		
Diagnostics	IP Address	10.113.10.38		
SCPI Remote Trace	Subnet Mask	255.255.0.0		
Instrument Control	Default Gateway	10.113.0.1		
File Download	DNS Server(s)	10.0.2.166	10.0.23.159	
File Upload	Dynamic DNS	O Disabled		
Web Control	eynamic bits	Enabled		-
License Management		Submit	(Password required!)	4

The "TCP/IP Mode" configuration field controls how the IP address for the instrument gets assigned. For the manual configuration mode, the static IP address, subnet mask, and default gateway are used to configure the LAN. The automatic configuration mode uses DHCP server or Dynamic Link Local Addressing (Automatic IP) to obtain the instrument IP address.



#### **Password protection**

Changing the LAN configuration is password-protected. The password reads **LxiWe-blfc** (notice upper and lower case characters). This password cannot be changed in the current software version.

#### 5.6.3.2 Advanced Config

The navigation entry "Advanced Config" provides LAN settings that are not declared mandatory by the LXI standard.

LXI Configuration

LXI	LAN Parameters		
Home			
Lan Configuration			
IP Configuration			
Advanced Config	Negotiation	Auto Detect 🛛 💌	
Ping Client Status	ICMP Ping	<ul> <li>Disabled</li> <li>Enabled</li> </ul>	
Help	VXI-11 Discovery	<ul> <li>Disabled</li> <li>Enabled</li> </ul>	
Diagnostics	mDNS and DNS-SD	<ul><li>● Disabled</li><li>● Enabled</li></ul>	
SCPI Remote Trace		Submit	(Password uired!)
Instrument Control			
File Download			
File Upload			
Web Control			
License Management			

The advanced LAN configuration parameters are used as follows:

- "Negotiation": The negotiation configuration field provides different Ethernet speed and duplex mode settings. In general, the "Auto Detect" mode is sufficient.
- "ICMP Ping" must be enabled to use the ping utility.
- "VXI-11 Discovery" and "mDNS and DNS-SD" are protocols which can be used for discovery of the instrument in the LAN. The VXI-11 discovery mechanism is a requirement on LXI devices from the first revision of the standard. Support for the multicast DNS (mDNS) and DNS-SD (DNS Service Discovery) mechanisms has been introduced as a requirement in version 1.3 of the standard. The R&S ZNB supports both discovery mechanisms.



#### Password protection

Changing the LAN configuration is password-protected. The password reads **LxiWe-blfc** (notice upper and lower case characters). This password cannot be changed in the current software version.

#### 5.6.3.3 Ping Client

Ping is a utility that verifies the connection between the LXI-compliant instrument and another device. The ping is initiated from the instrument. It uses the ICMP echo request and echo reply packets to determine whether the LAN connection to another device is functional. Ping is useful for diagnosing IP network or router failures.

The ping utility is not password-protected. To initiate a ping at the instrument:

- 1. Ensure that "ICMP Ping" is enabled (see Advanced Config).
- Enter the IP address of the second device into the "Destination Address" field (e.g. 10.123.10.0).
- 3. Click Submit.

### Remote Control

LXI Configuration

LXI	Ping Parameter		
Home			
Lan Configuration			
Status	Destination		
Help	Address		
		Clear Submit	
www.rohde-schwarz.com		Pinging 10.113.10.0 with 32 bytes of data:	1
<b>P</b> <sup>1</sup>		Finging 10.113.10.0 with 32 bytes of data.	
Diagnostics		Reply from 10.113.10.0: bytes=32 time<1ms TTL=128	
SCPI Remote Trace		Reply from 10.113.10.0: bytes=32 time<1ms TTL=128	
	Result	Reply from 10.113.10.0: bytes=32 time<1ms TTL=128	
Instrument Control	Result	Reply from 10.113.10.0: bytes=32 time<1ms TTL=128	
File Download		Ping statistics for 10.113.10.0:	
File Upload		Packets: Sent = 4, Received = 4, Lost = 0 (0%)	
· · · · · · · · · · · · · · · · · · ·		loss),	
Web Control			
License Management			
Manage Licenses			

# 6 Command Reference

This chapter describes all common commands and SCPI commands implemented by the analyzer.



#### Validity of the command set

The commands reported in this chapter are valid for vector network analyzers with 2 or 4 ports. Some of the program examples assume a four-port instrument. In most cases, a simple adjustment of the port power suffixes or parameters will ensure compatibility with 2-port analyzers.

#### Compatibility with R&S ZVB and older instruments

The SCPI command set for the R&S ZNB vector network analyzer has been designed for compatibility with network analyzers R&S ZVA and R&S ZVB. A special subset of commands has been implemented for compatibility with older analyzers of the R&S ZVR family. These commands are listed in chapter 6.4, "R&S ZVR/ZVAB Compatible Commands", on page 863.

If you want to make full use of the R&S ZNB features but do not need R&S ZVR compatibility, you should use the commands listed in chapter 6.3, "SCPI Command Reference", on page 495.

## 6.1 Special Terms and Notation

This section explains the meaning of special syntax elements used in the SCPI command reference sections.

The following information is provided in the reference sections:

- Complete command syntax and parameter list
- Description of the command and its relationship with other commands
- List and description of the parameters with their numerical ranges, default values and default units
- Supported command types (setting command, query). If nothing is mentioned, the command can be used to write **and** read data (setting command and query).
- Program example

The SCPI conformance information is stated at the beginning of each section. Unless otherwise stated, the commands are device-specific.

The commands are generally arranged in alphabetical order. Commands with similar function (e.g. a pair of ... STARt and ... STOP commands) may be described in a common section, which in some instances disrupts the strict alphabetical order.

## 6.1.1 Upper/Lower Case

Upper/lower case characters characterize the long and short form of the mnemonics in a command. The short form consists of all upper-case characters, the long form of all upper case plus all lower case characters. It is recommended to use either the short form or the long form; mixed forms are not always recognized. The R&S ZNB itself does not distinguish upper case and lower case characters.

## 6.1.2 Special Characters

The following special characters are frequencly used in the command description:

- | A vertical stroke characterizes alternative parameter settings. Only one of the parameters separated by | must be selected.
- [] Mnemonics in square brackets can be omitted when composing the command header. The complete command must be recognized by the instrument for reasons of compatibility with the SCPI standard. Parameters in square brackets are optional as well. They may be used in some application contexts, omitted in others.
- { } Braces or curly brackets enclose one or more parameters that may be included zero or more times.

## 6.1.3 Parameters

Many commands are supplemented by a parameter or a list of parameters. Parameters either provide alternative options (setting a or setting b or setting c ..., see special character "|"), or they form a list separated by commas (setting x, y).

- <Parameter1>, <Parameter2>...: In the command tables and lists, parameters are generally described by a name (Parameter1, Parameter2...) written in angle brackets (<>). In an application program, <Parameter1>, <Parameter2>.... must be replaced by one of the possible settings reported in the detailed parameter description.
   Example: CONTrol:AUXiliary:C[:DATA] <DecValue> with <DecValue> = 0 to 255

   --> possible command syntax: CONTrol:AUXiliary:C:DATA 1
- NAN (Not A Number) (as a returned value) is generally used to represent missing data, e.g. if a portion of a trace has not been acquired yet. It is also returned after invalid mathematical operations such as division by zero. As defined in the SCPI standard, NAN is represented as 9.91 E 37.
- **INV (INValid)** is returned e.g. if a limit check is performed without defining the appropriate tolerance values.

## 6.1.4 Numeric Suffixes

Symbols in angular brackets (<Ch>, <Chn>, <Mk>...) are numeric suffixes. Numeric suffixes are replaced by integer numbers to distinguish various items of the same type. The analyzer provides numeric suffixes for channels, traces, ports, markers etc. If unspecified, a numeric suffix is replaced by 1. The marker suffix must be in the range between 1 and 10, the number of ports depends on the analyzer model. No restrictions apply to channel, trace, and diagram suffixes.

In remote control, one active trace can be selected for each channel; see chapter 5.3.2, "Active Traces in Remote Control", on page 466. This concept simplifies the remote control command syntax, because it allows the active trace in a particular channel to be referenced by means of the channel suffix. To keep the syntax transparent, <Ch> is used for channel settings (it denotes the configured channel), whereas <Chn> is used for trace settings (it denotes the active trace in the channel).

## 6.2 Common Commands

Common commands are described in the IEEE 488.2 (IEC 625-2) standard. These commands have the same effect and are employed in the same way on different devices. The headers of these commands consist of "\*" followed by three letters. Many common commands are related to the status reporting system; see chapter 5.5, "Status Reporting System", on page 472.

Command	Parameters / Remarks	Short Description
*CLS CLear Status	– / no query	Sets the status byte (STB), the standard event register (ESR) and the EVENt part of the QUEStionable and the OPERation register to zero. The command does not alter the mask and transition parts of the registers. It clears the output buffer and the tooltip error messages for remote control.
*ESE Event Status Enable	0255	Sets the event status enable register to the value indicated. The query *ESE? returns the contents of the event status enable register in decimal form.
*ESR? Event Status Read	– / query only	Returns the contents of the event status register in decimal form (0 to 255) and subsequently sets the register to zero.
*IDN? IDentification Query	– / query only	Queries the instrument identification string of the R&S ZNB, including the manu- facturer, the instrument type, its serial number, and the software revision. The response is of the form "Rohde&Schwarz,ZNB <max. freq="">- <ports>Port,<serial_no>,<fw_version> (e.g. Rohde-Schwarz,ZNB8-2Port, 1311.6010.42,12345,1.10.12)".</fw_version></serial_no></ports></max.>
		The IDN information is editable; see "Define *IDN? + *OPT?" on page 432.
*IST? Individual STatus query	– / query only	Returns the contents of the IST flag in decimal form (0   1). The IST-flag is the status bit which is sent during a parallel poll.
*OPC OPeration Complete	-	Sets bit 0 in the event status register when all preceding commands have been executed. This bit can be used to initiate a service request. The query form writes a "1" into the output buffer as soon as all preceding commands have been executed. This is used for command synchronization.
* <b>OPT?</b> OPTion identification query	– query only	Queries the options included in the instrument and returns a list of the options installed. The response consists of arbitrary ASCII response data according to IEEE 488.2. The options are returned at fixed positions in a comma separated string. A zero is returned for options that are not installed. The OPT information is editable; see "Define *IDN? + *OPT?" on page 432.

Table 6-1: List of common commands

## www.valuetronics.com

Command	Parameters / Remarks	Short Description
*PCB Pass Control Back	030 / no query	Indicates the controller address to which GPIB bus control is returned after ter- mination of the triggered action.
* <b>PRE</b> Parallel poll Register Enable	0255	Sets parallel poll enable register to the value indicated. Query *PRE? returns the contents of the parallel poll enable register in decimal form.
* <b>PSC</b> Power on Status Clear	0   1	Determines whether the contents of the ENABle registers is maintained or reset when the instrument is switched on. *PSC = 0 causes the contents of the status registers to be maintained. Thus a service request can be triggered on switching on in the case of a corresponding configuration of status registers ESE and SRE. *PSC = 0 resets the registers. Query *PSC? reads out the contents of the power- on-status-clear flag. The response can be 0 or 1.
* <b>RST</b> ReSeT	– / no query	Sets the instrument to a defined default status. The command is equivalent to SYSTem:PRESet[:DUMMy]. The *RST value of each command is reported in the reference description. See also SYSTem:PRESet:SCOPe.
* <b>SRE</b> Service Request Enable	0255	Sets the service request enable register to the value indicated. Bit 6 (MSS mask bit) remains 0. This command determines under which conditions a service request is triggered. The query *SRE? returns the contents of the service request enable register in decimal form. Bit 6 is always 0.
* <b>STB?</b> STatus Byte query	– / query only	Reads the contents of the status byte in decimal form.
* <b>TRG</b> TRiGger	– / no query	Triggers all actions waiting for a trigger event. *TRG generates a manual trigger signal. This common command complements the TRIGger commands of the analyzer.
* <b>WAI</b> WAIt to continue	– / no query	Prevents servicing of the subsequent commands until all preceding commands have been executed and all signals have settled.

## 6.3 SCPI Command Reference

The following sections provide detailed reference information on the instrument control commands implemented by the R&S ZNB network analyzer.

•	CALCulate Commands	496
•	CONFigure Commands	
•	CONTrol Commands	
•	DIAGnostic Commands	
•	DISPlay Commands	
•	FORMat Commands	
•	HCOPy Commands	
•	INITiate Commands	
•	INSTrument Commands	640
•	MEMory	
•	MMEMory Commands	
•	OUTPut Commands	671
•	PROGram Commands	
•	[SENSe:] Commands	
•	SOURce Commands	

SCPI Command Reference

٠	STATus Commands	820
٠	SYSTem Commands	823
•	TRACe Commands	854
•	TRIGger Commands	857

## 6.3.1 CALCulate Commands

The CALCulate... commands perform post-acquisition data processing. Functions in the SENSe subsystem are related to data acquisition, while the CALCulate subsystem operates on the data acquired by a SENSe function.

#### 6.3.1.1 CALCulate:CLIMits...

The CALCulate:CLIMits... commands control the composite limit check.

#### CALCulate:CLIMits:FAIL?

Returns a 0 or 1 to indicate whether or not a global, composite limit check on several traces has failed.

Example:	*RST; CALC:LIM:CONT 1 GHZ, 2 GHZ
	Define an upper limit line segment in the stimulus range between
	1 GHz and 2 GHz, using default response values.
	CALC:LIM:STAT ON; FAIL?
	Switch the limit check on and query the result.
	CALC:CLIM:FAIL?
	Query the result for the composite limit check. As only one trace is tested, the response should be equal to the previous response.
Usage:	Query only
Manual control:	See "Global Check" on page 226

#### 6.3.1.2 CALCulate:DATA...

The CALCulate: DATA... commands provide access to the results of a measurement.



#### Data format

The trace data is transferred in either ASCII or block data (REAL) format, depending on the FORMat[:DATA] setting. If block data format is used, it is recommended to select EOI as a receive terminator (SYSTem:COMMunicate:GPIB[:SELF]:RTERminator EOI).

CALCulate <chn>:DATA</chn>	497
CALCulate:DATA:ALL?	499
CALCulate <ch>:DATA:CALL?</ch>	500
CALCulate <ch>:DATA:CALL:CATalog?</ch>	500
CALCulate:DATA:DALL?	500

SCPI Command Reference

CALCulate <chn>:DATA:NSWeep:COUNt?</chn>	
CALCulate <chn>:DATA:NSWeep:FIRSt?</chn>	
CALCulate <chn>:DATA:NSWeep[:LAST]?</chn>	
CALCulate <ch>:DATA:SGRoup?</ch>	
CALCulate <chn>:DATA:STIMulus?</chn>	
CALCulate:DATA:TRACe?	

#### CALCulate<Chn>:DATA <Format>, <Data>... CALCulate<Chn>:DATA? <Format>

Reads the current response values of the active data trace, reads or writes a memory trace, and reads or writes error terms.

The data format of the returned values is parameter-dependent; see tables below. The unit is the default unit of the measured parameter; see CALCulate<Ch>: PARameter:SDEFine.

Suffix: <Chn>

<Data>

<Format>

Channel number used to identify the active trace. If unspecified
the numeric suffix is set to 1.

#### Parameters:

<block\_data>

Unformatted trace data in ASCII or block data format, depending on FORMat [:DATA] setting. This parameter is only used for writing memory traces; see second example below.

#### Parameters for setting and query:

FDATa | SDATa | MDATa | TSData | NCData | SCORr1 | SCORr2 | SCORr3 | SCORr4 | SCORr5 | SCORr6 | SCORr7 | SCORr8 | SCORr9 | SCORr10 | SCORr11 | SCORr12 | SCORr13 | SCORr14 | SCORr15 | SCORr16 | SCORr17 | SCORr18 | SCORr19 | SCORr20 | SCORr21 | SCORr22 | SCORr23 | SCORr24 | SCORr25 | SCORr26 | SCORr27

See list of parameters below.

Example:	*RST; SWE:POIN 20
	Create a trace with 20 sweep points, making the created trace the active trace of channel 1 (omitted optional mnemonic SENSe1). CALC:DATA? FDAT
	Query the 20 response values of the created trace. In the FDATa setting, 20 comma-separated ASCII values are returned. CALC:DATA:STIM?
	Query the 20 stimulus values of the created trace. 20 comma- separated ASCII values are returned. CALC2:PAR:SDEF 'Trc2', 'S11'
	Create a second trace in a new channel no. 2. The second trace does not become the active trace and is not displayed. CALC:DATA:TRAC? 'Trc2', FDAT
	Query the response values of the second (non-active) trace. 20 comma-separated ASCII values are returned.
	Query the response values of all traces. 40 comma-separated ASCII values are returned.
Example:	Writing memory traces *RST; SWE:POIN 3
Example:	*RST; SWE: POIN 3 Create a data trace 'Trc1' with 3 sweep points, making the created trace the active trace of channel 1 (omitted optional mnemonic
Example:	*RST; SWE:POIN 3 Create a data trace 'Trc1' with 3 sweep points, making the created trace the active trace of channel 1 (omitted optional mnemonic SENSe1). TRAC:COPY 'MemTrc1', 'Trc1'; :CALC:PAR:SEL
Example:	*RST; SWE:POIN 3 Create a data trace 'Trc1' with 3 sweep points, making the created trace the active trace of channel 1 (omitted optional mnemonic SENSe1). TRAC:COPY 'MemTrc1', 'Trc1'; :CALC:PAR:SEL 'MemTrc1' Copy the data trace to a memory trace and select the memory trace as an active trace.
Example:	*RST; SWE:POIN 3 Create a data trace 'Trc1' with 3 sweep points, making the created trace the active trace of channel 1 (omitted optional mnemonic SENSe1). TRAC:COPY 'MemTrc1', 'Trc1'; :CALC:PAR:SEL 'MemTrc1' Copy the data trace to a memory trace and select the memory trace as an active trace. CALC:DATA SDAT, 1,2, 3,4, 5,6
Example:	<pre>*RST; SWE:POIN 3 Create a data trace 'Trc1' with 3 sweep points, making the created trace the active trace of channel 1 (omitted optional mnemonic SENSe1). TRAC:COPY 'MemTrc1', 'Trc1'; :CALC:PAR:SEL 'MemTrc1' Copy the data trace to a memory trace and select the memory trace as an active trace. CALC:DATA SDAT, 1,2, 3,4, 5,6 Write numbers (1,2), (3,4), (5,6) to the memory trace. CALC:DATA? SDAT</pre>
Example:	<pre>*RST; SWE:POIN 3 Create a data trace 'Trc1' with 3 sweep points, making the created trace the active trace of channel 1 (omitted optional mnemonic SENSe1). TRAC:COPY 'MemTrc1', 'Trc1'; :CALC:PAR:SEL 'MemTrc1' Copy the data trace to a memory trace and select the memory trace as an active trace. CALC:DATA SDAT, 1,2, 3,4, 5,6 Write numbers (1,2), (3,4), (5,6) to the memory trace.</pre>
Example:	*RST; SWE:POIN 3 Create a data trace 'Trc1' with 3 sweep points, making the created trace the active trace of channel 1 (omitted optional mnemonic SENSe1). TRAC:COPY 'MemTrc1', 'Trc1'; :CALC:PAR:SEL 'MemTrc1' Copy the data trace to a memory trace and select the memory trace as an active trace. CALC:DATA SDAT, 1,2, 3,4, 5,6 Write numbers (1,2), (3,4), (5,6) to the memory trace. CALC:DATA? SDAT Query the memory trace. The response is 1,2,3,4,5,6.

The following parameters are related to trace data (see also diagram in chapter 3.1.5, "Data Flow", on page 18):

FDATa	Formatted trace data, according to the selected trace format (CALCu- late <ch>:FORMat). 1 value per trace point for Cartesian diagrams, 2 values for polar diagrams.</ch>
SDATa	Unformatted trace data: Real and imaginary part of each measurement point. 2 values per trace point irrespective of the selected trace format. The trace mathematics is not taken into account.
MDATa	Unformatted trace data (see SDATa) after evaluation of the trace mathematics.

The following parameters denote the error terms generated during a calibration.

Error Term	Description	Receive Ports (S-parameter)
SCORr1,, SCORr12	2-port error terms; see [SENSe <ch>: ]CORRection:DATA.</ch>	1 and 2 (S11, S12, S21, S22)
SCORr13	Directivity	3 (\$33)
SCORr14	Source match	3 (\$33)
SCORr15	Reflection tracking	3 (\$33)
SCORr16	Isolation	3 (S31)
SCORr17	Load match	3 (S31)
SCORr18	Transmission tracking	3 (S13)
SCORr19	Isolation	1 (S13)
SCORr20	Load match	1 (S13)
SCORr21	Transmission tracking	1 (S13)
SCORr22	Isolation	3 (\$32)
SCORr23	Load match	3 (\$32)
SCORr24	Transmission tracking	3 (\$32)
SCORr25	Isolation	2 (S23)
SCORr26	Load match	2 (S23)
SCORr27	Transmission tracking	2 (S23)

	Table	6-3:	Error	terms	in :	the	CAL	Culat	te:D	ATA	commands
--	-------	------	-------	-------	------	-----	-----	-------	------	-----	----------

**Note:** The error terms are channel-specific; they apply to the active calibration of channel no. <Chn> or to the factory calibration (if no channel calibration is active). For the factory calibration, the query form is allowed only (no change of factory calibration data).

**Tip:** Use the generalized command [SENSe<Ch>:]CORRection:CDATa to read or write error terms for arbitrary analyzer ports. For additional programming examples refer to chapter 7.2.5.2, "Saving and Recalling Error Terms", on page 913.

#### CALCulate:DATA:ALL? <Format>

Reads the current response values of all traces of the current recall set.

#### Query parameters:

<format></format>	FDATa   SDATa   MDATa			
	Output format for the S-parameter data, see CALCulate <chn>:DATA.</chn>			
<b>Return values:</b> <data></data>	<block_data></block_data>			
Example:	See CALCulate <chn>:DATA</chn>			
Usage:	Query only			

#### CALCulate<Ch>:DATA:CALL? <Format>

Reads the current response values of all S-parameter data traces in channel no. <Ch>. If a full n-port system error correction (TOSM, TOM, TRL ...) is active in the referenced channel, the command reads the full nxn S-matrix of the calibrated ports (there is no need to create or display the S-parameter traces). Use CALCulate<Ch>:DATA:CALL: CATalog? to query the available traces.

<b>Suffix:</b> <ch></ch>	Channel number		
Query parameters: <format></format>	FDATa   SDATa   MDATa Output format for the S-parameter data; see CALCulate <chn>: DATA. *RST: n/a</chn>		
<b>Return values:</b> <data></data>	<block_data></block_data>		
Example:	Suppose that a TOSM calibration for ports 1 and 2 is active in channel no. 1. CALCulate:DATA:CALL:CATalog? Query the traces available for CALCulate <ch>:DATA:CALL?. The response is 'S11,S12,S21,S22'. CALCulate:DATA:CALL? SDATa Return the complex response values of all traces. The traces in the catalog list are read one after another: The response array contains n (number of points) pairs of real and imaginary values for S<sub>11</sub>, followed by n pairs of values for S<sub>12</sub>, S<sub>21</sub>, and S<sub>22</sub>.</ch>		
Usage:	Query only		

#### CALCulate<Ch>:DATA:CALL:CATalog?

Returns all traces which are available for CALCulate<Ch>: DATA: CALL? in channel no. <Ch>. The response is a string parameter with all S-parameter traces in the current channel or in the active system error correction; see example.

Suffix: <ch></ch>	Channel number
Example:	See CALCulate <ch>:DATA:CALL?</ch>
Usage:	Query only

#### CALCulate:DATA:DALL? <Format>

Reads the current response values of all data traces of the current recall set. Use CALCulate: DATA: ALL? to query data traces and memory traces.

Query parameters:	
<format></format>	FDATa   SDATa   MDATa
	Output format for the S-parameter data, see
Return values:	
<data></data>	<block_data></block_data>
Example:	Analogous to CALCulate:DATA:DALL?; see
	CALCulate <chn>:DATA.</chn>
Usage:	Query only

#### CALCulate<Chn>:DATA:NSWeep:COUNt?

Reads the number of completed sweeps in single sweep mode (INITiate<Ch>: CONTINUOUSOFF). The trace can be any of the traces acquired during the single sweep cycle.

Tip:

This command can only be used for [SENSe<Ch>:]SWEep:COUNt > 1.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Example:	See CALCulate <chn>:DATA:NSWeep:FIRSt?</chn>
Usage:	Query only

CALCulate<Chn>:DATA:NSWeep:FIRSt? <Format>[, <FwCount>, <FwCountEnd>]

Reads the response values of a trace or a consecutive group of traces acquired in single sweep mode (INITiate<Ch>: CONTinuous OFF).

Tip:

This command can only be used for [SENSe<Ch>:]SWEep:COUNt > 1.

Suffix:

<Format>

<Chn> Channel number used to identify the active trace.

#### Query parameters:

SDATa

Read unformatted sweep data (fixed parameter): Returns the real and imaginary part of each measurement point (2 values per trace point irrespective of the selected trace format).

<FwCount> Number of first sweep to be read. 1 denotes the first sweep acquired, 2 denotes the second and so forth. The sweep count in single sweep mode is defined via [SENSe<Ch>:]SWEep: COUNt.

Range: 1 to sweep count

<fwcountend></fwcountend>	Number of last sweep to be read. If this parameter is omitted, it is implicitly set to <fwcount> (a single sweep is read). Range: <fwcount> to sweep count</fwcount></fwcount>
<b>Return values:</b> <data></data>	<block_data></block_data>
Example:	<pre>SWE:COUN 10 Define the number of sweeps (10) to be measured in single sweep mode. INIT:CONT OFF; :INIT; Activate single sweep mode and start a single sweep sequence in channel no. 1. No synchronization is necessary. if (CALC:DATA:NSW:COUN? &gt; 4) CALC:DATA:NSW:FIRS? SDAT, 5 Wait until 5 sweeps have been measured, then query the results of the 5<sup>th</sup> sweep. See also chapter 7.2.4.3, "Retrieving the Results of Previous Sweeps", on page 910.</pre>
Usage:	Query only

#### CALCulate<Chn>:DATA:NSWeep[:LAST]? <Format>, <RvCount>

Reads the response values of a trace acquired in single sweep mode ( INITiate<Ch>: CONTinuousOFF). The trace can be any of the traces acquired during the single sweep cycle.

Tip:

- This command can only be used for [SENSe<Ch>:]SWEep:COUNt > 1.
- Ensure that the single sweep is terminated before using this command, otherwise the • results of the trace count will be unpredictable (see example below). Alternatively, use the CALCulate<Chn>:DATA:NSWeep:FIRSt? command.

S	uff	ïх
-		

		±
Suffix: <chn></chn>	Channel n	umber used to identify the active trace.
Query parameters: <format></format>	SDATa	
	and imagii	rmatted sweep data (fixed parameter): Returns the real nary part of each measurement point (2 values per trace spective of the selected trace format).
<rvcount></rvcount>		f sweep to be read. 1 denotes the last sweep acquired, the second-last and so forth.
	Range:	1 to sweep count defined via [SENSe <ch>:]SWEep:COUNt</ch>

Example:	<pre>SWE:COUN 10 Define the number of sweeps (10) to be measured in single sweep mode. INIT:CONT OFF; :INIT; *OPC? Activate single sweep mode and start a single sweep sequence in channel no. 1. Wait until the single sweep sequence is complete. CALC:DATA:NSW? SDAT, 3 Query the results of the 8<sup>th</sup> sweep. See also chapter 7.2.4.3, "Retrieving the Results of Previous Sweeps", on page 910.</pre>
Usage:	Query only

#### CALCulate<Ch>:DATA:SGRoup? <Format>

Reads the current response values of all S-parameters associated to a group of logical ports (S-parameter group). The S-parameter group must be created before using CALCulate<Ch>: PARameter: DEFine: SGRoup.

Suffix: <ch></ch>	Channel number of the previously defined S-parameter group.
Query parameters: <format></format>	FDATa   SDATa   MDATa Output format for the S-parameter data, see CALCulate <chn>: DATA on page 497.</chn>
Example:	See CALCulate <ch>: PARameter: DEFine: SGRoup</ch>
Usage:	Query only

#### CALCulate<Chn>:DATA:STIMulus?

Reads the stimulus values of the active data or memory trace.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.
Example:	See CALCulate <chn>:DATA</chn>
Usage:	Query only

#### CALCulate:DATA:TRACe? <TraceName>, <Format>

Queries the trace data of an arbitrary (not necessarily the active) trace, referenced by its trace name <TraceName>.

#### Parameters:

<TraceName> String parameter containing the trace name

<format></format>	FDATa   SDATa   MDATa   NCData
	Data format; see Data format identifiers used in the CALCu- late:DATA commands.
Example:	See Data format identifiers used in the CALCulate:DATA commands.
Usage:	Query only

#### 6.3.1.3 CALCulate:DLINe...

The CALCulate:DLINe... commands control the horizontal line used to mark and retrieve response values (display line).

CALCulate <chn>:DLINe</chn>	604
CALCulate <chn>:DLINe:STATe5</chn>	604

#### CALCulate<Chn>:DLINe <Position>

Defines the position (response value) of the horizontal line.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <position></position>	See list of parameters below. Range: -200 dB to +200 dB *RST: 0 dB Default unit: dBm
Example:	*RST; :CALC:DLIN 10 Define the position of the horizontal line in the default dB Mag dia- gram at +10 dB. CALC:DLIN:STAT ON Display the defined horizontal line.
Manual control:	See "Response Value" on page 237

#### CALCulate<Chn>:DLINe:STATe <Boolean>

Switches the horizontal line on or off.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <boolean></boolean>	ON   OFF - horizontal line on or off *RST: OFF
Example:	See CALCulate <chn>:DLINe</chn>
Manual control:	See "Horizontal Line" on page 237

#### 6.3.1.4 CALCulate:FILTer[:GATE]...

The CALCulate:FILTer[:GATE]... commands define the properties of the time gate which is used to optimize the time domain response.

CALCulate:FILTer[:GATE]:TIME:AOFFset	
CALCulate <chn>:FILTer[:GATE]:TIME:CENTer</chn>	505
CALCulate <chn>:FILTer[:GATE]:TIME:DCHebyshev</chn>	506
CALCulate <chn>:FILTer[:GATE]:TIME:SHAPe</chn>	506
CALCulate <chn>:FILTer[:GATE]:TIME:SHOW</chn>	507
CALCulate <chn>:FILTer[:GATE]:TIME:SPAN</chn>	507
CALCulate <chn>:FILTer[:GATE]:TIME:STATe</chn>	507
CALCulate <chn>:FILTer[:GATE]:TIME:STARt</chn>	508
CALCulate <chn>:FILTer[:GATE]:TIME:STOP</chn>	508
CALCulate <chn>:FILTer[:GATE]:TIME:WINDow</chn>	508
CALCulate <chn>:FILTer[:GATE]:TIME[:TYPE]</chn>	509

#### CALCulate:FILTer[:GATE]:TIME:AOFFset <Boolean>

Activates the operating mode where the time gate is moved in the opposite direction when the "Delay" setting is changed.

Parameters:	
<boolean></boolean>	ON   OFF - enable or disable "Adjust Time Gate".
	*RST: OFF
Example:	<pre>*RST; :CALCulate1:TRANsform:TIME:STATE ON CALCulate1:FILTer:GATE:TIME:STATE ON; SHOW ON Activate time domain representation and a time gate in channel no. 1. Display the time gate CALCulate1:FILTer:GATE:TIME:STARt 2ns; STOP 3 ns Restrict the time gate to the time interval between 2 ns and 3 ns. CALCulate:FILTer:GATE:TIME:AOFFset ON Activate an offset of the time gate according to a new delay setting. SENSe1:CORRection:EDELay1:TIME 1ns Specify a 1 ns delay at port 1. CALCulate1:FILTer:GATE:TIME:STARt?; STOP? Query the time gate position. The response is 1E-009;2E-009.</pre>
Manual control:	See "Adjust Time Gate" on page 394

#### CALCulate<Chn>:FILTer[:GATE]:TIME:CENTer <CenterTime>

Defines the center time of the time gate.

Suffix: <Chn>

Channel number used to identify the active trace.

Parameters: <centertime></centertime>	Center time of the time gate Range: -99.8999999 s to +99.8999999 s Increment: 0.1 ns *RST: 1.5E-009 s Default unit: s
Example:	*RST; :CALC:TRAN:TIME:STAT ON; :CALC:FILT:TIME: STAT ON Reset the instrument and enable the time domain representation and the time gate. CALC:FILT:TIME:CENT 0; SPAN 5ns Set the center time to 0 ns and the time span to 5 ns.
Manual control:	See "Axis Pair" on page 209

#### CALCulate<Chn>:FILTer[:GATE]:TIME:DCHebyshev <SidebandSupp>

Sets the sideband suppression for the Dolph-Chebyshev time gate. The command is only available if a Dolph-Chebyshev time gate is active (CALCulate<Chn>:FILTer[: GATE]:TIME:WINDow DCHebyshev).

Suffix: <chn></chn>	Channel number used to identify the active trace.	
Parameters: <sidebandsupp></sidebandsupp>	Sideband suppression Range: 10 dB to 120 dB Increment: 10 dB *RST: 32 dB Default unit: dB	
Example:	*RST; :CALC:FILT:TIME:WIND DCH Reset the instrument and select a Dolph-Chebyshev time gate for filtering the data in the frequency domain. CALC:FILT:TIME:DCH 25 Set the sideband suppression to 25 dB.	
Manual control:	See "Side Lobe Level" on page 210	

#### CALCulate<Chn>:FILTer[:GATE]:TIME:SHAPe <TimeGate>

Selects the time gate to be applied to the time domain transform.

Tip:

Use the generalized command CALCulate<Chn>:FILTer[:GATE]:TIME:WINDow if you wish to select a Dolph-Chebychev time gate.

Suffix:

<Chn> Channel number used to identify the active trace.

Parameters: <timegate>       MAXimum   WIDE   NORMal   MINimum</timegate>	
	MINimum - Steepest edges (rectangle) WIDE - Normal gate (Hann) NORM - Steep edges (Hamming) Maximum - Maximum flatness (Bohman) *RST: WIDE
Example:	*RST; :CALC:FILT:TIME:SHAP? Reset the instrument and query the type of time gate used. The response is WIDE.
Manual control:	See "Shape" on page 210

### CALCulate<Chn>:FILTer[:GATE]:TIME:SHOW <Boolean>

Enables or disables permanent display of the gate limits.

Suffix: <chn></chn>	Channel number used to identify the active trace.	
Parameters: <boolean></boolean>	ON - time gate permanently displayed OFF - time gate hidden *RST: OFF	
Example:	See CALCulate <chn>:FILTer[:GATE]:TIME:CENTer</chn>	
Manual control:	See "Show Range Limits" on page 209	

#### CALCulate<Chn>:FILTer[:GATE]:TIME:SPAN <Span>

Defines the span of the time gate.

Suffix: <chn></chn>	Channel number used to identify the active trace.	
Parameters: <span></span>	Span of the time gate.	
	Range: Increment: *RST: Default unit:	5E-009 s
Example:	See CALCulate <chn>:FILTer[:GATE]:TIME:CENTer</chn>	
Manual control:	See "Axis Pair" on page 209	

### CALCulate<Chn>:FILTer[:GATE]:TIME:STATe <Boolean>

Determines whether the time gate for trace no. <Chn> is enabled.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.	
Parameters: <boolean></boolean>	ON - time gate enabled OFF - time gate disabled *RST: OFF	
Example:	*RST; :CALC:TRAN:TIME:STAT? CALC:FILT:TIME:STAT? Reset the instrument, activating a frequency sweep, and query whether the default trace is displayed in the time domain and whether the time gate is enabled. The response to both queries is 0.	
Manual control:	See "Time Gate" on page 209	

#### CALCulate<Chn>:FILTer[:GATE]:TIME:STARt <StartTime> CALCulate<Chn>:FILTer[:GATE]:TIME:STOP <StopTime>

These commands define the start and stop times of the time gate, respectively.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.	
Parameters: <stoptime></stoptime>	Start or stop time of the time gate.Range:-100 s to +99.999999999998 s (start time ) and -99.999999999998 s to +100 s (stop time)Increment:0.1 ns*RST:-1E-009 s (start time) to +4E-009 s (stop time)Default unit: s	
Example:	*RST; :CALC:TRAN:TIME:STAT ON; :CALC:FILT:TIME: STAT ON Reset the instrument and enable the time domain representation and the time gate. CALC:FILT:TIME:STAR 0; STOP 10ns; SHOW ON Set the start time to 0 ns and the stop time to 10 ns and display the time gate permanently.	
Manual control:	See "Axis Pair" on page 209	

Note: If the start frequency entered is greater than the current stop frequency, the stop

frequency is set to the start frequency plus the minimum frequency span ( CALCulate<Chn>:FILTer[:GATE]:TIME:SPAN).

If the stop frequency entered is smaller than the current start frequency, the start frequency is set to the stop frequency minus the minimum frequency span.

#### CALCulate<Chn>:FILTer[:GATE]:TIME:WINDow <TimeGate>

Selects the time gate to be applied to the time domain transform.

Suffix: <chn></chn>	Channel number used to identify the active trace.	
Parameters: <timegate></timegate>	RECT   HAMMing   HANNing   BOHMan   DCHebyshev RECT - steepest edges (rectangle) HANN - normal gate (Hann) HAMMing - steep edges (Hamming) BOHMan - minimum flatness (Bohman) DCHebyshev - arbitrary gate shape (Dolph-Chebychev) *RST: HANN	
Example:	See CALCulate <chn>:FILTer[:GATE]:TIME:DCHebyshev</chn>	
Manual control:	See "Shape" on page 210	

#### CALCulate<Chn>:FILTer[:GATE]:TIME[:TYPE] <TimeGateFilter>

Selects the time gate filter type, defining what occurs to the data in the specific time region.

Suffix: <chn></chn>	Channel number used to identify the active trace-	
Parameters: <timegatefilter></timegatefilter>	BPASs   NOTCh BPASs - band pass filter: Pass all information in specified time region and reject everything else. NOTCh - notch filter: Reject all information in specified time region and pass everything else. *RST: BPASs	
Example:	*RST; :CALC:FILT:TIME:STAT ON Reset the instrument and enable the time gate. CALC:FILT:TIME NOTCh Select a notch filter in order to reject unwanted pulses.	
Manual control:	See "Bandpass / Notch" on page 209	

#### 6.3.1.5 CALCulate:FORMat...

The CALCulate:FORMat... commands determine the post-processing of the measured data in order to obtain various display formats.

#### CALCulate<Chn>:FORMat <Type>

Defines how the measured result at any sweep point is post-processed and presented in the graphical display.

**Note:** The analyzer allows arbitrary combinations of display formats and measured quantities; see chapter 4.2.2, "Format Settings", on page 181 and

CALCulate<Ch>: PARameter... commands. Nevertheless, it is advisable to check which display formats are generally appropriate for an analysis of a particular measured quantity; see chapter 3.2.4.6, "Measured Quantities and Display Formats", on page 43.

Suffix
-Chn>

<chn></chn>	Channel number used to identify the active trace.	
Parameters: <type></type>	MLINear   MLOGarithmic   PHASe   UPHase   POLar   SMITh   ISMith   GDELay   REAL   IMAGinary   SWR   COMPlex   MAGNitude See list of parameters below. *RST: MLOGarithmic	
Example:	$\label{eq:CALC4:PAR:SDEF 'Ch4Tr1', 'S11'} Create channel 4 and a trace named Ch4Tr1 to measure the input reflection coefficient S_{11}. The trace becomes the active trace in channel 4.  CALC4:FORM MLIN; :DISP:WIND:TRAC2:FEED 'CH4TR1' Calculate the magnitude of S_{11} and display it in a linearly scaled Cartesian diagram, assigning the trace number 2. \\ \end{tabular}$	

Manual control: See "dB Mag" on page 182

Assume that the result at a sweep point is given by the complex quantity z = x + jy. The meaning of the parameters is as follows (see also table in CALCulate<Chn>: MARKer<Mk>: FORMat description):

MLINear	Calculate the magnitude of z, to be displayed in a Cartesian diagram with a linear scale
MLOGarithmic	Calculate the magnitude of z, displayed in a Cartesian diagram with a logarithmic scale
PHASe	Phase of z, displayed in a Cartesian diagram with a linear vertical axis
UPHase	Unwrapped phase of z, displayed in a Cartesian dia- gram with a linear vertical axis
POLar	Magnitude and phase, displayed in a polar diagram
SMITh	Magnitude and phase, displayed in a Smith chart
ISMith	Magnitude and phase, displayed in an inverted Smith chart
GDELay	Group delay, displayed in a Cartesian diagram
REAL	Real part (x), displayed in a Cartesian diagram
IMAGinary	Imaginary part (y), displayed in a Cartesian diagram
SWR	Standing Wave Ratio (SWR), displayed in a Cartesian diagram

COMPlex (for compatibility with R&S ZVR analyzers)	x, y, displayed in a polar diagram
MAGNitude (for compatibility with R&S ZVR ana- lyzers)	Magnitude (sqrt( $x^2 + y^2$ )), displayed in a Cartesian diagram with a logarithmic scale

#### CALCulate<Chn>:FORMat:WQUType <Unit>

Selects the physical unit of the displayed trace.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.
<b>Parameters:</b> <unit></unit>	POWer   VOLTage Power or voltage units *RST: POWer
Example:	CALC4: PAR: SDEF 'Ch4Tr1', 'b1' Create channel 4 and a trace named Ch4Tr1 to measure the wave quantity b <sub>1</sub> . The trace becomes the active trace in channel 4. CALC4: FORM: WQUT VOLT Select voltage units for the created trace (identified by the suffix 4).
Manual control:	See "Show as" on page 165

#### 6.3.1.6 CALCulate:GDAPerture...

 $The {\tt CALCulate:GDAPerture...} commands configure the group delay measurement.$ 

#### CALCulate<Chn>:GDAPerture:SCOunt <Steps>

Defines an aperture for the calculation of the group delay as an integer number of frequency sweep steps.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <steps></steps>	Number of steps Range: 1 to 10000 *RST: 10
Example:	*RST; :CALC:FORM GDEL Select group delay calculation for the active trace. CALC:GDAP:SCO 15 Select an aperture of 15 steps.
Manual control:	See "Aperture" on page 184

#### 6.3.1.7 CALCulate:LIMit...

The CALCulate:LIMit... commands define the limit lines and control the limit check.

CALCulate <chn>:LIMit:CIRCle:DATA</chn>	
CALCulate <chn>:LIMit:CIRCle:DISPlay[:STATe]</chn>	
CALCulate <chn>:LIMit:CIRCle:FAIL?</chn>	
CALCulate <chn>:LIMit:CIRCle:SOUNd[:STATe]</chn>	
CALCulate <chn>:LIMit:CIRCle[:STATe]</chn>	514
CALCulate <chn>:LIMit:CIRCle:CLEar</chn>	
CALCulate <chn>:LIMit:CONTrol[:DATA]</chn>	514
CALCulate <chn>:LIMit:CONTrol:SHIFt</chn>	515
CALCulate <chn>:LIMit:DATA</chn>	516
CALCulate <chn>:LIMit:DELete:ALL</chn>	
CALCulate <chn>:LIMit:DISPlay[:STATe]</chn>	517
CALCulate <chn>:LIMit:FAIL?</chn>	517
CALCulate <chn>:LIMit:LOWer</chn>	518
CALCulate <chn>:LIMit:SEGMent<seg>:AMPLitude:STARt</seg></chn>	518
CALCulate <chn>:LIMit:SEGMent<seg>:AMPLitude:STOP</seg></chn>	518
CALCulate <chn>:LIMit:SEGMent:COUNt?</chn>	519
CALCulate <chn>:LIMit:SEGMent<seg>:STIMulus:STARt</seg></chn>	519
CALCulate <chn>:LIMit:SEGMent<seg>:STIMulus:STOP</seg></chn>	519
CALCulate <chn>:LIMit:SEGMent<seg>:TYPE</seg></chn>	
CALCulate <chn>:LIMit:SOUNd[:STATe]</chn>	
CALCulate <chn>:LIMit:STATe</chn>	
CALCulate <chn>:LIMit:STATe:AREA</chn>	
CALCulate <chn>:LIMit:TTLout<pt>[:STATe]</pt></chn>	
CALCulate <chn>:LIMit:LOWer[:DATA]</chn>	
CALCulate <chn>:LIMit:UPPer[:DATA]</chn>	
CALCulate <chn>:LIMit:LOWer:FEED.</chn>	
CALCulate <chn>:LIMit:UPPer:FEED</chn>	
CALCulate <chn>:LIMit:LOWer:SHIFt</chn>	
CALCulate <chn>:LIMit:UPPer:SHIFt</chn>	
CALCulate <chn>:LIMit:CLEar</chn>	

#### CALCulate<Chn>:LIMit:CIRCle:DATA <CenterX>, <CenterY>, <Radius>

Defines a circle limit lines by its center coordinates and its radius.

Suffix: <chn></chn>	Channel nur	nber used to identify the active trace.
Parameters:		
<centerx></centerx>	Range: *RST: Default unit:	Virtually no restriction for center coordinates. 0 UNIT
<centery></centery>	Range: *RST: Default unit:	Virtually no restriction for center coordinates. 0 UNIT

<radius></radius>	Range: *RST <sup>.</sup>	Virtually no restriction for radius (use positive values).
	Default unit	: UNIT
Example:	See CALCu	late <chn>:LIMit:CIRCle[:STATe]</chn>
Manual control:	See "Radiu	s / Center X/Y" on page 237

#### CALCulate<Chn>:LIMit:CIRCle:DISPlay[:STATe] <Boolean>

Displays or hides the circle limit line associated to the active trace.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <boolean></boolean>	ON   OFF - Circle limit line on or off. *RST: OFF
Example:	<pre>*RST; CALCulate:LIMit:CIRCle:DATA 0, 0, 0.5 Define a circle limit line centered around the origin of the polar diagram, assigning a radius of 0.5 U. CALCulate:FORMat POLar CALCulate:LIMit:CIRCle:DISPlay ON Activate a polar diagram and show the circle limit line in the dia- gram.</pre>
Manual control:	See "Show Limit Circle" on page 235

#### CALCulate<Chn>:LIMit:CIRCle:FAIL?

Returns a 0 or 1 to indicate whether or not the circle limit check has failed. 0 represents pass and 1 represents fail

Tip: Use CALCulate: CLIMits: FAIL? to perform a composite (global) limit check.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Example:	See CALCulate <chn>:LIMit:CIRCle[:STATe]</chn>
Usage:	Query only
Manual control:	See "Limit Check" on page 235

#### CALCulate<Chn>:LIMit:CIRCle:SOUNd[:STATe] <Boolean>

Switches the acoustic signal (fail beep) on or off. The fail beep is generated each time the analyzer detects an exceeded circle limit.

#### Suffix:

<Chn> Channel number used to identify the active trace.

Parameters: <boolean></boolean>	ON   OFF - Fail beep on or off. *RST: OFF
Example:	CALCulate:LIMit:CIRCle:STATe ON; SOUND ON Switch the limit check on and activate the fail beep.
Manual control:	See "Limit Fail Beep" on page 236

#### CALCulate<Chn>:LIMit:CIRCle[:STATe] <Boolean>

Switches the circle limit check on or off.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <boolean></boolean>	
Example:	*RST; CALCulate:LIMit:CIRCle:DATA 0, 0, 0.5 Define a circle limit line centered around the origin of the polar diagram, assigning a radius of 0.5 U. CALCulate:LIMit:CIRCle:STATE ON; FAIL? Switch the limit check on and query the result.
Manual control:	See "Limit Check" on page 235

#### CALCulate<Chn>:LIMit:CIRCle:CLEar

Resets the limit check results for the circle test.

Suffix: <chn></chn>	Channel number
Usage:	Event
Manual control:	See "Clear Test" on page 236

CALCulate<Chn>:LIMit:CONTrol[:DATA] <FreqPowTime>, <FreqPowTime>...

Defines the stimulus values of the limit line and/or creates new limit line segments. See also chapter 3.4.1.1, "Rules for Limit Line Definition", on page 61.

#### **Rules for creating segments**

The following rules apply to an active trace with n existing limit line segments:

- An odd number of values is rejected; an error message -109,"Missing parameter..." is generated.
- An even number of 2\*k values updates or generates k limit line segments.
- For n > k the stimulus values of all existing limit line segments no. 1 to k are updated, the existing limit line segments no. k+1, ..., n are deleted.
- For n < k the stimulus values of the limit line segments no. 1 to n are updated, the limit line segments n+1, ..., k are generated with default response values (see

SCPI Command Reference

#### CALCulate<Chn>:LIMit:UPPer[:DATA], CALCulate<Chn>:LIMit: LOWer[:DATA]).

**Note:** The generated segments are upper or lower limit line segments, depending on the CALCulate<Chn>:LIMit:SEGMent<Seg>:TYPE setting. CALCulate<Ch>:LIMit:CONTrol[:DATA] does not overwrite the type setting.

**Tip:** To define additional new limit line segments without overwriting the old segments use CALCulate<Chn>:LIMit:DATA.

## Suffix:

<chn></chn>	Channel number used to identify the active trace.
<b>Parameters:</b> <freqpowtime></freqpowtime>	Default unit: Hz
<freqpowtime></freqpowtime>	Pair(s) of frequency, power or time values, to be defined in accord- ance with the sweep type ([SENSe <ch>:]SWEep:TYPE). See also chapter 3.4.1.1, "Rules for Limit Line Definition", on page 61.</ch>
	Range:Virtually no restriction for limit segments.*RST:A segment that is created implicitly, e.g. by means of CALCulate <ch>:LIMit:UPPer[:DATA] or CALCu- late<ch>:LIMit:LOWer[:DATA,], covers the maxi- mum sweep range of the analyzer.Default unit:Hz</ch></ch>
Example:	*RST; :CALC:LIM:CONT 1 GHZ, 2 GHZ Select a lin. frequency sweep (default) and define an upper limit line segment in the stimulus range between 1 GHz and 2 GHz, using default response values (-40 dB). CALC:LIM:DISP ON Show the limit line segment in the active diagram.
Manual control:	See "Segment List" on page 228

#### CALCulate<Chn>:LIMit:CONTrol:SHIFt <LimShift>

Shifts an existing existing limit line in horizontal direction. See also chapter 3.4.1.1, "Rules for Limit Line Definition", on page 61.

#### Suffix: <Chn> C

Channel number used to identify the active trace.

#### Setting parameters:

<LimShift> Offset value for the limit line Range: Virtually no restriction for limit segments Default unit: Hz

Example:	*RST; :CALC:LIM:CONT 1 GHZ, 2 GHZ Define a limit line segment in the stimulus range between 1 GHz and 2 GHz, using default response values. CALC:LIM:CONT:SHIF 1; :CALC:LIM:CONT? Shift the segment by 1 Hz. The modified limit line segment ranges from 100000001 (Hz) to 200000001 (Hz).
Usage:	Setting only
Manual control:	See "Segment List" on page 228

CALCulate<Chn>:LIMit:DATA <Type>, <StartStim>, <StopStim>, <StartResp>, <StopResp>

Defines the limit line type, the stimulus and response values for a limit line with an arbitrary number of limit line segments. See chapter 3.4.1.1, "Rules for Limit Line Definition", on page 61.

**Note:** In contrast to CALCulate<Chn>:LIMit:CONTrol[:DATA], this command does not overwrite existing limit line segments. The defined segments are appended to the segment list as new segments.

Suffix: <chn></chn>	Channel number used to identify the active trace.
<b>Parameters:</b> <type></type>	<ul> <li>Identifier for the type of the limit line segment:</li> <li>0 – limit line segment off, segment defined but no limit check performed.</li> <li>1 – upper limit line segment</li> <li>2 – lower limit line segment</li> <li>Range: 0, 1, 2 (see above)</li> </ul>
<startstim>, <stopstim>, <startresp>, <stopresp></stopresp></startresp></stopstim></startstim>	Stimulus and response values of the first and last points of the limitline segment.Range:Virtually no restriction for limit segmentsDefault unit:The default stimulus units depend on the sweep type: Hz for frequency sweeps, dBm for power sweeps, s for time sweeps. The default response units are the units of the selected trace format (CALCu- late <chn>:FORMat).</chn>
Example:	<ul> <li>*RST; :CALC:LIM:CONT 1 GHZ, 1.5 GHZ</li> <li>Define an upper limit line segment in the stimulus range between 1 GHz and 1.5 GHz, using default response values.</li> <li>CALC:LIM:DATA 1, 150000000, 200000000, 2, 3</li> <li>Define an upper limit line segment in the stimulus range between 1.5 GHz and 2 GHz, assigning response values of +2 dB and +3 dB.</li> <li>CALC:LIM:DISP ON</li> <li>Show the limit line segment in the active diagram.</li> </ul>
Manual control:	See "Segment List" on page 228

#### CALCulate<Chn>:LIMit:DELete:ALL

Deletes all limit line segments.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.
Example:	<ul> <li>*RST; :CALC:LIM:CONT 1 GHZ, 1.5 GHZ</li> <li>Define an upper limit line segment in the stimulus range between 1 GHz and 1.5 GHz, using default response values.</li> <li>CALC:LIM:DATA 1,150000000, 200000000,2,3</li> <li>Define an upper limit line segment in the stimulus range between 1.5 GHz and 2 GHz, assigning response values of +2 dB and +3 dB.</li> <li>CALC:LIM:DEL:ALL</li> <li>Delete both created limit line segments.</li> </ul>
Usage:	Event
Manual control:	See "Add / Insert / Delete / Delete All" on page 229

#### CALCulate<Chn>:LIMit:DISPlay[:STATe] <Boolean>

Displays or hides the entire limit line (including all segments) associated to the active trace.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <boolean></boolean>	ON   OFF - Limit line on or off. *RST: OFF
Example:	*RST; :CALC:LIM:CONT 1 GHZ, 2 GHZ Define an upper limit line segment in the stimulus range between 1 GHz and 2 GHz, using default response values. CALC:LIM:DISP ON Show the limit line segment in the active diagram.
Manual control:	See "Show Limit Line" on page 224

#### CALCulate<Chn>:LIMit:FAIL?

Returns a 0 or 1 to indicate whether or not the limit check has failed. 0 represents pass and 1 represents fail

Tip: Use CALCulate: CLIMits: FAIL? to perform a composite (global) limit check.

Suffix: <Chn> Char

Channel number used to identify the active trace.

Example:	<ul> <li>*RST; :CALC:LIM:CONT 1 GHZ, 2 GHZ</li> <li>Define an upper limit line segment in the stimulus range between 1 GHz and 2 GHz, using default response values.</li> <li>CALC:LIM:STAT ON; FAIL?</li> <li>Switch the limit check on and query the result.</li> <li>CALC:LIM:STAT:AREA LEFT, TOP</li> <li>For a subsequent check at the GUI or a hardcopy, move the pass/ fail message to the top left position.</li> </ul>
Usage:	Query only
Manual control:	See "Limit Check" on page 225

#### CALCulate<Chn>:LIMit:LOWer...

Analogous to CALCulate<Chn>:LIMit:UPPer...; see CALCulate<Chn>: LIMit:LOWer[:DATA] and subsequent commands.

#### CALCulate<Chn>:LIMit:SEGMent<Seg>:AMPLitude:STARt <Response> CALCulate<Chn>:LIMit:SEGMent<Seg>:AMPLitude:STOP <Response>

These commands change the start or the stop response values (i.e. the response values assigned to the start or stop stimulus values) of a limit line segment. A segment must be created first to enable the commands (e.g CALCulate<Chn>:LIMit:DATA). See also chapter 3.4.1.1, "Rules for Limit Line Definition", on page 61.

Tip: To define the response values of several limit line segments with a single command, use CALCulate<Chn>:LIMit:LOWer[:DATA] or CALCulate<Chn>:LIMit: UPPer[:DATA].

Suffix: <chn></chn>	Channel nur	mber used to identify the active trace.
<seg></seg>	Segment nu	Imber
Parameters: <response></response>	Response v Range: *RST: Default unit:	Virtually no restriction for limit segments The default response values of a segment that is cre- ated by defining its stimulus values only (e.g. by means of CALCulate <ch>:LIMit:CONTrol[:DATA]), are -40 dB.</ch>

## www.valuetronics.com

Example: CALC:LIM:DATA 1,150000000, 20000000,2,3
Define an upper limit line segment (segment no. 1) in the stimulus range between 1.5 GHz and 2 GHz, assigning response values of +2 dB and +3 dB.
:CALC:LIM:SEGM:AMPL:STAR 5; STOP 5; :CALC:LIM: SEGM:TYPE LMIN
Change the segment to a lower limit line segment with a constant response value of +5 dB.
CALC:LIM:DATA?
Query the type, the stimulus and response values of the created segment with a single command. The response is 2,150000000,200000000,5,5.
Manual control: See "Segment List" on page 228

### CALCulate<Chn>:LIMit:SEGMent:COUNt?

Returns the number of limit line segments, including enabled and disabled segments.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Example:	CALC:LIM:DATA 1,150000000, 200000000,2,3 Define an upper limit line segment (segment no. 1) in the stimulus range between 1.5 GHz and 2 GHz, assigning response values of +2 dB and +3 dB. CALC:LIM:SEGM:COUNT? Query the number of segments. The response is 1.
Usage:	Query only
Manual control:	See "Segment List" on page 228

#### CALCulate<Chn>:LIMit:SEGMent<Seg>:STIMulus:STARt <FreqPowTime> CALCulate<Chn>:LIMit:SEGMent<Seg>:STIMulus:STOP <FreqPowTime>

These commands change the start and stop stimulus values (i.e. the smallest and the largest stimulus values) of a limit line segment. A segment must be created first to enable the commands (e.g CALCulate<Chn>:LIMit:DATA). See also chapter 3.4.1.1, "Rules for Limit Line Definition", on page 61.

**Tip:** To define the stimulus values of several limit line segments with a single command, use CALCulate<Chn>:LIMit:CONTrol[:DATA].

Suffix:	
<chn></chn>	Channel number used to identify the active trace.
<seg></seg>	Segment number

<b>Parameters:</b> <freqpowtime></freqpowtime>	Frequency, power or time value, to be defined in accordance with the sweep type ([SENSe <ch>:]SWEep:TYPE).</ch>
	Range:Virtually no restriction for limit segments.*RST:A segment that is created implicitly, e.g. by means of CALCulate <ch>:LIMit:UPPer[:DATA] or CALCu- late<ch>:LIMit:LOWer[:DATA,], covers the maxi- mum sweep range of the analyzer.Default unit:Hz for frequency sweeps, dBm for power sweeps, s for time sweeps</br></ch></ch>
Example:	<ul> <li>CALC:LIM:DATA 1,150000000, 20000000,2,3</li> <li>Define an upper limit line segment (segment no. 1) in the stimulus range between 1.5 GHz and 2 GHz, assigning response values of +2 dB and +3 dB.</li> <li>CALC:LIM:SEGM:STIM:STAR 1GHZ; STOP 2 GHZ; :</li> <li>CALC:LIM:SEGM:TYPE LMIN</li> <li>Change the segment to a lower limit line segment with a stimulus range between 1 GHz and 2 GHz.</li> <li>CALC:LIM:DATA?</li> <li>Query the type, the stimulus and response values of the created segment with a single command. The response is</li> </ul>
Manual control:	2,100000000,200000000,2,3. See "Segment List" on page 228

#### CALCulate<Chn>:LIMit:SEGMent<Seg>:TYPE <LimLineType>

Selects the limit line type for a limit line segment. This can be done before or after defining the stimulus and response values of the segment, however, a segment must be created first to enable this command (e.g CALC:LIM:DATA).

Note: The type command overwrites the CALCulate<Chn>:LIMit:DATA settings and is overwritten by them. It is not affected by the other commands in the CALCulate<Chn>:LIMit... subsystem defining stimulus and response values of limit lines.

#### Suffix:

<chn></chn>	Channel number used to identify the active trace.	
<seg></seg>	Segment number	
Parameters: <limlinetype></limlinetype>	LMIN   LMA Limit line ty	•
	Range:	LMAX (upper limit line segment), LMIN (lower limit line segment), OFF (limit check switched off, limit line segment not deleted)
	*RST:	LMAX

User Manual 1173.9163.02 - 13

## www.valuetronics.com

Example:	*RST; :CALC:LIM:UPP 0, 0 Define an upper limit line segment across the entire sweep range, using a constant upper limit of 0 dBm. CALC:LIM:SEGM:TYPE LMIN Turn the defined limit line segment into a lower limit line segment.
Manual control:	See "Segment List" on page 228

#### CALCulate<Chn>:LIMit:SOUNd[:STATe] <Boolean>

Switches the acoustic signal (fail beep) on or off. The fail beep is generated each time the analyzer detects an exceeded limit.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <boolean></boolean>	ON   OFF - Fail beep on or off. *RST: OFF
Example:	CALC:LIM:STAT ON; SOUN ON Switch the limit check on and activate the fail beep.
Manual control:	See "Limit Fail Beep" on page 225

#### CALCulate<Chn>:LIMit:STATe <Boolean>

Switches the limit check (including upper and lower limits) on or off.

Tip: Use CALCulate<Ch>:LIMit:UPPer:STATe or

CALCulate<Ch>:LIMit:LOWer:STATe to switch on or off the individual limit checks for upper or lower limit lines.

Suffix	

<chn></chn>	Channel number used to identify the active trace.		
Parameters: <boolean></boolean>	ON   OFF - Limit check on or off. *RST: OFF		
Example:	*RST; CALC:LIM:CONT 1 GHZ, 2 GHZ Define an upper limit line segment in the stimulus range between 1 GHz and 2 GHz, using default response values. CALC:LIM:STAT ON; FAIL? Switch the limit check on and query the result.		
Manual control:	See "Limit Check" on page 225		

#### CALCulate<Chn>:LIMit:STATe:AREA <HorizontalPos>, <VerticalPos>

Moves the limit check pass/fail message for the active trace <Chn> to one of nine predefined positions in the active diagram.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.
Parameters: <horizontalpos></horizontalpos>	LEFT   MID   RIGHt Horizontal position
<verticalpos></verticalpos>	TOP   MID   BOTTom Vertical position
Example:	See CALCulate <chn>:LIMit:FAIL?</chn>
Manual control:	See "Limit Check" on page 225

#### CALCulate<Chn>:LIMit:TTLout<Pt>[:STATe] <Boolean>

Switches the TTL pass/fail signals on or off. The signals are applied to the USER PORT connector as long as the active trace <Chn> is within limits, including the ripple limits.

Suffix: <chn></chn>	Channel number used to identify the active trace.		
<pt></pt>	1 - TTL out pass 1 (pin 13 of USER PORT connector) 2 - TTL out pass 2 (pin 14 of USER PORT connector)		
Parameters: <boolean></boolean>	ON   OFF - TTL output signal on or off. *RST: OFF		
Example:	<ul> <li>*RST; :CALC:LIM:CONT 1 GHZ, 2 GHZ</li> <li>Define an upper limit line segment in the stimulus range between</li> <li>1 GHz and 2 GHz, using default response values.</li> <li>CALC:LIM:STAT ON; TTL2 ON</li> <li>Switch the limit check on and activate the TTL out pass 2 signal.</li> </ul>		
Manual control:	See "TTL 1 / 2 Pass" on page 226		

CALCulate<Chn>:LIMit:LOWer[:DATA] <LimitLineSegm>, <LimLineSegm>... CALCulate<Chn>:LIMit:UPPer[:DATA] <Response>, <Response>...

Defines the response (y-axis) values of the lower or upper limit line and/or creates new limit line segments. See also chapter 3.4.1.1, "Rules for Limit Line Definition", on page 61.

Note: The commands CALCulate<Ch>:LIMit:LOWer[:DATA] and CALCulate<Ch>:LIMit:UPPer[:DATA] use a fixed numbering scheme for limit line segments: Upper limit line segments are assigned odd numbers (1, 3, 5,...), lower limit

line segments are assigned even numbers (2, 4, 6,...).

**Rules for creating segments** 

The following rules apply to an active trace with n existing upper and n existing lower limit line segments:

- An odd number of values is rejected; an error message -109,"Missing parameter..." is generated.
- An even number of 2\*k values updates or generates k lower limit line segments.
- For n > k the response values of all existing lower limit line segments no. 2, 4 ... 2\*k are updated, the existing upper and lower limit line segments no. 2\*k+1 ... 2\*n are deleted. The existing upper limit line segments no. 1, 3, 2\*k-1 are not affected.
- For n < k the response values of the lower limit line segments no. 2, 4 to 2\*n are updated, the lower limit line segments 2\*n+2, 2\*n+4 ... 2\*k are generated with default stimulus values (see CALCulate<Chn>:LIMit:CONTrol[:DATA] on page 514. In addition, the missing upper limit line segments 2\*n+1, 2\*n+3 ... 2\*k-1 are generated with default stimulus and response values

#### Suffix:

<chn></chn>	Channel number used to identify the active trace.		
Parameters: <response></response>	Default unit: dBm		
<response></response>	Pair(s) of re	sponse values	
	Range: *RST: Default unit	Virtually no restriction for limit segments The response value of a segment that is created by defining its stimulus values only (e.g. by means of CALCulate <chn>:LIMit:CONTrol[:DATA]), is -40 dB. dB</chn>	
Example:	CALC:LIM:LOW -10, 0, 0, -10 Define two lower limit line segments covering the entire sweep range. Two upper limit line segments with default response values are created in addition. CALC:LIM:UPP -10, 0, 0, -10 Change the response values of the upper limit line segments. CALC:LIM:DISP ON Show the limit line segments in the active diagram.		
Manual control:	See "Segment List" on page 228		

CALCulate<Chn>:LIMit:LOWer:FEED <StimulusOffset>, <ResponseOffset>[, <TraceName>]

CALCulate<Chn>:LIMit:UPPer:FEED <StimulusOffset>, <ResponseOffset>[, <TraceName>]

Generates a lower or an upper limit line using the stimulus values of a data or memory trace and specified offset values.

#### Suffix:

<Chn>

Channel number used to identify the active trace. This trace provides the stimulus data for the limit line unless another trace <TraceName> is specified.

Setting parameters <stimulusoffset></stimulusoffset>	Stimulus offset value, used to shift all imported limit line segments in horizontal direction.	
	Range: -1000 GHz to +1000 GHz [Hz] *RST: 0 Hz Default unit: Hz	
<responseoffset></responseoffset>	Response offset value, used to shift all imported limit line seg- ments in vertical direction.	
	Range: -1012 dB to +1012 dB *RST: 0 dB Default unit: dB	
<tracename></tracename>	Name of the selected trace as used e.g. in CALCulate <ch>: PARameter:SDEFine. If no trace name is specified the analyzer uses the active trace no. <chn>.</chn></ch>	
Example:	CALC:LIM:LOW:FEED 1 GHZ, -10 Use the stimulus values of the active trace, shifted by 1 GHz to the right and decreased by -10 dB, to create a lower limit line. CALC:LIM:UPP:FEED 1 GHZ, 10 Use the stimulus values of the active trace, shifted by 1 GHz to the right and increased by 10 dB, to create an upper limit line. CALC:LIM:LOW:SHIF -3; :CALC:LIM:CONT:SHIF 1 GHz Shift the lower limit line by an additional -3 dB in vertical and by 1 GHz in horizontal direction. The upper limit line is also shifted.	
Usage:	Setting only	
Manual control:	See "Segment List" on page 228	

## CALCulate<Chn>:LIMit:LOWer:SHIFt <LimShift> CALCulate<Chn>:LIMit:UPPer:SHIFt <LimShift>

These commands shift all lower and upper limit line segments assigned to the active trace in vertical direction. Both commands shift **all** limit lines; they have the same functionality. See also chapter 3.4.1.1, "Rules for Limit Line Definition", on page 61.

#### Suffix: <Chn>

<chn></chn>	Channel number used to identify the active trace.	
Setting parameters: <limshift></limshift>	Response offset value for all limit line segments. Range: Virtually no restriction for limit segments Default unit: dB	
Example:	See CALCulate <chn>:LIMit:LOWer:FEED</chn>	
Usage:	Setting only	

#### CALCulate<Chn>:LIMit:CLEar

Resets the limit check results for the limit line test.

Suffix: <chn></chn>	Channel number
Usage:	Event
Manual control:	See "Clear Test" on page 226

#### 6.3.1.8 CALCulate:MARKer...

The CALCulate:MARKer... commands control the marker functions. The commands are device-specific and beyond what is specified in the SCPI subsystem SOURce:MARKer...

CALCulate <chn>:MARKer<mk>:AOFF</mk></chn>	
CALCulate <chn>:MARKer<mk>:BWIDth</mk></chn>	
CALCulate <chn>:MARKer<mk>:COUPled[:STATe]</mk></chn>	
CALCulate <chn>:MARKer<mk>:DELTa[:STATe]</mk></chn>	
CALCulate <chn>:MARKer<mk>:FORMat</mk></chn>	
CALCulate <chn>:MARKer<mk>:FUNCtion:BWIDth:MODE</mk></chn>	
CALCulate <chn>:MARKer<mk>:FUNCtion:CENTer</mk></chn>	530
CALCulate <chn>:MARKer<mk>:FUNCtion:DOMain:USER</mk></chn>	530
CALCulate <chn>:MARKer<mk>:FUNCtion:DOMain:USER:SHOW</mk></chn>	531
CALCulate <chn>:MARKer<mk>:FUNCtion:DOMain:USER:STARt</mk></chn>	531
CALCulate <chn>:MARKer<mk>:FUNCtion:DOMain:USER:STOP</mk></chn>	531
CALCulate <chn>:MARKer<mk>:FUNCtion:EXECute</mk></chn>	532
CALCulate <chn>:MARKer<mk>:FUNCtion:RESult?</mk></chn>	533
CALCulate <chn>:MARKer<mk>:FUNCtion:SPAN</mk></chn>	533
CALCulate <chn>:MARKer<mk>:FUNCtion:STARt</mk></chn>	534
CALCulate <chn>:MARKer<mk>:FUNCtion:STOP</mk></chn>	534
CALCulate <chn>:MARKer<mk>:MODE</mk></chn>	534
CALCulate <chn>:MARKer<mk>:NAME</mk></chn>	535
CALCulate <chn>:MARKer<mk>:REFerence:MODE</mk></chn>	535
CALCulate <chn>:MARKer<mk>:REFerence:NAME</mk></chn>	536
CALCulate <chn>:MARKer<mk>:REFerence[:STATe]</mk></chn>	536
CALCulate <chn>:MARKer<mk>:REFerence:TYPE</mk></chn>	536
CALCulate <chn>:MARKer<mk>:REFerence:X</mk></chn>	537
CALCulate <chn>:MARKer<mk>:REFerence:Y?</mk></chn>	538
CALCulate <chn>:MARKer:SEARch:BFILter:RESult[:STATe]</chn>	538
CALCulate <chn>:MARKer:SEARch:BFILter:RESult[:STATe]:AREA</chn>	538
CALCulate <chn>:MARKer<mk>:SEARch:TRACking</mk></chn>	539
CALCulate <chn>:MARKer<mk>[:STATe]</mk></chn>	539
CALCulate <chn>:MARKer[:STATe]:AREA</chn>	540
CALCulate <chn>:MARKer<mk>:TARGet</mk></chn>	540
CALCulate <chn>:MARKer<mk>:TYPE</mk></chn>	540
CALCulate <chn>:MARKer<mk>:X</mk></chn>	541
CALCulate <chn>:MARKer<mk>:Y?</mk></chn>	

#### CALCulate<Chn>:MARKer<Mk>:AOFF

Removes all markers from all traces of the active recall set. The removed markers remember their properties (stimulus value, format, delta mode, number) when they are restored (CALCulate<Chn>:MARKer<Mk>[:STATe]ON). The marker properties are definitely lost if the associated trace is deleted.

Suffix: <chn></chn>	Channel number used to identify the active trace. If unspecified the numeric suffix is set to 1.	
<mk></mk>	Marker number in the range 1 to 10. This numeric suffix is ignored and may be set to any value.	
Example:	Suppose that the active recall set contains an active trace no. 1. CALC:MARK1 ON; MARK2 ON Create markers 1 and 2 and assign them to the trace no. 1. CALC:MARK:AOFF Remove both markers.	
Usage:	Event	
Manual control:	See "All Markers Off" on page 239	

#### CALCulate<Chn>:MARKer<Mk>:BWIDth <Bandwidth>

Sets the bandfilter level for a bandfilter search or returns the results. The command is only available after a bandfilter search has been executed (CALCulate<Chn>: MARKer<Mk>: FUNCtion: EXECute BFILter; see example below).

The response to the query CALCulate<Chn>:MARKer<Mk>:BWIDth? contains the following bandfilter search results:

- <Bandwidth> bandwidth of the bandpass/bandstop region.
- <Center> stimulus frequency at the center of the bandpass/bandstop region (the stimulus value of marker M4).
- <QualityFactor (3 dB)> quality factor, i.e. the ratio between the center frequency and the 3-dB bandwidth.
- <Loss> loss at the center of the bandpass/bandstop region (the response value of marker M4 at the time of the bandfilter search).
- <LowerEdge> lower band edge.
- <UpperEdge> upper band edge.

**Tip:** To obtain the <Quality Factor (BW)> result from the bandfilter info field, calculate the ratio <Center> / <Bandwidth>.

# Suffix: <Chn> Channel number used to identify the active trace. <Mk> Marker number in the range 1 to 10. This numeric suffix is ignored and may be set to any value because the bandfilter search functions always use markers M1 to M4.

<ul> <li><bandwidth></bandwidth></li> <li>Difference between the band edges and the center response value of a bandfilter peak; must be negative for a bandpass search and positive for a bandstop search.</li> <li>Range: For bandpass: -100.00 dB to -0.01 dB; for bandstop: +0.01 dB to +100.00 dB</li> <li>Increment: 0.03 dB</li> <li>*RST: -3 dB</li> <li>Default unit: dB</li> <li>Example:</li> <li>CALC:MARK:FUNC:BWID:MODE BST</li> <li>Select a bandstop filter search.</li> <li>CALC:MARK:FUNC:EXEC BFIL</li> <li>Initiate the bandpass filter search for the current trace. Create markers M1 to M4.</li> <li>CALC:MARK:SEAR:BFIL:RES ON</li> <li>Display the marker info field in the diaram area.</li> <li>CALC:MARK:BWID 6</li> <li>Select a 6-dB bandwidth for the bandstop.</li> <li>CALC:MARK:BWID?</li> <li>Query the results of the bandfilter search. An error message is generated if the bandfilter search fails so that no valid results are available.</li> <li>CALC:MARK:SEAR:BFIL:RES:AREA LEFT, TOP</li> <li>For a subsequent check at the GUI or a hardcopy, move the info field to the top left position.</li> <li>Manual control:</li> </ul>	Parameters:		
+0.01 dB to +100.00 dB Increment: 0.03 dB *RST: -3 dB Default unit: dB Example: CALC:MARK:FUNC:BWID:MODE BST Select a bandstop filter search. CALC:MARK:FUNC:EXEC BFIL Initiate the bandpass filter search for the current trace. Create markers M1 to M4. CALC:MARK:SEAR:BFIL:RES ON Display the marker info field in the diaram area. CALC:MARK:BWID 6 Select a 6-dB bandwidth for the bandstop. CALC:MARK:BWID 7 Query the results of the bandfilter search. An error message is generated if the bandfilter search fails so that no valid results are available. CALC:MARK:SEAR:BFIL:RES:AREA LEFT, TOP For a subsequent check at the GUI or a hardcopy, move the info field to the top left position.	<bandwidth></bandwidth>	of a bandfilter peak; must be negative for a bandpass search and	
Select a bandstop filter search. CALC:MARK:FUNC:EXEC BFIL Initiate the bandpass filter search for the current trace. Create markers M1 to M4. CALC:MARK:SEAR:BFIL:RES ON Display the marker info field in the diaram area. CALC:MARK:BWID 6 Select a 6-dB bandwidth for the bandstop. CALC:MARK:BWID? Query the results of the bandfilter search. An error message is generated if the bandfilter search fails so that no valid results are available. CALC:MARK:SEAR:BFIL:RES:AREA LEFT, TOP For a subsequent check at the GUI or a hardcopy, move the info field to the top left position.		+0.01 dB to +100.00 dB Increment: 0.03 dB *RST: -3 dB	
	Example:	CALC:MARK:FUNC:BWID:MODE BST Select a bandstop filter search. CALC:MARK:FUNC:EXEC BFIL Initiate the bandpass filter search for the current trace. Create markers M1 to M4. CALC:MARK:SEAR:BFIL:RES ON Display the marker info field in the diaram area. CALC:MARK:BWID 6 Select a 6-dB bandwidth for the bandstop. CALC:MARK:BWID 7 Query the results of the bandfilter search. An error message is generated if the bandfilter search fails so that no valid results are available. CALC:MARK:SEAR:BFIL:RES:AREA LEFT, TOP	
	Manual control:		

#### CALCulate<Chn>:MARKer<Mk>:COUPled[:STATe] <Boolean>

Couples the markers of all traces in the active recall set to the markers of trace no. <Chn>, provided that they have the same sweep type ([SENSe<Ch>:]SWEep:TYPE).

Suffix: <chn></chn>	Channel number used to identify the active trace. The effects of marker coupling depend on the active trace number; see "Marker Coupling" on page 31.
<mk></mk>	Marker number in the range 1 to 10. This suffix is ignored because the command affects all markers.
Parameters: <boolean></boolean>	ON   OFF - enables or disables marker coupling. *RST: OFF

Example:	Suppose that the active recall set contains two traces Trc1 and Trc2, assigned to channels no. 1 and 2, respectively. :CALC1:PAR:SEL 'TRC1'; :CALC1:MARK1 ON; MARK2 ON Select Trc1 as the active trace and create the two markers no. 1 and 2. The default position for both markers is the center of the sweep range. CALC1:MARK:COUP ON Create two markers no. 1 and 2 on Trc 2 and couple them to the
Manual control:	markers of Trc 1. See "Coupled Markers" on page 240
	occ obupied markets on page 240

#### CALCulate<Chn>:MARKer<Mk>:DELTa[:STATe] <Boolean>

Switches the delta mode for marker <Mk> on trace no. <Chn> on or off. The marker must be created before using CALCulate<Chn>:MARKer<Mk>[:STATe] ON. If the active trace contains no reference marker, the command also creates a reference marker.

Suffix: <chn></chn>	Channel number used to identify the active trace.	
<mk></mk>	Marker number in the range 1 to 10.	
Parameters: <boolean></boolean>	ON   OFF - Enables or disables the delta mode. *RST: OFF	
Example:	Suppose that the active recall set contains an active trace no. 1. CALC:MARK ON Create marker no. 1 and set it to the center of the sweep range. CALC:MARK:DELT ON Create a reference marker at the center of the sweep range and set marker 1 to delta mode.	
Manual control:	See "Mkr Stimulus / On / Delta Mode" on page 239	

#### CALCulate<Chn>:MARKer<Mk>:FORMat <OutFormat>

Defines the output format for the (complex) value of marker <Mk> on trace no. <Chn>.

**Note:** The formats of the markers assigned to a trace are independent of each other and of the trace format settings; see CALCulate<Chn>:FORMat.

Suffix:	
<chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10.

## Parameters:

<outformat></outformat>	MLINear   MLOGarithmic   PHASe   POLar   GDELay   REAL   IMAGinary   SWR   LINPhase   LOGPhase   IMPedance   ADMittance   DEFault   COMPlex   MDB   MLPHase   MDPHase	
	See list of parameters below. *RST: DEFault	
Example:	Suppose that the active recall set contains an active trace no. 1. CALC:MARK ON; :CALC:MARK:FORM? Create marker 1, assign it to the trace no. 1 and query its format. The analyzer returns the format of the active trace.	

Manual control: See "Marker Format" on page 240

Assume that the marker result is given by the complex quantity z = x + jy. The meaning of the parameters is as follows:

DEFault	The format of the trace no. <chn> (MLOG after *RST); see CALCulate<ch>:FORMat.</ch></chn>
MLINear	z  = sqrt ( x2 + y2 )
MLOGarithmic	z  = sqrt ( x2 + y2 )
MDB (for R&S ZVR compatibility)	dB Mag(z) = 20 * log z  dB
PHASe	$\varphi(z) = \arctan(\operatorname{Im}(z) / \operatorname{Re}(z))$
POLar	x, y (Real and Imag)
COMPlex (for R&S ZVR compatibility)	
GDELay	Group Delay, –d $\Phi(z)$ / d $\Omega$
REAL	x
IMAGinary	У
SWR	Standing Wave Ratio, SWR = (1 +  z ) / (1  z )
LINPhase	Lin Mag and Phase,  z , arctan ( Im(z) / Re(z) )
MLPhase (for R&S ZVR compatibility)	
LOGPhase	dB Mag and Phase, 20 * log z  dB, arctan(Im(z) / Re(z))
MDPhase (for R&S ZVR compatibility)	
IMPedance	R, X, L or C (depending on sign(X))
ADMittance	G, B, L or C (depending on sign(X))

## CALCulate<Chn>:MARKer<Mk>:FUNCtion:BWIDth:MODE <BandfilterType>

Selects the bandfilter search mode. In contrast to manual control, bandfilter tracking is not automatically activated.

Suffix:

<Chn>

Channel number used to identify the active trace.

<mk></mk>	Marker number in the range 1 to 10. This numeric suffix is ignored and may be set to any value because the bandfilter search func- tions always use markers M1 to M4.
Parameters:	
<bandfiltertype></bandfiltertype>	BPASs   BSTop   BPRMarker   BSRMarker   BPABsolute   BSABsolute   NONE
	Bandfilter search type:
	BPASs – Bandpass Search Ref to Max
	BSTop – Bandstop Search Ref to Max
	BPRMarker – Bandpass Search Ref to Marker
	BSRMarker – Bandstop Search Ref to Marker
	BPABsolute – Bandpass Absolute Level
	BSABsolute – Bandstop Absolute Level
	NONE – deactivate bandfilter search, result off
	*RST: NONE
Example:	See CALCulate <chn>:MARKer<mk>:BWIDth</mk></chn>
Manual control:	See "Bandpass Ref to Max" on page 249

#### CALCulate<Chn>:MARKer<Mk>:FUNCtion:CENTer

Sets the center of the sweep range equal to the stimulus value of the marker <Mk> on trace no. <Chn>.

Suffix: <chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10.
Example:	*RST; :CALC:MARK ON Create marker 1 in the center of the current sweep range and assign it to trace no. 1. CALC:MARK:FUNC:CENT Leave the sweep range unchanged.
Usage:	Event
Manual control:	See "Center = Marker" on page 244

#### CALCulate<Chn>:MARKer<Mk>:FUNCtion:DOMain:USER <NumSearchRange>

Assigns a search range no. <NumSearchRange> to marker no <Mk> and selects the search range, e.g. in order to display range limit lines or define the start and stop values.

Suffix:	
<chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10.

#### **Parameters:**

<NumSearchRange> Number of the search range.

	Range: *RST:	0 to 10. 0 denotes the fixed full span search range (equal to the sweep range), 1 to 10 denote user- definable search ranges; see example. 0 (reserved for full span search range)
Example:	Select the no. 1. CALC:MAF Set the sta CALC:MAF	ARK1:FUNC:DOM:USER 2 search range no. 2, assigned to marker no. 1 and trace RK:FUNC:DOM:USER:STARt 1GHz art frequency of the search range to 1 GHz. RK:FUNC:DOM:USER:STOP 1.2GHz op frequency of the search range to 1.2 GHz.
Manual control:	See "Sear	ch Range" on page 245

#### CALCulate<Chn>:MARKer<Mk>:FUNCtion:DOMain:USER:SHOW <Boolean>

Displays or hides range limit lines for the search range selected via CALCulate<Chn>:MARKer<Mk>:FUNCtion:DOMain:USER.

Suffix: <chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10.
Parameters: <boolean></boolean>	ON   OFF - range limit lines on or off. *RST: OFF
Example:	See CALCulate <chn>:STATistics:DOMain:USER</chn>
Manual control:	See "Range Limit Lines on" on page 246

## CALCulate<Chn>:MARKer<Mk>:FUNCtion:DOMain:USER:STARt <StarSearchRange>

CALCulate<Chn>:MARKer<Mk>:FUNCtion:DOMain:USER:STOP <StopSearchRange>

These commands define the start and stop values of the search range selected via CALCulate<Chn>:MARKer<Mk>:FUNCtion:DOMain:USER.

#### Suffix:

<chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10.

#### Parameters:

<StopSearchRange> Beginning or end of the search range.

	Range: *RST: Default unit:	Maximum allowed sweep range, depending on the instrument model and on the sweep type. 0 Hz Hz
Example:	See CALCul	<pre>late<chn>:MARKer<mk>:FUNCtion:DOMain:</mk></chn></pre>
Manual control:	See "Search	Range" on page 245

#### CALCulate<Chn>:MARKer<Mk>:FUNCtion:EXECute [<SearchMode>]

Selects a search mode for marker no. <Mk> and initiates the search. The marker must be created before using CALCulate<Chn>:MARKer<Mk>[:STATe]ON (exception: bandfilter search).

Suffix:	
<chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10. For a bandfilter search (BFILter) this numeric suffix is ignored and may be set to any value because the bandfilter search functions always use markers M1 to M4.
Setting parameters:	
<searchmode></searchmode>	MAXimum   MINimum   RPEak   LPEak   NPEAK   TARGet   LTARget   RTARget   BFILter
	See list of parameters below.
Example:	Suppose that the active recall set contains an active trace no. 1. CALC:MARK ON
	Create marker M1 and assign it to trace no. 1. CALC:MARK:FUNC:EXEC MAX; RES?
	Move the created marker to the absolute maximum of the trace and query the stimulus and response value of the search result.
Usage:	Setting only
Manual control:	See "Max / Min" on page 243

The analyzer provides the following search modes:

Mode	Find
MAXimum	Absolute maximum in the search range (seeCALCulate <chn>:MARKer<mk>: FUNCtion:DOMain:USER)</mk></chn>
MINimum	Absolute maximum in the search range
RPEak	Next valid peak to the right of the current marker position
LPEak	Next valid peak to the left
NPEak	Next highest or lowest value among the valid peaks (next peak)

# www.valuetronics.com

Mode	Find
TARGet	Target value (see CALCulate <chn>:MARKer<mk>:TARGet)</mk></chn>
RTARget	Next target value to the right of the current marker position
LTARget	Next target value to the left
BFILter	Bandfilter search. The results are queried using CALCulate <chn>:MARKer<mk>: BWIDth.</mk></chn>

#### CALCulate<Chn>:MARKer<Mk>:FUNCtion:RESult?

Returns the result (stimulus and response value) of a search started by means of CALCulate<Chn>:MARKer<Mk>: FUNCtion:EXECute. The search must be executed before the command is enabled.

Suffix: <chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10. This numeric suffix is ignored and may be set to any value.
Example:	See CALCulate <chn>:MARKer<mk>:FUNCtion:EXECute</mk></chn>
Usage:	Query only
Manual control:	See "Max / Min" on page 243

#### CALCulate<Chn>:MARKer<Mk>:FUNCtion:SPAN

Sets the sweep span of the sweep range equal to the absolute value of the first coordinate of the active delta marker <Mk> on trace no. <Chn>.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10.
Example:	<pre>*RST; :CALC:MARK ON; MARK:DELTa ON Create marker 1 in the center of the current sweep range and enable the delta mode. CALC:MARK:X 300MHz Increase the stimulus value of the delta marker by 300 MHz. CALC:MARK:FUNC:SPAN Set the sweep range equal to 300 MHz. The sweep range starts at the reference marker position, i.e. in the center of the analyzer's frequency range.</pre>
Usage:	Event
Manual control:	See "Center / Start / Stop / Span = Marker" on page 253

#### CALCulate<Chn>:MARKer<Mk>:FUNCtion:STARt CALCulate<Chn>:MARKer<Mk>:FUNCtion:STOP

These command sets the beginning  $(\ldots \text{STARt})$  and the end  $(\ldots \text{STOP})$  of the sweep range equal to the stimulus value of the marker <Mk> on trace no. <Chn>.

Suffix: <chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10
Example:	<ul> <li>*RST; :CALC:MARK ON</li> <li>Create marker 1 in the center of the current sweep range and assign it to trace no. 1.</li> <li>CALC:MARK:FUNC:STAR</li> <li>Divide the sweep range in half, starting at the current marker position. As an alternative:</li> <li>CALC:MARK:FUNC:STOP</li> <li>Divide the sweep range in half, ending at the current marker position.</li> </ul>
Usage:	Event
Manual control:	See "Center / Start / Stop / Span = Marker" on page 253

#### CALCulate<Chn>:MARKer<Mk>:MODE <Mode>

Sets marker no. <Mk> to continuous or discrete mode. The marker doesn't have to be created before (CALCulate<Chn>:MARKer<Mk>[:STATe] ON), the mode can be assigned in advance.

Suffix: <chn> <mk></mk></chn>	Channel number used to identify the active trace. Marker number in the range 1 to 10.
Parameters: <mode></mode>	CONTinuous   DISCrete CONTinuous - marker can be positioned on any point of the trace, and its response values are obtained by interpolation. DISCrete - marker can be set to discrete sweep points only. *RST: CONT
Example:	Suppose that the active recall set contains an active trace no. 1. CALC:MARK:MODE DISC; :CALC:MARK2:MODE CONT Create marker 1 in discrete mode and marker 2 in continuous mode. CALC:MARK ON; MARK2 ON Display the two markers. Due to the different modes the horizontal positions can be different.
Manual control:	See "Discrete" on page 241

User Manual 1173.9163.02 - 13

# www.valuetronics.com

#### CALCulate<Chn>:MARKer<Mk>:NAME <MarkerName>

Defines a name for marker no. <Mk>. The marker doesn't have to be created before ( CALCulate<Chn>:MARKer<Mk>[:STATe] ON), the name can be assigned in advance.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10.
Parameters: <markername></markername>	Marker name (string parameter) *RST: 'M1' for marker no. 1 etc.
Example:	Suppose that the active recall set contains an active trace no. 1. CALC:MARK:NAME '&\$% 1'; :CALC:MARK ON Create marker 1 named "&\$% 1" and display the marker . CALC:MARK:REF ON CALC:MARK:REF:NAME 'Reference' Display the reference marker and rename it "Reference".
Manual control:	See "Marker Name" on page 240

#### CALCulate<Chn>:MARKer<Mk>:REFerence:MODE <Mode>

Sets the reference marker to continuous or discrete mode. The marker doesn't have to be created before (CALCulate<Chn>:MARKer<Mk>[:STATe] ON), the mode can be assigned in advance.

-		
SI	itt	ix:
$\mathbf{v}$		1.

<chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10. This numeric suffix is ignored and may be set to any value.
Parameters:	
<mode></mode>	CONTinuous   DISCrete
	CONTinuous - marker can be positioned on any point of the trace, and its response values are obtained by interpolation. DISCrete - marker can be set to discrete sweep points only. *RST: CONT
Example:	Suppose that the active recall set contains an active trace no. 1. CALC:MARK:REF:MODE DISC CALC:MARK2:REF:MODE CONT Create the reference marker in discrete mode and marker 2 in continuous mode. CALC:MARK:REF ON; :CALC:MARK2 ON Display the two markers. Due to the different modes the horizontal positions can be different.
Manual control:	See "Discrete" on page 241

User Manual 1173.9163.02 - 13

# www.valuetronics.com

#### CALCulate<Chn>:MARKer<Mk>:REFerence:NAME <MarkerName>

Defines a name for the reference marker. The marker doesn't have to be created before (CALCulate<Chn>:MARKer<Mk>[:STATe] ON), the name can be assigned in advance.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10. This numeric suffix is ignored and may be set to any value.
Parameters: <markername></markername>	Marker name (string parameter) *RST: 'R'
Example:	See CALCulate <chn>:MARKer<mk>:NAME</mk></chn>
Manual control:	See "Marker Name" on page 240

#### CALCulate<Chn>:MARKer<Mk>:REFerence[:STATe] <Boolean>

Creates the reference marker and assigns it to trace no. <Chn>.

Suffix: <chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10. This numeric suffix is ignored and may be set to any value.
<b>Parameters:</b> <boolean></boolean>	ON   OFF - creates or removes the marker. *RST: OFF
Example:	Suppose that the active recall set contains an active trace no. 1. CALC:MARK:REF ON; :CALC:MARK ON Create the reference marker and marker 1 and assign them to trace no. 1. The default position of both markers is the center of the sweep range.
Manual control:	See "Mkr Stimulus / On / Delta Mode" on page 239

#### CALCulate<Chn>:MARKer<Mk>:REFerence:TYPE <Mode>

Sets the reference to normal or fixed mode. The marker must be created before using CALCulate<Chn>:MARKer<Mk>[:STATe] ON.

Suffix: <chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10. This numeric suffix is ignored
	and may be set to any value.

Parameters: <mode></mode>	NORMal   FIXed NORMal - response value changes according to the measurement result. FIXed - marker keeps its current response value. *RST: NORMal
Example:	CALC:MARK:REF ON; :CALC:MARK:REF:TYPE FIX Create the reference markerand display it in the center of the sweep range as a fixed marker. CALC:MARK:REF:X 1GHz Shift the marker horizontally. The response value remains fixed.
Manual control:	See "Fixed" on page 242

#### CALCulate<Chn>:MARKer<Mk>:REFerence:X <MarkerValue>

Defines the stimulus (in Cartesian diagrams: x-axis) value of the reference marker, which can (but doesn't have to) be displayed using CALCulate<Chn>:MARKer<Mk>: REFerence[:STATe] ON.

Suffix:	
<chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10. This numeric suffix is ignored and may be set to any value.
Parameters:	
<markervalue></markervalue>	Stimulus value of the reference marker.
	Range:-9.9E+11 Hz to +9.9E+11 Hz (for frequency sweeps); -999 dBm to +999 dBm (for power sweeps); 0 s to 127500 s (for time and CW mode sweeps)*RST:0 HzDefault unit:Hz
Example:	Suppose that the active recall set contains an active trace no. 1 and that the sweep range for a frequency sweep starts at 1 GHz. CALC:MARK:REF ON Create the reference marker and display it in the center of the sweep range. CALC:MARK:REF:X 1GHz Set the reference marker to the beginning of the sweep range. CALC:MARK:REF:Y? Query the measurement value at the reference marker position.
Manual control:	See "Mkr Stimulus / On / Delta Mode" on page 239

#### CALCulate<Chn>:MARKer<Mk>:REFerence:Y?

Returns the response (in Cartesian diagrams: y-axis) value of the reference marker. The reference marker must be created before using CALCulate<Chn>:MARKer<Mk>: REFerence[:STATe]ON.

Suffix: <chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10. This numeric suffix is ignored and may be set to any value.
Example:	See CALCulate <chn>:MARKer<mk>:REFerence:X</mk></chn>
Usage:	Query only
Manual control:	See "Ref Mkr" on page 239

#### CALCulate<Chn>:MARKer:SEARch:BFILter:RESult[:STATe] <Boolean>

Shows or hides the bandfilter search results in the diagram area.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <boolean></boolean>	ON - show the bandfilter search results. If no bandfilter search has been initiated before (CALCulate <chn>:MARKer<mk>: FUNCtion:EXECute BFILter), nothing is displayed. OFF - hide the bandfilter search results. *RST: OFF</mk></chn>
Example:	See CALCulate <chn>:MARKer<mk>:BWIDth</mk></chn>
Manual control:	See "Result Off" on page 251

#### CALCulate<Chn>:MARKer:SEARch:BFILter:RESult[:STATe]:AREA

<HorizontalPos>, <VerticalPos>

Moves the bandfilter search info field for the active trace <Chn> to one of nine predefined positions in the active diagram.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters:	
<horizontalpos></horizontalpos>	LEFT   MID   RIGHt
	Horizontal position
<verticalpos></verticalpos>	TOP   MID   BOTTom
	Vertical position
Example:	See CALCulate <chn>:MARKer<mk>:BWIDth</mk></chn>

Manual control: See "Bandpass Ref to Max" on page 249

#### CALCulate<Chn>:MARKer<Mk>:SEARch:TRACking <Boolean>

Enables or disables the marker tracking mode for marker no. <Mk>. Tracking mode causes the active minimum/maximum or target search of the active marker to be repeated after each sweep. A marker must be created and a search mode must be active ( CALCulate<Chn>:MARKer<Mk>:FUNCtion:EXECute ...) to use this command.

**Tip:** If the current search mode is a bandfilter search this command enables or disables bandfilter tracking.

Suffix: <chn></chn>	Channel number used to identify the active trace.	
<mk></mk>	Marker number in the range 1 to 10. For a bandfilter search (BFILter) this numeric suffix is ignored and may be set to any value because the bandfilter search functions always use markers M1 to M4.	
Parameters: <boolean></boolean>	ON   OFF - enables or disables the marker tracking mode.	
	*RST: OFF	
Example:	Suppose that the active recall set contains an active trace no. 1. CALC:MARK ON; :CALC:MARK:FUNC:EXEC MAXimum Create marker no. 1 and assign them to trace no. 1. Activate a maximum search for marker no. 1. CALC:MARK:SEAR:TRAC ON Enable the tracking mode for the created marker.	
Manual control:	See "Tracking" on page 244	

#### CALCulate<Chn>:MARKer<Mk>[:STATe] <Boolean>

Creates the marker numbered <Mk> and assigns it to trace no. <Chn>.

Suffix: <chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10. If unspecified the numeric suffix is set to 1.
Parameters:	
<boolean></boolean>	ON   OFF – creates or removes the marker.
	*RST: OFF
Example:	Suppose that the active recall set contains an active trace no. 1. CALC:MARK ON; MARK2 ON
	Create markers 1 and 2 and assign them to trace no. 1. The default position of both markers is the center of the sweep range.
Manual control:	See "Mkr Stimulus / On / Delta Mode" on page 239

#### CALCulate<Chn>:MARKer[:STATe]:AREA <HorizontalPos>, <VerticalPos>

Moves the marker info field for the active trace <Chn> to one of nine predefined positions in the active diagram.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.	
<b>Parameters:</b> <horizontalpos></horizontalpos>	LEFT   MID   RIGHt Horizontal position	
<verticalpos></verticalpos>	TOP   MID   BOTTom Vertical position	
Example:	See CALCulate <chn>:MARKer<mk>:Y?</mk></chn>	
Manual control:	See "Mkr 1 Mkr 10" on page 239	

#### CALCulate<Chn>:MARKer<Mk>:TARGet <TargetSearchVal>

Defines the target value for the target search of marker no. <Mk>, which can be activated using CALCulate<Chn>:MARKer<Mk>:FUNCtion:EXECute TARGet.

Suffix:		
<chn></chn>	Channel number used to identify the active trace.	
<mk></mk>	Marker nun	nber in the range 1 to 10.
<b>Parameters:</b> <targetsearchval></targetsearchval>	Target search value of marker no. <mk>.</mk>	
	Range: *RST:	Depending on the format of the active trace (CAL- Culate <chn>:FORMat). For a "dB Mag" trace the range is -300 dB to +200 dB, the increment (UP. DOWN) is 0.1 dB. Depending on the trace format; 0 dB for a dB Mag trace.</chn>
	Default unit: dB, deg etc., depending on the trace format	
Example:	CALC:MARK ON Create marker no. 1 and display it in the center of the sweep range. :CALC:MARK:TARG -10; FUNC:EXEC TARG Define a target search value of -10 dB and start the target search. CALC:MARK:X? Query the stimulus value corresponding to the target search result.	
Manual control:	See "Target Value" on page 247	

#### CALCulate<Chn>:MARKer<Mk>:TYPE <Mode>

Sets marker no. <Mk> to normal or fixed mode. The marker must be created before using CALCulate<Chn>:MARKer<Mk>[:STATe] ON.

User Manual 1173.9163.02 - 13

# www.valuetronics.com

Suffix: <chn></chn>	Channel number used to identify the active trace.	
<mk></mk>	Marker number in the range 1 to 10.	
Parameters: <mode></mode>	NORMal   FIXed NORMal - response value changes according to the measurement result. FIXed - marker keeps its current response value. *RST: NORMal	
Example:	CALC:MARK ON; :CALC:MARK:TYPE FIX Create marker 1and display it in the center of the sweep range as a fixed marker. CALC:MARK:X 1GHz Shift the marker horizontally. The response value remains fixed.	
Manual control:	See "Fixed" on page 242	

#### CALCulate<Chn>:MARKer<Mk>:X <StimulusValue>

Defines the stimulus (in Cartesian diagrams: x-axis) value of the marker no. <Mk>, which can (but doesn't have to) be created using CALCulate<Chn>:MARKer<Mk>[: STATe] ON.

Suffix: <chn> <mk></mk></chn>	Channel number used to identify the active trace. Marker number in the range 1 to 10.	
<b>Parameters:</b> <stimulusvalue></stimulusvalue>	Stimulus value of marker no. <mk>.</mk>	
	Range: *RST: Default unit	-9.9E+11 Hz to +9.9E+11 Hz (for frequency sweeps) -999 dBm to +999 dBm (for power sweeps) 0 s to 127500 s for time and CW mode sweeps) 0 Hz : Hz
Example:	Suppose that the active recall set contains an active trace no. 1 and the sweep range for a frequency sweep starts at 1 GHz. CALC:MARK ON Create marker no. 1 and display it in the center of the sweep range. CALC:MARK:X 1GHz Set the marker to the beginning of the sweep range.	
Manual control:	See "Mkr Stimulus / On / Delta Mode" on page 239	

#### CALCulate<Chn>:MARKer<Mk>:Y?

Returns the response (in Cartesian diagrams: y-axis) value of marker no. <Mk>. The marker must be created before using CALCulate<Chn>:MARKer<Mk>[:STATe]ON.

User Manual 1173.9163.02 - 13

# www.valuetronics.com

Suffix: <chn></chn>	Channel number used to identify the active trace.	
<mk></mk>	Marker number in the range 1 to 10.	
Example:	Suppose that the active recall set contains an active trace no. 1. CALC:MARK ON Create marker no. 1 and display it in the center of the sweep range. CALC:MARK:Y? Query the measurement value at the marker position. CALC:MARK:STAT:AREA LEFT, TOP For a subsequent check at the GUI or a hardcopy, move the info field to the top left position.	
Usage:	Query only	
Manual control:	See "Mkr 1 Mkr 10" on page 239	

## 6.3.1.9 CALCulate:MATH...

The CALCulate:MATH... commands permit processing of measured data in numerical expression format. The operators are +, -, \*, / and use of constants and data arrays are permitted.

CALCulate <chn>:MATH[:EXPRession]:SDEFine</chn>	542
CALCulate <chn>:MATH:FUNCtion</chn>	
CALCulate <chn>:MATH:MEMorize</chn>	544
CALCulate <chn>:MATH:STATe</chn>	
CALCulate <chn>:MATH:WUNit[:STATe]</chn>	

#### CALCulate<Chn>:MATH[:EXPRession]:SDEFine <Expression>

Defines a general mathematical relation between traces. To calculate and display the new mathematical trace, the mathematical mode must be switched on ( CALCulate<Chn>:MATH:STATe ON).

## Suffix:

<chn></chn>	Channel number used to identify the active trace.	
Parameters: <expression></expression>	Operands, operators and functions; see table below.	
Example:	<pre>*RST; :CALC:MATH:MEM Copy the current state of the default trace 'Trc1' to a memory trace named 'Mem2[Trc1]'. The memory trace is not displayed. CALC:MATH:SDEF 'Trc1 / Mem2[Trc1]' Define a mathematical trace, dividing the data trace by the stored memory trace. The mathematical trace is not displayed. CALC:MATH:STAT ON Display the mathematical trace instead of the active data trace.</pre>	
Manual control:	See "Data / Mem, Data – Mem" on page 198	

Expressions defined via CALCulate <ch>:MATH[:EXPRession]:SDEFine may con-</ch>	-
tain the following elements:	

Туре	Complete List	Description
Operands	<trace name="">   activeTrc   Mem[activeTrc]</trace>	All traces and memory traces of the active recall set   Active trace   Active memory trace assigned to the active trace
Constants	e, pi   1, -1.2, 8e9   1 + 2j, 2 + 1e-9j	Constants   Real values in decimal or exponential format   Complex numbers
Operators	-+,-,*,/,^	Basic arithmetic operations; ^ for exponentiation
Functions	linMag (), dBMag (), Arg (), Re (), Im (), log (), In (), tan (), atan (), sin (), asin (), cos (), acos (), Min ( , ), Max ( , )	Mathematical functions with one or two arguments
Special Functions	StimVal	Current stimulus value (see description of operators for User Defined Math)
Brackets	()	Priority of operations in complex expressions

#### CALCulate<Chn>:MATH:FUNCtion <Mode>

Defines a simple mathematical relation between the active trace and the active memory trace to calculate a new mathematical trace and displays the mathematical trace.

**Note:** This command places some restrictions on the mathematical expression and the operands. Use CALCulate<Chn>:MATH[:EXPRession]:SDEFine to define general expressions.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <mode></mode>	NORMal   ADD   SUBTract   MULTiply   DIVide
	NORMal – Math. trace = active data trace ADD – Math. trace = data + memory SUBTract – Math. trace = data - memory MULTiply – Math. trace = data * memory DIVide – Math. trace = data / memory *RST: NORMal

Example:	<ul> <li>*RST; :CALC:MATH:MEM</li> <li>Copy the current state of the default trace 'Trc1' to a memory trace named 'Mem2[Trc1]'. The memory trace is not displayed. CALC:MATH:FUNC DIV</li> <li>Define a mathematical trace, dividing the data trace by the stored memory trace. The mathematical trace is displayed instead of the active data trace.</li> <li>CALC:MATH:STAT?</li> <li>The response is 1 (mathematical mode switched on, mathematical trace displayed).</li> </ul>
Manual control:	See "Data / Mem, Data – Mem" on page 198

#### CALCulate<Chn>:MATH:MEMorize

Copies the current state of the active data trace to a memory trace. If a mathematical trace is active, the data trace associated with the mathematical trace is copied. The memory trace is named Mem<n>[<Data Trace>] where <n> counts all data and memory traces in the active recall set in chronological order, and <Data Trace> is the name of the associated (copied) data trace.

The exact function of the command depends on the number of memory traces associated to the active data trace:

- If no memory trace is associated to the active trace, a new memory trace is generated. •
- If several memory traces are associated to the active trace, the current measurement data overwrites the last generated or changed memory trace.

Note: To copy a trace to the memory without overwriting an existing memory trace or define a memory trace name, use TRACe:COPY

<MemTraceName>, <DataTraceName>. To copy an active mathematical trace use TRACe:COPY:MATH<MemTraceName>,<DataTraceName>

S	uf	Ťİ	X	:

<chn></chn>	Channel number used to identify the active trace.
Example:	*RST; :CALC:MATH:MEM Copy the current state of the default trace 'Trc1' to a memory trace named 'Mem2[Trc1]'. The memory trace is not displayed. DISP:WIND:TRAC2:FEED 'Mem2[Trc1]' Display the created memory trace in the active diagram area (dia- gram area no. 1).
Usage:	Event
Manual control:	See "Data to <destination>" on page 196</destination>

- ----

#### CALCulate<Chn>:MATH:STATe <Boolean>

Activates or deactivates the mathematical mode where the mathematical trace defined via CALCulate<Chn>:MATH[:EXPRession]:SDEFine is calculated and displayed instead of the active data trace. The command is not valid for mathematical traces calculated via CALCulate<Chn>:MATH:FUNCtion.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.
Parameters: <boolean></boolean>	ON – display the active data trace. OFF – display the mathematical trace. *RST: OFF
Example:	<ul> <li>*RST; :CALC:MATH:MEM</li> <li>Copy the current state of the default trace 'Trc1' to a memory trace named 'Mem2[Trc1]'. The memory trace is not displayed.</li> <li>CALC:MATH:SDEF 'Trc1 / Mem2[Trc1]'</li> <li>Define a mathematical trace, dividing the data trace by the stored memory trace. The mathematical trace is not displayed</li> <li>CALC:MATH:STAT ON</li> <li>Display the mathematical trace instead of the active data trace.</li> </ul>
Manual control:	See "Trace Math" on page 198

#### CALCulate<Chn>:MATH:WUNit[:STATe] <Boolean>

Controls the conversion and formatting of the mathematic expression defined via CALCulate<Chn>:MATH[:EXPRession]:SDEFine (see "Result is Wave Quantity" on page 201).

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters:	
<boolean></boolean>	ON – "Result is Wave Quantity" enabled; the analyzer assumes that the result of the mathematical expression represents a volt- age. OFF – "Result is Wave Quantity" disabled; the analyzer assumes that the result of the mathematical expression is dimensionless. *RST: OFF

# www.valuetronics.com

Example: \*RST; SWE:TYPE POW CALC:PAR:SDEF 'Trc1', 'a1' Reset the instrument, activate a power sweep, and select a wave quantity a<sub>1</sub> for the trace Trc1. DISP:WIND:TRAC:FEED 'Trc1' Display the generated trace in the active window. CALC:MATH:SDEF 'StimVal'; STAT ON Define a mathematical trace, dividing the data trace by the stored memory trace. Display the mathematical trace instead of the active data trace. CALC:MATH:WUN ON Take into account that the stimulus value is a voltage (derived from the source power) rather than a dimensionless quantity. The y-axis range of the mathematical trace now exactly corresponds to the power sweep range. Manual control: See "Mathematical Expression" on page 200

#### 6.3.1.10 CALCulate:PARameter...

The CALCulate: PARameter... commands assign names and measurement parameters to traces. The commands are device-specific.

CALCulate <ch>:PARameter:CATalog?</ch>	546
CALCulate <ch>:PARameter:DEFine:SGRoup</ch>	547
CALCulate <ch>:PARameter:DELete</ch>	
CALCulate:PARameter:DELete:ALL	549
CALCulate <ch>:PARameter:DELete:CALL</ch>	549
CALCulate <ch>:PARameter:DELete:SGRoup</ch>	
CALCulate <ch>:PARameter:MEASure</ch>	
CALCulate <ch>:PARameter:SDEFine</ch>	551
CALCulate <ch>:PARameter:SELect</ch>	553

#### CALCulate<Ch>:PARameter:CATalog?

Returns the trace names and measurement parameters of all traces assigned to a particular channel.

The result is a string containing a comma-separated list of trace names and measurement parameters, e.g. 'CH4TR1, S11, CH4TR2, S12'. The measurement parameters are returned according to the naming convention of CALCulate<Ch>: PARameter: SDEFine. The order of traces in the list reflects their creation time: The oldest trace is the first, the newest trace is the last trace in the list.

# Suffix:

<Ch>

Channel number. If unspecified the numeric suffix is set to 1.

Example:	CALC4:PAR:SDEF 'Ch4Tr1', 'S11' Create channel 4 and a trace named Ch4Tr1 to measure the input reflection coefficient S <sub>11</sub> .
	CALC4:PAR:CAT?
	Query the traces assigned to channel 4. If Ch4Tr1 is the only trace assigned to channel 4, the response is 'CH4TR1, S11'.
Usage:	Query only

CALCulate<Ch>:PARameter:DEFine:SGRoup <LogicalPort1>, <LogicalPort2>...

Creates the traces for all S-parameters associated with a group of logical ports (Sparameter group). The traces can be queried using CALCulate<Ch>:DATA:SGRoup?

Traces must be selected to become active traces; see CALCulate<Ch>: PARameter:SELect.

**Note:** Each channel can contain a single S-parameter group only. Defining a new S-parameter group deletes the previous one. Use CALCulate<Ch>: PARameter: DELete:SGRoup on page 550 to delete the current S-group explicitly.

# Suffix:

<Ch>

Channel number. <Ch> may be used to reference a previously defined channel. If <Ch> does not exist, it is generated with default channel settings.

#### Parameters:

<LogicalPort1>

Logical (balanced or unbalanced) port numbers. The port numbers must be in ascending order, their number is limited by the test ports of the analyzer. With n logical port numbers, the command generates n<sup>2</sup> traces. The traces correspond to the following S-parameters:

 $S_{\text{log_port1><log_port1>}}, S_{\text{log_port1><log_port2>}} \dots S_{\text{log_port1><log_port4>}}$ 

$$\begin{split} &S_{<log\_port<n>><log\_port>n}, \ S_{<log\_port<n>><log\_port2>...} \ S_{<log\_port<n>><log\_port<n>><log\_port2>...} \ S_{<log\_port<n>><log\_port2>n>><log\_port2>n>, e.g. \ S_{11}, \ S_{12}, \ S_{21}, \ S_{22} \ for <log\_port1> = 1, \ <log\_port2> = 2. \ If only one logical port <log\_port1> is specified, a single trace with the reflection coefficient \ S_{<log\_port1><log\_port1>} \ is created. \end{split}$$

#### Trace names

...

The generated traces are assigned the following trace names: <Ch\_name>\_SG\_S<log\_port1><log\_port1>, <Ch\_name>\_SG\_S<log\_port1><log\_port2> ...

<Ch\_name>\_SG\_S<log\_port1><log\_port<n>> ...<Ch\_name>\_S G\_S<log\_port<n>><log\_port1>,

<Ch\_name>\_SG\_S<log\_port<n>><log\_port2>...

<Ch\_name>\_SG\_S<log\_port<n>><log\_port<n>>,

e.g. Ch1\_SG\_S11, Ch1\_SG\_S12, Ch1\_SG\_S21, Ch1\_SG\_S22 for  $<Ch_name> = Ch1$ ,  $<log_port1> = 1$ ,  $<log_port2> = 2$ . The trace names are displayed in the "Channel Manager" and in the "Trace Manager" dialogs where they can be changed manually. The  $<Ch_name>$  is defined via

CONFigure:CHANnel<Ch>:NAME '<Ch name>'.

.Trace names are important for referencing the generated traces; see program example below.

Range:1 to 4 (depending on instrument model)\*RST:NONE (see below)

#### <LogicalPort2>

#### Example:

CALC2:PAR:DEF:SGR 1,2

Create channel 2 and four traces to measure the two-port Sparameters  $S_{11}$ ,  $S_{12}$ ,  $S_{21}$ ,  $S_{22}$ . The traces are not displayed. DISP:WIND:TRAC2:FEED 'Ch2\_SG\_S11' DISP:WIND:TRAC3:FEED 'Ch2\_SG\_S12' DISP:WIND:TRAC4:FEED 'Ch2\_SG\_S21' DISP:WIND:TRAC5:FEED 'Ch2\_SG\_S22'

Display the four traces in the diagram no. 1.

INIT2:CONT OFF; :INIT2:IMMediate; \*OPC

Perform a complete speep in channel no. 2 to ensure the traces are completely "filled" with data.

CALC2:DATA:SGR? SDAT

Retrieve all four traces as unformatted data (real and imaginary part at each sweep point). The analyzer first returns the complete  $S_{11}$  trace, followed by the  $S_{12}$ ,  $S_{21}$ , and  $S_{22}$  traces.

CALC2:PAR:DEL:SGR

Delete the previously created port group.

Manual control:	See "All S-Params" on page 152
CALCulate <ch>:PA</ch>	Rameter:DELete <tracename></tracename>
Deletes a trace with	a specified trace name and channel.
<b>Suffix:</b> <ch></ch>	Channel number.
Setting parameters <tracename></tracename>	Trace name, e.g. 'Trc4'. See "Rules for trace names" in chap- ter 4.2.4.2, "Trace Manager (Dialog)", on page 194.
Example:	<pre>CALCulate4:PARameter:SDEFine 'Ch4Tr1', 'S11' Create channel 4 and a trace named Ch4Tr1 to measure the input reflection coefficient S<sub>11</sub>. CALCulate4:PAR:CAT? Query the traces assigned to channel 4. Ch4Tr1 is the only trace assigned to channel 4, so the response is 'CH4TR1, S11'. CALCulate4:PARameter:SDEFine 'CH4TR2', 'S21'; SDEFine 'CH4TR3', 'S12'; SDEFine 'CH4TR4', 'S22' Create three more traces for the remaining 2-port S-parameters. CALCulate4:PARameter:DELete 'CH4TR1' Delete the first created trace. CALCulate4:PARameter:DELete:CALL Delete the remaining three traces in channel 4. CALCulate:PARameter:DELete:ALL Delete all traces, including the default trace Trc1 in channel 1.</pre>
Usage:	Setting only
Manual control:	See "Delete Trace" on page 194

## CALCulate:PARameter:DELete:ALL

Deletes all traces in all channels of the active recall set, including the default trace Trc1 in channel 1. The manual control screen shows "No Trace".

Example:	See CALCulate <ch>: PARameter: DELete</ch>
Usage:	Event
Manual control:	See "Delete Trace" on page 194

## CALCulate<Ch>:PARameter:DELete:CALL

Deletes all traces in channel no. <Ch>.

Suffix: <ch></ch>	Channel number
Example:	See CALCulate <ch>: PARameter: DELete</ch>

Usage:EventManual control:See "Delete Trace" on page 194

# CALCulate<Ch>:PARameter:DELete:SGRoup

Deletes a group of logical ports (S-parameter group), previously defined via CALCulate<Ch>: PARameter: DEFine: SGRoup.

Suffix: <ch></ch>	Channel number. <ch> may be used to reference a previously defined channel. If <ch> does not exist, it is generated with default channel settings.</ch></ch>
Example:	See CALCulate <ch>: PARameter: DEFine: SGRoup</ch>
Usage:	Event

#### CALCulate<Ch>:PARameter:MEASure <TraceName>[, <Result>]

Assigns a measurement result to an **existing** trace. The query returns the dreult assigned to the specified trace (no second parameter; see example).

Note: To create a new trace and at the same time assign the attributes, use CALCulate<Ch>: PARameter:SDEFine. To display the trace, create a diagram ( DISPlay[:WINDow<Wnd>]:STATE ON) and assign the trace to this diagram ( DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:FEED); see example below.

Traces must be selected to become active traces; see CALCulate<Ch>:

PARameter: SELect. CALCulate<Ch>: PARameter: CATalog? returns a list of all defined traces. You can open the "Trace Manager" dialog to obtain an overview of all channels and traces, including the traces that are not displayed.

Suffix: <ch></ch>	Channel number of an existing channel containing the referenced trace.
Parameters:	
<tracename></tracename>	Trace name, string variable, e.g. 'Trc4'. See "Rules for trace names" in "Trace Manager Table" on page 194. Trace names must be unique across all channels and diagrams.
<result></result>	Measurement parameter (string variable); see table 6-4. A query of a wave quantity 'xy' returns 'xyD <n><detector>', where <n> numbers the source (drive) port, and <detector> denotes the detector setting (SAM for a "Normal" (sample), AVG for an "AVG Real Imag", AMP for an AVG Mag Phase detector). A query of a ratio 'x/y' returns 'xD<n>/yD<m><detector>', where <n> and <m> number the source ports</m></n></detector></m></n></detector></n></detector></n>

Example:	CALC4: PAR: SDEF 'Ch4Tr1', 'S11' Create channel 4 and a trace named Ch4Tr1 to measure the input reflection coefficient S <sub>11</sub> . CALC4: PAR: MEAS 'Ch4Tr1', 'a1' Change the measurement parameter of the trace and measure the wave quantity a <sub>1</sub> . CALC4: PAR: MEAS? 'Ch4Tr1' Query the measured quantity. The response is 'A1D1SAM'.
Manual control:	See "S-Parameter" on page 151

#### CALCulate<Ch>:PARameter:SDEFine <TraceName>, <Result>

Creates a trace and assigns a channel number, a name and a measurement parameter to it. The trace becomes the active trace in the channel but is not displayed.

Note: To display the trace defined via CALCulate<Ch>: PARameter: SDEFine, create a diagram (DISPlay[:WINDow<Wnd>]:STATEON) and assign the trace to this diagram (DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:FEED); see example below. CALCulate<Ch>: PARameter: MEASure changes the measurement result of an existing trace.

To select an existing trace as the active trace, use CALCulate<Ch>: PARameter: SELect. You can open the trace manager to obtain an overview of all channels and traces, including the traces that are not displayed.

**Tip:** This command has no query form. Use CALCulate<Ch>: PARameter:MEASure 'TraceName' to query the measurement result of the trace. CALCulate<Ch>: PARameter:CATalog? returns a list of all defined traces.

#### Suffix:

<Ch>

Channel number. <Ch> may be used to reference a previously defined channel. If <Ch> does not exist, it is generated with default channel settings.

#### Setting parameters:

<tracename></tracename>	Trace name, string variable, e.g. 'Trc4'. See "Rules for trace names" in "Trace Manager Table" on page 194. Trace names must be unique across all channels and diagrams. If a trace with the selected trace name already exists, the analyzer behaves as follows: If the existing trace is assigned to the same channel as the new trace, it is deleted. The new trace is not auto- matically assigned to a diagram area; see note above. If the existing trace is assigned to a different channel, no new trace can be created. The analyzer returns an error message.
<result></result>	Measurement result (string variable); see list of parameters below.

Example:	CALC4:PAR:SDEF 'Ch4Tr1', 'S11' Create channel 4 and a trace named Ch4Tr1 to measure the input reflection coefficient S <sub>11</sub> . DISP:WIND2:STAT ON Create diagram area no. 2. DISP:WIND2:TRAC:FEED 'CH4TR1' Display the generated trace in diagram area no. 2.	
Usage:	Setting only	
Manual control:	See "S-Parameter" on page 151	

The measurement parameter is selected by means of the keywords in the following table. The selection depends on the number of test ports of the analyzer, e.g.  $S_{44}$  is not available on 2-port analyzers.

Table 6-4: Name strings for measurement results

<b>3</b>	
'S11'   'S12'     'S0101'	Normal mode S-parameters S <out><in>, where <out> and <in> denote the output and input port numbers of the DUT. To avoid ambiguities, <out> and <in> must be either both 1-digit numbers (e.g. 12) or both 2-digit numbers (e.g. 0102).</in></out></in></out></in></out>
'SCD11'	Mixed mode S-parameters S <mout><m in="">, where <mout> and <min> denote the output and input port modes. All combinations of S (single-ended, unbal-anced), D (differential) and C (common) are allowed. Port numbers like for normal mode S-parameters.</min></mout></m></mout>
'Y11'     'YSS11'     'YCC11'     'YDD11'   'Z11'     'ZSS11'     'ZCC11'     'ZDD11'	Short-circuit Y-parameters and open-circuit Z-parameters with port modes and port numbers like for normal mode S-parameters*).
'Y-S11'  'Y-SSS11'  'Y-SCC11'  'Y-SDD11'  'Z-S11'  'Z-SSS11'  'Z-SCC11'  'Z- SDD11'	S-parameters converted to matched-circuit admittances and impedances with port modes and port numbers like for normal mode S-parameters.
'A1'     'A01'     'B1'     'B01'     'A1SAM'   'A1AVG'   'A1AMP'	Wave quantities with port numbers like for normal mode S-parameters. The strings SAM, AVG, AMP appended to the wave quantities denote a normal (sample, SAM), AVG Real Imag (AVG), or AVG Mag Phase (AMP) detector. The observation time for average detectors is set via [SENSe <ch>:] SWEep:DETector:TIME.</ch>
'A1D2'     'A01D02'     'B1D2'     'B01D02'     'A1D1SAM'   'A1D1AVG'   'A1D1AMP'	Wave quantities with port numbers and source port numbers (D <no> for drive port). The strings SAM, AVG, AMP appended to the wave quantities denote a normal (sample, SAM), AVG Real Imag (AVG), or AVG Mag Phase (AMP) detector.</no>
'A1G2'     'A01G02'     'B1G2'     'B01G02'     'A1G1SAM'   'A1G1AVG'   'A1G1AMP'	Wave quantities with port numbers and external generator providing the stim- ulus signal (G <no> for generator no.). The strings SAM, AVG, AMP appended to the wave quantities denote a normal (sample, SAM), AVG Real Imag (AVG), or AVG Mag Phase (AMP) detector.</no>
'B2/A1'   'B02/A01'     'B2/A1SAM'   'B2/A1AVG'   B2/A1AMP'	Ratio of wave quantities with port numbers like for normal mode S-parameters. The strings SAM, AVG, AMP appended to the wave quantities denote a normal (sample, SAM), AVG Real Imag (AVG), or AVG Mag Phase (AMP) detector.
'B2D1/A1D1'   'B02D01/A01D01'   'B2D1/ A1D1SAM'   'B2D1/A1D1AVG' 'B2D1/A1D1AMP'	Ratio of wave quantities with port numbers and source port numbers (D <no> for drive port). The strings SAM, AVG, AMP appended to the wave quantities denote a normal (sample, SAM), AVG Real Imag (AVG), or AVG Mag Phase (AMP) detector.</no>

'B2G1/A1G1'   'B02G01/A01G01'   'B2G1/ A1G1SAM'   'B2G1/A1G1AVG' 'B2G1/A1G1AMP'	Ratio of wave quantities with port numbers and external generator providing the stimulus signal (G <no> for generator no.). The strings SAM, AVG, AMP appended to the wave quantities denote a normal (sample, SAM), AVG Real Imag (AVG), or AVG Mag Phase (AMP) detector.</no>
'IMB21'   'IMB12'   'IMB31'	Imbalance parameter for balanced ports Imb <receive_port><drive_port>. The indices denote the logical receive port and the logical drive port of the analyzer.</drive_port></receive_port>
'KFAC21'   'KFAC12'	Stability factor K (for unbalanced ports only)
'MUF121'   'MUF112'	Stability factor 1 (for unbalanced ports only)
'MUF221'   'MUF212'	Stability factor 2 (for unbalanced ports only)
'Pmtr1G1'   'Pmtr2G1'   'Pmtr3D1'	Power sensor measurement using a power meter 'Pmtr <no>' and either an external generator 'G<no>' or an analyzer source port 'D<no>'</no></no></no>
'DC1D1' 'DC4D1'   'DC1D01' 'DC4D01'   'DC1G1' 'DC4G1'	DC measurement DC 1 to DC 4. D1 or D01 etc. denotes the drive port, G1 etc. denotes an external generator port.
'DC1V'   'DC10V'	For R&S ZVAB compatibility; query returns 'DC1D1' or 'DC2D1')
'PAE21'   PAE12'	Power added efficiency
'IM3UO'   'IM3LO'   'IM3MO'   'IM5UO' 'IM9MO'	Intermodulation product IM <order><side><at dut=""> where <order> = 3   5   7   9, <side> = U   L   M (for upper or lower or major), at DUT output</side></order></at></side></order>
'IP3UI'   'IP3UO'   'IP3LI'   'IP3LO'   'IP3MI'   'IP3MO'   'IP5UI' 'IP9MO'	Intercept point IP <order><side><at dut=""> where <order> = 3   5   7   9, <side> = U   L   M (for upper or lower or major), <at dut=""> = I   O (for input or output)</at></side></order></at></side></order>
NLO	Noise level at DUT output
UTI   UTO   LTI   LTO	Upper or lower tone at DUT input or output

\*) Selecting a parameter Y...<n><m> or Z...<n><m> sets the range of port numbers to be considered for the Y and Z-parameter measurement to <n>:<m>.

#### CALCulate<Ch>:PARameter:SELect <TraceName>

Selects an existing trace as the active trace of the channel. All trace commands without explicit reference to the trace name act on the active trace (e.g. CALCulate<Chn>: FORMat). CALCulate<Ch>: PARameter:SELect is also necessary if the active trace of a channel has been deleted.

# Suffix: <Ch>

Channel number.

#### Parameters:

<TraceName>

Trace name, e.g. 'Trc4'. See "Rules for trace names" in "Trace Manager Table" on page 194.

 $\label{eq:calc4:PAR:SDEF 'Ch4Tr1', 'S11'} Create channel 4 and a trace named Ch4Tr1 to measure the input reflection coefficient S_{11}. The trace is the active trace in channel 4. CALC4:PAR:SDEF 'Ch4Tr2', 'S22' Create another trace named Ch4Tr2 to measure the output reflection coefficient S_{22}. Again this new trace becomes the active trace in channel 4. CALC4:PAR:SEL 'Ch4Tr1' Select the first trace Ch4Tr1 as the active trace. CALC4:FORM MLIN Calculate the magnitude of S_{11} and display it in a linearly scaled Cartesian diagram. \\$ 

#### 6.3.1.11 CALCulate:PHOLd...

The CALCulate: PHOLd... commands control the max hold (peak hold) function.

CALCulate <chn>:PHOLd <holdfunc></holdfunc></chn>		
Enables, disables,	or restarts the max hold and the min hold functions.	
<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.	
Parameters: <holdfunc></holdfunc>	MIN   MAX   OFF	
	MIN - Enable the min hold function. MAX - enable the max hold function. OFF - disable the max hold or min hold function.	
	*RST: OFF	
Example:	*RST; :CALC:PHOL MAX Reset the instrument and enable the max hold function. CALC:PHOL OFF; PHOL MAX Restart max hold.	

Manual control: See "Hold" on page 217

#### 6.3.1.12 CALCulate:RIPPle...

The CALCulate:RIPPle... commands define the ripple limits and control the ripple limit check.

CALCulate <chn>:RIPPle:CONTrol:DOMain</chn>	555
CALCulate <chn>:RIPPle:DATA</chn>	555
CALCulate <chn>:RIPPle:DELete:ALL</chn>	556
CALCulate <chn>:RIPPle:DISPlay[:STATe]</chn>	557
CALCulate <chn>:RIPPle:FAIL?</chn>	557
CALCulate <chn>:RIPPle:RDOMain:FORMat</chn>	558
CALCulate <chn>:RIPPle:SEGMent:COUNt?</chn>	558

SCPI Command Reference

CALCulate <chn>:RIPPle:SEGMent<seg>:LIMit</seg></chn>	559
CALCulate <chn>:RIPPle:SEGMent<seg>:RESult?</seg></chn>	
CALCulate <chn>:RIPPle:SEGMent<seg>[:STATe]</seg></chn>	
CALCulate <chn>:RIPPle:SEGMent<seg>:STIMulus:STARt</seg></chn>	
CALCulate <chn>:RIPPle:SEGMent<seg>:STIMulus:STOP</seg></chn>	
CALCulate <chn>:RIPPle:SOUNd[:STATe]</chn>	
CALCulate <chn>:RIPPle:STATe</chn>	
CALCulate <chn>:RIPPle:STATe:AREA</chn>	
CALCulate <chn>:RIPPle:CLEar</chn>	

#### CALCulate<Chn>:RIPPle:CONTrol:DOMain <SweepType>

Deletes the existing ripple limit ranges and (re-)defines the physical units of the stimulus values of the ripple limit lines. The unit of the ripple limit is defined via CALCulate<Chn>:RIPPle:RDOMain:FORMat.

#### Suffix:

<Chn> Channel number used to identify the active trace. Setting parameters: <SweepType> FLIN | FLOG | FSEG | FSINgle | TLIN | TLOG | PLIN | PLOG | **PSINgle** Keywords for the units of the stimulus values; frequency, power, and time units. The selected unit must be compatible with the sweep type ([SENSe<Ch>:]SWEep:TYPE on page 787); otherwise the ripple limit lines cannot be displayed and no ripple limit check is possible. \*RST: FLIN Default unit: Hz (for FLIN, FLOG, FSEG, and FSINgle), s (for TLIN and TLOG), dBm (for PLIN, PLOG and PSINgle). Example: SWE:TYPE POW Select a power sweep. CALC:RIPP:CONT:DOM PLIN Delete all existing ripple limit ranges and select level units for the ripple limit of the active trace. CALC:RIPP:DATA 1, -10, -5, 3 Define and enable a ripple limit range in the stimulus range between -10 dBm and -5 dBm, assigning a ripple limit of 3 dB. Usage: Setting only Manual control: See "Add / Insert / Delete / Delete All / Align All" on page 233

CALCulate<Chn>:RIPPIe:DATA <RippleLimRange>...

Adds and enables/disables an arbitrary number of ripple limit ranges, assigning the stimulus values and the ripple limits. See chapter 3.4.1.2, "Rules for Ripple Test Definition", on page 63.

**Note:** This command does not overwrite existing ripple limit ranges. The defined ranges are appended to the range list as new ranges. Use the

CALCulate<Chn>:RIPPle:SEGMent<Seg>... commands to change existing ripple limits.

#### Suffix:

<Chn> Channel number used to identify the active trace.

#### **Parameters:**

<ripplelimrange></ripplelimrange>	Parameter list in the format <type>, <startstimulus>, <stopsti- mulus&gt;, <ripplelimit>{, <type>, <startstimulus>, <stopstimu- lus&gt;, <ripplelimit>}, where: <type> – Boolean identifier for the ripple limit range type. 1 for ripple limit range on (with limit check). 0 for ripple limit range off: The range is defined, but no limit check result displayed. The result is still available via CALCulate<chn>:RIPPle:</chn></type></ripplelimit></stopstimu- </startstimulus></type></ripplelimit></stopsti- </startstimulus></type>
	<pre>SEGMent<seg>:RESult?. <startstimulus> - stimulus value of the first point of the ripple limit range. The unit is adjusted to the sweep type of the active channel ([SENSe<ch>:]SWEep:TYPE).</ch></startstimulus></seg></pre>
	<startstimulus> – stimulus value of the last point of the ripple limit range. The unit is adjusted to the sweep type. <ripplelimit> – ripple limit in the range. The unit is adjusted to the format of the active trace (CALCulate<chn>: FORMat).</chn></ripplelimit></startstimulus>
	Range:Virtually no restriction for ripple limit ranges.*RST:n/a (no ripple limit line defined after a reset)Default unit:Stimulus values: Hz for frequency sweeps, dBm for power sweeps, s for time and CW mode sweeps. Ripple limit: see above.
Example:	*RST; CALC:RIPP:DATA 1, 150000000, 200000000, 3, 1, 200000000, 300000000, 5 Define and enable a ripple limit range in the stimulus range between 1.5 GHz and 2 GHz, assigning a ripple limit of +3 dB. Define and enable a second ripple limit range in the stimulus range between 2 GHz and 3 GHz, assigning a ripple limit of +5 dB. CALC:RIPP:DISP ON Show the ripple limits in the active diagram.
Manual control:	See "Add / Insert / Delete / Delete All / Align All" on page 233

#### CALCulate<Chn>:RIPPle:DELete:ALL

Deletes all ripple limit ranges.

Suffix: <Chn>

Channel number used to identify the active trace.

Example:	<ul> <li>*RST; CALC:RIPP:DATA 1,150000000, 200000000,</li> <li>3, 1, 200000000, 300000000, 5</li> <li>Define and enable a ripple limit range in the stimulus range between 1.5 GHz and 2 GHz, assigning a ripple limit of +3 dB.</li> <li>Define and enable a second ripple limit range in the stimulus range between 2 GHz and 3 GHz, assigning a ripple limit of +5 dB.</li> <li>CALC:RIPP:DEL:ALL</li> <li>Delete both created ripple limit ranges.</li> </ul>
Usage:	Event
Manual control:	See "Add / Insert / Delete / Delete All / Align All" on page 233

# CALCulate<Chn>:RIPPle:DISPlay[:STATe] <Boolean>

Displays or hides all ripple limit lines (including all ranges) associated to the active trace.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <boolean></boolean>	ON   OFF - ripple limit line on or off. *RST: OFF
Example:	*RST; CALC:RIPP:DATA 1,150000000, 200000000, 3 Define and enable a ripple limit range in the stimulus range between 1.5 GHz and 2 GHz, assigning a ripple limit of +3 dB. CALC:RIPP:DISP ON Show the ripple limit range in the active diagram.
Manual control:	See "Show Ripple Limits" on page 230

#### CALCulate<Chn>:RIPPle:FAIL?

Returns a 0 or 1 to indicate whether or not the global ripple limit check has failed.

**Tip:** Use CALCulate<Chn>:RIPPle:SEGMent<Seg>:RESult? to query the result for a single ripple limit range.

#### Suffix:

<chn></chn>	Channel number used to identify the active trace.
Example:	*RST; CALC:RIPP:DATA 1, 150000000, 200000000, 3
	Define and enable a ripple limit range in the stimulus range between 1.5 GHz and 2 GHz, assigning a ripple limit of +3 dB. CALC:RIPP:STAT ON; FAIL? Switch the limit check on and query the result. CALC:RIPP:STAT:AREA LEFT, TOP For a subsequent check at the GUI or a hardcopy, move the info
	field to the top left position.
Usage:	Query only

Manual control: See "Ripple Check" on page 231

#### CALCulate<Chn>:RIPPle:RDOMain:FORMat <UnitRef>

Deletes the existing ripple limit ranges and (re-)defines the physical unit of the ripple limit. The units of the stimulus values are defined via CALCulate<Chn>:RIPPle: CONTrol:DOMain.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.
Setting parameters: <unitref></unitref>	COMPlex   MAGNitude   PHASe   REAL   IMAGinary   SWR   GDELay   L   C Keyword for the physical unit of the response values; dimension- less numerss, relative power, phase, time, inductance, capaci- tance units. *RST: n/a Default unit: 1 (U, for COMPlex, REAL, IMAGinary, and SWR); dB (for MAGNitude), deg (for PHASe), s (for GDELay), H (Henry, for L), F (Farad, for C).
Example:	*RST; CALC:RIPP:DATA 1, 150000000, 200000000, 3 Define and enable a ripple limit range in the stimulus range between 1.5 GHz and 2 GHz, assigning a ripple limit of +3 dB. CALC:RIPP:RDOM:FORM COMP Delete the ripple limit range, select complex units for the ripple limit.
Usage:	Setting only

#### CALCulate<Chn>:RIPPle:SEGMent:COUNt?

Queries the number of ripple limit ranges. The response is an integer number.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Example:	*RST; CALC:RIPP:DATA 1, 150000000, 200000000, 3, 1, 200000000, 300000000, 5 Define and enable a ripple limit range in the stimulus range between 1.5 GHz and 2 GHz, assigning a ripple limit of +3 dB. Define and enable a second ripple limit range in the stimulus range between 2 GHz and 3 GHz, assigning a ripple limit of +5 dB. CALC:RIPP:SEGM:COUNT? Query the number of ranges. The response is 2.
Usage:	Query only
Manual control:	See "Range List" on page 233

#### CALCulate<Chn>:RIPPle:SEGMent<Seg>:LIMit <Limit>

Defines the ripple limit for ripple limit range no. <Seg>. A range must be created first to enable this command (e.g. CALCulate<Chn>:RIPPle:DATA). See chapter 3.4.1.2, "Rules for Ripple Test Definition", on page 63.

**Tip:** To define several ripple limit ranges with a single command, use CALCulate<Chn>:RIPPle:DATA.

Suffix: <chn></chn>	Channel number used to identify the active trace.	
<seg></seg>	Number of the ripple limit range.	
<b>Parameters:</b> <limit></limit>	Ripple limit in the range. The unit is adjusted to the format of the active trace (CALCulate <chn>: FORMat).</chn>	
	Range:Virtually no restriction for ripple limit ranges.*RST:n/a (no ripple limit line defined after a reset)Default unit:See above.	
Example:	See CALCulate <chn>:RIPPle:SEGMent<seg>:STIMulus: STARt</seg></chn>	
Manual control:	See "Range List" on page 233	

#### CALCulate<Chn>:RIPPle:SEGMent<Seg>:RESult?

Returns the result of the ripple limit check in the previously defined limit range no. <Seg>. The response consists of two parameters:

- <Boolean> 0 for "passed", 1 for "failed".
- <Limit> measured ripple in the limit range. A result is returned even if the limit check in the range no. <Seg> is disabled; see example below.

A reset deletes all ripple limit ranges. Use CALCulate<Ch>:RIPPle:FAIL? to query the result for global ripple limit check.

**Note:** In remote control, the ripple limit check result is calculated once at the end of each sweep. If the ripple limits are changed, a new sweep is required to obtain updated ripple limit check results. In single sweep mode (INITiate<Ch>: CONTinuous OFF), the new sweep must be started explicitly. This behavior is different from manual control where a changed ripple limit line can directly affect the pass/fail result of the displayed trace.

Suffix:	
<chn></chn>	Channel number used to identify the active trace.
<seg></seg>	Number of the ripple limit range.

Example:	*RST; CALC:RIPP:DATA 1, 150000000, 200000000, 3
	Define and enable a ripple limit range in the stimulus range between 1.5 GHz and 2 GHz, assigning a ripple limit of +3 dB. CALC:RIPP:STAT ON; SEGM:RES?
	Enable the limit check and query the result for the created range.
	Possible response: 0,0.3529814004.
	CALC:RIPP:DATA 0, 250000000, 300000000, 3
	Define a second ripple limit range with disabled limit check (no limit check results are displayed in the diagram area). CALC:RIPP:SEGM2:RES? Query the result for the second range. Possible response: 0,1.149071925.
Usage:	Query only
Manual control:	See "Ripple Check" on page 231

## CALCulate<Chn>:RIPPle:SEGMent<Seg>[:STATe] <Boolean>

Enables or disables the limit check in the ripple limit range no. <Seg>.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.	
<seg></seg>	Number of the ripple limit range.	
Parameters: <boolean></boolean>	ON   OFF - Limit check on or off. A result is available even if the limit check is disabled; see example for CALCulate <chn>: RIPPle:SEGMent<seg>:RESult?. *RST: n/a (no ripple limit line defined after a reset)</seg></chn>	
Example:	See CALCulate <chn>:RIPPle:SEGMent<seg>:STIMulus: STARt</seg></chn>	
Manual control:	See "Range List" on page 233	

## CALCulate<Chn>:RIPPle:SEGMent<Seg>:STIMulus:STARt <FreqPowTime> CALCulate<Chn>:RIPPle:SEGMent<Seg>:STIMulus:STOP <FreqPowTime>

These commands change the start or stop stimulus values (i.e. the smallest or largest stimulus values) of a ripple limit range. A range must be created first to enable these commands (e.g CALCulate<Chn>:RIPPle:DATA). See chapter 3.4.1.2, "Rules for Ripple Test Definition", on page 63.

**Tip:** To define several ripple limit ranges with a single command, use CALCulate<Chn>:RIPPle:DATA.

Suffix:	
<chn></chn>	Channel number used to identify the active trace.
<seg></seg>	Number of the ripple limit range.

User Manual 1173.9163.02 - 13

- ---

Parameters:	
<freqpowtime></freqpowtime>	Frequency, power or time value, according to the sweep type of the active channel ([SENSe <ch>:]SWEep:TYPE).</ch>
	Range:Virtually no restriction for ripple limit ranges.*RST:n/a (no ripple limit line defined after a reset)Default unit:Hz for frequency sweeps, dBm for power sweeps, s for time and CW mode sweeps.
Example:	<ul> <li>*RST; CALC:RIPP:DATA 1,150000000, 20000000,3</li> <li>Define and enable a ripple limit range in the stimulus range between 1.5 GHz and 2 GHz, assigning a ripple limit of +3 dB. CALC:RIPP:SEGM:STIM:STAR 1GHZ; STOP 2.5 GHZ; : CALC:RIPP:SEGM:LIM 5</li> <li>Change the range to a stimulus range between 1 GHz and 2.5 GHz and a limit of 5 dB. CALC:RIPP:SEGM:STAT OFF</li> <li>Disable the limit check in the modified stimulus range.</li> </ul>
Manual control:	See "Range List" on page 233

#### CALCulate<Chn>:RIPPle:SOUNd[:STATe] <Boolean>

Switches the acoustic signal (fail beep) on or off. The fail beep is generated each time the analyzer detects an exceeded ripple limit.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <boolean></boolean>	ON   OFF - fail beep on or off. *RST: OFF
Example:	CALC:RIPP:STAT ON; SOUN ON Switch the limit check on and activate the fail beep.
Manual control:	See "Ripple Fail Beep" on page 232

## CALCulate<Chn>:RIPPle:STATe <Boolean>

Switches the ripple limit check for the active trace on or off.

**Tip:** Use CALCulate<Chn>:RIPPle:SEGMent<Seg>[:STATe] to switch the limit check for a single ripple limit range on or off.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <boolean></boolean>	ON   OFF – ripple limit check on or off. *RST: OFF
Example:	See CALCulate <chn>:RIPPle:FAIL?</chn>

Manual control: See "Ripple Check" on page 231

## CALCulate<Chn>:RIPPIe:STATe:AREA <HorizontalPos>, <VerticalPos>

Moves the ripple test info field for the active trace <Chn> to one of nine predefined positions in the active diagram.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.
<b>Parameters:</b> <horizontalpos></horizontalpos>	LEFT   MID   RIGHt Horizontal position
<verticalpos></verticalpos>	TOP   MID   BOTTom Vertical position
Example:	See CALCulate <chn>:RIPPle:FAIL?</chn>
Manual control:	See "Ripple Check" on page 231

## CALCulate<Chn>:RIPPle:CLEar

Resets the limit check results for the ripple test.

<pre>Suffix: <chn></chn></pre>	Channel number
Usage:	Event
Manual control:	See "Clear Test" on page 232

## 6.3.1.13 CALCulate:SMOothing...

~ ~~

The CALCulate: SMOothing... commands provide the settings for trace smoothing.

CALCulate <chn>:SMOothing:APERture</chn>	562
CALCulate <chn>:SMOothing[:STATe]</chn>	563

#### CALCulate<Chn>:SMOothing:APERture <SmoothAperture>

Defines how many measurement points are averaged to smooth the trace.

 Suffix:

 <Chn>
 Channel number used to identify the active trace.

## Parameters:

<smoothaperture></smoothaperture>	smoothing i equal to [x <sub>i</sub> ·	aperture. A smoothing aperture of n % means that the nterval for each sweep point i with stimulus value $x_i$ is - span*n/200, $x_i$ + span*n/200], and that the result of i by the arithmetic mean value of all measurement points
	in this interv	/al.
	Range:	0.05% to 100%.

Range: 0.05% to rook. \*RST: 1 Default unit: %

*RST; :CALC:SMO ON
Activate smoothing for the default trace.
CALC:SMO:APER 0.5
Reduce the smoothing aperture to 0.5 %.

Manual control: See "Aperture" on page 216

## CALCulate<Chn>:SMOothing[:STATe] <Boolean>

Enables or disables smoothing for trace no. <Chn>.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <boolean></boolean>	ON   OFF - smoothing on or off. *RST: OFF
Example:	See CALCulate <chn>:SMOothing:APERture</chn>
Manual control:	See "Smoothing" on page 216

## 6.3.1.14 CALCulate:STATistics...

The <code>CALCulate:STATistics...</code> commands evaluate and display statistical and phase information of the trace.

CALCulate <chn>:STATistics:DOMain:USER</chn>	564
CALCulate <chn>:STATistics:DOMain:USER:SHOW</chn>	564
CALCulate <chn>:STATistics:DOMain:USER:STARt</chn>	564
CALCulate <chn>:STATistics:DOMain:USER:STOP</chn>	564
CALCulate <chn>:STATistics:EPDelay[:STATe]</chn>	565
CALCulate <chn>:STATistics:MMPTpeak[:STATe]</chn>	565
CALCulate <chn>:STATistics:MSTDdev[:STATe]</chn>	565
CALCulate <chn>:STATistics:NLINear:COMP:LEVel</chn>	565
CALCulate <chn>:STATistics:NLINear:COMP:RESult?</chn>	566
CALCulate <chn>:STATistics:NLINear:COMP[:STATe]</chn>	566
CALCulate <chn>:STATistics:RESult?</chn>	566
CALCulate <chn>:STATistics:RMS[:STATe]</chn>	567

SCPI Command Reference

CALCulate <chn>:STATistics:SFLatness[:STATe]</chn>	
CALCulate <chn>:STATistics[:STATe]</chn>	
CALCulate <chn>:STATistics[:STATe]:AREA</chn>	

#### CALCulate<Chn>:STATistics:DOMain:USER <EvalRange>

Selects one out of 10 evaluation ranges to be configured with the CALCulate<Chn>: STATistics:DOMain:USER:SHOW, CALCulate<Chn>:STATistics:DOMain: USER:STARt, and CALCulate<Chn>:STATistics:DOMain:USER:STOP commands.

#### Suffix:

<chn></chn>	Channel number used to identify the active trace.
<b>Parameters:</b> <evalrange></evalrange>	Number of the evaluation range.Range:1 to 10. In addition, 0 denotes the (non-configurable) "Full Span" evaluation range.*RST:0
Example:	<pre>*RST; :CALC:STAT:DOM:USER? Query the default evaluation range. The response is zero, i.e. the evaluation range is equal to the complete sweep range CALC:STAT:DOM:USER 1 CALC:STAT:DOM:USER:STARt 1GHZ; STOP 2GHZ; SHOW ON Select evaluation range no. 1 and define the evaluation range between 1 GHz and 2 GHz. Display the range limit lines.</pre>
Manual control:	See "Evaluation Range" on page 215

#### CALCulate<Chn>:STATistics:DOMain:USER:SHOW <Boolean>

Displays or hides range limit lines for the evaluation range selected via CALCulate<Chn>:STATistics:DOMain:USER.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <boolean></boolean>	ON   OFF - range limit lines on or off. *RST: OFF
Example:	See CALCulate <chn>:STATistics:DOMain:USER</chn>
Manual control:	See "Range Limit Lines on" on page 215

## CALCulate<Chn>:STATistics:DOMain:USER:STARt <Start> CALCulate<Chn>:STATistics:DOMain:USER:STOP <Stop>

These commands define the start and stop values of the evaluation range selected via CALCulate<Chn>:STATistics:DOMain:USER.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.
Parameters: <stop></stop>	Start or stop value of the evaluation range.
	Range:-1000 GHz to 1000 GHz*RST:Lowest or highest frequency of the analyzer, depending on the analyzer model.
	Default unit: Hz
Example:	See CALCulate <chn>:STATistics:DOMain:USER</chn>
Manual control:	See "Evaluation Range" on page 215

## CALCulate<Chn>:STATistics:EPDelay[:STATe] <Boolean> CALCulate<Chn>:STATistics:MMPTpeak[:STATe] <Boolean> CALCulate<Chn>:STATistics:MSTDdev[:STATe] <Boolean>

These commands display or hide the "Phase/El Length" results, the "Min/Max/Peak-Peak" results, and the "Mean/Std Dev" results in the diagram area of trace no. <Chn>.

Channel number used to identify the active trace.
ON   OFF - statistical info field on or off. *RST: OFF
See CALCulate <chn>:STATistics[:STATe]</chn>
See "Statistical Functions" on page 211

## CALCulate<Chn>:STATistics:NLINear:COMP:LEVel <Stop>

Defines the compression value x for the compression point measurement ( CALCulate<Chn>:STATistics:NLINear:COMP:RESult?).

Suffix: <chn></chn>	Channel nur	mber used to identify the active trace.
Parameters: <stop></stop>	Stop value o Range: *RST: Default unit:	of the evaluation range. +0.01 dBm to +100.00 dBm 1 dBm dB
Example:	See CALCul RESult?	late <chn>:STATistics:NLINear:COMP:</chn>
Manual control:	See "Compr	Point / Value" on page 213

#### R&S<sup>®</sup> ZNB

## CALCulate<Chn>:STATistics:NLINear:COMP:RESult?

Returns the x-dB compression point of an S-parameter or ratio measured in a power sweep. The compression value x is set via CALCulate<Chn>:STATistics: NLINear:COMP:LEVel.

The response contains two numeric values:

- <Cmp In> stimulus level at the compression point in dBm.
- <Cmp Out> sum of <Cmp In> plus the magnitude of the measured response value at the compression point in dBm.

#### Suffix:

<chn></chn>	Channel number used to identify the active trace.
Example:	<pre>*RST; SWE:TYPE POW Select a power sweep with default CW frequency and sweep range. CALC:STAT:NLIN:COMP:LEV 2 Define a compression value of 2 dB. CALC:STAT:NLIN:COMP:RES? Query the compression point results <cmp in="">, <cmp out="">. An execution error message (error no200) is returned if no com- pression point is found. CALC:STAT:NLIN:COMP ON Display the compression point result in the diagram area.</cmp></cmp></pre>
Usage:	Query only
Manual control:	See "Compr Point / Value" on page 213

## CALCulate<Chn>:STATistics:NLINear:COMP[:STATe] <Boolean>

Displays or hides the compression point result in the diagram area of trace no. <Chn>.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <boolean></boolean>	ON   OFF - statistical info field on or off. *RST: OFF
Example:	See CALCulate <chn>:STATistics:NLINear:COMP: RESult?</chn>
Manual control:	See "Compr Point / Value" on page 213

## CALCulate<Chn>:STATistics:RESult? <Result>

Returns a single statistical parameter of the trace no. <Chn> or all parameters. It is not necessary to display the info field (CALCulate<Chn>:STATistics[:STATe]ON) before using this command.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.
Parameters: <result></result>	<ul> <li>MEAN   STDDev   MAX   MIN   RMS   PTPeak   PEAK2p   ELENgth   PDELay   GAIN   SLOPe   FLATness   ALL</li> <li>MEAN - return arithmetic mean value of all response values of the trace in the entire sweep range (or in the evaluation range defined in manual control).</li> <li>STDDev - return standard deviation of all response values.</li> <li>MAX - return the maximum of all response values.</li> <li>MIN - return the minimum of all response values.</li> <li>RMS - return the root mean square of all response values.</li> <li>PTPeak - return the peak-to-peak value (MAX - MIN).</li> <li>ELENgth - return the phase delay.</li> <li>GAIN - return the gain, i.e. the larger of two marker values.</li> <li>SLOPe - return the flatness of the trace between two marker values.</li> <li>FLATness - return the flatness of the trace between two marker values.</li> <li>ALL - return all statistical values, observing the order used above.</li> <li>The unit is the default unit of the measured parameter (see CALCulate<ch>: PARameter:SDEFine) but may also depend on the trace format (linear or logarithmic scale, see CALCulate<ch>: FORMat). If a polar trace format is selected, then the statistical parameters are calculated from the linear magnitude of the measurement parameter.</ch></ch></li> </ul>
Example:	*RST; :CALC:STAT:RES? MAX Calculate and return the maximum of the default trace showing an S-parameter on a dB Mag scale. :CALC:FORM POL; STAT:RES? MAX Display the trace in a polar diagram and re-calculate the maxi- mum. The result corresponds to the previous result but is conver- ted to a unitless linear value.
Usage:	Query only
Manual control:	See "Statistical Functions" on page 211

## CALCulate<Chn>:STATistics:RMS[:STATe] <Boolean> CALCulate<Chn>:STATistics:SFLatness[:STATe] <Boolean>

These commands display or hide the "RMS" and the "Flatness/Gain/Slope" results in the diagram area of trace no. <Chn>.

Suffix:

<Chn> Channel number used to identify the active trace.

Parameters: <boolean></boolean>	ON   OFF - statistical info field on or off. *RST: OFF
Example:	See CALCulate <chn>:STATistics[:STATe]</chn>
Manual control:	See "Flatness / Gain / Slope" on page 213

#### CALCulate<Chn>:STATistics[:STATe] <Boolean>

Displays or hides all statistical results in the diagram area of trace no. <Chn> except the compression point results.

**Tip:** You can display or hide the "Min/Max/Peak-Peak", "Mean/Std Dev/RMS", "Phase/ El Length" and "Flatness/Gain/Slope" results separately; see example below.

Suffix: <chn> Parameters:</chn>	Channel number used to identify the active trace.
<boolean></boolean>	ON   OFF - Statistical info field on or off. *RST: OFF
Example:	<pre>*RST; :CALC:STAT:MMPT ON Reset the instrument, hiding all statistical results. Display the "Min/ Max/Peak-Peak" results. CALC:STAT:MSTD ON Display the "Mean/Std Dev" results in addition. CALC:STAT:RMS ON Display the "RMS" results in addition. CALC:STAT:EPD ON Display the "Phase/EI Length" results in addition. CALC:STAT:SFL ON Display the "Flatness/Gain/Slope" results in addition. CALC:STAT:STAT:AREA LEFT, TOP For a subsequent check at the GUI or a hardcopy, move the info field to the top left position CALC:STAT OFF Hide all results.</pre>
Manual control:	See "Statistical Functions" on page 211

CALCulate<Chn>:STATistics[:STATe]:AREA <HorizontalPos>, <VerticalPos>

Moves the statistics info field for the active trace <Chn> to one of nine predefined positions in the active diagram.

#### Suffix:

<Chn> Channel r

Channel number used to identify the active trace.

Parameters:			
<horizontalpos></horizontalpos>	LEFT   MID   RIGHt		
	Horizontal position		
<verticalpos></verticalpos>	TOP   MID   BOTTom		
	Vertical position		
Example:	See CALCulate <chn>:STATistics[:STATe]</chn>		
Manual control:	See "Compr Point / Value" on page 213		

#### 6.3.1.15 CALCulate:TRANsform...

The CALCulate: TRANsform... commands convert measured data from one representation to another and control the transformation into the time domain (with option R&S ZNB-K2).

CALCulate <chn>:TRANsform:COMPlex</chn>	569
CALCulate <chn>:TRANsform:IMPedance:RNORmal</chn>	
CALCulate <chn>:TRANsform:TIME:CENTer</chn>	
CALCulate <chn>:TRANsform:TIME:DCHebyshev</chn>	
CALCulate <chn>:TRANsform:TIME:LPASs</chn>	
CALCulate <chn>:TRANsform:TIME:LPASs:DCSParam</chn>	
CALCulate <chn>:TRANsform:TIME:LPASs:DCSParam:CONTinuous</chn>	572
CALCulate <chn>:TRANsform:TIME:LPASs:DCSParam:EXTRapolate</chn>	
CALCulate <chn>:TRANsform:TIME:LPFRequency</chn>	
CALCulate <chn>:TRANsform:TIME:RESolution:EFACtor</chn>	
CALCulate <chn>:TRANsform:TIME:SPAN</chn>	574
CALCulate <chn>:TRANsform:TIME:STARt</chn>	574
CALCulate <chn>:TRANsform:TIME:STATe</chn>	575
CALCulate <chn>:TRANsform:TIME:STIMulus</chn>	575
CALCulate <chn>:TRANsform:TIME:STOP</chn>	575
CALCulate <chn>:TRANsform:TIME[:TYPE]</chn>	576
CALCulate <chn>:TRANsform:TIME:WINDow</chn>	576
CALCulate <chn>:TRANsform:TIME:XAXis</chn>	577

#### CALCulate<Chn>:TRANsform:COMPlex <Result>

Converts S-parameters into converted (matched-circuit) Y-parameters or Z-parameters and vice versa, assuming that port no. i is terminated with  $Z_{0i}$  so that the three parameter sets are equivalent and the following formulas apply:

$$Z_{ii} = Z_{0i} \frac{1 + S_{ii}}{1 - S_{ii}}$$
$$Z_{ij} = 2 \cdot \frac{\sqrt{Z_{0i} \cdot Z_{0j}}}{S_{ij}} - (Z_{0i} + Z_{0j}), \quad i \neq j,$$

User Manual 1173.9163.02 - 13

## www.valuetronics.com

$$Y_{ii} = \frac{1}{Z_{0i}} \frac{1 - S_{ii}}{1 + S_{ii}} = 1/Z_{ii}$$

$$Y_{ij} = \frac{S_{ij}}{2 \cdot \sqrt{Z_{0i} \cdot Z_{0j}} - S_{ij} \cdot (Z_{0i} + Z_{0j})} = 1/Z_{ij}, \quad i \neq j, \quad i, j = 1, ..., 99$$
Suffix:
 Channel number used to identify the active trace.
Parameters:
 S | Y | Z

S-parameters, Y-parameters, Z-parameters			
*RST; CALC:PAR:MEAS 'Trc1'", '"Y-S22'			
Select the converted admittance Y < S22 as measurement parameter of the default trace. CALC:TRAN:COMP S			
			Convert the converted Y-parameter into an S-parameter.

#### CALCulate<Chn>:TRANsform:IMPedance:RNORmal <Model>

Selects the theory for the renormalization of port impedances. The selection has an impact on the conversion formulas for wave quantities and S-parameters.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.	
Parameters: <model></model>	TWAVes   PWAVes TWAVes - travelling waves PWAVes - power waves *RST: TWAVes	
Example:	See [SENSe <ch>:]PORT<phypt>:ZREFerence</phypt></ch>	
Manual control:	See "Renormalization according to Theory of" on page 159	

## CALCulate<Chn>:TRANsform:TIME:CENTer <CenterTime>

Defines the center time of the diagram in time domain.

Suffix:

<Chn> Channel number used to identify the active trace.

#### Parameters:

<CenterTime>

Center time of the diagram in time domain. Range: -99.9999999999 s to +99.9999999999 s Increment: 0.1 ns \*RST: 1.5E-009 s Default unit: s

Example:	*RST; :CALC:TRAN:TIME:STAT ON
	Reset the instrument, activating a frequency sweep, and enable
	the time domain transformation for the default trace.
	CALC:TRAN:TIME:CENT 0; SPAN 5ns
	Set the center time to 0 ns and the time span to 5 ns.

Manual control: See "Time Start / Stop / Center / Span" on page 259

Note: If the x-axis is scaled in distance units (CALCulate<Chn>: TRANsform: TIME: XAXis DISTance), then the center value is entered in m; the range and default value changes accordingly.

#### CALCulate<Chn>:TRANsform:TIME:DCHebyshev <SidebandSupp>

Sets the sideband suppression for the Dolph-Chebyshev window. The command is only available if a Dolph-Chebyshev window is active (CALCulate<Chn>:TRANsform: TIME:WINDow DCHebyshev).

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.		
Parameters: <sidebandsupp></sidebandsupp>	Sideband suppression Range: 10 dB to 120 dB Increment: 10 dB *RST: 32 dB Default unit: dB		
Example:	*RST; :CALC:TRAN:TIME:WIND DCH Reset the instrument and select a Dolph-Chebyshev window for filtering the data in the frequency domain. CALC:TRAN:TIME:DCH 25 Set the sideband suppression to 25 dB.		
Manual control:	See "Side Lobe Level" on page 206		

#### CALCulate<Chn>:TRANsform:TIME:LPASs <Algorithm>

Calculates the harmonic grid for low pass time domain transforms according to one of the three alternative algorithms.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <algorithm></algorithm>	KFSTop   KDFRequency   KSDFrequency
	KFSTop - keep stop frequency and number of points KDFRequency - keep frequency gap and number of points KSDfrequency - keep stop frequency and approximate frequency gap
Example:	See CALCulate <chn>:TRANsform:TIME[:TYPE]</chn>

Manual control: See "Set Harmonic Grid and Keep" on page 207

#### CALCulate<Chn>:TRANsform:TIME:LPASs:DCSParam <DCValue>

Defines the DC value for low pass transforms. The command is enabled only if the sweep points are on a harmonic grid (to be set explicitly or using CALCulate<Chn>: TRANsform:TIME:LPASs).

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.		
Parameters: <dcvalue></dcvalue>	DC value of the measured quantity Range: Depending on the measured quantity (-1 to +1 for S- parameters) *RST: 0		
Example:	<ul> <li>*RST; :CALC:TRAN:TIME:STAT ON</li> <li>Reset the instrument, activating a frequency sweep with S<sub>21</sub> as measured quantity, and enable the time domain transformation for the default trace.</li> <li>CALC:TRAN:TIME LPAS; TIME:STIM STEP</li> <li>Select a low pass step transformation.</li> <li>CALC:TRAN:TIME:LPAS KFST</li> <li>Calculate a harmonic grid, maintaining the stop frequency and the number of points.</li> <li>CALC:TRAN:TIME:LPAS:DCSP 0.2</li> <li>Set the DC value.</li> <li>CALC:TRAN:TIME:LPAS:DCSP:EXTR; :CALC:TRAN:TIME:LPAS:DCSP?</li> <li>Extrapolate the measured trace, overwrite the defined DC value, and query the new value.</li> <li>CALC:TRAN:TIME:LPAS:DCSP:CONT ON</li> <li>Switch over to continuous extrapolation (e.g. because you noticed a discrepancy between the manually entered DC value and the extrapolation and assume the extrapolation to be more trustworthy).</li> <li>CALC:TRAN:TIME:RES:EFAC 3</li> <li>Select a resolution enhancement factor of 3 in order to improve the resolution in time domain.</li> </ul>		
Manual control:	See "DC Value" on page 207		

## CALCulate<Chn>:TRANsform:TIME:LPASs:DCSParam:CONTinuous <Boolean>

Determines whether continuous extrapolation for the DC value is enabled.

Suffix: <Chn>

Channel number used to identify the active trace.

Parameters: <boolean></boolean>	ON - continuous extrapolation enabled OFF - continuous extrapolation disabled *RST: OFF	
Example:	See CALCulate <chn>:TRANsform:TIME:LPASs:DCSParam</chn>	
Manual control:	See "DC Value" on page 207	

## CALCulate<Chn>:TRANsform:TIME:LPASs:DCSParam:EXTRapolate

Extrapolates the measured trace towards f = 0 and overwrites the current DC value ( CALCulate<Chn>: TRANsform: TIME: LPASs: DCSParam). The command is relevant for low pass time domain transforms.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Example:	See CALCulate <chn>:TRANsform:TIME:LPASs:DCSParam</chn>
Usage:	Event
Manual control:	See "DC Value" on page 207

## CALCulate<Chn>:TRANsform:TIME:LPFRequency

Calculates the harmonic grid for low pass time domain transforms, keeping the stop frequency and the number of points.

**Tip:** Use CALCulate<Chn>: TRANsform: TIME: LPASs if you wish to use one of the other algorithms for calculating the grid.

Suffix: <chn></chn>	Channel number used to identify the active trace.		
Example:	See CALCulate <chn>:TRANsform:TIME[:TYPE]</chn>		
Usage:	Event		
Manual control:	See "DC Value" on page 207		

#### CALCulate<Chn>:TRANsform:TIME:RESolution:EFACtor <REfactor>

Defines the resolution enhancement factor for the time domain transform.

Suffix: <chn></chn>	Channel number used to identify the active trace.	
Parameters: <refactor></refactor>	Resolution enhancement factor.	
	Range: Increment: *RST:	

SCPI Command Reference

Example:	See CALCulate <chn>:TRANsform:TIME:LPASs:DCSParam</chn>

Manual control: See "Resolution Enh(ancement)" on page 206

## CALCulate<Chn>:TRANsform:TIME:SPAN <Span>

Defines the time span of the diagram in time domain.

Suffix: <chn></chn>	Channel nui	mber used to identify the active trace.
<b>Parameters:</b> <span></span>	•	5E-009 s
Example:	See CALCu	late <chn>:TRANsform:TIME:CENTer</chn>
Manual control:	See "Time S	Start / Stop / Center / Span" on page 259

**Note:** If the x-axis is scaled in distance units (CALCulate<Chn>:TRANsform:TIME: XAXis DISTance), then the span is entered in m; the range and default value changes accordingly.

#### CALCulate<Chn>:TRANsform:TIME:STARt <StartTime>

Defines the start time of the diagram in time domain.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.		
Parameters: <starttime></starttime>	Start time of the diagram.Range:-100 s to +99.99999999998 s.Increment:0.1 ns*RST:-1E-009 sDefault unit:s		
Example:	*RST; :CALC:TRAN:TIME:STAT ON Reset the instrument, activating a frequency sweep, and enable the time domain transformation for the default trace. CALC:TRAN:TIME:STAR 0; STOP 10 ns Set the start time to 0 ns and the stop time to 10 ns.		
Manual control:	See "Time Start / Stop / Center / Span" on page 259		

Note: If the start frequency entered is greater than the current stop frequency ( CALCulate<Chn>: TRANsform: TIME: STOP), the stop frequency is set to the start frequency plus the minimum frequency span (CALCulate<Chn>: TRANsform: TIME: SPAN). If the x-axis is scaled in distance units (CALCulate<Chn>: TRANsform: TIME: XAXis DISTance), then the start value is entered in m; the range and default value changes accordingly.

#### CALCulate<Chn>:TRANsform:TIME:STATe <Boolean>

Determines whether the time domain transformation for trace no. <Chn> is enabled.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <boolean></boolean>	ON - time domain representation active. OFF - frequency domain representation active. *RST: OFF
Example:	*RST; :CALC:TRAN:TIME:STAT? Reset the instrument, activating a frequency sweep, and query whether the default trace is displayed in the time domain. The response is 0.
Manual control:	See "Time Domain" on page 205

#### CALCulate<Chn>:TRANsform:TIME:STIMulus <Type>

Selects the type of stimulus to be simulated in the low pass transformation process.

Suffix: <chn></chn>	Channel number used to identify the active trace.
<b>Parameters:</b> <type></type>	IMPulse   STEP
	<pre>IMPulse - impulse response, in bandpass or lowpass mode. STEP - step response, only in lowpass mode (a bandpass mode setting CALCulate<chn>:TRANsform:TIME[:TYPE] BPASs is automatically changed to lowpass). *RST: IMP</chn></pre>
Example:	See CALCulate <chn>:TRANsform:TIME[:TYPE]</chn>
Manual control:	See "Type" on page 205

## CALCulate<Chn>:TRANsform:TIME:STOP <StopTime>

Defines the stop time of the diagram in time domain.

Suffix: <Chn>

Channel number used to identify the active trace.

Parameters: <stoptime></stoptime>	Stop time of the diagram. Range: -99.99999999998 s to +100 s. Increment: 0.1 ns *RST: +4E-009 s Default unit: s
Example:	See CALCulate <chn>:TRANsform:TIME:STARt</chn>
Manual control:	See "Time Start / Stop / Center / Span" on page 259

Note: If the stop frequency entered is smaller than the current start frequency ( CALCulate<Chn>:TRANsform:TIME:STARt), the start frequency is set to the stop frequency minus the minimum frequency span (CALCulate<Chn>:TRANsform: TIME:SPAN). If the x-axis is scaled in distance units (CALCulate<Chn>: TRANsform:TIME:XAXis DISTance), then the stop value is entered in m; the range and default value changes accordingly.

#### CALCulate<Chn>:TRANsform:TIME[:TYPE] <TransformType>

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <transformtype></transformtype>	BPASs   LPASs BPASs - band pass impulse (only impulse response; a step response CALCulate <chn>: TRANsform: TIME: STIMulus STEP is automatically changed to impulse response) LPASs - low pass (impulse or step response, depending on CALCulate<chn>: TRANsform: TIME: STIMulus setting) *RST: BPASs</chn></chn>
Example:	*RST; :CALC:TRAN:TIME:STAT ON Reset the instrument, activating a frequency sweep, and enable the time domain transformation for the default trace. CALC:TRAN:TIME LPAS; TIME:STIM STEP Select a low pass step transformation. CALC:TRAN:TIME:LPAS KFST Calculate a harmonic grid, keeping the stop frequency and the number of points.
Manual control:	See "Type" on page 205

Selects the time domain transformation type.

## CALCulate<Chn>:TRANsform:TIME:WINDow <WindowType>

Selects the window type for filtering the data in the frequency domain prior to the time domain transformation.

Suffix: <chn></chn>	Channel number used to identify the active trace.	
Parameters: <windowtype></windowtype>	RECT   HAMMing   HANNing   BOHMan   DCHebyshev RECT - no profiling (rectangle) HANN - normal profile (Hann) HAMMing - low first sidelobe (Hamming) BOHMan - steep falloff (Bohman) DCHebyshev - arbitrary sidelobes (Dolph-Chebychev) *RST: HANN	
Example:	See CALCulate <chn>:TRANsform:TIME:DCHebyshev</chn>	
Manual control:	See "Impulse Response" on page 205	

#### CALCulate<Chn>:TRANsform:TIME:XAXis <Unit>

Switches over between the x-axis scaling in time units or distance units.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.
<b>Parameters:</b> <unit></unit>	TIME   DISTance TIME - x-axis scaled in time units. DISTance - x-axis scaled in distance units (Distance = Time * $c_0$ * Velocity Factor).
Example:	*RST; :CALC:TRAN:TIME:STAT ON Reset the instrument, activating a frequency sweep, and enable the time domain transformation for the default trace. CALC:TRAN:TIME:XAX DIST Convert the x-axis scaling to distance units.
Manual control:	See "Time / Distance" on page 259

## 6.3.1.16 CALCulate:TRANsform:VNETworks...

The CALCulate: TRANsform: VNETworks... commands define the circuit models for single ended and balanced port (de-)embedding and activate the (de-)embedding function.

The circuit models are referenced by means of predefined character data parameters. They are different for single ended port and balanced port.

Parameter	Circuit model	Capacitances	Resistances	Inductances
FIMPort	File import, no circuit model	_	_	_
STSL	Serial Touchstone (.s2p) data, shunt L	_	R1	L1
STSC	Serial Touchstone (.s2p) data, shunt C	C1	R1	_

Parameter	Circuit model	Capacitances	Resistances	Inductances
SLST	Shunt L, serial Touchstone (.s2p) data	-	R1	L1
SCST	Shunt C, serial Touchstone (.s2p) data	C1	R1	-
CSSL	Serial Cs, shunt L	C1, C2	R1, R2, R3	L1
LSSC	Serial Ls, shunt C	C1	R1, R2, R3	L1, L2
CSSC	Serial Cs, shunt C	C1, C2, C3	R1, R2, R3	-
LSSL	Serial Ls, shunt L	-	R1, R2, R3	L1, L2, L3
SLCS	Shunt L, serial Cs	C1, C2	R1, R2, R3	L1
SCLS	Shunt C, serial Ls	C1	R1, R2, R3	L1, L2
SCCS	Shunt C, serial Cs	C1, C2, C3	R1, R2, R3	-
SLLS	Shunt L, serial Ls	-	R1, R2, R3	L1, L2, L3

Parameter	Circuit model	Capacitances	Resistances	Inductances
FIMPort	File import, no circuit model	-	-	-
CSL	Serial C, shunt L	C1	R1, R2	L1
LSC	Serial L, shunt C	C1	R1, R2	L1
CSC	Serial C, shunt C	C1, C2	R1, R2	-
LSL	Serial L, shunt L	_	R1, R2	L1, L2
SLC	Shunt L, serial C	C1	R1, R2	L1
SCL	Shunt C, serial L	C1	R1, R2	L1
SCC	Shunt C, serial C	C1, C2	R1, R2	-
SLL	Shunt L, serial L	_	R1, R2	L1, L2

CALCulate <ch>:TRANsform:VNETworks:BALanced:DEEMbedding<logpt>:</logpt></ch>
PARameters:C <cmp></cmp>
CALCulate <ch>:TRANsform:VNETworks:BALanced:DEEMbedding<logpt>:</logpt></ch>
PARameters:L <cmp></cmp>
CALCulate <ch>:TRANsform:VNETworks:BALanced:DEEMbedding<logpt>:</logpt></ch>
PARameters:R <cmp></cmp>
CALCulate <ch>:TRANsform:VNETworks:BALanced:DEEMbedding<logpt>[:STATe]</logpt></ch>
CALCulate <ch>:TRANsform:VNETworks:BALanced:DEEMbedding<logpt>:</logpt></ch>
TNDefinition
CALCulate <ch>:TRANsform:VNETworks:BALanced:EMBedding<logpt>:PARameters:</logpt></ch>
C <cmp></cmp>
CALCulate <ch>:TRANsform:VNETworks:BALanced:EMBedding<logpt>:PARameters:</logpt></ch>
L <cmp></cmp>
CALCulate <ch>:TRANsform:VNETworks:BALanced:EMBedding<logpt>:PARameters:</logpt></ch>
R <cmp></cmp>
CALCulate <ch>:TRANsform:VNETworks:BALanced:EMBedding<logpt>[:STATe]</logpt></ch>
•

CALCulate <ch>:TRANsform:VNETworks:BALanced:EMBedding<logpt>:TNDefinition</logpt></ch>	585
CALCulate <ch>:TRANsform:VNETworks:SENDed:DEEMbedding<phypt>:</phypt></ch>	
PARameters:C <cmp></cmp>	585
CALCulate <ch>:TRANsform:VNETworks:SENDed:DEEMbedding<phypt>:</phypt></ch>	
PARameters:L <cmp></cmp>	586
CALCulate <ch>:TRANsform:VNETworks:SENDed:DEEMbedding<phypt>:</phypt></ch>	
PARameters:R <cmp></cmp>	587
CALCulate <ch>:TRANsform:VNETworks:SENDed:DEEMbedding<phypt>[:STATe]</phypt></ch>	587
CALCulate <ch>:TRANsform:VNETworks:SENDed:DEEMbedding<phypt>:TNDefinition</phypt></ch>	
	588
CALCulate <ch>:TRANsform:VNETworks:SENDed:EMBedding<phypt>:PARameters:</phypt></ch>	
C <cmp></cmp>	588
CALCulate <ch>:TRANsform:VNETworks:SENDed:EMBedding<phypt>:PARameters:</phypt></ch>	
L <cmp></cmp>	589
CALCulate <ch>:TRANsform:VNETworks:SENDed:EMBedding<phypt>:PARameters:</phypt></ch>	
R <cmp></cmp>	590
CALCulate <ch>:TRANsform:VNETworks:SENDed:EMBedding<phypt>[:STATe]</phypt></ch>	590
CALCulate <ch>:TRANsform:VNETworks:SENDed:EMBedding<phypt>:TNDefinition</phypt></ch>	591

## CALCulate<Ch>:TRANsform:VNETworks:BALanced:DEEMbedding<LogPt>: PARameters:C<Cmp> <CircuitModel>[, <Capacitance>]

Specifies the capacitance values C1, C2, C3 in the different circuit models for balanced port deembedding.

In the query form, the <Capacitance> parameter must be omitted. The command returns the capacitance value for the specified circuit model.

S	uffi	ix:

<ch></ch>	Channel number
<logpt></logpt>	Logical port number (balanced port)
<cmp></cmp>	Number of capacitance in circuit model. The total number of capacitances depends on the selected circuit model.
Parameters: <circuitmodel></circuitmodel>	STSC   SCST   CSSL   LSSC   CSSC   SLCS   SCLS   SCCS Possible circuit models (character data); see table 6-5.
<capacitance></capacitance>	Capacitance C <cmp> for the specified circuit model. Range: -1mF to 1 mF. Increment: 1 fF (10E-15 F) *RST: 1 pF (10E-12 F) Default unit: F</cmp>
Example:	<pre>*RST; :SOUR:LPOR1 1,2; :CALC:TRAN:VNET:BAL: DEEM:PAR:C2? CSSL Create a balanced port and query the default capacitance C2 for the Serial Cs, shunt L circuit model. The response is 1E-012 (1 pF). CALC:TRAN:VNET:BAL:DEEM:PAR:C2 CSSL, 2.2E-12 Increase the capacitance to 2.2 pF.</pre>

Manual control: See "Networks" on page 406

CALCulate<Ch>:TRANsform:VNETworks:BALanced:DEEMbedding<LogPt>: PARameters:L<Cmp> <CircuitModel>[, <Inductance>]

Specifies the inductance values L1, L2, L3 in the different circuit models for balanced port deembedding.

In the query form, the <Inductance> parameter must be omitted. The command returns the inductance value for the specified circuit model.

Manual control:	See "Networks" on page 406
Example:	<pre>*RST; :SOUR:LPOR1 1,2; :CALC:TRAN:VNET:BAL: DEEM:PAR:L1? CSSL Create a balanced port and query the default inductance L1 for the Serial Cs, shunt L circuit model. The response is 1E-009 (1 nH). CALC:TRAN:VNET:BAL:DEEM:PAR:L1 CSSL, 2.2E-9 Increase the inductance to 2.2 nH.</pre>
<inductance></inductance>	Inductance L <cmp> for the specified circuit model. Range: -1H to 1 H. Increment: 1 pH (10E-12 H) *RST: 1 nH (10E-9 H) Default unit: H</cmp>
Parameters: <circuitmodel></circuitmodel>	STSL   SLST   CSSL   LSSC   LSSL   SLCS   SCLS   SLLS Possible circuit models (character data); see table 6-5.
<cmp></cmp>	Number of inductance in circuit model. The total number of induc- tances depends on the selected circuit model.
<logpt></logpt>	Logical port number (balanced port)
Suffix: <ch></ch>	Channel number

## CALCulate<Ch>:TRANsform:VNETworks:BALanced:DEEMbedding<LogPt>: PARameters:R<Cmp> <CiruitModel>[, <Resistance>]

Specifies the resistance values R1, R2, R3 in the different circuit models for balanced port deembedding.

In the query form, the <Resistance> parameter must be omitted. The command returns the resistance value for the specified circuit model.

#### Suffix:

<ch></ch>	Channel number
<logpt></logpt>	Logical port number (balanced port)

<cmp></cmp>	Number of resistance in circuit model. The total number of resis- tances depends on the selected circuit model.
Parameters: <ciruitmodel></ciruitmodel>	STSL   STSC   SLST   SCST   CSSL   LSSC   CSSC   LSSL   SLCS   SCLS   SCCS   SLLS Possible circuit models (character data); see table 6-5.
<resistance></resistance>	$\begin{array}{llllllllllllllllllllllllllllllllllll$
Example:	*RST; :SOUR:LPOR1 1,2; :CALC:TRAN:VNET:BAL: DEEM:PAR:R1? CSSL; R2? CSSL; R3? CSSL Create a balanced port and query the default resistances for the Serial Cs, shunt L circuit model. The response is 1000000000;1000000000; 0. CALC:TRAN:VNET:BAL:DEEM:PAR:R3 CSSL, 2.2E+3 Increase the resistance R3 to 2.2 kΩ.
Manual control:	See "Networks" on page 406

## CALCulate<Ch>:TRANsform:VNETworks:BALanced:DEEMbedding<LogPt>[: STATe] <Boolean>

Enables or disables the deembedding function for balanced ports. It is allowed to change the circuit model and its parameters while deembedding is enabled.

Suffix: <ch></ch>	Channel number
<logpt></logpt>	Logical port number (balanced port)
Parameters: <boolean></boolean>	ON - deembedding active OFF - deembedding inactive *RST: OFF
Example:	*RST; SOUR:LPOR1 1,2; LPOR2 3,4 Define a balanced port configuration. CALC:TRAN:VNET:BAL:DEEM:TND CSSL Select the Serial Cs, shunt L circuit model for deembedding. CALC:TRAN:VNET:BAL:DEEM:PAR:R3 CSSL, 2.2E+3; : CALC:TRAN:VNET:BAL:DEEM ON Increase the resistance R3 for the Serial Cs, shunt L circuit model to 2.2 kΩ and enable deembedding.
Manual control:	See "Logical Port" on page 406

## CALCulate<Ch>:TRANsform:VNETworks:BALanced:DEEMbedding<LogPt>: TNDefinition <CircuitModel>

Selects the circuit model for balanced port deembedding.

<b>Suffix:</b> <ch></ch>	Channel number
<logpt></logpt>	Logical port number (balanced port)
Parameters: <circuitmodel></circuitmodel>	FIMPort   STSL   STSC   SLST   SCST   CSSL   LSSC   CSSC   LSSL   SLCS   SCLS   SCCS   SLLS Possible circuit models (character data); see table 6-5. *RST: CSSL
Example:	<pre>See CALCulate<ch>:TRANsform:VNETworks:BALanced: DEEMbedding<logpt>[:STATe]</logpt></ch></pre>
Manual control:	See "Networks" on page 406

## CALCulate<Ch>:TRANsform:VNETworks:BALanced:EMBedding<LogPt>: PARameters:C<Cmp> <CiruitModel>[, <Capacitance>]

Specifies the capacitance values C1, C2, C3 in the different circuit models for balanced port embedding.

In the query form, the <Capacitance> parameter must be omitted. The command returns the capacitance value for the specified circuit model.

Suffix:	
<ch></ch>	Channel number
<logpt></logpt>	Logical port number (balanced port)
<cmp></cmp>	Number of capacitance in circuit model. The total number of capacitances depends on the selected circuit model.
Parameters:	
<ciruitmodel></ciruitmodel>	STSC   SCST   CSSL   LSSC   CSSC   SLCS   SCLS   SCCS
	Possible circuit models (character data); see table 6-5.
<capacitance></capacitance>	Capacitance C <cmp> for the specified circuit model.</cmp>
	Range: -1mF to 1 mF.
	Increment: 1 fF (10E-15 F)
	*RST: 1 pF (10E-12 F)
	Default unit: F

## www.valuetronics.com

SCPI Command Reference

Example:	<ul> <li>*RST; :SOUR:LPOR1 1,2; :CALC:TRAN:VNET:BAL:EMB: PAR:C2? CSSL</li> <li>Create a balanced port and query the default capacitance C2 for the Serial Cs, shunt L circuit model. The response is 1E-012 (1 pF).</li> <li>CALC:TRAN:VNET:BAL:EMB:PAR:C2 CSSL, 2.2E-12 Increase the capacitance to 2.2 pF.</li> </ul>
Manual control:	See "Networks" on page 404

## CALCulate<Ch>:TRANsform:VNETworks:BALanced:EMBedding<LogPt>: PARameters:L<Cmp> <CircuitModel>[, <Inductance>]

Specifies the inductance values L1, L2, L3 in the different circuit models for balanced port embedding.

In the query form, the <Inductance> parameter must be omitted. The command returns the inductance value for the specified circuit model.

Suffix: <ch></ch>	Channel number
<logpt></logpt>	Logical port number (balanced port)
<cmp></cmp>	Number of inductance in circuit model. The total number of induc- tances depends on the selected circuit model.
Parameters: <circuitmodel></circuitmodel>	STSL   SLST   CSSL   LSSC   LSSL   SLCS   SCLS   SLLS Possible circuit models (character data); see table 6-5.
<inductance></inductance>	Inductance L <cmp> for the specified circuit model. Range: -1H to 1 H. Increment: 1 pH (10E-12 H) *RST: 1 nH (10E-9 H) Default unit: H</cmp>
Example:	<pre>*RST; :SOUR:LPOR1 1,2; :CALC:TRAN:VNET:BAL:EMB: PAR:L1? CSSL Create a balanced port and query the default inductance L1 for the Serial Cs, shunt L circuit model. The response is 1E-009 (1 nH). CALC:TRAN:VNET:BAL:EMB:PAR:L1 CSSL, 2.2E-9 Increase the inductance to 2.2 nH.</pre>
Manual control:	See "Networks" on page 404

## CALCulate<Ch>:TRANsform:VNETworks:BALanced:EMBedding<LogPt>: PARameters:R<Cmp> <CircuitModel>[, <Resistance>]

Specifies the resistance values R1, R2, R3 in the different circuit models for balanced port embedding.

User Manual 1173.9163.02 - 13

Cuffiv.

In the query form, the <Resistance> parameter must be omitted. The command returns the resistance value for the specified circuit model.

Suffix: <ch></ch>	Channel number
<logpt></logpt>	Logical port number (balanced port)
<cmp></cmp>	Number of resistance in circuit model. The total number of resis- tances depends on the selected circuit model.
Parameters: <circuitmodel></circuitmodel>	STSL   STSC   SLST   SCST   CSSL   LSSC   CSSC   LSSL   SLCS   SCLS   SCCS   SLLS Possible circuit models (character data); see table 6-5.
<resistance></resistance>	$\begin{array}{llllllllllllllllllllllllllllllllllll$
Example:	*RST; :SOUR:LPOR1 1,2; :CALC:TRAN:VNET:BAL:EMB: PAR:R1? CSSL; R2? CSSL; R3? CSSL Create a balanced port and query the default resistances for the Serial Cs, shunt L circuit model. The response is 1000000000;1000000000; 0. CALC:TRAN:VNET:BAL:EMB:PAR:R3 CSSL, 2.2E+3 Increase the resistance R3 to 2.2 kΩ.
Manual control:	See "Networks" on page 404

## CALCulate<Ch>:TRANsform:VNETworks:BALanced:EMBedding<LogPt>[: STATe] <Boolean>

Enables or disables the embedding function for balanced ports. It is allowed to change the circuit model and its parameters while embedding is enabled.

Suffix: <ch></ch>	Channel number
<logpt></logpt>	Logical port number (balanced port)
Parameters: <boolean></boolean>	ON   OFF - embedding active or inactive *RST: OFF

Example:	*RST; SOUR:LPOR1 1,2; LPOR2 3,4
	Define a balanced port configuration.
	CALC:TRAN:VNET:BAL:EMB:TND CSSL
Select the Serial Cs, shunt L circuit model for embedding.	
	CALC:TRAN:VNET:BAL:EMB:PAR:R3 CSSL, 2.2E+3; :
CALC:TRAN:VNET:BAL:EMB ON	
	Increase the resistance R3 for the Serial Cs, shunt L circuit model to 2.2 $k\Omega$ and enable embedding.
Manual control:	See "Logical Port" on page 404

## CALCulate<Ch>:TRANsform:VNETworks:BALanced:EMBedding<LogPt>: TNDefinition <CircuitModel>

Selects the circuit model for balanced port embedding.

Suffix: <ch></ch>	Channel number
<logpt></logpt>	Logical port number (balanced port)
Parameters: <circuitmodel></circuitmodel>	FIMPort   STSL   STSC   SLST   SCST   CSSL   LSSC   CSSC   LSSL   SLCS   SCLS   SCCS   SLLS Possible circuit models (character data); see table 6-5. *RST: CSSL
Example:	See CALCulate <ch>:TRANsform:VNETworks:BALanced: EMBedding<logpt>[:STATe]</logpt></ch>
Manual control:	See "Networks" on page 404

## CALCulate<Ch>:TRANsform:VNETworks:SENDed:DEEMbedding<PhyPt>: PARameters:C<Cmp> <CircuitModel>[, <Capacitance>]

Specifies the capacitance values C1, C2 in the different circuit models for single ended port deembedding.

In the query form, the <Capacitance> parameter must be omitted. The command returns the capacitance value for the specified circuit model.

Suffix: <ch></ch>	Channel number
<phypt></phypt>	Physical port number
<cmp></cmp>	Number of capacitance in circuit model. The total number of capacitances depends on the selected circuit model.
Parameters: <circuitmodel></circuitmodel>	CSL   LSC   CSC   SLC   SCL   SCC Possible circuit models (character data); see table 6-6.

<capacitance></capacitance>	Capacitance C <cmp> for the specified circuit model.</cmp>
	Range: -1mF to 1 mF. Increment: 1 fF (10E-15 F) *RST: 1 pF (10E-12 F) Default unit: F
Example:	*RST; :CALC:TRAN:VNET:SEND:DEEM:PAR:C2? CSC Query the default capacitance C2 for the Serial C, shunt C circuit model. The response is 1E-012 (1 pF). CALC:TRAN:VNET:SEND:DEEM:PAR:C2 CSC, 2.2E-12 Increase the capacitance to 2.2 pF.
Manual control:	See "Networks" on page 402

## CALCulate<Ch>:TRANsform:VNETworks:SENDed:DEEMbedding<PhyPt>: PARameters:L<Cmp> <CircuitModel>[, <Inductance>]

Specifies the inductance values L1, L2 in the different circuit models for single ended port deembedding.

In the query form, the <Inductance> parameter must be omitted. The command returns the inductance value for the specified circuit model.

Suffix: <ch> <phypt> <cmp></cmp></phypt></ch>	Channel number Physical port number Number of inductance in circuit model. The total number of induc- tances depends on the selected circuit model.
Parameters: <circuitmodel></circuitmodel>	CSL   LSC   LSL   SLC   SCL   SLL Possible circuit models (character data); see table 6-6.
<inductance></inductance>	$\label{eq:loss} \begin{array}{llllllllllllllllllllllllllllllllllll$
Example:	*RST; :CALC:TRAN:VNET:SEND:DEEM:PAR:L1? SLL Query the default inductance L1 for the Shunt L, serial L circuit model. The response is 1E-009 (1 nH). CALC:TRAN:VNET:SEND:DEEM:PAR:L1 SLL, 2.2E-9 Increase the inductance to 2.2 nH.
Manual control:	See "Networks" on page 402

## CALCulate<Ch>:TRANsform:VNETworks:SENDed:DEEMbedding<PhyPt>: PARameters:R<Cmp> <CircuitModel>[, <Resistance>]

Specifies the resistance values R1, R2 in the different circuit models for single ended port deembedding.

In the query form, the <Resistance> parameter must be omitted. The command returns the resistance value for the specified circuit model.

Suffix: <ch></ch>	Channel number
<phypt></phypt>	Physical port number
<cmp></cmp>	Number of resistance in circuit model. The total number of resis- tances depends on the selected circuit model.
Parameters: <circuitmodel></circuitmodel>	CSL   LSC   CSC   LSL   SLC   SCL   SCC   SLL Possible circuit models (character data); see table 6-6.
<resistance></resistance>	$\begin{array}{llllllllllllllllllllllllllllllllllll$
Example:	*RST; :CALC:TRAN:VNET:SEND:DEEM:PAR:R1? CSL; R2? CSL Query the default resistances for the Serial C, shunt L circuit model. The response is 10000000; 0. CALC:TRAN:VNET:SEND:DEEM:PAR:R2 CSL, 2.2E+3 Increase the resistance R2 to 2.2 k $\Omega$ .
Manual control:	See "Networks" on page 402

## CALCulate<Ch>:TRANsform:VNETworks:SENDed:DEEMbedding<PhyPt>[: STATe] <Boolean>

Enables or disables the deembedding function for single ended ports. It is allowed to change the circuit model and its parameters while deembedding is enabled.

Suffix:	
<ch></ch>	Channel number
<phypt></phypt>	Physical port number
Parameters:	
<boolean></boolean>	ON - deembedding active
	OFF - deembedding inactive
	*RST: OFF

User Manual 1173.9163.02 - 13

## www.valuetronics.com

Example:	CALC:TRAN:VNET:SEND:DEEM:TND CSL	
	Select the Serial C, shunt L circuit model for deembedding.	
	CALC:TRAN:VNET:SEND:DEEM:PAR:R2 CSL, 2.2E+3; :	
	CALC:TRAN:VNET:SEND:DEEM ON	
	Increase the resistance R2 for the Serial C, shunt L circuit model	
	to 2.2 k $\Omega$ and enable deembedding.	
Manual control:	See "Port" on page 402	

## CALCulate<Ch>:TRANsform:VNETworks:SENDed:DEEMbedding<PhyPt>: TNDefinition <CircuitModel>

Selects the circuit model for single ended port deembedding.

Suffix: <ch></ch>	Channel number.
<phypt></phypt>	Physical port number
Parameters: <circuitmodel></circuitmodel>	FIMPort   CSL   LSC   CSC   LSL   SLC   SCL   SCC   SLL Possible circuit models (character data); see table 6-6. *RST: CSL
Example:	<b>See</b> CALCulate <ch>:TRANsform:VNETworks:SENDed: DEEMbedding<phypt>[:STATe]</phypt></ch>
Manual control:	See "Networks" on page 402

## CALCulate<Ch>:TRANsform:VNETworks:SENDed:EMBedding<PhyPt>: PARameters:C<Cmp> <CircuitModel>[, <Capacitance>]

Specifies the capacitance values C1, C2 in the different circuit models for single ended port embedding.

In the query form, the <Capacitance> parameter must be omitted. The command returns the capacitance value for the specified circuit model.

Suffix:	
<ch></ch>	Channel number
<phypt></phypt>	Physical port number
<cmp></cmp>	Number of capacitance in circuit model. The total number of capacitances depends on the selected circuit model.
Parameters:	
<circuitmodel></circuitmodel>	CSL   LSC   CSC   SLC   SCL   SCC
	Possible circuit models (character data); see table 6-6.

<capacitance></capacitance>	Capacitance C <cmp> for the specified circuit model.</cmp>
	Range: -1mF to 1 mF. Increment: 1 fF (10E-15 F) *RST: 1 pF (10E-12 F) Default unit: F
Example:	*RST; :CALC:TRAN:VNET:SEND:EMB:PAR:C2? CSC Query the default capacitance C2 for the Serial C, shunt C circuit model. The response is 1E-012 (1 pF). CALC:TRAN:VNET:SEND:EMB:PAR:C2 CSC, 2.2E-12 Increase the capacitance to 2.2 pF.
Manual control:	See "Networks" on page 400

## CALCulate<Ch>:TRANsform:VNETworks:SENDed:EMBedding<PhyPt>: PARameters:L<Cmp> <CircuitModel>[, <Inductance>]

Specifies the inductance values L1, L2 in the different circuit models for single ended port embedding.

In the query form, the <Inductance> parameter must be omitted. The command returns the inductance value for the specified circuit model.

Suffix: <ch> <phypt> <cmp></cmp></phypt></ch>	Channel number Physical port number Number of inductance in circuit model. The total number of induc- tances depends on the selected circuit model.
Parameters: <circuitmodel></circuitmodel>	CSL   LSC   LSL   SLC   SCL   SLL Possible circuit models (character data); see table 6-6.
<inductance></inductance>	Inductance L <cmp> for the specified circuit model. Range: -1H to 1 H. Increment: 1 pH (10E-12 H) *RST: 1 nH (10E-9 H) Default unit: H</cmp>
Example:	*RST; :CALC:TRAN:VNET:SEND:EMB:PAR:L1? SLL Query the default inductance L1 for the Shunt L, serial L circuit model. The response is 1E-009 (1 nH). CALC:TRAN:VNET:SEND:EMB:PAR:L1 SLL, 2.2E-9 Increase the inductance to 2.2 nH.
Manual control:	See "Networks" on page 400

User Manual 1173.9163.02 - 13

# www.valuetronics.com

## CALCulate<Ch>:TRANsform:VNETworks:SENDed:EMBedding<PhyPt>: PARameters:R<Cmp> <CircuitModel>[, <Resistance>]

Specifies the resistance values R1, R2 in the different circuit models for single ended port embedding.

In the query form, the <Resistance> parameter must be omitted. The command returns the resistance value for the specified circuit model.

Suffix: <ch></ch>	Channel number
<phypt></phypt>	Physical port number
<cmp></cmp>	Number of resistance in circuit model. The total number of resis- tances depends on the selected circuit model.
Parameters: <circuitmodel></circuitmodel>	CSL   LSC   CSC   LSL   SLC   SCL   SCC   SLL Possible circuit models (character data); see table 6-6.
<resistance></resistance>	$\begin{array}{llllllllllllllllllllllllllllllllllll$
Example:	*RST; :CALC:TRAN:VNET:SEND:EMB:PAR:R1? CSL; R2? CSL Query the default resistances for the Serial C, shunt L circuit model. The response is 10000000; 0. CALC:TRAN:VNET:SEND:EMB:PAR:R2 CSL, 2.2E+3 Increase the resistance R2 to 2.2 k $\Omega$ .
Manual control:	See "Networks" on page 400

## CALCulate<Ch>:TRANsform:VNETworks:SENDed:EMBedding<PhyPt>[:STATe] <Boolean>

Enables or disables the embedding function for single ended ports. It is allowed to change the circuit model and its parameters while embedding is enabled.

Suffix:	
<ch></ch>	Channel number
<phypt></phypt>	Physical port number
Parameters:	
<boolean></boolean>	ON - embedding active OFF - embedding inactive
	*RST: OFF

User Manual 1173.9163.02 - 13

## www.valuetronics.com

Example:	CALC:TRAN:VNET:SEND:EMB:TND CSL Select the Serial C, shunt L circuit model for embedding.
	CALC:TRAN:VNET:SEND:EMB:PAR:R2 CSL, 2.2E+3; :
	CALC:TRAN:VNET:SEND:EMB ON
	Increase the resistance R2 for the Serial C, shunt L circuit model to 2.2 $k\Omega$ and enable embedding.
Manual control:	See "Port" on page 400

## CALCulate<Ch>:TRANsform:VNETworks:SENDed:EMBedding<PhyPt>: TNDefinition <CircuitModel>

Selects the circuit model for single ended port embedding.

Suffix: <ch></ch>	Channel number.
<phypt></phypt>	Physical port number
Parameters: <circuitmodel></circuitmodel>	FIMPort   CSL   LSC   CSC   LSL   SLC   SCL   SCC   SLL Possible circuit models (character data); see table 6-6. *RST: CSL
Example:	See CALCulate <ch>:TRANsform:VNETworks:SENDed: EMBedding<phypt>[:STATe]</phypt></ch>
Manual control:	See "Networks" on page 400

## 6.3.2 CONFigure Commands

The CONFigure... commands create and delete channels or traces and assign channel and trace names. The commands are device-specific.

CONFigure:CHANnel:CATalog?	
CONFigure:CHANnel:MEASure:ALL[:STATe]	
CONFigure:CHANnel <ch>:MEASure[:STATe]</ch>	
CONFigure:CHANnel <ch>:NAME</ch>	
CONFigure:CHANnel <ch>:NAME:ID?</ch>	
CONFigure:CHANnel <ch>[:STATe]</ch>	
CONFigure:CHANnel <ch>:TRACe:CATalog?</ch>	
CONFigure:CHANnel <ch>:TRACe:REName</ch>	
CONFigure:TRACe:CATalog?	
CONFigure:TRACe <trc>:CHANnel:NAME?</trc>	
CONFigure:TRACe <trc>:CHANnel:NAME:ID?</trc>	596
CONFigure:TRACe <trc>:NAME</trc>	
CONFigure:TRACe <trc>:NAME:ID?</trc>	
CONFigure:TRACe <trc>:REName</trc>	
CONFigure:TRACe:WINDow?	
CONFigure:TRACe:WINDow:TRACe?	

#### CONFigure:CHANnel:CATalog?

Returns the numbers and names of all channels in the current recall set. The response is a string containing a comma-separated list of channel numbers and names; see example below. If all channels have been deleted the response is an empty string ("").

Example:	*RST; :CONF:CHAN2:STAT ON; NAME 'New Channel' Create channel 2 and assign the channel name "New Channel".
	CONF:CHAN:CAT?
	Query all channels and their names. As a default channel no. 1 is
	created on *RST, the response is '1, Ch1, 2, New_Channel'.
	CONF:CHAN:NAME:ID? 'New Channel'
	Query the channel number for the channel named "New Channel".
	The response is 2.
Usage:	Query only
Manual control:	See "Channel table" on page 361

## CONFigure:CHANnel:MEASure:ALL[:STATe] <Boolean>

Enables or disables the sweep in all channels of the active recall set. This command can be used in combination with CONFigure:CHANnel<Ch>:MEASure[:STATe] to optimize the measurement speed.

Parameters:	
<boolean></boolean>	ON   OFF
	*RST: ON
Example:	See CONFigure:CHANnel <ch>:MEASure[:STATe]</ch>
Manual control:	See "Continuous / Single" on page 276

## CONFigure:CHANnel<Ch>:MEASure[:STATe] <Boolean>

Enables or disables the sweep in channel no. <Ch>. This command can be used to restrict the measurement in a subset of channels in order to optimize the measurement speed.

#### Suffix:

<Ch> Number of an existing channel.

#### Parameters:

<Boolean>

ON | OFF \*RST: ON (all existing channels)

Example:	<ul> <li>*RST; :CONFigure:CHANnel2 ON; CHANnel3 ON</li> <li>Create channels 2 and 3, in addition to the default channel no. 1.</li> <li>The analyzer performs sweeps in all three channels.</li> <li>CONFigure:CHANnel:MEASure:ALL OFF</li> <li>Disable the measurement in all channels</li> <li>CONFigure:CHANnel2:MEASure ON</li> <li>(Re-)enable the measurement in channel no. 2. The analyzer measures in channel 2; the channels no. 1 and 3 are not measured.</li> </ul>
Manual control:	See "Continuous / Single" on page 276

#### CONFigure:CHANnel<Ch>:NAME <ChannelName>

Assigns a name to channel number <Ch>. The channel must be created before ( CONFigure:CHANnel<Ch>[:STATe] ON). Moreover it is not possible to assign the same name to two different channels. CONFigure:CHANnel:CATalog? returns a list of all defined channels with their names.

Number of an existing channel.
Channel name, e.g. 'Channel 4'. *RST: 'Ch1'
See CONFigure:CHANnel:CATalog?
See "Trace Manager Table" on page 194

## CONFigure:CHANnel<Ch>:NAME:ID? <ChannelName>

Queries the channel number (numeric suffix) of a channel with known channel name. A channel name must be assigned before (CONFigure:CHANnel<Ch>:NAME '<ChannelName>'). CONFigure:CHANnel:CATalog? returns a list of all defined channels with their names.

## Suffix:

<ch></ch>	Channel number. This suffix is not relevant and may be omitted (the command returns the actual channel number).
Parameters: <channelname></channelname>	Channel name, e.g. 'Channel 4'.
Example:	See CONFigure:CHANnel:CATalog?
Usage:	Query only
Manual control:	See "Trace Manager Table" on page 194

## CONFigure:CHANnel<Ch>[:STATe] <Boolean>

Creates or deletes channel no. <Ch> and selects it as the active channel. CONFigure:CHANnel<Ch>:NAME defines the channel name.

A channel created with CONFigure:CHANnel<Ch>[:STATe] ON can be configured but has no trace assigned so that no measurement can be initiated. Use CALCulate<Ch>: PARameter:SDEFine "<TraceName>, "<Parameter>" to create a new channel and a new trace. In remote control it is possible to remove all channels. This is in contrast to manual control where at least one channel with one diagram area and one trace must be available.

## Suffix:

Parameters: <boolean>         ON - create channel no. <ch>. If the channel no. <ch> exis</ch></ch></boolean>	ts
already, it is not modified but selected as the active channe OFF - delete channel no. <ch>. *RST: ON for channel no. 1 (created on *RST), OFF to other channels.</ch>	Ι.
Example: See CONFigure:CHANnel:CATalog?	
Manual control: See "Delete Channel" on page 360	

#### CONFigure:CHANnel<Ch>:TRACe:CATalog?

Returns the numbers and names of all traces in channel no. <Ch>>. The response is a string containing a comma-separated list of trace numbers and names; see example. If all traces have been deleted the response is an empty string ("").

**Tip:** Use CONFigure: TRACe: CATalog? to query the traces in all channels of the active recall set.

Channel number
See CONFigure:TRACe:CATalog?
Query only
See "Trace Manager Table" on page 194

#### CONFigure:CHANnel<Ch>:TRACe:REName <TraceName>

Assigns a (new) name to the active trace in channel <Ch>.

Suffix: <Ch>

Suffix

Channel number

#### Setting parameters:

<TraceName> Trace name, e.g. 'Trace 4'.

Example:	<pre>*RST; :CONF:CHAN:TRAC:REN 'Testtrace_1' Reset the analyzer to create a default trace in channel 1 and set this trace as the active trace. Rename the trace 'Testtrace_1'. CALC:PAR:SDEF 'Testtrace_2', 'S11' Create a new trace which will become the active trace in channel no. 1. CONF:TRAC:REN 'Testtrace_1', 'Testtrace_3' Rename the first trace (which is currently not active) 'Testtrace_3'.</pre>
Usage:	Setting only
Manual control:	See "Trace Manager Table" on page 194

#### CONFigure:TRACe:CATalog?

Returns the numbers and names of all traces in the current recall set. The response is a string containing a comma-separated list of trace numbers and names, see example below. If all traces have been deleted the response is an empty string ("").

**Tip:** Use CONFigure:CHANnel<Ch>:TRACe:CATalog? to query the traces in a particular channel; see example.

Example:	<pre>*RST; :CALC2:PAR:SDEF 'Ch2Trc2', 'S11' Create channel 2 and a new trace named Ch2Trc2. CONF:TRAC:CAT? Query all traces and their names. As a default trace no. 1 is created upon *RST, the response is '1, Trc1, 2, Ch2Trc2'. CONF:CHAN1:TRAC:CAT? Query the channels in channel no. 1. The response is '1, Trc1'. CONF:TRAC:NAME:ID? 'Ch2Trc2' Query the trace number for the trace named "Ch2Trc2". The response is 2. CONF:TRAC2:NAME? Query the trace name for trace no. 2. The response is 'Ch2Trc2'. CONF:TRAC:CHAN:NAME? 'Ch2Trc2' Query the channel name for trace Ch2Trc2. The response is 'Ch2Trc2'.</pre>
Usage:	Query only
Manual control:	See "Trace Manager Table" on page 194

#### CONFigure:TRACe<Trc>:CHANnel:NAME? <TraceName>

Queries the channel name for an existing trace named '<TraceName>'.

Suffix: <trc></trc>	Trace number. This suffix is ignored; the trace is referenced by its name.
Parameters: <tracename></tracename>	Trace name, e.g. 'Ch2Trc2'.
Example:	See CONFigure:TRACe:CATalog?
Usage:	Query only
Manual control:	See "Add Ch + Trace" on page 360

#### CONFigure:TRACe<Trc>:CHANnel:NAME:ID? <TraceName>

Queries the channel number (numeric suffix) for an existing trace named '<TraceName>'.

Suffix: <trc></trc>	Trace number. This suffix is ignored; the trace is referenced by its name.
Parameters: <tracename></tracename>	Trace name, e.g. 'Ch2Trc2'.
Example:	See CONFigure: TRACe: CATalog?
Usage:	Query only
Manual control:	See "Add Ch + Trace" on page 360

#### CONFigure:TRACe<Trc>:NAME <TraceName>

Assigns a name to an existing trace number <Trc>. Note that it is not possible to assign the same name to two different traces. CONFigure:TRACe:CATalog? returns a list of all traces in the active recall set with their names.

<b>Suffix:</b> <trc></trc>	Number of an existing trace.
Parameters: <tracename></tracename>	Trace name, e.g. 'Ch2Trc2'. *RST: 'Trc1'
Example:	See CONFigure:TRACe:CATalog?

#### CONFigure:TRACe<Trc>:NAME:ID? <TraceName>

Queries the trace number (numeric suffix) of a trace with known trace name. CONFigure:TRACe:CATalog? returns a list of all traces in the active recall set with their names.

Suffix: <trc></trc>	Trace number. This suffix is not relevant and may be omitted (the command returns the actual trace number).
Parameters: <tracename></tracename>	Trace name, e.g. 'Ch2Trc2'.
Example:	See CONFigure: TRACe: CATalog?
Usage:	Query only

#### CONFigure:TRACe<Trc>:REName <OldTraceName>, <NewTraceName>

Assigns a new name to a trace. The trace does not have to be the active trace.

<trc></trc>	Trace number. This suffix is ignored; the trace is identified via its
	<tracename></tracename>

### Setting parameters:

<oldtracename></oldtracename>	String parameter with old trace name, e.g. 'Ircl'	
<newtracename></newtracename>	String parameter with new trace name, e.g. 'S11 Trace' *RST: n/a	
Example:	See CONFigure:CHANnel <ch>:TRACe:REName</ch>	
Usage:	Setting only	
Manual control:	See "Trace Manager Table" on page 194	

#### CONFigure:TRACe:WINDow? <TraceName>

Returns the trace number within a diagram which is assigned to the trace <TraceName> is assigned to. A zero is returned when the trace is not assigned/displayed.

The trace number is equal to the <WndTr> suffix in DISPlay[:WINDow<Wnd>]: TRACe<WndTr>:FEED and similiar commands; see example.

#### **Parameters:**

<tracename></tracename>	Trace name (string), e.g. 'Ircl'
Example:	See CONFigure:TRACe:WINDow:TRACe?
Usage:	Query only
Manual control:	See "Add" on page 195

### CONFigure:TRACe:WINDow:TRACe? <TraceName>

Returns the number of the diagram which the trace <TraceName> is assigned to. A zero is returned when the trace is not assigned/displayed.

The diagram number is equal to the <Wnd> suffix in DISPlay[:WINDow<Wnd>]: TRACe<WndTr>:FEED and similiar commands; see example.

## Parameters:

<tracename></tracename>	Trace name (string), e.g. 'Ircl'	
Example:	<pre>*RST; :CALC:PAR:SDEF 'Trc2', 'S11' Create a new trace named Trc2. CONF:TRAC:WIND:TRAC? 'Trc2' Query the diagram number for Trc2. The new trace is currently not displayed, so the response is 0. DISP:WIND2:STAT ON Create a new diagram no. 2. DISP:WIND2:TRAC3:FEED 'Trc2' Display the trace in the new diagram no. 2, assigning the trace number 3. CONF:TRAC:WIND? 'Trc2' Query the diagram number for Trc2. The the response is 2. CONF:TRAC:WIND:TRAC? 'Trc2' Query the trace number for Trc2. The the response is 3.</pre>	
Usage:	Query only	
Manual control:	See "Add" on page 195	

## 6.3.3 CONTrol Commands

The Control... commands control the USER PORT connector and the Handler I/O (Universal Interface) connector (option R&S ZN-B14).

CONTrol:AUXiliary:C[:DATA]	
CONTrol:HANDler:A[:DATA]	
CONTrol:HANDler:B[:DATA]	
CONTrol:HANDler:C[:DATA]	
CONTrol:HANDler:D[:DATA]	
CONTrol:HANDler:E[:DATA]	
CONTrol:HANDler:F[:DATA]	
CONTrol:HANDler:G[:DATA]	
CONTrol:HANDler:H[:DATA]	
CONTrol:HANDler:A:MODE	
CONTrol:HANDler:B:MODE	
CONTrol:HANDler:C:MODE	
CONTrol:HANDler:D:MODE	601
CONTrol:HANDler[:EXTension]:INDex:STATe	
CONTrol:HANDler[:EXTension]:RTRigger:STATe	
CONTrol:HANDler:INPut?	
CONTrol:HANDler:LOGic	
CONTrol:HANDler:OUTPut <pt>:USER</pt>	
CONTrol:HANDler:OUTPut <pt>[:DATA]</pt>	
CONTrol:HANDler:PASSfail:LOGic	
CONTrol:HANDler:PASSfail:MODE	

SCPI Command Reference

CONTrol:HANDler:PASSfail:POLicy	605
CONTrol:HANDler:PASSfail:SCOPe	
CONTrol:HANDler:PASSfail:STATus?	606
CONTrol:HANDler:RESet	606
CONTrol:HANDler:SWEepend	607

#### CONTrol:AUXiliary:C[:DATA] <DecValue>

Sets or queries a channel-dependent eight-bit decimal value to control eight independent output signals at the USER PORT connector (lines 8, 9, 10, 11 and lines 16, 17, 18, 19). The output signals are 3.3 V TTL signals which can be used to differentiate between up to 255 independent analyzer states. CONTrol:AUXiliary:C[:DATA] itself does not change the analyzer state.

#### Channel bit definition and activation

The channel bits have the following properties:

- After a \*RST of the analyzer all channel bits (including the value for the active, sweeping channel no. 1) are set to zero; no signal is applied to pins 8 to 11 and 16 to 19 of the USER PORT connector.
- The value defined with CONTrol:AUXiliary:C[:DATA] is assigned to the active channel (INSTrument:NSELect <Ch>).
- The signals at the USER PORT connector reflect the channel bits of the measuring channel, i.e. the channel for which the analyzer performs a sweep. This channel is not necessarily identical with the active channel.
- The signals are switched on as soon as a measurement (sweep) in a channel with non-zero channel bits is started. They are changed whenever a channel with different channel bits becomes the measuring channel.
- The signals at the USER PORT connector are maintained after the analyzer enters the hold state. This happens if all channels use single sweep mode and if all sweep sequences have been terminated.
- Pins 16 to 19 may be reserved for monitoring the drive ports 1 to 4 of the analyzer ( OUTPut:UPORt:ECBits OFF). This leaves up to 16 different monitored channel states.

**Tip:** A simple application consists of selecting the channel numbers as parameters for CONTrol:AUXiliary:C[:DATA] and monitor the activity of up to 255 different channels at the USER PORT connector; see example below. You can also use the USER PORT output signals as channel-dependent trigger signals for external devices. Use OUTPut<Ch>:UPORt[:VALue] to transfer the eight bit value for an arbitrary channel <Ch> in binary representation.

## Parameters:

<DecValue> Decimal value. The values correspond to the following states of the USER PORT connector: 0 - no signal at any of the no signal at any of the eight pins 8, 9,

10, 11, 16, 17, 18, 19

1 - output signal at pin 8

2 - output signal at pin 9

3 - output signal at pins 8 and 9

255 - output signal at pins 8, 9, 10, 11, 16, 17, 18, 19

Range:	0 to 255
*RST:	0 (no signal)

**Example:** \*RST; :CONT:AUX:C 1

...

Assign the channel bit value 1 to the active channel no. 1. The analyzer performs a measurement in channel no. 1, therefore the output signal at pin 8 is switched on.

CONF:CHAN2:STAT ON; :CONT:AUX:C 2

Create channel no. 2, causing it to become the active channel, and assign the channel bit value 2. The analyzer performs no measurement in channel no. 2, therefore the output signal is not changed.

CALC2:PAR:SDEF 'Ch2Tr1', 'S11'

Create a trace named 'Ch2Tr1' and assign it to channel 2. While the analyzer measures in channel 2, the output signal changes from pin 8 to pin 9.

Manual control: See "Table Columns" on page 275

CONTrol:HANDIer:A[:DATA] <DecValue> CONTrol:HANDIer:B[:DATA] <DecValue> CONTrol:HANDIer:C[:DATA] <DecValue> CONTrol:HANDIer:D[:DATA] <DecValue> CONTrol:HANDIer:E[:DATA] <DecValue> CONTrol:HANDIer:F[:DATA] <DecValue> CONTrol:HANDIer:G[:DATA] <DecValue> CONTrol:HANDIer:G[:DATA] <DecValue>

The setting commands write data to ports A, B, C, D, E, F, G, H. To write data to a port, the port must be configured as an output port (see example). By default, the port lines have negative logic: A "0" at a pin corresponds to a high signal, a "1" to a low signal. The logic can be changed using CONTrol:HANDler:LOGicPOSitive. When writing to port G, port C must be configured as an output port. When writing to port H, port C and port D must be configured as output ports (see CONTrol:HANDler:D:MODE).

The queries read data from ports A, B, C, D, E, F, G, H. If the port is an output port, the queries return the last value that was written to the port.

## Parameters:

<decvalue></decvalue>	Decimal representation fo an n-bit binary value. The ranges are: Port A: 0 to 255 (pins A7 A0) Port B: 0 to 255 (pins B7 B0) Port C: 0 to 15 (pins C3 C0) Port D: 0 to 15 (pins D3 D0) Port E: 0 to 255 (pins D3 D0 C3 C0) Port F: 0 to 65535 (pins B7 B0 A7 A0) Port G: 0 to 1048575 (pins C3 C0 B7 B0 A7 A0) Port H: 0 to 16777215 (pins D3 D0 C3 C0 B7 B0 A7 A0) The parameters MIN, MAX, DEF are not supported. <b>Note:</b> *RST or "Preset" do not change the configuration of the Universal Interface. Use CONTrol:HANDler:RESet to restore default values.	
	*RST: n/a (default: 0 (port A, B, and F); ports C, D, and E are configured as input ports.)	
Example:	CONT:HAND:A:MODE OUTP Configure port A as an output port. CONT:HAND:A 192 Write data to port A. CONT:HAND:B:MODE INP Configure port B as an input port. CONT:HAND:B?	

CONTrol:HANDler:A:MODE <Mode> CONTrol:HANDler:B:MODE <Mode> CONTrol:HANDler:C:MODE <Mode> CONTrol:HANDler:D:MODE <Mode>

Controls the direction of the data flow at ports A, B, C, D. The direction at the combined ports E, F, G, H is according to the configuration at the other ports.

Read data from port B.

#### **Parameters:**

<mode></mode>	INPut – Inpu OUTPut – C Note:*RST versal Inter	INPut   OUTPut INPut – Input of data at the port OUTPut – Output of data at the port <b>Note:</b> *RST or "Preset" do not change the configuration of the Uni- versal Interface. Use CONTrol:HANDler:RESet to restore	
Example:	default valu *RST: See CONTr	es. n/a (default: Port A and B: OUTPut (also valid for port F); port C and D: INPut (also valid for port E). Ports G and H have mixed default modes.) ol:HANDler:A[:DATA]	

User Manual 1173.9163.02 - 13

#### CONTrol:HANDler[:EXTension]:INDex:STATe <Boolean>

Selects the digital signal that is routed to pin 20 of the Universal Interface connector.

#### **Parameters:**

<boolean></boolean>	ON - /INDEX signal at pin 20 OFF - /PORT_B6 signal at pin 20
	*RST: n/a (default: OFF) <b>Note:</b> *RST or "Preset" do not change the configuration of the Uni- versal Interface. Use CONTrol:HANDler:RESet to restore default values.
Example:	CONT: HAND: EXT: IND: STAT ON Route the /INDEX signal to pin 20. CONT: HAND: EXT: RTR: STAT ON Route the /READY_FOR_TRIGGER signal to pin 21. CONT: HAND: RES Restore the default state: Pins no. 20 and 21 are available for port B input/output signals.

#### CONTrol:HANDler[:EXTension]:RTRigger:STATe <Boolean>

Selects the digital signal that is routed to pin 21 of the Universal Interface connector.

<boolean></boolean>	OFF - /POR Note:*rst	DY_FOR_TRIGGER RT_B7 signal at pin 21 or "Preset" do not change the configuration of the Uni- face. Use CONTrol:HANDler:RESet to restore es.
	*RST:	n/a (default: OFF)
Example:	See CONTr	ol:HANDler[:EXTension]:INDex:STATe

### CONTrol:HANDler:INPut? <NumberOfTrans>

Queries whether a high to low transition occurred at the /INPUT 1 line (pin 2) of the Universal Interface since the last CONTrol:HANDler:INPut? query. A negative pulse fed to this line also causes the /OUTPUT 1 and /OUTPUT 2 lines (pins 3 and 4) to change to low.

### Parameters:

Daramotore

<numberoftrans></numberoftrans>	0 – no transition detected since last query. 1 – one or more transitions detected. The query resets the counter to zero. *RST: n/a
Example:	CONTrol:HANDler:INPut? Query whether a high to low transition occurred.
Usage:	Query only

#### CONTrol:HANDler:LOGic <Logic>

Selects the logic of the data ports A to H of the Universal Interface. For output ports, a change in logic reverses the state of the output lines immediately. For input ports, a change in logic will be reflected next time when data is read.

### Parameters:

<logic></logic>	POSitive   NEGative	
	POSitive – 0 = low, 1 = high NEGative – 0 = high, 1 = low	
	Note:*RST or "Preset" do not change the configuration versal Interface. Use CONTrol:HANDler:RESet to re default values.	
	*RST:	n/a (default: NEGative)
Example:		ANDler:LOGic POS logic of the data ports to positive.

#### CONTrol:HANDler:OUTPut<Pt>:USER <BinValue>

Defines the state of the output ports (pin 3 or 4) of the Universal Interface connector after the next negative pulse on the /INPUT1 line (pin 2).

#### Suffix:

••••		
<pt></pt>	Output port number: 1 - /OUTPUT1 (pin 3) 2 - /OUTPUT2 (pin 4) The parameters MIN, MAX, DEF are not supported. <b>Note:</b> *RST or "Preset" do not change the configuration of the Uni- versal Interface. Use CONTrol:HANDler:RESet to restore	
	default values.	
Parameters:		
<binvalue></binvalue>	0 - high 1 - low	
	*RST: n/a (default: 0)	
Example:	See CONTrol:HANDler:OUTPut <pt>[:DATA]</pt>	

#### CONTrol:HANDler:OUTPut<Pt>[:DATA] <BinValue>

Writes a 0 or 1 to the output ports (pin 3 or 4) of the Universal Interface connector. The port lines have negative logic: A "0" corresponds to a high signal, a "1" to a low signal.

The query reads the last value that has been written to the output port.

Suffix:		
<pt></pt>	Output port number:	
	1 - /OUTPUT1 (pin 3)	
	2 - /OUTPUT2 (pin 4)	
	The parameters MIN, MAX, DEF are not supported.	
	Note:*RST or "Preset" do not change the configuration of the Uni-	
	versal Interface. Use CONTrol:HANDler:RESet to restore	
	default values.	
Parameters:		
<binvalue></binvalue>	0 - high	
	1 - low	
	*RST: n/a (default: 0)	
Example:	CONT:HAND:OUTP2:DATA 0	
	Set the /OUTPUT2 line (pin 4) to 0 (current state of /OUTPUT2).	
	CONT:HAND:OUTP2:USER 1	
	Define the next state of the /OUTPUT2 line as 1 (low). /OUTPUT2 will go from 0 to 1 when the analyzer receives a negative pulse on	
	the /INPUT1 line (pin 2).	

#### CONTrol:HANDler:PASSfail:LOGic <Logic>

Specifies the the logic of the /PASS FAIL line (pin 33) of the Universal Interface.

Parameters: <logic></logic>	POSitive   NEGative POSitive – high meas PASS, low means FAIL NEGative – low meas PASS, high means FAII		
	NEGative – low meas PASS, high means FAIL Note:*RST or "Preset" do not change the configuration of the Uni- versal Interface. Use CONTrol:HANDler:RESet to restore default values.		
	*RST:	n/a (default: POSitive)	
Example:	See CONTr	ol:HANDler:PASSfail:MODE	

#### CONTrol:HANDler:PASSfail:MODE <Mode>

Specifies the default logical pass/fail state and the timing of the /PASS FAIL line (pin 33). The /PASS FAIL STROBE (pin 36) is set after the /PASS FAIL line; see chapter 9.1.4.4, "Timing of Control Signals", on page 934.

If the mode is PASS or FAIL, the /PASS FAIL line is returned to its default state when the analyzer is ready for a new measurement (/READY FOR TRIGGER).

User Manual 1173.9163.02 - 13

Parameters:	
<mode></mode>	NOWait   PASS   FAIL
	NOWait – the /PASS FAIL line is set as soon as a failure condition occurs.
	PASS – the line stays in PASS state (as defined by CONTrol:
	HANDler: PASSfail: LOGic) until a sweep end condition (deter-
	<pre>mined by CONTrol:HANDler:PASSfail:SCOPe) occurs.</pre>
	FAIL – the line stays in FAIL state until a sweep end condition occurs.
	Note:*RST or "Preset" do not change the configuration of the Uni-
	versal Interface. Use CONTrol:HANDler:RESet to restore default values.
	*RST: n/a (default: NOWait)
Example:	Configure the /SWEEP END (pin 34) and /PASS FAIL (pin 33)
Example.	signals:
Example.	
Example.	signals:
Example.	signals: CONTrol:HANDler:SWEepend GLOBal Set the /SWEEP END line to low when all sweeps in all channels
Example.	signals: CONTrol:HANDler:SWEepend GLOBal Set the /SWEEP END line to low when all sweeps in all channels are complete.
Example.	<pre>signals: CONTrol:HANDler:SWEepend GLOBal Set the /SWEEP END line to low when all sweeps in all channels are complete. CONTrol:HANDler:PASSFail:MODE PASS Set the default state of the /PASS FAIL line to PASS. CONTrol:HANDler:PASSFail:SCOPe GLOBal</pre>
Example.	<pre>signals: CONTrol:HANDler:SWEepend GLOBal Set the /SWEEP END line to low when all sweeps in all channels are complete. CONTrol:HANDler:PASSFail:MODE PASS Set the default state of the /PASS FAIL line to PASS.</pre>
Example.	<pre>signals: CONTrol:HANDler:SWEepend GLOBal Set the /SWEEP END line to low when all sweeps in all channels are complete. CONTrol:HANDler:PASSFail:MODE PASS Set the default state of the /PASS FAIL line to PASS. CONTrol:HANDler:PASSFail:SCOPe GLOBal Set the /PASS FAIL line when all sweeps in all channels are com-</pre>
Example.	<pre>signals: CONTrol:HANDler:SWEepend GLOBal Set the /SWEEP END line to low when all sweeps in all channels are complete. CONTrol:HANDler:PASSFail:MODE PASS Set the default state of the /PASS FAIL line to PASS. CONTrol:HANDler:PASSFail:SCOPe GLOBal Set the /PASS FAIL line when all sweeps in all channels are com- plete.</pre>
Example.	<pre>signals: CONTrol:HANDler:SWEepend GLOBal Set the /SWEEP END line to low when all sweeps in all channels are complete. CONTrol:HANDler:PASSFail:MODE PASS Set the default state of the /PASS FAIL line to PASS. CONTrol:HANDler:PASSFail:SCOPe GLOBal Set the /PASS FAIL line when all sweeps in all channels are com- plete. CONTrol:HANDler:PASSFail:LOGic POSitive</pre>
Example.	<pre>signals: CONTrol:HANDler:SWEepend GLOBal Set the /SWEEP END line to low when all sweeps in all channels are complete. CONTrol:HANDler:PASSFail:MODE PASS Set the default state of the /PASS FAIL line to PASS. CONTrol:HANDler:PASSFail:SCOPe GLOBal Set the /PASS FAIL line when all sweeps in all channels are com- plete. CONTrol:HANDler:PASSFail:LOGic POSitive Set the /PASS FAIL line to positive logic.</pre>

## CONTrol:HANDler:PASSfail:POLicy <Policy>

Specifies how the global pass/fail status (CONTrol:HANDler:PASSfail:STATus? on page 606) is calculated.

Parameters:	
-------------	--

<policy></policy>	ALLTests   ALLMeas		
	ALLTests – the status is PASS if all limit checks in all measure- ments (traces) pass. ALLMeas – the status is PASS if a limit check is defined for all measurements (traces) and all limit checks pass. It is FAIL if one or more traces have no associated limit check, or if at least one limit check fails. <b>Note:</b> *RST or "Preset" do not change the configuration of the Uni- versal Interface. Use CONTrol:HANDler:RESet to restore		
	default values.		
Example:	See CONTrol:HANDler:PASSfail:MODE		

## CONTrol:HANDler:PASSfail:SCOPe <Scope>

Specifies the "sweep end" condition that will cause the /PASS FAIL line (pin 33) to report the status of the global limit check.

**Note:** This setting is not valid if the pass/fail mode is NOWait (CONTrol:HANDler: PASSfail:MODENOWait).

#### Parameters:

<scope></scope>	GLOBal   C	CHANnel	
	GLOBal – v Note:*RSI versal Inter	CHANnel – when all the sweeps for each channel are complete GLOBal – when all sweeps in all channels are complete <b>Note:</b> *RST or "Preset" do not change the configuration of the Uni- versal Interface. Use CONTrol:HANDler:RESet to restore default values.	
	*RST:	n/a (default: GLOBal)	
Example:	See CONT1	col:HANDler:PASSfail:MODE	

## CONTrol:HANDler:PASSfail:STATus?

Returns the global pass/fail status of the last measurement.

<b>Return values:</b> <status></status>	PASS   FAIL   NONE PASS – all measurements that are not in single sweep mode (on hold) have been swept, and all limit checks have been passed. FAIL – all measurements that are not in single sweep mode (on hold) have been swept, at least one limit check failed according to the specified pass/fail policy (CONTrol:HANDler:PASSfail: POLicy). NONE – no pass/fail status available, e.g. because the measure- ment is in progress or because no limit check has been defined. *RST: n/a
Example:	Preparations: Configure and enable a limit check. Start a mea- surement and wait until the sweep is complete. CONTrol:HANDler:PASSfail:STATus? Query the result of the global limit check.
Usage:	Query only

#### CONTrol:HANDler:RESet

Restores the default states of the CONTrol:HANDler... commands including the data port values.

Example:	See CONTrol:HANDler[:EXTension]:INDex:STATe
Usage:	Event

#### CONTrol:HANDler:SWEepend <SweepEnd>

Specifies the event that will cause the /SWEEP END line (pin 34) to go low; see chapter 9.1.4.4, "Timing of Control Signals", on page 934.

#### Parameters:

<sweepend></sweepend>	SWEep   CHANnel   GLOBal	
	SWEep – every time a sweep is complete CHANnel – when all the sweeps for each channel are complete GLOBal – when all sweeps in all channels are complete <b>Note:</b> *RST or "Preset" do not change the configuration of the Ur versal Interface. Use CONTrol:HANDler:RESet to restore default values.	
	*RST: n/a (default: GLOBal)	
Example:	See CONTrol:HANDler:PASSfail:MODE	

## 6.3.4 DIAGnostic Commands

The DIAGnostic... commands provide access to service and diagnostic routines used in service, maintenance and repair. In accordance with the SCPI standard all commands are device-specific.

Service functions are password-protected (SYSTem: PASSword[:CENable]) and should be used by an R&S service representative only. Refer to the service manual for more information.

DIAGnostic:DEVice:STATe6	107
DIAGnostic:SERVice:RFPower6	80
DIAGnostic:SERVice:SFUNction	80

#### DIAGnostic:DEVice:STATe <Filename>

Generates a system report and writes it to the specified file. See chapter 8.1.3, "Obtaining Technical Support", on page 919.

#### Setting parameters:

<filename></filename>	<pre>String parameter containing the file name. If no path is specified, the file is stored to the directory C:\Users\Public\Documents\Vna\Report; the extension *.zip is appended automatically. *RST: n/a</pre>
Example:	DIAG:DEV:STAT 'report_16032011_1120' Generate a report and store it to C:\Users\Public\Documents\Vna\Report\ report_16032011_1120. Use the MMEMory commands to rename, move, or delete the file.
Usage:	Setting only

Manual control: See "Save... / Print... / Save Report" on page 428

#### DIAGnostic:SERVice:RFPower <Boolean>

Turns the internal source power at all ports and the power of all external generators on or off. This command is equivalent to OUTPut<Ch>[:STATe].

<b>Parameters:</b>	ON   OFF -	switch the power on or off.
<boolean></boolean>	*RST:	ON
Example:		RFP OFF

#### DIAGnostic:SERVice:SFUNction <SFIdentifier>

Activates a service function (mainly for internal use). Service functions are identified by groups of numbers, separated by dots.

### Parameters:

<sfidentifier></sfidentifier>	Service function identifier (including the dots) in single or double guotes (string parameter). This is analogous to manual entry of
	the identifier in the "Service Function" dialog.
Manual control:	See "Password" on page 429

## 6.3.5 DISPlay Commands

The DISPlay... commands control the selection and presentation of graphical and trace information on the screen.



## Trace display

Traces are generally identified by a string parameter defining the trace name (e.g. CALCulate<Ch>: PARameter: SELect <TraceName>). In the DISPlay... subsystem, traces are assigned to diagrams (DISPlay[:WINDow<Wnd>]: TRACe<WndTr>: FEED <TraceName>). While this assignment is valid, the trace is identified by the numeric suffix <Wnd>, and the trace name is not needed.

#### Units for DISPlay... commands

The DISPlay... subsystem contains commands to define particular points in the diagram, e.g. to set the scale or a reference value. This requires the entry of a numeric value and a physical unit, depending on the parameter type displayed. The following table lists the physical units accepted by the analyzer.

Power	DBM, DB, DBW, W, MW, UW, NW, PW
Voltage	V, MV, UV, NV, PV, DBV, DBMV, DBUV

Phase	DEG, KDEG, MDEG, UDEG, NDEG, PDEG
Group delay	S, MS, US, NS, PS
Impedance	ОНМ, GOHM, MOHM, KOHM
Admittance	SIE, MSIE, USIE, NSIE
Inductance	H, MH, UH, NH, PH, FH
Capacitance	F, MF, UF, NF, PF, FF
Dimensionless	UNIT, MUNIT, UUNIT, NUNIT, PUNIT, FUNIT

DISPlay:ANNotation:CHANnel[:STATe]	610
DISPlay:ANNotation:FREQuency[:STATe]	
DISPlay:ANNotation:TRACe[:STATe]	
DISPlay:CMAP:LIMit:FCOLorize[:STATe]	
DISPlay:CMAP:LIMit:FSYMbol[:STATe]	
DISPlay:CMAP:LIMit[:STATe]	
DISPlay:CMAP:MARKer[:STATe]	
DISPlay:CMAP <dispel>:RGB.</dispel>	
DISPlay:CMAP:TRACe:COLor[:STATe]	
DISPlay:CMAP:TRACe:RGB.	
DISPlay:LAYout.	
DISPlay:LAYout:APPLy	
DISPlay:LAYout:DEFine	
DISPlay:LAYout:EXECute	
DISPlay:LAYout:GRID	
DISPlay:LAYout:JOIN	
DISPlay:RFSize	
DISPlay[:WINDow <wnd>]:CATalog?</wnd>	
DISPlay[:WINDow <wnd>]:MAXimize</wnd>	
DISPlay[:WINDow <wnd>]:OVERview[:STATe]</wnd>	
DISPlay[:WINDow <wnd>]:NAME</wnd>	619
DISPlay[:WINDow <wnd>]:STATe</wnd>	
DISPlay[:WINDow <wnd>]:TITLe:DATA</wnd>	620
DISPlay[:WINDow <wnd>]:TITLe[:STATe]</wnd>	620
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:CATalog?</wndtr></wnd>	621
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:DELete</wndtr></wnd>	621
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:EFEed</wndtr></wnd>	622
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:FEED</wndtr></wnd>	622
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:SHOW</wndtr></wnd>	623
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:X:OFFSet</wndtr></wnd>	624
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:Y:OFFSet</wndtr></wnd>	
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:Y[:SCALe]:AUTO</wndtr></wnd>	
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:Y[:SCALe]:PDIVision</wndtr></wnd>	
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:Y[:SCALe]:RLEVel</wndtr></wnd>	
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:Y[:SCALe]:RPOSition</wndtr></wnd>	
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:Y[:SCALe]:BOTTom</wndtr></wnd>	
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:Y[:SCALe]:TOP</wndtr></wnd>	
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:ZOOM[:STATe]</wndtr></wnd>	
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:ZOOM:STARt</wndtr></wnd>	630

SCPI Command Reference

DISPlay[:WINDow <wnd>]:TRACe<wndtr>:ZOOM:STOP</wndtr></wnd>	630
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:ZOOM:BOTTom</wndtr></wnd>	
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:ZOOM:TOP</wndtr></wnd>	631

```
DISPlay:ANNotation:CHANnel[:STATe] <Boolean>
DISPlay:ANNotation:FREQuency[:STATe] <Boolean>
DISPlay:ANNotation:TRACe[:STATe] <Boolean>
```

Shows or hides the channel list(s), all frequency stimulus values, or the trace list(s) in the diagrams.

### Parameters:

<boolean></boolean>	ON   OFF - show or hide information element(s).	
	*RST: ON	
Example:	*RST; :DISP:ANN:TRAC OFF; CHAN ON; FREQ OFF Create diagram area no. 1 (with default trace) and hide the trace list. Keep the channel list but hide the swept frequency range.	
Manual control:	See "Trace Info" on page 415	

### DISPlay:CMAP:LIMit:FCOLorize[:STATe] <Boolean>

Assigns a different trace color to failed trace segments ("Colorize Trace when Failed").

Parameters: <boolean></boolean>	ON   OFF - colorize trace or keep original trace color. *RST: n/a (a *RST does not affect the setting). In the factory configuration, OFF is preset.
Example:	See DISPlay:CMAP:LIMit[:STATe]
Manual control:	See "Limit Test > Colorize Trace when Failed" on page 417

#### DISPlay:CMAP:LIMit:FSYMbol[:STATe] <Boolean>

Displays or hides the limit fail symbols (colored squares) on the trace.

#### **Parameters:**

<boolean></boolean>	ON   OFF -	show or hide symbols.
	*RST:	n/a (a *RST does not affect the setting). In the factory configuration, ON is preset.
Example:	See DISPL	ay:CMAP:LIMit[:STATe]
Manual control:	See "Limit Test > Show Limit Fail Symbols" on page 417	

## DISPlay:CMAP:LIMit[:STATe] <Boolean>

Displays all limit lines either with individually configured colors or with the color of the associated trace(s). The colors of all display elements are defined via DISPlay: CMAP<DispEl>:RGB.

Parameters: <boolean></boolean>	ON - the limit line colors are defined via DISPlay:CMAP <dispel>:RGB where <dispel> = 9 12. The limit line colors are independent of the trace colors. OFF - all limit lines have the color of the associated trace. *RST: n/a (a *RST does not affect the setting). In the factory</dispel></dispel>
	configuration, OFF is preset.
Example:	DISP:CMAP:LIMit OFF Use the trace colors for all limit lines associated with each trace. Subsequent limit line color definitions will be ignored until individ- ual limit settings are enabled again. DISPlay:CMAP:LIMit:FCOLorize:STATE ON Assign a different trace color to failed trace sections. DISPlay:CMAP:LIMit:FSYMbol:STATE OFF Remove the limit fail symbols from the trace.
Manual control:	See "Limit Test > Use Trc Color for Limit Lines" on page 418

#### DISPlay:CMAP:MARKer[:STATe] <Boolean>

Displays all markers with the same color or display each marker with the color of the associated trace. The colors of all display elements are defined via DISPlay:CMAP<DispEl>:RGB <Red>, <Green>, <Blue> ...

Parameters:	
-------------	--

<boolean></boolean>	ON - all markers have the same color, to be defined via		
	<pre>DISPlay:CMAP<dispel>:RGB <red>, <green>, <blue>.</blue></green></red></dispel></pre>		
	The marker color is independent of the trace colors. OFF - each marker has the color of the associated trace.		
Example:	See DISPlay:CMAP <dispel>:RGB</dispel>		
Manual control:	See "General > Same Color all Markers" on page 419		

**DISPlay:CMAP<DispEl>:RGB** <Red>, <Green>, <Blue>[, <TraceStyle>, <TraceWidth>]

Defines the color of all display elements based on the Red/Green/Blue color model.

## Suffix:

<dispel></dispel>	Number of the display element. The display elements correspond-
	ing to the numbers 1 to 20 are listed below.

## Parameters:

<Red>

Red content of the defined color.

Range: 0 (zero intensity, corresponding to a 0 in the 24-bit color model) to 1 (full intensity, corresponding to 255 in the 24-bit color model).

<green></green>	Green content of the defined color.	
	Range:	0 (zero intensity, corresponding to a 0 in the 24-bit color model) to 1 (full intensity, corresponding to 255 in the 24-bit color model).
<blue></blue>	Blue conter	nt of the defined color.
	Range:	0 (zero intensity, corresponding to a 0 in the 24-bit color model) to 1 (full intensity, corresponding to 255 in the 24-bit color model).
<tracestyle></tracestyle>	SOLid   DA	SHed   DOTTed   DDOTted   DDDotted
	•	ace style, only for traces ( <dispel> &gt; 12): One of the neters SOLid   DASHed   DOTTed   DDOTted  </dispel>
<tracewidth></tracewidth>	Optional trace width, only for traces ( <dispel> &gt; 12).</dispel>	
	Range:	1 to 20
Example:	Create diag parameter S CALC: PAR DISP: WINH Create a net area no. 1. active trace CALC: MARH Assign a mat the same of DISP: CMAH Color the fin DISP: CMAH Query the n made in pre	K2 ON arker M2 to the trace. Both markers are displayed with olor. P13:RGB 1,0,0; :DISP:CMAP14:RGB 0,1,0 rst trace red, the second trace green.
	Change the	e marker colors: M1 turns red, M2 turns green.
Manual control:	See "Eleme	ent" on page 417

Manual control: See "Element" on page 417

The numeric suffixes <DispEl> denote the following display elements:

<dispel></dispel>	Display Element	
1	Background	
2	Text	
3	Selected Text	
4	Grid	
5	Reference Line	
6	Same Color for all Markers	

SCPI Command Reference

<dispel></dispel>	Display Element
7	Horizontal Line / Vertical Range Lines
8	Diagram Title
9	Limit Fail Trace Color
10	Limit Line Type Off
11	Limit Line Type Upper
12	Limit Line Type Lower
13	Trace 1 (see also DISPlay: CMAP: TRACe: RGB)
14	Trace 2
15	Trace 3
16	Trace 4
17	Trace 5
18	Trace 6
19	Trace 7
20	Trace 8

## DISPlay:CMAP:TRACe:COLor[:STATe] <Boolean>

Defines the trace color schemes in different diagram areas.

## Parameters:

<boolean></boolean>	OFF - independent color scheme in new diagram area. Moved traces change their color. ON - color scheme in new diagram area continues the previous color scheme. Moved traces keep their color.
Example:	<pre>*RST; :DISP:CMAP13:RGB 1,0,0 Create diagram area no. 1 (with default trace showing the S- parameter S<sub>21</sub>) and color the trace red. DISP:CMAP:TRAC:COL OFF; :DISP:WIND2:STAT ON Select independent color schemes for new diagram areas. Create a new diagram area no. 2. CALC:PAR:SDEF 'Trc2', 'S11'; :DISP:WIND2:TRAC2: FEED 'TRC2' Create a new trace named Trc2 and display the trace in a new diagram area no. 2. The new trace is red like the first trace. DISP:CMAP:TRAC:COL ON; :DISP:WIND3:STAT ON Continue the same color scheme in new diagram areas. Create a new diagram area no. 3. CALC:PAR:SDEF 'Trc3', 'S22'; :DISP:WIND3:TRAC3: FEED 'Trc3' Create a new trace named Trc3 and display the trace in a new diagram area no. 3. The new trace is not red.</pre>

User Manual 1173.9163.02 - 13

Manual control: See "General > Trace Colors per Diagram" on page 418

**DISPlay:CMAP:TRACe:RGB** <TraceName>, <Red>, <Green>, <Blue>[, <TraceStyle>, <TraceWidth>]

Defines the color of a trace referenced by its name, based on the Red/Green/Blue color model. Use the generalized command DISPlay: CMAP<DispEl>:RGB to define the color of other display elements.

Parameters:
-------------

<tracename></tracename>	Trace name	e, string parameter
<red></red>	Red content	t of the defined color.
	Range:	0 (zero intensity, corresponding to a 0 in the 24-bit color model) to 1 (full intensity, corresponding to 255 in the 24-bit color model).
<green></green>	Green conte	ent of the defined color.
	Range:	0 (zero intensity, corresponding to a 0 in the 24-bit color model) to 1 (full intensity, corresponding to 255 in the 24-bit color model).
<blue></blue>	Blue content of the defined color.	
	Range:	0 (zero intensity, corresponding to a 0 in the 24-bit color model) to 1 (full intensity, corresponding to 255 in the 24-bit color model).
<tracestyle></tracestyle>	Optional tra	SHed   DOTTed   DDOTted   DDDotted ce style, only for traces ( <dispel> &gt; 12): One of the neters SOLid   DASHed   DOTTed   DDOTted  </dispel>
<tracewidth></tracewidth>	Optional tra	ce width, only for traces ( <dispel> &gt; 12).</dispel>
	Range:	1 to 20
Example:	Color the de	SP:CMAP:TRAC:RGB 'Trc1', 1, 0, 0 efault trace 'Trc1' red. SPlay:CMAP <dispel>:RGB</dispel>
Manual control:	See "Proper	rties" on page 417

#### DISPlay:LAYout <LayoutMode>

Arranges the diagrams in the screen, leaving the diagram contents unchanged.

<layoutmode></layoutmode>	LINeup   STACk   HORizontal   VERTical   GRID
	LINeup – the diagrams are arranged side by side. STACk – the diagrams are arranged one on top of the other. HORizontal – the diagrams are arranged in horizontal rows. VERTical – the diagrams are arranged in vertical rows. GRID – the diagrams are arranged as a rectangular matrix. The number of rows and columns is as defined with command DISPlay:LAYout:GRID.
Example:	See DISPlay:LAYout:GRID
Manual control:	See "Split Type / Diagrams / Rows / Columns" on page 413

#### DISPlay:LAYout:APPLy <LayoutId>

Selects a previously defined layout for display in the analyzer screen.

Parameters: <layoutid></layoutid>	Integer value 1, 2
	Current number, as defined by DISPlay:LAYout:DEFine.
Example:	See Creating Diagrams
Manual control:	See "Additional Functionality: SCPI Commands" on page 414

DISPlay:LAYout:DEFine <LayoutId>, <LayoutFormatMode>, <LayoutData> DISPlay:LAYout:DEFine? <LayoutId>

Creates a horizontal or vertical display layout and provides it with an identifier (<LayoutId>).

Layouts are defined row by row (horizontal layouts) or column by column (vertical layouts).

A horizontal layout consists of N rows, each of height h<sub>i</sub> (i = 1 to N). The heights are defined in units relative to the total height of the screen, i.e. their sum h<sub>1</sub> + h<sub>2</sub> + ... h<sub>N</sub> must be equal to 1.00.

Each row contains a selectable number of diagrams with independent widths  $w_{ij}$  (j = 1, 2 ...M(i)). The sum of the widths in each row must also match the screen width, hence  $w_{i1} + w_{i2} + ... + w_{iM(i)} = 1.00$  for all rows (i = 1 to N).

The <LayoutData> string for horizontal layouts reads 'h<sub>1</sub>,w<sub>11</sub>,w<sub>12</sub>...

 $w_{1M(1)};h_2,w_{12},w_{22}...w_{2M(2)};...;h_N,w_{N1},w_{N2}...w_{NM(N)}'.$ 

A semicolon separates different rows, a comma separates different diagram widths within a row.

 The definition of a vertical layout is analogous, however, the role of rows and columns is interchanged.

The query returns the layout data in an alternative, executable format. The executable format is also used by DISPlay:LAYout:EXECute.

Use DISPlay:LAYout:JOIN or DISPlay:LAYout:EXECute to create more complicated (nested) layouts.

**Note:** The maximum number of diagrams in a layout is 256.

#### Parameters:

<LayoutFormatMode>HORizontal | VERTical

Horizontal or vertical layout; see above.

<layoutdata></layoutdata>	String parameter defining the number of diagrams and their posi-
	tion (easy format); see above.

#### Parameters for setting and query:

<layoutid></layoutid>	Integer value 1, 2
	Current number, used by other DISPlay: LAYout com- mands to reference the created layout.
Example:	See Creating Diagrams
Manual control:	See "Additional Functionality: SCPI Commands" on page 414

#### DISPlay:LAYout:EXECute <LayoutData>

Creates and displays a horizontal or vertical display layout. The query returns the layout data of the currently displayed layout (the last layout selected via DISPlay:LAYout: APPLy) in executable format.

The executable format is an extension of the easy format used by DISPlay:LAYout: DEFine.

- The <LayoutData> string consists of two parts: <LayoutData> = '(<StartFormat>,<RepeatFormat<sub>1</sub>>,<Repeat Format<sub>2</sub>> ...). The <StartFormat> descriptor distinguishes between horizontal and vertical layouts and defines the number of rows or columns. A <RepeatFormat> descriptor follows for each row or colum in the layout. The <RepeatFormat> descriptors can be nested in order to describe joined layouts; refer to Creating Diagrams for an easy example.
- For a horizontal layout with N rows, each of height h<sub>i</sub> (i = 1 ... N) and filled with M(i) diagrams with independent widths w<sub>ij</sub> (j = 1, 2 ...M(i)), the data string is composed as follows:
   <StartFormat> = N,1,0.00,0.00

<RepeatFormat<sub>i</sub>> = (1,M(i),1.00,h<sub>i</sub>[w<sub>i1</sub>,1.00], [w<sub>i2</sub>,1.00] ... [w<sub>iM(i)</sub>,1.00])

For a vertical layout with N columns, each of width w<sub>i</sub> (i = 1 ... N) and filled with M(i) diagrams with independent heights h<sub>ij</sub> (j = 1, 2 ...M(i)), the data string is composed as follows:

<StartFormat> = 1,N,0.00,0.00 <RepeatFormat<sub>i</sub>> = (M(i),1,w<sub>i</sub>,1.00,[1.00,h<sub>i1</sub>], [1.00,h<sub>i2</sub>] ... [1.00,h<sub>iM(i)</sub>])

Note: The maximum number of diagrams in a layout is 256.

#### Parameters:

<LayoutData> String parameter defining the number of diagrams and their position (executable format); see above.

Example: See Creating Diagrams

Manual control: See "Additional Functionality: SCPI Commands" on page 414

### DISPlay:LAYout:GRID <Rows>, <Columns>

Defines the number of rows and columns if DISPlay:LAYout GRID is set.

Parameters:		
<rows></rows>	Range:	1 to 16
	*RST:	1
<columns></columns>	Range:	1 to 16
	*RST:	1
Example:	DISPlay:	LAYout GRID
	Select te sp	lit type where the diagrams are arranged in rows and
	columns.	
	DISPlay:	LAYout:GRID 2,2
	Arrange 4 c	liagrams in two rows and two columns.
Manual control:	See "Split T	Type / Diagrams / Rows / Columns" on page 413

DISPlay:LAYout:JOIN <MainLayoutId>, <DiagramNumber>, <SubLayoutId>

Creates a nested layout, inserting a sub-layout into one of the diagrams of a main layout. Main layout and sub-layout must be defined previously, preferably using DISPlay: LAYout:DEFine.

Note: The maximum number of joined levels within a layout is 16.

Setting parameters: <mainlayoutid></mainlayoutid>	Integer value 1, 2 Current number of main layout, as defined by DISPlay: LAYout:DEFine.
<diagramnumber></diagramnumber>	Integer value 1, 2
	Diagram number in the main layout
<sublayoutid></sublayoutid>	Integer value 1, 2
	Current number of sub-layout, as defined by DISPlay:
	LAYout:DEFine.
	*RST: n/a
Example:	See Creating Diagrams
Usage:	Setting only
Manual control:	See "Additional Functionality: SCPI Commands" on page 414

#### DISPlay:RFSize <RelFontSize>

Defines the size of the fonts in the diagram on a relative scale.

Parameters: <relfontsize></relfontsize>	Relative font size
	Range:       80 % to 170 %         *RST:       100 %         Default unit:       percent
Example:	*RST; :DISP:RFS 80 Use smaller fonts to gain more space for the traces in the diagram.
Manual control:	See "Font Size" on page 416

## DISPlay[:WINDow<Wnd>]:CATalog?

C. Hiv.

Returns the numbers and names of all diagrams in the current recall set.

The response is a string containing a comma-separated list of diagram area numbers and names, see example below. If all diagram areas have been deleted, the response is an empty string ("").

Suffix: <wnd></wnd>	Number of a diagram. This suffix is ignored; the command returns a list of all diagrams.
Example:	<pre>*RST; :DISP:WIND2:STAT ON Create diagram no. 2. DISP:WIND2:NAME 'S11 Test Diagram' Assign a name to the new diagram. DISP:CAT? Query all diagrams and their names. As a default diagram no. 1 is created upon *RST, the response is ''1,1,2,S11 Test Diagram'. The first diagram is not named; its default name is equal to the diagram number. CALC:PAR:SDEF 'Win2_Tr1', 'S11' Create a trace named Win2_Tr1 to measure the input reflection coefficient S<sub>11</sub>. DISP:WIND2:TRAC9:FEED 'Win2_Tr1' Display the generated trace in diagram area no. 2, assigning the trace number 9 to it. DISP:WIND2:TRAC:CAT? Query all traces in diagram area no. 2. The response is '9,Win2_Tr1'.</pre>
Usage:	Query only
Manual control:	See "Title" on page 409

## DISPlay[:WINDow<Wnd>]:MAXimize <Boolean>

Maximizes all diagram areas in the active recall set or restores the previous display configuration.

Suffix: <wnd></wnd>	Number of the diagram area to become the active diagram area. DISPlay:WINDow <wnd>:MAXimize acts on all diagrams of the current recall set, however, the diagram no. <wnd> is displayed on top of the others.</wnd></wnd>
Parameters:	
<boolean></boolean>	ON   OFF - maximize all diagram areas or restore the previous display configuration. *RST: OFF
Example:	*RST; :DISP:WIND2:STAT ON Create diagram areas no. 1 (with default trace) and 2 (with no trace). DISP:WIND2:MAXimize ON Maximize the diagram areas, placing area no. 2 on top.
Manual control:	See "Maximize" on page 409

#### DISPlay[:WINDow<Wnd>]:OVERview[:STATe] <Boolean>

Enables the zoom function with an additional overview window for the diagram no. <Wnd> or removes the overview window from a diagram.

Suffix: <wnd></wnd>	Number of the zoomed diagram area
Parameters: <boolean></boolean>	ON – activate the zoom window with overview window OFF – remove the overview window *RST: OFF
Example:	<pre>See DISPlay[:WINDow<wnd>]:TRACe<wndtr>:ZOOM[: STATe]</wndtr></wnd></pre>
Manual control:	See "Overview Select" on page 192

## DISPlay[:WINDow<Wnd>]:NAME <Name>

Defines a name for diagram area <Wnd>. The name appears in the list of diagram areas, to be queried by DISPlay [:WINDow<Wnd>]:CATalog?.

Suffix: <wnd></wnd>	Number of the diagram area.
Parameters: <name></name>	String variable for the name.
Example:	See DISPlay[:WINDow <wnd>]:CATalog?</wnd>
Manual control:	See "Title" on page 409

#### DISPlay[:WINDow<Wnd>]:STATe <Boolean>

Creates or deletes a diagram area, identified by its area number <Wnd>.

Suffix: <wnd></wnd>	Number of the diagram area to be created or deleted.
Parameters: <boolean></boolean>	ON   OFF - creates or deletes diagram area no. <wnd>. *RST: -</wnd>
Example:	CALC4: PAR: SDEF 'Ch4Tr1', 'S11' Create channel 4 and a trace named Ch4Tr1 to measure the input reflection coefficient S <sub>11</sub> . DISP:WIND2: STAT ON Create diagram area no. 2. DISP:WIND2: TRAC9: FEED 'CH4TR1' Display the generated trace in diagram area no. 2, assigning the trace number 9 to it.
Manual control:	See "Add Trace + Diag" on page 193

#### DISPlay[:WINDow<Wnd>]:TITLe:DATA <Title>

Defines a title for diagram area <Wnd>.

Suffix: <wnd></wnd>	Number of the diagram area.
<b>Parameters:</b> <title>&lt;/th&gt;&lt;th&gt;String variable for the title. The length of the title is practically unlimited but should be kept short enough to be displayed in the diagrams.&lt;/th&gt;&lt;/tr&gt;&lt;tr&gt;&lt;th&gt;Example:&lt;/th&gt;&lt;th&gt;*RST; :DISP:WIND:TITL:DATA 'S21 Test Diagram'&lt;br&gt;Define a title for the default diagram area. The title is displayed&lt;br&gt;below the top of the diagram area.&lt;br&gt;DISP:WIND:TITL OFF; TITL:DATA?&lt;br&gt;Hide the title. The title is no longer displayed but still defined so it&lt;br&gt;can be displayed again.&lt;/th&gt;&lt;/tr&gt;&lt;tr&gt;&lt;th&gt;Manual control:&lt;/th&gt;&lt;th&gt;See "Title" on page 409&lt;/th&gt;&lt;/tr&gt;&lt;/tbody&gt;&lt;/table&gt;</title>	

## DISPlay[:WINDow<Wnd>]:TITLe[:STATe] <Boolean>

Displays or hides the title for area number <Wnd>, defined by means of DISPlay:WINDow<Wnd>:TITLe:DATA.

Suffix: <Wnd>

Number of the diagram area.

Parameters: <boolean></boolean>	ON   OFF - displays or hides the title.
	*RST: ON
Example:	See DISPlay[:WINDow <wnd>]:TITLe:DATA</wnd>
Manual control:	See "Title" on page 409

## DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:CATalog?

Returns the numbers and names of all traces in diagram area no. <Wnd>.

Suffix: <wnd></wnd>	Number of a diagram area.
<wndtr></wndtr>	Trace number used to distinguish the traces of the same diagram area $<$ Wnd>. This suffix is ignored; the command returns a list of all traces.
Example:	See DISPlay[:WINDow <wnd>]:CATalog?</wnd>
Usage:	Query only
Manual control:	See "Title" on page 409

## DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:DELete

Releases the assignment between a trace and a diagram area, as defined by means of DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:FEED<TraceName> and expressed by the <WndTr> suffix. The trace itself is not deleted; this must be done via CALCulate<Ch>: PARameter: DELete<TraceName>.

Suffix: <wnd></wnd>	Number of an existing diagram area (defined by means of DISPlay[:WINDow <wnd>]:STATEON).</wnd>
<wndtr></wndtr>	Trace number used to distinguish the traces of the same diagram area < $\mbox{Wnd}$ .
Example:	CALC4: PAR: SDEF 'Ch4Tr1', 'S11' Create channel 4 and a trace named Ch4Tr1 to measure the input reflection coefficient S <sub>11</sub> . DISP:WIND2: STAT ON Create diagram area no. 2. DISP:WIND2: TRAC9: FEED 'CH4TR1' Display the generated trace in diagram area no. 2, assigning the trace number 9 to it. DISP:WIND2: TRAC9: DELete Release the assignment between trace no. 9 and window no. 2. The trace can still be referenced with its trace name Ch4Tr1.
Usage:	Event

User Manual 1173.9163.02 - 13

#### DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:EFEed <TraceName>

Assigns an existing trace (CALCulate<Ch>: PARameter:SDEFine<TraceName>) to a diagram area <Wnd>, and displays the trace. Use DISPlay[:WINDow<Wnd>]: TRACe<WndTr>:FEED to assign the trace to a diagram area using a numeric suffix (e.g. in order to use the DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:Y:OFFSet command).

**Tip:** You can open the "Trace Manager" dialog to obtain an overview of all channels and traces, including the traces that are not displayed.

Suffix: <wnd></wnd>	Number of an existing diagram area (defined by means of DISPlay[:WINDow <wnd>]:STATEON).</wnd>
<wndtr></wndtr>	Trace number. This suffix is ignored; the trace is referenced by its name.
Setting parameters:	
<tracename></tracename>	String parameter for the trace name, e.g. 'Trc4'.
Example:	CALC4: PAR: SDEF 'Ch4Tr1', 'S11' Create channel 4 and a trace named Ch4Tr1 to measure the input reflection coefficient S <sub>11</sub> . DISP: WIND2: STAT ON Create diagram area no. 2. DISP: WIND2: TRAC: EFE 'CH4TR1' Display the generated trace in diagram area no. 2. No trace num- ber is assigned.
Usage:	Setting only
Manual control:	See "Add" on page 195

#### DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:FEED <TraceName>

Assigns an existing trace (CALCulate<Ch>: PARameter: SDEFine) to a diagram area, using the <WndTr> suffix, and displays the trace. Use DISPlay[:WINDow<Wnd>]: TRACe<WndTr>:EFEed to assign the trace to a diagram area without using a numeric suffix.

**Tip:** A trace can be assigned to a diagram only once. If a attempt is made to assign the same trace a second time (e.g. by typing DISP:WIND2:TRAC8:FEED 'CH4TR1' after executing the program example below) an error message -114,"Header suffix out of range" is generated. You can open the "Trace Manager" dialog to obtain an overview of all channels and traces, including the traces that are not displayed.

#### Suffix:

<wnd></wnd>	Number of an existing diagram area (defined by means of DISPlay[:WINDow <wnd>]:STATe ON).</wnd>
<wndtr></wndtr>	Trace number used to distinguish the traces of the same diagram area $<\!\!\mathbb{W}nd\!>$ .

Parameters: <tracename></tracename>	String parameter for the trace name, e.g. 'Trc4'.
Example:	CALC4: PAR: SDEF 'Ch4Tr1', 'S11' Create channel 4 and a trace named Ch4Tr1 to measure the input reflection coefficient S <sub>11</sub> . DISP:WIND2: STAT ON Create diagram area no. 2. DISP:WIND2: TRAC9: FEED 'CH4TR1' Display the generated trace in diagram area no. 2, assigning the trace number 9 to it.
Manual control:	See "Add Trace" on page 193

## DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:SHOW <TraceName>[, <Boolean>]

Displays or hides an existing trace, identified by its trace name <  $Trace_Name$ >, or a group of traces.

**Tip:** You can open the trace manager to obtain an overview of all channels and traces, including the traces that are not displayed.

Suffix:	
<wnd></wnd>	Number of a diagram area. This suffix is ignored; the command affects traces in all diagram areas.
<wndtr></wndtr>	Trace number. This suffix is ignored; the trace is referenced by its name.
Parameters:	
<tracename></tracename>	DALL – all data traces MALL – all memory traces <string> – single trace identified by its trace name (string param- eter), e.g. 'Trc4'.</string>
<boolean></boolean>	ON   OFF – display or hide traces.
Example:	*RST; :DISP:TRAC:SHOW? 'Trc1'
	Reset the analyzer, creating the default trace 'Trc1'. The trace is displayed; the query returns 1. CALC4:PAR:SDEF 'Ch4Tr1', 'S11'
	Create channel 4 and a trace named Ch4Tr1 to measure the input reflection coefficient $S_{11}$ .
	DISP:WIND2:STAT ON; :DISP:WIND2:TRAC:FEED 'CH4TR1'
	Create diagram area no. 2 and display the generated trace in the diagram area.
	DISP:TRAC:SHOW DALL, OFF
	Hide both traces in both diagrams. DISP:TRAC:SHOW? DALL
	Query whether all data traces are displayed. The response 0
	means that at least one trace is hidden.

Manual control: See "Show <Destination>" on page 198

## DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:X:OFFSet <StimulusOffset>

Shifts the trace  $\langle WndTr \rangle$  in horizontal direction, leaving the positions of all markers unchanged.

Suffix: <wnd></wnd>	Number of an existing diagram area (defined by means of DISPlay[:WINDow <wnd>]:STATe ON).</wnd>	
<wndtr></wndtr>	Existing trace number, assigned by means of DISPlay[: WINDow <wnd>]:TRACe<wndtr>:FEED.</wndtr></wnd>	
Parameters: <stimulusoffset></stimulusoffset>	Stimulus offset value. Range: -1000 GHz to +1000 GHz. The range and unit	
	depends on the sweep type. *RST: 0 Default unit: Hz	
Example:	*RST; :DISP:WIND:TRAC:X:OFFS 1MHZ; :DISP:WIND	):

TRAC: Y: OFFS 10 Create the default trace and shift it horizontally by 1 MHz, vertically by 10 dB.

Manual control: See "Shift Trace > Stimulus" on page 217

DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:Y:OFFSet <MagnitudeFactor>[, <PhaseFactor>, <RealPart>, <ImaginaryPart>]

Modifies all points of the trace  $\langle WndTr \rangle$  by means of an added and/or a multiplied complex constant. The response values M of the trace are transformed according to:

#### Suffix: <Wnd> Number of an existing diagram area (defined by means of DISPlay[:WINDow<Wnd>]:STATe ON). <WndTr> Existing trace number, assigned by means of DISPlay[: WINDow<Wnd>]:TRACe<WndTr>:FEED. **Parameters:** Multiplied magnitude factor <MagnitudeFactor> -300 dB to + 300 dB Range: \*RST: 0 dB Default unit: dB <PhaseFactor> Multiplied phase factor, optional for setting command but returned by query Range: -3.4\*1038 deg to +3.4\*1038 deg \*RST: 0 deg Default unit: deg

User Manual 1173.9163.02 - 13

<realpart></realpart>	Real and imaginary part of added complex constant, optional for setting command but returned by query
	Range: -3.4*1038 to +3.4*1038 *RST: 0
<imaginarypart></imaginarypart>	
Example:	<pre>*RST; :DISP:WIND:TRAC:X:OFFS 1MHZ; :DISP:WIND: TRAC:Y:OFFS 10 Create the default trace and shift it horizontally by 1 MHz, vertically by 10 dB. DISP:WIND:TRAC:Y:OFFS? Query all response offset values. The response is 10,0,0,0.</pre>
Manual control:	See "Shift Trace > Mag / Phase / Real / Imag" on page 217

DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:Y[:SCALe]:AUTO <Activate>[, <TraceName>]

Displays the entire trace in the diagram area, leaving an appropriate display margin. The trace can be referenced either by its number <WndTr> or by its name <TraceName>.

Suffix: <wnd></wnd>	Number of an existing diagram area (defined by means of DISPlay[:WINDow <wnd>]:STATEON). This suffix is ignored if the optional <tracename> parameter is used.</tracename></wnd>		
<wndtr></wndtr>	Existing trace number, assigned by means of DISPlay[: WINDow <wnd>]:TRACe<wndtr>:FEED. This suffix is ignored if the optional <tracename> parameter is used.</tracename></wndtr></wnd>		
Setting parameters: <activate></activate>	ONCE Activate the autoscale function.		
<tracename></tracename>	Optional string parameter for the trace name, e.g. 'Trc4'. If this optional parameter is present, both numeric suffixes are ignored (trace names must be unique across different channels and windows).		
Example:	<pre>*RST; DISP:WIND:TRAC:Y:PDIV?; RLEV? Query the value between two grid lines and the reference value for the default trace. The response is 10;0. DISP:WIND:TRAC:Y:AUTO ONCE; PDIV?; RLEV? or: DISP:WIND:TRAC:Y:AUTO ONCE, 'Trc1'; PDIV?; RLEV? Autoscale the default trace and query the scaling parameters again. In general both values have changed.</pre>		
Usage:	Setting only		
Manual control:	See "Auto Scale Trace" on page 188		

## DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:Y[:SCALe]:PDIVision <VerticalDiv>[, <TraceName>]

Sets the value between two grid lines (value "per division") for the diagram area <Wnd>. When a new PDIVision value is entered, the current RLEVel is kept the same, while the top and bottom scaling is adjusted for the new PDIVision value.

Suffix: <wnd></wnd>	Number of an existing diagram area (defined by means of DISPlay[:WINDow <wnd>]:STATE ON). This suffix is ignored if the optional <tracename> parameter is used.</tracename></wnd>			
<wndtr></wndtr>	Existing trace number, assigned by means of DISPlay[: WINDow <wnd>]:TRACe<wndtr>:FEED. This suffix is ignored if the optional <tracename> parameter is used.</tracename></wndtr></wnd>			
Parameters:				
<verticaldiv></verticaldiv>	Value and unit for the vertical diagram divisions. Range and unit depend on the measured quantity, see "Units for DISPlay commands" on page 608.			
	*RST: Depending on the measured quantity. The default reference level for an S-parameter displayed in a dB Mag diagram is 10 dB. Default unit: dB			
<tracename></tracename>	Optional string parameter for the trace name, e.g. 'Trc4'. If this optional parameter is present, both numeric suffixes are ignored (trace names must be unique across different channels and windows).			
Example:	CALC4: PAR: SDEF 'Ch4Tr1', 'S11' Create channel 4 and a trace named Ch4Tr1 to measure the input reflection coefficient S <sub>11</sub> . DISP: WIND2: STAT ON Create diagram area no. 2. DISP: WIND2: TRAC9: FEED 'CH4TR1' Display the generated trace in diagram area no. 2, assigning the trace number 9 to it. DISP: WIND2: TRAC9: Y: PDIV 5 or: DISP: WIND2: TRAC9: Y: PDIV 5, 'CH4TR1' Set the value per division to 5 dB.			
Manual control:	See "Scale/Div" on page 189			

# DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:Y[:SCALe]:RLEVel <RefLevel>[, <TraceName>]

Sets the reference level (or reference value) for a particular displayed trace. Setting a new reference level does not affect the value of PDIVision. The trace can be referenced either by its number <WndTr> or by its name <TraceName>.

User Manual 1173.9163.02 - 13

Suffix:			
<wnd></wnd>	Number of an existing diagram area (defined by means of DISPlay[:WINDow <wnd>]:STATE ON). This suffix is ignored if the optional <tracename> parameter is used.</tracename></wnd>		
<wndtr></wndtr>	Existing trace number, assigned by means of DISPlay[: WINDow <wnd>]:TRACe<wndtr>:FEED. This suffix is ignored if the optional <tracename> parameter is used.</tracename></wndtr></wnd>		
Parameters:			
<reflevel></reflevel>	Value and unit for the reference level (or reference value, if the trace does not show a level). Range and unit depend on the measured quantity, see "Units for DISPlay commands" on page 608.		
	*RST: Default unit:	Depending on the measured quantity. The default reference level for an S-parameter displayed in a dB Mag diagram is 0 dB. dB	
<tracename></tracename>	optional para	ng parameter for the trace name, e.g. 'Trc4'. If this ameter is present, both numeric suffixes are ignored s must be unique across different channels and win-	
Example:	CALC4:PAR:SDEF 'Ch4Tr1', 'S11' Create channel 4 and a trace named Ch4Tr1 to measure the input reflection coefficient S <sub>11</sub> . DISP:WIND2:STAT ON Create diagram area no. 2. DISP:WIND2:TRAC9:FEED 'CH4TR1' Display the generated trace in diagram area no. 2, assigning the trace number 9 to it. DISP:WIND2:TRAC9:Y:RLEV -10 Or: DISP:WIND2:TRAC9:Y:RLEV -10, 'CH4TR1' Change the reference level to -10 dB.		
Manual control:	See "Ref Va	lue" on page 189	

DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:Y[:SCALe]:RPOSition <RefPosition>[, <TraceName>]

Sets the point on the y-axis to be used as the reference position as a percentage of the length of the y-axis. The reference position is the point on the y-axis which should equal the RLEVel.

### Suffix:

<Wnd>

Number of an existing diagram area (defined by means of DISPlay[:WINDow<Wnd>]:STATE ON). This suffix is ignored if the optional <TraceName> parameter is used.

<wndtr></wndtr>	Existing trace number, assigned by means of DISPlay[: WINDow <wnd>]:TRACe<wndtr>:FEED. This suffix is ignored if the optional <tracename> parameter is used.</tracename></wndtr></wnd>	
Parameters: <refposition></refposition>	Value of the reference position in percent. The top of the y-axis is defined to have a reference position of 100%, while the bottom of the y-axis is defined to have a reference position of 0%. Range: 0% to 100% *RST: 80% Default unit: %	
<tracename></tracename>	Optional string parameter for the trace name, e.g. 'Trc4'. If this optional parameter is present, both numeric suffixes are ignored (trace names must be unique across different channels and windows).	
Example:	<ul> <li>CALC4:PAR:SDEF 'Ch4Tr1', 'S11'</li> <li>Create channel 4 and a trace named Ch4Tr1 to measure the input reflection coefficient S<sub>11</sub>.</li> <li>DISP:WIND2:STAT ON</li> <li>Create diagram area no. 2.</li> <li>DISP:WIND2:TRAC9:FEED 'CH4TR1'</li> <li>Display the generated trace in diagram area no. 2, assigning the trace number 9 to it.</li> <li>DISP:WIND2:TRAC9:Y:RPOS 50</li> <li>or:</li> <li>DISP:WIND2:TRAC:Y:RPOS 50, 'CH4TR1'</li> <li>Set the reference position to the center of the diagram area.</li> </ul>	
Manual control:	See "Ref Position" on page 189	

## DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:Y[:SCALe]:BOTTom <LowEdge>[, <TraceName>] DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:Y[:SCALe]:TOP <UppEdge>[,

#### <TraceName>]

These commands define the lower (bottom) and upper (top) edge of the diagram area  $<\!\!\mathbb{W}nd\!\!>$ .

## Suffix:

Number of an existing diagram area (defined by means of DISPlay[:WINDow <wnd>]:STATE ON). This suffix is ignored the optional <tracename> parameter is used.</tracename></wnd>	
Existing trace number, assigned by means of DISPlay[: WINDow <wnd>]:TRACe<wndtr>:FEED. This suffix is ignored if the optional <tracename> parameter is used.</tracename></wndtr></wnd>	
1	

Parameters: <uppedge></uppedge>	<ul> <li>Value and unit for the lower or upper diagram edge. Range and unit depend on the measured quantity, see "Units for DISPlay commands" on page 608.</li> <li>*RST: Depending on the measured quantity. The default lower edge for a dB Mag diagram is -80 dB. The default upper edge is +20 dB.</li> </ul>	
	Default unit: dB	
<tracename></tracename>	Optional string parameter for the trace name, e.g. 'Trc4'. If this optional parameter is present, both numeric suffixes are ignored (trace names must be unique across different channels and windows).	
Example:	CALC4:PAR:SDEF 'Ch4Tr1', 'S11' Create channel 4 and a trace named Ch4Tr1 to measure the input reflection coefficient S <sub>11</sub> . DISP:WIND2:STAT ON Create diagram area no. 2. DISP:WIND2:TRAC9:FEED 'CH4TR1' Display the generated trace in diagram area no. 2, assigning the trace number 9 to it. DISP:WIND2:TRAC9:Y:BOTT -40; TOP 10 or: DISP:WIND2:TRAC9:Y:BOTT -40, 'CH4TR1'; TOP 10, 'CH4TR1' Scale the diagram between -40 dB and +10 dB.	
Manual control:	See "Max / Min" on page 190	

# DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM[:STATe] <Boolean>[, <TraceName>]

Applies or disables the zoom function based on the current zoom window settings.

Suffix: <wnd></wnd>	Number of an existing diagram (defined by means of DISPlay[:WINDow <wnd>]:STATe ON). This suffix is ignored if the optional <tracename> parameter is used.</tracename></wnd>
<wndtr></wndtr>	Existing trace number, assigned by means of DISPlay[: WINDow <wnd>]:TRACe<wndtr>:FEED. This suffix is ignored if the optional <tracename> parameter is used.</tracename></wndtr></wnd>
Parameters: <boolean></boolean>	Enable or disable the zoom. OFF also restores the original dia- gram size after a zoom function was applied. OFF

<TraceName> Optional string parameter for the trace name, e.g. 'Trc4'. If this
optional parameter is present, both numeric suffixes are ignored
(trace names must be unique across different channels and windows).

Example: \*RST; :DISPlay:WINDow1:TRACe:ZOOM:BOTTom -20;

	RS1, .DISTING.WINDOWI.INGGC.ZOOM.DOTION 20,			
	TOP +10; STARt 1GHz; STOP 1.5 GHz			
	Define a zoom rectangle in the default diagram no. 1 ranging from			
	-20 dB to +10 dB and from 1 GHz to 1.5 GHz.			
	DISPlay:WINDow1:TRACe:ZOOM ON			
	Zoom into the diagram no. 1 so that the zoom window fills the entire diagram. The actual sweep range and the stimulus values			
	of the sweep points are not affected.			
DISPlay:WINDow1:OVERview:STATe ON	DISPlay:WINDow1:OVERview:STATe ON			
	Activate an additional overview window in the upper part of the			
diagram.	diagram.			
Manual control:	See "Zoom Reset" on page 191			

DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM:STARt <LeftBorder>[,

<TraceName>]

```
DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:ZOOM:STOP <RightBorder>[, 
<TraceName>]
```

These commands specify the start and stop values of the zoom window (left and right border), respectively. In contrast to manual control, all or part of the zoom window may be outside the original diagram. The range of possible values depends on the R&S ZNB's frequency range; see chapter 6.3.14.10, "[SENSe:]FREQuency...", on page 736.

<wnd></wnd>	Number of an existing diagram (defined by means of DISPlay[:WINDow <wnd>]:STATE ON). This suffix is ignored in the optional <tracename> parameter is used.</tracename></wnd>		
<wndtr></wndtr>	Existing trace number, assigned by means of DISPlay[: WINDow <wnd>]:TRACe<wndtr>:FEED. This suffix is ignored i the optional <tracename> parameter is used.</tracename></wndtr></wnd>		
Parameters:			
<rightborder></rightborder>	Left or right border of the zoom window.		
	Range:See description above.*RST:Start or stop of the analyzer's sweep range.Default unit:Hz		
<tracename></tracename>	Optional string parameter for the trace name, e.g. 'Trc4'. If this optional parameter is present, both numeric suffixes are ignored (trace names must be unique across different channels and windows).		
Example:	See DISPlay[:WINDow <wnd>]:TRACe<wndtr>:ZOOM[: STATe]</wndtr></wnd>		
Manual control:	See "Max / Min / Start / Stop" on page 192		

630

DISPlay[:WINDow <tracename< th=""><th>-</th><th>WndTr&gt;:ZOOM:BOTTom <lowedge>[,</lowedge></th></tracename<>	-	WndTr>:ZOOM:BOTTom <lowedge>[,</lowedge>
	<wnd>]:TRACe&lt;</wnd>	WndTr>:ZOOM:TOP <uppedge>[,</uppedge>
		nd upper edge of the zoom window. In contrast to n window may be outside the original diagram.
Suffix: <wnd></wnd>	DISPlay[:WI	existing diagram (defined by means of NDow <wnd>]:STATE ON). This suffix is ignored if raceName&gt; parameter is used.</wnd>
<wndtr></wndtr>	Existing trace number, assigned by means of DISPlay[: WINDow <wnd>]:TRACe<wndtr>:FEED. This suffix is ignored if the optional <tracename> parameter is used.</tracename></wndtr></wnd>	
Parameters:		
<uppedge></uppedge>	Range: <i -8</i 	r edge of the zoom window. _owEdge>: -390 dB to +9.99 dB; <uppedge>: 9.99 dB to +232 dB _owEdge&gt;: -90 dB; <uppedge>: +10 dB 3</uppedge></uppedge>
<tracename></tracename>	Optional string parameter for the trace name, e.g. 'Trc4'. If this optional parameter is present, both numeric suffixes are ignored (trace names must be unique across different channels and windows).	
Example:	<b>See</b> DISPlay STATe]	[:WINDow <wnd>]:TRACe<wndtr>:ZOOM[:</wndtr></wnd>
Manual control:	See "Max / Mir	n / Start / Stop" on page 192

## 6.3.6 FORMat Commands

The FORMAT... commands select a data format for transferring numeric data (including arrays) from and to the analyzer.

FORMat:BORDer
FORMat[:DATA]

## FORMat:BORDer <ByteOrder>

Controls whether binary data is transferred in normal or swapped byte order.

Parameters: <byteorder></byteorder>	NORMal   S	SWAPped
	SWAPped - the least significant byte is transferred first (little endian). NORMal - the most significant byte is transferred first (big endian).	
	*RST:	SWAPped (if the GPIB Language is set to PNA or HP xxxx, then the order is NORMal)
Example:	FORM: BORI	D NORM byte order to normal mode.
Manual control:	See "Define	e *IDN? + *OPT?" on page 432

# FORMat[:DATA] <TransferFormat>[, <Length>]

Selects the format for numeric data transferred to and from the analyzer.

**Note:** The format setting is only valid for commands and queries whose description states that the response is formatted as described by FORMat[:DATA]. In particular, it affects trace data transferred by means of the commands in the TRACe:... system.

#### Parameters:

<transferformat></transferformat>	ASCii   REAL	
	ASCii - numeric data is transferred as ASCII bytes. The numbers are separated by commas as specified in IEEE 488.2. REAL - Data is transferred in a definite length block as IEEE float- ing point numbers of the specified <length>. See chapter 5.2.3.5, "Block Data Format", on page 464. <b>Note:</b> If binary data is transferred to the analyzer, the receive ter- minator should be set to EOI (SYSTem:COMMunicate:GPIB[: SELF]:RTERminator EOI) to avoid inadvertent interruption of the data transfer.</length>	
<length></length>	The optional <length> parameter is needed for REAL format only. It defines the length of the floating point numbers in bits. Valid values are 32 and 64.</length>	
	*RST: ASCII. The default length of REAL data is 32 bits (single precision).	
Example:	FORM REAL, 32 Select real data format. SYST:COMM:GPIB:RTER EOI	
	SIST:COMM:GPIB:RTER EOI Set the terminator to EOI.	
	(During a calibration) CORR:CDAT?	
	'REFLTRACK',1,0	
	Query a system error correction term. The data is transferred in a definite length block which can be written to a file; the analyzer displays the message " <no> bytes binary data received".</no>	

User Manual 1173.9163.02 - 13

# 6.3.7 HCOPy Commands

The HCOPY... commands control the output of screen information to an external device. Part of the functionality of this system is included in the "File" menu.

HCOPy:DESTination	633
HCOPy:DEVice:LANGuage	
HCOPy:ITEM:ALL.	
HCOPy:ITEM:LOGO[:STATe]	
HCOPy:ITEM:MLISt[:STATe]	
HCOPy:ITEM:TIME[:STATe]	
HCOPy:PAGE:COLor	
HCOPy:PAGE:MARGin:BOTTom	
HCOPy:PAGE:MARGin:LEFT	
HCOPy:PAGE:MARGin:RIGHt	
HCOPy:PAGE:MARGin:TOP	
HCOPy:PAGE:ORIentation	
HCOPy:PAGE:WINDow	
HCOPy[:IMMediate]	

### HCOPy:DESTination <PrinterName>

Selects a printer name or file as destination for the screen output.

# Parameters:

<printername></printername>	String variable containing the printer name. One of the printers accessible from your PC. The following strings are supported in addition: 'MMEM' - print to file. The file name is defined via MMEMory:NAME. The command HCOPy:DEVice:LANGuage selects the file format. 'DEFPRT' - use default printer, to be selected in the "Printers and Faxes" dialog of the Windows control panel. 'RST: n/a (*RST does not overwrite the printer destination)
Example:	<pre>MMEM:NAME 'C:\Screenshots\PLOT1.BMP' Define a printer file name (without creating the file), assuming that .BMP is the current file format (see HCOPy:DEVice: LANGuage). HCOP:DEST 'MMEM'; :HCOP Select 'Print to file' and create the printer file specified before.</pre>
Manual control:	See "To File" on page 149

# HCOPy:DEVice:LANGuage <Format>

Selects a file format for printer files. Selecting the format is recommended to ensure that the file defined via MMEMory: NAME can be read or imported by an external application.

Parameters:		
<format></format>	BMP   PNG   JPG   PDF   SVG	
	BMP - Windows bitmap	
	JPG - JPEG bitmap	
	PNG - portable network graphics format	
	PDF - portable document format (Adobe <sup>®</sup> Systems)	
	SVG - scalable vector graphics format, XML-based	
	*RST: n/a (*RST does not affect the printer configuration)	
Example:	HCOP:DEV:LANG BMP	
	Select Windows bitmap format for printer files.	
	MMEM:NAME 'C:\Screenshots\PLOT1.BMP'	
	Define a printer file name and specify an existing directory (without	
	creating the file).	
	HCOP:DEST 'MMEM'; :HCOP	
	Select 'Print to file' and create the printer file specified before.	

# HCOPy:ITEM:ALL

Selects the complete screen contents to be printed, including the logo (HCOPy:ITEM: LOGO[:STATe]), time (HCOPy:ITEM:TIME[:STATe]), and the marker list (HCOPy: ITEM:MLISt[:STATe]).

Example:	HCOP: ITEM: ALL Select the complete information to be printed. HCOP	
Usage:	Start printing. Event	

#### HCOPy:ITEM:LOGO[:STATe] <Boolean>

Qualifies whether or not the printed output contains the logo. The default R&S logo (file Logo.gif) is stored in the Resources\Images subdirectory of the VNA program directory and can be replaced by another logo.

# **Parameters:**

<boolean></boolean>	ON   OFF *RST:	ON   OFF - logo is included or excluded. *RST: n/a (*RST does not affect the printer configuration	
Example:	Select the HCOP:IT	HCOP:ITEM:ALL Select the complete information to be printed. HCOP:ITEM:LOGO ON; :HCOP Include the logo in the printed output and start printing.	

# HCOPy:ITEM:MLISt[:STATe] <Boolean>

Qualifies whether or not the printed output contains the information in the marker info field (marker list).

Parameters:	ON   OFF -	- marker list is included or excluded.
<boolean></boolean>	*RST:	n/a (*RST does not affect the printer configuration)
Example:	HCOP:ITE	M:ALL complete information to be printed. M:MLISt ON; :HCOP e marker list in the printed output and start printing.

# HCOPy:ITEM:TIME[:STATe] <Boolean>

Qualifies whether or not the printed output contains the current date and time.

Parameters:	ON   OFF - date and time is included or excluded.
<boolean></boolean>	*RST: n/a (*RST does not affect the printer configuration)
Example:	HCOP:ITEM:ALL Select the complete information to be printed. HCOP:ITEM:TIME ON; :HCOP Include the data and time in the printed output and start printing.

# HCOPy:PAGE:COLor <Boolean>

Enables color printing.

Dar	am	eters	2 '
гa	ann		<b>)</b> .

<boolean></boolean>	ON – print with color or grayscale (depending on the printer capa- bilities). OFF – use black-and-white printing using line styles to allow iden- tification of different traces.	
	*RST:	n/a (*RST does not affect the printer configuration)
Example:	HCOP: PAGE Be thrifty; ge	:COL OFF enerate black-and-white hardcopies.

# HCOPy:PAGE:MARGin:BOTTom <LowMargin>

Defines the distance between the bottom of the page and the bottom of the printed information.

# Parameters:

<lowmargin></lowmargin>	Lower margin	
	Range: *RST:	0.01 mm to 10000 mm n/a (*RST does not affect the printer configuration)
Example:		E:MARG:BOTT 10; TOP 10 er and a lower margin of 1 cm.

#### HCOPy:PAGE:MARGin:LEFT <LeftMargin>

Defines the distance between the left edge of the page and the left edge of the printed information.

Parameters: <pre><leftmargin></leftmargin></pre>	Left margin	
	Range: *RST:	0.01 mm to 10000 mm n/a (*RST does not affect the printer configuration)
Example:		:MARG:LEFT 10; RIGHT 10 nd a right margin of 1 cm.

# HCOPy:PAGE:MARGin:RIGHt <RightMargin>

Defines the distance between the right edge of the page and the right edge of the printed information.

Parameters: <rightmargin></rightmargin>	Right margi	n
	Range: *RST:	0.01 mm to 10000 mm n/a (*RST does not affect the printer configuration)
Example:		E:MARG:LEFT 10; RIGHT 10 and a right margin of 1 cm.

# HCOPy:PAGE:MARGin:TOP < UppMargin>

Defines the distance between the top of the page and the top of the printed information.

Parameters:	Upper marg	Jpper margin	
	Range: *RST:	0.01 mm to 10000 mm n/a (*RST does not affect the printer configuration)	
Example:		E:MARG:BOTT 10; TOP 10 er and a lower margin of 1 cm.	

#### HCOPy:PAGE:ORIentation <Orientation>

Defines the orientation of the printed page. Switching between LANDscape and PORTrait rotates the hardcopy result by 90 degrees. No other settings are changed.

Parameters:	
<orientation></orientation>	LANDscape   PORTrait
	PORTrait - short edge of the paper is the top of the page.LANDscape - long edge of the paper is the top of the page.*RST:n/a (*RST does not affect the printer configuration)
Example:	HCOP: PAGE: ORI LAND; : HCOP Select landscape page orientation and start printing.

# HCOPy:PAGE:WINDow <PrintDiagram>

Defines the number of diagrams per printed page.

# **Parameters:**

<printdiagram></printdiagram>	ALL   SINGle   ACTive   NONE	
	NONE - print no diagram at all. ALL - all diagrams are printed on one page. SINGle - one diagram per page. ACTive - print only active diagram.	
	*RST: n/a (*RST does not affect the printer configuration)	
Example:	HCOP:PAGE:WIND SING; :HCOP Select one diagram per page and start printing.	

# HCOPy[:IMMediate]

Initializes the print according to the current HCOPy... configuration.

Example:	HCOP:DEST ' <printer_name>'</printer_name>
	Select the printer for the output of screen data.
	HCOP
	Start printing.
Usage:	Event
Manual control:	See "Print ( <printer>)" on page 147</printer>

# 6.3.8 INITiate Commands

The INITiate... commands control the initiation of the trigger system and define the scope of the triggered measurement.

INITiate <ch>:CONTinuous</ch>	637
INITiate:CONTinuous:ALL.	638
INITiate[:IMMediate]:ALL	639
INITiate <ch>[:IMMediate][:DUMMy]</ch>	
INITiate <ch>[:IMMediate]:SCOPe</ch>	

# INITiate<Ch>:CONTinuous <Boolean>

Qualifies whether the analyzer measures in single sweep or in continuous sweep mode.

# Suffix:

<ch></ch>	Channel number. This suffix is ignored in the "ZVR" and "ZVABT"
	compatibility modes (SYSTem:LANGuage 'ZVR'   'ZVABT').

Parameters: <boolean></boolean>	<pre>ON - the analyzer measures continuously, repeating the current sweep. OFF - the measurement is stopped after the number of sweeps defined via [SENSe<ch>:]SWEep:COUNt.INITiate<ch>[: IMMediate][:DUMMy] initiates a new measurement cycle. *RST: ON</ch></ch></pre>
Example:	<pre>*RST; :CALC2:PAR:SDEF 'TRC2','S11' DISPlay:WINDow:TRACe2:FEED 'Trc2' Reset the analyzer to create the default channel no. 1 and default trace. Create a second trace and display the trace. Both traces are measured continuously. INIT1:CONT OFF Activate single sweep mode for the first channel. The measure- ment in channel no. 1 is stopped after the current sweep. Channel no. 2 is still measured continuously. INIT1 Activate a new (single) sweep in channel no. 1. Channel no. 2 is still measured continuously. INIT:CONT:ALL OFF Activate single sweep mode for all channels. The measurement in channel no. 2 is also stopped after the current sweep. INIT:ALL Re-start a single sweep in both channels.</pre>
Example:	Alternative settings using the R&S ZVAB compatibility mode: *RST; :SYSTem:LANGuage 'ZVABT' *RST; :INIT:CONT OFF Activate single sweep mode for all channels (including channel no. 2 created later). INIT:SCOP SING State that a single sweep will be performed in the active channel. CALC2:PAR:SDEF 'TRC2', 'S11'; :INIT2 Create channel no. 2 with a new trace and start a single sweep in channel no. 2. Activate single sweep mode for all channels, start a single sweep in the second channel.
Manual control:	See "Continuous / Single" on page 276

# INITiate:CONTinuous:ALL <Boolean>

Qualifies whether the analyzer measures in single sweep or in continuous sweep mode.

This command is not supported in the "ZVR" or "ZVABT" compatibility modes.

<b>Parameters:</b> <boolean></boolean>	ON - the analyzer measures continuously in all channel, repeating the current sweep. The query returns ON (1) if at least one channel is measured continuously. OFF - the measurement is stopped after the number of sweeps defined via [SENSe <ch>:]SWEep:COUNt.INITiate<ch>[: IMMediate][:DUMMy] initiates a new measurement cycle. *RST: ON</ch></ch>
Example:	See INITiate <ch>:CONTinuous</ch>
Manual control:	See "All Channels Continuous / on Hold" on page 277

# INITiate[:IMMediate]:ALL

Starts a new single sweep sequence in all channels. This command is available in single sweep mode only (INITiate:CONTINUOUS:ALL OFF). The data of the last sweep (or of previous sweeps, see Retrieving the Results of Previous Sweeps) can be read using CALCulate<Chn>:DATA:NSWeep:FIRSt? SDATa, <count>.

This command is not supported in the "ZVR" or "ZVABT" compatibility modes.

**Note:** In contrast to all other commands of the analyzer, the INITiate<Ch>[:IMMediate]... commands have been implemented for overlapped execution; see chapter 5.4, "Command Processing", on page 469.

Example:	See INITiate <ch>:CONTinuous</ch>
Usage:	Event
Manual control:	See "Restart Sweep" on page 277

# INITiate<Ch>[:IMMediate][:DUMMy]

Starts a new single sweep sequence. This command is available in single sweep mode only (INITiate<Ch>: CONTinuous OFF). The data of the last sweep (or previous sweeps, see chapter 7.2.4.3, "Retrieving the Results of Previous Sweeps", on page 910) can be read using CALCulate<Chn>: DATA:NSWeep:FIRSt? SDATa, <count>.

**Note:** In contrast to all other commands of the analyzer, the

INITiate<Ch>[:IMMediate]... commands have been implemented for overlapped execution; see chapter 5.4, "Command Processing", on page 469.

Suffix: <ch></ch>	Channel number. If the channel number does not exist the analyzer returns an error message. If the "ZVR" or "ZVABT" compatibility mode is active and INITiate <ch>[:IMMediate]: SCOPe ALL is selected, this suffix is ignored.</ch>
Example:	See INITiate <ch>:CONTinuous</ch>
Usage:	Event

Manual control: See "Restart Sweep" on page 277

# INITiate<Ch>[:IMMediate]:SCOPe <Scope>

Selects the scope of the single sweep sequence. The setting is applied in single sweep mode only (INITiate<Ch>: CONTinuous OFF).

This command is needed in the "ZVR" and "ZVABT" compatibility modes only (
SYSTem:LANGuage 'ZVR' | 'ZVABT').

# Suffix:

<ch></ch>	Channel number. The channel is ignored because the command affects all channels.
Parameters:	
<scope></scope>	ALL   SINGle
	<pre>INITiate<ch>[:IMMediate][:DUMMy] starts a single sweep in all channels or in the referenced channel <ch> only.</ch></ch></pre>
Example:	See INITiate <ch>:CONTinuous</ch>
Manual control:	See "Sweep All Channels" on page 278

# 6.3.9 INSTrument Commands

The INSTrument... commands select or query particular resources (SCPI: logical instruments) of the analyzer.

INSTrument:NSELect	640
INSTrument:PORT:COUNt?	640
INSTrument:TPORt:COUNt?	641
INSTrument:SMATrix	

# INSTrument:NSELect <Channel>

Selects a channel as the active channel.

# Parameters:

<channel></channel>	Number of the channel to be activated. The channel must be cre- ated before using CONFigure:CHANnel <ch>[:STATe] ON.</ch>		
	Range: *RST:	1, 2, 1	
Example:		N2:STAT ON; :INST:NSEL? nnel no. 2 and select it as the active channel. The query	

# INSTrument:PORT:COUNt?

Returns the number of test ports (Port 1, Port 2 ...) of the analyzer.

SCPI Command Reference

 Example:
 INST: PORT: COUN?

 Return the number of ports of your analyzer.

 Usage:
 Query only

# INSTrument:TPORt:COUNt?

Returns the total number of test ports.

In absence of switch matrices, i.e. if no RF connection to a switch matrix is configured, this is identical to the number of VNA ports (see INSTrument:PORT:COUNT? on page 640).

With switch matrices, the return value is the total number of matrix test ports and VNA ports that are assigned to a (DUT) test port.

Usage: Query only

#### INSTrument:SMATrix <Boolean>

In "set direction" this command perfoms a default setup or "clear" of the switch matrix RF connections; in "get direction" it queries whether at least one RF connection to a switch matrix is configured.

# Parameters:

<boolean></boolean>	ON   1 (setting) – adds all registered switch matrices to the RF configuration, performing a default assignment of VNA ports and test ports.
	OFF   0 (setting) – removes all switch matrices from the RF con- figuration
	1 (query) – at least one RF connection to a switch matrix 0 (query) – no RF connection to a switch matrix

# 6.3.10 MEMory

The MEMory... commands control the loaded recall sets of the analyzer.



#### Storing setups

The MEMory... commands don't affect any stored files. Use the MMEMory... commands to store and load data and to manage files stored on a mass storage device.

MEMory:CATalog?	642
MEMory:DEFine	
MEMory:DELete:ALL	
MEMory:DELete[:NAME]	
MEMory:SELect	

# MEMory:CATalog?

Returns the names of all loaded recall sets.

Example:	<pre>*RST; :MEM:DEF 'SET_2' Create a recall set named 'Set_2' and make it the active recall set. MEM:CAT? Query all recall sets. The response is 'Set1, SET_2'. MMEM:STOR:STAT 1, 'C:\Users\Public\ Documents\Rohde-Schwarz\Vna\RecallSets\Set_2.znx' MEM:DEL 'Set_2.znx' Store the active recall set Set_2 to a file, renaming it Set_2.znx. Close the setup.</pre>
Usage:	Query only

# MEMory:DEFine <Name>

Creates a new recall set <Name> using default settings for the traces, channels and diagram areas. The created recall set becomes the active recall set.

Setting	parameters:
---------	-------------

<name></name>	String parameter to specify the name of the created recall set.	
Example:	See MEMory: CATalog?	
Usage:	Setting only	
Manual control:	See "New" on page 143	

# MEMory:DELete:ALL

Deletes all loaded recall sets.

Example:	MEM:DEL:ALL; :MEM:CAT?
	Delete all recall sets. The query MEM: CAT? returns an empty
	string. The local screen shows no recall set.
Usage:	Event

# MEMory:DELete[:NAME] <Name>

Closes the specified recall set.

#### Setting parameters:

<Name> String parameter to specify the name of the recall set to be closed.
Example: See MEMory:CATalog?
Usage: Setting only

#### MEMory:SELect <Name>

Selects a recall set as the active recall set.

## Setting parameters:

<name></name>	String parameter to specify the recall set.	

Example: \*RST; :MEM:DEF 'SET 2'

Create a recall set named "SET_2" and make it the active recall
set.
MEM:SEL 'Set1'
Activate the default recall set "Set1".
MMEM:STOR:STAT 1, 'C:\Users\Public\
$Documents\Rohde-Schwarz\Vna\RecallSets\$
Set1.znx'; :MEM:DEL 'Set1.znx'
Store the active recall set "Set1" to a file, renaming it Set1.znx.
Close the recall set.
Setting only

# 6.3.11 MMEMory Commands

The MMEMory... commands provide mass storage capabilities for the analyzer.

### Internal and external mass storage

The mass storage of the analyzer may be internal or external. The internal mass storage location is either the public folder or the instrument folder of the internal hard disk (C:\Users\Public or C:\Users\Instrument, see below). The external mass storage device can be a USB memory stick connected to one of the USB ports (mapped to any free drive letter) or a network connection.

# File and directory names

The parameters for file names and directory names are strings. Some commands use a fixed directory; for others the file name parameter can contain the complete path including the drive name and all subdirectories, e.g. 'C:\Users\Public\test.txt' for the file named test.txt in the Users\Public subdirectory of the internal hard disk drive C:\. If no complete path is specified, the file location is relative to the current directory (queried with MMEMory:CDIRectory). The file name itself may contain the period as a separator for extensions.

File and directory names can be chosen according to Windows<sup>®</sup> conventions. All letters and numbers are allowed, as well as the special characters "\_", "^", "\$", "<", "!", "#", "%", "&", "-", "{", "}", "(", ")", "@" and "`". Reserved file names are CON, AUX, COM1, ..., COM4, LPT1, ..., LPT3, NUL and PRN. The use of wildcards ? and \* is not allowed.

# Public folders in Windows® 7 and default file locations

In order to achieve maximum system security, most of the folders on the internal hard disk are read-only folders. Only the following folders can be changed:

- C:\Users\Public
- C:\Users\Instrument

The public and instrument folders may be used to store user data. To simplify this task, the public folder contains predefined subfolders; e.g. the subfolder C:\Users\Public\Documents\Rohde-Schwarz\Vna\Calibration\Kits is intended for calibration kit data. The subfolder structure is similar to R&S ZVA/B instruments, however, the R&S ZVA/B default path C:\Rohde&Schwarz\Nwa is replaced by C:\Users\Public\Documents\Rohde-Schwarz\Vna.

	0.45
MMEMory:AKAL:FACTory:CONVersion	
MMEMory:AKAL:USER:CONVersion	
MMEMory:CATalog?	
MMEMory:CATalog:ALL?	
MMEMory:CDIRectory	
MMEMory:COPY	
MMEMory:DATA	
MMEMory:DELete	
MMEMory:DELete:CORRection	
MMEMory:LOAD:CKIT	
MMEMory:LOAD:CKIT:SDATa	
MMEMory:LOAD:CKIT:UDIRectory	
MMEMory:LOAD:CMAP	
MMEMory:LOAD:CORRection	
MMEMory:LOAD:CORRection:MERGe	
MMEMory:LOAD:CORRection:RESolve	653
MMEMory:LOAD:CORRection:TCOefficient	
MMEMory:LOAD:LIMit	654
MMEMory:LOAD:RIPPIe	
MMEMory:LOAD:SEGMent	657
MMEMory:LOAD:STATe	658
MMEMory:LOAD:TRACe	658
MMEMory:LOAD:VNETworks <ch>:BALanced:DEEMbedding<logpt></logpt></ch>	659
MMEMory:LOAD:VNETworks <ch>:BALanced:EMBedding<logpt></logpt></ch>	660
MMEMory:LOAD:VNETworks <ch>:SENDed:DEEMbedding<phypt></phypt></ch>	661
MMEMory:LOAD:VNETworks <ch>:SENDed:EMBedding<phypt></phypt></ch>	662
MMEMory:MDIRectory	662
MMEMory:MOVE	663
MMEMory:NAME	
MMEMory:RDIRectory	
MMEMory:STORe:CKIT	664
MMEMory:STORe:CKIT:WLABel	664
MMEMory:STORe:CMAP	665
MMEMory:STORe:CORRection	
MMEMory:STORe:CORRection:TCOefficient	
MMEMory:STORe:LIMit	666
MMEMory:STORe:MARKer	
-	

SCPI Command Reference

MMEMory:STORe:RIPPle	
MMEMory:STORe:SEGMent	
MMEMory:STORe:STATe	
MMEMory:STORe:TRACe	
MMEMory:STORe:TRACe:CHANnel	
MMEMory:STORe:TRACe:PORTs	
	-

# MMEMory:AKAL:FACTory:CONVersion <Directory>

Converts the factory calibration data of the standards in the active calibration unit ( SYSTem:COMMunicate:RDEVice:AKAL:ADDRess) to Touchstone format and copies it to the specified directory.

# Setting parameters:

<directory></directory>	String parameter to specify the directory.
Example:	<pre>MMEM:AKAL:FACTory:CONVersion 'C:\Users\Public\ Documents\Rohde-Schwarz\Vna\AKAL\Touchstone' Convert and copy the factory calibration data of the active calibration unit to the specified (writable) directory.</pre>
Usage:	Setting only
Manual control:	See "Apply/Cancel" on page 287

# MMEMory:AKAL:USER:CONVersion <Directory>[, <CalKitFile>]

Converts an arbitrary (e.g. user-defined) set of calibration data of the standards in the active calibration unit (SYSTem:COMMunicate:RDEVice:AKAL:ADDRess) to Touch-stone format and copies it to the specified directory.

#### Setting parameters:

<directory></directory>	String parameter to specify the directory.
<calkitfile></calkitfile>	Name and (possibly) directory of the cal kit file to be used for the automatic calibration (optional string parameter): – If the parameter is omitted, the analyzer uses the last characterized cal kit file. – If an empty string (' ') is specified, the factory cal kit file stored in the active calibration unit (SYSTem:COMMunicate: RDEVice:AKAL:ADDRess) is used. By default this file is also used in manual control.
	<ul> <li>A cal kit file name *.calkit without path denotes a specific cal kit file stored in the active calibration unit.</li> <li>A cal kit file name *.calkit with path denotes a specific cal kit file stored in an arbitrary directory.</li> </ul>

Example:	<pre>MMEM:AKAL:USER:CONV 'C:\Users\Public\ Documents\Rohde-Schwarz\Vna\AKAL\Touchstone' Convert and copy the calibration data of the standards of the last characterized cal kit to the specified (writable) directory. MMEM:AKAL:USER:CONV 'C:\Users\Public\ Documents\Rohde-Schwarz\Vna\AKAL\Touchstone', 'user.calkit' Convert and copy the calibration data of the standards of the user- defined cal kit 'user.calkit' to the specified directory.</pre>
Usage:	Setting only
Manual control:	See "Apply/Cancel" on page 287

# MMEMory:CATalog? [<Directory>]

Returns the contents of the current or of a specified directory. The directory information is returned in the following format:

<Used Size>, <FreeDiskSpace>{,<FileEntry>}{,<DirectoryEntry>}

The information elements indicate the following:

- <Used Size> disk space in bytes used by the listed files, excluding subdirectories
- <FreeDiskSpace> available free disk space in bytes
- <FileEntry> file name, (blank), file size in bytes
- <DirectoryEntry> directory name, <Dir>, (blank)

**Tip:** Use MMEMory: CATalog: ALL? to query the contents of the current directory and all subdirectories.

# Parameters:

<directory></directory>	String parameter to specify the directory. If the directory is omitted, the command queries the contents of the current directory, to be queried with MMEMory: CDIRectory?.
Example:	<pre>MMEM:CAT? Possible response: 0, 771604480, calibration, <dir>, , colorschemes, <dir>, ,</dir></dir></pre>
Usage:	Query only

#### MMEMory:CATalog:ALL? [<Directory>]

Returns the contents of the current or of a specified directory and all subdirectories. The information is returned in the following format:

Directory of <Directory>, <Used Size>, <FreeDiskSpace>{,<FileEntry>}{,<DirectoryEntry>}{,Directory of <Subdirectory>, <Used Size>, <FreeDiskSpace>{,<FileEntry>} {,<DirectoryEntry>}}

See also MMEMory: CATalog?.

**Tip:** Use MMEMory: CATalog? to query the contents of the current directory.

Parameters: <directory></directory>	String parameter to specify the directory path. If the directory is omitted, the command queries the contents of the current directory, to be queried with MMEMory: CDIRectory?
Example:	<pre>MMEM:CAT:ALL? Possible response: Directory of C:\Users\Public\Documents\ Rohde-Schwarz\Vna0, 2283155456, calibration, <dir>, , colorschemes, <dir>, , hardcopy, <dir>, , limitlines, <dir>, ,</dir></dir></dir></dir></pre>
Usage:	Query only

# MMEMory:CDIRectory <Directory>

Changes the default directory for mass memory storage.

# Parameters:

<directory></directory>	String parameter to specify the directory. If DEFault is used, the analyzer selects the default directory 'C:\Users\Public\Documents\Rohde-Schwarz\Vna'.
Example:	MMEM:CDIR 'C: \Users\Public\NetworkService\Application Data' Change to the specified directory. See also condensed program example in section Path Independ- ent RC Programs.

# MMEMory:COPY <SourceFile>, <NewFile>

Copies an existing file to a new file.

# Setting parameters:

<SourceFile>

<newfile></newfile>	String parameters to specify the name of the file to be copied and the name of the new file.
	*RST: n/a
Example:	MMEM:COPY 'C:\Users\Public\Documents\ Rohde-Schwarz\Vna\RecallSets\SET1.znx','D:' Copy file Set1.znx in directory C:\Users\Public\Documents\Rohde-Schwarz\Vna\ RecallSets to the external storage medium, mapped to drive D:\.
Usage:	Setting only

# MMEMory:DATA <Filename>[, <DataBlock>]

Loads a <DataBlock> into the file <FileName>.

Parameters: <filename></filename>	String parameter to specify the name of the file.
<datablock></datablock>	<block_data> Data in IEEE488.2 block data format. The delimiter EOI must be selected to achieve correct data transfer.</block_data>
Example:	MMEM:DATA? 'C:\Users\Public\TEST01.HCP' Query the block data contained in file TEST01.HCP.

# **MMEMory:DELete** <File>[, <Force>]

Removes a file from the specified directory

Setting paramet <file></file>	Mandatory string parameter containing the path and file name of the removed file. If the path is omitted, the current directory is used (see MMEMory: CDIRectory).
<force></force>	FORCe Optional parameter, allows you to delete read-only files, too.
Example:	MMEM:DEL 'C:\Users\Public\TEST01.HCP' Remove file TEST01.HCP from the directory C: \Users\Public. The file must not be read-only; otherwise the additional parameter FORCe is required.
Usage:	Setting only

# MMEMory:DELete:CORRection <CalGroupName>

Deletes a system error correction data set stored in the cal pool (cal group file).

# Setting parameters:

<calgroupname></calgroupname>	String parameter to specify the name of the cal group file to be deleted. Cal group files must have the extension *.cal. The directory path must not be specified; the analyzer always uses the default cal pool directory 'C: \Users\Public\Documents\Rohde-Schwarz\Vna\ Calibration\Data'.
Example:	See MMEMory:LOAD:CORRection
Usage:	Setting only
Manual control:	See "Pool / Delete from Pool" on page 358

# MMEMory:LOAD:CKIT <CalKitFile>

Loads cal kit data from a specified R&S ZNB cal kit file.

#### Setting parameters:

<calkitfile></calkitfile>	<pre>String parameter to specify the name and directory of the loaded cal kit file. If no path is specified the analyzer searches the current directory, to be queried with MMEMory:CDIRectory?.</pre> Note: The loaded file must be a R&S ZNB-specific cal kit file with the extension *.calkit. R&S ZVR cal kit files can be imported using the [SENSe:]CORRection:CKIT:INSTall command. Agilent cal kit files can be imported manually and converted into *.calkit files.
Example:	<pre>MMEM:LOAD:CKIT 'C:\Users\Public\Documents \Rohde-Schwarz\Vna\Calibration\Kits\New_kit.calkit Load the previously created cal kit file New_kit.calkit from the default cal kit directory :MMEM:STOR:CKIT 'New_kit', 'C: \Users\Public\Documents \Rohde-Schwarz\Vna\Calibration\Kits\New_kit.calkit</pre>

Store the data for the user-defined cal kit Newkit and overwrite the cal kit file New\_kit.calkit.

Usage: Setting only

Manual control: See "Import Cal Kit" on page 292

**MMEMory:LOAD:CKIT:SDATa** <ConnectorType>, <CalKitName>, <StandardType>, <CalKitLabel>, <TouchstoneFile>[, <FirstPort>, <SecondPort>]

Loads cal kit data for a specific connector type, cal kit, and calibration standard from a specified Touchstone file, assigning a label for the cal data. A restriction on the port assignment may be defined in addition.

# Setting parameters:

<connectortype></connectortype>	String parameter	containing the nam	ne of the connector type.

<CalKitName> String parameter containing the name of a calibration kit available on the analyzer. <StandardType> MMTHrough | MFTHrough | FFTHrough | MMLine | MMLine1 | MMLine2 | MMLine3 | MFLine | MFLine1 | MFLine2 | MFLine3 | FFLine | FFLine1 | FFLine2 | FFLine3 | MMATten | MFATten |

FFATten | MMSNetwork | MFSNetwork | FFSNetwork | MOPen | FOPen | MSHort | FSHort | MOSHort | MOSHort1 | MOSHort2 | MOSHort3 | FOSHort | FOSHort1 | FOSHort2 | FOSHort3 | MREFlect | FREFlect | MMTCh | FMTCh | MSMatch | FSMatch

Standard types; for a description refer to table Standard types and their parameters .

<CalKitLabel> String parameter defining a label for the cal kit data. An empty string means that no label is defined.

User Manual 1173.9163.02 - 13

<TouchstoneFile> String parameter to specify the name and directory of the Touchstone file to be loaded. A \*.s1p file must be used for one-port standards, a \*.s2p file for two-port standards. If no path is specified the analyzer searches the current directory, to be queried with MMEMory: CDIRectory?. \*RST: <FirstPort> Fist port number (sufficient for one-port standards). If the port numbers are omitted, the cal kit data is valid for all ports. <SecondPort> Second port number, for two-port standards. If the port numbers are omitted, the cal kit data is valid for all ports. Example: MMEM:LOAD:CKIT:SDAT 'N 50 Ohm', 'Default Kit',MOPEN,'Test data','test.s1p',1 Load the file Test.s1p from the current directory in order to define the properties of an Open (m) standard in the cal kit named "Default Kit" for the N 50  $\Omega$  connector type. Assign the label "Test data" and specify that the standard data is valid for port no. 1 only. Usage: Setting only

Manual control: See "Import Cal Kit" on page 292

# Connector and cal kit naming conventions:

Connector and calibration kit names must be entered as string parameters. The strings contain the connector and cal kit names used in the Calibration Kits dialog; a  $\Omega$  in the name must be replaced by 'Ohm', e.g.:

- -'NewKit1' denotes the user-defined calibration kit "NewKit1".
- -'N 50 Ohm Ideal Kit' denotes the "N 50  $\Omega$  Ideal Kit".
- -'ZV-Z21 typical' denotes the cal kit "ZV-Z21 typical".

#### MMEMory:LOAD:CKIT:UDIRectory <Directory>

Specifies the "Search Path for Additional Cal Kits and Connector Types". All cal kit files in the specified directory will be (re-)loaded automatically as predefined kits (i.e. read-only kits which cannot be modified) every time the VNA application is started.

# Parameters:

<Directory>

String parameter to specify the directory path. The directory can be created separately (MMEMory:MDIRectory). An empty string means that no cal kit files will be loaded.

Example:	MMEM:LOAD:CKIT:UDIR 'C:\Users\Public\Documents
	\Rohde-Schwarz\Vna\Calibration\Kits\Autoload'
	Specifiy the directory for additionally available cal kits.
	MMEM:MDIR 'C:\Users\Public\Documents
	\Rohde-Schwarz\Vna\Calibration\Kits\Autoload'
	Create the specified "Autoload" directory.
	MMEM:STOR:CKIT 'New Kit 1', 'C:
	\Users\Public\Documents
	\Rohde-Schwarz\Vna\Calibration\Kits\Autoload
	\New Kit 1.calkit'
	Store the data for the existing, user-defined cal kit "New Kit 1" to the "Autoload" directory.
Manual control:	See "Search Path for Additional Cal Kits" on page 424

# MMEMory:LOAD:CMAP <ColorSchemeFile>

Loads a color scheme from a specified VNA color scheme file.

Setting parameters: <colorschemefile></colorschemefile>	String parameter to specify the name and directory of the color scheme file to be loaded. The default extension (manual control) for color scheme files is *.ColorScheme, although other exten- sions are allowed.
Example:	<pre>MMEM:LOAD:CMAP 'C:\Users\Public \Documents\Rohde-Schwarz\Vna\ColorSchemes\ Test.ColorScheme' Load the previously created color scheme file Test.ColorScheme from the default color scheme directory. DISP:CMAP13:RGB 1,0,0; :DISP:CMAP14:RGB 0,1,0 Color the first trace red, the second trace green. MMEM:STOR:CMAP 'C:\Users\Public \Documents\Rohde-Schwarz\Vna\ColorSchemes\ Test.ColorScheme' Store the data for the user-defined cal kit "Newkit" and overwrite the cal kit file New_kit.calkit.</pre>
Usage:	Setting only
Manual control:	See "Recall / Save" on page 419

# MMEMory:LOAD:CORRection <Channel>[, <CalGroupFile>]

Applies a system error correction data set stored in the cal pool (cal group file) to channel no. <Ch>>.

# Parameters:

<Channel> Channel number of an existing channel. ALL applies the selected data set to all channels.

<calgroupfile></calgroupfile>	String parameter to specify the name of the cal group file to be loaded. Cal group files must have the extension *.cal. The direc- tory path must not be specified; the analyzer always uses the default cal pool directory C:\Users\Public\Documents \Rohde-Schwarz\Vna\Calibration\Data.
Example:	<ul> <li>MMEM:STOR:CORR 1, 'Calgroup1.cal'</li> <li>Copy the current correction data set of channel 1 to a cal group file Calgroup1.cal.</li> <li>CONF:CHAN2:STAT ON; :MMEM:LOAD:CORR 2, 'Calgroup1.cal'</li> <li>Apply the stored correction data (cal group file) to channel 2.</li> <li>MMEM:LOAD:CORR? 2</li> <li>Query the cal group file for channel 2. Response:     'Calgroup1.cal'</li> <li>MMEM:LOAD:CORR:RES 2, 'Calgroup1.cal'</li> <li>Resolve the pool link between channel 2 and the cal group file.</li> <li>MMEM:LOAD:CORR? 2</li> <li>Query the cal group file for channel 2. Response: ''</li> <li>MMEM:LOAD:CORR? 2</li> <li>Query the cal group file for channel 2 and the cal group file.</li> <li>MMEM:LOAD:CORR? 1</li> </ul>
Manual control:	See "Add / Add All / Replace / Apply / Apply to All" on page 358

# **MMEMory:LOAD:CORRection:MERGe** <Channel>[, <CalGroupFile>, <CalGroupFile>...]

Merges (activates) several cal group files for channel no. <Channel> so that the query [SENSe<Ch>:]CORRection:COLLect:METHod:DEFine? returns a list of all merged calibration types (equivalent to the calibration pool list in the "Calibration Manager" dialog). The merged cal group files can be stored to a common file; see example.

# Setting parameters:

<Channel> Channel number of an existing channel

<CalGroupFile>

<CalGroupFile> String parameters with the names of the merged cal group files. Cal group files must have the extension \*.cal. The file extensions must be specified as part of the string parameters. In contrast the directory path must not be specified; the analyzer always uses the default path C:\Users\Public\Documents\Rohde-Schwarz\Vna\ CALibration\DATA.

SENS1:CORR:COLL:METH:DEF 'Test', FRTRans, 1, 3 Example: Select a bidirectional transmission normalization between ports 1 and 3 as a calibration type for channel 1. CORR:COLL:SAVE:SEL:DEF; :MMEM:STOR:CORR 1, 'P1-P3.cal' Create a default calibration data set for the selected calibration type and store the data to a cal group file. SENS1:CORR:COLL:METH:DEF 'Test', FRTRans, 1, 4 Select a bidirectional transmission normalization between ports 1 and 4 as a calibration type for channel 1. CORR:COLL:SAVE:SEL:DEF; :MMEM:STOR:CORR 1, 'P1-P4.cal' Create a default calibration data set for the selected calibration type and store the data to a cal group file. CORR:COLL:METH:DEF? Query the active calibrations for channel 1. The response is FRTR0104 (the last data set stored). MMEM:LOAD:CORR: MERGE 1, 'P1-P3.cal', 'P1-P4.cal'; :CORR:COLL: METH: DEF? Merge the two calibration types and query the active calibrations again. The response is FRTR0103, FRTR0104. MMEM:STOR:CORR 1, 'Merged.cal' Store both sets of calibration data to a common cal group file. Usage: Setting only Manual control: See "Add / Add All / Replace / Apply / Apply to All" on page 358

#### MMEMory:LOAD:CORRection:RESolve <Channel>[, <CalGroupFile>]

Resolves the pool link between channel <Channel> and a correction data set (cal group file). After resolving the pool link, the analyzer keeps the previous system error correction as a channel calibration ("Channel Cal"). A new calibration will replace the channel calibration but not overwrite the old cal group file (and not affect other channels).

#### Setting parameters:

<channel></channel>	Channel number of an existing channel. ${\tt ALL}$ resolves the pool link for all channels.
<calgroupfile></calgroupfile>	Optional string parameter to specify the name of the cal group file. Cal group files must have the extension *.cal. The directory must not be specified; the analyzer always uses the default path C: \Users\Public\Documents\Rohde-Schwarz\Vna \Calibration\Data. If there is no link between <ch> and the specified file, the command has no effect. If no file is specified, the command resolves any link between <ch> and an arbitrary cal group file.</ch></ch>
Example:	See MMEMory:LOAD:CORRection
Usage:	Setting only

Manual control: See "Resolve Pool Link" on page 358

#### MMEMory:LOAD:CORRection:TCOefficient <TraceFile>[, <Trace>]

Loads trace data from a specified power meter correction file or trace file and assigns it to a trace with a specified name. Traces are created using CALCulate<Ch>: PARameter:SDEFine.

# Setting parameters:

<tracefile></tracefile>	String parameter to specify the name and directory of the loaded trace file. The R&S ZNB supports power meter correction list files (*.pmcl, to be generated using MMEMory:STORe: CORRection:TCOefficient), *csv, and Touchstone (*.s <n>p) files. If no path is specified the analyzer searches the current directory, to be queried with MMEMory:CDIRectory?. The file extensions *.s<n>p, *csv, and *.pmcl for Touchstone, ASCII, and power meter correction list files are mandatory. *RST: n/a</n></n>
<trace></trace>	Optional string parameter: For inported Touchstone files for more than one port (*.s2p, *.s3p, *.s4p), the parameter denotes the imported S-parameter ('s11', 's12',). For ASCII (*.csv) files, the parameter references a trace name in the file (case sensitive). If the parameter is omitted, the first trace in the specified file is imported. The parameter is not used for power meter correction list files (*.pmcl). *RST: n/a
Example:	See SOURce <ch>: POWer<phypt>:CORRection: TCOefficient:CALibration</phypt></ch>
Usage:	Setting only
Manual control:	See "Import File" on page 354

**MMEMory:LOAD:LIMit** <TraceName>, <LimLineFile>[, <TouchstoneFile>, <StimulusOffset>, <ResponseOffset>, <LimLineType>]

Loads a limit line definition from a specified file and assigns it to a trace with a specified name. Limit lines are created using the CALCulate<Ch>:LIMit... commands.

**Note:** Limit lines can be loaded from Touchstone files (\*.s<n>p, where <n> denotes the number of ports). The optional parameters '<TouchstoneFile>',

<StimulusOffset>, <ResponseOffset>, <LimLineType> are only relevant for Touchstone files. For \*.limit files, no optional parameters can be set.

#### Setting parameters:

<TraceName> Name of an existing trace in the active recall set (string parameter). The imported limit line is assigned to this trace, irrespective of the trace information in the limit line file.

<limlinefile></limlinefile>	file to be loa line files is * is specified	meter to specify the name and directory of the limit line aded. The default extension (manual control) for limit .limit, although other extensions are allowed. If no path the analyzer searches the current directory, to be n MMEMory: CDIRectory?. See also note on Touch- above.
<touchstonefile></touchstonefile>	The parame port Touchs allowed).	meter, selects an S-parameter from a Touchstone file. eter must be compatible with the file type (e.g. for one- stone files *.s1p, only the parameter name 'S11' is
	*RST:	'S11' (if all optional parameters are omitted)
<stimulusoffset></stimulusoffset>		fset for limit lines loaded from a Touchstone file. A et shifts the limit line by 1 GHz in (positive) horizontal
	Range: *RST: Default unit	Depending on the sweep range of the analyzer. 0 :: Hz
<responseoffset></responseoffset>	•	offset for limit lines loaded from a Touchstone file. A shifts the limit line by 1 dB in (positive) vertical direction. Depending on the measured quantity. 0 :: dBm
<limlinetype></limlinetype>	LMIN   LMA Limit line ty LMAX - upp LMIN - lowe OFF - limit *RST:	pe : per limit line er limit line

Example: Assume that the current recall set contains two traces named Trc1 and Trc2, respectively, and that limit lines have been defined for Trc1. MMEM:STOR:LIM 'TRC1', 'C: \Users\Public\Documents \Rohde-Schwarz\Vna\LIMitLines\Lim\_Trc1.limit' Store the limit line definition of Trc1 to a limit line file. MMEM:LOAD:LIM 'TRC2', 'C: \Users\Public\Documents \Rohde-Schwarz\Vna\LIMitLines\Lim Trc1.limit' Load the previously created limit line file and assign the limit lines to Trc2. MMEM:STOR:TRAC 'TRC1', 'C: \Users\Public\Documents \Rohde-Schwarz\Vna\LIMitLines\Trc1.s1p' Store the current trace data of Trc1 to a limit line file in Touchstone format. MMEM:LOAD:LIM 'TRC1', 'C: \Users\Public\Documents \Rohde-Schwarz\Vna\LIMitLines\Trc1.s1p', 'S11', 0, 2, LMAX Load the previously created Touchstone limit line file and assign the limit lines to Trc1, applying a response offset of 2 dB. CALC:LIMit:DISPlay ON Show the limit line in the diagram. Usage: Setting only Manual control: See "Recall / Save Limit Line..." on page 229

#### MMEMory:LOAD:RIPPle <TraceName>, <RippleLimFile>

Loads a ripple limit definition from a specified file and assigns it to a trace with a specified name. Ripple limits are created using the CALCulate<Ch>:RIPPle... commands.

#### Setting parameters:

<tracename></tracename>	Name of an existing trace in the active setup (string parameter). The imported ripple limit line is assigned to this trace, irrespective of the trace information in the ripple limit file.
<ripplelimfile></ripplelimfile>	*RST: - String parameter to specify the name and directory of the ripple limit file to be loaded. The default extension (manual control) for ripple limit files is *.ripple, although other extensions are allowed. If no path is specified the analyzer searches the current directory, to be queried with MMEMory:CDIRectory?.

User Manual 1173.9163.02 - 13

Example:	Assume that the current setup contains two traces named Trc1 and Trc2, respectively, and that ripple limits have been defined for Trc1. MMEM:STOR:RIPP 'TRC1', 'C: \Users\Public\Documents \Rohde-Schwarz\Vna\LIMitLines\Lim_Trc1.limit' Store the ripple limit definition of Trc1 to a ripple limit file. MMEM:LOAD:RIPP 'TRC2', 'C: \Users\Public\Documents Rohde-Schwarz\Vna\LIMitLines\Lim_Trc1.limit' Load the previously created ripple limit file and assign the limits to Trc2. CALC:RIPP:DISPlay ON Show the ripple limit line for the active trace in the diagram.
Usage:	Setting only
Manual control:	See "Recall / Save Ripple Test" on page 234

# MMEMory:LOAD:SEGMent <Channel>, <SweepSegFile>

Loads a sweep segment definition from a specified file and assigns it to a specified channel. Sweep segments are defined using the [SENSe<Ch>:]SEGMent<Seg>... commands.

Setting	parameters:
---------	-------------

<channel></channel>	Channel number.
<sweepsegfile></sweepsegfile>	String parameter to specify the name and directory of the sweep segment file to be loaded. The default extension (manual control) for sweep segment files is *.seglist, although other extensions are allowed. If no path is specified the analyzer searches the current directory, to be queried with MMEMory:CDIRectory?.
Example:	Assume that the current recall set contains two channels num- bered 1 and 2, respectively, and that sweep segments have been defined for channel no. 1. MMEM:STOR:SEGM 1, 'C:\Users\Public\Documents\ Rohde-Schwarz\Vna\SweepSegments\Seg_Ch1.seglist' Store the sweep segment definition of channel 1 to a sweep seg- ment file. MMEM:LOAD:SEGM 2, 'C:\Users\Public\Documents\ Rohde-Schwarz\Vna\SweepSegments\Seg_Ch1.seglist' Load the previously created sweep segment file and use the sweep segments for channel 2.
Usage:	Setting only
Manual control:	See "Import / Export" on page 273

#### MMEMory:LOAD:STATe <Compatibility>, <RecallSetFile>

Loads configuration data from a specified recall set file and sets the analyzer to the corresponding instrument state.

#### Setting parameters:

<compatibility></compatibility>	1 (this value is used for compatibility with the SCPI standard but is ignored).
<recallsetfile></recallsetfile>	String parameter to specify the name and directory of the recall set file to be loaded. The default extension (manual control) for recall set files is *.znx, although other extensions are allowed. If no path is specified the analyzer searches the current directory, to be queried with MMEMory: CDIRectory?.
Example:	<pre>MMEM:STOR:STAT 1, 'C:\Users\Public\Documents\ Rohde-Schwarz\Vna\RecallSets\Set_0413.znx' Store the current setup configuration in the file Set_0413.znx in the default directory for recall set files. MMEM:LOAD:STAT 1, 'C:\Users\Public\Documents\ Rohde-Schwarz\Vna\RecallSets\Set_0413.znx' Load the settings stored in Set_0413.znx.</pre>
Usage:	Setting only
Manual control:	See "Open Recall" on page 143

**MMEMory:LOAD:TRACe** <DestinationTraceName>, <TraceFile>[, <SParamOrTraceName>]

Loads trace data from a specified trace file and assigns it to a trace with a specified name. Traces are created using the CALCulate<Ch>: PARameter: SDEFine command.

# Setting parameters:

- <DestinationTraceNanNeame of an existing data trace in the active recall set (string parameter). The trace data is loaded into a memory trace associated with the specified data trace. If one or more memory traces are already associated with the specified data trace, the last generated memory trace is overwritten.
- <TraceFile> String parameter to specify the name and directory of the trace file to be loaded. Several file formats for trace files are supported. If no path is specified the analyzer searches the current directory, to be queried with MMEMory: CDIRectory?. The file extensions \*.s<n>p, \*.csv, and \*.dat for Touchstone, ASCII, and Matlab files are mandatory.
- <SParamOrTraceNam@ptional string parameter: For imported Touchstone files for more than one port (\*.s2p, \*.s3p, \*.s4p), the parameter denotes the imported S-parameter ('S11', 'S12', ...). For ASCII (\*.csv) and Matlab (\*dat) files, the parameter references a trace name in the file (case sensitive). If the parameter is omitted, the first trace in the specified file is imported.

Example:	Assume that the current recall set contains a trace named Trc1. MMEM:STOR:TRAC 'TRC1', 'C:\Users\Public \Documents\Rohde-Schwarz\Vna\Traces\Trc1.slp' Store the current trace data of Trc1 to a trace file. MMEM:LOAD:TRAC 'TRC1', 'C:\Users\Public \Documents\Rohde-Schwarz\Vna\Traces\Trc1.slp' Load the previously created trace file and create a memory trace assigned to Trc1. CALC:PAR:DEF:SGR 1,2 Create four traces to measure the two-port S-parameters S <sub>11</sub> ,
	S <sub>12</sub> , S <sub>21</sub> , S <sub>22</sub> . The traces are not displayed. MMEM:STOR:TRAC 'TRC1', 'C:\Users\Public
	\Documents\Rohde-Schwarz\Vna\Traces\Trc1.s2p'
	Store the four S-parameter traces to a two-port Touchstone file. MMEM:LOAD:TRAC 'TRC1', 'C:\Users\Public
	$\label{eq:locuments} Rohde-Schwarz \Vna \Traces \Trc1.s2p' \\ \Load the previously created Touchstone file and overwrite the \\previously generated memory trace assigned to Trc1 with the \\S_{11} trace.$
Usage:	Setting only

# MMEMory:LOAD:VNETworks<Ch>:BALanced:DEEMbedding<LogPt> <PortFile>[, <Port>, <Interchange>]

See "Import..." on page 218

Loads data from a specified Touchstone file defining a balanced port circuit model for deembedding. Select a balanced port circuit model involving file import before using the command.

# Suffix:

<Ch> Channel number

<LogPt> Logical port number

# Setting parameters:

Manual control:

<PortFile> String parameter to specify the name and directory of the loaded Touchstone file. The balanced port circuit models STSL | STSC | SLST | SCST require two 2-port (\*.s2p) files, to be assigned to the different ports PMAin and PSECondary; the FIMPort model requires a single 4-port (\*.s4p) file but no additional port assignment. If no path is specified the analyzer searches the current directory,

to be queried with MMEMory: CDIRectory?.

<port></port>	<ul> <li>PMAin   PSECondary</li> <li>Port assignment for two 2-port (*.s2p) files:</li> <li>PMAin - Port 1</li> <li>PSECondary - Port 2</li> <li>The ports must be specified for the import of 2-port (*.s2p) files;</li> <li>they must be omitted for 4-port (*.s4p) files.</li> </ul>
<interchange></interchange>	IPORts Interchange port numbers of loaded *.s2p file. If the parameter is omitted, the port numbers are not interchanged. The parameter must not be used for 4-port files.
Example:	<pre>*RST; SOUR:LPOR1 1,2; LPOR2 3,4 Define a balanced port configuration. CALC:TRAN:VNET:BAL:DEEM:TND STSL Select the "Serial .s2p data, shunt L" circuit model. MMEM:LOAD:VNET:BAL:DEEM2 'C:\Users\Public \Documents\Rohde-Schwarz\Vna\VNET\Test.s2p', PMA Load a Touchstone file and assign it to logical port no. 2.</pre>
Usage:	Setting only
Manual control:	See "D1, D2" on page 407

# MMEMory:LOAD:VNETworks<Ch>:BALanced:EMBedding<LogPt> <PortFile>[, <Port>, <Interchange>]

Loads data from a specified Touchstone file defining a balanced port circuit model for embedding. Select a balanced port circuit model involving file import before using the command.

# Suffix:

<Ch> Channel number

<LogPt> Logical port number

# Setting parameters:

<PortFile> String parameter to specify the name and directory of the loaded Touchstone file. The balanced port circuit models STSL | STSC | SLST | SCST require two 2-port (\*.s2p) files, to be assigned to the different ports PMAin and PSECondary; the FIMPort model requires a single 4-port (\*.s4p) file but no additional port assignment. If no path is specified the analyzer searches the current directory, to be queried with MMEMory:CDIRectory?.

<port></port>	<ul> <li>PMAin   PSECondary</li> <li>Port assignment for two 2-port (*.s2p) files:</li> <li>PMAin - Port 1</li> <li>PSECondary - Port 2</li> <li>The ports must be specified for the import of 2-port (*.s2p) files;</li> <li>they must be omitted for 4-port (*.s4p) files.</li> </ul>
<interchange></interchange>	IPORts Interchange port numbers of loaded $*.s2p$ file. If the parameter is omitted, the port numbers are not interchanged. The parameter must not be used for 4-port files.
Example:	<pre>*RST; SOUR:LPOR1 1,2; LPOR2 3,4 Define a balanced port configuration. CALC:TRAN:VNET:BAL:EMB:TND STSL Select the "Serial .s2p data, shunt L" circuit model. MMEM:LOAD:VNET:BAL:EMB2 'C: \Users\Public\Documents \Rohde-Schwarz\Vna\VNET\Test.s2p', PMA Load a Touchstone file and assign it to logical port no. 2.</pre>
Usage:	Setting only
Manual control:	See "D1, D2" on page 405

# MMEMory:LOAD:VNETworks<Ch>:SENDed:DEEMbedding<PhyPt>

<TouchstoneFile>[, <Interchange>]

Loads data from a specified two-port (\*.s2p) Touchstone file defining a single ended circuit model for deembedding. Select the single ended port circuit model involving file import (FIMPort) before using the command.

# Suffix:

<ch></ch>	Channel number
<phypt></phypt>	Physical port number
Setting parameters: <touchstonefile></touchstonefile>	String parameter to specify the name and directory of the loaded Touchstone file. If no path is specified the analyzer searches the current directory, to be queried with MMEMory: CDIRectory?.
<interchange></interchange>	IPORts Interchange port numbers of loaded *.s2p file. If the parameter is omitted, the port numbers are not interchanged.
Example:	CALC:TRAN:VNET:SEND:DEEM:TND FIMP Select the "Serial .s2p" data circuit model. MMEM:LOAD:VNET:SEND:DEEM2 'C:\Users\Public \Documents\Rohde-Schwarz\Vna\VNET\Test.s2p' Load a Touchstone file and assign it to the physical port no. 2.
Usage:	Setting only

Manual control: See "Select File" on page 403

# MMEMory:LOAD:VNETworks<Ch>:SENDed:EMBedding<PhyPt>

<TouchstoneFile>[, <Interchange>]

Loads data from a specified two-port (\*.s2p) Touchstone file defining a single ended circuit model for embedding. Select the single end. Select the single ended port circuit model involving file import (FIMPort)before using the command.

Suffix: <ch></ch>	Channel number
<phypt></phypt>	Physical port number
Setting parameters: <touchstonefile></touchstonefile>	String parameter to specify the name and directory of the loaded Touchstone file. If no path is specified the analyzer searches the current directory, to be queried with MMEMory:CDIRectory?.
<interchange></interchange>	IPORts
	Interchange port numbers of loaded *.s2p file. If the parameter is omitted, the port numbers are not interchanged.
Example:	CALC:TRAN:VNET:SEND:EMB:TND FIMP Select the "Serial .s2p" data circuit model. MMEM:LOAD:VNET:SEND:EMB2 'C:\Users\Public \Documents\Rohde-Schwarz\Vna\VNET\Test.s2p' Load a Touchstone file and assign it to the physical port no. 2.
Usage:	Setting only
Manual control:	See "Select File" on page 401

# MMEMory:MDIRectory <NewDirectory>

Creates a new subdirectory for mass memory storage in an existing directory.

Setting parameters: <newdirectory></newdirectory>	String parameter to specify the new directory. Either the full path or a subdirectory for the current directory (see MMEMory: CDIRectory).
Example:	<pre>MMEM:MDIR 'C:\Users\Public\New_Directory' Create the specified directory. The parent directory C:\Users\Public must have been created before. MMEM:MDIR 'C: \Users\Public\New_Directory\New_Subdirectory' Create an additional subdirectory. MMEM:CDIR 'C:\Users\Public\Instrument'; MDIR 'New_Directory' Create an additional directory C:\Users\Public\Instrument\New_Directory.</pre>

User Manual 1173.9163.02 - 13

Usage: Setting only

# MMEMory:MOVE <SourceFile>, <NewFile>

Moves a file to the indicated directory and stores it under the file name specified, if any. If <NewFile> contains no path indication, the command renames the file without moving it.

# Setting parameters:

<SourceFile>

<newfile></newfile>	String parameters to specify the name and the path of the file to be copied and the name and the path of the new file.
Example:	<pre>MMEM:MOVE 'C:\Users\Public\Documents \Rohde-Schwarz\Vna\RecallSets\SET1.znx','D:' Move file Set1.znx in directory C: \Users\Public\Documents \Rohde-Schwarz\Vna\RecallSets to an external storage medium, mapped to drive D:\.</pre>
Usage:	Setting only

#### MMEMory:NAME <Filename>

Defines a name for a file which can be used to store the printer output. The file is created when it is selected as a printer destination (HCOPy:DESTination'MMEM').

# Parameters:

String parameter to specify the file name. The supported file for- mats are *.wmf, *.ewmf, *.bmp, *.png; see command
HCOPy: DEVice: LANGuage. The specified directory must exist, otherwise no file can be generated. If no path is specified the ana- lyzer uses the current directory, to be queried with MMEMory:
CDIRectory?.
*RST: 'Hardcopy'
MMEM:NAME 'C:
\Users\Public\Screenshots\PLOT1.BMP'
Define a printer file name, to be stored in the existing directory
C:\Users\Public\Screenshots (without creating the file).
HCOP:DEST 'MMEM'; :HCOP
Select "Print to file" and create the printer file specified before.

# MMEMory:RDIRectory <Directory>

Removes an existing directory from the mass memory storage system.

#### Setting parameters:

<Directory> String parameter to specify the directory.

Example:	MMEM:RDIR 'C: \Users\Public\NetworkService\Application Data' Removes the specified directory.
Usage:	Setting only

# MMEMory:STORe:CKIT <CalKitName>, <CalKitFile>

Stores the data of a calibration kit to a specified file. The calibration kit is identified by its name.

Setting parameters: <calkitname></calkitname>	Name of a user-defined calibration kit available on the analyzer. <b>Tip:</b> It is not possible to modify or store predefined or ideal kits.
<calkitfile></calkitfile>	String parameter to specify the name and directory of the cal kit file to be created. The file is a network analyzer-specific cal kit file with the extension *.calkit. If no path is specified the analyzer uses the current directory, to be queried with MMEMory: CDIRectory?.
Example:	<pre>MMEM:LOAD:CKIT 'C:\Users\Public\Documents \Rohde-Schwarz\Vna\Calibration\Kits\New Kit 1.calkit' Load the previously created cal kit file New Kit 1.calkit from the default cal kit directory :MMEM:STOR:CKIT 'New Kit 1', 'C: \Users\Public\Documents \Rohde-Schwarz\Vna\Calibration\Kits\New Kit 1.calkit' Store the data for the user-defined cal kit "New Kit 1" and overwrite the cal kit file New Kit 1.calkit.</pre>
Usage:	Setting only
Manual control:	See "Import / Export " on page 339

MMEMory:STORe:CKIT:WLABel <CalKitName>, <Label>, <CalKitFile>

Stores the data of a calibration kit to a specified file. The calibration kit is identified by its name and label.

Parameters: <calkitname></calkitname>	Name of a user-defined calibration kit available on the analyzer. <b>Tip:</b> It is not possible to modify or store predefined or ideal kits.
<label></label>	Label of the calibration kit, usually its serial number.
<calkitfile></calkitfile>	String parameter to specify the name and directory of the cal kit file to be created. The file is a NWA-specific cal kit file with the extension *.calkit. If no path is specified the analyzer uses the current directory, to be queried with MMEMory:CDIRectory on page 647.

User Manual 1173.9163.02 - 13

Example: See [SENSe:]CORRection:CKIT:LLABel

Usage: Setting only

# MMEMory:STORe:CMAP <ColorSchemeFile>

Stores a color scheme to a specified VNA color scheme file.

# Setting parameters:

<colorschemefile></colorschemefile>	String parameter to specify the name and directory of the color scheme file to be created. If no path is specified the analyzer uses the current directory, to be queried with MMEMory: CDIRectory ?. The default extension (manual control) for color scheme files is *.ColorScheme, although other extensions are allowed.
Example:	See MMEMory:LOAD:CMAP
Usage:	Setting only
Manual control:	See "Recall / Save" on page 419

# MMEMory:STORe:CORRection <Channel>, <CalGroupFile>

Copies the correction data of channel <Channel> to the cal pool, generating a new correction data file (cal group). The file has the extension \*.cal and is stored in the C:\Users\Public\Documents\Rohde-Schwarz\Vna\Calibration\Data directory.

# Setting parameters:

<channel></channel>	Channel number
<calgroupfile></calgroupfile>	String parameter to specify the name of the created cal group file. There is no need to specify the directory path and file extension; the analyzer uses the default cal pool directory C:\Users\Public\Documents\Rohde-Schwarz\Vna\ Calibration\Data and a *.cal extension.
Example:	See MMEMory:LOAD:CORRection
Usage:	Setting only
Manual control:	See "Add / Add All / Replace / Apply / Apply to All" on page 358

# MMEMory:STORe:CORRection:TCOefficient <TraceFile>

Saves the current power loss list to a specified power meter correction list file.

# Setting parameters:

<tracefile></tracefile>	String parameter to specify the name and directory of the created
	power meter correction list file. The file extension *.pmcl is man-
	datory. If no path is specified the analyzer searches the current
	directory, to be queried with MMEMory: CDIRectory?.
	*RST: n/a

SCPI Command Reference

Example:	<pre>See SOURce<ch>:POWer<phypt>:CORRection: TCOefficient:CALibration</phypt></ch></pre>
Usage:	Setting only
Manual control:	See "Recall / Save" on page 354

# MMEMory:STORe:LIMit <TraceName>, <LimLineFile>

Saves the limit lines associated to a specified trace to a limit line file. Limit lines are created using the CALCulate<Chn>:LIMit... commands.

Setting parameters: <tracename></tracename>	Name of an existing trace in the active recall set (string parameter) for which a limit line definition exists.
<limlinefile></limlinefile>	String parameter to specify the name and directory of the created limit line file. The default extension (manual control) for limit line files is *.limit, although other extensions are allowed. If no path is specified the analyzer uses the current directory, to be queried with MMEMory:CDIRectory?.
Example:	See MMEMory:LOAD:LIMit
Usage:	Setting only
Manual control:	See "Recall / Save Limit Line" on page 229

# MMEMory:STORe:MARKer <AsciiFile>

Saves the values of all markers to a ASCII file.

# Setting parameters:

<asciifile></asciifile>	String parameter to specify the name and directory of the created ASCII file. The default extension (manual control) for marker files is *.txt, although other extensions are allowed. If no path is specified the analyzer uses the current directory, to be queried with MMEMory:CDIRectory?. An example for the file contents is given below.
Example:	<pre>*RST Reset the analyzer, creating the default trace no. 1 in channel no. 1. CALC:MARK ON; MARK:X 1GHz Create marker no. 1 and place it to 1 GHz. CALC:MARK2 ON; MARK2:X 2GHz Create a second marker and place it to 2 GHz. MMEM:STOR:MARK 'Marker.txt' Store the marker values to an ASCII file. The file contains both marker values, e.g.: Trc1 S21 Mkr 1 1.000000 GHz -4.900 dB Mkr 2 2.000000 GHz -6.807 dB</pre>

Usage:Setting onlyManual control:See "Export Markers" on page 242

#### MMEMory:STORe:RIPPle <TraceName>, <RippleLimFile>

Saves the ripple limits associated with a specified trace to a ripple limit file. Ripple limit definitions are created using the CALCulate<Chn>:RIPPle... commands.

# Setting parameters:

<tracename></tracename>	Name of an existing trace in the active setup (string parameter) for which a ripple limit definition exists.
<ripplelimfile></ripplelimfile>	String parameter to specify the name and directory of the created ripple limit file. The default extension (manual control) for ripple limit files is *.ripple, although other extensions are allowed. If no path is specified the analyzer uses the current directory, to be queried with MMEMory:CDIRectory?
Example:	See MMEMory:LOAD:LIMit
Usage:	Setting only

# MMEMory:STORe:SEGMent <Channel>, <SweepSegFile>

Saves the sweep segment definition of a specified channel to a sweep segment file. Sweep segments are defined using the [SENSe<Ch>:]SEGMent<Seg>... commands.

Setting parameters: <channel></channel>	Channel number
<sweepsegfile></sweepsegfile>	String parameter to specify the name and directory of the created sweep segment file. The default extension (manual control) for sweep segment files is *.seglist, although other extensions are allowed. If no path is specified the analyzer uses the current directory, to be queried with MMEMory:CDIRectory?.
Example:	See MMEMory:LOAD:SEGMent
Usage:	Setting only
Manual control:	See "Import / Export" on page 273

MMEMory:STORe:STATe <Compatibility>, <RecallSetFile>

Stores the configuration data of the current recall set to a specified recall set file.

MMEMory:STORe:STATe renames the current recall set, appending a .znx extension. See example for MMEMory:LOAD:STATe.

#### Setting parameters:

<compatibility></compatibility>	1 (this value is used for compatibility with the SCPI standard but ignored).
<recallsetfile></recallsetfile>	String parameter to specify the name and directory of the created recall set file. The default extension (manual control) for recall set files is *.znx, although other extensions are allowed. If no path is specified the analyzer uses the current directory, to be queried with MMEMory:CDIRectory?.
Example:	See MMEMory: LOAD: STATe
Usage:	Setting only
Manual control:	See "Save" on page 144

**MMEMory:STORe:TRACe** <TraceName>, <TraceFile>[, <FormatInd>, <Format>, <DecSeparator>, <FieldSeparator>]

Stores the trace data of a specified data trace to a trace file. Traces are created using the CALCulate<Ch>: PARameter: SDEFine command.

**Tip:**\*.s<n>p Touchstone files (<n> = 1, 2, 3, ...) are intended for a complete set of <n>port S-parameters. Data export fails if the active channel does not contain the full set of <n><sup>2</sup> traces. If the necessary traces are available, '<trc\_name>' can be the name of any of the traces. To create Touchstone files while less than <n><sup>2</sup> single-ended traces are available, use MMEMory: STORe: TRACe: PORTs.

#### Setting parameters:

<tracename></tracename>	Name of an existing data trace in the active recall set (string parameter).
<tracefile></tracefile>	String parameter to specify the name and directory of the created trace file. Several file formats for trace files are supported. The file extensions $*.s < n > p$ , $*.csv$ , and $*.dat$ for Touchstone, ASCII, and Matlab files are mandatory. To generate a multiport Touchstone file $*.s2p$ , $*.s3p$ , the channel must contain traces for the full set of S-parameters; the ' <trc_name>' is ignored. If no path is specified the analyzer uses the current directory, to be queried with MMEMory:CDIRectory?.</trc_name>
<formatind></formatind>	FORMatted   UNFormatted
	UNFormatted - unformatted data export specified by the second optional parameter. FORMatted - formatted data export (for *.csv and *.dat files only). If the first optional parameter is omitted, the command stores

If the first optional parameter is omitted, the command stores unformatted data.

<format></format>	COMPlex   LINPhase   LOGPhase
	COMPlex - complex values (real and imaginary part) LINPhase - linear magnitude and phase. LOGPhase - dB-magnitude and phase. If the second optional parameter is omitted, the command stores complex data.
<decseparator></decseparator>	POINt   COMMa
	POINt - decimal separator: point. COMMa - decimal separator: comma. If the third optional parameter is omitted, points are used.
<fieldseparator></fieldseparator>	SEMicolon   COMMa   TABulator   SPACe
	SEMicolon - field separator: semicolon
	COMMa - field separator: comma. TABulator - field separator: tabulator.
	SPACe - field separator: space.
	If the fourth optional parameter is omitted, semicolons are used.
Example:	See MMEMory:LOAD:TRACe
Usage:	Setting only
Manual control:	

**MMEMory:STORe:TRACe:CHANnel** <Channel>, <TraceFile>[, <FormatInd>, <Format>, <DecSeparator>, <FieldSeparator>]

Stores the trace data of all data traces in the specified channel to a trace file. Traces are created using the CALCulate<Ch>: PARameter: SDEFine command.

**Tip:**\*.s<n>p Touchstone files (<n> = 1, 2, 3, ...) are intended for a complete set of <n>port S-parameters. Data export fails if the active channel does not contain the full set of <n><sup>2</sup> traces.

#### Setting parameters:

<channel></channel>	Channel number in the active recall set. ALL means that a sepa- rate file is created for each channel in the active recall set.
<tracefile></tracefile>	String parameter to specify the name and directory of the created trace file. Several file formats for trace files are supported. The file extensions $*.s < n > p$ , $*.csvc$ , and $*.dat$ for Touchstone, ASCII, and Matlab files are mandatory. To generate a multiport Touchstone file $*.s2p$ , $*.s3p$ , the channel must contain traces for the full set of S-parameters. If no path is specified the analyzer uses the C: \Users\Public\Documents\Rohde-Schwarz\Vna\Traces directory.

<formatind></formatind>	FORMatted   UNFormatted UNFormatted - unformatted data export specified by the second optional parameter. FORMatted - formatted data export (for *.csv and *.dat files only). If the first optional parameter is omitted, the command stores unformatted data.
<format></format>	COMPlex   LINPhase   LOGPhase COMPlex - complex values (real and imaginary part) LINPhase - linear magnitude and phase. LOGPhase - dB-magnitude and phase. If the second optional parameter is omitted, the command stores complex data.
<decseparator></decseparator>	POINt   COMMa POINt - Decimal separator: point. COMMa - Decimal separator: comma. If the third optional parameter is omitted, points are used.
<fieldseparator></fieldseparator>	SEMicolon   COMMa   TABulator   SPACe SEMicolon - Field separator: semicolon COMMa - field separator: comma. TABulator - field separator: tabulator. SPACe - field separator: space. If the third optional parameter is omitted, semicolons are used.
Example:	*RST; :CONF:TRAC:NAME? Reset the instrument, creating a default channel no 1 and a default trace Trc1. CALC:PAR:DEF:SGR 1,2 Create four traces to measure the two-port S-parameters $S_{11}$ , $S_{12}$ , $S_{21}$ , $S_{22}$ . The traces are not displayed. MMEM:STOR:TRAC:CHAN 1, 'C:\Users\Public \Documents\Rohde-Schwarz\Vna\Traces\Chn1.csv' Store all trace data of channel 1 to a trace file. MMEM:STOR:TRAC:CHAN 1, 'C:\Users\Public \Documents\Rohde-Schwarz\Vna\Traces\Chn1.s2p' Store the four S-parameter traces to a two-port Touchstone file. The Touchstone file will not contain the default trace Trc1.
Usage:	Setting only
Manual control:	See "Export" on page 219

**MMEMory:STORe:TRACe:PORTs** <Channel>, <TouchstoneFile>, <Format>, <Port>,, <Port>...

Generates a Touchstone file for the specified ports. The Touchstone file (.s<n>p where <n> is the number of ports) contains a full set of <n>2 single-ended S-parameters for the selected ports. Traces are created using the CALCulate<Ch>: PARameter:SDEFine command.

The command fails unless the conditions for Touchstone file export are met; see "Conditions for Touchstone file export" on page 67.

Setting parameters:	
<channel></channel>	Channel number in the active recall set.
<touchstonefile></touchstonefile>	String parameter to specify the name and directory of the created Touchstone file. The file extension $*.s < n > p$ for a n-port Touchstone file is mandatory. If no path is specified the analyzer uses the current directory, to be queried with MMEMory: CDIRectory ?.
<format></format>	COMPlex   LINPhase   LOGPhase
	COMPlex - complex values (real and imaginary part). LINPhase - Linear magnitude and phase. LOGPhase - dB-magnitude and phase.
<port></port>	First port number
<port></port>	Second port number. Further port numbers can be used as nee- ded.
Example:	Suppose that a full four-port calibration for ports 1 to 4 and channel 1 has been performed, and that a DUT with two balanced ports is connected. The analyzer measures an arbitrary mixed mode S- parameter. MMEM:STOR:TRAC:PORT 1, 'Test.s4p', COMPlex, 1,2,3,4 Calculate all single-ended S-parameters and store them to a four- port Touchstone file.
Usage:	Setting only
Manual control:	See "Export" on page 219

#### 6.3.12 OUTPut Commands

The OUTPut... commands control the characteristics of the analyzer's output ports.

OUTPut <ch>[:STATe]</ch>	672
OUTPut:UPORt:ECBits	
OUTPut <ch>:UPORt[:VALue]</ch>	672

#### OUTPut<Ch>[:STATe] <Boolean>

Turns the internal source power at all ports and the power of all external generators on or off.

 Suffix:

 <Ch>
 Channel number. This suffix is ignored; the setting is valid for all channels.

 Parameters:

 <Boolean>
 ON | OFF - switch the power on or off.

 \*RST:
 ON

 Example:
 OUTP OFF

 Turn off the RF source power.

 Manual control:
 See "RF Off All Channels" on page 257

#### OUTPut:UPORt:ECBits <Boolean>

Defines the usage of pins pins 16 to 19 of the USER PORT connector.

Parameters: <boolean></boolean>	ON – channel bits 4 to 7 OFF – drive port 1 to 4 *RST: ON
Example:	See OUTPut <ch>:UPORt[:VALue]</ch>
Manual control:	See "Pin 16 - 19" on page 427

#### OUTPut<Ch>:UPORt[:VALue] <BinValue>

Sets or queries a channel-dependent eight-bit binary value to control eight independent output signals at the USER PORT connector (lines 8, 9, 10, 11 and lines 16, 17, 18, 19). The output signals are 3.3 V TTL signals which can be used to differentiate between up to 255 independent analyzer states. OUTPut<Ch>:UPORt[:VALue] itself does not change the analyzer state.

#### Channel bit definition and activation

The channel bits have the following properties:

- After a \*RST of the analyzer all channel bits (including the value for the active, sweeping channel no. 1) are set to zero; no signal is applied to pins 8 to 11 and 16 to 19 of the USER PORT connector.
- The value defined with OUTPut<Ch>:UPORt[:VALue] is assigned to channel no. <Ch>.
- The signals at the USER PORT connector reflect the channel bits of the measuring channel, i.e. the channel for which the analyzer performs a sweep. This channel is not necessarily identical with the active channel.

- The signals are switched on as soon as a measurement (sweep) in a channel with non-zero channel bits is started. They are changed whenever a channel with different channel bits becomes the measuring channel.
- The signals at the USER PORT connector are maintained after the analyzer enters the hold state. This happens if all channels use single sweep mode and if all sweep sequences have been terminated.
- Pins 16 to 19 may be reserved for monitoring the drive ports 1 to 4 of the analyzer (OUTPut<Ch>:UPORt:ECBits OFF). This leaves up to 16 different monitored channel states.

**Tip:** You can use the active channel number as a parameter for OUTPut<Ch>:UPORt[:VALue] and monitor the activity of up to 255 different channels at the USER PORT connector; see example below. You can also use the USER PORT output signals as channel-dependent (or drive port-dependent) trigger signals for external devices. Furthermore you can use CONTrol:AUXiliary:C[:DATA] to transfer the eight bit value in decimal representation.

Suffix: <Ch>

Channel number

#### Parameters:

<BinValue>

	USER POR #B00000000 17, 18, 19 #B0000000 #B00000010 #B00000010	<ul> <li>e. The values correspond to the following states of the T connector:</li> <li>D - no signal at any of the eight pins 8, 9, 10, 11, 16,</li> <li>1 - output signal at pin 8</li> <li>D - output signal at pin 9</li> <li>1 - output signal at pins 8 and 9</li> <li>1 - output signal at pins 8, 9, 10, 11, 16, 17, 18, 19</li> </ul>
	Range: *RST:	#B00000000 to #B11111111 (for setting command), 0 to 255 (query) #B00000000 (0)
Example:	Assign the c no. 1. The a therefore the CONF: CHAN Create chan assign the c no measure not changed CALC2: PAR Create a tra	ce named 'Ch2Tr1', 'S11' ce named 'Ch2Tr1' and assign it to channel 2. While measures in channel 2, the output signal changes opin 9.

Reserve pin 16 to 19 for monitoring the drive ports of the analyzer.

Manual control: See "Channel Bits (Decimal)" on page 426

#### 6.3.13 PROGram Commands

The PROGram... commands control external application programs that can be run on the analyzer.

PROGram[:SELected]:EXECute	674
PROGram[:SELected]:INIMessage	675
PROGram[:SELected]:INIParameter	
PROGram[:SELected]:NAME	
and the second	

#### PROGram[:SELected]:EXECute <AppName>

Starts an application program or open a file using an application available on the analyzer.

**Note:** It is not possible to run several programs simultaneously. If the command PROGram[:SELected]:EXECute ... is sent while a previously started program is still executed, the analyzer generates a SCPI error -100, "Command error...".

#### Tip: Executing batch files; command prompt

When executing batch scripts or other DOS applications, the analyzer does not display any DOS windows; the screen is left for the vector network analyzer (VNA) application. The same applies to the Windows NT command prompt (cmd.exe). To access the command prompt, proceed as follows:

- Create a batch file (e.g. Start\_cmd.bat) containing the command line start cmd.exe and store the file to C:\Winnt\system32.
- Execute the batch file: PROG:EXEC 'C:\winnt\system32\Start\_cmd.bat'

The command prompt window is displayed in front of the VNA application. You can also open several command prompt windows simultaneously.

#### Setting parameters:

<appname></appname>	String variable containing the name and path of an application program to be executed or of a file to be opened. The path can be defined as an absolute path (e.g. 'c:\') or relative to the current directory (MMEMory:CDIRectory). Blanks in the <appname> can be used to separate the application name from (optional) parameters.</appname>
Example:	<pre>PROGram:SELected:NAME PROG Select general program execution on the analyzer. MMEM:CDIR 'C:\Program Files\Rohde-Schwarz\Vector Network Analyzer\Bin' Go to the VNA program directory. PROG:EXEC 'iecwin32.exe' Start the application IECWIN32.</pre>
Usage:	Setting only

#### PROGram[:SELected]:INIMessage <IniFile>[, <SendValue>]

Writes a message <SendValue> into the preferences (\*.ini) file specified by <IniFile>. The message is entered into the [MESSAGE] section using the fixed key Send; the value for the fixed key Receive is set to an empty string.

The query reads the value associated with the fixed key Receive from the [MESSAGE] section of the preferences file specified by <IniFile>. If no value exists for that key, the query returns an empty string.

Both commands can be used to establish a simple file-based two-way communication mechanism to an external application launched by PROGram[:SELected]:EXECute; see example.

#### Parameters:

<inifile></inifile>	Name and path of the *.ini file. The *.ini extension may be omitted as it is created automatically by the command. The speci- fied path/directory must exist. If the *.ini file does not exist, it is created.
<sendvalue></sendvalue>	Value for the fixed key Send.
Example:	<pre>PROG:INIM 'c:\preferences\myapp', 'this is a message' Write the string this is a message into the file c:\preferences\myapp.ini. The contents of the file look like:</pre>

Suppose the external program writes the string

PROG:INIM? 'c:\preferences\myapp'

response is "this is a response".

[MESSAGE] Send="this is a message" Receive=

Query the value of the key Receive in the \*.ini file. The

this is a response to the Receive key (and possibly deletes

PROGram[:SELected]:INIParameter <IniFile>{ , <Key>,<Value> | '<Value>'}

the contents of the Send key.

Defines and writes one or several key/value pairs into the preferences file (\*.ini) specified by <file path>. The information is entered into the [PARAMETER] section.

This command can be used to supply information to an external application launched by : PROGram[:SELected]:EXECute.

The query must be sent with a single <Key> value. It reads the value associated with the key from the [PARAMETER] section of the preferences file specified by <file\_path>. If the key/value pair does not exist, the query returns an empty string.

Parameters:	
<inifile></inifile>	Name and path of the *.ini file. The *.ini extension may be omitted as it is created automatically by the command. The speci- fied path/directory must exist. If the *.ini file does not exist, it is created.
<key></key>	Key for the key/value pair(s).

<value></value>	String or numeric value for the key/value pair(s). If a string param- eter is supplied, it has to be enclosed in single or double quotes.				
Example:	<pre>PROG:INIP 'c:\preferences\myapp', 'myparameter', 'myvalue', 'startf', 123.05 Write two key/value pairs into the file c:\preferences\myapp.ini. The contents of the file look like: [PARAMETER] myparameter="myvalue" startf="123.05" PROG:INIP? 'c:\preferences\myapp', 'myparameter' Query the value of the key myparameter in the *.ini file. The response is "myvalue".</pre>				

#### PROGram[:SELected]:NAME <Program>

Selects the application to be run on the analyzer. At present, only the general parameter PROG is available. This means that PROGram[:SELected]:EXECute can start any program.

**Tip:** Use this command in order to avoid problems should the default value change in future firmware versions.

Parameters
------------

<program></program>		m running under Windows or any file that can be n an application program available on the analyzer. PROG
Example:	See PROGr	am[:SELected]:EXECute

#### 6.3.14 [SENSe:] Commands

The [SENSe:]... commands affect the receiver settings of the R&S ZNB.

#### 6.3.14.1 [SENSe:]AVERage...

The [SENSe:]AVERage... commands set sweep averaging parameters. The sweep average is a noise-reduction technique which consists of calculating each measurement point as an average of the same measurement point over several consecutive sweeps.



In contrast to the sweep count (for single sweep mode, [SENSe<Ch>:]SWEep:COUNt), averaging is always channel-specific. Both features are completely independent from each other.

SCPI Command Reference

[SENSe <ch>:]AVERage:CLEar</ch>	677
[SENSe <ch>:]AVERage:COUNt</ch>	677
[SENSe <ch>:]AVERage:MODE</ch>	
[SENSe <ch>:]AVERage[:STATe]</ch>	

#### [SENSe<Ch>:]AVERage:CLEar

Starts a new average cycle, clearing all previous results and thus eliminating their effect on the new cycle.

Suffix: <ch></ch>	Channel number
Example:	SENS1:AVER:COUN 15; :AVER ON Set the average factor for channel 1 to 15 (the mnemonic SENS1 can be omitted) and enable the sweep average. AVER:COUN 5; CLE Reduce the average factor and restart the average.
Usage:	Event
Manual control:	See "Factor / On / Reset" on page 262

#### [SENSe<Ch>:]AVERage:COUNt <AverageFactor>

Defines the number of consecutive sweeps to be combined for the sweep average ("Factor").

Suffix:

<Ch>Channel number
Parameters:
<AverageFactor> Sweep average factor
Range: 1 to 1000
\*RST: 10
Example: See [SENSe<Ch>:]AVERage:CLEar
Manual control: See "Factor / On / Reset" on page 262

#### [SENSe<Ch>:]AVERage:MODE <Mode>

Suffix: <Ch>

#### Parameters:

<Mode>

#### AUTO | FLATten | REDuce

#### AUTO

Automatic selection of the averaging mode, depending on the trace format.

#### FLATten

Averaging of the (linear) magnitude and phase values, provides the most effective noise suppression for the "dB Mag", "Phase", "Unwr. Phase", and "Lin Mag" formats.

#### REDuce

Averaging of the real and imaginary parts of each measurement result, provides the most effective noise suppression for the "Real" and "Imag" formats and for polar diagrams.

Manual control: See "Mode" on page 263

#### [SENSe<Ch>:]AVERage[:STATe] <Boolean>

Enable or disable the sweep average.

Suffix: <ch></ch>	Channel number
Parameters: <boolean></boolean>	ON   OFF - enables or disables the automatic calculation of the sweep average over the specified number of sweeps ( [SENSe <ch>:]AVERage:COUNt). *RST: ON</ch>
Example:	See [SENSe <ch>:]AVERage:CLEar</ch>
Manual control:	See "Factor / On / Reset" on page 262

#### 6.3.14.2 [SENSe:]BANDwidth...

The [SENSe:]BANDwidth... commands set the bandwidth of the IF measurement filter (resolution bandwidth).The forms BANDwidth and BWIDth are equivalent.

[SENSe <ch>:]BANDwidth[:RESolution]6</ch>	378
[SENSe <ch>:]BWIDth[:RESolution]</ch>	
[SENSe <ch>:]BANDwidth[:RESolution]:SELect6</ch>	379
[SENSe <ch>:]BWIDth[:RESolution]:SELect6</ch>	379

#### [SENSe<Ch>:]BANDwidth[:RESolution] <ResBandw> [SENSe<Ch>:]BWIDth[:RESolution] <ResBandw>

Defines the resolution bandwidth of the analyzer (Meas. Bandwidth). Values between 1 Hz and 1 MHz can be set. Option R&S ZNB--K17, "Increased Bandwidth", provides bandwidths up to 10 MHz.

Bandwidths can be set in 1 - 1.5 - 2 - 3 - 5 - 7 steps. The analyzer rounds up any entered value between these steps and rounds down values exceeding the maximum bandwidth.

Suffix:

<ch></ch>	Channel number			
Parameters: <resbandw></resbandw>	Resolution bandwidth			
	Range:See aboveIncrement:1-1.5-2-3-5-7 steps*RST:10 kHzDefault unit:Hz			
Example:	BAND 1.1 Set a resolution bandwidth of approx. 1.1 Hz for channel 1. BAND? The analyzer returns the rounded bandwidth of 1.5 Hz.			
Manual control:	See "Bandwidth" on page 261			

#### [SENSe<Ch>:]BANDwidth[:RESolution]:SELect <Selectivity> [SENSe<Ch>:]BWIDth[:RESolution]:SELect <Selectivity>

Defines the selectivity of the IF filter for an unsegmented sweep. The value is also used for all segments of a segmented sweep, provided that separate selectivity setting is disabled ([SENSe<Ch>:]SEGMent<Seg>:BWIDth[:RESolution]:SELect:CONTrol OFF).

Suffix: <ch></ch>	Channel number			
Parameters: <selectivity></selectivity>	NORMal   MEDium   HIGH NORMal - F filter with normal selectivity and shortest settling time. MEDium - IF filter with steeper edges and longer settling time. HIGH - IF filter with highest selectivity but longest settling time. *RST: NORMal			
Example:	See [SENSe <ch>:]SEGMent<seg>:BWIDth[: RESolution]:SELect:CONTrol</seg></ch>			
Manual control:	See "Selectivity" on page 261			

#### 6.3.14.3 [SENSe:]CORRection:CDATa...

The [SENSe:]CORRection:CDATa... commands read or write system error correction data.

[SENSe<Ch>:]CORRection:CDATa <ErrorTerm>, <SourcePort>, <LoadPort>, <CorrectionData>...

[SENSe<Ch>:]CORRection:CDATa:PORT<PhyPt> <ErrorTerm>, <SourcePort>, <LoadPort>, <CorrectionData>...

Writes or reads system error correction data for a specific channel <Ch>, calibration method ([SENSe<Ch>:]CORRection:COLLect:METHod:DEFine), and port combination <SourcePort>, <LoadPort>. The setting command can be used to transfer user-defined correction data <CorrectionData> to the analyzer; the query returns the current correction data set. ASCII or block data can be transferred, depending on the selected data transfer format (FORMat[:DATA]).

The sweep must be stopped to transfer calibration data; see program example for [SENSe<Ch>:]CORRection:COLLect:SAVE:SELected:DEFault.

**Note:** This command affects the active calibration of channel no. <Ch> or the factory calibration (if no channel calibration is active). For the factory calibration, the query form is allowed only (no change of factory calibration data).

**Tip:** The analyzer provides a default calibration corresponding to a test setup which does not introduce any systematic errors; see [SENSe<Ch>:]CORRection:COLLect: SAVE:SELected:DEFault.

For an overview of calibration methods and error terms refer to chapter 3.5.1, "Calibration Types", on page 70.

#### G and H matrices

The 7-term calibration types named Txx (e.g. TOM, TRM, TRL, TNA) are based on a network analyzer with two ports i and j, each equipped with a test receiver and a reference receiver. The system errors are described in terms of two "error two-ports"  $P_G$  and  $P_H$ :

The error two-port P<sub>G</sub> is assigned to port i of the analyzer. Its transmission matrix G describes how the system errors modify the outgoing and incident waves at port i:

$\begin{bmatrix} \mathbf{b}_i \end{bmatrix}$	_	<b>G</b> <sub>11</sub>	$\mathbf{G}_{12}$	*	<b>m</b> iref
a <sub>i</sub>	_	<b>G</b> <sub>21</sub>	$\mathbf{G}_{22}$		_m <sub>i test</sub> _

The error two-port P<sub>H</sub> is assigned to port j of the analyzer. Its transmission matrix H describes how the system errors modify the measured incident and outgoing waves at port j:

$\begin{bmatrix} \mathbf{a}_j \end{bmatrix}$	_		$H_{12}^{-}$	*	m <sub>j test</sub>
b		H <sub>21</sub>	$H_{22}$		m <sub>jref</sub>

In the two equations above, a and b denote the waves at the calibrated reference plane i and j (e.g. the input and output of the 2-port DUT). The m waves are the raw measured waves of test port i and j. The subscripts "ref" and "test" refer to the reference and test receivers, respectively. During the calibration the network analyzer acquires ratios of wave quantities, which leaves one of non-diagonal matrix elements of G or H as a free normalization factor. The network analyzer uses the normalization  $H_{21} = 1$ .

User Manual 1173.9163.02 - 13

Suffix:		
<ch></ch>	Channel number of the calibrated channel.	
<phypt></phypt>	Physical port number, used to select a specific frequency axis in arbitrary mode (with option R&S ZNB-K4).	
Parameters: <errorterm></errorterm>	<ul> <li>String parameters describing the different error terms, depending on the current calibration method; see table below. Each term contains one complex value (real and imaginary part) for each sweep point. The parameters must be transferred in full length. The following strings are allowed:</li> <li>'DIRECTIVITY' – directivity at the <sourceport></sourceport></li> <li>'SRCMATCH' – source match at the <sourceport></sourceport></li> <li>'REFLTRACK' – reflection tracking at the <sourceport></sourceport></li> <li>'LOADMATCH' – load match at the <loadport></loadport></li> <li>'TRANSTRACK' – transmission tracking between the <sourceport> and the <loadport>; see above.</loadport></sourceport></li> <li>'G11' 'G22' – G matrix elements, referenced to the <sourceport> (irrespective of the values of <port1_no> and <port2_no>).</port2_no></port1_no></sourceport></li> <li>'H11' 'H22' – H matrix elements, referenced to the <loadport> (irrespective of the values of <sourceport> and <loadport>); see above.</loadport></sourceport></loadport></li> <li>'Q11' 'Q22 ', 'PREL' – 9-term correction factors, for internal use (combine with <sourceport> = 1, <loadport> is ignored).</loadport></sourceport></li> <li>'L1', 'L2', 'LA' – 9-term correction factors, for internal use only (combine with <sourceport> = 1, <loadport> = 2).</loadport></sourceport></li> <li>Range: The error terms are dimensionless complex numbers.</li> <li>*RST: n/a</li> </ul>	
<sourceport></sourceport>	Source port number	
<loadport></loadport>	Load port number. If the error term is not related to the load port, a dummy number can be used; e.g. CORR:CDAT 'REFLTRACK', 1, 0	
<correctiondata></correctiondata>	Correction data set to be transferred to the analyzer: One complex number per sweep point. The correction data set is assigned to the specified channel, error term, source and load port. This parameter must not be used for queries.	
Example:	See [SENSe <ch>:]CORRection:COLLect:SAVE: SELected:DEFault.</ch>	

The different calibration types of the analyzer provide the following error terms:

Calibration type	Parameters in [SENSe <ch>:]CORRection: COLLect:METHod:DEFine</ch>	Available error terms (depending on port numbers)
One-port normalization (reflection) using an open or a short standard	REFL, RSHort	'REFLTRACK'

Full one port ("Refl OSM")	FOPort	'DIRECTIVITY', 'SRCMATCH', 'REFLTRACK'
Two-port normalization	FRTRans	'TRANSTRACK'
One path two port	OPTPort	'DIRECTIVITY', 'SRCMATCH', 'REFLTRACK', 'TRANSTRACK'
TOSM	TOSM	'DIRECTIVITY', 'SRCMATCH', 'REFLTRACK', 'LOADMATCH', 'TRANSTRACK'
TOM, TSM, TRM, TRL, TNA	TOM   TSM   TRM   TRL   TNA	'DIRECTIVITY', 'SRCMATCH', 'REFLTRACK', 'LOADMATCH', 'TRANSTRACK' (for reading and writing) 'G11' 'G22' and 'H11', 'H12', 'H22' (for reading only; the 'H21' matrix elements are normalized to 1)

#### 6.3.14.4 [SENSe:]CORRection:SMATrix:CDATa...

The [SENSe:]CORRection:SMATrix:CDATa... commands read or write system error correction data in the presence of switching matrices (see chapter 3.7.12, "External Switch Matrices", on page 134).

[SENSe<Ch>:]CORRection:SMATrix:CDATa <ErrorTerm>, <SourceTestPort>, <LoadTestPort>, <SourceVNAPort>, <LoadVNAPort>, <CorrectionData>...

[SENSe<Ch>:]CORRection:SMATrix:CDATa:PORT<PhyPt> <ErrorTerm>, <SourceTestPort>, <LoadTestPort>, <SourceVNAPort>, <LoadVNAPort>, <CorrectionData>...

Writes or reads system error correction data in the presence of switching matrices.

Same command structure and logic as for [SENSe:]CORRection:CDATa... commands, except for additional parameters SourceVNAPort and LoadVNAPort that restrict the returned correction data to the measurement path between by the respective physical VNA ports (if any). See chapter 3.7.12.5, "Multiple Paths and Calibration", on page 140 for details.

Suffix:

<Ch>

<PhyPt>

#### Parameters:

<ErrorTerm>

<SourceTestPort>

<LoadTestPort>

<sourcevnaport></sourcevnaport>	Number of the VNA port connected to the source test port (via switch matrix)
<loadvnaport></loadvnaport>	Number of the VNA port connected to the load test port (via switch

<CorrectionData> <block\_data>

matrix)

#### 6.3.14.5 [SENSe:]CORRection:CKIT...

The [SENSe:]CORRection:CKIT... commands deal with calibration kits and cal kit data. The calibration kits are distinguished by their names (<CalkitName>), the optional labels (<label>) can be used to carry information about the calibration standard.

In order to handle several identical calibration kits with different serial numbers use the commands of chapter chapter 6.3.14.6, "[SENSe:]CORRection:CKIT... with Labels", on page 689.

[SENSe:]CORRection:CKIT: <conntype>:SELect</conntype>	683
[SENSe:]CORRection:CKIT:CATalog?	
[SENSe:]CORRection:CKIT:DELete	684
[SENSe:]CORRection:CKIT:LABel	684
[SENSe:]CORRection:CKIT:SELect	685
[SENSe:]CORRection:CKIT:STANdard:CATalog?	685
[SENSe:]CORRection:CKIT: <standardtype></standardtype>	

#### [SENSe:]CORRection:CKIT:<ConnType>:SELect <CalKitName>

Selects the calibration kit to be used for a specified connector type <ConnType>. The kit is identified by its name.

**Tip:** For connector types with arbitrary, user-defined names you can use the command [SENSe:]CORRection:CKIT:SELect.

#### Cal kit naming conventions

Calibration kit names must be entered as string parameters. The string contains the cal kit name used in the calibration dialogs (e.g. "Calibration Presettings"); a " $\Omega$ " in the name must be replaced by Ohm, e.g.:

- NewKit1 denotes the user-defined calibration kit "NewKit1".
- N 50 Ohm Ideal Kit denotes the "N 50  $\Omega$  Ideal Kit".
- ZV-Z21 typical denotes the cal kit "ZV-Z21 typical".

#### Suffix:

<conntype></conntype>	N50, N75 – PC7, PC35 USER <no></no>	type, one of the following identifiers: N 50 $\Omega$ or N 75 $\Omega$ connectors , PC292 – PC 7, PC 3.5 or 2.92 mm connectors – user-defined connectors UserConn1, UserConn2 r-defined connector type SMA
Parameters: <calkitname></calkitname>	String parameter containing the name of a calibration kit available on the analyzer. See "Cal kit naming conventions " above.	
	*RST:	n/a (A *RST does not change the assignment between connector types and calibration kits.)

Example:	<pre>MMEM:LOAD:CKIT 'C:\Users\Public \Documents\Rohde-Schwarz \Vna\Calibration\Kits\New Kit 1.calkit' Load the previously created cal kit file New Kit 1.calkit from the default cal kit directory. CORR:CKIT:N50:SEL 'New Kit 1' Assign the imported kit to the N 50 Ω connector type, assuming that the cal kit name stored in New Kit 1.calkit reads New Kit 1.</pre>
Manual control:	See "Add / Copy / Delete / Standards" on page 339

#### [SENSe:]CORRection:CKIT:CATalog? <ConnectorType>

Returns a list of all cal kits for a given connector type.

Parameters:	
<connectortype></connectortype>	Name of the connector type. Use [SENSe <ch>:</ch>
	]CORRection:CONNection:CATalog? to query connector
	names.
Example:	See [SENSe <ch>:]CORRection:CONNection:CATalog?</ch>
Usage:	Query only
Manual control:	See "Add / Copy / Delete / Standards" on page 339

#### [SENSe:]CORRection:CKIT:DELete <CalKitName>

Deletes an imported or user-defined cal kit.

Note: It is not possible to modify or store predefined or ideal kits.

Setting parameters: <calkitname></calkitname>	String parameter containing an imported or user-defined calibra- tion kit available on the analyzer.
Example:	See [SENSe:]CORRection:CKIT:LABel
Usage:	Setting only
Manual control:	See "Add / Copy / Delete / Standards" on page 339

#### [SENSe:]CORRection:CKIT:LABel <CalKitName>[, <Label>]

Assigns a label to an imported or user-defined calibration kit.

Parameters:	String parameter containing an imported or user-defined calibra-
<calkitname></calkitname>	tion kit available on the analyzer.
<label></label>	String parameter containing the label.

Example: CORR:CKIT:FOP 'N 50 Ohm','New Kit 1', '', 0,400000000,0,0,50,99,-2.3,0.22,0,0,0,0 Create a new cal kit "New Kit 1" and assign an open (f) standard for the N 50 Ω connector type with specific properties. CORR:CKIT:LAB 'New Kit 1', 'Test kit created today' Label the previously created kit. CORR:CKIT:LAB? 'New Kit 1' Check the label. CORR:CKIT:DEL 'New Kit 1' Delete the kit.

#### [SENSe:]CORRection:CKIT:SELect <ConnectorType>[, <CalKitName>]

Selects the calibration kit to be used, specifying its connector type and name (optional).

**Tip:** The command is suitable for connector types with arbitrary, user-defined names. For standard connector types you can use the command [SENSe:]CORRECTION: CKIT:<ConnType>:SELect.

#### Parameters:

<connectortype></connectortype>	Connector type, e.g. a user-defined connector type (string varia- ble).
<calkitname></calkitname>	String parameter containing the name of a calibration kit available on the analyzer.
Example:	<pre>MMEM:LOAD:CKIT 'C:\Users\Public \Documents\Rohde-Schwarz \Vna\Calibration\Kits\New Kit 1.calkit' Load the previously created cal kit file New Kit 1.calkit from the default cal kit directory. CORR:CKIT:SEL 'N 50 Ohm', 'New Kit 1' Assign the imported kit to the N 50 Ω connector type, assuming that the cal kit name stored in New Kit 1.calkit reads New Kit 1.</pre>
Manual control:	See "Cal Kit" on page 292

#### [SENSe:]CORRection:CKIT:STANdard:CATalog? <CalKitName>

Returns a list of all standards in a given calibration kit.

#### Parameters:

<calkitname></calkitname>	Name of the cal kit. Use [SENSe:]CORRection:CKIT: CATalog? to query cal kit names.
Example:	See [SENSe <ch>:]CORRection:CONNection:CATalog?</ch>
Usage:	Query only

[SENSe:]CORRection:CKIT:<StandardType> <ConnType>, <CalKitName>, <StandardLabel>, <MinFreq>, <MaxFreq>, <ElLength>, <Loss>, <Z0>, <C0>, <C1>, <C2>, <C3>, <L0>, <L1>, <L2>, <L3>, [OPEN | SHORt | MATCh, <Resistance>, <Port1>, <Port2>]

Defines the parameters of a non-ideal 1 port or 2-port calibration standard <StandardType>. A particular physical standard can be selected by specifying the name of the calibration kit and its serial number. Depending on the standard type, only a subset of the parameters may be used; see table 6-8.

**Note:** If the specified cal kit does not exist, it is created with the specified calibration standard.

#### Parameters:

Farameters.	
<standardtype></standardtype>	Standard type. For reflection standards, the first character denotes the gender, e.g.:
	FOPen, MOPen: Open (f) or Open (m) standard.
	The following reflection standards are supported: MOPen,
	FOPen, MSHort, FSHort, OSHort, MOSHort, FOSHort,
	MMTCh, FFTCh, MREFLect, FREFLect
	For transmission standards, the first two characters denotes the
	genders on both ends, e.g.:
	FFSNetwork, MFSNetwork, MMSNetwork: Symm. network
	(ff), symm. network (mf) or symm. network (mm) standard.
	For a complete list of standard types refer to table 6-8.
Parameter list	String parameters to specify the configured standard
	(' <conntype>', '<calkitname>', '<standard>')<b>and</b></standard></calkitname></conntype>
	numeric parameters defining its properties. See Parameter list.
	Note: The following transmission standards have only 8 parame-
	ters (until <z0>): MMTHrough, MFTHrough, FFTHrough,</z0>
	MMLine, MFLine, FFLine
	The following reflection and transmission standards have only 5
	parameters (until <maxfreq>): MSMatch, FSMatch,</maxfreq>
	MMATten, MFATten, FFATten
	*RST: n/a
Example:	CORR:CKIT:FOP 'N 50 Ohm','New Kit 1', '',
•	0,400000000,0,0,50,99,-2.3,0.22,0,0,0,0,0
	Define the properties of the Open (f) standard for a N 50 $\Omega$ con-
	nector type in cal kit "New Kit 1".
	CORR:CKIT:FOP? 'N 50 Ohm'
	Query the properties of the Open (f) standard for a N 50 $\Omega$ con-
	nector type in the active cal kit.
	CORR:CKIT:FOP? 'N 50 Ohm', 'New Kit 1'
	Query the properties of the Open (f) standard for a N 50 $\Omega$ con-
	nector type in cal kit "New Kit 1".
Manual control:	See "Add / Copy / Delete / Standards" on page 339

The parameters in the [SENSe<Ch>:]CORRection:CKIT:<StandardType>,
[SENSe<Ch>:]CORRection:CKIT:<StandardType>:WLABels, and
[SENSe<Ch>:]CORRection:CKIT:<ConnectorType>:<StandardType> commands have the following meaning:

Table 6-7: Parameter list

Parameter	Meaning	Comment/Unit
' <connectorname>'</connectorname>	Name of the connector type. Use SENSe1:CORRection:CON- Nection:CATalog? to query connector names.	String parameter
' <calkitname>'</calkitname>	Name of the calibration kit. Use [SENSe <ch>:]CORRection:CKIT:CATalog? to query cal kit names.</ch>	String parameter
' <calkitlabel>'</calkitlabel>	Label (e.g. the serial number) of the calibration kit; for WLABel command only	String parameter
' <standardlabel>'</standardlabel>	Label (e.g. the serial number) of the standard	String parameter
<minfreq></minfreq>	Min. frequency for which the circuit model is valid	Default unit is Hz
<maxfreq></maxfreq>	Max. frequency for which the circuit model is valid	Default unit is Hz
<eilength></eilength>	Electrical length (offset parameter) of the standard	Default unit is m
<loss></loss>	Loss (offset parameter) of the standard	To be specified without unit (implicit unit is dB)
<z0></z0>	Reference impedance (no unit)	To be specified without unit (implicit unit is $\Omega$ )
<c0>   <l0></l0></c0>	Polynomial coefficients C0 or L0 for the fringing capacitance or residual inductance of the standard (load parameter)	To be specified without unit (implicit unit is fF or pH)
<c1>   <l1></l1></c1>	Polynomial coefficients C1 or L1 for the fringing capacitance or residual inductance of the standard (load parameter)	To be specified without unit (implicit unit is fF /GHz or pH /GHz)
<c2>   <l2></l2></c2>	Polynomial coefficients C2 or L2 for the fringing capacitance or residual inductance of the standard (load parameter)	To be specified without unit (implicit unit is fF/GHz <sup>2</sup> or pH/GHz <sup>2</sup> )
<c3>   <l3></l3></c3>	Polynomial coefficients C3 or L3 for the fringing capacitance or residual inductance of the standard (load parameter)	To be specified without unit (implicit unit is fF/GHz <sup>3</sup> or pH/GHz <sup>3</sup> )
OPEN   SHORt   MATCh	Simplified modelling as an open or short or match standard. The load circuit model generally consists of capacitance C which is connected in parallel to an inductance L and a resist- ance R, both connected in series. OPEN means that R is infin- ite so that the standard behaves like a capacitor (no induc- tance, the polynomial coefficients specify C). SHORt means that R is zero so that the standard behaves like an inductance (no capacitance, the polynomial coefficients specify L). MATCh means that the standard behaves like a match with the speci- fied <resistance></resistance>	Character data
<resistance></resistance>	Optional resistance for the MATCh standard	Numeric value
, <port1>, <port2></port2></port1>	Optional port restriction: one port number for one port stand- ards, two port numbers for two port standards	Integer value

The different standard types are defined by the following parameters. Port restrictions are indicated in brackets:

#### Table 6-8: Standard types and their parameters

<std_type></std_type>	Meaning	Parameters in [SENSe <ch>:]CORRec- tion:CKIT:<conntype>:<standard- Type&gt;</standard- </conntype></ch>
MOPen   FOPen	Open (m) or open (f)	' <calkitname>' <c3>[, <port1>]</port1></c3></calkitname>
MOPen(P1)   FOPen(P2)	Open (m or f with port restriction)	complete parameter list with capacitance coefficients, no OPEN   SHORT   MATCh
MSHort   FSHort	Short (m) or short (f)	' <calkitname>' <l3>[, <port1>]</port1></l3></calkitname>
		complete parameter list with inductance coefficients, no OPEN   SHORT   MATCh
OSHort   MOSHort   MOSHORT1   MOSH- ORT2   MOSHORT3   FOSHort   FOSHORT1   FOSHORT2   FOSH- ORT3	Offset short (sexless) or offset short (m) or offset short (f) (for user-defined connector types only)	<pre>'<calkitname>' <l3>[, <port1>] complete parameter list with inductance coefficients, no OPEN   SHORT   MATCh</port1></l3></calkitname></pre>
(MOSHort and MOSH- ORT1 etc. are equiva- lent)		
MMTCh   FMTCh	Match (m) or match (f)	' <calkitname>' <maxfreq>[, <port1>]</port1></maxfreq></calkitname>
		no offset parameters, no load parameters (polynomial coefficients), no OPEN   SHORt   MATCh
MSMatch  FSMatch	Sliding match (m) or sliding match (f)	' <calkitname>' <maxfreq>[, <port1>]</port1></maxfreq></calkitname>
		no offset parameters, no load parameters (polynomial coefficients), no OPEN   SHORt   MATCh
MREFlect   FREFlect	Reflect (m) or reflect (f)	' <calkitname>' OPEN   SHORt [, <port1>]</port1></calkitname>
		no loss, otherwise complete parameter list
MMTHrough   MFTHrough	Through (m - m) or through (m - f) or through (f - f)	' <calkitname>' <loss>[, <port1>, <port2>]</port2></port1></loss></calkitname>
FFTHrough		no load parameters (polynomial coeffi- cients), no OPEN   SHORt   MATCh
MMLine   MMLINE1   MFLine   MFLINE1	Line1 (m - m) or line1 (m - f) or line1 (f - f) Line1 (m - m, with port restriction)	' <calkitname>' <loss>[, <port1>, <port2>]</port2></port1></loss></calkitname>
FFLine   FFLINE1 MMLine(P2P3)		no load parameters (polynomial coeffi- cients), no OPEN   SHORt   MATCh
MMLINE2   MFLINE2   FFLINE2	Line2 (m - m) or line2 (m - f) or line2 (f - f), especially for TRL calibration	' <calkitname>' <loss>[, <port1>, <port2>]</port2></port1></loss></calkitname>
		no load parameters (polynomial coeffi- cients), no OPEN   SHORt   MATCh
MMLINE3   MFLINE3   FFLINE3	Line3 (m - m) or line3 (m - f) or line3 (f - f), especially for TRL calibration	' <calkitname>' <loss>[, <port1>, <port2>]</port2></port1></loss></calkitname>
		no load parameters (polynomial coeffi- cients), no OPEN   SHORt   MATCh

<std_type></std_type>	Meaning	Parameters in [SENSe <ch>:]CORRec- tion:CKIT:<conntype>:<standard– Type&gt;</standard– </conntype></ch>
MMATten   MFATten   FFATten	Attenuation (m - m) or attenuation (m - f) or attenuation (f - f)	' <calkitname>' <maxfreq>[, <port1>, <port2>]</port2></port1></maxfreq></calkitname>
		no offset parameters, no load parameters (polynomial coefficients), no OPEN   SHORt   MATCh
MMSNetwork   MFSNetwork   FFSNetwork	Symmetric network (m - m) or symmetric network (m - f) or symmetric network (f - f)	' <calkitname>' OPEN   SHORt   MATCh[, <port1>, <port2>] no loss, otherwise complete parameter list</port2></port1></calkitname>

#### 6.3.14.6 [SENSe:]CORRection:CKIT... with Labels

The following [SENSe:]CORRection:CKIT... commands identify the calibration kit to be used by a combination of its <CalkitName> and <CalkitLabel>. Typically, the serial number of the calibration kit serves as a calibration kit label. Due to their different labels, the analyzer can handle several calibration kits with identical names.

[SENSe:]CORRection:CKIT: <conntype>:LSELect</conntype>	689
[SENSe:]CORRection:CKIT:LCATalog?	690
[SENSe:]CORRection:CKIT:LDELete	690
[SENSe:]CORRection:CKIT:LLABel	690
[SENSe:]CORRection:CKIT:LSELect	691
[SENSe:]CORRection:CKIT:STANdard:LCATalog?	692
[SENSe:]CORRection:CKIT: <standardtype>:WLABel</standardtype>	

#### [SENSe:]CORRection:CKIT:<ConnType>:LSELect <CalKitName>, <Label>

Selects the calibration kit to be used for a specified connector type <ConnType>. The kit is identified by its name and label.

**Tip:** For connector types with arbitrary, user-defined names and labels you can use the command [SENSe:]CORRection:CKIT:LSELect.

#### Suffix:

••••	
<conntype></conntype>	Connector type, one of the following identifiers:
	N50, N75 – N 50 $\Omega$ or N 75 $\Omega$ connectors
	PC7, PC35, PC292 – PC 7, PC 3.5 or 2.92 mm connectors
	USER <no> – user-defined connectors UserConn1, UserConn2</no>
	SMA – user-defined connector type SMA
Parameters:	
<calkitname></calkitname>	String parameter containing the name of a calibration kit available on the analyzer. See "Cal kit naming conventions " under
	[SENSe:]CORRection:CKIT: <conntype>:LSELect.</conntype>
	*RST: n/a (A *RST does not change the assignment

between connector types and calibration kits.)

<calkitlabel></calkitlabel>	<ul> <li>String parameter containing the label of a calibration kit available on the analyzer, usually the serial number.</li> <li>*RST: n/a (A *RST does not change the assignment between connector types and calibration kits.)</li> </ul>
Example:	<pre>MMEM:LOAD:CKIT 'C:\Users\Public \Documents\Rohde-Schwarz \Vna\Calibration\Kits\New Kit 1 (123456).calkit' Load the previously created cal kit file New Kit 1 (123456).calkit from the default cal kit directory. CORR:CKIT:N50:LSEL 'New Kit 1', '123456' Assign the imported kit to the N 50 Ω connector type, assuming that the calkit page stored in New Kit 1 (123456) calkit</pre>
	that the cal kit name stored in New Kit 1 (123456).calkit reads New Kit 1 and that its label reads 123456.

#### [SENSe:]CORRection:CKIT:LCATalog? <ConnectorType>

Returns a list of all cal kits and their labels for a given connector type.

Parameters: <connectortype></connectortype>	Name of the connector type. Use [SENSe <ch>: ]CORRection:CONNection:CATalog? to query connector names.</ch>
Example:	See [SENSe <ch>:]CORRection:CONNection:CATalog?</ch>
Usage:	Query only

#### [SENSe:]CORRection:CKIT:LDELete <CalKitName>, <Label>

Deletes an imported or user-defined cal kit which is identified by its cal kit name and label.

**Note:** It is not possible to modify or store predefined or ideal kits.

#### **Parameters:**

<label>String parameter containing the label of an imported or user- defined calibration kit available on the analyzer.Example:See [SENSe:]CORRection:CKIT:LLABelUsage:Setting only</label>	<calkitname></calkitname>	String parameter containing an imported or user-defined calibra- tion kit available on the analyzer.
	<label></label>	
Usage: Setting only	Example:	See [SENSe:]CORRection:CKIT:LLABel
	Usage:	Setting only

[SENSe:]CORRection:CKIT:LLABel <CalKitName>, <CalkitLabel>[, <NewLabel>]

Assigns a calibration kit label to an imported or user-defined calibration kit or renames an existing calibration kit label.

#### Parameters:

<calkitname></calkitname>	String parameter containing an imported or user-defined calibra- tion kit available on the analyzer.
<calkitlabel></calkitlabel>	String parameter containing the current label.
<newlabel></newlabel>	String parameter containing the new calibration kit label.
Example:	<pre>CORR:CKIT:FOP:WLAB 'N 50 Ohm','New Kit 1', 'Test kit created today', '', 0,400000000,0,0,50,99,-2.3,0.22,0,0,0,0 Create a new cal kit "New Kit 1" labelled "Test kit created today" and assign an open (f) standard for the N 50 Ω connector type with specific properties. CORR:CKIT:LLAB 'New Kit 1', 'Test kit created today', '2012-05-25' Change the label of the previously created kit. CORR:CKIT:LLAB? 'New Kit 1', '2012-05-25' Check the label. MMEMory:STORe:CKIT: WLABel 'New Kit 1', '2012-05-25', 'C: \Users\Public\Documents \Rohde-Schwarz\Vna\Calibration\Kits\New Kit 1 (2012-05-25).calkit' Store the data for the labelled cal kit to the cal kit file New Kit 1 (2012-05-25).calkit. CORR:CKIT:LDEL 'New Kit 1', '2012-05-25' Delete the kit. from the internal memory. MMEMory:LOAD:CKIT 'C:\Users\Public\Documents \Rohde-Schwarz\Vna\Calibration\Kits\New Kit 1 (2012-05-25).calkit' Rehead the kit.</pre>

[SENSe:]CORRection:CKIT:LSELect <ConnectorType>, <CalKitName>, <KitLabel>

Selects the calibration kit to be used, specifying its connector type, name, and label.

**Tip:** The command is suitable for connector types with arbitrary, user-defined names. For standard connector types you can use the command [SENSe:]CORRection: CKIT:<ConnType>:LSELect.

#### Parameters:

<connectortype></connectortype>	Connector type, e.g. a user-defined connector type (string varia- ble).
<calkitname></calkitname>	String parameter containing the name of a calibration kit available on the analyzer.
<kitlabel></kitlabel>	String parameter containing the label of a calibration kit available on the analyzer.

Example: MMEM:LOAD:CKIT 'C:\Users\Public \Documents\Rohde-Schwarz \Vna\Calibration\Kits\New Kit 1 (123456).calkit' Load the previously created cal kit file New Kit 1 (123456).calkit from the default cal kit directory. CORR:CKIT:LSEL 'N 50 Ohm', 'New Kit 1', '123456' Assign the imported kit to the N 50 Ω connector type, assuming that the cal kit name stored in New Kit 1 (123456).calkit reads New Kit 1 and that its label reads 123456.

#### [SENSe:]CORRection:CKIT:STANdard:LCATalog? <CalKitName>, <KitLabel>

Returns a list of all standards in a given calibration kit.

Parameters: <calkitname></calkitname>	Name of the cal kit. Use [SENSe:]CORRection:CKIT: LCATalog? to query cal kit names and labels.
<kitlabel></kitlabel>	Name of the calibration kit label.
Example:	See [SENSe <ch>:]CORRection:CONNection:CATalog?</ch>
Usage:	Query only

[SENSe:]CORRection:CKIT:<StandardType>:WLABel <ConnType>, <CalKitName>, <CalKitLabel>, <StandardLabel>, <MinFreq>, <MaxFreq>, <ElLength>, <Loss>, <Z0>, <C0>, <C1>, <C2>, <C3>, <L0>, <L1>, <L2>, <L3>, [OPEN | SHORt | MATCh, <Resistance>, <Port1>, <Port2>]

Defines the parameters of a non-ideal 1 port or 2-port calibration standard <StandardType>. A particular physical standard can be selected by specifying the name and label of the calibration kit and the standard's serial number. Depending on the standard type, only a subset of the parameters may be used; see Standard types and their parameters.

**Note:** If the specified cal kit does not exist, it is created with the specified calibration standard.

User Manual 1173.9163.02 - 13

#### Parameters: 4

<standardtype></standardtype>	<ul> <li>Standard type. For reflection standards, the first character denotes the gender, e.g.:</li> <li>FOPen, MOPen: Open (f) or Open (m) standard.</li> <li>The following reflection standards are supported: MOPen,</li> <li>FOPen, MSHort, FSHort, OSHort, MOSHort, FOSHort,</li> <li>MMTCh, FFTCh, MREFLect, FREFLect</li> <li>For transmission standards, the first two characters denotes the genders on both ends, e.g.:</li> <li>FFSNetwork, MFSNetwork, MMSNetwork: Symm. network (ff), symm. network (mf) or symm. network (mm) standard.</li> <li>For a complete list of standard types refer to Standard types and their parameters.</li> </ul>
Parameter list	<pre>String parameters to specify the configured standard ('<conntype>', '<calkitname>', '<calkitlabel>, '<standardlabel>') and numeric parameters defining its properties. See Parameter list. Note: The following transmission standards have only 8 parame- ters (until <zo>): MMTHrough, MFTHrough, FFTHrough, MMLine, MFLine, FFLine. The following reflection and transmission standards have only 5 parameters (until <maxfreq>): MSMatch, FSMatch, MMATten, MFATten, FFATten. See also table 6-8. *RST: n/a</maxfreq></zo></standardlabel></calkitlabel></calkitname></conntype></pre>
Example:	<ul> <li>CORR:CKIT:FOP:WLAB 'N 50 Ohm', 'New Kit 1', '123456', '', 0, 400000000, 0, 0, 50, 99, -2.3, 0.22, 0, 0, 0, 0</li> <li>Define the properties of the Open (f) standard for a N 50 Ω connector type in the calibration kit "New Kit 1" labelled "123456".</li> <li>CORR:CKIT:FOP:WLAB? 'N 50 Ohm', 'New Kit 1', '123456'</li> <li>Query the properties of the Open (f) standard for a N 50 Ω connector type in the calibration kit.</li> </ul>

#### 6.3.14.7 [SENSe:]CORRection...

The [SENSe:]CORRection... commands control the system error correction and measurement receiver (power) calibration.

[SENSe <ch>:]CORRection:COLLect[:ACQuire]:RSAVe</ch>	695
[SENSe <ch>:]CORRection:COLLect[:ACQuire]:RSAVe:DEFault</ch>	695
[SENSe <ch>:]CORRection:COLLect[:ACQuire]:SELected</ch>	696
[SENSe <ch>:]CORRection:COLLect:AUTO</ch>	697
[SENSe:]CORRection:COLLect:AUTO:CKIT	698
[SENSe:]CORRection:COLLect:AUTO:CKIT:PASSword	699
[SENSe <ch>:]CORRection:COLLect:AUTO:PORTs</ch>	700
[SENSe:]CORRection:COLLect:AUTO:PORTs:CONNection?	700

User Manual 1173.9163.02 - 13

SCPI Command Reference

SENSe <ch>:]CORRection:COLLect:AUTO:PORTs:TYPE</ch>	
SENSe <ch>:]CORRection:COLLect:AUTO:POWer</ch>	
SENSe <ch>:]CORRection:COLLect:AUTO:TYPE</ch>	
SENSe:]CORRection:COLLect:CHANnels:ALL	
SENSe <ch>:]CORRection:COLLect:CONNection<phypt></phypt></ch>	
SENSe <ch>:]CORRection:COLLect:CONNection:GENDers</ch>	
SENSe <ch>:]CORRection:COLLect:CONNection:PORTs</ch>	
SENSe <ch>:]CORRection:COLLect:DELete</ch>	
SENSe <ch>:]CORRection:COLLect:FIXTure[:ACQuire]</ch>	
SENSe <ch>:]CORRection:COLLect:FIXTure:LMParameter:LOSS[:STATe]</ch>	
SENSe <ch>:]CORRection:COLLect:FIXTure:LMParameter[:STATe]</ch>	
SENSe <ch>:]CORRection:COLLect:FIXTure:SAVE</ch>	
SENSe <ch>:]CORRection:COLLect:FIXTure:STARt</ch>	
SENSe <ch>:]CORRection:COLLect:LOAD:SELected</ch>	
SENSe <ch>:]CORRection:COLLect:METHod:DEFine</ch>	
SENSe:]CORRection:COLLect:PMETer:ID	
SENSe <ch>:]CORRection:COLLect:SAVE:SELected:DEFault</ch>	
SENSe <ch>:]CORRection:COLLect:SAVE:SELected[:DUMMy]</ch>	
SENSe <ch>:]CORRection:COLLect:SCONnection<phypt></phypt></ch>	714
SENSe <ch>:]CORRection:CONNection</ch>	
SENSe <ch>:]CORRection:CONNection:CATalog?</ch>	718
SENSe <ch>:]CORRection:CONNection:DELete</ch>	716
SENSe <ch>:]CORRection:DATA:PARameter<sfk>?</sfk></ch>	717
SENSe <ch>:]CORRection:DATA:PARameter<sfk>:PORT<phypt>?</phypt></sfk></ch>	717
SENSe <ch>:]CORRection:DATA:PARameter:COUNt?</ch>	719
SENSe <ch>:]CORRection:DATE?</ch>	719
SENSe <ch>:]CORRection:EDELay<phypt>:AUTO</phypt></ch>	720
SENSe <ch>:]CORRection:EDELay<phypt>:DIELectric</phypt></ch>	
SENSe <ch>:]CORRection:EDELay<phypt>:DISTance</phypt></ch>	
SENSe <ch>:]CORRection:EDELay<phypt>:ELENgth</phypt></ch>	
SENSe <ch>:]CORRection:EDELay<phypt>[:TIME]</phypt></ch>	
SENSe <ch>:]CORRection:LOSS<phypt></phypt></ch>	
SENSe <ch>:]CORRection:LOSS<phypt>:AUTO</phypt></ch>	
SENSe <ch>:]CORRection:LOSS<phypt>:FREQuency</phypt></ch>	
SENSe <ch>:]CORRection:LOSS<phypt>:OFFSet</phypt></ch>	
SENSe <ch>:]CORRection:OFFSet<phypt>[:STATe]</phypt></ch>	
SENSe <ch>:]CORRection:POWer<phypt>:ACQuire</phypt></ch>	
SENSe <ch>:]CORRection:PCAL</ch>	
SENSe <ch>:]CORRection:POWer<phypt>:AWAVe[:STATe]</phypt></ch>	
SENSe <ch>:]CORRection:POWer:DATA SENSe<ch>:]CORRection:POWer:DATA:PORT<phypt></phypt></ch></ch>	
SENSe <ch>:]CORRection:POWer<phypt>:IMODulation:ACQuire</phypt></ch>	
SENSe <ch>:]CORRection:POWer<phypt>[:STATe]</phypt></ch>	
SENSe <ch>:]CORRection:SSTate?</ch>	
SENSe <ch>:]CORRection[:STATe]</ch>	
SENSe <ch>:]CORRection:STIMulus?</ch>	
SENSe <ch>:]CORRection:STIMulus:PORT<phypt>?</phypt></ch>	
SENSe:]CORRection:COLLect:AUTO:CKIT:PORTs	
SENSe <ch>:]CORRection:COLLect:AUTO:CONFigure</ch>	

SCPI Command Reference

[SENSe <ch>:]CORRection:COLLect:AUTO:ASSignment:DEFine:DEFault</ch>	731
[SENSe <ch>:]CORRection:COLLect:AUTO:ASSignment:COUNt?</ch>	731
[SENSe <ch>:]CORRection:COLLect:AUTO:ASSignment<asg>:DEFine</asg></ch>	
[SENSe <ch>:]CORRection:COLLect:AUTO:ASSignment<asg>:DEFine:TPORt</asg></ch>	
[SENSe <ch>:]CORRection:COLLect:AUTO:ASSignment<asg>:ACQuire</asg></ch>	734
[SENSe <ch>:]CORRection:COLLect:AUTO:SAVE</ch>	
[SENSe <chn>:]CORRection:PSTate?</chn>	

#### [SENSe<Ch>:]CORRection:COLLect[:ACQuire]:RSAVe <Boolean>

Activates or deactivates the calibration mode where the raw measurement data of the standards is stored after the calibration is completed ("Repeat Previous Cal"). The setting is valid for the current calibration, where it overwrites the global setting ([SENSe<Ch>:]CORRection:COLLect[:ACQuire]:RSAVe:DEFault). A new calibration deletes the calibration data acquired in previous calibrations.

#### Suffix: <Ch> Channel number of the calibrated channel Parameters: <Boolean> ON | OFF - "Repeat Previous Cal" on or off. \*RST: OFF Example: CORR:COLL:RSAV:DEF ON Generally keep the raw measurement data of the standards after the calibration is completed. CORR:COLL:METH:DEF 'Test',RSHort,1 Select a one-port normalization at port 1 with a short standard as calibration type. CORR:COLL:SEL SHOR, 1 Measure a short standard connected to port 1 and store the raw measurement results of this standard. CORR:COLL:RSAV OFF To save disk space, delete the current raw calibration data after the calibration is completed. CORR:COLL:SAVE:SEL Calculate the system error correction data and apply it to the active channel. Manual control: See "Save Sweep Data" on page 423

#### [SENSe<Ch>:]CORRection:COLLect[:ACQuire]:RSAVe:DEFault <Boolean>

Activates or deactivates the storage of raw measurement data after the calibration is completed ("Save Sweep Data"). The setting remains valid for all subsequent calibrations until it is changed explicitly. A new calibration deletes the calibration data acquired in previous calibrations.

This setting is automatically disabled and deactivated in case a switch matrix is used in the RF configuration.

User Manual 1173.9163.02 - 13

<b>Suffix:</b> <ch></ch>	Channel number of the calibrated channel.
Parameters: <boolean></boolean>	ON   OFF - "Save Sweep Data" on or off. *RST: OFF
Example:	See [SENSe <ch>:]CORRection:COLLect[:ACQuire]: RSAVe</ch>
Manual control:	See "Save Sweep Data" on page 423

[SENSe<Ch>:]CORRection:COLLect[:ACQuire]:SELected <Type>, <TestPort>[, <SecondPort>, <Boolean>, <DelayTimePhase>]

Starts a calibration measurement in order to acquire measurement data for the selected standards. The standards are reflection or transmission standards and can be connected to arbitrary analyzer ports.

**Note:** The calibration measurement has a variable timeout: *Timeout* = (*Sweep time / Number of sweep points*) \* 3 + 0.1 s

The timeout may be reached e.g. while the measurement waits for the specified trigger event. It is used for all standard measurements including power calibration sweeps (for SMARTerCal).

#### Suffix:

<ch></ch>	Channel	number	of the	calibrated	channel

#### Setting parameters:

<type></type>	THRough   OPEN   SHORt   OSHort   OSHort1   OSHort2   OSHort3   MATCh   NET   ATT   REFL   SLIDe   LINE   LINe1   LINe2   LINe3   UTHRough   POWer
	Standard types: Through, Open, Short, Match, Symmetric Net- work (NET), Attenuation (ATT), Reflect, Sliding Match (SLIDe), Line1 (LINE1 and LINE are synonymous), Line2 and Line3 (esp. for TRL calibration), Offset Short 1 to 3 (OSHort), Unknown Through, power meter (for SMARTerCal).
<testport></testport>	Test port number. For a transmission standard (through, line, attenuation, symmetric network) the input and output port numbers must be specified, for reflection standards, only one port number is required. *RST: n/a
<secondport></secondport>	Second test port number, for transmission standards only
<boolean></boolean>	Optional status parameter for UTHRough standard: OFF - unknown through standard is non-dispersive. ON - unknown through standard is dispersive. *RST: OFF

<DelayTimePhase> Optional entry of delay time or phase for UTHRough standard: AUTO - the analyzer determines the delay time or phase during the calibration sweep.

<delay or phase> - entry of the delay time in ps (for non-dispersive standards) or of the phase at the start frequency of the sweep in deg (for dispersive standards). If an estimate of the start phase is entered, the analyzer uses the **calculated** value which is closest to the estimate.

#### Automatic determination of the phase

The UOSM algorithm provides the transmission factor of the unknown through standard up to an ambiguous sign. This yields the two alternative phase values displayed in the calibration wizard; see Unknown Through Standard.

In remote control, the analyzer performs a plausibility check in order to determine the correct phase. No manual selection is necessary. The check starts at the first sweep point, using the transmission factor with negative phase. The analyzer measures the phase at the subsequent sweep points, assuming that the phase difference between any two consecutive points is less than 90 deg. From these phase values, the analyzer calculates a linear extrapolation and derives an estimate for the DC phase limit. If this DC phase is in the vicinity of ... -180 deg, +180 deg, ... then the transmission factor with negative phase is adopted. If the DC phase is in the vicinity of ... 0 deg, +360 deg, ... then the transmission factor with inverted sign (corresponding to a 180 deg phase shift) is adopted.

\*RST: AUTO

Example: See [SENSe<Ch>:]CORRection:COLLect:SAVE: SELected[:DUMMy] Usage: Setting only

Manual control: See "Ports and Standards" on page 294

[SENSe<Ch>:]CORRection:COLLect:AUTO <Characterization>, <TestPort>, <TestPort>...

Selects and initiates an automatic calibration for the specified test ports using a single, auto-detected port assignment.

#### Tip:

- If the test setup contains a high attenuation, the analyzer may fail to detect the cal unit ports connected to each of its ports. In this case use the extended command [SENSe<Ch>:]CORRection:COLLect:AUTO:PORTs.
- Use [SENSe<Ch>:]CORRection:COLLect:AUTO:TYPE if you want to specify a particular calibration type for the automatic calibration.
- If several calibration units are connected, use SYSTem:COMMunicate:RDEVice: AKAL:ADDRess to select a unit for the calibration.

User Manual 1173.9163.02 - 13

• Use [SENSe<Ch>:]CORRection:COLLect:AUTO:CONFigure to prepare an automatic calibration with multiple port assignments.

automatic calibration with multiple port assignments.		
<b>Suffix:</b> <ch></ch>	Channel number of the calibrated channel	
Setting parameters <characterization></characterization>	<ul> <li>Name and (possibly) directory of the characterization (cal kit file) to be used for the automatic calibration (string parameter):</li> <li>If an empty string (' ') is specified, the factory cal kit file stored in the active calibration unit is used.</li> <li>A VNA cal kit file name *.calkit without path denotes a specific cal kit file stored in the active calibration unit.</li> <li>A VNA cal kit file name *.calkit with path denotes a specific cal kit file name *.calkit with path denotes a specific cal kit file name *.calkit with path denotes a specific cal kit file name *.calkit</li> </ul>	
<testport></testport>		
<testport></testport>	Test port numbers. For an n-port automatic calibration, n arbitrary (not necessarily consecutive) port numbers must be specified. The analyzer automatically detects the calibration unit ports connected to each analyzer port.	
Example:	CORR:COLL:AUTO '', 1, 2, 4 Perform an automatic 3-port calibration at test ports 1, 2, and 4 using the calibration unit's default calibration kit file and arbitrary test ports of the cal unit.	
Usage:	Setting only	

Manual control: See "Apply/Cancel" on page 287

#### [SENSe:]CORRection:COLLect:AUTO:CKIT < Characterization>

Generates a characterization (cal kit file) with the specified name containing the cal kit data of the active calibration unit (SYSTem:COMMunicate:RDEVice:AKAL:ADDRess). The cal kit file can be stored in the calibration unit or written to a directory on the analyzer.

**Note** that this command can only be executed if the number if cal unit ports is less or equal to the number of test ports. Furthermore the command assumes the "canonical" assignment of cal unit ports to test ports: cal unit port 1 assigned to test port 1, cal unit port 2 assigned to test port 2 etc. The new command [SENSe:]CORRection: COLLect:AUTO:CKIT:PORTs allows for flexible assignments.

#### Setting parameters:

<Characterization>

Name and (possibly) directory of the created characterization / cal kit file (string parameter, extension \*.calkit): If no path and directory is specified, the file is stored in the calibration unit (see also [SENSe<Ch>:]CORRection:COLLect:AUTO). The factory calibration data on the unit is not overwritten. If a path and directory is specified, the file is stored in the directory on the analyzer's hard disk. The default directory (MMEMory:CDIRectory) is not used.

Example:	CORR:COLL:AUTO:CKIT 'AutoCalChar.calkit'
	Generate a cal kit file AutoCalChar.calkit for the active cali-
	bration unit and store it in the calibration unit.
Usage:	Setting only
Manual control:	See "Comment / Filename / Finish" on page 347

#### [SENSe:]CORRection:COLLect:AUTO:CKIT:PASSword <Password>

Enters a password to enable a single password-protected action in the automatic calibration or in the characterization wizard. If password protection has been activated manually in the "Characterize Cal Unit" dialog, the password is required for any single execution of one the following commands, provided that a cal kit (characterization) file different from the active characterization is specified:

[SENSe]:CORRection:COLLect:AUTO [SENSe]:CORRection:COLLect:AUTO:CKIT [SENSe]:CORRection:COLLect:AUTO:PORTs [SENSe]:CORRection:COLLect:AUTO:PORTs:TYPE [SENSe]:CORRection:COLLect:AUTO:TYPE

**Tip:** You have to send [SENSe:]CORRection:COLLect:AUTO:CKIT:PASSword repeatedly if your command script uses several password-protected commands. You do not need a password to perform automatic calibrations using the active cal unit characterization.

#### Setting parameters:

<password></password>	Password (string parameter), as defined in manual control.
Example:	<pre>SENSe:CORRection:COLLect:AUTO:CKIT:PASSword 'My_password' Enter a password My_password (assuming that password pro- tection has been activated manually). SENSe:CORRection:COLLect:AUTO '', 1, 2 Perform an automatic 2-port calibration at test ports 1 and 2 using the calibration unit's default calibration kit file and automatic port assignment. SENSe:CORRection:COLLect:AUTO:CKIT:PASSword 'My_password' Re-enter the password. SENSe:CORRection:COLLect:AUTO '', 1, 2 Repeat the calibration.</pre>
Usage:	Setting only
Manual control:	See "Authentication / Set Password" on page 344

User Manual 1173.9163.02 – 13

[SENSe<Ch>:]CORRection:COLLect:AUTO:PORTs <Characterization>, <TestPort1>, <CalUnitPort1>, <TestPort2>...

Selects and initiates an automatic calibration at arbitrary analyzer and calibration unit ports. A progress monitor for the calibration sweeps is displayed.

**Tip:** This command is necessary if the analyzer fails to detect the cal unit ports connected to each of its ports (e.g. because of a high attenuation in the test setup). If auto-detection works you can use the simpler command [SENSe<Ch>:]CORRection:COLLect: AUTO.

#### Suffix:

<ch></ch>	Channel number of the calibrated channel
Setting parameters: <characterization></characterization>	<ul> <li>Name and (possibly) directory of the characterization (cal kit file) to be used for the automatic calibration (string parameter):</li> <li>If an empty string (' ') is specified, the factory cal kit file stored in the active calibration unit is used.</li> <li>A VNA cal kit file name *.calkit without path denotes a specific cal kit file stored in the active calibration unit.</li> <li>A VNA cal kit file name *.calkit with path denotes a specific cal kit file name *.calkit with path denotes a specific cal kit file name *.calkit with path denotes a specific cal kit file name *.calkit with path denotes a specific cal kit file stored in an arbitrary directory.</li> </ul>
<testport1></testport1>	Test port numbers. For an n-port automatic calibration, n arbitrary (not necessarily consecutive) port numbers must be specified.
<calunitport1></calunitport1>	Port numbers of the cal unit. For an n-port automatic calibration, n arbitrary (not necessarily consecutive) port numbers must be specified. It is possible to combine arbitrary (not necessarily matching) pairs of analyzer and cal unit ports.
<testport2></testport2>	
Example:	CORR: COLL: AUTO: PORT '', 1, 2, 2, 4, 4, 1 Perform an automatic 3-port calibration at the analyzer test ports 1, 2, and 4 using the calibration unit's default calibration kit file and ports 2, 4, and 1 of the cal unit.
Usage:	Setting only
Manual control:	See "Apply/Cancel" on page 287

#### [SENSe:]CORRection:COLLect:AUTO:PORTs:CONNection?

Returns the assignment between the network analyzer ports and the ports of the connected automatic calibration unit.

Example:	<ul> <li>CORR: COLL: AUTO: PORT '', 1, 2, 2, 4, 4, 1</li> <li>Perform an automatic 3-port calibration at the analyzer test ports 1, 2, and 4 using the calibration unit's default calibration kit file and ports 2, 4, and 1 of the cal unit.</li> <li>CORR: COLL: AUTO: PORT: CONN?</li> <li>Query the actual port assignment. If the cal unit is properly connected according to the previous command, the response is 1,2,2,4,3,0,4,1. A zero means that the corresponding analyzer port is not connected to any port of the calibration unit.</li> </ul>
Usage:	Query only
Manual control:	See "Detect Port Assignment" on page 284

[SENSe<Ch>:]CORRection:COLLect:AUTO:PORTs:TYPE <CalType>[, <Characterization>, <TestPort1>, <CalUnitPort1>, <TestPort2>...]

Selects and initiates an automatic calibration at arbitrary test and calibration unit ports. A progress monitor for the calibration sweeps is displayed.

**Tip:** This command is necessary if the analyzer fails to detect the cal unit ports connected to each of its ports (e.g. because of a high attenuation in the test setup). If auto-detection works you can use the simpler command [SENSe<Ch>:]CORRection:COLLect: AUTO:TYPE.

#### Suffix:

<Ch>

Channel number of the calibrated channel

#### Setting parameters:

<caltype></caltype>	FNPort   FOPort   OPTPort   FRTRans   FTRans   RTRans   UTRans   REFL   RSHort   PFNPort
	FNPort - full n-port (UOSM) calibration FOPort - full one-port ("Refl OSM") calibration OPTPort - one path two ports calibration SFTPort - separate full two-port calibration (UOSM calibration at two ports) PFNPort – full n-port (UOSM) calibration for SMARTerCal
<characterization></characterization>	<ul> <li>Name and (possibly) directory of the characterization (cal kit file) to be used for the automatic calibration (string parameter):</li> <li>If an empty string (' ') is specified, the factory cal kit file stored in the active calibration unit is used.</li> <li>A VNA cal kit file name *.calkit without path denotes a specific cal kit file stored in the active calibration unit.</li> <li>A VNA cal kit file name *.calkit with path denotes a specific cal kit file stored in an arbitrary directory.</li> </ul>
<testport1></testport1>	Test port number. For an n-port automatic calibration, n arbitrary (not necessarily consecutive) port numbers must be specified. For a one path two port calibration (OPTPort), the first port no. denotes the source port (fully calibrated port).

<calunitport1></calunitport1>	Port numbers of the cal unit. For an n-port automatic calibration, n arbitrary (not necessarily consecutive) port numbers must be specified. It is possible to combine arbitrary (not necessarily matching) pairs of analyzer and cal unit ports.
<testport2></testport2>	Second test port number
	*RST: n/a
Example:	<pre>CORR:COLL:AUTO:PORT FNPort, '', 1, 2, 2, 4, 4, 1 Perform an automatic full 3-port calibration at test ports 1, 2, and 4 using the calibration unit's default calibration kit file and ports 2, 4, and 1 of the cal unit. See also [SENSe<ch>:]CORRection:COLLect:AUTO: POWer</ch></pre>
Usage:	Setting only
Manual control:	See "Calibration Type / Source" on page 282

#### [SENSe<Ch>:]CORRection:COLLect:AUTO:POWer [<TestPort>]

Initiates a receiver power calibration at the analyzer port <Port>. This is the second step of an automatic SMARTerCal.

**Note:** The power calibration must be performed "after" the system error correction; see example below.

Suffix: <Ch>

Channel number of the calibrated channel

#### Setting parameters:

<TestPort>

Test port number. The port number must match the port number selected via [SENSe:]CORRection:COLLect:PMETer:ID; see example.

Example:	<pre>Suppose that a power meter no. 1 is configured and USB-con- nected to the analyzer. SENSe:CORRection:COLLect:PMETer:ID 1, 2 Select power meter no. 1, to be connected to Port 2, for the SMARTerCal. &gt; Connect the calibration unit between ports 1 and 2 of the ana- lyzer, SENSe:CORRection:COLLect:AUTO:PORTs:TYPE PFNPort, '', 1, 1, 2, 2 Perform an automatic full 2-port (UOSM) calibration at the ana- lyzer test ports 1 and 2 using the calibration unit's default calibra- tion kit file and default port assignments (ports 1 and 2 of the cal unit). &gt; Remove the cal unit and connect the power meter to Port 2 of the analyzer. SENSe:CORRection:COLLect:AUTO:POWer 2 Perform an additional receiver power calibration at Port 2. This completes the</pre>
Usage:	Setting only
Manual control:	See "Start Cal Sweep" on page 317

# [SENSe<Ch>:]CORRection:COLLect:AUTO:TYPE <CalType>[, <Characterization>, <TestPort1>, <TestPort2>...]

Selects and initiates an automatic calibration at arbitrary analyzer and cal unit ports. This command also selects the calibration type. A progress monitor for the calibration sweeps is displayed.

**Tip:** If the test setup contains a high attenuation the analyzer may fail to detect the cal unit ports connected to each of its ports. In this case use the extended command [SENSe<Ch>:] CORRECTION: COLLect:AUTO: PORTs: TYPE.

If several calibration units are connected, use SYSTem:COMMunicate:RDEVice: AKAL:ADDRess to select a unit for the calibration.

#### Suffix:

<ch></ch>	Channel number of the	calibrated channel

#### Setting parameters:

<caltype></caltype>	FNPort   FOPort   OPTPort   FRTRans   FTRans   RTRans   UTRans   REFL   RSHort   PFNPort
	FNPort – full n-port (UOSM) calibration
	FOPort – full one-port ("Refl OSM") calibration
	SFTPort – separate full two-port calibrations
	OPTPort – one path two ports calibration
	PFNPort – full n-port (UOSM) calibration for SMARTerCal

<characterization></characterization>	<ul> <li>Name and (possibly) directory of the characterization (cal kit file) to be used for the automatic calibration (string parameter):</li> <li>If an empty string (' ') is specified, the factory cal kit file stored in the active calibration unit is used.</li> <li>A VNA cal kit file name *.calkit without path denotes a specific cal kit file stored in the active calibration unit.</li> <li>A VNA cal kit file name *.calkit with path denotes a specific cal kit file name *.calkit with path denotes a specific cal kit file name *.calkit with path denotes a specific cal kit file name *.calkit</li> </ul>
<testport1></testport1>	Test port numbers. For an n-port automatic calibration, n arbitrary (not necessarily consecutive) port numbers must be specified. For a one path two port calibration (OPTPort), the first port no. denotes the node port (fully calibrated port).
<testport2></testport2>	Second test port number of the analyzer
Example:	CORR:COLL:AUTO:TYPE FNPort, '', 1, 2, 4 Perform an automatic full 3-port calibration at test ports 1, 2, and 4 using the calibration unit's default calibration kit file and arbitrary test ports of the cal unit.
Usage:	Setting only
Manual control:	See "Calibration Type / Source" on page 282

#### [SENSe:]CORRection:COLLect:CHANnels:ALL <Boolean>

Enables calibration of all channels in the active recall set. The command is valid for the following calibration methods:

- Manual system error correction
- Automatic system error correction (cal unit)
- Manual SMARterCal
- Automatic SMARTerCal (cal unit)

A scalar power calibration is not affected.

Parameters: <boolean></boolean>	ON – calibrate all channels. OFF – calibrate the active channel only.
Example:	See [SENSe <ch>:]CORRection:COLLect:SAVE: SELected[:DUMMy]</ch>
Manual control:	See "Calibrate all Channels" on page 282

# [SENSe<Ch>:]CORRection:COLLect:CONNection<PhyPt> <ConnectorType>

Selects a connector type at a specified port <PhyPt> and its gender.

**Tip:** Use [SENSe<Ch>:]CORRection:COLLect:SCONnection<PhyPt> to select an arbitrary connector type using a string variable.

Suffix: <ch></ch>	Channel number of the calibrated channel
<phypt></phypt>	Port numbers of the analyzer <b>Note:</b> If the analyzer is set to use the same connectors at all ports ([SENSe <ch>:]CORRection:COLLect:CONNection:PORTs ALL), then a change of a connector type is valid for all ports. The gender of the connectors can still be different.</ch>
Parameters: <connectortype></connectortype>	N50Female   N50Male   N75Female   N75Male   PC7   SMAFemale   SMAMale   PC35female   PC35male   PC292female   PC292male   BNC50male   BNC50female   BNC75male   BNC75female   UFEMale1   UMALe1   UFEMale2   UMALe2
	Connector type and gender of the connectors (omitted for query). The R&S ZVR-compatible parameters UFEMALE1 and UMALE1 denote the user-defined connector type "UserConn1", UFEMALE2 and UMALE2 denote the user-defined connector type "UserConn2". SMAFEMALE and SMAMALE denote the user-defined connector type "SMA". The user-defined connector types must be defined before being addressed by [SENSe <ch>:]CORRection:COLLect: CONNection<phypt>.</phypt></ch>
	*RST: N50FEMALE for all ports.
Example:	*RST; :CORR:COLL:CONN1 N75MALE; CONN4? Change the connector type at port 1 from N50FEMALE to N75MALE. The connector type at the other ports is also changed to N75, however, the gender (female) is maintained. CORR:COLL:CONN4? returns N75FEMALE.
Manual control:	See "Connector / Gender" on page 291

# [SENSe<Ch>:]CORRection:COLLect:CONNection:GENDers <Gender>

Qualifies whether the genders at the test ports (but not their connector types) are equal or independent.

# Suffix:

<ch></ch>	Channel number of the calibrated channel
Parameters: <gender></gender>	ALL   SINGle ALL – equal (uniform) genders. If the gender at one port is changed, the connector type at all other ports is changed accord- ingly. SINGle – independent (possibly non-uniform) genders at the ports. *RST: SINGle

SCPI Command Reference

Example:	See [SENSe <ch>:]CORRection:COLLect:CONNection:</ch>
	PORTS
Manual control:	See "Same Connector / Gender All Ports" on page 292

#### [SENSe<Ch>:]CORRection:COLLect:CONNection:PORTs <ConnectorType>

Qualifies whether the connector types at the test ports (but not their gender) are equal or independent. Some calibration types require uniform port connector types.

Suffix: <ch></ch>	Channel number of the calibrated channel
Parameters: <connectortype></connectortype>	ALL   SINGle ALL – equal (uniform) connector types. If the connector type at one port is changed, the connector type at all other ports is changed accordingly. SINGle – independent (possibly non-uniform) connector types at the ports.
	*RST: ALL
Example:	CORR:COLL:CONN:PORTS SING Select independent connector types at the ports. CORR:COLL:CONN1 N50MALE; CONN4 N75FEMALE; CONN2? Select independent connector types at ports 1 and 4. The con- nector type at port 2 is not changed; the query returns N50FEMALE.
Manual control:	See "Same Connector / Gender All Ports" on page 292

# [SENSe<Ch>:]CORRection:COLLect:DELete [<CalName>]

Deletes system error correction data generated and stored previously.

#### Suffix:

<Ch> Channel number of the calibrated channel

-

#### Setting parameters:

Name of the calibration (string parameter) defined together with
<pre>the calibration type ([SENSe<ch>:]CORRection:COLLect:</ch></pre>
METHod:DEFine).
ALL - the analyzer deletes all calibrations.
If nothing is specified the analyzer deletes the last system error
correction stored by means of [SENSe <ch>:]CORRection:</ch>

COLLect:SAVE:SELected[:DUMMy].

\*RST:

Example:	<ul> <li>Select a one-port normalization at port 1 with a short standard as calibration type.</li> <li>CORR:COLL:SEL SHOR, 1</li> <li>Measure a short standard connected to port 1 and store the measurement results of this standard.</li> <li>CORR:COLL:SAVE:SEL</li> <li>CORR:COLL:DEL ALL</li> <li>Calculate the system error correction data and apply it to the active channel, then delete the data.</li> </ul>
Usage:	Setting only
Usage:	calibration type. CORR:COLL:SEL SHOR,1 Measure a short standard connected to port 1 and store the mea- surement results of this standard. CORR:COLL:SAVE:SEL CORR:COLL:DEL ALL Calculate the system error correction data and apply it to the active channel, then delete the data. Setting only

Manual control:See "Apply" on page 295

# [SENSe<Ch>:]CORRection:COLLect:FIXTure[:ACQuire] <StandardType>, <TestPort1>, <TestPort2>...

Starts a fixture compensation sweep in order to acquire measurement data for a test fixture that has its inner conductor terminated with the selected standards.

# Suffix:

<ch></ch>	Channel number of the corrected channel
Setting parameters: <standardtype></standardtype>	OPEN   SHORt Terminating standard type: open or short.
<testport1></testport1>	
<testport2></testport2>	Test port numbers. For a fixture compensation, n arbitrary (not necessarily consecutive) port numbers must be specified. *RST: -

Example:	<pre>*RST; CORR:COLL:FIXT:LMP:LOSS OFF Configure a fixture compensation measurement (for all channels): The analyzer performs an Auto Length (no loss) calculation. CORR:COLL:FIXT:ACQ OPEN, 2; :CORR:COLL:FIXT:ACQ SHOR, 4 Perform a fixture compensation sweep at port 2, terminated with an open standard, and at port 4, terminated with a short. CORR:COLL:FIXT:SAVE Save and apply the compensation data. CORR:COLL:FIXT:STAR Prepare a new fixture compensation measurement, deleting the previous data for channel 1. CORR:COLL:FIXT:LMP OFF Select a Direct Compensation measurement (for all channels and traces). CORR:COLL:FIXT:ACQ SHOR, 1, 3 Perform a fixture compensation sweep at ports 1 and 3, terminated with a short standard. CALC2:PAR:SDEF 'Trc2', 'S22' Create channel no. 2 with a trace named Trc2. SENS2:CORR:COLL:FIXT:STAR Prepare a fixture compensation measurement for channel 2. The channel 1 data is not affected. SENS2:CORR:COLL:FIXT:SAVE; :SENS2:CORR:COLL: FIXT:SAVE Save and apply the compensation data for both channel 2. SENS1:CORR:COLL:FIXT:SAVE; :SENS2:CORR:COLL: FIXT:SAVE Save and apply the compensation data for both channels. SENS1:CORR:OFFS3:DFC?; :SENS2:CORR:OFFS3:DFC? Query whether the analyzer uses Direct Compensation results at port 3. The response is 1;1 (true for both channels).</pre>
Usage:	Setting only
Manual control:	See "Fixture Compensation" on page 395

# [SENSe<Ch>:]CORRection:COLLect:FIXTure:LMParameter:LOSS[:STATe] <Boolean>

Selects an Auto Length or an Auto Length and Loss calculation.

Suffix:	
<ch></ch>	

Channel number of the corrected channel. This suffix is ignored;
the setting is valid for all channels.

# Parameters:

<Boolean> 1 - Auto Length and Loss 0 - Auto Length, no loss \*RST: 1

SCPI Command Reference

Manual control:	See "Fixture Compensation" on page 395		
	ACQuire]		
Example:	See [SENSe <ch>:]CORRection:COLLect:FIXTure[:</ch>		

#### [SENSe<Ch>:]CORRection:COLLect:FIXTure:LMParameter[:STATe] <Boolean>

Selects an Auto Length (and Loss) calculation or a Direct Compensation.

Suffix: <ch></ch>	Channel number of the corrected channel. This suffix is ignored; the setting is valid for all channels.
Parameters:	
<boolean></boolean>	<pre>1 - Auto Length (and Loss), depending on the last [SENSe<ch>:]CORRection:COLLect:FIXTure: LMParameter:LOSS[:STATe] setting 0 - Direct Compensation *RST: 1</ch></pre>
Example:	See [SENSe <ch>:]CORRection:COLLect:FIXTure[: ACQuire]</ch>
Manual control:	See "Fixture Compensation" on page 395

#### [SENSe<Ch>:]CORRection:COLLect:FIXTure:SAVE

Completes a fixture compensation, storing and applying the acquired data.

Suffix: <ch></ch>	Channel number of the corrected channel
Example:	See [SENSe <ch>:]CORRection:COLLect:FIXTure[: ACQuire]</ch>
Usage:	Event
Manual control:	See "Fixture Compensation" on page 395

# [SENSe<Ch>:]CORRection:COLLect:FIXTure:STARt

Prepares the analyzer for fixture compensation comprising a single or a series of fixture compensation sweeps

([SENSe<Ch>:]CORRection:COLLect:FIXTure[:ACQuire]). Previous compensation data is deleted.

#### Suffix:

Example:	<pre>See [SENSe<ch>:]CORRection:COLLect:FIXTure[: ACQuire]</ch></pre>
Usage:	Event

#### Manual control: See "Fixture Compensation" on page 395

#### [SENSe<Ch>:]CORRection:COLLect:LOAD:SELected <CalGroupFile>, <Standard>, <TestPort1>[, <TestPort2>]

Reloads a set of previously acquired calibration data for a particular standard from a file in the cal pool. The loaded data may be combined with new calibration measurement data ([SENSe<Ch>:]CORRection:COLLect[:ACQuire]:SELected) in order to simplify and speed up the new calibration procedure. The channel settings for loaded and new calibrations (e.g. the number of sweep points) must be identical.

**Note:** The analyzer performs a consistency check for the loaded data. If the loaded file is incompatible with the channel settings of channel <Ch>, or if it does not contain data for the specified standard and port(s), a command error message (–100, "Command error;...") is generated.

#### Suffix:

<ch></ch>	Channel number of the calibrated channel		
Parameters: <calgroupfile></calgroupfile>	String parameter to specify the name of the loaded cal group file.		
<standard></standard>	THRough   OPEN   SHORt   OSHort   OSHort1   OSHort2   OSHort3   MATCh   NET   ATT   REFL   SLIDe   LINE   LINe1   LINe2   LINe3   UTHRough   POWer		
	Standard types: Through, Open, Short, Match, Symmetric Net- work (NET), Attenuation (ATT), Reflect, Sliding Match (SLIDe), Line 1 (LINE1 and LINE are synonymous), Line 2 and Line 3 (esp. for TRL calibration), Offset Short 1 to 3 (OSHort), Unknown Through.		
<testport1></testport1>	Test port numbers. For a transmission standard (through, line, attenuation, symmetric network) the input and output port numbers must be specified, for reflection standards, only one port number is required.		
<testport2></testport2>	Second test port number, for transmission standards only.		
Example:	Suppose that the cal pool contains a file 'Calgroup3.cal' with a valid through calibration for the active channel no. 1, which you want to include in a new TOSM calibration for ports 1 and 2. MMEM:CDIR DEF; CDIR 'Calibration\Data' Go to the cal group directory. :SENSe1:CORRection:COLLect:METHod:DEFine 'New Cal', TOSM, 1, 2 Define a new TOSM calibration. SENSe1:CORRection:COLLect:LOAD:SELected 'Cal Group 3.cal', THROUGH, 1, 2 Load the through data from the cal pool file into the new calibration. SENSe1:CORRection:COLLect:ACQuire:SELected OPEN, 1 Proceed with the new calibration measurements.		

User Manual 1173.9163.02 - 13

# www.valuetronics.com

#### Manual control: See "Ports and Standards" on page 294

[SENSe<Ch>:]CORRection:COLLect:METHod:DEFine <CalName>, <CalType>, <TestPort1>, <TestPort2>...

Selects a calibration type for channel <Ch> at arbitrary test ports.

Suffix: <ch></ch>	Channel number of the calibrated channel		
Parameters: <calname></calname>	Name of the calibration (string parameter). The name serves as a reference to delete a particular set of system correction data ( [SENSe <ch>:]CORRECTION:COLLECT:DELETE).</ch>		
<caltype></caltype>	REFL   RSHort   FOPort   FTRans   RTRans   FRTRans   OPTPort   TOSM   UOSM   TRL   TOM   TSM   TRM   TNA   PTOSm   PTOM   PTSM   PTRM   PTRL   PTNA   PUOSm Calibration types; see list below.		
<testport1></testport1>	First calibrated test port number. For an n-port calibration type, n port numbers must be specified. If more than n numbers are defined, the spare numbers (the last ones in the list) are ignored. Entering less than n numbers causes an error message. For a one path two port calibration (OPTPort), the first port no. denotes the node port (fully calibrated port).		
<testport2></testport2>	Second calibrated port number.		
Example:	See [SENSe <ch>:]CORRection:COLLect:SAVE: SELected[:DUMMy]</ch>		
Manual control	See "Type / Seurce" on page 290		

Manual control: See "Type / Source" on page 289

The supported calibration types are listed below.

Parameter	Type ("Calibration Presetting" dialog)
REFL   RSHort	Refl Norm Open   Refl Norm Short
FOPort	Full One Port ("Refl OSM")
FTRans   RTRans   FRTRans	Trans Norm - Forward   Trans Norm - Reverse   Trans Norm Both "Forward" ("Reverse") means that the port with the smaller (larger) port number serves a a drive port.
OPTPort	One Path Two Ports
TOSM	TOSM
UOSM	UOSM
TRL   TOM   TSM   TRM   TNA	TRL   TOM   TSM   TRM   TNA
PTOSm   PUOSm   PTRL   PTOM   PTSM   PTRM   PTNA	One of the previous calibration types in combination with a power calibration (for SMARTerCal).

### [SENSe:]CORRection:COLLect:PMETer:ID <PowerMeter>, <TestPort>

Selects an external power meter for the SMARTerCal and assigns it to an analyzer port.

**Note:** The command cannot be used unless a power meter is connected via GPIB bus, USB or LAN interface and configured in the "External Power Meters" dialog.

#### Parameters:

<powermeter></powermeter>	Number of external power meter. The parameters UP, DOWN, MIN, MAX are not available for this command.	
	Range: *RST:	1 to number of configured external generators The power meter selection is not changed by a reset of the analyzer.
<testport></testport>	Test port number. During power calibration, the power meter is connected to this port.	
	*RST:	1 to the number of test ports
Example:	See [SENSe <ch>:]CORRection:COLLect:AUTO:POWer</ch>	
Manual control:	See "Power Meter" on page 312	

#### [SENSe<Ch>:]CORRection:COLLect:SAVE:SELected:DEFault

Generates a set of default system error correction data for the selected ports and calibration type. The default data set corresponds to a test setup which does not introduce any systematic errors; none of the measurement results acquired previously ( [SENSe<Ch>:]CORRection:COLLect[:ACQuire]:SELected) is taken into account.

**Tip:** The main purpose of the default correction data set is to provide a dummy system error correction which you can replace with your own, external correction data. You may have acquired the external data in a previous session or even on an other instrument. If you want to use the external correction data on the analyzer, simply generate the default data set corresponding to your port configuration and calibration type and overwrite the default data. For details refer to the program example below.

#### Suffix:

<Ch>

Channel number of the calibrated channel.

CORR:COLL:METH:DEF 'Test',RSHort,1 Example: Select a one-port normalization at port 1 with a short standard as calibration type. CORR:COLL:SAVE:SEL:DEF Calculate a dummy system error correction for the normalization at port 1. The dummy system error correction provides the reflection tracking error term 'REFLTRACK'. CORR:CDAT? 'REFLTRACK',1,0 Query the dummy system error correction term. The response is a 1 (written as 1, 0 for the real and imaginary part) for each sweep point (no attenuation and no phase shift between the analyzer and the calibration plane). INIT:CONT OFF; :INIT; \*WAI Stop the sweep to ensure correct transfer of calibration data. CORR:CDAT 'REFLTRACK',1,0,<ASCII\_data> Replace the dummy system error correction term with your own correction data, transferred in ASCII format. INIT:CONT ON Restart the sweep in continuous mode. Usage: Event Manual control: See "Apply" on page 295

#### [SENSe<Ch>:]CORRection:COLLect:SAVE:SELected[:DUMMy]

Calculates the system error correction data from the acquired measurement results ([SENSe<Ch>:]CORRection:COLLect[:ACQuire]:SELected), stores it and applies it to the calibrated channel <Ch>. To avoid incompatibilities, older system error correction data is deleted unless it has been transferred into a cal pool (MMEMory: STORe:CORRection<Ch>, '<file name>').

Suffix:			
<ch></ch>	Channel number of the calibrated channel		
Example:	CORRection:COLLect:METHod:DEFine 'Test',RSHort, 1		
	Select a one-port normalization at port 1 with a short standard as calibration type.		
	CORRection:COLLect:CHANnels:ALL ON		
	Enable calibration in all channels of the active recall set.		
	CORRection:COLLect:SELected SHOR,1		
	Measure a short standard connected to port 1 and store the mea- surement results of this standard.		
	CORRection:COLLect:SAVE:SELected		
	Calculate the system error correction data and apply it to the channels.		
Usage:	Event		
Manual control:	See "Apply" on page 295		

# [SENSe<Ch>:]CORRection:COLLect:SCONnection<PhyPt> <Type>[, <Gender>]

Selects a connector type at a specified port <PhyPt> and its gender. In contrast to [SENSe<Ch>:]CORRection:COLLect:CONNection<PhyPt>, this command uses a string variable to identify the connector type.

Suffix: <ch></ch>	Channel number of the calibrated channel	
<phypt></phypt>	Port numbers of the analyzer. If the analyzer is set to use the same connectors at all ports ([SENSe <ch>:]CORRection: COLLect:CONNection:PORTs ALL), then a change of a connector type is valid for all ports. The gender of the connectors can still be different.</ch>	
<b>Parameters:</b> <type></type>	Connector type (string parameter) of the connectors. See "Cal kit naming conventions" under [SENSe:]CORRection:CKIT: <conntype>:SELect. *RST: 'N 50 Ohm',FEM for all ports.</conntype>	
<gender></gender>	MALE   FEMale Gender of the connectors. The gender designation is not neces- sary (and ignored) for sexless connector types.	
Example:	*RST; :CORR:COLL:SCON1 'N 75 Ohm', MALE; SCON4? Change the connector type at port 1 from 'N 50 Ohm', FEM to 'N 75 Ohm', MALE. The connector type at the other ports is also changed to N 75 Ohm, however, the gender (female) is main- tained. CORR:COLL:SCON4? returns 'N 75 Ohm', FEM.	
Manual control:	See "Connector / Gender" on page 291	

[SENSe<Ch>:]CORRection:CONNection <ConnectorName>[, <Mode>, <Gender>, <RelPermittivity>, <RefImpedance>]

Configures the user-defined connector types.

Suffix: <ch></ch>	Channel number	
Parameters: <pre><connectorname></connectorname></pre>	Name of the user-defined connectors, string parameter.	
<mode></mode>	TEM   WGUide Transverse electric or waveguide type propagation mode.	
<gender></gender>	GENDer   NGENder GENDer – polar connector type (m/f) NGENder – sexless connector type	
<relpermittivity></relpermittivity>	Relative permittivity Range: 0.000000001 to 1000.	

# www.valuetronics.com

<refimpedance></refimpedance>	For TEM type connectors: reference impedance in $\Omega$ (without unit), For waveguide (WGUide) type connectors: cutoff frequency in Hz (without unit).	
	Range:	Ref. impedance: $1\mu\Omega$ to 1000 M $\Omega$ . Cutoff frequency: 0 Hz to 1000 GHz.
	*RST:	-
Example:	CORR: CONN 'USERCON', TEM, GEND, 1.00000, 50 Define a TEM type connector type named USERCON. CORR: CONN? 'USERCON' Query the properties of the configured connector type. CORR: CONN: DEL 'USERCON' Delete the configured connector type.	
Manual control:	See "Conn	ector / Gender" on page 291

# [SENSe<Ch>:]CORRection:CONNection:CATalog?

Returns a list of the connector types of all calibration kits in use.

Suffix:

<Ch>

Channel number. This suffix is ignored because connector types are channel-independent.

Example:	CORRection:CONNection:CATalog?
	Query connector types. Possible response: 'N 50 Ohm, N 75
	Ohm,7 mm,3.5 mm,2.92 mm,2.4 mm,1.85 mm,7-16,Type F (75)'
	CORRection:CKIT:CATalog? 'N 50 Ohm'
	Query cal kits for N (50 Ω) connector types. Possible response: 'N 50 Ohm Ideal Kit,3653,85054D,ZV-Z121,ZCAN 50 Ohm,ZV-Z21 typical,85032B/E,85032F,85054B,New
	Kit 1'. We assume that a cal kit New Kit 1 with label
	2012-05-25 was created before.
	CORRection:CKIT:LCATalog? 'N 50 Ohm'
	Query cal kits for N (50 $\Omega$ ) connector types with their labels. Pos-
	sible response: 'N 50 Ohm Ideal
	Kit,,3653,,85054D,,ZV-Z121,,ZCAN 50 Ohm,,ZV-Z21
	typical,,85032B/E,,85032F,,85054B,,New Kit
	1, 2012-05-25'. A sequence of two commas means that the
	preceding cal kit has no label assigned.
	CORRection:CKIT:STANdard:CATalog? '85032B/E'
	Query standards in cal kit named 85032B/E. Possible response: 'MOP, FOP, MSH, FSH, MMMT, FMMT, MFTH'
	CORRection:CKIT:STANdard:LCATalog? 'New Kit 1','2012-05-25'
	Query standards in user cal kit named New Kit 1 labelled 2012-05-25. Possible response:
	'MOP, FOP, MSH (P1), FSH, MMMT, FMMT, MSM, FSM, MREF, FREF, MOSHORT2, FOSHORT2, MOSHORT3, FOSHORT3, MMTH, MMTH (P2P3) ' (P1 etc. denote restricted port assignments).
Usage:	Query only
Manual control:	See "Connector / Gender" on page 291

# [SENSe<Ch>:]CORRection:CONNection:DELete <ConnectorName>

Deletes a user-defined connector type named <ConnectorName>.

Suffix: <ch></ch>	Channel number
Setting parameters: <connectorname></connectorname>	Name of the user-defined connectors, string parameter.
Example:	See [SENSe <ch>:]CORRection:CONNection</ch>
Usage:	Setting only
Manual control:	See "Connector / Gender" on page 291

# [SENSe<Ch>:]CORRection:DATA:PARameter<Sfk>? <SfkSettingType> [SENSe<Ch>:]CORRection:DATA:PARameter<Sfk>:PORT<PhyPt>? <SfkSettingType>

Gets the settings of active system error correction no. <Sfk> (or of the factory calibration, if no channel calibration is active).

Suffix:

·	Physical port number, used to select a specific frequency axis in arbitrary mode (with option R&S ZNB-K4).
Lutio	The number of the system error correction. Less or equal than the total number of active system error corrections for the related channel (see [SENSe <ch>: CORRection:DATA:PARameter:COUNt? on page 719)</ch>
<ch>C</ch>	Channel number of the calibrated channel.

#### Parameters:

<SfkSettingType>

STARt | STOP | POINts | SPOWer | STYPe | BANDwidth | PDLY | RATTenuation | TYPE | PORTs | THRoughs

The requested setting.

If no <SfkSettingType> is specified, the values for STARt, STOP, POINts, SPOWer and STYPe are returned

#### STARt

Start frequency (or CW frequency, if no frequency sweep is active) **STOP** 

#### 310P

Stop frequency (or CW frequency, if no frequency sweep is active)

#### POINts

Number of points

#### SPOWer

Source power (or stop power, for power sweeps)

#### STYPe

Sweep type or grid (LIN, LOG, SEGM)

#### BANDwidth

Measurement bandwidth

#### PDLY

Point delay (Meas Delay) for OSM

### RATTenuation

Receiver attenuations: comma-separated list containing a value pair <port no.>,<rec. att.> (float,integer) for each of the involved **PORTs** 

#### TYPE

Calibration type (see <Type> parameter in [SENSe<Ch>:

]CORRection:COLLect[:ACQuire]:SELected

# on page 696)

#### PORTs

The related test port numbers (comma-separated list of integers)

# THRoughs

Measued Throughs: comma-separated list of ordered port number pairs <pno1-pno2>

#### **Example:** SENSe:CORRection:DATA:PARameter?

# Unrestricted query. Result looks like this: 100000,8500000000,201,-10,LIN

SENSe:CORRection:DATA:PARameter? STARt
...
SENSe:CORRection:DATA:PARameter? STYPe

#### Query settings one by one.

SENSe:CORRection:DATA:PARameter? RATTenuation Query receiver attenuations. Result looks like this: 1,0.000000,2,0.000000

Usage: Query only

# www.valuetronics.com

Manual control: See "Apply" on page 295

#### [SENSe<Ch>:]CORRection:DATA:PARameter:COUNt?

Gets the number of active system error corrections for channel <Ch>.

This may be > 1 in case the enhanced multi-calibration wizard was used (see SYSTem:DISPlay:DIALogs:SETup:MCAL[:STATe] on page 853) to collect the calibration data. The properties of the available calibrations can be queried using the [SENSe<Ch>:]CORRection:DATA:PARameter<Sfk>? command.

C		ff	١.	•	
J	u		14	N	•

<ch></ch>	Channel number of the calibrated channel.
Usage:	Query only
Manual control:	See "Channel Properties" on page 358

#### [SENSe<Ch>:]CORRection:DATE?

Returns the date and time when the active system error correction data for channel <Ch> was acquired (see example).

<b>Suffix:</b> <ch></ch>	Channel number of the calibrated channel
Example:	<ul> <li>CORR:COLL:METH REFL1</li> <li>Select a one-port normalization at port 1 as calibration type.</li> <li>CORR:COLL OPEN1</li> <li>Measure an open standard connected to port 1 and store the measurement results of this standard.</li> <li>CORR:COLL:SAVE</li> <li>Calculate the system error correction data and apply it to the active channel.</li> <li>CORR:DATE?</li> <li>Query the time when the system error correction became active.</li> <li>The analyzer returns the date and time, e.g.</li> <li>'03/20/11,18:30:39'.</li> <li>CORR:DATA:PAR?</li> <li>Query the sweep settings for the calibration sweep. The analyzer returns the start and stop frequency, the number of points, source power, and the sweep type, e.g.</li> <li>30000,80000000,201,0,LIN.</li> <li>CORR:SST?</li> <li>Query the calibration status. The analyzer returns 'CAL OFF' (because the performed one-port calibration is not sufficient for the measured transmission S-parameter S<sub>21</sub>).</li> </ul>
Usage:	Query only
Manual control:	See "Apply" on page 295

#### [SENSe<Ch>:]CORRection:EDELay<PhyPt>:AUTO <Activate>

Defines the offset parameter for the active test port such that the residual delay of the active trace (defined as the negative derivative of the phase response) is minimized across the entire sweep range ("Auto Length").

Suffix:				
<ch></ch>	Channel number of the offset-corrected channel			
<phypt></phypt>	Port number of the analyzer. This numeric suffix is ignored; the active port is determined by the active trace.			
Setting parameters:				
<activate></activate>	ONCE			
	Applies the auto length function.			
Example:	*RST; :CORR:EDEL:AUTO ONCE			
	Reset the instrument and apply the auto length function to the default trace (Trc1 in channel 1).			
Usage:	Setting only			
Manual control:	See "Auto Length" on page 395			

# [SENSe<Ch>:]CORRection:EDELay<PhyPt>:DIELectric <Permittivity>

Defines the permittivity for the offset correction at test port < PhyPt>.

<b>Suffix:</b> <ch></ch>	Channel nu	mber of the offset-corrected channel
<phypt></phypt>	Port numbe	r of the analyzer
<b>Parameters:</b> <permittivity></permittivity>	Permittivity Range: *RST:	1 to +1E+6 1.00062
Example:	See [SENSe <ch>:]CORRection:EDELay<phypt>:ELENgth</phypt></ch>	
Manual control:	See "Permittivity / Velocity Factor" on page 394	

#### [SENSe<Ch>:]CORRection:EDELay<PhyPt>:DISTance <MechLength>

Defines the offset parameter for test port <PhyPt> as a mechanical length.

Suffix:	
<ch></ch>	Channel number of the offset-corrected channel
<phypt></phypt>	Port number of the analyzer

Parameters: <mechlength></mechlength>	Mechanical length	
	Range: *RST: Default unit	-3.402823466E+038 m to +3.4028234664E+038 m. 0 m : m
Example:	See [SENSe <ch>:]CORRection:EDELay<phypt>:ELENgth</phypt></ch>	
Manual control:	See "Delay / Electrical Length / Mechanical Length" on page 393	

# [SENSe<Ch>:]CORRection:EDELay<PhyPt>:ELENgth <ElecLength>

Defines the offset parameter for test port <PhyPt> as an electrical length.

Suffix: <ch> <phypt> Parameters:</phypt></ch>	Channel number of the offset-corrected channel Port number of the analyzer	
<eleclength></eleclength>	Electrical length Range: -1E+9 m to +1E+9 m. Increment: 1 mm *RST: 0 m Default unit: m	
Example:	Default unit: m CORR: EDEL2: ELEN 0.3 Define an electrical length of 30 cm for channel 1 and port no. 2. CORR: EDEL2: DIST?; DIEL? Query the values of the mechanical length and the permittivity at port 2. The mechanical length is equal to the electrical length divi- ded by the square root of the permittivity; the latter is set to its default value. The response is 0.29990704322;1.00062. CORR: EDEL2? Query the value of the delay at port 2. The delay is equal to the electrical length divided by the speed of light in the vacuum, so the response is 1.0006922856E-009. CORR: LOSS2 2; LOSS2: FREQ 1.5 GHz; OFFS 3 dB Define the offset loss parameters at port 2.	
Manual control:	See "Delay / Electrical Length / Mechanical Length" on page 393	

# [SENSe<Ch>:]CORRection:EDELay<PhyPt>[:TIME] <Delay>

Defines the offset parameter for test port <PhyPt> as a delay time.

Suffix:	
<ch></ch>	Channel number of the offset-corrected channel
<phypt></phypt>	Port number of the analyzer

Parameters:		
<delay></delay>	Delay	
	Range:	-3.40282346638529E+038 s to
		+3.40282346638529E+038 s.
	*RST:	0 s
	Default unit	S
Example:	See [SENS	e <ch>:]CORRection:EDELay<phypt>:ELENgth</phypt></ch>
Manual control:	See "Delay	/ Electrical Length / Mechanical Length" on page 393

# [SENSe<Ch>:]CORRection:LOSS<PhyPt> <OffsetLoss>

Defines the offset loss at the reference frequency ([SENSe<Ch>:]CORRection: LOSS<PhyPt>:FREQuency).

<b>Suffix:</b> <ch></ch>	Channel number of the offset-corrected channel
<phypt></phypt>	Port number of the analyzer
Parameters: <offsetloss></offsetloss>	Frequency-dependent part of the offset loss Range: -200 dB to +200 dB Increment: 0.001 dB *RST: 0 dB Default unit: dB
Example:	See [SENSe <ch>:]CORRection:EDELay<phypt>:ELENgth</phypt></ch>
Manual control:	See "Loss at DC / Loss at Freq / Freq for Loss" on page 398

#### [SENSe<Ch>:]CORRection:LOSS<PhyPt>:AUTO <Activate>

Defines the offset parameters for the active test port such that the residual delay of the active trace (defined as the negative derivative of the phase response) is minimized and the measured loss is reproduced as far as possible across the entire sweep range ("Auto Length and Loss").

# Suffix:

<ch></ch>	Channel number of the offset-corrected channel
<phypt></phypt>	Port number of the analyzer. This numeric suffix is ignored; the active port is determined by the active trace.
Setting parameters: <activate></activate>	ONCE Applies the "Auto Length and Loss" function.
Example:	*RST; :CORR:LOSS:AUTO ONCE Reset the instrument and apply the "Auto Length and Loss" func- tion to the default trace (Trc1 in channel 1).
Usage:	Setting only

Manual control: See "Auto Length and Loss" on page 399

#### [SENSe<Ch>:]CORRection:LOSS<PhyPt>:FREQuency <RefFreq>

Defines the reference frequency for the frequency-dependent part of the offset loss ( [SENSe<Ch>:]CORRection:LOSS<PhyPt>:OFFSet).

0	mber of the offset-corrected channel
Port numbe	er of the analyzer
Reference f Range: Increment: *RST: Default unit	Frequency range of the analyzer model. 1 MHz 1000000000 Hz (= 1 GHz)
See [SENS	e <ch>:]CORRection:EDELay<phypt>:ELENgth</phypt></ch>
See "Loss a	at DC / Loss at Freq / Freq for Loss" on page 398
	Port number Reference f Range: Increment: *RST: Default unit See [SENS

#### [SENSe<Ch>:]CORRection:LOSS<PhyPt>:OFFSet <OffsetLoss>

Defines the frequency-independent part (DC value) of the offset loss.

Suffix: <ch></ch>	Channel number of the offset-corrected channel
<phypt></phypt>	Port number of the analyzer
Parameters: <offsetloss></offsetloss>	Frequency-independent part of the offset lossRange:-200 dB to +200 dBIncrement:0.001 dB*RST:0 dBDefault unit:dB
Example:	See [SENSe <ch>:]CORRection:EDELay<phypt>:ELENgth</phypt></ch>
Manual control:	See "Loss at DC / Loss at Freq / Freq for Loss" on page 398

#### [SENSe<Ch>:]CORRection:OFFSet<PhyPt>[:STATe] <Boolean>

Resets the offset parameters for all test ports to zero and the reference frequency to 1 GHz or queries whether any of the offset parameters are different from zero.

#### Suffix:

<ch></ch>	Channel number of the offset-corrected channel
<phypt></phypt>	Port number of the analyzer. This numeric suffix is ignored; the command affects the parameters of all ports.

# Parameters:

<boolean></boolean>	The parameter function depends on whether the command is used as a setting command or as a query: For setting command: ON - no effect OFF - resets all length offsets to zero and the reference frequency to 1 GHz For query: 1 - at least one length offset parameter is different from its default value 0 - all length offsets are zero / set to default *RST: OFF
Example:	*RST; :CORR:OFFS? Reset the instrument and query whether the length offset param- eters have been reset as well. The response is 0.
Manual control:	See "Reset Offsets" on page 399

# [SENSe<Ch>:]CORRection:POWer<PhyPt>:ACQuire <Wave>[, <CalPort>,

<SourceType>, <SourcePort>]

Selects the wave quantity and the source for the receiver power calibration, starts the calibration sweep, and applies the receiver power correction.

# Suffix:

Sumix:	
<ch></ch>	Calibrated channel number
<phypt></phypt>	Calibrated port number. This suffix is ignored because the port number is specified in the parameter list.
Setting parameters:	
<wave></wave>	AWAVe   BWAVe   B1   B2   B3   B4
	$\begin{array}{l} AWAVe-calibration of reference waves  a_1, a_2, \hdots \ In manual control, the reference receiver calibration is included in the source power calibration of each port.\\ \\ BWAVe-calibration of received wave  b_1, b_2, \hdots \ In manual control (CalPort), the used $
<calport></calport>	Calibrated port number
	Range: 1 to port number of the analyzer

<sourcetype></sourcetype>	PORT   GENerator PORT - internal source at port <calport>, to be fed to port <sourceport> using an external through connection. If <calport> = <sourceport>, an Open or Short standard is required. GENerator - external generator no. <source_no>.</source_no></sourceport></calport></sourceport></calport>
<sourceport></sourceport>	Number of the port for the internal source or generator.Range:1 to port number of the analyzer/number of external generators.
Example:	<pre>*RST; CORR:POW:ACQ AWAVe,1,PORT,1 Perform a receiver power calibration of the wave a<sub>1</sub> using port 1 as a source port, assuming that the transmitted source power a<sub>1</sub> is correct. No external cabling is needed. CORR:POW:AWAV? Check whether the calibration is applied (the response is 1). CALC:PAR:MEAS 'TRC1', 'A1' Select a<sub>1</sub> as a measured quantity for the default trace. CALC:MARK ON; MARK:Y?; :SOUR:POW? Create marker no. <mk> in the center of the sweep range and query the measurement value. The calibrated power of the refer- ence wave a<sub>1</sub> is approx. equal to the default source power value. See also example for [SENSe<ch>:]CORRection: OFFSet<phypt>[:STATE].</phypt></ch></mk></pre>
Usage:	Setting only
Manual control:	See "Port Overview" on page 305

# [SENSe<Ch>:]CORRection:PCAL <ActivatePowerCals>

Activates or deactivates all power calibrations.

Suffix: <Ch>

Calibrated channel number

# Setting parameters:

<ActivatePowerCals> NONE | ALL

NONE – deactivate all power calibrations. ALL – activate all power calibrations. \*RST: n/a

Example:	<ul> <li>*RST; CORR: POW: ACQ AWAVe, 1, PORT, 1</li> <li>Perform a receiver power calibration of the wave a<sub>1</sub> using port 1 as a source port, assuming that the transmitted source power a<sub>1</sub> is correct. No external cabling is needed.</li> <li>CORR: POW: AWAV?</li> <li>Check whether the calibration is applied (the response is 1).</li> <li>CORR: PCAL NONE; POW: AWAV?</li> <li>Disable all power calibrations and check again whether the calibration is applied (the response is 0).</li> </ul>
Usage:	Setting only
Manual control:	See "All Power Cals On / Off" on page 355

#### [SENSe<Ch>:]CORRection:POWer<PhyPt>:AWAVe[:STATe] <Boolean>

Enables or disables the receiver power calibration for channel <Ch> and for the reference waves  $a_n$ . The setting command is disabled unless the reference waves have been power calibrated ([SENSe<Ch>:]CORRection:POWer<PhyPt>:ACQuire on page 724 AWAVe, ...). The query always returns a result.

This command extends the functionality of manual control, where the reference receiver calibration is included in the source power calibration of each port (and always ON).

<b>Suffix:</b> <ch></ch>	Calibrated channel number
<phypt></phypt>	Calibrated port number
Parameters: <boolean></boolean>	Enables (ON) or disables (OFF) the receiver power calibration for the reference waves $a_n$ .
	*RST: OFF
Example:	See [SENSe <ch>:]CORRection:POWer<phypt>:ACQuire</phypt></ch>

# [SENSe<Ch>:]CORRection:POWer:DATA <Wave>, <CorrData>... [SENSe<Ch>:]CORRection:POWer:DATA:PORT<PhyPt> <Wave>, <CorrData>...

Reads or writes receiver power correction data sets. A power correction data set contains n real values where:

- Each value corresponds to the ratio of the actual power at the receiver input (value provided by the used source) to the uncalibrated power in dB.
- The number n is equal to the number of sweep points.

Increasing (decreasing) the values in the correction data sets increases (decreases) the input power reading. Writing correction data (the setting command) fails if the number of transferred values is not equal to the number of sweep points.

#### Suffix:

<Ch>

Calibrated channel number

<phypt></phypt>	Physical port number, used to select a specific frequency axis in arbitrary mode (with option R&S ZNB-K4).
Parameters: <wave></wave>	Identifier for the calibrated wave: 'A <n>' or 'AWAV<n>' denote correction data for the reference wave a<n>, where <n> corresponds to the port number. 'B<n>' or 'BWAV<n>' denote correction data for the reference wave b<n>.</n></n></n></n></n></n></n>
<corrdata></corrdata>	<block_data></block_data>
	Power correction values in block data format or as a comma-sep- arated list of real numbers. The query returns a list of numbers.
Example:	<ul> <li>*RST; :SWE:POIN 10</li> <li>Reset the instrument and reduce the number of sweep points to 10.</li> <li>CORR:POW:ACQ AWAVe,1,PORT,1</li> <li>Perform a receiver power calibration of the wave a<sub>1</sub> using port 1 as a source port, assuming that the transmitted source power a<sub>1</sub> is correct. No external cabling is needed.</li> <li>CORR:POW:DATA? 'AWAV1'</li> <li>Query the correction values. The analyzer returns 10 comma-separated real numbers.</li> <li>CORR:POW:DATA 'AWAV1', 1, 2, 3, 4, 5, -6, -7, -8, -9, -0</li> <li>Replace the correction values by ten (new) numbers.</li> </ul>
Manual control:	See "Start Cal Sweep" on page 309

# [SENSe<Ch>:]CORRection:POWer<PhyPt>:IMODulation:ACQuire

Starts the receiver calibration (3<sup>rd</sup> power calibration step for intermodulation measurements), stores and applies the calibration data.

Note: The receiver calibration relies on the source power calibration acquired in step nos.
1 and 2. [SENSe<Ch>:]CORRection:POWer<PhyPt>:IMODulation:ACQuire is
enabled only after steps 1 and 2 have been carried out (SOURce<Ch>:
POWer<PhyPt>:CORRection:IMODulation:LTONe[:ACQuire], SOURce<Ch>:
POWer<PhyPt>:CORRection:IMODulation:UTONe[:ACQuire]).

Suffix: <ch></ch>	Calibrated channel number
<phypt></phypt>	Port number. This suffix is ignored; the analyzer calibrates the port that is selected as a receive port for the intermodulation measurement ([SENSe <ch>:]FREQuency:IMODulation:RECeiver).</ch>
Example:	<b>See</b> SOURce <ch>:POWer<phypt>:CORRection: IMODulation:LTONe[:ACQuire]</phypt></ch>
Usage:	Event

Manual control: See "Start Cal Sweep" on page 381

#### [SENSe<Ch>:]CORRection:POWer<PhyPt>[:STATe] <Boolean>

Enables or disables the receiver power calibration for channel <Ch> and for the received waves b<PhyPt>. The setting command is disabled unless the received waves have been power calibrated ([SENSe<Ch>:]CORRection:POWer<PhyPt>:ACQuire BWAVe, ...). The query always returns a result.

<b>Suffix:</b> <ch></ch>	Calibrated channel number
<phypt></phypt>	Calibrated port number
<b>Parameters:</b> <boolean></boolean>	Enables (ON) or disables (OFF) the receiver power calibration for the received waves b <sub><phypt></phypt></sub> .*RST:OFF
Example:	<pre>*RST; CORR:POW:ACQ BWAVe,1,PORT,2 Perform a receiver power calibration of the wave b1 using port 2 as a source port, assuming that the source power a<sub>2</sub> is correct. A through connection from port 2 to port 1 is needed. CORR:POW? Check whether the calibration is applied (the response is 1). CALC:PAR:MEAS 'TRC1', 'B1D2' Select b<sub>1</sub> as a measured quantity for the default trace. CALC:MARK ON; MARK:Y?; :SOUR:POW? Create marker no. <mk> in the center of the sweep range and query the measurement value. The calibrated power of the received wave b<sub>1</sub> is approx. equal to the default source power value. See also example for [SENSe<ch>:]CORRection: POWer<phypt>:ACQuire.</phypt></ch></mk></pre>
Manual control:	See "Port Overview" on page 356

#### [SENSe<Ch>:]CORRection:SSTate?

Returns the system error correction state label of the active trace in channel <Chn>. The response is a string variable containing the calibration state label in the trace list ('Cal', 'Cai', 'Cal Off' ..; see chapter 3.5.4, "Calibration Labels", on page 84).

Suffix: <ch></ch>	Channel number used to identify the active trace.
Example:	See [SENSe <ch>:]CORRection:DATE?</ch>
Usage:	Query only
Manual control:	See "Apply" on page 295

#### [SENSe<Ch>:]CORRection[:STATe] <Boolean>

Enables or disables the system error correction for channel <Ch>.

<b>Suffix:</b> <ch></ch>	Calibrated channel number
<b>Parameters:</b> <boolean></boolean>	Enables (ON) or disables (OFF) the correction. *RST: ON
Example:	*RST; :CORR? Reset the instrument and query whether channel 1 is system error corrected. The response is 1.
Manual control:	See "User Cal Active" on page 355

# [SENSe<Ch>:]CORRection:STIMulus? [SENSe<Ch>:]CORRection:STIMulus:PORT<PhyPt>?

Queries the stimulus values of the active calibration. A calibration must be selected before the command is executed; see example.

Suffix: <ch></ch>	Channel number of the calibrated channel
<phypt></phypt>	Physical port number, used to select a specific frequency axis in arbitrary mode (with option R&S ZNB-K4).
Example:	<pre>*RST; :CORR:COLL:METH:DEF 'Test',RSHort,1 Select a one-port normalization at port 1 with a short standard as calibration type. CORR:STIM? Query the stimulus frequencies. The response contains 201 fre- quency values. CORR:COLL:SEL SHOR,1 Measure a short standard connected to port 1 and store the mea- surement results of this standard. CORR:COLL:SAVE:SEL Calculate the system error correction data and apply it to the active channel.</pre>
Usage:	Query only
Manual control:	See "Apply" on page 295

[SENSe:]CORRection:COLLect:AUTO:CKIT:PORTs < Characterization>,

<TestPort1>, <CalUnitPort1>, <TestPort2>...

Generates a characterization (cal kit file) with the specified name containing the cal kit data of the active calibration unit (SYSTem:COMMunicate:RDEVice:AKAL:ADDRess). The cal kit file can be stored in the calibration unit or written to a directory on the analyzer.

Similar logic as [SENSe:]CORRection:COLLect:AUTO:CKIT, but with flexible port assignment.

# Setting parameters:

<characterization></characterization>	Name and (possibly) directory of the created characterization / cal kit file (string parameter, extension *.calkit): If no path and directory is specified, the file is stored in the calibration unit (see also [SENSe <ch>:]CORRection:COLLect:AUTO). The factory cal- ibration data on the unit is not overwritten. If a path and directory is specified, the file is stored in the directory on the analyzer's hard disk. The default directory (MMEMory:CDIRectory) is not used.</ch>
<testport1></testport1>	Number of first test port.
<calunitport1></calunitport1>	Number of the calibration unit port to whom the first test port ( <testport1>) is assigned.</testport1>
<testport2></testport2>	Number of second test port
Usage:	Setting only
Manual control:	See "Test Port Assignment" on page 346

# [SENSe<Ch>:]CORRection:COLLect:AUTO:CONFigure <CalType>,

<Characterization>

- ---

Selects a calibration type and a cal unit characterization (cal kit file) for an automatic calibration with Multiple Port Assignments.

Suffix: <ch></ch>	Channel number of the calibrated channel
Parameters: <caltype></caltype>	FNPort   FOPort   OPTPort   FRTRans   FTRans   RTRans   UTRans   REFL   RSHort   PFNPort FNPort – full n-port (UOSM) calibration FOPort – full one-port ("Refl OSM") calibration SFTPort – separate full two-port calibrations OPTPort – one path two ports calibration PFNPort – full n-port (UOSM) calibration for SMARTerCal
<characterization></characterization>	Name and (possibly) directory of the characterization (cal kit file) to be used for the automatic calibration (string parameter): - if nothing is specified (empty string ' '), the factory cal kit file stored in the active calibration unit is used - a cal kit file name *.calkit without path addresses a specific cal kit file stored in the active calibration unit - the full path to a cal kit file addresses a specific cal kit file stored in an arbitrary directory
Example:	See [SENSe <ch>:]CORRection:COLLect:AUTO: ASSignment<asg>:DEFine.</asg></ch>
Manual control:	See "Characterization" on page 282

# www.valuetronics.com

#### [SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment:DELete:ALL

Deletes all port assignments (see chapter 3.5.5.4, "Multiple Port Assignments", on page 89).

Suffix: <ch></ch>	Channel number of the calibrated channel
Example:	<pre>See [SENSe<ch>:]CORRection:COLLect:AUTO: ASSignment<asg>:DEFine</asg></ch></pre>
Usage:	Event

[SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment:DEFine:DEFault <TestPort1>, <TestPort2>...

Creates the default port assignment(s) for the specified test ports.

The number of created assignments can be queried using the [SENSe<Ch>: ]CORRection:COLLect:AUTO:ASSignment:COUNt? command.

Use [SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment<Asg>:DEFine or [SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment<Asg>:DEFine:TPORt to define additional port assignments (for higher precision) or to set up the port assignments manually.

See chapter 3.5.5.4, "Multiple Port Assignments", on page 89 for background information.

Suffix: <ch></ch>	Channel number of the calibrated channel
<b>Parameters:</b> <testport1></testport1>	Test port number 1
<testport2></testport2>	Test port number 2
Usage:	Setting only
Manual control:	See "Default Port Assignment" on page 285

#### [SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment:COUNt?

Returns the number of configured port assignments. This is particulary useful if the default port assignment ([SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment: DEFine:DEFault) was used.

See chapter 3.5.5.4, "Multiple Port Assignments", on page 89 for background information.

<b>Suffix:</b> <ch></ch>	Channel number of the calibrated channel
Example:	See [SENSe <ch>:]CORRection:COLLect:AUTO: ASSignment<asg>:DEFine on page 732</asg></ch>
Usage:	Query only

User Manual 1173.9163.02 - 13

# www.valuetronics.com

Manual control: See "Port Assignments (Table Rows)" on page 284

[SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment<Asg>:DEFine

<TestPort1>, <CalUnitPort1>, <TestPort2>...

Explicitely defines port assignment no. <Asg> for channel no. <Ch> without relying on port auto-detection.

[See chapter 3.5.5.4, "Multiple Port Assignments", on page 89 for background information.]

With manual configuration a non-minimal set of port assignments can be created, which may increase measurement accuracy. On the other hand, it is up to the user to ensure that the created set of port assignments is complete and valid for the chosen calibration type (see [SENSe<Ch>:]CORRection:COLLect:AUTO:CONFigure).

Use the [SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment:DEFine: DEFault command to use the (complete and valid set of) default assignments instead.

**Note** that during the corresponding calibration sweep the R&S ZNB expects the physical port connections to be established exactly as defined by the port pairs. Use the [SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment<Asg>:DEFine:TPORt on page 733 command to take advantage of auto-detection of port assignments.

Suffix: <ch></ch>	Number of the channel
<asg></asg>	Number of the port assignment
<b>Parameters:</b> <testport1></testport1>	First test port number
<calunitport1></calunitport1>	Number of the calibration unit port that is assigned to the first test port
<testport2></testport2>	Second test port number

Example: Let's perform a full 3-port calibration with a two-port calibration unit, using factory characterization and the port assignments given in the table below. Prerequisite: the adequate calibration unit was selected before using SYSTem:COMMunicate:RDEVice:AKAL:ADDRess SENSe1:CORRection:COLLect:AUTO:ASSignment: DELete:ALL Deletes all available port assignments. SENSel:CORRection:COLLect:AUTO:ASSignment: CONFigure 'FNPort','' Sets the automatic calibration to "Full n-port" with factory characterization. SENSe1:CORRection:COLLect:AUTO:ASSignment1: DEFine 2,1,3,2 Creates port assignment 1 explicitly (no auto-detection). SENSe1:CORRection:COLLect:AUTO:ASSignment2: DEFine:TPORt 3,4 Creates port assignment 2 implicitely (auto-detection). Before starting the calibration sweep for port assignment 1, ensure test port 2 is connected to cal unit port 1 and test port 3 to cal unit port 2 SENSel:CORRection:COLLect:AUTO:ASSignment1: ACQUire Perfoms the calibration sweep for port assignment 1 Before starting the calibration sweep for port assignment 2, ensure test ports 3 and 4 are connected to the cal unit (in any order) SENSe1:CORRection:COLLect:AUTO:ASSignment2: ACQUire Perfoms the calibration sweep for port assignment 2; auto-detects the existing port-connections at runtime SENSe1:CORRection:COLLect:AUTO:SAVE Checks whether the acquired calibration data are sufficient to calculate the system error correction. If yes, applies them to the selected channel. Manual control: See "Port Assignments (Table Rows)" on page 284

	Ű,	, , , ,
Test Port	Port Assignment 1	Port Assignment 2
2	Cal Unit Port 1	-
3	Cal Unit Port 2	auto-detected

# [SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment<Asg>:DEFine:TPORt <TestPort1>, <TestPort2>...

Implicitly defines port assignment no. <Asg> for channel no. <Ch> by specifying the test ports to be calibrated. The port assignments for the specified test ports are **auto-detec-ted** at the start of the corresponding calibration sweep.

auto-detected

User Manual 1173.9163.02 - 13

4

With manual configuration a non-minimal set of port assignments can be created, which may increase measurement accuracy. On the other hand, it is up to the user to ensure that the created set of port assignments is complete and valid for the chosen calibration type (see [SENSe<Ch>:]CORRECTION:COLLect:AUTO:CONFigure).

Use

- [SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment:DEFine:DEFault to establish the (complete and valid set of) default assignments
- [SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment<Asg>:DEFine on page 732 to define port assignments without subsequent auto-detection

[See chapter 3.5.5.4, "Multiple Port Assignments", on page 89 for background information.]

Suffix: <ch></ch>	Number of the channel
<asg></asg>	Number of the port assignment
<b>Parameters:</b> <testport1></testport1>	First test port number
<testport2></testport2>	Second test port number
Example:	See [SENSe <ch>:]CORRection:COLLect:AUTO: ASSignment<asg>:DEFine</asg></ch>
Manual control:	See "Port Assignments (Table Rows)" on page 284

#### [SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment<Asg>:ACQuire

Starts the automatic calibration sweep for the indicated channel and port assignment.

A complete, valid set of port assignments must be defined before you can initiate a calibration. See chapter 3.5.5.4, "Multiple Port Assignments", on page 89 for background information.

Suffix: <ch></ch>	Number of the calibrated channel
<asg></asg>	Number of the port assignment
Example:	See [SENSe <ch>:]CORRection:COLLect:AUTO: ASSignment<asg>:DEFine</asg></ch>
Usage:	Event
Manual control:	See "Start Cal Sweep / Abort Sweep" on page 286

#### [SENSe<Ch>:]CORRection:COLLect:AUTO:SAVE

Calculates the system error correction for automatic calibrations with Multiple Port Assignments, saves the data and applies the calibration to the active channel.

Requires successful calibration sweeps for all related port assignments (see [SENSe<Ch>:]CORRection:COLLect:AUTO:ASSignment<Asg>:ACQuire)

Suffix: <ch></ch>	Channel number of the calibrated channel
Example:	<pre>See [SENSe<ch>:]CORRection:COLLect:AUTO: ASSignment<asg>:DEFine</asg></ch></pre>
Usage:	Event
Manual control:	See "Apply/Cancel" on page 287

#### [SENSe<Chn>:]CORRection:PSTate?

Gets the power calibration label of the active trace in channel <Chn>.

See chapter 3.5.6.3, "Power Calibration Labels", on page 95 for the possible return values.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Usage:	Query only
Manual control:	See "Apply" on page 305

#### 6.3.14.8 [SENSe:]COUPle...

The [SENSe:]COUPle... commands select the sweep mode.

#### [SENSe<Ch>:]COUPle <Order>

Determines the order of partial measurements and sweeps.

Suffix: <ch></ch>	Channel number. This suffix is ignored; the sweep mode applies to all channels in the active recall set.
Parameters:	
<order></order>	ALL   AUTO   NONE
	AUTO - optimized display update: fast sweeps are performed in alternated mode, slower sweeps in chopped mode ALL - chopped sweep mode, complete all partial measurements before proceeding to the next sweep point NONE - alternated sweep mode on, reverse the order of partial measurements and sweeps
	*RST: NONE

Example:	COUP NONE Activate the alternated sweep mode. TRIG:LINK 'PPO' Set the triggered measurement sequence equal to one partial measurement. Each trigger event starts one partial measurement for all sweep points.
Manual control:	See "Driving Mode" on page 369

# 6.3.14.9 [SENSe:]DC...

The [SENSe:]DC... commands select and configure the DC voltage measurement.

#### [SENSe<Ch>:]DC<DCInp>:RANGe <Voltage>

Assigns a DC voltage range to the rear panel input connector DC INPUT <DCInp>.

<b>Suffix:</b> <ch></ch>	Channel number
<dcinp></dcinp>	Number of DC INPUT connector on the rear panel, 1 to 4
Parameters: <voltage></voltage>	DC voltage range. The entered numeric value is rounded up to ±300 mV, ±3 V, ±20 V. Values above +20 V are rounded down. Default unit: V
Example:	SENSe1: DC2: RANGe 1; :DC2: RANGE? Select a DC measurement at DC INPUT2 with an expected DC voltage range of ±1 V. The value is rounded up; the response is 3.
Manual control:	See "Ranges > DC 1 DC 4" on page 179

#### 6.3.14.10 [SENSe:]FREQuency...

The [SENSe:]... commands set frequency-related parameters, especially the measurement and display ranges for the different sweep types. The frequency ranges for the different instrument models are listed below; for more details refer to the data sheet.

Frequency settings	R&S ZNB4	R&S ZNB8
Start, Stop	9 kHz to 4.5 GHz	9 kHz to 8.5 GHz
Center	>9 kHz to <4.5 GHz	>9 kHz to <8.5 GHz
Span	1 Hz to 4.499991 GHz	1 Hz to 8.499991 GHz



# **Option R&S ZNB-B1, Bias Tees**

If option R&S ZNB-B1 is installed, the frequency range starts at 100 kHz.

SCPI Command Reference

[SENSe <ch>:]FREQuency:CENTer</ch>	
[SENSe <ch>:]FREQuency:CONVersion</ch>	
[SENSe <ch>:]FREQuency:CONVersion:ARBitrary</ch>	738
[SENSe <ch>:]FREQuency:CONVersion:ARBitrary:PMETer<pmtr></pmtr></ch>	739
[SENSe <ch>:]FREQuency:CONVersion:GAIN:LMCorrection</ch>	740
[SENSe <ch>:]FREQuency:CONVersion:MIXer:FIXed<stg></stg></ch>	741
[SENSe <ch>:]FREQuency:CONVersion:MIXer:FUNDamental</ch>	741
[SENSe <ch>:]FREQuency:CONVersion:MIXer:IFPort</ch>	742
[SENSe <ch>:]FREQuency:CONVersion:MIXer:LOMultiplier<stg></stg></ch>	742
[SENSe <ch>:]FREQuency:CONVersion:MIXer:LOPort<stg></stg></ch>	742
[SENSe <ch>:]FREQuency:CONVersion:MIXer:MFFixed</ch>	743
[SENSe <ch>:]FREQuency:CONVersion:MIXer:RFMultiplier</ch>	744
[SENSe <ch>:]FREQuency:CONVersion:MIXer:RFPort</ch>	745
[SENSe <ch>:]FREQuency:CONVersion:MIXer:STAGes</ch>	745
[SENSe <ch>:]FREQuency:CONVersion:MIXer:TFRequency<stg></stg></ch>	745
[SENSe <ch>:]FREQuency[:CW]</ch>	
[SENSe <ch>:]FREQuency:FIXed</ch>	746
[SENSe <ch>:]FREQuency:IMODulation:CONVersion</ch>	747
[SENSe <ch>:]FREQuency:IMODulation:LTONe</ch>	747
[SENSe <ch>:]FREQuency:IMODulation:ORDer<im>[:STATe]</im></ch>	748
[SENSe <ch>:]FREQuency:IMODulation:RECeiver</ch>	
[SENSe <ch>:]FREQuency:IMODulation:SPECtrum:MORDer</ch>	
[SENSe <ch>:]FREQuency:IMODulation:SPECtrum[:STATe]</ch>	
[SENSe <ch>:]FREQuency:IMODulation:TDIStance</ch>	
[SENSe <ch>:]FREQuency:IMODulation:UTONe</ch>	
[SENSe <ch>:]FREQuency:SBANd</ch>	
[SENSe <ch>:]FREQuency:SEGMent:AXIS</ch>	
[SENSe <ch>:]FREQuency:SPAN</ch>	
[SENSe <ch>:]FREQuency:STARt</ch>	
[SENSe <ch>:]FREQuency:STOP</ch>	

#### [SENSe<Ch>:]FREQuency:CENTer <CenterFreq>

Defines the center of the measurement and display range for a frequency sweep (sweep range). The default center frequency is the center of the analyzer's maximum frequency range:  $(f_{MIN} + f_{MAX})/2$ . The range depends on the instrument model; see table 6-9.

# Suffix:

<ch></ch>	Channel number
Parameters: <centerfreq></centerfreq>	Center frequency of the sweep Increment: 0.1 kHz Default unit: Hz
Example:	*RST; :SYST:FREQ? MIN; :SYST:FREQ? MAX Query the frequency range of the analyzer. FREQ:CENT 100MHz Set center frequency to 100 MHz. FREQ:SPAN 50000 Set frequency span to 50 kHz.

Manual control: See "Start / Stop / Center / Span Frequency (Power / Time)" on page 256

**Note:** The measurement range defined by means of the center frequency and the current span ([SENSe<Ch>:]FREQuency:SPAN) must not exceed the allowed frequency range of the analyzer. If necessary, the span is reduced to min (<CenterFreq>  $- f_{MIN}$ ,  $f_{MAX} -$ <CenterFreq>).

[SENSe <ch>:]FREQuency:CONVersion <conversionmode></conversionmode></ch>		
Enables a frequency conversion measurement mode for channel <ch>.</ch>		
<b>Suffix:</b> <ch></ch>	Channel number	
Parameters: <conversionmode></conversionmode>	FUNDamental   ARBitrary FUNDamental - measurement of the fundamental signal (no fre- quency-converting mode). This selection cancels all port-specific frequency and power settings (see example). ARBitrary - frequency conversion mode (arbitrary port frequen- cies). This mode is automatically activated when a port-specific frequency is defined. MIXer scalar mixer mode. The mixer mode is configured using the [SENSe <ch>:]FREQuency:CONVersion:MIXer com- mands. *RST: FUNDamental</ch>	
Example:	See SOURce <ch>:FREQuency<phypt>:CONVersion: ARBitrary:IFRequency</phypt></ch>	
Manual control:	See "Reset Port Settings" on page 367	

# [SENSe<Ch>:]FREQuency:CONVersion:ARBitrary <Numerator>, <Denominator>, <Offset>, <SweepType>

Defines the receiver frequency for frequency-converting measurements. The receiver frequency is either a range (for frequency sweeps) or a CW frequency (for power, time and CW Mode sweeps). The receiver frequency is valid for all ports.

**Note:** The frequency formula is applied even if the analyzer returns an error message, because the frequency is outside the allowed range.

Suffix: <Ch>

Channel number

# Parameters:

<numerator>, <denominator>, <offset></offset></denominator></numerator>	Parameters of the frequency formula. The receiver frequencies calculated according to $f_r = $ Numerator>/ <denominator>*<math>f_b</math>. + <offset> where <math>f_b</math> represents the channel base frequency (parameter SWEep). For parameters CW or FIXed, <math>f_b = 0</math>. Note: The <offset> parameter also includes the "Offset Ramanual control. The following restrictions apply to the numeric values: <numerator> - values are rounded to positive or negative in numbers; zero is not allowed. <denominator> - values are rounded to positive integer num <offset> - values are rounded to (positive or negative) multiple of 1 Hz.</offset></denominator></numerator></offset></offset></denominator>	er atio" in nteger mbers.
	Range:The converted frequency or frequency range m within the analyzer's frequency range, depend the instrument model.*RST:The default frequency/frequency range corres to the sweep range or CW frequency of the and i.e. <numerator> = <denominator> = 1, <offset </offset Hz</denominator></numerator>	ling on ponds alyzer,
<sweeptype></sweeptype>	$\begin{array}{ll} CW \mid FIXed \mid SWEep \\ SWEep & - \text{ the full formula is applied. For frequency sweeps} \\ command \ defines \ a \ sweep \ range. \\ CW \mid FIXed & - \ the reduced \ formula \ with \ f_b = 0 \ is applied; \ the mand \ defines \ a \ fixed \ frequency. \\ \\ *RST: \qquad SWEep \end{array}$	
Example:	*RST; FREQ:STAR 1E+9; STOP 1.1E+9 Reset the analyzer (activating a frequency sweep) and set sweep range between 1 GHz and 1.1 GHz. SENS:FREQ:CONV:ARB 2, 1, 1E+9, SWE Convert the receiver frequency to the range between 3 GH 3.2 GHz.	

[SENSe<Ch>:]FREQuency:CONVersion:ARBitrary:PMETer<Pmtr> <Numerator>, <Denominator>, <Offset>, <SweepType>

Defines the receiver frequency of a power meter used for frequency-converting measurements. The receiver frequency is either a range (for frequency sweeps) or a CW frequency (for power, time and CW Mode sweeps). The receiver frequency is valid for all ports.

<Numerator>, <Denominator> and <Offset> are parameters of the frequency formula. The receiver frequency  $f_r$  is calculated according to

f<sub>r</sub> = <Numerator>/<Denominator> \* f<sub>b</sub> + <Offset>

where  $f_b$  represents the channel base frequency (parameter <code>SWEep</code>). For parameters <code>CW or FIXed</code>,  $f_b$  = 0.

<Numerator>, <Denominator> and <Offset> values are rounded to positive or negative integer numbers; zero is not allowed.

Note:

- The default frequency or frequency range corresponds to the sweep range or CW frequency of the analyzer.
- The <Offset> parameter also includes the "Offset Ratio" in manual control.
- The converted frequency or frequency range must be within the power meter's receiver frequency range. Nevertheless, the frequency formula is applied even if the analyzer returns an error message, because the frequency is outside the allowed range.

Suffix: <ch></ch>	Channel number		
-			
<pmtr></pmtr>	Power meter number		
Parameters: <pre><numerator></numerator></pre>	*RST: 1		
<denominator></denominator>	*RST: 1		
<offset></offset>	*RST: 0 Default unit: Hz		
<sweeptype></sweeptype>	CW   FIXed   SWEep SWEep - the full formula is applied. For frequency sweeps, the command defines a sweep range. CW   FIXed - the reduced formula with f <sub>b</sub> = 0 is applied; the com- mand defines a fixed frequency. *RST: SWEep		
Example:	<ul> <li>*RST; FREQ:STAR 1E+9; STOP 1.1E+9</li> <li>Reset the analyzer (activating a frequency sweep) and set the sweep range between 1 GHz and 1.1 GHz.</li> <li>SYST:COMM:RDEV:PMET1:DEF 'USB Power Meter', 'NRP-Z55', 'usb', '100045'</li> <li>Configure an R&amp;S NRP power meter as external power meter no. 1, assigning the name USB Power Meter and an serial number 100045.</li> <li>SENS:FREQ:CONV:ARB:PMET 2, 1, 1E+9, SWE</li> <li>Convert the receiver frequency to the range between 3 GHz and 3.2 GHz.</li> </ul>		
Manual control:	See "Frequency conversion formula" on page 367		

#### [SENSe<Ch>:]FREQuency:CONVersion:GAIN:LMCorrection <Boolean>

Enables or disables the load match correction for frequency conversion transmission Sparameters (conversion gain factors).

User Manual 1173.9163.02 - 13

www.valuetronics.com

Manual control:	See "Load Match Correction" on page 355	
Example:	See SOURce <ch>:FREQuency<phypt>:CONVersion: ARBitrary:IFRequency</phypt></ch>	
Parameters: <boolean></boolean>	*RST: ON	
Suffix: <ch></ch>	Channel number	

# [SENSe<Ch>:]FREQuency:CONVersion:MIXer:FIXed<Stg> <InputOutput>

Selects the mixer input or output signal which is at the fixed frequency defined via [SENSe<Ch>:]FREQuency:CONVersion:MIXer:MFFixed.

Suffix: <ch></ch>	Channel number.		
<stg></stg>	Counter for fixed signal (1 if only one mixer stage is used, 1 or 2 for 2 mixer stages).		
Parameters:			
<inputoutput></inputoutput>	RF   LO   LO1   LO2   IF		
	RF - mixer input signal		
	LO   LO1   LO2 - local oscillator signal 1 or 2 (for 2-stage mixer measurements, see [SENSe <ch>:] FREQuency:</ch>		
	CONVersion:MIXer:STAGes)		
	IF - mixer output signal (mixing product)		
	*RST: LO		
Example:	See [SENSe <ch>:]FREQuency:CONVersion:MIXer: MFFixed</ch>		

#### [SENSe<Ch>:]FREQuency:CONVersion:MIXer:FUNDamental <InputOutput>

Selects the mixer input or output signal which is at the fundamental frequency (channel frequency, to be defined by means of [SENSe<Ch>:]FREQuency:STARt, [SENSe<Ch>:]FREQuency:STOP, [SENSe<Ch>:]FREQuency:CW etc.).

Suffix: <ch>Cha</ch>	annel number.
RF LO mea CON	LO LO1 LO2 IF - mixer input signal  LO1 LO2 - local oscillator signal 1 or 2 (for 2-stage mixer asurements; see [SENSe <ch>:]FREQuency: Wersion:MIXer:STAGes) mixer output signal (mixing product) ST: RF</ch>

SCPI Command Reference

Manual control:	See "Frequency (table)" on page 384
	MFFixed
Example:	See [SENSe <ch>:]FREQuency:CONVersion:MIXer:</ch>

# [SENSe<Ch>:]FREQuency:CONVersion:MIXer:IFPort <PortNumber>

Selects an analyzer port as receive port for the IF signal.

Suffix: <ch></ch>	Channel nur	nber
Parameters: <portnumber></portnumber>	Range: *RST:	1 to number of test ports 2
Example:	See [SENSe <ch>:]FREQuency:CONVersion:MIXer: MFFixed</ch>	
Manual control:	See "Port Se	ettings" on page 383

# [SENSe<Ch>:]FREQuency:CONVersion:MIXer:LOMultiplier<Stg> <Numerator>, <Denominator>

Selects the frequency conversion factors for the LO signal.

The conversion factor is a ratio of two positive integers: numerator and denominator.

<b>Suffix:</b> <ch></ch>	Channel nu	mber
<stg></stg>	Mixer stage signals LO 1 or LO 2; see [SENSe <ch>: ]FREQuency:CONVersion:MIXer:STAGes</ch>	
Parameters: <numerator></numerator>	Range: *RST:	1, 2, 3 1
<denominator></denominator>	Range: *RST:	1, 2, 3 1
Example:	See [SENSe <ch>:]FREQuency:CONVersion:MIXer: MFFixed</ch>	
Manual control:	See "Multiplication (table)" on page 385	

[SENSe<Ch>:]FREQuency:CONVersion:MIXer:LOPort<Stg> <SourceType>[, <SourceNumber>]

Selects an analyzer or an external generator port as a signal source for the LO1 or LO2 signal.

Note:

If External Switch Matrices are part of the RF connection configuration, operation with Internal Second Source (R&S ZNB-B2) is *not* supported. In this case only external generators can be used as local oscillators.

Suffix: <ch></ch>	Channel number
<stg></stg>	Mixer stage (signals LO 1 or LO 2; see [SENSe <ch>: ]FREQuency:CONVersion:MIXer:STAGes).</ch>
Parameters:	
<sourcetype></sourcetype>	PORT   GENerator   NONE
	NONE – LO signal is not controlled by the analyzer. PORT – analyzer port GENerator – external generator *RST: NONE
<b>a</b>	
<sourcenumber></sourcenumber>	Number of analyzer port or generator.
Example:	See [SENSe <ch>:]FREQuency:CONVersion:MIXer: MFFixed</ch>
Manual control:	See "Port Settings" on page 383

# [SENSe<Ch>:]FREQuency:CONVersion:MIXer:MFFixed <InputOutput>[,

<FixedFrequency>]

Assigns a fixed frequency to the RF, LO 1, LO 2, or to the IF signal. The fixed frequency setting becomes active if the port is selected as a port with fixed frequency ( [SENSe<Ch>:] FREQuency:CONVersion:MIXer:FIXed<Stg>).

<b>Suffix:</b> <ch></ch>	Channel n	umber
Parameters:		
<inputoutput></inputoutput>	RF   LO   LO1   LO2   IF	
	Fixed frequency for the specified port RF – mixer input signal LO   LO1 – local oscillator signal no. 1 LO2 – local oscillator signal no. 2, for 2-stage mixer measurement ([SENSe <ch>:] FREQuency: CONVersion: MIXer: STAGes IF – mixer output signal</ch>	
	Range:	Depending on the instrument model [Hz]. The incre- ment (parameters UP or DOWN) is 0.1 kHz. Minimum of the analyzer's frequency range
<fixedfrequency></fixedfrequency>	Default un	it: Hz

Example: The following example assume a four-port analyzer with independent source ports no. 1 and 3. Moreover, an external generator Gen 1 must be connected to the analyzer and configured. \*RST; FREQ:CONV:MIX:STAG 2 Select a mixer measurement with two mixer stages. FREQ:CONV:MIX:RFSource 1; IFSource 2 Select the analyzer port 1 as a source port for the RF signal, port 2 as a receive port for the IF signal. FREQ:CONV:MIX:LOSource1 PORT, 3; LOSource2 GEN, 1 Select port 3 as a source port for the local oscillator LO1, port 3 as a source for LO 2. FREQ:CONV:MIX:RFMultiplier 2, 1; LOMultiplier1 2, 1 ; LOMultiplier2 2, 1 Define frequency conversion factors 2 for the RF signals and the LO signals. FREQ:STARt 1GHz; STOP 2 GHZ Select a sweep range between 1 and 2 GHz. FREQ:CONV:MIX:FIXed1 L01; FIXed2 L02 Assign fixed frequency settings to the two LO signals. FREQ:CONV:MIX:FUNDamental RF; MFFixed LO1, 10 MHz; MFFixed LO2, 10 MHz Assign the channel base frequency (sweep range) to the RF signal, fixed frequencies of 10 MHz to both LO signals. FREQ:CONV:MIX:TFRequency1 DCUP; TFRequency2 UCON Select down-conversion (USB) at the first mixer-stage, up-conversion (USB) at the second mixer stage. SOUR: FREQ: CONV: MIX: PMODe RF, FUNDamental; PMODE LO1, FIXed; PMODe LO2, FIXed; PMODe IF, FUNDamental Assign the channel base power to the RF and IF signals, a fixed power to the LO signals. SOUR: FREQ: CONV: MIX: PMFixed LO1, -20; PMFixed LO2, -10 Define the fixed powers of the LO signals. Manual control: See "Frequency (table)" on page 384

[SENSe<Ch>:]FREQuency:CONVersion:MIXer:RFMultiplier <Numerator>, <Denominator>

Selects the frequency conversion factor for the RF signal. The conversion factor is a ratio of two positive integers (numerator, denominator).

# Suffix:

<Ch> Channel number

#### Parameters:

<Numerator>

Range: 1, 2, 3 ...

1

\*RST:

<denominator></denominator>	Range: *RST:	1, 2, 3 1
Example:	See [SEN MFFixed	<pre>Se<ch>:]FREQuency:CONVersion:MIXer:</ch></pre>
Manual control:	See "Multi	plication (table)" on page 385

#### [SENSe<Ch>:]FREQuency:CONVersion:MIXer:RFPort <Port>

Selects a test port as source port for the RF signal.

Suffix: <ch></ch>	Channel number	
Parameters: <port></port>	Test port nu Range: *RST:	mber 1 to number of test ports 1
Example:	See [SENSe <ch>:]FREQuency:CONVersion:MIXer: MFFixed</ch>	
Manual control:	See "Port Se	ettings" on page 383

# [SENSe<Ch>:]FREQuency:CONVersion:MIXer:STAGes <Stages>

Selects the number of mixer stages for scalar mixer measurements.

<b>Suffix:</b> <ch></ch>	Channel number	
Parameters: <stages></stages>	Number of mixer stages Range: 1   2 *RST: 1	
Example:	See [SENSe <ch>:]FREQuency:CONVersion:MIXer: MFFixed</ch>	
Manual control:	See "2nd Mixer" on page 386	

# [SENSe<Ch>:]FREQuency:CONVersion:MIXer:TFRequency<Stg> <IFConversionMode>

Selects the frequency conversion mode of the IF signal.

Suffix:	
<ch></ch>	Channel number.
<stg></stg>	Mixer stage (1 or 2; see [SENSe <ch>:] FREQuency:</ch>
	CONVersion:MIXer:STAGes.

#### Parameters:

<IFConversionMode> DCUPper | DCLower | UCONversion | BAND1 | BAND2

	DCUPper   BAND2 – IF = RF - LO (down conversion upper side- band, equivalent to BAND2) DCLower   BAND1– IF = LO - RF (down conversion lower side- band, equivalent to BAND1) UCONversion – IF = LO + RF (up conversion) *RST: DCUPper		
Example:	*RST; FREQ:CONV:MIX:LOF 3 GHz Reset the analyzer and specify a fixed frequency of 1 GHz, to be assigned to the LO signal. FREQ:STAR 1 GHz; STOP 2 GHz Define a sweep range between 3 and 4 GHz, to be assigned to the RF signal. FREQ:CONV:MIX:TFR DCL Select down conversion to the lower sideband, corresponding to an IF frequency range between 2 GHz and 1 GHz.		
Manual control:	See "Conversion" on page 386		

# [SENSe<Ch>:]FREQuency[:CW] <FixedFreq> [SENSe<Ch>:]FREQuency:FIXed <FixedFreq>

Defines the fixed (Continuous Wave, CW) frequency for all sweep types operating at fixed frequency (power sweep, time sweep, CW mode sweep). The two command forms [SENSe<Ch>:]FREQuency[:CW] and [SENSe<Ch>:]FREQuency:FIXed are equivalent.

This command also defines the center frequency of the intermodulation spectrum diagram (option R&S ZNB-K14). The frequency range depends on the R&S ZNB model; see chapter 6.3.14, "[SENSe:] Commands", on page 676.

**Note:** [SENSe<Ch>:] FREQuency[:CW] |:FIXed is equivalent to SOURce<Ch>: FREQuency<PhyPt>[:CW] |:FIXed. Source and receiver frequency are always equal; the four commands overwrite each other.

With option R&S ZNB-K4, Frequency Conversion Measurements, port-specific source and receiver frequencies can be defined; see SOURce<Ch>:FREQuency<PhyPt>: CONVersion:ARBitrary:IFRequency.

#### Suffix:

<Ch>

Channel number

# Parameters:

<FixedFreq>

Fixed stimulus and analyzer frequency Increment: 0.1 kHz \*RST: 1 GHz Default unit: Hz

Example:	FUNC "XPOW: POW: A1" Activate a power sweep and select the wave quantity a <sub>1</sub> as mea		
	sured parameter for channel and trace no. 1.		
	FREQ:CW 100MHz Set the CW frequency to 100 MHz.		
Manual control:	See "CW Frequency" on page 256		

#### [SENSe<Ch>:]FREQuency:IMODulation:CONVersion <OFF>

Disables the intermodulation measurement and switches back to normal mode (no frequency conversion).

<b>Suffix:</b> <ch></ch>	Channel number	
Setting parameters: <off></off>	OFF Disable intermodulation measurement *RST: n/a	
Example:	See [SENSe <ch>:]FREQuency:IMODulation:LTONe</ch>	
Usage:	Setting only	
Manual control:	See "Reset Frequency Conv Intermod" on page 373	

[SENSe<Ch>>:]FREQuency:IMODulation:LTONe <SourceType>[, <SourceNumber>]

Selects the source for the lower tone signal that is used for the intermodulation measurement.

Suffix: <ch></ch>	Channel nur	mber	
Parameters: <sourcetype></sourcetype>	PORT Lower tone	source; internal source at port <arg1></arg1>	
<sourcenumber></sourcenumber>	Number of the port for the internal source		
	Range: *RST:	1 to port number of the analyzer/number of external generators n/a (for all parameters)	

# [SENSe<Ch>:]FREQuency:IMODulation:ORDer<Im>[:STATe] <Boolean>

Enables or disables the measurement of the intermodulation products of order <IM order>.

Suffix: <ch> <im></im></ch>	Channel number Order of IM products	
Parameters: <boolean></boolean>	ON   OFF – enables or disables measurement *RST: ON (for <im> = 3), OFF (for <im> &gt; 3)</im></im>	
Example:	See [SENSe <ch>:]FREQuency:IMODulation:LTONe</ch>	
Manual control:	See "Prepare Measurement of IM Order " on page 378	

# [SENSe<Ch>:]FREQuency:IMODulation:RECeiver <PortNumber>

Selects the receiving port for the intermodulation measurement.

Suffix: <Ch>

Channel number

Parameters: <pre><portnumber></portnumber></pre>	Analyzer port number		
	Range: *RST:	1 to the number of analyzer ports 2	
Example:	See [SENSe <ch>:]FREQuency:IMODulation:LTONe</ch>		
Manual control:	See "Receiving Port" on page 377		

# [SENSe<Ch>:]FREQuency:IMODulation:SPECtrum:MORDer <IMOrder>

Defines the maximum order of intermodulation products for the intermodulation spectrum measurement.

<b>Suffix:</b> <ch></ch>	Channel number	
Parameters: <imorder></imorder>	Maximum o Range: *RST:	rder of IM products 3   5   7   9 3
Example:	<pre>See [SENSe<ch>:]FREQuency:IMODulation:SPECtrum[: STATe]</ch></pre>	
Manual control:	See "CW Mode Spectrum" on page 373	

#### [SENSe<Ch>:]FREQuency:IMODulation:SPECtrum[:STATe] <Boolean>

Enables or disables the measurement of the intermodulation spectrum. If a new channel is desired, the trace must be created separately; see second example below.

Suffix: <ch></ch>	Channel number
Parameters: <boolean></boolean>	ON   OFF - enables or disables intermodulation spectrum mea- surement.
	*RST: OFF

Example:	Intermodulation spectrum measurement within the active channel. *RST; FREQ: IMOD: LTON PORT, 1; UTON GEN, 1 Reset the instrument to create the default channel no. 1. Select port 1 as a source port for the lower tone, a (previously configured) external generator no. 1 as a source port for the upper tone. FREQ: STAR 1GHZ; STOP 2GHz Define a suitable sweep range to ensure that the analyzer can measure all intermodulation products. SENS1: FREQ: IMOD: SPEC ON Enable the intermodulation spectrum measurement for channel no. 1. CALC1: PAR: CAT? Query the traces in channel no. 1. The response is 'Trc1, B2D1SAM'. SENS1: FREQ 1.5 GHz; :SENS1: FREQ: IMOD: SPEC: MORD 9 Adjust the center frequency and the maximum IM order of the spectrum intermodulation diagram.
Example:	Intermodulation spectrum measurement in a new channel. *RST; FREQ: IMOD: LTON PORT, 1; UTON GEN, 1 Reset the instrument to create the default channel no. 1. Select port 1 as a source port for the lower tone, a (previously configured) external generator no. 1 as a source port for the upper tone. FREQ: STAR 1GHZ; STOP 2GHz Define a suitable sweep range to ensure that the analyzer can measure all intermodulation products. CALC2: PAR: SDEF 'Trc2', 'S21' Create a new channel no. 2 and a trace named 'Trc2'. Select S <sub>21</sub> as a measured quantity. DISP: WIND: TRAC2: FEED 'Trc2' Display the new trace in diagram no. 1. SENS2: FREQ: IMOD: SPEC ON Enable the intermodulation spectrum measurement for the new channel no. 2. CALC2: PAR: CAT? Query the traces in channel no. 2. The response is 'Trc2, B2D1SAM'.
Manual control:	See "CW Mode Spectrum" on page 373

# [SENSe<Ch>:]FREQuency:IMODulation:TDIStance <ToneDistance>

Defines the tone distance (frequency offset) between the upper and the lower tone.

Suffix: <Ch>

Channel number

Parameters: <pre><tonedistance></tonedistance></pre>	Upper tone frequency minus lower tone frequency.		
	Range: *RST: Default unit	Lower limit: 0 Hz, upper limit depending on the instru- ment model and the sweep range for the lower tone. 1 MHz : Hz	
Example:	See [SENSe <ch>:]FREQuency:IMODulation:LTONe</ch>		
Manual control:	See "Tone Distance" on page 378		

#### [SENSe<Ch>>:]FREQuency:IMODulation:UTONe <SourceType>[, <arg1>]

Selects the source for the upper tone signal that is used for the intermodulation measurement.

# Note:

If External Switch Matrices are part of the RF connection configuration, operation with Internal Second Source (R&S ZNB-B2) is *not* supported. In this case only external generators can be used as upper tone generator.

Suffix:		
<ch></ch>	Channel nu	mber
Parameters:		
<sourcetype></sourcetype>	PORT   GE	Nerator   NONE
	Upper tone	source:
	NONE – no	source selected (for query only)
	PORT – inte	ernal second source at port <arg1></arg1>
	GENerator	– configured external generator no. <arg1></arg1>
	*RST:	NONE
<arg1></arg1>	Analyzer po	ort number or generator number
	Range:	1 to number of ports of the analyzer or number of configured external generators
	*RST:	n/a (no analyzer or generator port selected)
Example:	See [SENS	e <ch>:]FREQuency:IMODulation:LTONe</ch>
Manual control:	See "Upper	Tone" on page 377

#### [SENSe<Ch>:]FREQuency:SBANd <Sideband>

Defines whether the analyzer measures with a local oscillator frequency LO below or above the RF input frequency.

**Tip:** In a segmented frequency sweep, it is possible to set the sideband (SBANd) parameter individually for each segment; see [SENSe<Ch>:]SEGMent<Seg>:DEFine. The [SENSe<Ch>:]FREQuency:SBANd setting is global and not valid for segmented sweeps. The two sideband settings do not overwrite each other.

Suffix:	
<ch></ch>	Channel number. This suffix is ignored; the setting applies to all channels in the active recall set.
Parameters:	
<sideband></sideband>	POSitive   NEGative   AUTO
	<b>POSitive</b> LO > RF; the LO frequency is always above the measured RF frequency.
	<b>NEGative</b> LO < RF; the LO frequency is always below the measured RF frequency.
	AUTO
	The analyzer auto-selects the LO frequency, depending on the receiver (RF) frequency.
	*RST: AUTO
Example:	*RST; :SWE:TYPE?; :FREQ:SBAN? Query the *RST values for the sweep type and the sideband set- ting. The response is LIN (linear frequency sweep) and AUTO (automatic setting of the LO frequency).
Manual control:	See "Image Suppr." on page 369

# [SENSe<Ch>:]FREQuency:SEGMent:AXIS <Scale>

Selects either frequency based or point based x-axis for segmented sweeps.

Suffix: <ch></ch>	Channel number
Parameters: <scale></scale>	POINt   FREQuency
Example:	<pre>SENSe:SEGMent:INSert 1MHZ, 1.1MHZ, 101, -21DBM, 0.5S, 0, 10KHZ SENSe:SEGMent:INSert 2MHZ, 3MHZ, 101, -21DBM, 0.5S, 0, 10KHZ Create two sweep segments with different frequency spans, each with 101 sweep points. SENSe:SEGMent:FREQuency:AXIS POINt Select the point based frequency axis. The first 101 sweep points are distributed over the left half of the diagram, the second 101 points over the right half.</pre>
Manual control:	See "Seg x-Axis" on page 270

#### [SENSe<Ch>:]FREQuency:SPAN <Span>

Defines the width (span) of the measurement and display range for a frequency sweep (sweep range). The default span equals to the maximum frequency range of the analyzer:  $f_{MAX} - f_{MIN}$ . The range depends on the instrument model; see table 6-9

Suffix: <ch></ch>	Channel number
Parameters: <span></span>	Frequency span of the sweep Increment: 0.1 kHz Default unit: Hz
Example:	See [SENSe <ch>:]FREQuency:CENTer</ch>
Manual control:	See "Start / Stop / Center / Span Frequency (Power / Time)" on page 256

**Note:** The measurement range defined by means of the span and the current center frequency ([SENSe<Ch>:]FREQuency:CENTer), must not exceed the allowed frequency range of the analyzer. If necessary, the center frequency is adjusted to  $f_{MIN}$  + <Span>/2 or  $f_{MAX}$  - <Span>/2.

# [SENSe<Ch>:]FREQuency:STARt <StartFreq> [SENSe<Ch>:]FREQuency:STOP <StopFreq>

These commands defines the start and stop frequency for a frequency sweep. The values also define display range in a Cartesian diagram. The default start and stop frequencies equal to the minimum and maximum frequency of the analyzer.

The ranges depend on the instrument model; see Frequency ranges of R&S ZNB analyzers.

<b>Suffix:</b> <ch></ch>	Channel number
Parameters: <stopfreq></stopfreq>	Start and stop frequency of the sweep Increment: 0.1 kHz Default unit: Hz
Example:	*RST; FREQ: STAR 100000 Activate a frequency sweep and set the start frequency to 100 kHz. FREQ: STOP 10MHz Set the stop frequency to 10 MHz.
Manual control:	See "Start / Stop / Center / Span Frequency (Power / Time)" on page 256

**Note:** If the start frequency entered is greater than the current stop frequency, the stop frequency is set to the start frequency plus the minimum frequency span ( [SENSe<Ch>:]FREQuency:SPAN). If the stop frequency entered is smaller than the current start frequency, the start frequency is set to the stop frequency minus the minimum frequency span.

# 6.3.14.11 [SENSe:]LPORt...

The [SENSe:]LPORt... commands define the reference impedances of the balanced ports.

[SENSe <ch>:]LPORt<logpt>:ZCOMmon</logpt></ch>	754
[SENSe <ch>:]LPORt<logpt>:ZDIFferent</logpt></ch>	754

[SENSe<Ch>:]LPORt<LogPt>:ZCOMmon <RealPart>[, <ImaginaryPart>] [SENSe<Ch>:]LPORt<LogPt>:ZDIFferent <RealPart>[, <ImaginaryPart>]

These commands specify the complex common mode and differential mode reference impedances for the balanced (logical) port numbered <LogPt>.

Suffix:		
<ch></ch>	Channel number	
<logpt></logpt>	Logical port number. The logical ports must be defined using SOURce <ch>:LPORt<logpt> <physicalport1>, <physicalport2>. An n port analyzer supports a maximum of n/2 (n even) or (n - 1)/2 (n odd) logical ports.</physicalport2></physicalport1></logpt></ch>	
Parameters:		
<realpart></realpart>	Real part of the port impedance.	
	Range:1 mΩ to 10 MΩ*RST:ZCOMmon: 25 Ω; ZDIFferent: 100 Ω (real impedances)Default unit:Ohm	
<imaginarypart></imaginarypart>	Imaginary part of the port impedance; may be omitted to define a real impedance.	
	Range:- 10 M $\Omega$ to 10 M $\Omega$ *RST:0 $\Omega$ (real impedances)Default unit:Ohm	
Example:	*RST; :CALC:PAR:DEL 'TRC1' Reset the analyzer and delete the (default) trace for channel no. 1. SOUR:LPOR1 1,2 Combine the physical ports no. 1 and 2 to define the balanced (logical) port no. 1. LPOR1:ZDIF 27, 2 Specify a complex differential mode reference impedance of $27\Omega + j * 2\Omega$ for the defined port.	
Manual control:	See "Common Mode / Differential Mode" on page 159	

User Manual 1173.9163.02 - 13

# www.valuetronics.com

#### 6.3.14.12 [SENSe:]PAE...

The [SENSe:]PAE... commands configure the measurement of the Power Added Efficiency of an active 2-port device.

#### [SENSe<Ch>:]PAE:DCINput:MAIN <Input>

Selects the first (main) DC INPUT connector for the PAE measurement (used for all measurement types; see example).

Suffix: <ch></ch>	Channel number
Parameters: <input/>	DC1   DC2   DC3   DC4 Rear panel connectors DC INPUT 1 4 *RST: DC1
Example:	See [SENSe <ch>:]PAE:TYPE</ch>
Manual control:	See "Connector buttons" on page 181

#### [SENSe<Ch>:]PAE:DCINput:SECondary <Input>

Selects the secondary DC INPUT connector for the PAE measurement (used for measurement type "Voltage and Current" only; see example). The main DC input ( [SENSe<Ch>:]PAE:DCINput:MAIN) and the secondary DC input must be different from each other.

Suffix: <ch></ch>	Channel number
Parameters: <input/>	DC1   DC2   DC3   DC4
	Rear panel connectors DC INPUT 1 4 *RST: DC2
Example:	See [SENSe <ch>:]PAE:TYPE</ch>
Manual control:	See "Connector buttons" on page 181

#### [SENSe<Ch>:]PAE:PARameters:I <Current>

Defines the constant DC supply current I<sub>0</sub> for the PAE measurement (measurement type: "Constant Current Source"; see example).

Suffix: <Ch>

Channel number

Parameters: <Current>

\*RST: 0 A Default unit: A

Example: See [SENSe<Ch>:] PAE:TYPE

Manual control: See "Formula" on page 181

#### [SENSe<Ch>:]PAE:PARameters:R <Resistance>

Defines the resistance R of the precision resistor used for the PAE measurement (measurement types: "Constant Voltage Source" or "Voltage and Current"; see example).

<b>Suffix:</b> <ch></ch>	Channel number	
Parameters: <resistance></resistance>	Range: *RST: Default unit	0 Ohm to 1E+9 Ohm 50 Ohm : Ohm
Example:	See [SENS	e <ch>:]PAE:TYPE</ch>
Manual control:	See "Formu	ıla" on page 181

#### [SENSe<Ch>:]PAE:PARameters:U <Voltage>

Defines the constant DC supply voltage  $U_0$  for the PAE measurement (measurement type "Constant Voltage Source"; see example).

Channel number	
*RST: 0 V Default unit: V	
See [SENSe <ch>:]PAE:TYPE</ch>	
See "Formula" on page 181	

#### [SENSe<Ch>:]PAE:TYPE <Type>

Selects the measurement type for the Power Added Efficiency (PAE) measurement. The three measurement types involve different test setups, input parameters, and DC voltage measurements.

Suffix: <ch></ch>	Channel number
<b>Parameters:</b> <type></type>	VOLTage   CURRent   VCURrent
	Constant voltage source, constant current source, voltage and current
	*RST: VOLTage

Example:	SENSe1:PAE:TYPE VOLTage Select a measurement type with constant voltage source. SENSe1:PAE:PARameters:U 5V; R 500hm Define the parameters for the PAE measurement. SENSe1:PAE:DCINput:MAIN DC1; :DC1:RANGe 20 Define the DC connector and power range
	Alternative measurement type: constant current source.
	SENSe1:PAE:TYPE CURRent
	SENSe1:PAE:PARameters:I 100mA
	SENSe1:PAE:DCINput:MAIN DC1; :DC1:RANGe 20
	Alternative measurement type: voltange and current. SENSe1:PAE:TYPE VCURrent
	SENSe1:PAE:PARameters:R 500hm
	SENSe1:PAE:DCINput:MAIN DC1; :DC1:RANGe 3
	SENSe1:PAE:DCINput:SECondary DC2; :DC2:RANGe 20
	For all measurement types:
	CALCulate1:PARameter:SDEFine 'Trc1', 'PAE21'
	DISPlay:WINDow1:TRACe:FEED 'Trc1'
	Select a PAE measurement with port 1 as a source port, port 2 as a receive port.
Manual control:	See "Measurement Type" on page 180

# 6.3.14.13 [SENSe:]PORT...

The [SENSe:]PORT... commands define the reference impedances at the physical ports.

# [SENSe<Ch>:]PORT<PhyPt>:ZREFerence <RealPart>[, <ImaginaryPart>]

Specifies the complex reference impedance for the physical port numbered <PhyPt>.

Suffix: <ch></ch>	Channel nur	nber
<phypt></phypt>	Physical por	t number
Parameters: <realpart></realpart>	Real part of	the port impedance.
	Range: *RST: Default unit:	1 m $\Omega$ to 10 M $\Omega$ Default reference impedance of the connector family assigned to the port (real impedance, e.g. 50 $\Omega$ ). Ohm

<imaginarypart></imaginarypart>	Imaginary part of the port impedance. This part may be omitted to define a real impedance.	
	Range:- 10 MΩ to 10 MΩ*RST:Default reference impedance of the connector family assigned to the port (real impedance, e.g. 50 Ω).Default unit:Ohm	
Example:	PORT2: ZREF 52, 2 Specify a complex reference impedance of 52 $\Omega$ + j * 2 $\Omega$ for the (physical) port no. 2. CALC: TRAN: IMP: RNOR PWAV Select renormalization of port impedances according to the power waves theory.	
Manual control:	See "Renormalization according to Theory of" on page 159	

# 6.3.14.14 [SENSe:]POWer...

The [SENSe:]POWer... commands configure the receiver step attenuators (options R&S ZNB-B31/32/33/34) and the automatic/adaptive gain control (AGC) of the R&S ZNB.

See also [SENSe<Ch>:]SEGMent<Seg>:POWer:GAINcontrol on page 773.

[SENSe <ch>:]POWer:ATTenuation</ch>	.758
ISENSe <ch>:]POWer:GAINcontrol</ch>	
- [SENSe <ch>:]POWer:GAINcontrol:GLOBal</ch>	.760
- [SENSe <ch>:]POWer:AGCMode<phypt>:MEASure</phypt></ch>	.760
[SENSe <ch>:]POWer:IFGain<phypt>:MEASure</phypt></ch>	

#### [SENSe<Ch>:]POWer:ATTenuation <arg0>[, <arg1>]

Sets an attenuation factor for the received waves. This command is available if at least one of the receiver step attenuator options R&S ZNB<n>-B31/32/33/34 is installed (<n> denotes the vector analyzer type).

#### Suffix:

<Ch>

Channel number

#### Parameters:

<arg0> Test port of the analyzer, depending on the analyzer model: Test port 1: ARECeiver (or 1), requires option R&S ZNB<n>-B31 Test port 2: BRECeiver (or 2), requires option R&S ZNB<n>-B31 Test port 3: CRECeiver (or 3), requires option R&S ZNB<n>-B31 Test port 4: DRECeiver (or 4), requires option R&S ZNB<n>-B31 Default unit: n/a

<arg1></arg1>	Attenuation	factor for the received wave.
	Range:	0 dB, 10 dB, 20 dB, 30 dB. UP and DOWN increment/ decrement the attenuation in 10 dB steps. The ana- lyzer rounds any entered value below the maximum attenuation to the closest step.
	*RST: Default unit	0 dB
	Delault unit	UD
Example:	POW:ATT A	
		nuation factor of 10 dB for the waves received at test channel no. 1. The other test ports and channels are d.
Manual control:	See "Step /	Attenuators" on page 258

[SENSe<Ch>:]POWer:GAINcontrol <ReceiverName>, <Mode> [SENSe<Ch>:]POWer:GAINcontrol? <ReceiverName>

Defines a port-specific AGC setting for each drive port configuration.

Suffix: <ch></ch>	Channel number
Parameters: <mode></mode>	LNOise   LDIStortion   AUTO AUTO – automatic/adaptive gain control (AGC) according to the RF input level. LNOise – fixed, large IF gain, for low input levels. LDIStortion – fixed, small IF gain, for high input levels.
Parameters for setti <receivername></receivername>	<b>Ing and query:</b> String parameter defining the wave(s) followed by the drive port; see examples below and table 6-4.
Example:	<pre>*RST; :SENSe:POWer:GAINcontrol:GLOBal MANual Activate independent AGC settings for each drive port. SENSe:POWer:GAINcontrol 'B2D1', LNO Set the ACG for the received wave <math>b_2</math> (port 2) to "Low Noise". The setting applies while port 1 is the drive port. SENSe:POWer:GAINcontrol 'A2B2B3D2', LNO Set the ACG for the waves <math>a_2</math>, <math>b_2</math>, and <math>b_3</math> to "Low Noise". The setting applies while port 2 is the drive port. SENSe:POWer:GAINcontrol? 'B1D2' Query the ACG setting for the wave <math>b_1</math> while port 2 is the drive port. The response is 1, LDIS (default setting).</pre>
Manual control:	See "Manual Config" on page 371

#### [SENSe<Ch>:]POWer:GAINcontrol:GLOBal <AGCModesGlobal>

Configures the Automatic Gain Control (AGC) in the receiver path (measurement receiver, b-waves) for all analyzer ports. The command is also used to enable manual AGC configuration.

Suffix: <Ch>

Channel number

#### **Parameters:**

<agcmodesglobal></agcmodesglobal>	LNOise   LDIStortion   AUTO   MANual
	AUTO – automatic/adaptive gain control (AGC) according to the RF input level.
	LNOise – fixed, large IF gain, for low input levels.
	LDIStortion – fixed, small IF gain, for high input levels.
	MANual – enables the manual configuration of independent AGC
	settings for each drive port, see [SENSe <ch>:] POWer:</ch>
	GAINcontrol and [SENSe <ch>:]SEGMent<seg>:POWer:</seg></ch>
	GAINcontrol.
	*RST: AUTO
Example:	See [SENSe <ch>:]POWer:GAINcontrol:GLOBal</ch>
Manual control:	See "AGC Mode" on page 371

#### [SENSe<Ch>:]POWer:AGCMode<PhyPt>:MEASure <Mode> [SENSe<Ch>:]POWer:IFGain<PhyPt>:MEASure <AGCMode>

These two equivalent commands activate manual gain control and select the IF gain in the measurement channels (b-waves). The IF gain in the reference channel (a-waves) is set automatically if not otherwise defined using [SENSe<Ch>:]POWer:GAINcontrol.

**Note:** These commands are replaced by [SENSe<Ch>:]POWer:GAINcontrol and [SENSe<Ch>:]POWer:GAINcontrol:GLOBal. They are supported for compatibility with FW versions < 1.5.

<b>Suffix:</b> <ch></ch>	Channel number
<phypt></phypt>	Test port number of the analyzer
Parameters: <agcmode></agcmode>	LNOise   LDIStortion   AUTO
	AUTO – automatic/adaptive gain control (AGC) according to the RF input level. LNOise – fixed, large IF gain, for low input levels.
	LDIStortion – fixed, small IF gain, for high input levels.
	*RST: LDIS

Example:	*RST; :SENSe:POWer:IFG2:MEAS LNO; :SENSe:POWer: IFG1:MEAS?
	Optimize the received waves (measurement channel, b-waves) at port 2 for small input levels and query the AGC settings for the received waves at port 1. The response is LDIS.
Manual control:	See "Attenuation" on page 366

# 6.3.14.15 [SENSe:]ROSCillator...

The [SENSe:]ROSCillator... commands control the frequency reference signal.

[SENSe <ch>:]ROSCillator:EXTernal:FREQuency</ch>	761
[SENSe <ch>:]ROSCillator[:SOURce]</ch>	761

# [SENSe<Ch>:]ROSCillator:EXTernal:FREQuency <ExtClockFreq>

Specifies or queries the frequency of the external reference oscillator.

Suffix: <ch></ch>	Channel number. This suffix is ignored in the ROSCillator sub- system and can be set to any value.
Parameters: <extclockfreq></extclockfreq>	Frequency of the external reference clock signal. The frequency must be 10 MHz; any other setting is ignored. *RST: 10 MHz Default unit: Hz
Example:	See [SENSe <ch>:]ROSCillator[:SOURce]</ch>
Manual control:	See "Ext Frequency" on page 430

# [SENSe<Ch>:]ROSCillator[:SOURce] <Source>

Selects the source of the reference oscillator signal.

	C C
<b>Suffix:</b> <ch></ch>	Channel number. This suffix is ignored in the ROSCillator sub- system and can be set to any value.
Parameters:	
<source/>	INTernal   EXTernal
	INTernal - select internal 10 MHz reference oscillator. EXTernal - select external 10 MHz reference clock.
	*RST: INTernal

Example:	ROSC EXT
	Select external reference oscillator.
	ROSC:EXT:FREQ?
	Query the frequency of the external reference oscillator. The response is 10000000 Hz, i.e. the frequency of the external reference oscillator must be 10 MHz.
Manual control:	See "Internal / External" on page 430

#### 6.3.14.16 [SENSe:]SEGMent<Seg>...

The [SENSe:]SEGMent<Seg>... commands define all channel settings for a segmented frequency sweep. A segmented sweep is activated via [SENSe<Ch>: ]SWEep:TYPE SEGMent.



The commands in this subsystem do not accept the step parameters UP and DOWN. Numeric values can be entered directly or using the DEFault, MINimum, MAXimum parameters.

[SENSe <ch>:]SEGMent<seg>:ADD</seg></ch>	763
[SENSe <ch>:]SEGMent<seg>:BWIDth[:RESolution]</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:BWIDth[:RESolution]:CONTrol</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:BWIDth[:RESolution]:SELect</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:BWIDth[:RESolution]:SELect:CONTrol</seg></ch>	
[SENSe <ch>:]SEGMent:COUNt?</ch>	
[SENSe <ch>:]SEGMent<seg>:DEFine</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:DEFine:SELect</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:DELete:ALL</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:DELete[:DUMMy]</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:FREQuency:CENTer?</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:FREQuency:SPAN?</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:FREQuency:STARt</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:FREQuency:STOP</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:INSert</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:INSert:SELect</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:POWer[:LEVel]</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:POWer:GAINcontrol</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:POWer:GAINcontrol:CONTrol</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:POWer[:LEVel]:CONTrol</seg></ch>	
[SENSe <ch>:]SEGMent<seg>[:STATe]</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:SWEep:DWELI</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:SWEep:DWELI:CONTrol</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:SWEep:POINts</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:SWEep:TIME</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:SWEep:TIME:CONTrol</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:SWEep:TIME:SUM?</seg></ch>	

User Manual 1173.9163.02 - 13

# www.valuetronics.com

#### [SENSe<Ch>:]SEGMent<Seg>:ADD

Inserts a new sweep segment using default channel settings ("Insert New Segment"). The added segment covers the frequency interval between the maximum frequency of the existing sweep segments and the stop frequency of the entire sweep range.

**Tip:** Use [SENSe<Ch>:]SEGMent<Seg>:INSert to create a segment with specific channel settings.

<b>Suffix:</b> <ch></ch>	Channel number
<seg></seg>	Sweep segment number. Segment numbers must be sequential. If n segments exist already, the added segment must have the segment number n+1.
Example:	SEGM: INS 1MHZ, 1.5MHZ, 111, -21DBM, 0.5S, 0, 10KHZ Create a sweep segment with a sweep range between 1.0 MHz and 1.5 MHz. SEGM2: ADD Create a second sweep segment. The frequency range of the second segment will be between 1.5 MHz and the maximum fre- quency of the analyzer.
Usage:	Event
Manual control:	See "Add / Insert / Delete / Delete All" on page 272

#### [SENSe<Ch>:]SEGMent<Seg>:BWIDth[:RESolution] <ResBandwidth>

Defines the resolution bandwidth of the analyzer (Meas. Bandwidth) in sweep segment no. <Seg>. Values between 1 Hz and 1 MHz can be set. Option R&S ZNB--K17, "Increased Bandwidth", provides bandwidths up to 10 MHz.

Bandwidths can be set in 1 - 1.5 - 2 - 3 - 5 - 7 steps. The analyzer rounds up any entered value between these steps and rounds down values exceeding the maximum bandwidth.

At the same time, the command activates separate bandwidth setting in all sweep segments ([SENSe<Ch>:]SEGMent<Seg>:BWIDth[:RESolution]:CONTrol ON).

SUITIX	S	uffix	<b>x</b> :
--------	---	-------	------------

<ch></ch>	Channel number	
<seg></seg>	Sweep segment number	
Parameters: <resbandwidth></resbandwidth>	•	See above 1-1.5-2-3-5-7 steps 10 kHz
Example:	See [SENSe <ch>:]SEGMent<seg>:BWIDth[: RESolution]:CONTrol</seg></ch>	

Manual control: See "Table Columns" on page 275

[SENSe <ch>:]SEC</ch>	GMent <seg>:BWIDth[:RESolution]:CONTrol <boolean></boolean></seg>	
Selects common or	r independent "Meas. Bandwidth" settings for the sweep segments.	
Suffix:		
<ch></ch>	Channel number	
<seg></seg>	Sweep segment number. This suffix is ignored; the setting controls the whole segmented sweep.	
Parameters:		
<boolean></boolean>	ON – use independent bandwidth settings, to be defined via	
	[SENSe <ch>:]SEGMent<seg>:BWIDth[:RESolution].</seg></ch>	
	OFF - reset the bandwidth in all sweep segments to the bandwidth	
	for unsegmented sweeps, defined via [SENSe <ch>:</ch>	
	] BWIDth [:RESolution]. ON will not restore the previous val-	
	ues.	
	The parameter is automatically switched to ON when a bandwidth	
	<pre>is entered using [SENSe<ch>:]SEGMent<seg>:BWIDth[:</seg></ch></pre>	
	RESolution].	
	*RST: OFF	
Example:	*RST; :SENS:SEGM:ADD	
	Create a new sweep segment no. 1 in channel no. 1 using default settings and thus 10 kHz measurement bandwidth. SEGM:BWID 1 MHZ	
	Increase the resolution bandwidth to 1 MHz.	
	SEGM:BWID:CONT OFF	
	Couple the bandwidths in all segments and reset the bandwidth in segment no. 1 to the initial value.	
Manual control:	See "Table Columns" on page 275	

# [SENSe<Ch>:]SEGMent<Seg>:BWIDth[:RESolution]:SELect <Selectivity>

Defines the selectivity in sweep segment no. <Seg>. At the same time, the command activates separate selectivity settings in all sweep segments ([SENSe<Ch>:]SEGMent<Seg>:BWIDth[:RESolution]:SELect:CONTrol ON).

<b>Suffix:</b> <ch></ch>	Channel number
<seg></seg>	Sweep segment number
Parameters: <selectivity></selectivity>	NORMal   MEDium   HIGH NORMal - IF filter with normal selectivity and shortest settling time. MEDium - IF filter with steeper edges and longer settling time. HIGH - IF filter with highest selectivity but longest settling time.

SCPI Command Reference

<b>.</b>	
Manual control:	RESolution]:SELect:CONTrol See "Table Columns" on page 275
Example:	See [SENSe <ch>:]SEGMent<seg>:BWIDth[:</seg></ch>

# [SENSe<Ch>:]SEGMent<Seg>:BWIDth[:RESolution]:SELect:CONTrol <Boolean>

Selects common or independent "Selectivity" settings for the sweep segments.

<b>Suffix:</b> <ch></ch>	Channel number
-	
<seg></seg>	Sweep segment number. This suffix is ignored; the setting controls the whole segmented sweep.
Parameters:	
<boolean></boolean>	ON - use independent selectivity settings, to be defined via
	[SENSe <ch>:]SEGMent<seg>:BWIDth[:RESolution]:</seg></ch>
	SELect.
	OFF - reset the selectivity in all sweep segments to the selectivity
	for unsegmented sweeps, defined via [SENSe <ch>:</ch>
	]BWIDth[:RESolution]:SELect. ON will not restore the pre-
	vious values.
	The parameter is automatically switched to ON when a selectivity
	<pre>is entered using [SENSe<ch>:]SEGMent<seg>:BWIDth[:</seg></ch></pre>
	RESolution]:SELect.
	*RST: OFF
Example:	*RST; :SEGM:ADD
	Create a new sweep segment no. 1 in channel no. 1 using default
	settings and thus NORMal selectivity.
	SEGM:BWID:SEL HIGH
	Change the selectivity to HIGH.
	BWID: SEL?
	Query the (default) selectivity for unsegmented sweeps. The response is NORM.
	SEGM:BWID:SEL:CONT OFF
	Couple the selectivities in all segments and reset the selectivity in
	segment no. 1 to the unsegmented value NORMal.
Manual control:	See "Table Columns" on page 275

#### [SENSe<Ch>:]SEGMent:COUNt?

Returns the number of sweep segments in the channel including all segments that are switched off ([SENSe<Ch>:]SEGMent<Seg>[:STATe]OFF).

#### Suffix:

<Ch>

Channel number

Example:	<ul> <li>SEGM: ADD</li> <li>Create a new sweep segment no. 1 in channel no. 1 using default settings.</li> <li>SEGM OFF</li> <li>Disable the measurement in the created sweep segment.</li> <li>SEGM: COUN?</li> <li>Query the number of segments.</li> </ul>
Usage:	Query only
Manual control:	See "Table Columns" on page 272

[SENSe<Ch>:]SEGMent<Seg>:DEFine <StartFreq>, <StopFreq>, <Points>, <Power>, <SegmentTime>|<MeasDelay>, <Unused>, <MeasBandwidth>[, <LO>, <Selectivity>]

Creates or re-defines a sweep segment no. <Seg> with specific channel settings.

Entry of the first seven numeric parameters is mandatory; no default values are provided. All settings except <LO> can be changed for existing segments using other commands of the [SENSe<Ch>:]SEGMent<Seg>... subsystem.

**Note:** Use [SENSe<Ch>:]SEGMent<Seg>:ADD to create a segment with default channel settings. Use [SENSe<Ch>:]SEGMent<Seg>:INSert (no query) to insert a new segment into the current segment list.

Suffix: <ch></ch>	Channel number
<seg></seg>	Sweep segment number. Segment numbers must be sequential. The specified segment number must be smaller or equal to the number of existing segments plus 1. If segment number <seg> already exists, it is replaced by the new segment.</seg>
Parameters:	
<startfreq></startfreq>	Start frequency of the segment; see [SENSe <ch>:</ch>
	]SEGMent <seg>:FREQuency:STARt.</seg>
	Default unit: Hz
<stopfreq></stopfreq>	Stop frequency of the segment; see [SENSe <ch>:</ch>
	]SEGMent <seg>:FREQuency:STOP</seg>
	Default unit: Hz
<points></points>	Number of sweep points in the segment. See [SENSe <ch>: ]SEGMent<seg>:SWEep:POINts.</seg></ch>
<power></power>	Internal source power in the segment. See [SENSe <ch>: ]SEGMent<seg>:POWer[:LEVel].</seg></ch>
	Default unit: dBm

<segmenttime></segmenttime>	<pre>Duration of the sweep in the segment. See [SENSe<ch>: ]SEGMent<seg>:SWEep:TIME. In the setting [SENSe<ch>: ]SEGMent<seg>:INSert:SELect DWELL, this parameter is replaced by <measdelay>. Range: Depending on other channel settings. AUTO activates automatic sweep time setting in the segment, which is equivalent to the minimum sweep time possible. Default unit: s</measdelay></seg></ch></seg></ch></pre>
<measdelay></measdelay>	Delaut unit: s Delay for each partial measurement in the segment. See
	<pre>[SENSe<ch>:]SEGMent<seg>:SWEep:DWELL. In the setting [SENSe<ch>:]SEGMent<seg>:INSert:SELectSWTime, this parameter is replaced by <segmenttime>.</segmenttime></seg></ch></seg></ch></pre>
<unused></unused>	Ignored parameter (for compatibility with R&S ZVR analyzers). Should be set to the default value 0.
<measbandwidth></measbandwidth>	Resolution bandwidth in the segment. See [SENSe <ch>: ]SEGMent<seg>:BWIDth[:RESolution]. Default unit: Hz</seg></ch>
<l0></l0>	POSitive   NEGative   AUTO
	Position of the local oscillator frequency LO relative to the RF fre- quency. In remote control this parameter must be set when a sweep segment is created. See [SENSe <ch>:]FREQuency: SBANd.</ch>
<selectivity></selectivity>	NORMal   MEDium   HIGH
	Selectivity of the IF filter. See [SENSe <ch>:]SEGMent<seg>: BWIDth[:RESolution]:SELect.</seg></ch>
Example:	SEGM: ADD Create a new sweep segment no. 1 in channel no. 1 using default settings. SEGM: DEF? Query the channel settings for the new segment. A possible response is 100000000, 200000000, 51, -300, 0.0044625, 0, 10000, AUTO, NORM.
Manual control:	See "Table Columns" on page 275

# [SENSe<Ch>:]SEGMent<Seg>:DEFine:SELect <TimeRef>

Defines whether the sweep time of a new segment, i.e. numeric parameter no. 5 of the command [SENSe<Ch>:]SEGMent<Seg>:DEFine, is entered as a segment sweep time ("Segment Time") or as a measurement delay ("Meas Delay").

Suffix: <Ch>

Channel number

SCPI Command Reference

<seg></seg>	Sweep segment number
Parameters: <timeref></timeref>	SWTime   DWELI SWTime - use segment sweep time. DWELI - use measurement delay.
Example:	<ul> <li>SEGM1:DEF:SEL DWEL</li> <li>Select the measurement delay to determine the sweep time in a new sweep segment no. 1.</li> <li>SEGM1:DEF 1MHZ, 1.5MHZ, 111, -21DBM, 0.01S, 0, 10KHZ</li> <li>Create a sweep segment with a sweep range between 1.0 MHz and 1.5 MHz and a measurement delay of 10 ms.</li> <li>SEGM1:SWE:TIME?</li> <li>Query the sweep time in the new segment.</li> </ul>
Manual control:	See "Table Columns" on page 275

# [SENSe<Ch>:]SEGMent<Seg>:DELete:ALL

Deletes all sweep segments in the channel. [SENSe<Ch>:]SEGMent<Seg>: DELete[:DUMMy] deletes a single segment.

<b>Suffix:</b> <ch></ch>	Channel number
<seg></seg>	Sweep segment number. This suffix is ignored; the command deletes all segments.
Example:	SEGM: ADD Create a new sweep segment no. 1 in channel no. 1 using default settings. SEGM: DEL: ALL Delete the created segment and all segments in the channel cre- ated before.
Usage:	Event
Manual control:	See "Add / Insert / Delete / Delete All" on page 272

# [SENSe<Ch>:]SEGMent<Seg>:DELete[:DUMMy]

Deletes the specified (single) sweep segment. [SENSe<Ch>:]SEGMent<Seg>: DELete:ALL deletes all segments in the channel.

Suffix:	
<ch></ch>	Channel number
<seg></seg>	Sweep segment number

 Example:
 SEGM: ADD

 Create a new sweep segment no. 1 in channel no. 1 using default settings.

 SEGM: DEL

 Delete the created segment.

 Manual control:
 See "Add / Insert / Delete / Delete All" on page 272

# [SENSe<Ch>:]SEGMent<Seg>:FREQuency:CENTer? [SENSe<Ch>:]SEGMent<Seg>:FREQuency:SPAN?

These commands return the center frequency and the span (width) of sweep segment no. <Seg>.

Suffix: <ch> <seg></seg></ch>	Channel number Sweep segment number
Example:	SEGM: INS 1MHZ, 1.5MHZ, 111, -21DBM, 0.5S, 0, 10KHZ Create a sweep segment with a sweep range between 1.0 MHz and 1.5 MHz. SEGM: FREQ: CENT? SPAN? Query the center frequency and span of the created segment. The response is 1250000; 500000.
Usage: Manual control:	Query only See "Table Columns" on page 272

Note: The frequency range of the sweep segment can be changed via [SENSe<Ch>:] SEGMent<Seg>:FREQuency:STARt and [SENSe<Ch>:]SEGMent<Seg>: FREQuency:STOP.

# [SENSe<Ch>:]SEGMent<Seg>:FREQuency:STARt <StartFreq> [SENSe<Ch>:]SEGMent<Seg>:FREQuency:STOP <StopFreq>

These commands define the start and stop frequency of sweep segment no. <Seg>. The sweep segments must be within the frequency range of the R&S ZNB; see table 6-9.

Suffix: <ch></ch>	Channel number
	Chamler Humber
<seg></seg>	Sweep segment number
Parameters:	
<stopfreq></stopfreq>	Start or stop frequency of the sweep.
	Increment: 0.1 kHz Default unit: Hz

Example:	SEGM: INS 1MHZ, 1.5MHZ, 111, -21DBM, 0.5S, 0, 10KHZ Create a sweep segment with a sweep range between 1.0 MHz and 1.5 MHz. SEGM: FREQ: STAR?; STOP?		
	Query the start and stop frequency of the created segment. The response is 1000000;1500000.		
Manual control:	See "Table Columns" on page 272		

**Note:** If the start frequency entered is greater than the current stop f

**Note:** If the start frequency entered is greater than the current stop frequency, the stop frequency is set to the start frequency plus the minimum frequency span of 1 Hz. If the stop frequency entered is smaller than the current start frequency, the start frequency is set to the stop frequency minus the minimum frequency span ([SENSe<Ch>:] FREQuency: SPAN).

[SENSe<Ch>:]SEGMent<Seg>:INSert <StartFreq>, <StopFreq>, <Points>, <Power>, <SegmentTime>|<MeasDelay>, <Unused>, <MeasBandwidth>[, <LO>, <Selectivity>]

Adds a new sweep segment no. <Seg> with specific channel settings.

Entry of the first seven numeric parameters is mandatory; no default values are provided. All settings except <LO> can be changed for existing segments using other commands of the [SENSe<Ch>:]SEGMent<Seg>... subsystem.

**Note:** Use [SENSe<Ch>:]SEGMent<Seg>:ADD to create a segment with default channel settings. Use [SENSe<Ch>:]SEGMent<Seg>:DEFine to change or query all settings of an existing segment.

<b>Suffix:</b> <ch></ch>	Channel number
<seg></seg>	Sweep segment number. Segment numbers must be sequential. The specified segment number must be smaller or equal to the number of existing segments plus 1. If one or more sweep segments with segment numbers <seg> or larger exist in the current channel, then all these existing segment numbers are incremented by 1 and the new segment is inserted as segment no. <seg>.</seg></seg>
Parameters:	
<startfreq></startfreq>	Start frequency of the segment. See [SENSe <ch>:</ch>
	]SEGMent <seg>:FREQuency:STARt.</seg>
	Default unit: Hz
<stopfreq></stopfreq>	Stop frequency of the segment; see [SENSe <ch>:</ch>
	]SEGMent <seg>:FREQuency:STOP.</seg>
	Default unit: Hz
<points></points>	Number of sweep points in the segment. See [SENSe <ch>: ]SEGMent<seg>:SWEep:POINts.</seg></ch>

<power></power>	Internal source power in the segment. See [SENSe <ch>: ]SEGMent<seg>:POWer[:LEVel]. Default unit: dBm</seg></ch>	
<segmenttime></segmenttime>	<pre>Duration of the sweep in the segment. See [SENSe<ch>: ]SEGMent<seg>:SWEep:TIME. In the setting [SENSe<ch>: ]SEGMent<seg>:INSert:SELect DWELL, this parameter is replaced by <measdelay>.</measdelay></seg></ch></seg></ch></pre>	
	Range: Depending on other channel settings. AUTO activates automatic sweep time setting in the segment, which is equivalent to the minimum sweep time possible. Default unit: s	
<measdelay></measdelay>	Delay for each partial measurement in the segment. See [SENSe <ch>:]SEGMent<seg>:SWEep:DWELL. In the setting [SENSe<ch>:]SEGMent<seg>:INSert:SELect SWTime, this parameter is replaced by <segmenttime>.</segmenttime></seg></ch></seg></ch>	
<unused></unused>	Ignored parameter (for compatibility with R&S ZVR analyzers). Should be set to the default value 0.	
<measbandwidth></measbandwidth>	Resolution bandwidth in the segment. See [SENSe <ch>: ]SEGMent<seg>:BWIDth[:RESolution].</seg></ch>	
	Default unit: Hz	
<lo></lo>	POSitive   NEGative   AUTO Position of the local oscillator frequency LO relative to the RF fre- quency. In remote control this parameter must be set when a sweep segment is created. See [SENSe <ch>:]FREQuency: SBANd.</ch>	
<selectivity></selectivity>		
-Selectivity>	NORMal   MEDium   HIGH Selectivity of the IF filter. See [SENSe <ch>:]SEGMent<seg>: BWIDth[:RESolution]:SELect.</seg></ch>	
Example:	SEGM: INS 1MHZ, 1.5MHZ, 111, -21DBM, 0.5S, 0, 10KHZ Create a sweep segment with a sweep range between 1.0 MHz and 1.5 MHz. SEGM2: ADD Create a second sweep segment. The frequency range of the second segment will be between 1.5 MHz and the maximum fre- quency of the analyzer.	
Manual control:	See "Add / Insert / Delete / Delete All" on page 272	

#### [SENSe<Ch>:]SEGMent<Seg>:INSert:SELect <TimeRef>

Defines whether the sweep time of a new segment, i.e. numeric parameter no. 5 of the command [SENSe<Ch>:]SEGMent<Seg>:INSert, is entered as a segment sweep time ("Segment Time") or as a measurement delay ("Meas Delay").

<b>Suffix:</b> <ch> <seg></seg></ch>	Channel number Sweep segment number
<pre>Seg&gt; Parameters: <timeref></timeref></pre>	SWTime   DWELI SWTime - use segment sweep time. DWELI - use measurement delay. *RST: SWTime
Example:	<pre>SEGM1:INS:SEL DWEL Select the meas. delay to determine the sweep time in a new sweep segment no. 1. SEGM1:INS 1MHZ, 1.5MHZ, 111, -21DBM, 0.01S, 0, 10KHZ Create a sweep segment with a sweep range between 1.0 MHz and 1.5 MHz and a meas. delay of 10 ms. SEGM1:SWE:TIME? Query the sweep time in the new segment.</pre>
Manual control:	See "Table Columns" on page 275

#### [SENSe<Ch>:]SEGMent<Seg>:POWer[:LEVel] <IntSourcePow>

Defines the power of the internal signal source in sweep segment no. <Seg>. At the same time, the command activates separate power control in all sweep segments ( [SENSe<Ch>:]SEGMent<Seg>:POWer[:LEVel]:CONTrol).

<b>Suffix:</b> <ch></ch>	Channel nur	nber
<seg></seg>	Sweep segn	nent number
Parameters: <intsourcepow></intsourcepow>	Internal sour Range: *RST: Default unit:	-300 dBm to +200 dBm. The usable power range is frequency-dependent; refer to the data sheet. -10 dBm
Example:	settings and SEGM: POW	w sweep segment no. 1 in channel no. 1 using default thus -10 dBm internal source power. -20 e power to -20 dBm.

User Manual 1173.9163.02 - 13

# www.valuetronics.com

Manual control: See "Table Columns" on page 275

[SENSe<Ch>:]SEGMent<Seg>:POWer:GAINcontrol <ReceiverName>, <Mode> [SENSe<Ch>:]SEGMent<Seg>:POWer:GAINcontrol? <ReceiverName>

Defines segment-specific AGC settings. The settings are valid for segmented sweeps only. [SENSe<Ch>:]SEGMent<Seg>:POWer:GAINcontrol:CONTrol enables these settings.

#### Suffix:

Suffix:	
<ch></ch>	Channel number
<seg></seg>	Sweep segment number
Parameters:	
<mode></mode>	LNOise   LDIStortion   AUTO
	AUTO – automatic/adaptive gain control (AGC) according to the RF input level.
	LNOise – fixed, large IF gain, for low input levels. LDIStortion – fixed, small IF gain, for high input levels.
Parameters for setti	ing and query:
<receivername></receivername>	String parameter defining the wave(s) followed by the drive port; see examples below and table 6-4.
Example:	<pre>*RST; :SENSe:POWer:GAINcontrol:GLOBal MANual Activate independent AGC settings for each drive port. SENSe:SEGMent1:ADD; :SENSe:SWEep:TYPE SEGMent Create a new sweep segment no. 1 and activate segmented sweep type. SENSe:SEGMent1:POWer:GAINcontrol:CONTrol OFF Enable segmented AGC. SENSe:SEGMent1:POWer:GAINcontrol 'B2D1', LNO Set the ACG for the received wave b<sub>2</sub> (port 2) in sweep segment no. 1 to "Low Noise". The setting applies while port 1 is the drive port. SENSe:SEGMent1:POWer:GAINcontrol 'A2B2B3D2', LNO Set the ACG for the waves a<sub>2</sub>, b<sub>2</sub>, and b<sub>3</sub> in sweep segment no. 1 to "Low Noise". The setting applies while port 2 is the drive port. SENSe:SEGMent1:POWer:GAINcontrol? 'B1D2' Query the ACG setting for the wave b<sub>1</sub> in sweep segment no. 1 while port 2 is the drive port. The response is 1, LDIS (default setting).</pre>

Manual control: See "Manual Config..." on page 371

# [SENSe<Ch>:]SEGMent<Seg>:POWer:GAINcontrol:CONTrol <arg0>

Selects common or independent AGC settings for the sweep segments.

<b>Suffix:</b> <ch></ch>	Channel number
<seg></seg>	Sweep segment number. This suffix is ignored; the setting controls the whole segmented sweep.
Parameters:	
<arg0></arg0>	<pre>ON - use independent AGC settings, to be defined via [SENSe<ch>:]SEGMent<seg>:POWer:GAINcontrol. OFF - reset the AGC in all sweep segments to the AGC for unseg- mented sweeps, defined via [SENSe<ch>:]POWer: GAINcontrol Or [SENSe<ch>:]POWer:GAINcontrol: GLOBal. ON will not restore the previous values. The parameter is automatically switched to ON when an AGC is entered using [SENSe<ch>:]SEGMent<seg>:POWer: GAINcontrol. *RST: OFF</seg></ch></ch></ch></seg></ch></pre>
Example:	See [SENSe <ch>:]SEGMent<seg>:POWer:GAINcontrol</seg></ch>
Manual control:	See "Segmented AGC" on page 372

# [SENSe<Ch>:]SEGMent<Seg>:POWer[:LEVel]:CONTrol <Boolean>

Selects common or independent internal source "Power" settings for the sweep segments.

Suffix: <ch></ch>	Channel number			
< <u></u>	Channel humber			
<seg></seg>	Sweep segment number. This suffix is ignored; the setting controls the whole segmented sweep.			
Parameters:				
<boolean></boolean>	ON – use independent power settings, to be defined via			
	[SENSe <ch>:]SEGMent<seg>:POWer[:LEVel].</seg></ch>			
OFF – reset the power in all sweep segments to the power				
	unsegmented sweeps, defined via SOURce <ch>:</ch>			
POWer <phypt>[:LEVel][:IMMediate][:AMPLitude]. will not restore the previous values. The parameter is automatically switched to ON when a segme</phypt>				
				<pre>power is entered using [SENSe<ch>:]SEGMent<seg>:</seg></ch></pre>
				POWer[:LEVel].
	*RST: OFF			

Example:	SEGM: ADD Create a new sweep segment no. 1 in channel no. 1 using default settings and thus -10 dBm internal source power. SEGM: POW -20
	Decrease the power to -20 dBm. SEGM: POW: CONT OFF
	Couple the powers in all segments and reset the power in segment no. 1 to the initial value.
Manual control:	See "Table Columns" on page 275

#### [SENSe<Ch>:]SEGMent<Seg>[:STATe] <Boolean>

Activates or deactivates the sweep segment <Seg>. Sweep points belonging to inactive segments only are not measured.

Suffix: <ch></ch>	Channel number
<seg></seg>	Sweep segment number
Parameters: <boolean></boolean>	ON   OFF - activates or deactivates the measurement in sweep segment <seg>. *RST: ON</seg>
Example:	SEGM: ADD Create a new sweep segment no. 1 in channel no. 1 using default settings. SEGM OFF Disable the measurement in the created sweep segment.
Manual control:	See "Table Columns" on page 272

#### [SENSe<Ch>:]SEGMent<Seg>:SWEep:DWELI <MeasDelay>

Defines the delay time for each partial measurement in sweep segment no. <Seg> ("Meas. Delay"). If coupling of the segments is switched on ([SENSe<Ch>:] SEGMent<Seg>:SWEep:DWEL1:CONTrol ON), the delay is valid for all sweep segments in the current channel.

Suffix:	
<ch></ch>	Channel number
<seg></seg>	Sweep segment number

- Pi	araı	mete	rs	
	aiai	men	513.	

<MeasDelay> Measurement delay before each partial measurement. Changing the delay leaves the number of points unchanged but has an impact on the duration of the sweep ([SENSe<Ch>: ]SEGMent<Seg>:SWEep:TIME). 0 s to 2500 s Range: \*RST: 0 s Default unit: s Example: SEGM:ADD Create a new sweep segment no. 1 in channel no. 1 using default settings. SEGM:SWE:DWEL 1 MS Set the meas. delay in segment no. 1 to 1 ms. SEGM:DEF? Response: 300000,800000000,51,-300,0.056559,0,10000,POS, NORM Query the channel parameters for sweep segment 1. The response value for the segment sweep time (olive) implicitly contains the defined meas. delay. Manual control: See "Table Columns" on page 275

### [SENSe<Ch>:]SEGMent<Seg>:SWEep:DWELI:CONTrol <Boolean>

Selects common or independent "Meas. Delay" settings for the sweep segments.

Suffix:		
<ch></ch>	Channel number.	
<seg></seg>	Sweep segment number. This suffix is ignored; the command controls the whole segmented sweep.	
Parameters:		
<boolean></boolean>	ON – use independent delay settings, to be defined via	
	[SENSe <ch>:]SEGMent<seg>:SWEep:DWEL1.</seg></ch>	
	OFF – reset the delay in all sweep segments to the delay for	
	unsegmented sweeps, defined via [SENSe <ch>:]SWEep:</ch>	
	DWEL1.	
	The parameter is automatically switched to ON when a meas.	
	delay time is entered using [SENSe <ch>:]SEGMent<seg>:</seg></ch>	
	SWEep:DWELL.	
	*RST: OFF	

Example:	<ul> <li>SEGM: ADD</li> <li>Create a new sweep segment no. 1 in channel no. 1 using default settings and thus 0 s meas. delay.</li> <li>SEGM: SWE: DWELL 0.1</li> <li>Increase the meas. delay to 0.1 s.</li> <li>SEGM: SWE: DWELL: CONT OFF</li> <li>Couple the meas. delay in all segments and reset the delay in segment no. 1 to the initial value of 0 s.</li> </ul>
Manual control:	See "Table Columns" on page 275

#### [SENSe<Ch>:]SEGMent<Seg>:SWEep:POINts <SegPoint>

Defines the total number of measurement points in sweep segment no. <Seg>.

Suffix: <ch></ch>	Channel nu	mber
<seg></seg>	Sweep segr	ment number
Parameters: <segpoint></segpoint>	Number of p Range: *RST:	points in the segment 1 to 60001. 1 is allowed if start and stop frequencies are equal. 51
Example:	settings. SEGM:SWE:	w sweep segment no. 1 in channel no. 1 using default POIN 401 e number of points to 401.
Manual control:	See "Table	Columns" on page 272

### [SENSe<Ch>:]SEGMent<Seg>:SWEep:TIME <SegSweepTime>

Sets the duration of the sweep in sweep segment no. <Seg> ("Segment Time"). At the same time, the command activates separate sweep time setting in all sweep segments ([SENSe<Ch>:]SEGMent<Seg>:SWEep:TIME:CONTrol ON).

Suffix:	
<ch></ch>	Channel number
<seg></seg>	Sweep segment number

User Manual 1173.9163.02 - 13

# Parameters:

<segsweeptime></segsweeptime>	<pre>segment time. The minimum segment time depends on the other hannel settings, in particular on the number of points ( SENSe<ch>:]SEGMent<seg>:SWEep:POINts), the IF band- vidth ([SENSe<ch>:]SEGMent<seg>:BWIDth[: ESolution]) and the delay for each partial measurement ( SENSe<ch>:]SEGMent<seg>:SWEep:DWEL1). The maximum a 1000 s. Changing the duration leaves the number of points nchanged but directly affects the delay.</seg></ch></seg></ch></seg></ch></pre>	
	Range:Minimum value to 1000 s*RST:Minimum value, depending on the channel settings. This default value corresponds to automatic sweep time setting in manual control.Default unit:s	
Example:	SEGM: ADD Create a new sweep segment no. 1 in channel no. 1. SEGM: SWE: TIME 0.1 Increase the segment sweep time to 0.1 s. SEGM: SWE: TIME: SUM? Query the total duration of the segmented sweep. The response is 0.1, because there is only one sweep segment.	
Manual control:	See "Table Columns" on page 275	

# [SENSe<Ch>:]SEGMent<Seg>:SWEep:TIME:CONTrol <Boolean>

Selects common or independent "Segment Sweep Time" settings for the sweep segments.

Suffix: <ch></ch>	Channel number
<seg></seg>	Sweep segment number. This suffix is ignored; the command controls the whole segmented sweep.
Parameters:	
<boolean></boolean>	<pre>ON - use independent segment sweep time settings, to be defined via [SENSe<ch>:]SEGMent<seg>:SWEep:TIME. OFF - reset the segment sweep time in all sweep segments to the segment sweep time for unsegmented sweeps, defined via [SENSe<ch>:]SWEep:TIME. ON will not restore the previous values. The parameter is automatically switched to ON when a segment sweep time is entered using [SENSe<ch>:]SEGMent<seg>: SWEep:TIME or if the channel settings in a sweep segment require a sweep time larger than the unsegmented sweep time. *RST: OFF</seg></ch></ch></seg></ch></pre>

Example:	SEGM: ADD Create a new sweep segment no. 1 in channel no. 1. SEGM: SWE: TIME 0.1 Increase the segment sweep time to 0.1 s. SEGM: SWE: TIME: CONT OFF Couple the sweep times in all segments and reset the sweep time
	Couple the sweep times in all segments and reset the sweep time in segment no. 1 to the initial value.
Manual control:	See "Table Columns" on page 275

# [SENSe<Ch>:]SEGMent<Seg>:SWEep:TIME:SUM?

Returns the total duration of the segmented sweep, calculated as the sum of the sweep times of the individual segments ([SENSe<Ch>:]SEGMent<Seg>:SWEep:TIME).

Suffix: <ch></ch>	Channel number.
<seg></seg>	Sweep segment number. This suffix is ignored; the command returns the sum of all segments.
Example:	See [SENSe <ch>:]SEGMent<seg>:SWEep:TIME</seg></ch>
Usage:	Query only
Manual control:	See "Table Columns" on page 275

# 6.3.14.17 [SENSe:]SWEep...

The [SENSe:]SWEep... commands provide general settings to control the sweep. Most of the settings have an impact on the sweep time.

[SENSe <ch>:]SWEep:AXIS:FREQuency</ch>	779
[SENSe <ch>:]SWEep:AXIS:POWer</ch>	780
[SENSe <ch>:]SWEep:COUNt</ch>	781
[SENSe:]SWEep:COUNt:ALL	
[SENSe <ch>:]SWEep:DETector:TIME</ch>	
[SENSe <ch>:]SWEep:DWELI</ch>	782
[SENSe <ch>:]SWEep:DWELI:IPOint</ch>	
[SENSe <ch>:]SWEep:POINts</ch>	783
[SENSe <chn>:]SWEep:SRCPort</chn>	
[SENSe <ch>:]SWEep:STEP</ch>	
[SENSe <ch>:]SWEep:TIME</ch>	
[SENSe <ch>:]SWEep:TIME:AUTO</ch>	
[SENSe <ch>:]SWEep:TYPE</ch>	

#### [SENSe<Ch>:]SWEep:AXIS:FREQuency <Scale>

Selects either the channel base frequency or one of the port frequencies as the stimulus axis in all diagrams of the active recall set. This command has no effect if no port-specific frequencies are defined.

<b>Suffix:</b> <ch></ch>	Channel number
Parameters: <scale></scale>	String parameter, one of the following signals: 'Channel Base; Source' - base channel frequency 'Port 1; Source' - source frequency at port 1 'Port 2; Source' - source frequency at port 2  'Gen 1; Source' - external generator frequency 1  'Pmtr 1; Receiver' - external power meter frequency 1  *RST: 'Channel Base: Source'
Example:	<pre>*RST; FREQ:STAR 1 GHz; STOP 2 GHz Define a base channel frequency range between 1 GHz and 2 GHz. This frequency is also used as an (initial) frequency range for all test ports and external generators. SOUR:FREQ1:CONV:ARB:IFR 1, 1, 1E+9, SWE Convert the source frequency at test port no. 1 to the range between 2 GHz and 3 GHz. SWE:AXIS:FREQ 'Port 1; Source' Select the source signal at port 1 as the reference signal for fre- quency definitions. FREQ:STAR 3 GHz; STOP 4 GHz SwE:AXIS:FREQ 'Port 2; Source' Select the source signal at port 2 as the reference signal for fre- quency definitions. FREQ:STAR?; STOP? Query the frequency range at test port 2. The response is 20000000; 300000000.</pre>
Manual control:	See "Stimulus Axis > Frequency / Power" on page 362

# [SENSe<Ch>:]SWEep:AXIS:POWer <Scale>

Selects either the channel base power or one of the port powers as the stimulus axis in all diagrams of the active recall set. This command has no effect if no port-specific powers are defined.

Suffix: <Ch>

Channel number

Parameters: <scale></scale>	String parameter, one of the following signals: 'Channel Base; Source' - base channel power 'Port 1; Source' - source power at port 1 'Port 2; Source' - source power at port 2  'Gen 1; Source' - external generator power 1  *RST: 'Channel Base; Source'
Example:	<ul> <li>*RST; SOUR: POW 5</li> <li>Define a base channel power of +5 dBm. This power is also used as an (initial) power for all test ports and external generators.</li> <li>SOUR: POW1: OFFS -5, CPAD</li> <li>Change the source power at test port no. 1 to 0 dB without affecting the power at the remaining ports.</li> <li>SWE: AXIS: POW 'Port 1; Source'</li> <li>Select the source signal at port 1 as the reference signal for power definitions.</li> <li>SOUR: POW -5</li> <li>Shift all powers by -5 GHz.</li> <li>SWE: AXIS: POW 'Port 2; Source'</li> <li>Select the source signal at port 2 as the reference signal for power definitions.</li> <li>SOUR: POW?</li> <li>Query the power at test port 2. The response is 0.</li> </ul>
Manual control:	See "Stimulus Axis > Frequency / Power" on page 362

# [SENSe<Ch>:]SWEep:COUNt <Sweep>

Defines the number of sweeps to be measured in single sweep mode ( INITiate<Ch>:CONTinuous OFF) and in channel no. <Ch>. Use [SENSe:]SWEep: COUNt:ALL to define the sweep count for all channels.

Suffix: <ch></ch>	Channel nu	mber
Parameters: <sweep></sweep>	Number of consecutive sweeps to be measured.	
	Range: *RST:	1 to 100000 1
Example:	See CALCu	late <chn>:DATA:NSWeep:FIRSt?</chn>
Manual control:	See "Sweeps" on page 277	

#### [SENSe:]SWEep:COUNt:ALL <Sweep>

Defines the number of sweeps to be measured in single sweep mode ( INITiate<Ch>: CONTINUOUSOFF). The setting is applied to all channels. Use [SENSe<Ch>:] SWEep:COUNt to define the sweep count for a single channel.

#### Setting parameters:

<sweep></sweep>	Number of consecutive sweeps to be measured.		
	Range: *RST:	1 to 100000 1	
Example:	See chapter	7.2.4, "Data Handling", on page 908.	
Usage:	Setting only		
Manual control:	See "Sweep	os" on page 277	

#### [SENSe<Ch>:]SWEep:DETector:TIME <DetectorTime>

Defines the detector observation time ratios and wave quantities if an "AVG Real Imag" or an "AVG Mag Phase" detector is active. The detector is selected together with the measured quantity (CALCulate<Ch>: PARameter:MEASure or CALCulate<Ch>: PARameter:SDEFine).

#### Suffix:

<ch></ch>	Channel number
Parameters: <detectortime></detectortime>	Detector time Range: 0 s to 3456000 s *RST: 0.01 s Default unit: s
Example:	*RST; :CALC:PAR:MEAS 'TRC1', 'a1D1RMS' Select the wave quantity a <sub>1</sub> for the default trace and activate the RMS detector. SWE:DET:TIME 1 Specify an observation time of 1 s at each sweep point.
Manual control:	See "Detector" on page 162

#### [SENSe<Ch>:]SWEep:DWELI <MeasDelay>

Defines the "Meas. Delay" before each partial measurement or the first partial measurement (depending on whether "All Partial Meas'ments" or "First Partial Meas'ment" is selected). Setting a delay disables the automatic calculation of the (minimum) sweep time; see [SENSe<Ch>:] SWEep:TIME:AUTO.

Suffix:

<Ch>

Channel number

Parameters: <measdelay></measdelay>	Measurement delay before each partial measurement. Changing the delay leaves the number of points unchanged but has an impact on the duration of the sweep ([SENSe <ch>:]SWEep: TIME). Range: 0 s to 13680 s *RST: 0 s Default unit: s</ch>
Example:	*RST Reset the instrument, activating a frequency sweep with the S- parameter $S_{21}$ as a measurement result for channel and trace no. 1. SWEep:TIME? Query total sweep time. SWEep:DWEL 1 SWEep:DWEL:IPOint ALL Set a delay of 1 s for each partial measurement. SWE:TIME? Query total sweep time. The time is extended by the delay times the total number of sweep points (one partial measurement per sweep point required).
Manual control	See "Mess Deley" on page 265

Manual control: See "Meas Delay" on page 265

#### [SENSe<Ch>:]SWEep:DWELI:IPOint <InsertionPoints>

Defines whether the measurement delay (previously defined via [SENSe<Ch>: ]SWEep:DWEL1) is inserted before all partial measurements or before the first partial measurement only.

<b>Suffix:</b> <ch></ch>	Channel number
<b>Parameters:</b> <insertionpoints></insertionpoints>	ALL   FIRSt Insertion before all or before the first partial measurement *RST: ALL
Example:	See [SENSe <ch>:]SWEep:DWEL1</ch>
Manual control:	See "Meas Delay" on page 265

# [SENSe<Ch>:]SWEep:POINts <SweepPoint>

Defines the total number of measurement points per sweep ("Number of Points").

Values between 1 and 100,001 can be set.

Suffix:

<Ch> Channel number 1

Parameters:			
<sweeppoint></sweeppoint>	Number of points per sweep		
	- 0-	see above 201	
Example:	*RST		
-	Reset the instrument, activating a frequency sweep with 201		
	sweep points.		
	SWE:TIME?		
	Query total sweep time.		
	SWE:POIN 2010		
	Multiply the (default) number of points by 10.		
	Query total sweep time again. The analyzer estimates a sweep		
		also multiplied by 10.	
Manual control:	See "Start on page 25	/ Stop / Center / Span Frequency (Power / Time)" 56	

#### [SENSe<Chn>:]SWEep:SRCPort <Port>

Selects a source port for the stimulus signal. The setting acts on the active trace. The effect of the drive port selection depends on the measurement parameter associated to the active trace:

- If an S-parameter S<sub><out><in></sub> is measured, the second port number index <in> (input port of the DUT = drive port of the analyzer) is set equal to the selected drive port: Drive port selection affects the measured quantity.
- If a wave quantity or a ratio is measured, the drive port is independent of the measured quantity:

Suffix: <chn></chn>	Channel number used to identify the active trace.
Parameters: <port></port>	Test port number of the analyzer, 1 to 2, 3 or 4, depending on the analyzer model. *RST: 1 (test port 1)
Example:	CALC4:PAR:SDEF "Ch4Tr1", "A1" Create channel 4 and a trace named "Ch4Tr1" to measure the wave quantity a <sub>1</sub> . The trace automatically becomes the active trace. SENS4:SWE:SRCP 2 Select drive port 2 for the active trace. CALC4:PAR:MEAS? "Ch4Tr1" Query the measurement result for "Ch4Tr1". The response is 'A1D2SAM'.

### [SENSe<Ch>:]SWEep:STEP <StepSize>

Sets the distance between two consecutive sweep points.

**Note:** This setting is valid for sweep types with equidistant sweep points only. It does not apply to logarithmic and segmented sweeps.

<b>Suffix:</b> <ch></ch>	Channel number	
Parameters: <stepsize></stepsize>	Stimulus step size. The minimum step size is equal to the sweep span divided by the maximum number of points ([SENSe <ch>:] SWEep:POINts) minus one, the maximum step size is equal to the sweep span ([SENSe<ch>:] FREQuency: SPAN). See also description of manual control and program example below.</ch></ch>	
	Range: *RST:Depending on the other channel settings; see above. Depending on the analyzer model. The default step size is equal to the default sweep span of the ana- lyzer divided by the default number of points minus one.Default unit:Hz	
Example:	*RST; :SWE:STEP? Query the default step size. For a 8.5 GHz analyzer, the response is 42499500. 42499500 Hz = (8.5 GHz - 100 kHz) / 200. SWE:STEP UP Increase the step size. FREQ:STOP?; :SWE:POIN? Query the stop frequency of the sweep and the number of points. Increasing the step size has changed both values.	
Manual control:	See "Freq Step Size" on page 264	

#### [SENSe<Ch>:]SWEep:TIME <SweepDuration>

Sets the duration of the sweep ("Sweep Time"). Setting a sweep time disables the automatic calculation of the (minimum) sweep time; see [SENSe<Ch>:]SWEep:TIME: AUTO.

**Note:** The sweep time is ignored for the sweep types "Time" and "CW Mode" ( [SENSe<Ch>:]SWEep:TYPE).

Suffix: <Ch>

Channel number

# Parameters:

<sweepduration></sweepduration>	Sweep time. The minimum sweep time depends on the other channel settings, in particular on the number of points ( [SENSe <ch>:]SWEep:POINts), the IF bandwidth ( [SENSe<ch>:]BWIDth[:RESolution]) and the measure- ment delay for each partial measurement ([SENSe<ch>:] SWEep:DWEL1). Changing the duration leaves the number of points unchanged but directly affects the delay.</ch></ch></ch>		
	Range: *RST:	Minimum sweep time to 100000 s. Minimum sweep time, depending on the channel set- tings.	
	Default unit: s		
Example:	SWE: DWEL? Query the d SWE: TIME Increase the SWE: DWEL? Query the m delay is incr	elay for each partial measurement.	
Manual control:	See "Start / on page 256	Stop / Center / Span Frequency (Power / Time)" 6	

#### [SENSe<Ch>:]SWEep:TIME:AUTO <Boolean>

When enabled, the (minimum) sweep time is calculated internally using the other channel settings and zero delay ([SENSe<Ch>:]SWEep:DWEL1).

**Note:** The automatically calculated sweep duration is ignored for the sweep types "Time" and "CW Mode" ([SENSe<Ch>:]SWEep:TYPE).

<b>Suffix:</b> <ch></ch>	Channel number
Parameters: <boolean></boolean>	ON   OFF - turn the automatic calculation of the sweep time on or off. OFF is also set if the sweep duration or delay is set explicitly using [SENSe <ch>:]SWEep:TIME or [SENSe<ch>:]SWEep:DWEL1.</ch></ch>
	*RST: ON
Example:	SWE:TIME 1 Set a total sweep time of 1 s. SWE:TIME:AUTO? A query returns the value 1.
Manual control:	See "Sweep Time / Auto" on page 265

# [SENSe<Ch>:]SWEep:TYPE <Format>

Selects the sweep type, i.e. the sweep variable (frequency/power/time) and the position of the sweep points across the sweep range.

Suffix:

<Ch>

Channel number.

Parameters:			
<format></format>	LINear   LOGarithmic   POWer   CW   POINt   SEGMent		
	LINear - linear frequency sweep at constant source power (		
	<pre>SOURce<ch>:POWer<phypt>[:LEVel][:IMMediate][:</phypt></ch></pre>		
	AMPLitude]). The stimulus frequency		
	<ul> <li>([SENSe<ch>:]FREQuency:) is swept in equidistant steps over the frequency range. In a Cartesian diagram, the x-axis is a linear frequency axis.</ch></li> <li>LOGarithmic - logarithmic frequency sweep. The frequency is swept in equidistant steps on a logarithmic scale. In a Cartesian</li> </ul>		
	diagram, the x-axis is a logarithmic frequency axis.		
	SEGMent - segmented frequency sweep. The sweep range is composed of several continuous frequency ranges or single fre- quency points defined by means of the commands in the [SENSe <ch>:]SEGMent<seg> subsystem.</seg></ch>		
	POWer - power sweep. The measurement is performed at con-		
	<pre>stant frequency (SOURce<ch>: FREQuency<phypt>: FIXed)</phypt></ch></pre>		
	but with variable generator power that is swept in linear, equidis- tant steps over a continuous range		
	(SOURce <ch>: POWer<phypt>:STARt, SOURce<ch>:</ch></phypt></ch>		
	POWer <phypt>:STOP). In a Cartesian diagram, the x-axis is a dB-linear power axis.</phypt>		
	CW - time sweep. The measurement is performed at constant fre- quency (SOURce <ch>: FREQuency<phypt>: FIXed) and</phypt></ch>		
	<pre>source power (SOURce<ch>: POWer<phypt>[:LEVel][:</phypt></ch></pre>		
	IMMediate][:AMPLitude]) and repeated over a specified		
	period of time at constant time intervals.		
	POINt - CW mode sweep, time sweep triggered according to the current trigger settings.		
	*RST: LINear		
Example:	*RST		
	Reset the analyzer, activating a linear frequency sweep. SWE:TYPE LOG		
	Change to a logarithmic frequency sweep, resetting the stimulus values of the sweep points.		
Manual control:	See "Lin Freq" on page 266		

# 6.3.15 SOURce Commands

The SOURCE... commands affect the source settings of the R&S ZNB.

# 6.3.15.1 SOURce:FREQuency...

The SOURce: FREQuency... commands configure the sources for frequency conversion measurements and control the frequency and power of the internal signal source.

SOURce <ch>:FREQuency<phypt>:CONVersion:ARBitrary:EFRequency<gen></gen></phypt></ch>	788
SOURce <ch>:FREQuency<phypt>:CONVersion:ARBitrary:IFRequency</phypt></ch>	789
SOURce <ch>:FREQuency:CONVersion:MIXer:PMFixed</ch>	791
SOURce <ch>:FREQuency:CONVersion:MIXer:PMODe</ch>	791
SOURce <ch>:FREQuency<phypt>[:CW]</phypt></ch>	792
SOURce <ch>:FREQuency<phypt>:FIXed</phypt></ch>	792

SOURce<Ch>:FREQuency<PhyPt>:CONVersion:ARBitrary:EFRequency<Gen> <Boolean>, <Numerator>, <Denominator>, <Offset>, <SweepType>

Defines an external generator frequency for frequency-converting measurements. The external generator frequency is either a range (for frequency sweeps) or a CW frequency (for power, time and CW Mode sweeps).

Suffix:		
<ch></ch>	Channel nu	mber
<phypt></phypt>	•	mber of the analyzer. This suffix is ignored because or is referenced via <gen>.</gen>
<gen></gen>	Generator n	umber
Parameters: <boolean></boolean>	Switch the g	generator on or off.
<numerator></numerator>	Parameters of the frequency formula. The source frequency $f_s$ is calculated according to $f_s = $ Numerator>/ <denominator> * <math>f_b</math> + <offset> where <math>f_b</math> represents the channel base frequency (parameter SWEep). For parameters CW or FIXed, <math>f_b = 0</math>. Note: The <offset> parameter also includes the "Offset Ratio" in manual control.</offset></offset></denominator>	
	Range: *RST:	The converted frequency or frequency range must be within the external generator's frequency range. In addition the <numerator> values are rounded to pos- itive or negative integer numbers. The default frequency/frequency range corresponds to the sweep range or CW frequency of the analyzer, i.e. <numerator> = <denominator> = 1, <offset> = 0 Hz.</offset></denominator></numerator></numerator>
	Default unit:	: 1

<denominator></denominator>	See above, <numerator></numerator>
	Range:The converted frequency or frequency range must be within the external generator's frequency range. In addition the <denominator> values are rounded to positive integer numbers; zero is not allowed.*RST:1Default unit:1</denominator>
<offset></offset>	See above, <numerator></numerator>
	Range:The converted frequency or frequency range must be within the external generator's frequency range. In addition the <offset> values are rounded to (positive or negative) multiples of 1 Hz.*RST:0Default unit:Hz</offset>
<sweeptype></sweeptype>	CW   FIXed   SWEep
	SWEep - the full formula is applied. For frequency sweeps, the command defines a sweep range.CW   FIXed - the reduced formula with $f_b = 0$ is applied; the com- mand defines a fixed frequency.*RST:SWEep
Example:	<pre>*RST; FREQ:STAR 1E+9; STOP 1.1E+9 Reset the analyzer (activating a frequency sweep) and set the sweep range between 1 GHz and 1.1 GHz. SYST:COMM:RDEV:GEN1:DEF 'Ext. Gen. 1', 'SME02', 'gpib0', '21' Configure an R&amp;S SME02 generator as external generator no. 1, assigning the name "Ext. Gen. 1" and a GPIB address 21. SOUR:FREQ:CONV:ARB:EFR ON, 1, 4, 1E+9, SWE Switch the generator on and convert the generator frequency to the range between 1.25 GHz and 1.275 GHz.</pre>
Manual control:	See "Frequency conversion formula" on page 367

#### SOURce<Ch>:FREQuency<PhyPt>:CONVersion:ARBitrary:IFRequency

<Numerator>, <Denominator>, <Offset>, <SweepType>

Defines the port-specific source frequency for frequency-converting measurements. The port frequency is either a range (for frequency sweeps) or a CW frequency (for power, time and "CW Mode" sweeps).

**Note:** The frequency formula is applied even if the analyzer returns an error message, because the frequency is outside the allowed range.

### Suffix:

<ch></ch>	Channel number
<phypt></phypt>	Test port number of the analyzer

Parameters:			
<numerator></numerator>	culated acc set> where	s of the frequency formula. The port frequency $f_p$ is cal- cording to $f_p = \langle Numerator \rangle \langle Denominator \rangle * f_b + \langle Off-e f_b represents the channel base frequency (parameter$	
		or parameters CW or FIXed, $f_b = 0$ .	
	<b>Note:</b> The <offset> parameter also includes the "Offset Ratio" in manual control.</offset>		
	Range:	The converted frequency or frequency range must be within the analyzer's frequency range, depending on the instrument model. In addition the <numerator> values are rounded to positive or negative integer numbers; zero is not allowed.</numerator>	
	*RST:	The default frequency/frequency range corresponds to the sweep range or CW frequency of the analyzer, i.e. <numerator> = <denominator> = 1, <offset> = 0 Hz.</offset></denominator></numerator>	
	Default un	it: 1	
<denominator></denominator>	See above, <numerator></numerator>		
	Range:	The converted frequency or frequency range must be within the analyzer's frequency range, depending on the instrument model. In addition the <denominator> values are rounded to positive integer numbers; zero is not allowed.</denominator>	
	*RST: Default uni	1	
<offset></offset>	See above	e, <numerator></numerator>	
	Range:	The converted frequency or frequency range must be within the analyzer's frequency range, depending on the instrument model. In addition the <offset> values are rounded to (positive or negative) multiples of 1 Hz.</offset>	
	*RST: Default uni	0 it: Hz	
<sweeptype></sweeptype>	CW   FIXe	d   SWEep	
	command CW   FIXe	he full formula is applied. For frequency sweeps, the defines a sweep range. d - the reduced formula with $f_b = 0$ is applied; the com-	
	*RST:	nes a fixed frequency. SWEep	
	1.01.	Owech	

Example:	*RST; FREQ:STAR 1E+9; STOP 1.1E+9
	Reset the analyzer (activating a frequency sweep) and set the
	sweep range between 1 GHz and 1.1 GHz.
	SOUR:FREQ2:CONV:ARB:IFR 2, 1, 1E+9, SWE
	Convert the source frequency at test port no. 2 to the range
	between 3 GHz and 3.2 GHz.
	SENSe:FREQuency:CONVersion:GAIN:LMCorrection ON
	Enable the load match correction for all conversion gains.
	SENSe:FREQuency:CONVersion?
	Query the measurement mode. The response is ARB, because the
	port frequency definition also activates the arbitrary mode.
	SENSe:FREQuency:CONVersion FUND
	De-activate the arbitrary mode, cancel the port frequency defini- tion.
Manual control:	See "Frequency conversion formula" on page 367

# SOURce<Ch>:FREQuency:CONVersion:MIXer:PMFixed <arg0>[, <arg1>]

Suffix: <ch></ch>	Channel number	
Parameters: <arg0></arg0>	RF   LO   LO1   LO2   IF RF – mixer input signal LO   LO1 – local oscillator signal no. 1 LO2 – local oscillator signal no. 2, for 2-stage mixer measurements ([SENSe <ch>:] FREQuency: CONVersion:MIXer:STAGes) IF – mixer output signal</ch>	
<arg1></arg1>	Fixed power Range: The exact range depends on the analyzer model or external generator used; refer to the data sheet. *RST: -25 dBm (for LO) Default unit: dBm	
Example:	See [SENSe <ch>:]FREQuency:CONVersion:MIXer: MFFixed</ch>	
Manual control:	See "Power (table)" on page 384	

Assigns a fixed power to the RF, LO 1, LO 2, or to the IF signal.

#### SOURce<Ch>:FREQuency:CONVersion:MIXer:PMODe <arg0>[, <arg1>]

Sets the RF, LO 1, LO 2, or the IF signal ports to fixed power or to the channel base power.

# Suffix:

<Ch> Channel number

```
User Manual 1173.9163.02 - 13
```

Parameters:		
<arg0></arg0>	RF   LO   LO1   LO2   IF	
	RF – mixer input signal	
	LO   LO1 – local oscillator signal no. 1	
	LO2 – local oscillator signal no. 2, for 2-stage mixer measurements	
	([SENSe <ch>:]FREQuency:CONVersion:MIXer:STAGes) IF - mixer output signal</ch>	
<arg1></arg1>	FUNDamental   FIXed	
	FIXed – use a fixed power, to be specified via SOURce <ch>:</ch>	
	FREQuency:CONVersion:MIXer:PMFixed	
	FUNDamental – use the channel base power specified via	
	SOURce <ch>:POWer<pt>:STARt, SOURce<ch>:</ch></pt></ch>	
	POWer <pt>:STOP,</pt>	
	SOURce <ch>:POWer<pt>[:LEVel][:IMMediate][:</pt></ch>	
	AMPlitude]	
	*RST: Minimum of the analyzer's frequency range	
Example:	See [SENSe <ch>:]FREQuency:CONVersion:MIXer: MFFixed</ch>	
Manual control:	See "Power (table)" on page 384	
	See "Power (table)" on page 384	

# SOURce<Ch>:FREQuency<PhyPt>[:CW] <FixedFreq> SOURce<Ch>:FREQuency<PhyPt>:FIXed <FixedFreq>

Defines the fixed (Continuous Wave, CW) frequency for all sweep types operating at fixed frequency (power sweep, time sweep, CW mode sweep). The two command forms SOURce<Ch>: FREQuency<PhyPt>: CW and SOURce<Ch>: FREQuency<PhyPt>: FIXed are equivalent.

The frequency range depends on the R&S ZNB model; see chapter 6.3.14, "[SENSe:] Commands", on page 676.

**Note:** SOURce<Ch>: FREQuency<PhyPt>[:CW] |: FIXed is equivalent to [SENSe<Ch>:] FREQuency[:CW] |: FIXed. Source and receiver frequency are always equal; the four commands overwrite each other.

With option R&S ZNB-K4, Frequency Conversion Measurements, port-specific source and receiver frequencies can be defined; see SOURce<Ch>:FREQuency<PhyPt>: CONVersion:ARBitrary:IFRequency.

Suffix: <Ch>

Channel number

channel.

<PhyPt>

Test port number of the analyzer. This suffix is ignored because the selected frequency applies to all source ports in the active

<b>Parameters:</b> <fixedfreq></fixedfreq>	Fixed stimulus and analyzer frequency. Increment: 0.1 kHz *RST: 1 GHz Default unit: Hz
Example:	FUNC "XPOW: POW: A1" Activate a power sweep and select the wave quantity a <sub>1</sub> as mea- sured parameter for channel and trace no. 1. SOUR: FREQ: CW 100 MHz Set the CW frequency to 100 MHz.
Manual control:	See "CW Frequency" on page 256

# 6.3.15.2 SOURce:LPORt...

The SOURCE: LPORt... commands define the logical ports representing a balanced port configuration.

SOURce <ch>:LPORt<logpt>79</logpt></ch>	3
SOURce <ch>:LPORt<logpt>:CLEar79</logpt></ch>	4

### SOURce<Ch>:LPORt<LogPt> <PhysicalPort1>[, <PhysicalPort2>]

Assigns the logical port number <LogPt>

- to the single-ended physical port <PhysicalPort1>
- or to a pair of physical ports <PhysicalPort1>,<PhysicalPort2>, at the same time defining them as balanced port

A balanced port configuration generally introduces a new set of mixed mode measured quantities. Therefore the traces must be redefined when a balanced port is created. To avoid any inconsistencies the analyzer deletes all traces when SOURce<Ch>:LPORt<LogPt> is used.

#### Important:

In the current implementaton, the required logical ports must be created explicitly and numbered consecutively, starting at 1.

Suffix: <ch></ch>	Channel number.	
<logpt></logpt>	Logical port number used to number balanced or single-ended ports. If unspecified the numeric suffix is set to 1. One balanced port requires two physical ports, so the maximum number of bal- anced ports is half the number of test ports (see INSTrument: TPORt:COUNT?).	
Parameters:		
<physicalport1></physicalport1>	Number of first/only physical port	
	Range: 1 to number of test ports	

<PhysicalPort2> Number of second physical port (optional), forming a balanced port with the first physical port The port numbers must be different. Moreover, a physical port cannot be assigned to several logical ports. Range: 1 to number of test ports Example: \*RST; :SOUR:LPOR1 1,2; :LPOR2 4; :LPOR3 3 Combine the physical ports 1 and 2 to the logical port 1 (balance) and assign physical ports 4 and 3 to logical ports 2 and 3, respectively SOUR:LPOR1? Query the physical ports assigned to logical port no. 1. The response is 1,2. SOUR:GRO 1,2 Define logical ports no. 1 and 2 as used (group 1), port 3 as unused SOUR:GRO? Query the port group no. 1. The response is 1,2. SOUR:GRO:CLE ALL; :SOUR:GRO? Dissolve all port groups and repeat the query. The response is 1,n where n denotes the number of available test ports. SOUR:LPOR:CLE ALL SOUR: LPOR1? Dissolve all logical ports and repeat the query. The response is 1: the logical port no. 1 is identical to the physical port no. 1. Manual control: See "Select Predefined" on page 156

## SOURce<Ch>:LPORt<LogPt>:CLEar [<Scope>]

Dissolves a balanced port numbered <LogPt> or all balanced ports.

<b>Suffix:</b> <ch></ch>	Channel number
<logpt></logpt>	Logical port number used to number balanced ports. Range according to the current port configuration ( SOURce <ch>: LPORt<logpt>). If an undefined balanced port number is used, the analyzer generates an error message. Excep- tion: Parameter ALL, see below.</logpt></ch>
Setting parameters:	
<scope></scope>	ALL
	If $ALL$ is specified, all balanced ports are dissolved; the <log_port> suffix is ignored. If <math>ALL</math> is omitted, only the specified balanced port is dissolved.</log_port>
Example:	See SOURce <ch>:LPORt<logpt></logpt></ch>
Usage:	Setting only
Manual control:	See "Select Predefined" on page 156

#### 6.3.15.3 SOURce:GROup...

The SOURce: GROup... commands define the group of (un-)used logical ports.

SOURce <ch>:GROup<grp></grp></ch>	5
SOURce <ch>:GROup<grp>:CLEar</grp></ch>	5

#### SOURce<Ch>:GROup<Grp> <log port1>, <log port2>

Defines a port group numbered <Grp> containing a continuous range of logical ports between <log port1> and <log port2>. See SOURce<Ch>:LPORt<LogPt> on how to define logical ports.

#### Note:

In the current implementaton

- the R&S ZNB only supports a single port group per channel: the group of used • ports
- the group must start at logical port number 1

#### Suffix:

<ch></ch>	Channel number.
<grp></grp>	Port group number. Currently this suffix is ignored: only <grp>=1 is supported.</grp>
Parameters: <log_port1></log_port1>	Range: must be set to 1
<log_port2></log_port2>	First and last logical port number in the port group.
Example:	See SOURce <ch>:LPORt<logpt> on page 793</logpt></ch>
Manual control:	See "Define Physical to Logical Port Relation" on page 157

### SOURce<Ch>:GROup<Grp>:CLEar [<arg0>]

Dissolves a group of logical ports <Grp> or all port groups. See SOURce<Ch>: GROup<Grp> on page 795 on how to define port groups.

#### Note:

In the current implementaton the R&S ZNB only supports a single port group per channel: the group of used ports.

# Suffix:

<ch></ch>	Channel number.
<grp></grp>	Port group number. Currently this suffix is ignored: only <grp>=1 is supported.</grp>

# Setting parameters:

<arg0></arg0>	ALL
	If ALL is specified, all port groups are dissolved and a default port group 1, consisting of all available logical ports, is restored; the <grp> suffix is ignored.</grp>
	If ALL is omitted, only the specified port group is dissolved, except the deleted port group was the only one, in which case again default port group 1 will be restored. In case an undefined port group number is used, the analyzer generates an error message.
Example:	See SOURce <ch>:LPORt<logpt> on page 793</logpt></ch>
Usage:	Setting only
Manual control:	See "Define Physical to Logical Port Relation" on page 157

# 6.3.15.4 SOURce:POWer...

The SOURce: POWer... commands define the power of the internal and external signal sources and control a scalar source power calibration.



#### Port-specific and general settings

The SOURce: POWer... subsystem comprises port-specific and general settings. Portspecific settings are valid for the port specified by the numeric suffix <PhyPt> (...: POWer<PhyPt>:...). General settings are valid for all test ports of the analyzer; the port suffix is ignored. Refer to the description of the individual commands for more information.

#### SOURce:POWer:CORRection...

The SOURce: POWer: CORRection... commands control a scalar source power calibration.

SOURce <ch>:POWer<phypt>:CORRection[:ACQuire]</phypt></ch>	797
SOURce <ch>:POWer<phypt>:CORRection[:ACQuire]:VERification:RESult?</phypt></ch>	
SOURce <ch>:POWer<phypt>:CORRection:COLLect:AVERage[:COUNt]</phypt></ch>	799
SOURce <ch>:POWer<phypt>:CORRection:COLLect:AVERage:NTOLerance</phypt></ch>	799
SOURce <ch>:POWer<phypt>:CORRection:COLLect:CFACtor</phypt></ch>	800
SOURce <ch>:POWer<phypt>:CORRection:COLLect:PMReadings</phypt></ch>	800
SOURce <ch>:POWer:CORRection:DATA</ch>	801
SOURce <ch>:POWer:CORRection:DATA:PORT<phypt></phypt></ch>	801
SOURce <ch>:POWer<phypt>:CORRection:GENerator<gen>[:STATe]</gen></phypt></ch>	802
SOURce <ch>:POWer<phypt>:CORRection:IMODulation:LTONe[:ACQuire]</phypt></ch>	802
SOURce <ch>:POWer:CORRection:IMODulation:PORT</ch>	803
SOURce <ch>:POWer<phypt>:CORRection:IMODulation:UTONe[:ACQuire]</phypt></ch>	804
SOURce <ch>:POWer<phypt>:CORRection:NREadings</phypt></ch>	804
SOURce <ch>:POWer<phypt>:CORRection:OSOurces[:STATe]</phypt></ch>	804
SOURce:POWer:CORRection:PMETer:ID	805
SOURce <ch>:POWer<phypt>:CORRection:PPOWer</phypt></ch>	805
SOURce <ch>:POWer<phypt>:CORRection:PSELect</phypt></ch>	806

SCPI Command Reference

SOURce <ch>:POWer<phypt>:CORRection:STATe</phypt></ch>	806
SOURce <ch>:POWer<phypt>:CORRection:TCOefficient:CALibration</phypt></ch>	807
SOURce <ch>:POWer<phypt>:CORRection:TCOefficient:COUNt?</phypt></ch>	808
SOURce <ch>:POWer<phypt>:CORRection:TCOefficient:DEFine<listno></listno></phypt></ch>	808
SOURce <ch>:POWer<phypt>:CORRection:TCOefficient:DELete<listno>:ALL</listno></phypt></ch>	809
SOURce <ch>:POWer<phypt>:CORRection:TCOefficient:DELete<listno>[:DUMMy]</listno></phypt></ch>	809
SOURce <ch>:POWer<phypt>:CORRection:TCOefficient:FEED</phypt></ch>	810
SOURce <ch>:POWer<phypt>:CORRection:TCOefficient:INSert<listno></listno></phypt></ch>	810
SOURce <ch>:POWer<phypt>:CORRection:TCOefficient[:STATe]</phypt></ch>	811
SOURce <ch>:POWer<phypt>:CORRection:DATA:PARameter<wv>:COUNt?</wv></phypt></ch>	811
SOURce <ch>:POWer:CORRection:DATA:PARameter<wv>?</wv></ch>	812

# SOURce<Ch>:POWer<PhyPt>:CORRection[:ACQuire] <SourceType>[,

<SourcePort>]

Selects the source for the source power calibration, starts and applies the source power calibration.

**Note:** The command cannot be used unless a power meter is connected via GPIB bus, USB or LAN interface and configured in the "External Power Meters" dialog.

Suffix:		
<ch></ch>	Calibrated c	hannel number
<phypt></phypt>	•	ort number. This suffix is ignored because the port pecified in the parameter list.
Parameters:		
<sourceport></sourceport>	Analyzer port or generator port number, if PORT or GENerator is the first parameter.	
	Range:	1 to port number of the analyzer / number of external generators.
Setting parameters:		
<sourcetype></sourcetype>	PORT   GEN	Nerator   A1   A2   A3   A4   ESRC1   ESRC2
	GENerator - The port and	lyzer port is the source of the calibrated wave. - external generator is the source. I generator numbers are specified by means of the rt> parameter.
	A1 and A2 a	A4 – direct analyzer port selection. The parameters re ZVR-compatible. No additional port number paramob be specified.
	•	RC2 – direct external generator selection. The param- R-compatible. No additional parameters need to be

Example:	SOUR: POW: CORR: OSO: STAT OFF
•	To improve the accuracy, switch off all other sources during the
	calibration sweep.
	SOUR:POWer:CORR:COLL:METH RRAF; PMR 2
	Enable fast power correction with two power meter readings.
	SOUR:POW:CORR:NRE 2; COLL:AVER:NTOL 0.5
	Increase the number of readings and reduce the power tolerance
	to improve the accuracy.
	SOURce:POW:CORR:COLL:CFAC 0.9
	Reduce the correction factor to 0.9.
	SOURce:POW:CORR:PSELect PPOW; PPOWer -5
	Define reference receiver cal power which is independent of the
	port power; set its value to -5 dBm.
	SOUR: POW: CORR: ACQ PORT, 1
	Perform a source power calibration using port 1 as a source port.
	SOUR: POW: CORR: STAT?
	Check whether the calibration is applied (the response is 1).
Example:	Change the test setup, connect a previously configured external generator no. 1 to the reference plane.
	SOUR: POW: CORR: ACQ GEN, 1
	Perform a source power calibration using the external generator
	no. 1 as a source.
	SOUR: POW: CORR: GEN?
	Check whether the calibration is applied (the response is 1).
Usage:	Setting only
Manual control:	See "Port Overview" on page 305

# SOURce<Ch>:POWer<PhyPt>:CORRection[:ACQuire]:VERification:RESult?

Returns (and deletes) the result of the last verification sweep. The response contains three values:

- <Channel> calibrated channel, e.g. Ch 1 for channel no. 1.
- <Boolean> 1 for "calibration passed" (the maximum offset is below the tolerance), 0 for "calibration failed".
- <MaxOffset> maximum power offset between the measured power at the reference plane and the "Cal Power" during the verification sweep in dB.

If no verfication sweep is available, or if the result has been queried already, the response is  $\ensuremath{\,0.}$ 

#### Suffix:

<ch></ch>	Calibrated channel number. This suffix is ignored; the result is based on the last verification sweep acquired.
<phypt></phypt>	Calibrated port number. This suffix is ignored; the result is based on the last verification sweep acquired.

Example:	<pre>*RST; :SOURce:POWer:CORRection:NREadings 2 SOURce:POWer:CORRection:COLLect:AVERage: NTOLerance 0.5 Increase the number of readings and reduce the power tolerance to improve the accuracy. SOURce:POWer:CORRection:ACQuire PORT,1 Perform a source power calibration using port 1 as a source port. SOURce:POWer:CORRection:ACQuire:VERification: RESult? Query the result of the verification sweep. Possible response: Ch1 1,9.9E+002</pre>
Usage:	Query only
Manual control:	See "Calibration Sweep Diagram" on page 304

# SOURce<Ch>:POWer<PhyPt>:CORRection:COLLect:AVERage[:COUNt] <NoReadings>

Sets a limit for the number of calibration sweeps in the source power calibration. The command is valid for all channels, ports and external generators. Equivalent command: SOURce<Ch>: POWer<PhyPt>: CORRection:NREadings.

<b>Suffix:</b> <ch></ch>	Calibrated channel number. This parameter is ignored; the limit applies to all channels.
<phypt></phypt>	Calibrated port number. This parameter is ignored; the limit applies to all sources.
Parameters: <noreadings></noreadings>	Number of readings Range: 1 to 100 *RST: 2
Example:	<pre>See SOURce<ch>: POWer<phypt>:CORRection[:ACQuire] (for equivalent command SOURce<ch>: POWer<phypt>: CORRection:NREadings)</phypt></ch></phypt></ch></pre>
Manual control:	See "Flatness Cal > Total Readings" on page 349

# SOURce<Ch>:POWer<PhyPt>:CORRection:COLLect:AVERage:NTOLerance <Tolerance>

Specifies the maximum deviation of the measured power from the target power of the calibration. The command is valid for all channels and calibrated ports.

Suffix:	Calibrated channel number. This parameter is ignored; the toler-
<ch></ch>	ance value is valid for all sources.
<phypt></phypt>	Calibrated port number. This parameter is ignored; the tolerance value is valid for all sources.

Parameters: <pre><tolerance></tolerance></pre>	Tolerance value		
	Range:0.001 dB to 1000 dB*RST:1 dBDefault unit:dB		
Example:	See SOURce <ch>: POWer<phypt>: CORRection[:ACQuire]</phypt></ch>		
Manual control:	See "Flatness Cal > Tolerance" on page 349		

# SOURce<Ch>:POWer<PhyPt>:CORRection:COLLect:CFACtor <Convergence>

Specifies the convergence factor for a source power calibration.

Suffix: <ch></ch>	Calibrated channel number. This parameter is ignored; the con- vergence factor is valid for all sources.	
<phypt></phypt>	Calibrated port number. This parameter is ignored; the conver- gence factor is valid for all sources.	
Parameters: <convergence></convergence>	Convergence factor Range: 0 to 2 Increment: 1 dB *RST: 1	
Example:	See SOURce <ch>: POWer<phypt>:CORRection[:ACQuire]</phypt></ch>	
Manual control:	See "Flatness Cal > Convergence" on page 349	

# SOURce<Ch>:POWer<PhyPt>:CORRection:COLLect:PMReadings <NoReadings>

Selects the number of power meter readings for source power calibration method SOURce<Ch>:POWer<PhyPt>:CORRection:COLLect:METHod RRAFter.

Suffix: <ch></ch>	Calibrated channel number. This parameter is ignored; the param- eter is valid for all channels.	
<phypt></phypt>	Calibrated port number. This parameter is ignored; the parameter is valid for all sources.	
Parameters: <noreadings></noreadings>	Number of power meter readings. If the value exceeds the maxi- mum number of calibration sweeps (SOURce <ch>: POWer<phypt>: CORRection: COLLect: AVERage[:COUNt]) the latter is adjusted.</phypt></ch>	
	Range: 1 to 100 *RST: 1	
Example:	See SOURce <ch>: POWer<phypt>:CORRection[:ACQuire]</phypt></ch>	

User Manual 1173.9163.02 - 13

SOURce<Ch>:POWer:CORRection:DATA <Source>, <CorrData>... SOURce<Ch>:POWer:CORRection:DATA:PORT<PhyPt> <Source>, <CorrData>...

Reads or writes scalar source power correction data sets. A power correction data set contains n real values where:

- Each value corresponds to the ratio of the actual power at the reference plane (value provided by the used source) to the uncalibrated power in dB.
- The number n is equal to the number of sweep points.

Increasing (decreasing) the values in the correction data sets increases (decreases) the power at the reference plane. Writing correction data (the setting command) fails if the number of transferred values is not equal to the number of sweep points.

<b>Suffix:</b> <ch></ch>	Calibrated channel number			
-				
<phypt></phypt>	Physical port number, used to select a specific frequency axis in arbitrary mode (with option R&S ZNB-K4).			
Parameters:				
<source/>	Identifier for the source of the calibrated wave: 'A <n>' or 'PORT<n>' denote correction data for the analyzer port no. <n>. 'ESRC<n>' or 'GEN<n>' denote correction data for the external generator no. <n>.</n></n></n></n></n></n>			
<corrdata></corrdata>	 block_data>			
	Power correction values in block data format or as a comma-sep- arated list of real numbers. The query returns a list of numbers. Range: All numbers are interpreted as dB-values.			
Example:	*RST; :SWE:POIN 10			
	Reset the instrument and reduce the number of sweep points to 10.			
	SOUR: POW: CORR: ACQ PORT, 1			
	Perform a source power calibration using port 1 as a source por SOUR: POW: CORR: DATA? 'A1'			
	Query the correction values. The analyzer returns 10 comma-sep- arated real numbers. SOUR: POW: CORR: DATA 'A1', 1, 2, 3, 4, 5, -6, -7, -8, -9, -0 Replace the correction values by ten (new) numbers.			
Manual control:	See "Apply" on page 305			

User Manual 1173.9163.02 - 13

# SOURce<Ch>:POWer<PhyPt>:CORRection:GENerator<Gen>[:STATe] <Boolean>

Enables or disables the source power calibration for channel <Ch> and for an external generator number <Gen>. The command is disabled unless a source power calibration for the external generator has been performed (SOURce<Ch:POWer<PhyPt>: CORRection[:ACQuire]). To enable or disable a source power calibration for an analyzer port use SOURce<Ch>:POWer<PhyPt>: CORRection:STATE.

Suffix: <ch></ch>	Calibrated channel number	
<phypt></phypt>	Calibrated port number. This suffix is ignored; the generator is selected via <gen>.</gen>	
<gen></gen>	Generator number	
Parameters: <boolean></boolean>	Enables (ON) or disables (OFF) the source power calibration for port number <phypt>. *RST: OFF</phypt>	
Example:	See SOURce <ch>: POWer<phypt>:CORRection[:ACQuire]</phypt></ch>	
Manual control:	See "Port Overview" on page 356	

### SOURce<Ch>:POWer<PhyPt>:CORRection:IMODulation:LTONe[:ACQuire]

Starts the source calibration for the lower tone (1<sup>st</sup> power calibration step for intermodulation measurements), stores and applies the calibration data. The external power meter used is selected via SOURce<Ch>: POWer<PhyPt>: CORRection: PMETer: ID.

<b>Suffix:</b> <ch></ch>	Calibrated channel number
<phypt></phypt>	Port number This suffix is ignored; the analyzer calibrates the port that is selected as a source port for the intermodulation measurement ([SENSe <ch>:]FREQuency:IMODulation:LTONe).</ch>

User Manual 1173.9163.02 - 13

Example: \*RST; FREQ: IMOD: LTON PORT, 1; UTON GEN, 1 Reset the instrument to create the default channel no. 1. Select port 1 as a source port for the lower tone, the (previously configured) external generator no. 1 as a source port for the upper tone. FREQ: IMOD: REC 2 Select port 2 as a receiver port. FREQ:STAR 1GHZ; STOP 2GHz Define a suitable sweep range to ensure that the analyzer can measure all intermodulation products. SOUR: POW: CORR: PMET: ID 1 Select power meter no. 1 (previously configured in the "External Power Meters" dialog and properly connected) for the RF source calibration. SOUR: POW: CORR: IMOD: LTON Start source power calibration for the lower tone at the previously selected source port 1. SOUR: POW: CORR: IMOD: UTON Start source power calibration for the upper tone at the previously selected source port 3. CORR: POW: IMOD: ACQ Start receiver power calibration at the previously selected receive port 2. CALC:PAR:SDEF 'IM\_Meas', 'IP3UI' Create a new channel no. 2 and a trace named 'IM\_Meas'. Select the upper 3rd-order intercept point at the DUT input as a measured quantity. Usage: Event Manual control: See "Start Cal Sweep" on page 381

### SOURce<Ch>:POWer:CORRection:IMODulation:PORT <SourceForRecCal>

Selects the source port for the receiver power calibration of an intermodulation measurement. An external generator must be configured before the generator port is available (SYSTem:COMMunicate:RDEVice:GENerator<Gen>:DEFine).

#### Suffix:

<Ch> Channel number

#### Parameters:

SourceForRecCal> String parameter to identify the source port: 'COMBINER' – combiner output

> 'PORT <n>' – analyzer port n (separate port no. by blank, e.g. 'PORT 4')

> 'GEN <n>' – external generator port n (separate port no. by blank, e.g. 'GEN 1')

\*RST: 'COMBINER'

**Command Reference** 

SCPI Command Reference

Example:	*RST; :SOURce:POWer:CORRection:IMODulation:PORT 'PORT 4'	
	Select the analyzer port no. 4 as a source port for the receiver power calibration.	
Manual control:	See "Src for Rcvr Cal" on page 378	

#### SOURce<Ch>:POWer<PhyPt>:CORRection:IMODulation:UTONe[:ACQuire]

Starts the source calibration for the upper tone (2<sup>nd</sup> power calibration step for intermodulation measurements), stores and applies the calibration data. The external power meter used is selected via SOURce<Ch>:POWer<PhyPt>:CORRection:PMETer:ID.

Suffix: <ch></ch>	Calibrated channel number		
<phypt></phypt>	Port number. This suffix is ignored; the analyzer calibrates the port that is selected as a source port for the intermodulation measurement ([SENSe <ch>:]FREQuency:IMODulation:UTONe).</ch>		
Example:	<b>See</b> SOURce <ch>:POWer<phypt>:CORRection: IMODulation:LTONe[:ACQuire]</phypt></ch>		
Usage:	Event		
Manual control:	See "Start Cal Sweep" on page 381		

### SOURce<Ch>:POWer<PhyPt>:CORRection:NREadings <NoCalSweeps>

Sets a limit for the number of calibration sweeps in the source power calibration. The command is valid for all channels, ports and external generators. Equivalent command: SOURce<Ch>: POWer<PhyPt>: CORRection:COLLect:AVERage[:COUNt].

Suffix: <ch></ch>	Calibrated c applies to al	hannel number. This parameter is ignored; the limit I sources.
<phypt></phypt>	Calibrated port number. This parameter is ignored; the limit applies to all sources.	
Parameters:		
<nocalsweeps></nocalsweeps>	Number of readings	
	Range: *RST:	1 to 100 2
Example:	See SOURCE	e <ch>:POWer<phypt>:CORRection[:ACQuire]</phypt></ch>
Manual control:	See "Flatness Cal > Total Readings" on page 349	

# SOURce<Ch>:POWer<PhyPt>:CORRection:OSOurces[:STATe] <Boolean>

Switches off all other sources during the calibration sweep for channel <Ch>.

Suffix: <ch></ch>	Calibrated channel number	
<phypt></phypt>	Calibrated port number. This parameter is ignored; the setting is valid for all sources.	
Parameters: <boolean></boolean>	ON - other sources not necessarily switched off. OFF - other sources switched off during the calibration sweep. *RST: ON	
Example:	See SOURce <ch>: POWer<phypt>:CORRection[:ACQuire]</phypt></ch>	
Manual control:	See "Switch Off All Other Sources" on page 348	

#### SOURce:POWer:CORRection:PMETer:ID <PowerMeter>

Selects an external power meter for the scalar source power calibration (flatness calibration).

**Note:** The command cannot be used unless a power meter is connected via GPIB bus, USB or LAN interface and configured in the "External Power Meters" dialog.

Parameters: <powermeter></powermeter>	Number of external power meter. The parameters UP, DOWN, MIN, MAX are not available for this command.		
	Range: *RST:	1 to number of configured external generators The power meter selection is not changed by a reset of the analyzer.	
Example:	See SOURce <ch>:POWer<phypt>:CORRection:COLLect[: ACQuire] on page 884</phypt></ch>		
Manual control:	See "Power Meter" on page 349		

### SOURce<Ch>:POWer<PhyPt>:CORRection:PPOWer <RecCalPower>

Defines the source power which the R&S ZNB uses to perform the first calibration sweep of the source power calibration ("Reference Receiver Cal Power"). The power value is ignored if the R&S ZNB is set to use the port power result (SOURce<Ch>: POWer<PhyPt>:CORRection:PSELect CPOW).

<b>Suffix:</b> <ch></ch>	Calibrated channel number. This parameter is ignored; the parameter is valid for all channels.
<phypt></phypt>	Calibrated port number. This parameter is ignored; the parameter is valid for all sources.

Parameters: <reccalpower></reccalpower>	Reference receiver cal power	
	Range:	Depending on source power range of the analyzer and the power range of the external power meter.
	*RST: Default unit	0 dBm :: dBm
Example:	See SOURce <ch>: POWer<phypt>:CORRection[:ACQuire]</phypt></ch>	
Manual control:	See "Reference Receiver Cal Power" on page 351	

#### SOURce<Ch>:POWer<PhyPt>:CORRection:PSELect <CalPower>

Qualifies how to define the source power which the R&S ZNB uses to perform the first calibration sweep of the source power calibration ("Reference Receiver Cal Power").

Suffix:	
<ch></ch>	Calibrated channel number. This parameter is ignored; the parameter is valid for all channels.
<phypt></phypt>	Calibrated port number. This parameter is ignored; the parameter is valid for all sources.
Parameters:	
<calpower></calpower>	CPOWer   PPOWer
	PPOWer – use cal power value defined via SOURce <ch>:</ch>
	POWer <phypt>:CORRection:PPOWer</phypt>
	CPOWer – use port power value
	*RST: PPOWer
Example:	See SOURce <ch>: POWer<phypt>:CORRection[:ACQuire]</phypt></ch>
Manual control:	See "Reference Receiver Cal Power" on page 351

### SOURce<Ch>:POWer<PhyPt>:CORRection:STATe <Boolean>

Enables or disables the source power calibration for channel <Ch> and for port number <PhyPt>. The setting command is disabled unless a source power calibration for the analyzer port has been performed (SOURce<Ch>:POWer<PhyPt>:CORRection[: ACQuire]). The query always returns a result.

To enable or disable a source power calibration for an external generator use SOURce<Ch>:POWer<PhyPt>:CORRection:GENerator<Gen>[:STATe].

Suffix:	
<ch></ch>	Calibrated channel number
<phypt></phypt>	Calibrated port number

User Manual 1173.9163.02 - 13

Parameters: <boolean></boolean>	Enables (ON) or disables (OFF) the source power calibration for port number <phypt>.</phypt>
	*RST: OFF
Example:	See SOURce <ch>: POWer<phypt>:CORRection[:ACQuire] .</phypt></ch>
Manual control:	See "Port Overview" on page 356

# SOURce<Ch>:POWer<PhyPt>:CORRection:TCOefficient:CALibration <Boolean>

Selects the position of the additional two-port in the test setup.

Suffix:	
<ch></ch>	Calibrated channel number. This parameter is ignored; the trans- mission coefficient settings are valid for all channels.
<phypt></phypt>	Calibrated port number. This parameter is ignored; the transmis- sion coefficient settings are valid for all sources.
Parameters:	
<boolean></boolean>	ON – two port at power meter (during calibration) OFF – two port at DUT (during measurement)
	*RST: ON (notice that the correction is switched off after a reset)
Example:	RST; :SOUR:POW:CORR:TCO:CAL OFF Select the test setup with the additional two-port in front of the DUT. SOUR:POW:CORR:TCO:DEF 1GHz, -5; DEF 2GHz, -10; DEF2? Define two points in the power loss list; query the second point. SOUR:POW:CORR:TCO:INS2 1.5 GHz, -7.5 Insert a third point as point no. 2 in the list.
Example:	SOUR: POW: CORR: TCO: COUN? Query the number of points. The response is 3. SOUR: POW: CORR: TCO ON Enable the use of two-port transmission coefficients. SOUR: POW: CORR: TCO: FEED 'Trc1' Replace the previous 3 points by the trace points of the default trace "Trc1".

Example:	<pre>MMEM:STOR:CORR:TCO 'C: \Users\Public\Documents\Rohde-Schwarz\Vna \PowerMeterCorr\Test.pmcl' Store the power loss list to the power meter correction list file Test.pmcl in the directory C:\Users\Public\Documents\Rohde-Schwarz\Vna \PowerMeterCorr. MMEM:LOAD:CORR:TCO 'C:\Users\Public\Documents \Rohde-Schwarz\Vna\PowerMeterCorr\Test.pmcl' Re-load the stored power meter correction list file.</pre>
Example:	SOUR: POW: CORR: TCO: DEL1 Delete the first point in the list. SOUR: POW: CORR: TCO: DEL: ALL; :SOUR: POW: CORR: TCO? Clear the entire list. Query whether the transmission coefficients are still taken into account. The response is 0. MMEM: LOAD: CORR: TCO 'C:\Users\Public\Documents \Rohde-Schwarz\Vna\Traces\Test.s2p', 'S21' Load a power loss list from a previously created 2-port Touchstone file.
Manual control:	See "Test Setup" on page 352

#### SOURce<Ch>:POWer<PhyPt>:CORRection:TCOefficient:COUNt?

Queries the number of frequency values and transmission coefficients in the power loss list.

Suffix: <ch></ch>	Calibrated channel number. This parameter is ignored; the trans- mission coefficient settings are valid for all channels.
<phypt></phypt>	Calibrated port number. This parameter is ignored; the transmis- sion coefficient settings are valid for all sources.
Example:	<b>See</b> SOURce <ch>:POWer<phypt>:CORRection: TCOefficient:CALibration</phypt></ch>
Usage:	Query only
Manual control:	See "Transmission Coefficients; Insert / Delete / Delete All" on page 353

SOURce<Ch>:POWer<PhyPt>:CORRection:TCOefficient:DEFine<ListNo> <Frequency>, <TransCoeff>

Adds a new frequency and transmission coefficient to the end of the power loss list. The query returns the frequency and transmission coefficient no. <ListNo>.

# Suffix:

<Ch>Calibrated channel number. This parameter is ignored; the transmission coefficient settings are valid for all channels.

<phypt></phypt>		port number. This parameter is ignored; the transmis- ient settings are valid for all sources.
<listno></listno>	Number of	point in the list. This suffix is only used for queries.
Parameters:		
<frequency></frequency>		equency value. If several points with identical frequen- ded, the analyzer automatically ensures a frequency 1 Hz.
	Range:	Stimulus values outside the frequency range of the analyzer are allowed.
	*RST:	n/a
	Default unit	: Hz
<transcoeff></transcoeff>	Transmissio	on coefficient
	•	-300 dB to +200 dB
	*RST: Default unit	n/a · dP
		. uB
Example:		e <ch>:POWer<phypt>:CORRection:</phypt></ch>
	TCOeffici	ient:CALibration
Manual control:	See "Trans on page 35	mission Coefficients; Insert / Delete / Delete All" 3

# SOURce<Ch>:POWer<PhyPt>:CORRection:TCOefficient:DELete<ListNo>:ALL

Clears the power loss list.

Suffix: <ch></ch>	Calibrated channel number. This parameter is ignored; the trans- mission coefficient settings are valid for all channels.
<phypt></phypt>	Calibrated port number. This parameter is ignored; the transmis- sion coefficient settings are valid for all sources.
<listno></listno>	Number of point in the list. This suffix is ignored; the command deletes all points.
Example:	See SOURce <ch>: POWer<phypt>:CORRection: TCOefficient:CALibration</phypt></ch>
Usage:	Event
Manual control:	See "Transmission Coefficients; Insert / Delete / Delete All" on page 353

# SOURce<Ch>:POWer<PhyPt>:CORRection:TCOefficient:DELete<ListNo>[: DUMMy]

Deletes a single point no. <ListNo> in the power loss list.

Suffix: <ch></ch>	Calibrated channel number. This parameter is ignored; the trans- mission coefficient settings are valid for all channels.
<phypt></phypt>	Calibrated port number. This parameter is ignored; the transmission coefficient settings are valid for all sources.
<listno></listno>	Number of point in the list.
Example:	<b>See</b> SOURce <ch>: POWer<phypt>:CORRection: TCOefficient:CALibration</phypt></ch>
Manual control:	See "Transmission Coefficients; Insert / Delete / Delete All" on page 353

#### SOURce<Ch>:POWer<PhyPt>:CORRection:TCOefficient:FEED <Trace>

Selects a trace which provides the points for the power loss list.

Suffix: <ch></ch>	Calibrated channel number. This parameter is ignored; the trans- mission coefficient settings are valid for all channels.
<phypt></phypt>	Calibrated port number. This parameter is ignored; the transmission coefficient settings are valid for all sources.
Setting parameters: <trace></trace>	String parameter for the trace name, e.g. 'Trc1'. The trace must exist in the active recall set. *RST: n/a
Example:	<b>See</b> SOURce <ch>: POWer<phypt>:CORRection: TCOefficient:CALibration</phypt></ch>
Usage:	Setting only
Manual control:	See "Get Trace" on page 353

# SOURce<Ch>:POWer<PhyPt>:CORRection:TCOefficient:INSert<ListNo> <Frequency>, <TransCoeff>

Inserts a new frequency and transmission coefficient at position no. <ListNo> in the power loss list. The following points are shifted down in the list.

# Suffix:

<ch></ch>	Calibrated channel number. This parameter is ignored; the trans-
	mission coefficient settings are valid for all channels.

<PhyPt> Calibrated port number. This parameter is ignored; the transmission coefficient settings are valid for all sources.

<ListNo> Number of point to insert in the list.

Parameters: <frequency></frequency>	Stimulus frequency value. If several points with identical frequen- cies are added, the analyzer automatically ensures a frequency spacing of 1 Hz.
	Range:Stimulus values outside the frequency range of the analyzer are allowed.*RST:n/aDefault unit:Hz
<transcoeff></transcoeff>	Transmission coefficient Range: -300 dB to +200 dB *RST: n/a Default unit: dB
Example:	See SOURce <ch>:POWer<phypt>:CORRection: TCOefficient:CALibration</phypt></ch>
Manual control:	See "Transmission Coefficients; Insert / Delete / Delete All" on page 353

# SOURce<Ch>:POWer<PhyPt>:CORRection:TCOefficient[:STATe] <Boolean>

Enables or disables the use of two-port transmission coefficients.

Suffix: <ch></ch>	Calibrated channel number. This parameter is ignored; the trans- mission coefficient settings are valid for all channels.	
<phypt></phypt>	Calibrated port number. This parameter is ignored; the transmis- sion coefficient settings are valid for all sources.	
Parameters: <boolean></boolean>	Enables (ON) or disables (OFF) the two-port transmission coefficients. *RST: n/a	
Example:	See SOURce <ch>: POWer<phypt>:CORRection: TCOefficient:CALibration</phypt></ch>	
Manual control:	See "Test Setup" on page 352	

# SOURce<Ch>:POWer<PhyPt>:CORRection:DATA:PARameter<Wv>:COUNt?

Gets the number of available power calibrations (both source power and measurement receiver).

Use SOURce<Ch>: POWer: CORRection: DATA: PARameter<Wv>? to retrieve the related settings.

Suffix:	
<ch></ch>	Number of the calibrated channel.
<phypt></phypt>	This suffix is ignored.

User Manual 1173.9163.02 - 13

<wv></wv>	This suffix is ignored.

Usage: Query only

Manual control: See "Port Overview" on page 305

# SOURce<Ch>:POWer:CORRection:DATA:PARameter<Wv>?

<PowerCalSettingType>

Gets settings of the available power calibrations.

<ch></ch>	Number of the ca	alibrated channel.

<wv></wv>	Number of the power calibration.
	<b>Use</b> SOURce <ch>: POWer<phypt>:CORRection:DATA:</phypt></ch>
	PARameter <wv>:COUNt? on page 811 to query the number of</wv>
	available power calibrations.

#### Parameters:

<PowerCalSettingType#AVE | STARt | STOP | POINts | STYPe | ATTenuation |

CPOWer | CFRequency

### WAVE

Calibrated port and calibration type (Gen=Source Power, Rec=Measurement Receiver)

STARt

Start Frequency or Power

Stop Frequency or Power

# **POINts**

Nr. of sweep points

# **STYPe**

Sweep type or grid (LIN, LOG, SEGM)

# **ATTenuation**

Source or receiver attenuation

#### **CPOWer**

Cal Power for frequency sweeps

#### CFRequency

Cal Frequency for power sweeps

#### Usage:

Query only Manual control: See "Port Overview" on page 305

# SOURce:POWer... (Contd.)

The SOURce: POWer... commands define the power of the internal signal source.

SOURce <ch>:POWer<phypt>:CORRection:GENerator<gen>:LEVel:OFFSet</gen></phypt></ch>	813
SOURce <ch>:POWer<phypt>:CORRection:LEVel:OFFSet</phypt></ch>	814
SOURce <ch>:POWer<phypt>:GENerator<gen>:OFFSet</gen></phypt></ch>	814
SOURce <ch>:POWer<phypt>:GENerator<gen>:PERManent[:STATe]</gen></phypt></ch>	815

User Manual 1173.9163.02 - 13

SCPI Command Reference

SOURce <ch>:POWer<phypt>:GENerator<gen>:STATe</gen></phypt></ch>	816
SOURce <ch>:POWer<phypt>[:LEVel][:IMMediate][:AMPLitude]</phypt></ch>	816
SOURce <ch>:POWer<phypt>[:LEVel][:IMMediate]:OFFSet</phypt></ch>	817
SOURce <ch>:POWer<phypt>[:LEVe]][:IMMediate]:SLOPe</phypt></ch>	818
SOURce <ch>:POWer<phypt>:PERManent[:STATe]</phypt></ch>	818
SOURce <ch>:POWer<phypt>:STATe</phypt></ch>	819
SOURce <ch>:POWer<phypt>:STARt</phypt></ch>	819
SOURce <ch>:POWer<phypt>:STOP</phypt></ch>	819

# SOURce<Ch>:POWer<PhyPt>:CORRection:GENerator<Gen>:LEVel:OFFSet <Offset>

Specifies a gain (positive values) or an attenuation (negative values) in the signal path between the external generator and the calibrated reference plane. The value has no impact on the generator power.

Suffix:	
<ch></ch>	Calibrated channel number
<phypt></phypt>	Calibrated port number. This suffix is ignored; the generator is selected via <gen>.</gen>
<gen></gen>	Generator number
Parameters:	
<offset></offset>	Gain or attenuation value
	Range:-300 dB to +300 dB (adjust to the test setup)Increment:0.01 dB (other values are rounded)*RST:0 dBDefault unit:dB
Example:	Assume that a DUT requires a constant input power of +35 dBm at its port 2, and that the measurement path contains an amplifier with a 30 dB gain. SYST:COMM:RDEV:GEN1:DEF 'Ext. Gen. 1', 'SME02', 'gpib0', '21' Configure an R&S SME02 generator as external generator no. 1, assigning the name Ext. Gen. 1 and a GPIB address 21. SOUR:POW:GEN1:OFFS 5, ONLY Set the source power of generator no. 1 to +5 dBm. SOUR:POW:CORR:GEN1:LEV:OFFS 30 Specify the gain of the amplifier in the signal path between the external generator and the input port of the DUT. SOUR:POW:CORR:ACQ GEN,1 Perform a source power calibration using the external generator no. 1 as a source port and the target power of +35 dBm.
Manual control:	See "Cal Power Offset" on page 351

Manual control: See "Cal Power Offset" on page 351

#### SOURce<Ch>:POWer<PhyPt>:CORRection:LEVel:OFFSet <Offset>

Specifies a gain (positive values) or an attenuation (negative values) in the signal path between the source port and the calibrated reference plane. The value has no impact on the source power.

<b>Suffix:</b> <ch> <phypt></phypt></ch>	Calibrated channel number Calibrated port number
Parameters: <offset></offset>	Gain or attenuation value Range: -300 dB to +300 dB (adjust to the test setup) Increment: 0.01 dB (other values are rounded) *RST: 0 dB Default unit: dB
Example:	Assume that a DUT requires a constant input power of +35 dBm at port 2, and that the measurement path contains an amplifier with a 30 dB gain. *RST; SOUR:POW 0 Reset the instrument and set the internal source power (base channel power) for the default channel 1 to 0 dBm. SOUR:POW2:OFFS 5, ONLY Replace the source power at port 2 by +5 dBm. The powers at the remaining ports are not affected. SOUR:POW2:CORR:LEV:OFFS 30 Specify the gain of the amplifier in the signal path between the analyzer port 2 and the input port of the DUT. SOUR:POW:CORR:ACQ_PORT,2 Perform a source power calibration using port 2 as a source port and the target power of +35 dBm.
Manual control:	See "Port Overview" on page 350

#### SOURce<Ch>:POWer<PhyPt>:GENerator<Gen>:OFFSet <Offset>, <Mode>

Defines the power of an external generator or its power offset relative to the channel power (SOURce<Ch>: POWer<PhyPt>[:LEVel][:IMMediate][:AMPLitude]).

Suffix: <ch></ch>	Channel number
<phypt></phypt>	Test port number of the analyzer. This suffix is ignored; the generator is selected via <gen>.</gen>
<gen></gen>	Generator number

User Manual 1173.9163.02 - 13

Parameters:		
<offset></offset>	Port-specific	c power offset
	Range:	-300 dB to +300 dB (adjust to the generator's actual source power range and the test setup)
	Increment:	
	*RST:	0 dB
	Default unit	: dB
<mode></mode>	ONLY   CPA	ADd
	ignored.	/ the port-specific power is used; the channel power is
	CPADd - the nel power.	e port-specific power is added as an offset to the chan-
	*RST:	CPADd
Example:	internal sou -6 dBm. SYST:COMM 'gpib0', SYST:COMM 'gpib0', Configure a assigning th figure a sec Gen. 2" and SOUR: POW: 6, CPAD Set the sour	Astrument, activating a frequency sweep and set the rce power (channel power) for the default channel 1 to A:RDEV:GEN1:DEF 'Ext. Gen. 1', 'SME02', '21'; A:RDEV:GEN2:DEF 'Ext. Gen. 2', 'SME02',
Manual control:	See "Port P	ower Offset" on page 350

# SOURce<Ch>:POWer<PhyPt>:GENerator<Gen>:PERManent[:STATe] <Boolean>

Defines whether the external generator is available as an external signal source in the test setup. External generators are always on for all partial measurements.

Suffix: <ch></ch>	Channel number
<phypt></phypt>	Test port number of the analyzer. This suffix is ignored; the generator is selected via <gen>.</gen>
<gen></gen>	Generator number
Parameters: <boolean></boolean>	ON - generator no. <phypt> is available. OFF - generator is available only if a measurement result with a generator drive port is selected *RST: OFF</phypt>

Example:	<pre>SYST:COMM:RDEV:GEN1:DEF 'Ext. Gen. 1', 'SME02', 'gpib0', '21' Configure an R&amp;S SME02 generator as external generator no. 1, assigning the name Ext. Gen. 1 and a GPIB address 21. SOUR:POW:GEN:PERM ON Activate the generator as an external signal source.</pre>
Manual control:	See "Gen" on page 364

# SOURce<Ch>:POWer<PhyPt>:GENerator<Gen>:STATe <Boolean>

Suffix: <ch> <phypt></phypt></ch>	Channel number Test port number of the analyzer. This suffix is ignored; the gen- erator is selected via <gen>.</gen>	
<gen></gen>	Generator number	
<b>Parameters:</b> <boolean></boolean>	ON   OFF - generator is on or off *RST: ON	
Example:	SYST:COMM:RDEV:GEN1:DEF 'Ext. Gen. 1', 'SME02', 'gpib0', '21' Configure an R&S SME02 generator as external generator no. 1, assigning the name "Ext. Gen. 1" and a GPIB address 21. SOUR:POW:GEN:STAT OFF Turn the external generator off. In the "Port Configuration" dialog, "RF Off" is checked for generator no. 1.	
Manual control:	See "RF Off" on page 364	

Turns an external generator numbered <Gen> on or off.

# SOURce<Ch>:POWer<PhyPt>[:LEVel][:IMMediate][:AMPLitude] <IntSourcePow>

Defines the power of the internal signal source (channel power). The setting is valid for all sweep types except power sweep.

**Tip:** Use SOURce<Ch>: POWer<PhyPt>: STARt and SOURce<Ch>: POWer<PhyPt>: STOP to define the sweep range for a power sweep.

Suffix: <ch></ch>	Channel number
<phypt></phypt>	Test port number of the analyzer. This suffix is ignored because the selected channel power applies to all source ports used in the active channel. It is possible though to define a port-specific slope factor for the source power (SOURce <ch>: POWer<phypt>[: LEVel][:IMMediate]:SLOPe) and a port-specific power offset (SOURce<ch>: POWer<phypt>[:LEVel][:IMMediate]: OFFSet).</phypt></ch></phypt></ch>

User Manual 1173.9163.02 - 13

Parameters: <intsourcepow></intsourcepow>	Internal source power	
	Range:       -300 dBm to +200 dBm. The usable power range is frequency-dependent; refer to the data sheet.         Increment:       0.1 dB         *RST:       -10 dBm         Default unit: dBm	
Example:	<ul> <li>FUNC "XFR: POW: RAT B1, A2"</li> <li>Activate a frequency sweep and select the ratio B1/A2 as measured parameter for channel and trace no. 1.</li> <li>SOUR: POW -6</li> <li>Set the internal source power for channel 1 to -6 dBm.</li> <li>SOUR: POW2: SLOP 10</li> <li>Set the power slope factor for the wave transmitted at port 2 to 10 dB/GHz. The internal source power and the waves at the other test ports are not affected.</li> </ul>	
Manual control:	See "Power" on page 256	

# SOURce<Ch>:POWer<PhyPt>[:LEVel][:IMMediate]:OFFSet <Offset>, <OffsetType>

Defines a port-specific source power or a power offset relative to the channel power ( SOURce<Ch>: POWer<PhyPt>[:LEVel][:IMMediate][:AMPLitude]). An additional "Cal Power Offset" can be defined via SOURce<Ch>: POWer<PhyPt>: CORRection:LEVel:OFFSet.

Suffix: <ch></ch>	Channel nur	nber
<phypt></phypt>	Test port nu	mber of the analyzer
Parameters: <offset></offset>	Port-specific	power offset
	Range: Increment: *RST: Default unit:	0 dB
<offsettype></offsettype>	ignored.	ADd the port-specific power is used; the channel power is port-specific power is added as an offset to the chan- CPADd

Example:	*RST; SOUR: POW -6 Reset the instrument, activating a frequency sweep and set the internal source power (channel power) for the default channel 1 to -6 dBm. SOUR: POW1: OFFS 6, ONLY; SOUR: POW2: OFFS 6, CPAD Replace the source power at port 1 by +6 dBm, the source power at port 2 by 0 dBm. The powers at the remaining ports (if available) are not affected.
Manual control:	See "Port Overview" on page 350

#### SOURce<Ch>:POWer<PhyPt>[:LEVel][:IMMediate]:SLOPe <Slope>

Defines a linear factor to modify the internal source power at port < PhyPt> as a function of the stimulus frequency.

<ch></ch>	Channel nu	mber
<phypt></phypt>	Test port nu	mber of the analyzer
Parameters: <slope></slope>	Port-specific Range:	c slope factor -40 dB/GHz to +40 dB/GHz. The resulting power
	Kange.	range over the entire frequency sweep must be within the power range of the analyzer; refer to the data sheet.
		0.1-dB/GHz
		0 dB/GHz
Example:	*RST: Default unit:	0 dB/GHz
Example:	*RST: Default unit: See SOURce	0 dB/GHz DB/GHZ

# SOURce<Ch>:POWer<PhyPt>:PERManent[:STATe] <Boolean>

Defines whether the source power is permanently on.

# Note:

If External Switch Matrices are part of the RF connection configuration, operation with Internal Second Source (R&S ZNB-B2) is *not* supported. In this case only external generators can be used as permanent signal sources.

# Suffix:

<Ch>Channel number
<PhyPt> Test port number of the analyzer

User Manual 1173.9163.02 - 13

Parameters: <boolean></boolean>	ON - power at port <phypt> is permanently on. OFF - power is only on for the partial measurements that require the port as a drive port. *RST: OFF</phypt>
Example:	SOUR: POW2: STAT ON Switch the RF power at port no. 2 on. SOUR: POW2: PERM ON Activate a permanent signal source.
Manual control:	See "Gen" on page 364

# SOURce<Ch>:POWer<PhyPt>:STATe <Boolean>

Turns the RF source power at a specified test port on or off.

Suffix: <ch></ch>	Channel number
<phypt></phypt>	Test port number of the analyzer
Parameters: <boolean></boolean>	ON   OFF - turns the internal source power at the specified test port no. <phypt> on or off. *RST: ON</phypt>
Example:	*RST; SOUR: POW -6 Set the internal source power for channel 1 and all test ports to -6 dBm. SOUR: POW2:STAT? Query whether the source power at test port 2 is on. The analyzer returns a 1.
Manual control:	See "RF Off" on page 364

# SOURce<Ch>:POWer<PhyPt>:STARt <StartPower> SOURce<Ch>:POWer<PhyPt>:STOP <StopPower>

These commands define the start and stop powers for a power sweep. The values also define the left and right edges of a Cartesian diagram. A power sweep must be active ( [SENSe<Ch>:]SWEep:TYPE POWer) to use these commands.

Suffix: <ch></ch>	Channel number
<phypt></phypt>	Test port number of the analyzer. This suffix is ignored because the selected power sweep range applies to all source ports used in the active channel.

User Manual 1173.9163.02 - 13

Parameters: <stoppower></stoppower>	Start or stop power of the sweep.
	Range: -150 dBm to +100 dBm. The usable power range is frequency-dependent; refer to the data sheet.
	Increment: 0.01 dB
	*RST: -25 dBm start power, 0 dBm stop power Default unit: dBm
Example:	SWE:TYPE POW
	Activate a power sweep.
	SOUR:POW:STAR -6; STOP 10
	Select a power sweep range between -6 dBm and +10 dBm.
Manual control:	See "Start / Stop / Center / Span Frequency (Power / Time)" on page 256

**Note:** If the start power entered is greater than the current stop power (SOURce<Ch>: POWer<PhyPt>: STOP), the stop power is set to the start power plus the minimum power span (increment) of 0.01 dB.

If the stop power entered is smaller than the current start power (SOURce<Ch>: POWer<PhyPt>: STARt), the start power is set to the stop power minus the minimum power span of 0.01 dB.

# 6.3.16 STATus Commands

The STATUS:... commands control the status reporting system. Status registers are not reset by \*RST; use \*CLS for this purpose.

STATus:PRESet	821
STATus:QUEStionable:CONDition?	821
STATus:QUEStionable:INTegrity:CONDition?	821
STATus:QUEStionable:INTegrity:HARDware:CONDition?	821
STATus:QUEStionable:LIMit <lev>:CONDition?</lev>	821
STATus:QUEStionable:ENABle	821
STATus:QUEStionable:INTegrity:ENABle	821
STATus:QUEStionable:INTegrity:HARDware:ENABle	821
STATus:QUEStionable:LIMit <lev>:ENABle</lev>	821
STATus:QUEStionable:NTRansition	822
STATus:QUEStionable:INTegrity:NTRansition	822
STATus:QUEStionable:INTegrity:HARDware:NTRansition	822
STATus:QUEStionable:LIMit <lev>:NTRansition</lev>	822
STATus:QUEStionable:PTRansition	822
STATus:QUEStionable:INTegrity:PTRansition	822
STATus:QUEStionable:INTegrity:HARDware:PTRansition	822
STATus:QUEStionable:LIMit <lev>:PTRansition</lev>	822
STATus:QUEStionable[:EVENt]?	823
STATus:QUEStionable:INTegrity[:EVENt]?	823
STATus:QUEStionable:INTegrity:HARDware[:EVENt]?	823
STATus:QUEStionable:LIMit <lev>[:EVENt]?</lev>	
STATus:QUEue[:NEXT]?	823

#### STATus:PRESet

Configures the status reporting system such that device-dependent events are reported at a higher level.

The command affects only the transition filter registers, the ENABle registers, and queue enabling:

- The ENABLE parts of the STATUS:OPERation and STATUS:QUEStionable... registers are set to all 1's.
- The PTRansition parts are set all 1's, the NTRansition parts are set to all 0's, so that only positive transitions in the CONDition part are recognized.

The status reporting system is also affected by other commands, see chapter 5.5.5, "Reset Values of the Status Reporting System", on page 485.

Example:	STAT: PRES
	Preset the status registers.

Usage: Event

# STATus:QUEStionable:CONDition? STATus:QUEStionable:INTegrity:CONDition? STATus:QUEStionable:INTegrity:HARDware:CONDition? STATus:QUEStionable:LIMit<Lev>:CONDition?

Returns the contents of the CONDition part of the QUEStionable... registers. Reading the CONDition registers is nondestructive.

#### Suffix:

<lev></lev>	Selects one of the two QUEStionable:LIMit registers; see "STATus:QUEStionable:LIMit<1 2>" on page 479.
Example:	<pre>STAT:QUES:LIMit:COND? Query the CONDition part of the QUEStionable:LIMit1 reg- ister to retrieve the current status of the limit check.</pre>
Usage:	Query only

# STATus:QUEStionable:ENABle <BitPattern> STATus:QUEStionable:INTegrity:ENABle <BitPattern> STATus:QUEStionable:INTegrity:HARDware:ENABle <BitPattern> STATus:QUEStionable:LIMit<Lev>:ENABle <BitPattern>

Sets the enable mask which allows true conditions in the EVENt part of the QUEStionable... registers to be reported in the summary bit. If a bit is 1 in the enable register and its associated event bit transitions to true, a positive transition will occur in the summary bit (e.g. bit 10 of the QUEStionable register for the LIMit1 register, bit 0 of the LIMit1 register for the LIMit2 register).

See also chapter 5.5.1, "Overview of Status Registers", on page 473 and chapter 5.5.5, "Reset Values of the Status Reporting System", on page 485.

Suffix: <lev></lev>		of the two QUEStionable:LIMit registers; see UEStionable:LIMit<1 2>" on page 479.
Parameters: <bitpattern></bitpattern>	Range: *RST:	0 to 65535 (decimal representation) n/a
Example:	~	S:LIM2:ENAB 6 1 and 2 of the QUEStionable:LIMit2:ENABle

# STATus:QUEStionable:NTRansition <BitPattern> STATus:QUEStionable:INTegrity:NTRansition <BitPattern> STATus:QUEStionable:INTegrity:HARDware:NTRansition <BitPattern> STATus:QUEStionable:LIMit<Lev>:NTRansition <BitPattern>

Sets the negative transition filters of the QUEStionable... status registers. If a bit is set, a 1 to 0 transition in the corresponding bit of the associated condition register causes a 1 to be written in the associated bit of the corresponding event register.

<lev></lev>		of the two QUEStionable:LIMit registers; see UEStionable:LIMit<1 2>" on page 479.
Parameters: <bitpattern></bitpattern>		
	Range: *RST:	0 to 65535 (decimal representation) n/a
Example:	Set bits no.	S:LIM2:NTR 6 1 and 2 of the able:LIMit2:NTRansition register

# STATus:QUEStionable:PTRansition <BitPattern> STATus:QUEStionable:INTegrity:PTRansition <BitPattern> STATus:QUEStionable:INTegrity:HARDware:PTRansition <BitPattern> STATus:QUEStionable:LIMit<Lev>:PTRansition <BitPattern>

Configures the positive transition filters of the QUEStionable... status registers. If a bit is set, a 0 to 1 transition in the corresponding bit of the associated condition register causes a 1 to be written in the associated bit of the corresponding event register.

See also chapter 5.5.5, "Reset Values of the Status Reporting System", on page 485.

#### Suffix:

<Lev>

1 | 2 Selects one of the two QUEStionable:LIMit registers; see "STATus:QUEStionable:LIMit<1|2>" on page 479.

Parameters: <bitpattern></bitpattern>	Range: *RST:	0 to 65535 (decimal representation) n/a
Example:	STAT:QUES:LIM2:PTR 6 Set bits no. 1 and 2 of the	
	QUEStiona	able:LIMit2:PTRansition register

# STATus:QUEStionable[:EVENt]? STATus:QUEStionable:INTegrity[:EVENt]? STATus:QUEStionable:INTegrity:HARDware[:EVENt]? STATus:QUEStionable:LIMit<Lev>[:EVENt]?

These commands return the contents of the EVENt parts of the QUEStionable, QUEStionable:INTegrity,QUEStionable:INTegrity:HARDware, and QUEStionable:LIMit<Lev> status registers. Reading an EVENt register clears it.

#### Suffix:

<lev></lev>	1   2 Selects one of the two QUEStionable:LIMit registers; see "STATus:QUEStionable:LIMit<1 2>" on page 479.
Example:	STAT:QUES:LIM1? Query the EVENt part of the QUEStionable:LIMit1 register to check whether an event has occurred since the last reading.
Usage:	Query only

# STATus:QUEue[:NEXT]?

Queries and at the same time deletes the oldest entry in the error queue. Operation is identical to that of SYSTem: ERROr [:NEXT]?.

The entry consists of an error number and a short description of the error. Positive error numbers are instrument-dependent. Negative error numbers are reserved by the SCPI standard; see section chapter 8, "Error Messages and Troubleshooting", on page 917.

Example:	STAT:QUE?
	Query the oldest entry in the error queue. 0, "No error" is returned if the error queue is empty.
Usage:	Query only

# 6.3.17 SYSTem Commands

The SYSTem... commands provide functions that are not related to instrument performance, such as functions for general housekeeping and functions related to global configurations.

# 6.3.17.1 SYSTem:COMMunicate...

The SYSTem:COMMunicate... commands provide remote control settings and configure remote (external) devices controlled by the R&S ZNB.

SYSTem:COMMunicate:AKAL:CONNection	004
SYSTem:COMMunicate:AKAL:MMEMory[:STATe]	
SYSTem:COMMunicate:GPIB[:SELF]:ADDRess	
SYSTem:COMMunicate:GPIB[:SELF]:RTERminator	
SYSTem:COMMunicate:RDEVice:AKAL:ADDRess	
SYSTem:COMMunicate:RDEVice:AKAL:ADDRess:ALL?	
SYSTem:COMMunicate:RDEVice:AKAL:CKIT:CATalog?	
SYSTem:COMMunicate:RDEVice:AKAL:CKIT:STANdard:CATalog?	
SYSTem:COMMunicate:RDEVice:AKAL:DATE?	
SYSTem:COMMunicate:RDEVice:AKAL:FRANge?	
SYSTem:COMMunicate:RDEVice:AKAL:PORTs?	
SYSTem:COMMunicate:RDEVice:AKAL:PREDuction[:STATe]	
SYSTem:COMMunicate:RDEVice:AKAL:SDATa?	
SYSTem:COMMunicate:RDEVice:AKAL:WARMup[:STATe]?	
SYSTem:COMMunicate:RDEVice:GENerator:DELete	
SYSTem:COMMunicate:RDEVice:GENerator <gen>:CATalog?</gen>	
SYSTem:COMMunicate:RDEVice:GENerator:COUNt?	
SYSTem:COMMunicate:RDEVice:GENerator <gen>:DEFine</gen>	
SYSTem:COMMunicate:RDEVice:GENerator <gen>:SEPMode</gen>	
SYSTem:COMMunicate:RDEVice:GENerator <gen>:SEPower</gen>	
SYSTem:COMMunicate:RDEVice:PMETer <pmtr>:AZERo</pmtr>	
SYSTem:COMMunicate:RDEVice:PMETer:DELete	
SYSTem:COMMunicate:RDEVice:PMETer <pmtr>:CATalog?</pmtr>	
SYSTem:COMMunicate:RDEVice:PMETer <pmtr>:CONFigure:AUTO[:STATe]</pmtr>	
SYSTem:COMMunicate:RDEVice:PMETer:COUNt?	
SYSTem:COMMunicate:RDEVice:PMETer <pmtr>:DEFine</pmtr>	
SYSTem:COMMunicate:RDEVice:PMETer <pmtr>:SPCorrection[:STATe]</pmtr>	836
SYSTem:COMMunicate:RDEVice:SMATrix <matr>:DEFine</matr>	
SYSTem:COMMunicate:RDEVice:SMATrix:COUNt?	837
SYSTem:COMMunicate:RDEVice:SMATrix:DELete	
SYSTem:COMMunicate:RDEVice:SMATrix <matr>:CATalog?</matr>	838
SYSTem:COMMunicate:RDEVice:SMATrix:CONFigure:STARt	838
SYSTem:COMMunicate:RDEVice:SMATrix:CONFigure:ABORt	838
SYSTem:COMMunicate:RDEVice:SMATrix:CONFigure:END	839
SYSTem:COMMunicate:RDEVice:SMATrix <matr>:CONFigure:MVNA</matr>	
SYSTem:COMMunicate:RDEVice:SMATrix <matr>:CONFigure:MLVNa</matr>	840
SYSTem:COMMunicate:RDEVice:SMATrix <matr>:CONFigure:MTESt</matr>	
SYSTem:COMMunicate:RDEVice:SMATrix <matr>:CONFigure:MLTest</matr>	
SYSTem:COMMunicate:RDEVice:SMATrix:CONFigure:TVNA	842

SYSTem:COMMunicate:AKAL:CONNection <CalStandard>, <Port>[, <SecondPort>]

Connects the selected calibration standard to one or two ports of the active calibration unit (see SYSTem:COMMunicate:RDEVice:AKAL:ADDRess)

Setting parameters:	
<calstandard></calstandard>	THRough   OPEN   SHORt   MATCh
	Connected one or two-port standard
<port></port>	Port number of the calibration unit, for one and two-port standards.
<secondport></secondport>	Second port number of the calibration unit, for two-port standards (THRough) only, omitted for the one-port standards.
Example:	SYST:COMM:AKAL:CONN THR, 1, 2 Connect a trough standard between ports 1 and 2 of the cal unit.
Usage:	Setting only
Manual control:	See "Apply/Cancel" on page 287

# SYSTem:COMMunicate:AKAL:MMEMory[:STATe] <Boolean>

Shows or hides the memory of the active calibration unit (see SYSTem:
COMMunicate:RDEVice:AKAL:ADDRess).

Setting parameters: <boolean></boolean>	ON - memory is shown in a separate drive. OFF - memory is not shown. *RST: OFF
Example:	SYST:COMM:AKAL:MMEM ON Show the memory of the active calibration unit.
Usage:	Setting only
Manual control:	See "Apply/Cancel" on page 287

### SYSTem:COMMunicate:GPIB[:SELF]:ADDRess <GBIBAddress>

Sets the GPIB address of the analyzer.

Parameters:			
<gbibaddress></gbibaddress>	GPIB address (integer number)		
	Range: 0 to 30		
Example:	SYST:COMM:GPIB:ADDR 10		
	Set the GPIB address to 10.		
	*RST; :SYST:COMM:GPIB:ADDR?		
	After a reset, the address is maintained (the response is 10)	).	
Manual control:	See "GPIB Address" on page 431		

#### SYSTem:COMMunicate:GPIB[:SELF]:RTERminator < Terminator>

Sets the receive terminator of the analyzer. The receive terminator indicates the end of a command or a data block.

The receive terminator setting is relevant if block data is transferred to the analyzer ( FORMat[:DATA]REAL). In the default setting LFEoi, the analyzer recognizes an LF character sequence with or without the EOI control bus message as a receive terminator. An accidental LF in a data block can be recognized as a terminator and cause an interruption of the data transfer.

The EOI setting is especially important if commands are transferred in block data format, because it ensures that the parser for command decoding is activated by the terminator only after the command has been completely transferred. Readout of binary data does not require a change of the receive terminator.

#### Parameters:

<terminator></terminator>	LFEoi   EOI
	LF character sequence with or without EOI recognized.
Example:	SYST:COMM:GPIB:RTER EOI Set the terminator to EOI.

#### SYSTem:COMMunicate:RDEVice:AKAL:ADDRess < USBAddress>

Selects one of the USB-connected calibration units for calibration (see commands SENSe<Ch>: CORRection:COLLect:AUTO...). This command is not necessary if only one cal unit is connected.

#### **Parameters:**

<usbaddress></usbaddress>	Name (USB address) of a connected calibration unit (string vari- able). The names of all connected cal units can be queried using SYSTem:COMMunicate:RDEVice:AKAL:ADDRess:ALL?.
Example:	SYST:COMM:RDEV:AKAL:ADDR:ALL? Query the names of all connected calibration units. SYST:COMM:RDEV:AKAL:ADDR 'ZV-Z52::1234' Select the cal unit named 'ZV-Z52::1234' for calibration. CORR:COLL:AUTO '', 1, 2, 4 Perform an automatic 3-port TOSM calibration at test ports 1, 2, and 4 using the calibration unit's default calibration kit file and arbitrary test ports of the cal unit.

Manual control: See "Cal Unit" on page 281

#### SYSTem:COMMunicate:RDEVice:AKAL:ADDRess:ALL?

Queries the names (USB addresses) of all connected calibration units.

Example:	See SYSTem:COMMunicate:RDEVice:AKAL:ADDRess
Usage:	Query only
Manual control:	See "Cal Unit" on page 281

#### SYSTem:COMMunicate:RDEVice:AKAL:CKIT:CATalog?

Queries all characterizations (cal kit files) which are stored on the connected calibration unit R&S ZV-Z5x. A possible response is 'Factory, ZV-Z53\_custom, Throughs'. The factory characterization is always available; an empty string denotes that no calibration unit is connected.

If several cal units are USB-connected to the analyzer, the command queries the cal unit selected via SYSTem:COMMunicate:RDEVice:AKAL:ADDRess.

Example:	<pre>SYST:COMM:RDEV:AKAL:ADDR:ALL? Query the names of all connected calibration units. SYST:COMM:RDEV:AKAL:ADDR 'ZV-Z52::1234' Select the cal unit named 'ZV-Z52::1234'. SYSTem:COMMunicate:RDEVice:AKAL:CKIT:CATalog? Query all characterizations stored on the connected calibration unit. SYSTem:COMMunicate:RDEVice:AKAL:SDATa? 'My_calkit', OPEN, S11, 1 Query the characterization data for the characterization named 'My_calkit' and an open standard (one-port, port restriction). A characterization with the queried properties must be available on the cal unit. SYSTem:COMMunicate:RDEVice:AKAL:WARMup? Query the warmup status of the calibration unit. SYSTem:COMMunicate:RDEVice:AKAL:DATE? 'Factory' Query the creation date of the factory calibration. SYSTem:COMMunicate:RDEVice:AKAL:FRANge? 'Factory' Query the frequency range of the factory calibration. SYSTem:COMMunicate:RDEVice:AKAL:PORTs? 'Factory' Query the port assignment of the factory calibration. SYSTem:COMMunicate:RDEVice:AKAL:CKIT:STANdard: CATalog? 'Factory' Query the standards of the factory calibration. Possible response: 'MOP(P1),MSH(P1),MMMT(P1),MOP(P2),MSH(P2), MMMT(P2)' - denotes an Open(m), Short (m) and Match (m) standard at each of the ports 1 and 2.</pre>
Usage:	Query only
Manual control:	See "Characterization" on page 282

#### SYSTem:COMMunicate:RDEVice:AKAL:CKIT:STANdard:CATalog? <CalKitName>

Queries all calibration standards of a characterization (cal kit file) that is stored in a connected calibration unit R&S ZV-Z5x. The query SYSTem: COMMunicate:RDEVice: AKAL:CKIT:CATalog? returns the names of the cal kit files. The factory characterization is always available.

User Manual 1173.9163.02 - 13

Parameters: <calkitname></calkitname>	Name of the cal kit file, string parameter. 'Factory' denotes the factory calibration.
Example:	<b>See</b> SYSTem:COMMunicate:RDEVice:AKAL:CKIT: CATalog?
Usage:	Query only
Manual control:	See "Characterization" on page 282

#### SYSTem:COMMunicate:RDEVice:AKAL:DATE? <CalUnitName>

Queries the creation date and time of a cal unit characterization (cal kit file) <CalUnitName>. A possible response is 'Friday, May 26, 2011, 10:13:40'. An empty string is returned if no calibration unit is connected.

If several cal units are USB-connected to the analyzer, the command queries the cal unit selected via SYSTem:COMMunicate:RDEVice:AKAL:ADDRess.

#### Parameters:

<calunitname></calunitname>	String parameter containing the name of a cal unit characteriza- tion. 'Factory' denotes the factory characterization; an empty string ' ' denotes the last referenced characterization.
Example:	<b>See</b> SYSTem:COMMunicate:RDEVice:AKAL:CKIT: CATalog?
Usage:	Query only
Manual control:	See "Characterization" on page 282

#### SYSTem:COMMunicate:RDEVice:AKAL:FRANge? <CalUnitName>

Queries the frequency range of a cal unit characterization (cal kit file) <CalUnitName>. The response consists of the start and stop frequencies in Hz, separated by a comma. 0, 0 is returned if no calibration unit is connected.

If several cal units are USB-connected to the analyzer, the command queries the cal unit selected via SYSTem:COMMunicate:RDEVice:AKAL:ADDRess.

### Parameters:

<calunitname></calunitname>	String parameter containing the name of a cal unit characterization. 'Factory' denotes the factory characterization; an empty string ' ' denotes the last referenced characterization.
Example:	<b>See</b> SYSTem:COMMunicate:RDEVice:AKAL:CKIT: CATalog?
Usage:	Query only
Manual control:	See "Characterization" on page 282

#### SYSTem:COMMunicate:RDEVice:AKAL:PORTs? <CalUnitName>

Queries the number of ports of a cal unit characterization (cal kit file) <CalUnitName>, the assigned connector types, and their gender. A possible response for a two-port calibration is '1, N 50 Ohm, MALE, 2, N 50 Ohm, MALE'. An empty string is returned if no calibration unit is connected.

If several cal units are USB-connected to the analyzer, the command queries the cal unit selected via SYSTem:COMMunicate:RDEVice:AKAL:ADDRess.

#### Parameters:

<calunitname></calunitname>	String parameter containing the name of a cal unit characteriza- tion. 'Factory' denotes the factory characterization; an empty string ' ' denotes the last referenced characterization.
Example:	<b>See</b> SYSTem:COMMunicate:RDEVice:AKAL:CKIT: CATalog?
Usage:	Query only
Manual control:	See "Characterization" on page 282

#### SYSTem:COMMunicate:RDEVice:AKAL:PREDuction[:STATe] <Boolean>

Enables or disables automatic power reduction at all test ports while an automatic calibration using the calibration unit R&S ZV-Zxx is active.

#### Parameters:

<boolean></boolean>	Power reduct *RST:	tion enabled or disabled. ON
Example:		MMunicate:RDEVice:AKAL:PREDuction OFF matic power reduction.
Manual control:	See "Auto P	ower Reduction for Cal Unit" on page 423

# SYSTem:COMMunicate:RDEVice:AKAL:SDATa? <CalUnitName>, <Type>, <SParameter>[, <FirstPort>, <SecondPort>]

Reads the calibration data for a particular standard from a cal unit characterization.

#### Parameters:

<CalUnitName> String parameter containing the name of a cal unit characterization. 'Factory' denotes the factory characterization; an empty string ' ' denotes the last referenced characterization.

<type></type>	THRough   OPEN   SHORt   MATCh   MMTHrough   MFTHrough   FFTHrough   MOPen   FOPen   MSHort   FSHort   MMTCh   FMTCh
	Standard types; for a description refer to table Standard types and their parameters . The standard types of a particular characterization can be queried via <pre>SYSTem:COMMunicate:RDEVice:</pre>
	AKAL:CKIT:STANdard:CATalog?. The factory characterization usually does not contain data for a through standard; therefore a query of the type SYSTem:COMMunicate:RDEVice:AKAL:SDATa? 'Factory', THR, S11, 1, 2 results in an error message.
<sparameter></sparameter>	S11   S12   S21   S22 S-parameter of the standard, use S11 for one-port standards, one of the four for 2-port standards.
<firstport></firstport>	Fist port number (sufficient for one-port standards). Port numbers can be omitted if the cal kit data is valid for all ports; see MMEMory:LOAD:CKIT:SDATa.
<secondport></secondport>	Second port number, for two-port standards. Port numbers can be omitted if the cal kit data is valid for all ports.
Example:	<b>See</b> SYSTem:COMMunicate:RDEVice:AKAL:CKIT: CATalog?
Usage:	Query only
Manual control:	See "Characterization" on page 282

#### SYSTem:COMMunicate:RDEVice:AKAL:WARMup[:STATe]?

Queries the warmup state of the connected calibration unit R&S ZV\_Z5x. If several cal units are USB-connected to the analyzer, the command queries the cal unit selected via SYSTem:COMMunicate:RDEVice:AKAL:ADDRess.

Possible responses are 1 (true, if the calibration unit has been connected for a sufficient time to rach its operating temperature) or 0 (false). 0 is also returned if no calibration unit is connected.

Example:	See SYSTem:COMMunicate:RDEVice:AKAL:CKIT	
	CATalog?	
Usage:	Query only	

#### SYSTem:COMMunicate:RDEVice:GENerator:DELete

Clears the configuration table for external generators.

Example: See SYSTem:COMMunicate:RDEVice:GENerator<Gen>: DEFine

Usage: Event

Manual control: See "Configured Devices" on page 439

#### SYSTem:COMMunicate:RDEVice:GENerator<Gen>:CATalog?

Queries the numbers of all configured external generators. The response is a string containing a comma-separated list of generator numbers.

Suffix: <gen></gen>	Number of the configured generator. This suffix is ignored; the command affects all generators.
Example:	<pre>SYST:COMM:RDEV:GEN1:DEF 'Ext. Gen. 1', 'SME02', 'gpib0', '21' SYST:COMM:RDEV:GEN2:DEF 'Ext. Gen. 2', 'SME02', 'gpib0', '22' Configure two R&amp;S SME02 generators as external generators no. 1 and 2, assigning different names and GPIB addresses. SYST:COMM:RDEV:GEN1:CAT? Query the generator numbers. The response is '1, 2'. SYST:COMM:RDEV:GEN1:COUN? Query the number of configured generators. The response is 2.</pre>
Usage:	Query only
Manual control:	See "Configured Devices" on page 439

### SYSTem:COMMunicate:RDEVice:GENerator:COUNt?

Queries the number of configured external generators. The response is an integer number of generators.

 Example:
 See SYSTem:COMMunicate:RDEVice:GENerator<Gen>:

 CATalog?

 Usage:
 Query only

SYSTem:COMMunicate:RDEVice:GENerator<Gen>:DEFine <GenName>, <Driver>, <Interface>, <Address>[, <FastSweep>, <ExtReference>]

Configures an external generator and adds it to the list of available generators.

Suffix:

<gen></gen>	Number of the configured generator. Generators must be num- bered in ascending order, starting with 1. If a number is re-used, the previous generator configuration is overwritten. Generators can be assigned several times so that the number of configured generators is practically unlimited.
	generators is practically uninflitted.

#### **Parameters:**

<genname></genname>	Name of the external generator (string parameter). An empty
	string means that no particular name is assigned to the generator.

<driver></driver>	Generator type (string parameter). The generator type is identical with the name of the generator driver file (*.gen) stored in the resources\extdev subdirectory of the analyzer's program direc- tory. Type the driver file name as shown in the "Add External Gen- erator" dialog, i.e. without the file extension ".gen" (example: use 'sme02', if the corresponding driver file name is sme02.gen). Alternative: The ' <driver>' string may also contain the gener- ator driver file name with its complete path, e.g. 'C:\Program Files\Rohde&amp;Schwarz\Network Analyzer\resources\extdev\sme02.gen'.</driver>
<interface></interface>	<pre>Interface type (string parameter): 'GPIB0', 'VXI-11', 'socket','usb-visa', 'other'</pre>
<address></address>	Interface address (string parameter), depending on the interface type. See table 4-4.
<fastsweep></fastsweep>	ON   OFF Optional Boolean parameter, enables or disables the fast sweep mode.
<extreference></extreference>	ON   OFF Optional Boolean parameter, sets the analyzer to internal (OFF) or external (ON) reference frequency.
Example:	<pre>SYST:COMM:RDEV:GEN1:DEF 'Ext. Gen. 1', 'SME02', 'gpib0', '21' Configure an R&amp;S SME02 generator as external generator no. 1, assigning the name "Ext. Gen. 1" and a GPIB address 21. SYST:COMM:RDEV:GEN1:DEF? Query the generator configuration. The response 'Ext. Gen. 1', 'SME02', 'GPIB0', '21',OFF, OFF indicates that the fast sweep mode is disabled and that the analyzer is set to internal reference frequency. SYST:COMM:RDEV:GEN1:DEL Clear the generator configuration table. SYST:COMM:RDEV:GEN1:DEF? Query the generator configuration. The analyzer returns an error message because the generator no. 1 is no longer configured.</pre>
Manual control:	See "Configured Devices" on page 439

# SYSTem:COMMunicate:RDEVice:GENerator<Gen>:SEPMode <Type>

Defines the external generator power control after the sweep end.

Suffix: <Gen>

Generator number

<b>Parameters:</b> <type></type>	OFF   LOW   KEEP   USER
	OFF – power is switched off LOW – switch to min. power
	KEEP – keep power at the value selected via SOURce <ch>:</ch>
	POWer <phypt>:GENerator<gen>:OFFSet</gen></phypt>
	USER - set to end power selected via <pre>SYSTem:COMMunicate:</pre>
	RDEVice:GENerator <gen>:SEPower</gen>
Example:	See SYSTem:COMMunicate:RDEVice:GENerator <gen>:</gen>
	SEPower
Manual control:	See "Configured Devices" on page 439

#### SYSTem:COMMunicate:RDEVice:GENerator<Gen>:SEPower < Power>

Defines the external generator power value after the end of a sweep. The setting is relevant if the generator is switched to a user-selected power; see example.

<b>Suffix:</b> <gen></gen>	Generator number
Parameters: <power></power>	End power
	Range: -145 dBm to +30 dBm *RST: 0 dBm Default unit: dBm
Example:	<pre>SYSTem:COMMunicate:RDEVice:GENerator:SEPMode USER Switch the generator to a user-selected power value after the sweep is terminated. SYSTem:COMMunicate:RDEVice:GENerator:SEPower -10 Define a end power of -10 dBm.</pre>
Manual control:	See "Configured Devices" on page 439
	icate:RDEVice:PMETer <pmtr>:AZERo</pmtr>

Starts auto zeroing of the external power meter.

Suffix: <pmtr></pmtr>	Number of the configured power meter. Power meters must be numbered in ascending order, starting with 1. If a number is re- used, the previous power meter configuration is overwritten. Power meters can be assigned several times so that the number of configured power meters is practically unlimited.
Example:	See SYSTem:COMMunicate:RDEVice:PMETer <pmtr>: DEFine</pmtr>

Usage: Event

Manual control: See "Auto Zero" on page 178

#### SYSTem:COMMunicate:RDEVice:PMETer:DELete

Clears the configuration table for external power meters.

Example:	See SYSTem:COMMunicate:RDEVice:PMETer <pmtr>: DEFine</pmtr>
Usage:	Event
Manual control:	See "Configured Devices" on page 437

#### SYSTem:COMMunicate:RDEVice:PMETer<Pmtr>:CATalog?

Queries the numbers of all configured external power meters. The response is a string containing a comma-separated list of power meter numbers.

Suffix:	
<pmtr></pmtr>	Number of the configured power meter. This suffix is ignored; the command affects all power meters.
Example:	<pre>SYST:COMM:RDEV:PMET1:DEF 'USB Power Meter 1', 'NRP-Z55', 'usb', '100045' SYST:COMM:RDEV:PMET2:DEF 'USB Power Meter 2', 'NRP-Z55', 'usb', '100046' Configure two R&amp;S NRP power meters as external power meter no. 1 and 2, assigning names and serial numbers. SYST:COMM:RDEV:PMET1:CAT? Query the power meter numbers. The response is '1, 2'. SYST:COMM:RDEV:PMET1:COUN? Query the number of configured power meters. The response is 2.</pre>
Usage:	Query only
Manual control:	See "Configured Devices" on page 437

SYSTem:COMMunicate:RDEVice:PMETer<Pmtr>:CONFigure:AUTO[:STATe] <Boolean>

Enables or disables "Auto Config NRP-Zxx". If the function is enabled, the analyzer automatically configures all power meters detected at any of the USB ports as Pmtr 1, Pmtr2, ...

#### Suffix:

<Pmtr>

Number of the configured power meter. This suffix is ignored; the command affects all power meters. Power meters can be assigned several times so that the number of configured power meters is practically unlimited.

Parameters: <boolean></boolean>	ON   OFF - enable or disable "Auto Config NRP-Zxx".
Example:	<pre>See SYSTem:COMMunicate:RDEVice:PMETer<pmtr>: DEFine</pmtr></pre>
Manual control:	See "Auto Config NRP-Zxx" on page 438

### SYSTem:COMMunicate:RDEVice:PMETer:COUNt?

Queries the number of configured external power meters. The result is an integer number of power meters.

Example:	<pre>See SYSTem:COMMunicate:RDEVice:PMETer<pmtr>: CATalog?</pmtr></pre>
Usage:	Query only
Manual control:	See "Configured Devices" on page 437

SYSTem:COMMunicate:RDEVice:PMETer<Pmtr>:DEFine <PmtrName>, <Driver>, <Interface>, <Address>

Configures an external power meter and adds it to the list of available power meters.

Suffix:	
<pmtr></pmtr>	Number of the configured power meter. Power meters must be numbered in ascending order, starting with 1. If a number is re- used, the previous power meter configuration is overwritten. Power meters can be assigned several times so that the number of configured power meters is practically unlimited.
Parameters:	
<pmtrname></pmtrname>	Name of the external power meter (string parameter). An empty string means that no particular name is assigned to the power meter.
<driver></driver>	Power meter type (string parameter). The power meter type is identical with the name of the power meter driver file (*.pwm) stored in the resources\extdev subdirectory of the analyzer's program directory. Type the driver file name as shown in the "Add External Generator" dialog, i.e. without the file extension ".pwm" (example: use 'NRVD', if the corresponding driver file name is NRVD.pwm).
	Alternative: The ' <driver>' string may also contain the power meter driver file name with its complete path, e.g. 'C:\Program Files\Rohde&amp;Schwarz\Network Analyzer\resources\extdev\nrvd.pwm'.</driver>
	-
<interface></interface>	Interface type (string parameter): 'GPIB0', 'VXI-11', 'socket', 'other', 'USB' (for the supported USB devices)

<address></address>	Interface address (string parameter), depending on the interface type. See table 4-3
Example:	<ul> <li>SYST: COMM: RDEV: PMET: CONF: AUTO OFF</li> <li>Disables "Auto Config NRP-Zxx" (if it was enabled previously).</li> <li>SYST: COMM: RDEV: PMET1: DEF 'USB Power Meter', 'NRP-Z55', 'usb', '100045'</li> <li>Configure an R&amp;S NRP power meter as external power meter no. 1, assigning the name "USB Power Meter" and a serial number 100045.</li> <li>SYST: COMM: RDEV: PMET: DEL</li> <li>Clear the power meter configuration table.</li> <li>SYST: COMM: RDEV: PMET: DEF?</li> <li>Query the power meter configuration. The analyzer returns an error message because the power meter no. 1 is no longer configured.</li> </ul>
Manual control:	See "Configured Devices" on page 437

# SYSTem:COMMunicate:RDEVice:PMETer<Pmtr>:SPCorrection[:STATe] <Boolean>

Gets/sets the state of the built-in S-parameter correction that is available on certain R&S®NRP-Z power sensors. See Application Note 1GP70: Using S-Parameters with R&S®NRP-Z Power Sensors for background information.

Note that this state is persistently stored on the power sensor (and NOT on the R&S ZNB).

Suffix:	
<pmtr></pmtr>	Number of the configured power meter.

Parameter	s:		
<boolean></boolean>		ON   OFF	

Manual control: See "Add Device" on page 437

SYSTem:COMMunicate:RDEVice:SMATrix<Matr>:DEFine <Unused>, <Driver>, <Interface>, <Address>

This command allows

- to configure (i.e. register) a new switching matrix
- to modify the (management) connection settings of an already configured switching matrix
- to get the (management) connection settings of a configured switching matrix

#### Suffix:

<Matr>

Index of the switch matrix. Switch matrices are numbered in ascending order, starting with 1. If a number is re-used, the current configuration is overwritten.

Parameters: <unused></unused>	Currently this parameter is ignored and always returns an empty string ' '.
<driver></driver>	Matrix driver name indicating the matrix type (string parameter). <b>Standard drivers</b> : The supported drivers are displayed in the "Driver" dropdown-list of the "Add External Switchmatrix" dialog. Each list entry corresponds to a matrix driver file (*.matrix) located in the Resources\ExtDev subdirectory of the analyzer's program directory. Specify the <driver> as the driver's file name without the *.matrix extension, e.g. as "ZV-Z81-05". Non-standard driver location: You may also specify the full absolute path to an appropriate driver file, e.g. "C:\Program Files\Rohde-Schwarz\Vector Network Analyzer\Resources\ExtDev\ZV-Z81-05.matrix".</driver>
<interface></interface>	Interface type (string parameter): either "USB" or "LAN".
<address></address>	Interface-specific address (string parameter). For the LAN interface this is the IP address or host name of the switch matrix.
Example:	SYST:COMM:RDEV:SMATrix1:DEF 'My switch matrix', 'ZV-Z81-05', 'LAN', '10.10.10.10' Register switch matrix no.1: type R&S ZV-Z81 (model .05) at IP address 10.10.10.10, with user-defined name "My switch matrix".
Manual control:	See "Configured Devices" on page 443

#### SYSTem:COMMunicate:RDEVice:SMATrix:COUNt?

Gets the number of configured switch matrices (see SYSTem:COMMunicate:
RDEVice:SMATrix<Matr>:DEFine on page 836)

Usage: Query only

#### SYSTem:COMMunicate:RDEVice:SMATrix:DELete

Unregisters all *unused* switch matrices, i.e. removes them from the list of configured devices.

A switch matrix is *used* if it is part of the RF connection configuration (see INSTrument: SMATrix on page 641).

Usage: Event

Manual control: See "Configured Devices" on page 443

#### SYSTem:COMMunicate:RDEVice:SMATrix<Matr>:CATalog?

Queries the numbers of the switch matrices currently part of the RF configuration (see INSTrument: SMATrix on page 641). The response is a string containing a commaseparated list of switch matrix numbers.

Suffix: <matr></matr>	Configuration index of the switch matrix. This suffix is ignored.
Example:	Suppose switch matrices 1 and 2 are currently connected to the R&S ZNB. SYST: COMM: RDEV: SMAT1: CAT? Query the numbers of the connected switch matrices. The response is '1, 2'. SYST: COMM: RDEV: SMAT1: COUN? Query the number of connected switch matrices. The response is 2.
Usage:	Query only

#### SYSTem:COMMunicate:RDEVice:SMATrix:CONFigure:STARt

Starts a manual RF connection configuration.

**Note:** a manual RF connection configuration must be performed within a transaction, enclosed by the commands SYSTem:COMMunicate:RDEVice:SMATrix: CONFigure:STARt and SYSTem:COMMunicate:RDEVice:SMATrix:CONFigure: END. The modied configuration will not be applied until the end of this transaction.

An RF connection configuration comprises the RF connections between the VNA, a set of switch matrices and the DUT test ports.

At transaction start the R&S ZNB creates an in-memory copy of the active configuration and strips off all RF connections from this copy. Subsequent RF connection actions such as SYSTem:COMMunicate:RDEVice:SMATrix<Matr>:CONFigure:MVNA and SYSTem:COMMunicate:RDEVice:SMATrix<Matr>:CONFigure:MTESt operate on the copy.

However, the copy contains the very same switch matrices as the original, so the adequate set of matrices has to be selected beforehand (using manual control or the remote command INSTrument: SMATrix).

If a previous transaction is active, it will be silently rolled back.

Usage: Event

#### SYSTem:COMMunicate:RDEVice:SMATrix:CONFigure:ABORt

Aborts a manual RF connection configuration.

**Note:** a manual RF connection configuration must be performed within a transaction, enclosed by the commands SYSTem:COMMunicate:RDEVice:SMATrix: CONFigure:STARt and SYSTem:COMMunicate:RDEVice:SMATrix:CONFigure: END. The modied configuration will not be applied until the end of this transaction.

The new configuration is discarded, i.e. the previous configuration remains active ("rollback"). The transaction wil be terminated.

Usage: Event

#### SYSTem:COMMunicate:RDEVice:SMATrix:CONFigure:END

Ends a manual RF connection configuration: if the configuration is valid, it will be activated ("commit"). Otherwise an error is returned and the new configuration is discarded, i.e. the previous configuration remains active ("rollback").

In any case the transaction will be terminated.

**Note:** a manual RF connection configuration must be performed within a transaction, enclosed by the commands SYSTem:COMMunicate:RDEVice:SMATrix: CONFigure:STARt and SYSTem:COMMunicate:RDEVice:SMATrix:CONFigure: END. The modied configuration will not be applied until the end of this transaction.

The configuration is valid if

- every VNA port is either connected to a matrix port or directly assigned to a DUT test port
- every matrix that is part of the configuration is connected to the VNA by at least one RF connection
- every VNA port that is not connected to a matrix is assigned to a test port
- the test ports are numbered consecutively, starting with 1

Event

Usage:

SYSTem:COMMunicate:RDEVice:SMATrix<Matr>:CONFigure:MVNA {<MatrixVNAPort>, <VNAPort>}

Sets/gets the RF connections between switch matrix and VNA as a comma-separated list of port numbers.

**Note:** a manual RF connection configuration must be performed within a transaction, enclosed by the commands SYSTem:COMMunicate:RDEVice:SMATrix: CONFigure:STARt and SYSTem:COMMunicate:RDEVice:SMATrix:CONFigure: END. The modied configuration will not be applied until the end of this transaction.

Suffix:

<Matr>

Configuration index of the switch matrix (see SYSTem: COMMunicate:RDEVice:SMATrix<Matr>:DEFine on page 836)

Setting parameters: { <matrixvnaport></matrixvnaport>	Number of the switch matrix VNA port Range: 1 # of VNA ports of the switch matrix
<vnaport>}</vnaport>	Number of the VNA port Range: 1 # of RF ports of the VNA
Example:	SYSTem:COMMunicate:RDEVice:SMATrix1:CONFigure: MVNA 1,1,2,2 VNA ports 1 and 2 are connected to matrix VNA ports 1 and 2, respectively
Manual control:	See "Edit Matrix VNA Port Connections" on page 447

#### SYSTem:COMMunicate:RDEVice:SMATrix<Matr>:CONFigure:MLVNa {<MatrixVNAPortLabel>, <VNAPort>}

Sets/gets the RF connections between switch matrix and VNA. Similar to SYSTem: COMMunicate:RDEVice:SMATrix<Matr>:CONFigure:MVNA, but uses the front panel labels of the matrix VNA ports instead.

By default, these labels are only available for some matrix types.

**Note:** a manual RF connection configuration must be performed within a transaction, enclosed by the commands SYSTem:COMMunicate:RDEVice:SMATrix: CONFigure:STARt and SYSTem:COMMunicate:RDEVice:SMATrix:CONFigure: END. The modied configuration will not be applied until the end of this transaction.

#### Suffix:

<matr></matr>	Index of the switch matrix (see <pre>SYSTem:COMMunicate:</pre>
	RDEVice:SMATrix <matr>:DEFine on page 836)</matr>

#### Setting parameters:

{<MatrixVNAPortLabelSwitch matrix VNA port label

	These labels are specified in the corresponding matrix driver file (see SYSTem:COMMunicate:RDEVice:SMATrix <matr>: DEFine on page 836).</matr>
<vnaport>}</vnaport>	Number of the VNA port Range: 1 # of RF ports of the VNA
Example:	A switch matrix ZV-Z81-05 is used. SYSTem:COMMunicate:RDEVice:SMATrix1:CONFigure: MLVNA '1B',1,'2D',2 VNA ports 1 and 2 are connected to matrix VNA ports '1B' and '2D', respectively
Manual control:	See "Edit Matrix VNA Port Connections" on page 447

# SYSTem:COMMunicate:RDEVice:SMATrix<Matr>:CONFigure:MTESt {<MatrixTestPort>, <TestPort>}

Sets/gets the matrix test port connections as a comma-separated list of port numbers

**Note:** a manual RF connection configuration must be performed within a transaction, enclosed by the commands SYSTem:COMMunicate:RDEVice:SMATrix: CONFigure:STARt and SYSTem:COMMunicate:RDEVice:SMATrix:CONFigure: END. The modied configuration will not be applied until the end of this transaction.

#### Suffix:

<matr></matr>	Index of the switch matrix (see SYSTem:COMMunicate: RDEVice:SMATrix <matr>:DEFine on page 836)</matr>
Setting parameters: { <matrixtestport></matrixtestport>	Number of the switch matrix test port
<testport>}</testport>	Number of the test port. Test ports must be numbered subsequently starting at 1.
Example:	SYSTem:COMMunicate:RDEVice:SMATrix1:CONFigure: MTESt 1,1,2,2,3,3,4,4,5,5 Test ports 1 to 5 of matrix 1 are assigned to DUT test ports 1 to 5.
Manual control:	See "Edit Test Port Connection" on page 448

### SYSTem:COMMunicate:RDEVice:SMATrix<Matr>:CONFigure:MLTest {<MatrixTestPortLabel>, <TestPort1>}

Sets/gets the matrix test port connections. Similar to SYSTem:COMMunicate: RDEVice:SMATrix<Matr>:CONFigure:MTESt, but uses the front panel labels of the matrix test ports instead.

By default, these labels are only available for some matrix types.

**Note:** a manual RF connection configuration must be performed within a transaction, enclosed by the commands SYSTem:COMMunicate:RDEVice:SMATrix: CONFigure:STARt and SYSTem:COMMunicate:RDEVice:SMATrix:CONFigure: END. The modied configuration will not be applied until the end of this transaction.

#### Suffix:

<matr></matr>	Index of the switch matrix (see SYSTem:COMMunicate:
	RDEVice:SMATrix <matr>:DEFine on page 836)</matr>

#### Setting parameters:

{<MatrixTestPortLabelSwitch matrix test port label

If available, these labels are specified in the corresponding matrix driver file (see SYSTem:COMMunicate:RDEVice: SMATrix<Matr>:DEFine on page 836).

<TestPort>} Number of the test port. Test ports must be numbered subsequently, starting at 1.

Example:A switch matrix ZV-Z82-16 is used.<br/>SYSTem:COMMunicate:RDEVice:SMATrix1:CONFigure:<br/>MLTESt 'A1',1,'B1',2,'C1',3,'D1',4<br/>The first test ports of submatrices A to D are assigned to test ports<br/>1 to 4, respectively.

Manual control: See "Edit Test Port Connection" on page 448

SYSTem:COMMunicate:RDEVice:SMATrix:CONFigure:TVNA <TestPort1>, <VNAPort1>...

Sets/gets the test port connections of the VNA in a switch matrix RF connection setup, i.e. the direct assignments of DUT test ports to VNA test ports.

**Note:** a manual RF connection configuration must be performed within a transaction, enclosed by the commands SYSTem:COMMunicate:RDEVice:SMATrix: CONFigure:STARt and SYSTem:COMMunicate:RDEVice:SMATrix:CONFigure: END. The modied configuration will not be applied until the end of this transaction.

# Setting parameters:

<testport></testport>	Number of the test port. Test ports must be numbered subsequently starting at 1.
<vnaport></vnaport>	Number of the VNA port
Example:	SYSTem:COMMunicate:RDEVice:SMATrix:CONFigure: TVNA 6,2,7,4 DUT test Ports 6 and 7 are assigned to VNA ports 2 and 4.
Manual control:	See "Edit Test Port Connection" on page 448

# 6.3.17.2 SYSTem... (Contd.)

The following SYSTem... commands provide general instrument configurations.

SYSTem:DATE	
SYSTem:DFPRint?	
SYSTem:DISPlay:BAR:HKEY[:STATe]	
SYSTem:DISPlay:BAR:MENU[:STATe]	
SYSTem:DISPlay:BAR:STATus[:STATe]	
SYSTem:DISPlay:BAR:STOols[:STATe]	
SYSTem:DISPlay:BAR:TITLe[:STATe]	
SYSTem:DISPlay:BAR:TOOLs[:STATe]	
SYSTem:DISPlay:COLor.	
SYSTem:DISPlay:UPDate	
SYSTem:ERRor:ALL?	
SYSTem:ERRor:DISPlay	
SYSTem:ERRor[:NEXT]?	
SYSTem:FIRMware:UPDate	
SYSTem:FPReset	
SYSTem:FREQuency?	

SCPI Command Reference

SYSTem:IDENtify:FACTory	
SYSTem:IDENtify[:STRing]	847
SYSTem:KLOCk	
SYSTem:LANGuage	
SYSTem:LOGGing:REMote[:STATe]	
SYSTem:OPTions:FACTory	
SYSTem:OPTions[:STRing]	
SYSTem:PASSword[:CENable]	
SYSTem:PRESet:SCOPe	
SYSTem:PRESet:USER:NAME	
SYSTem:PRESet:USER[:STATe]	
SYSTem:PRESet:USER:CAL	
SYSTem:PRESet[:DUMMy]	
SYSTem:SETTings:UPDate	851
SYSTem:SHUTdown	
SYSTem:SOUNd:ALARm[:STATe]	
SYSTem:SOUNd:STATus[:STATe]	852
SYSTem:TIME	852
SYSTem:TSLock	852
SYSTem:USER:KEY	
SYSTem:VERSion?	
SYSTem:DISPlay:DIALogs:SETup:MCAL[:STATe]	
SYSTem:SMATrix:OPTimization	854

#### SYSTem:DATE <Year>, <Month>, <Day>

The command queries or defines the instrument's current date setting.

The setting command requires administrator rights; refer to chapter "Administrative Tasks" in the Getting Started guide.

#### **Parameters:**

<year></year>	
---------------	--

	Year, four-digit number
<month></month>	
	Month, two-digit number, 01 (for January) to 12 (for December)
<day></day>	Day, two-digit number, 01 to the number of days in the month
Evennler	SYST: DATE?
Example:	Response: 2012, 05, 01 - it is the 1st of May, 2012.

#### SYSTem:DFPRint?

Queries the device footprint. The device footprint contains detailed information about the instrument and is mostly used for service purposes.

Usage:Query onlyManual control:See "Save... / Print... / Save Report" on page 428

```
SYSTem:DISPlay:BAR:HKEY[:STATe] <Boolean>
SYSTem:DISPlay:BAR:MENU[:STATe] <Boolean>
SYSTem:DISPlay:BAR:STATus[:STATe] <Boolean>
SYSTem:DISPlay:BAR:STOOIs[:STATe] <Boolean>
SYSTem:DISPlay:BAR:TITLe[:STATe] <Boolean>
SYSTem:DISPlay:BAR:TOOLs[:STATe] <Boolean>
```

Displays or hides the hardkey panel (HKEY), the menu bar below the diagram area (MENU), the status bar below the diagram area (STATUS), the softtool panel (STOOLS), the title bar of the main VNA application window (TITLe), and the toolbar above the diagram area (TOOLS).

#### **Parameters:**

<boolean></boolean>	ON   OFF
	Display or hide the information elements.
Example:	SYSTem:DISPlay:BAR:TOOLS ON; STOOLS ON; STATUS ON Display the toolbar, softtool panel, and status bar.
	SYSTem:DISPlay:BAR:TITLe OFF; HKEY OFF; MENU OFF Hide the title bar, hardkey bar, and menu bar.

### SYSTem:DISPlay:COLor <ColorScheme>

Selects the color scheme for all diagram areas in the active recall set.

Parameters: <pre><colorscheme></colorscheme></pre>	DBACkground   LBACkground   BWLStyles   BWSolid
	DBACkground - dark background LBACkground - light background BWLStyles - black and white line styles BWSolid - black and white solid
Example:	SYST:DISP:COL LBAC Select a light background, e.g. to generate color hardcopies.
Manual control:	See "Color Scheme" on page 415

#### SYSTem:DISPlay:UPDate <Activate>

Switches the display on or off while the analyzer is in the remote state. The command has no effect while the analyzer is in the local operating state.

**Tip:** Switching off the display speeds up the measurement. This command may have an impact on the update of trace and channel settings; see SYSTem:SETTings:UPDate.

Parameters: <activate></activate>	ON   OFF - switch the display on or off. If the display is switched on, the analyzer shows the diagrams and traces like in manual control. ONCE - switch the display on and show the current trace. This parameter can be used for occasional checks of the measurement results or settings. The measurement is continued, however, the measurement results are not updated. Compared to the ON set- ting, ONCE does not slow down the measurement speed.
Example:	SYST: DISP: UPD ON Switch the display on to view the traces and diagrams.

# SYSTem:ERRor:ALL?

Queries and at the same time deletes all entries in the error queue.

The entries consist of an error number and a short description of the error. Positive error numbers are instrument-dependent. Negative error numbers are reserved by the SCPI standard; see section Error Messages and Troubleshooting.

Example:	SYST:ERR:ALL?
	Query all entries in the error queue. 0, "No $$ error" is returned if the error queue is empty.
Usage:	Query only

#### SYSTem:ERRor:DISPlay <Boolean>

Switches the display of a tooltip for remote command errors on or off. The tooltip appears at the bottom of the remote screen and of the manual screen; it is **not** displayed for SCPI errors no.-113, Undefined header.

Parameters: <boolean></boolean>	ON   OFF - switch the tooltip on or off. *RST: OFF
Example:	SYST:ERR:DISP ON Switch the display of the tooltip for remote command errors on. FREQ:STAR 1
	<b>Generate a</b> Remote Error: -222, "Data out of range;" tooltip.
Manual control:	See "Show Errors" on page 432

### SYSTem:ERRor[:NEXT]?

Queries and at the same time deletes the oldest entry in the error queue. Operation is identical to that of STATUS:QUEue[:NEXT]?

The entry consists of an error number and a short description of the error. Positive error numbers are instrument-dependent. Negative error numbers are reserved by the SCPI standard; see section Error Messages and Troubleshooting.

Example:	SYST:ERR?
	Query the oldest entry in the error queue. 0, "No $$ error" is
	returned if the error queue is empty.
Usage:	Query only

#### SYSTem:FIRMware:UPDate <NWASetupFile>

Installs a firmware version stored in a VNA setup file (\*.msi) on the analyzer. The installation is automatic and does not require any further action.

#### Setting parameters:

<nwasetupfile></nwasetupfile>	String variable for the name and directory of a VNA setup file (*.msi).
Example:	SYST:FIRM:UPD 'C: \Users\Public\Setup\ZNBC_01.40.msi' Install the firmware version V1.40 from the setup file stored in the public directory of the analyzer's internal hard disk.
Usage:	Setting only

#### SYSTem:FPReset

Performs a factory preset of all instrument settings (i.e. all open recall sets) or of the active recall set, depending on the SYSTem: PRESet:SCOPe settings, and deletes channel 1 in the active recall set. As a result, the active recall set contains no channels, traces, and diagram areas.

Example:	SYST:PRES:SCOP SING
	Define the scope of a preset: the active recall set is reset only. SYST: FPR
	Reset the parameters of the current recall set and delete channel 1.
Usage:	Event

#### SYSTem:FREQuency? < MinMax>

Queries the minimum and maximum frequency of the network analyzer. For an overview refer to the tables at the beginning of chapter 6.3.14.10, "[SENSe:]FREQuency...", on page 736.

**Tip:** In contrast to [SENSe<Ch>:]FREQuency:STARt? and the other sweep range commands, SYSTem:FREQuency? can be used in all sweep modes.

#### Query parameters:

<MinMax> MINimum | MAXimum

Return values:	
<frequency></frequency>	MINimum   MAXimum
	Return minimum or maximum frequency.
Example:	See [SENSe <ch>:]FREQuency:CENTer</ch>
Usage:	Query only
Manual control:	See "Start / Stop / Center / Span Frequency (Power / Time)" on page 256

#### SYSTem:IDENtify:FACTory

Resets the response to the \*IDN? query to the factory default value. This command overwrites a user-defined identification string; see example.

Example:	<pre>SYSTem:IDENtify:STRing 'MyDevice'; *IDN? Define an identity string. The response is MyDevice. SYSTem:IDENtify:FACTory; *IDN? Re-activate the factory setting. The response is Rohde-Schwarz,<instrument type="">-<ports>,<stock no.=""><serial no.="">,<firmware version="">.</firmware></serial></stock></ports></instrument></pre>
Usage:	Event
Manual control:	See "Define *IDN? + *OPT?" on page 432

### SYSTem:IDENtify[:STRing] <InstId>

Defines an identity string for the network analyzer. The query is equivalent to **\*IDN**?.

Parameters: <instid></instid>	String parameter containing the instrument identity
Example:	See SYSTem: IDENtify: FACTory
Manual control:	See "Define *IDN? + *OPT?" on page 432

#### SYSTem:KLOCk <Boolean>

Locks or unlocks the local controls of the analyzer. This includes the front panel keys, the keyboard, or other local interfaces.

# Parameters:

<boolean></boolean>	ON   OFF - lock or unlock the local keys.	
	*RST:	OFF
Example:	SYST:KLOCK ON Lock the local keys.	

#### SYSTem:LANGuage <Language>

Specifies the remote language for the analyzer.

# Parameters:

<language></language>	Command syntax for the analyzer, string variable: 'SCPI' – R&S ZNB-specific command set: the analyzer supports all commands described in this documentation. 'ZVR'   'ZVABT' – compatibility with network analyzers of the R&S ZVR and R&S ZVA/B/T families. 'PNA'   'HP8510'   'HP8720'   'HP8753' – compatibility with network analyzers from other manufacturers.	
	*RST:	n/a - a reset does not affect the language setting. The factory setting is SCPI.
Example:	SYST:LANG	G 'PNA' IA-compatible command set.
Manual control:	See "Remo	te Language" on page 431

### SYSTem:LOGGing:REMote[:STATe] <Boolean>

Enables logging of all remote control commands transferred to the analyzer.

Parameters:	
-Declears	

<boolean></boolean>	<pre>ON - command sequence stored to file C:\Users\Public\Documents\Rohde-Schwarz\Vna\ RemoteLog\VNARemote.log. OFF - command sequence not logged.</pre>
Example:	<pre>SYST:LOGG:REM ON Enable remote logging. The log file 'C:\Users\Public\Documents\Rohde-Schwarz\Vna\ RemoteLog\VNARemote.log' is fixed and does not have to be specified.</pre>

# SYSTem:OPTions:FACTory

Resets the response to the \*OPT? query to the factory default value. This command overwrites a user-defined option string; see example.

Example:	SYSTem:OPTions:STRing 'MyOptions'; *OPT?
	Define an identity string. The response is MyOptions.
	SYSTem:OPTions:FACTory; *OPT?
	Re-activate the factory setting. The analyzer returns a comma- separated list of software and hardware options.
Usage:	Event
Manual control:	See "Define *IDN? + *OPT?" on page 432

# SYSTem:OPTions[:STRing] < Options>

Defines an option string for the network analyzer. The query is equivalent to \*OPT?.

Parameters:	String parameter containing the available options
Example:	See SYSTem:OPTions:FACTory
Manual control:	See "Define *IDN? + *OPT?" on page 432

#### SYSTem:PASSword[:CENable] <Password>

Sends a password to the analyzer enabling a class of service functions to function (Command ENable). Service functions are activated with the commands of the DIAGnostic... system and should be used by a R&S service representative only.

#### Setting parameters:

<password></password>	Case-sensitive string variable. Sending an invalid password generates error -221, (settings conflict).
Example:	SYST: PASS "XXXX" Enter password.
Usage:	Setting only
Manual control:	See "Password" on page 429

#### SYSTem:PRESet:SCOPe <Scope>

Specifies whether a preset (SYSTem: PRESet [:DUMMy]; \*RST) affects the active recall set only or all open recall sets.

# Parameters:

<scope></scope>	ALL   SINGle
	ALL – all open recall sets are deleted and the recall set "Set1" is created with default trace and channel settings. SINGle – the settings of the active setup are reset; the name of the active setup and the parameters of all other setups remain unchanged.
Example:	See SYSTem: PRESet [: DUMMy]
Manual control:	See "Preset Scope" on page 422

#### SYSTem:PRESet:USER:NAME <RecallSetFile>

Specifies the name of a recall set file (.znx) to be used for a user-defined preset.

Parameters: <recallsetfile></recallsetfile>	String parameter to specify the name and directory of the recall set file to be loaded. The default extension (manual control) for recall set files is *.znx, although other extensions are allowed. If
	no path is specified the analyzer searches the default directory (subdirectoryRecallSets)
Example:	See SYSTem: PRESet: USER[:STATe]

Manual control: See "Preset Configuration" on page 423

#### SYSTem:PRESet:USER[:STATe] <Boolean>

Selects a factory preset or a user-defined preset.

Note: The user-defined preset can be initiated using "System > Preset" (manual control) or MMEMory: LOAD: STATE. \*RST and SYSTem: PRESet [:DUMMy] always initiate a factory preset.

#### Parameters:

<boolean></boolean>	OFF - user-defined preset switched off (factory preset is used). ON - user-defined preset switched on.
Example:	SYST:PRES:USER ON
-	Enable a user-defined preset.
	SYST:PRES:USER:NAME 'C:\Users\Public
	\Documents\Rohde-Schwarz\Vna\RecallSets\Setup 2.znx'
	Select a setup file for the user-defined preset.
	Press PRESET (manual control) or use
	MMEM:LOAD:STAT 1, 'C:\Users\Public\Documents
	\Rohde-Schwarz\Vna\RecallSets\Setup_2.znx'.

Manual control: See "Preset Configuration" on page 423

### SYSTem:PRESet:USER:CAL <PresetUserCal>

Selects a calibration from the calibration pool that shall be restored during a user-defined preset.

The corresponding cal group file (<PresetUserCal>.cal) must be available in the cal pool directory

C:\Users\Public\Documents\Rohde-Schwarz\Vna\Calibration\Data\.

Parameters: <presetusercal></presetusercal>	Name of the cal group (i.e. the name of the cal group file without path and extension). Use the empty string to restore the default behavior (no preset user cal).
Example:	<pre>MMEMORY:STORE:CORRection 1, 'Refl1 Trans123.cal' Adds the active user calibration to the memory pool SYSTem:PRESet:USER:CAL 'Refl1 Trans123' Sets the newly created cal pool member as the preset user cal. SYSTem:PRESet:USER:CAL? Queries for the preset user cal. Returns 'Refl1 Trans123' SYSTem:PRESet:USER:CAL '' Restores the default behaviour of the instrument: no preset user cal.</pre>
Manual control:	See "Preset User Cal" on page 358

User Manual 1173.9163.02 - 13

#### SYSTem:PRESet[:DUMMy]

Performs a factory preset of all instrument settings (i.e. all open recall sets) or of the active recall set, depending on the SYSTem: PRESet: SCOPe settings. The command is equivalent to \*RST and to the action of the PRESET key on the front panel.

**Note:** If a user-defined preset is active (SYSTem: PRESet:USER[:STATe]ON), the PRESET key initiates a user-defined preset, while SYSTem: PRESet[:DUMMy] and \*RST still activate the factory preset. If "Align \*RST to User Defined Preset" is selected in the "System Configuration > Presets" dialog and a valid user preset file is available, \*RST and SYSTem: PRESet[:DUMMy] also restore the user-defined settings.

Example:	SYST:PRES:SCOP SING
	Define the scope of a preset: the active recall set is reset only.
	SYST:PRES
	Reset the parameters of the current recall set.
Manual control:	See "Preset" on page 448

#### SYSTem:SETTings:UPDate <Activate>

Initiates an immediate update of the channel or trace settings.

The command has an effect if the analyzer operates in single sweep mode ( INITiate<Ch>: CONTINUOUSOFF) and if the display update is switched off (SYSTEM: DISPlay: UPDateOFF). In this scenario, a change of the channel or trace settings is usually not taken into account immediately. The analyzer waits until the end of the current sweep sequence and changes all settings made during the last sweep period when the next single sweep sequence is initiated. Several settings can be made en bloc, which generally saves time.

SYSTem: SETTings: UPDate ONCE causes the analyzer to apply the settings at once without waiting for the end of the current single sweep sequence. The command has no effect in continuous sweep mode or if the display update is switched on.

The settings are also updated when the continuous sweep mode is activated ( INITiate<Ch>: CONTinuousON).

#### Setting parameters:

	SYST: SETT: UPD ONCE Update the settings made during the current single sweep period.
	Activate single sweep mode.
Example:	INIT:CONT OFF
	Causes an immediate update of the settings.
<activate></activate>	ONCE

#### SYSTem:SHUTdown

Switches the R&S ZNB to standby state.

 Example:
 SYST:SHUT

 Switch the analyzer to standby state.

 Usage:
 Event

# SYSTem:SOUNd:ALARm[:STATe] <Boolean> SYSTem:SOUNd:STATus[:STATe] <Boolean>

These commands switch alarm or status sounds on or off.

#### Parameters:

<boolean></boolean>	ON   OFF	
	*RST: ON	
Example:	SYST: SOUN: ALAR OFF; STAT OFF Switch alarm and status sounds off.	
Manual control:	See "Instrument Messages / Sounds / Transparent Info Fields / Show Sweep Symbols" on page 425	

SYSTem:TIME <Hours>, <Minutes>, <Seconds>

The command queries or defines the instrument's current time setting.

The setting command requires administrator rights; refer to chapter "Administrative Tasks" in the Getting Started guide.

#### **Parameters:**

	Response: 12, 0, 0 - it is precisely 12 pm.	
Example:	SYST:TIME?	
<seconds></seconds>	059	
<minutes></minutes>	059	
<hours></hours>	023	

#### SYSTem:TSLock <Type>

Locks the touchscreen functionality of the R&S ZNB, e.g. in order to prevent inadvertent entries during remote control.

### Parameters:

<Type>

OFF | DIAGrams | SCReen

OFF – touchscreen (e.g. the remote screen) remains active. You can use the buttons in "Remote" softtool panels. If you switch back to manual control, the drag and drop functions (e.g. for markers) are still available.

DIAGrams – lock the drag and drop functions in diagrams .

SCReen – lock the entire screen including the remote screen buttons.

\*RST: n/a (\*RST does not affect the tochscreen lock setting). Example: SYSTem:TSLock SCReen Lock the entire screen.

### SYSTem:USER:KEY <Key>[, <Label>]

Labels a user-defined key in the remote display. In the query form the command returns whether or not a user-defined key was tapped.

#### **Parameters:**

<key></key>	Number of the user key 0 – Delete all user keys and restore the default keys ("Go to Local", "Display Off"). 1 to 8 – User key numbers Range: 0 to 8 *RST: 0	
<label></label>	Label for user key no. 1 to 8 (string variable)	
Example:	<ul> <li>SYST: USER: KEY 1, 'User S11'</li> <li>Define a user key no. 1 labeled S11. The user key is only labeled, no functionality is assigned.</li> <li>SYST: USER: KEY? 1</li> <li>Query the label. The response is 1, 'User S11'.</li> <li>SYST: USER: KEY?</li> <li>Query the user action. The query returns 0, '', indicating that no user key has been tapped. If you tap the user softkey no. 1, the response is 1, 'User S11'. Moreover, the ESR bit no. 6 (User Request) is set.</li> <li>SYST: USER: KEY 0</li> <li>Delete the user key and restore the default keys.</li> </ul>	

#### SYSTem:VERSion?

Returns the SCPI version number to which the analyzer complies. The analyzer complies to the final SCPI version 1999.0

Example:	SYST:VERS?
	Query the SCPI version. The response is 1999.0.
Usage:	Query only

### SYSTem:DISPlay:DIALogs:SETup:MCAL[:STATe] <Boolean>

Enables/disables multiple calibrations in the calibration wizard.

Parameters: <Boolean>

Manual control: See "Multiple Cal in Calibration Wizard" on page 424

#### SYSTem:SMATrix:OPTimization <Unit>

Sets/gets the switch matrix route selection algorithm.

#### Parameters:

<Unit>

SPEed | PRECision

SPEed – Optimizes measurement speed by minimizing the total number of switching procedures. This is highly recommended for matrices with mechanical switches.

PRECision – Optimizes measurement precision by always using best possible routes (according to matrix-specific route priorization).

Firmware/Software: V1.70

# 6.3.18 TRACe Commands

The TRACe... commands handle active trace data and trace data stored in the analyzer's internal memory.

# 0

## Trace data formats

Trace data is transferred in either ASCII or block data (REAL) format, depending on the FORMat[:DATA] setting. If the block data format is used, it is recommended to select EOI as receive terminator (SYSTem:COMMunicate:GPIB[:SELF]:RTERminator EOI).

The commands in the TRACe... menu use the following ZVR-compatible parameters to specify traces:

Table 6-10: Reserved Trace Names	Table
----------------------------------	-------

Parameter	Meaning	Used in
CH1DATA CH2DATA	Active data trace of channels 1 to 4	TRACe:COPY TRACe[:DATA]:STIMulus[:ALL]?
CH3DATA CH4DATA		TRACe[:DATA][:RESPonse][:ALL]? CALCulate <chn>:MATH[:EXPRession][: DEFine]</chn>
CH1MEM CH2MEM CH3MEM CH4MEM	Active memory trace associ- ated to the active data trace CH1DATA, CH2DATA, CH3DATA, CH4DATA, respectively.	TRACe[:DATA]:STIMulus[:ALL]? TRACe[:DATA][:RESPonse][:ALL]?
IMPLied	Active data trace, addressed with <chn></chn>	CALCulate <chn>:MATH[:EXPRession][: DEFine]</chn>

Parameter	Meaning	Used in
CHMem	Active memory trace assigned to the IMPlied trace	CALCulate <chn>:MATH[:EXPRession][: DEFine]</chn>
MDATA1 MDATA2 MDATA3 MDATA4 MDATA5 MDATA6 MDATA7 MDATA8	Memory trace named Mem <n> [Trc<m>]. The trace name is unique because <n> counts all data and memory traces in the active setup.</n></m></n>	TRACe:CLEar TRACe:COPY TRACe[:DATA]:STIMulus[:ALL]? TRACe[:DATA][:RESPonse][:ALL]? CALCulate <chn>:MATH[:EXPRession][: DEFine]</chn>

#### TRACe:COPY <MemTraceName>, <DataTraceName>

Copies a data trace to a memory trace. The trace to be copied can be specified by two alternative methods:

- As the active data trace of channels 1 to 4 (CH1DATA, CH2DATA, CH3DATA, CH4DATA). If a mathematical trace is active, the associated data trace is copied.
- As a trace with a name (string variable).

The created memory trace can be specified as follows:

- As the memory trace named Mem<n>[Trc<m>], where n = 1, ... 8 and Trc<m> is the name of the copied data trace (MDATA1, MDATA2, MDATA3, MDATA4, MDATA5, MDATA6, MDATA7, MDATA8).
- As a memory trace with an arbitrary name (string variable).

An existing memory trace with the same name is overwritten.

**Note:** The copied trace is the data trace which is not modified by any mathematical operations. To copy a mathematical trace to a memory trace, use TRACe:COPY:MATH. To copy the active trace to the memory using an automatic memory trace name, use CALCulate<Chn>:MATH:MEMorize.

#### Setting parameters:

<memtracename></memtracename>	Name of the	Name of the memory trace (see also table 6-10).	
	Range:	<memory_trace> is either a string variable (enclosed in single or double quotes) or one of the following reserved names (no string variables):MDATA1   MDATA2   MDATA3   MDATA4   MDATA5   MDATA6   MDATA7   MDATA8 (only for memory traces Mem<n>[Trc<m>], where n = 1, 8).</m></n></memory_trace>	
<datatracename></datatracename>	Name of the	e data trace (see also table 6-10).	
	Range:	<pre><data_trace> is either a string variable (enclosed in single or double quotes) or one of the following reserved names (no string variables):CH1DATA   CH2DATA   CH3DATA   CH4DATA (only for the active data trace in channels Ch1, Ch2, Ch3, Ch4).</data_trace></pre>	

Example:	<ul> <li>*RST; :SWE:POIN 20</li> <li>Create a trace with 20 sweep points, making the created trace the active trace of channel 1 (omitted optional mnemonic SENSe1).</li> <li>TRAC:COPY "Mem_Pt20", CH1DATA</li> <li>Copy the current state of the created trace to a memory trace named "Mem_Pt20". The memory trace is not displayed.</li> <li>DISP:WIND:TRAC2:FEED "MEM_PT20"</li> <li>Display the created memory trace in the active diagram area (diagram area no. 1).</li> </ul>
Usage:	Setting only
Manual control:	See "Data to <destination>" on page 196</destination>

#### TRACe:COPY:MATH <MemTraceName>, <DataTraceName>

Copies a mathematical trace to a memory trace. The trace to be copied can be specified by two alternative methods:

- As the active mathematical trace of channels 1 to 4 (CH1DATA, CH2DATA, CH3DATA, CH4DATA)
- As a trace with a name (string variable).

The created memory trace can be specified as follows:

- As the memory trace named Mem<n>[Trc<m>], where n = 1, ... 8 and Trc<m> is the name of the copied data trace (MDATA1, MDATA2, MDATA3, MDATA4, MDATA5, MDATA6, MDATA7, MDATA8).
- As a memory trace with an arbitrary name (string variable).

An existing memory trace with the same name is overwritten.

**Note:** To copy a data trace which is not modified by any mathematical operations, use TRACe:COPY

#### Setting parameters:

<memtracename></memtracename>	Name of the	e memory trace (see also table 6-10).
	Range:	<memory_trace> is either a string variable (enclosed in single or double quotes) or one of the following reserved names (no string variables):MDATA1   MDATA2   MDATA3   MDATA4   MDATA5   MDATA6   MDATA7   MDATA8 (only for memory traces Mem<n>[Trc<m>], where n = 1, 8).</m></n></memory_trace>
<datatracename></datatracename>	Name of the	e data trace (see also table 6-10).
	Range:	<pre><data_trace> is either a string variable (enclosed in single or double quotes) or one of the following reserved names (no string variables):CH1DATA   CH2DATA   CH3DATA   CH4DATA (only for the active data trace in channels Ch1, Ch2, Ch3, Ch4).</data_trace></pre>


User Manual 1173.9163.02 - 13

Example: \*RST; :SWE:POIN 20 Create a trace with 20 sweep points, making the created trace the active trace of channel 1 (omitted optional mnemonic SENSe1). CALC:MATH:SDEF 'Trc1 / 2'; :CALC:MATH:STAT ON Define a mathematical trace, dividing the data trace by 2. Activate the mathematical mode and display the mathematical trace instead of the data trace. TRAC:COPY:MATH 'Mem Pt20',CH1DATA; :CALC:MATH: STAT OFF Copy the current state of the mathematical trace to a memory trace named "Mem\_Pt20". The memory trace is not displayed. Switch the display back to the data trace. DISP:WIND:TRAC2:FEED 'MEM\_PT20' Display the created memory trace together with the data trace. Usage: Setting only

# 6.3.19 TRIGger Commands

The TRIGger... commands synchronize the analyzer's actions (in particular, the start of a measurement sequence) with events. The

TRIGger:CHANnel<Ch>:AUXiliary... commands control the external trigger output EXT TRIG OUT at the rear panel of the instrument. The output trigger signal consists of TTL pulses of configurable duration and polarity which may be sent before or after each sweep or measurement point.

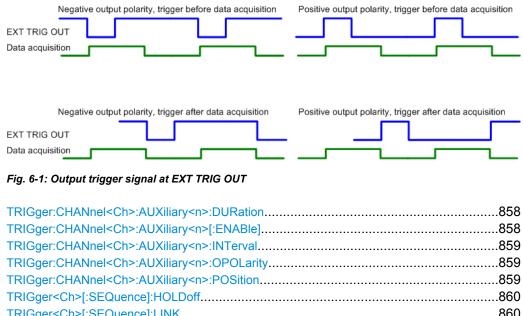

TRIGger <ch>[:SEQuence]:LINK</ch>	
TRIGger <ch>[:SEQuence]:MULTiple:HOLDoff</ch>	861
TRIGger <ch>[:SEQuence]:MULTiple:SLOPe<num></num></ch>	861
TRIGger <ch>[:SEQuence]:MULTiple:SOURce</ch>	
TRIGger <ch>[:SEQuence]:SLOPe</ch>	
TRIGger <ch>[:SEQuence]:SOURce</ch>	

#### R&S<sup>®</sup> ZNB

## TRIGger:CHANnel<Ch>:AUXiliary<n>:DURation <TrigOutDuration>

Specifies the width of the output trigger pulses at EXT TRIG OUT. The trigger duration must be shorter than the time lag between two consecutive triggered masurements. This time lag is equal to the "Sweep Time" (if the output trigger signal is sent once every sweep, TRIGger:CHANnel<Ch>:AUXiliary<n>:INTerval SWEep) or to the sweep time divided by the number of points (for

TRIGger:CHANnel<Ch>:AUXiliary<n>:INTerval POINt).

Channel number

If the trigger duration is too long, you can modify one of the following settings:

- Reduce the trigger duration, if possible.
- Slow down the sweep: select a smaller bandwidth or increase the "Sweep Time" setting.

#### Suffix:

<Ch>

<n>

Auxiliary channel number. This suffix is ignored; it can be set to 1 or omitted.

#### Parameters:

<trigoutduration></trigoutduration>	Range: *RST: Default unit	1 us (1E-6 s) to 1 s 1 us : s
Example:	See TRIGg	er:CHANnel <ch>:AUXiliary<n>[:ENABle]</n></ch>

## TRIGger:CHANnel<Ch>:AUXiliary<n>[:ENABle] < EnableTriggOut>

Turns the external trigger output EXT TRIG OUT for channel no. <Ch> on or off.

<b>Suffix:</b> <ch></ch>	Channel number	
<n></n>	Auxiliary channel number. This suffix is ignored; it can be set to 1 or omitted.	
<b>Parameters:</b> <enabletriggout></enabletriggout>	Turn trigger output on (ON) or off (OFF, no signal). *RST: OFF	
Example:	<pre>TRIGger:CHANnel:AUXiliary:ENABle ON Turn on the trigger output for channel no. 1 (channel suffix omit- ted). TRIGger:CHANnel:AUXiliary:DURation 10 us Change the width of the output trigger pulses. TRIGger:CHANnel:AUXiliary:POSition BEFore Send the output trigger pulses before data acquisition starts. TRIGger:CHANnel:AUXiliary:INTerval SWEep Send one output trigger pulse per sweep. TRIGger:CHANnel:AUXiliary:OPOLarity POSitive Select positive polarity for the output trigger pulses.</pre>	

User Manual 1173.9163.02 - 13

### TRIGger:CHANnel<Ch>:AUXiliary<n>:INTerval <Type>

Specifies whether the trigger output pulses are sent once every measurement point or once every sweep.

Suffix: <ch></ch>	Channel number	
<n></n>	Auxiliary channel number. This suffix is ignored; it can be set to 1 or omitted.	
Parameters:		
<type></type>	POINt   SWEep	
	*RST: SWEep	
Example:	See TRIGger:CHANnel <ch>:AUXiliary<n>[:ENABle]</n></ch>	

#### TRIGger:CHANnel<Ch>:AUXiliary<n>:OPOLarity <Type>

Selects the polarity of the output trigger pulses; see figure 6-1.

Suffix: <ch></ch>	Channel number
<n></n>	Auxiliary channel number. This suffix is ignored; it can be set to 1 or omitted.
Parameters: <type></type>	POSitive   NEGative *RST: NEGative
Example:	See TRIGger: CHANnel <ch>:AUXiliary<n>[:ENABle]</n></ch>

#### TRIGger:CHANnel<Ch>:AUXiliary<n>:POSition <Type>

Specifies whether the trigger output signal is sent before or after data acquisition; see figure 6-1. Choose this setting according to the external device to be triggered:

- BEFore is appropriate if the the device needs to be triggered before the data is acquired (typical example: a power meter which is used for power calibration).
- AFTer is appropriate if the device needs to be triggered just after data acquisition (typical example: an external generator which must be re-configured in order to get ready for the next measurement).

### Suffix:

<ch></ch>	Channel number
<n></n>	Auxiliary channel number. This suffix is ignored; it can be set to 1 or omitted.
Parameters:	
<type></type>	BEFore   AFTer
	*RST: AFTer

**Example:** See TRIGger:CHANnel<Ch>:AUXiliary<n>[:ENABle]

## TRIGger<Ch>[:SEQuence]:HOLDoff <DelayTime>

Sets a delay time between the trigger event and the start of the measurement ("Trigger Delay").

<b>Suffix:</b> <ch></ch>	Channel nur	mber.
Parameters: <delaytime></delaytime>	Increment:	0 s
Example: Manual control:	TRIG:HOLD Set a delay	ernal trigger source.

## TRIGger<Ch>[:SEQuence]:LINK <MeasSequence>

Selects the triggered measurement sequence. The identifier for the sequence is a string variable.

<b>Suffix:</b> <ch></ch>	Channel number	
Parameters: <meassequence></meassequence>	Triggered measurement sequence, string variable. 'SWEep' – trigger event starts an entire sweep. 'SEGMent' – trigger event starts a sweep segment, if segmented frequency sweep is active (see example below). If another sweep type is active, the trigger event starts an entire sweep. 'POINt' – trigger event starts measurement at the next sweep point. 'PPOint' – trigger event starts the next partial measurement at the current or at the next sweep point. *RST: 'SWEep'	
Example:	<pre>SEGM:ADD; :SWE:TYPE SEGM Select segmented frequency sweep. TRIG:LINK 'SEGM' Select a trigger segment as triggered measurement sequence. TRIG:LINK? Query the triggered measurement sequence. The response is 'SEGMENT'.</pre>	

User Manual 1173.9163.02 - 13

Manual control: See "Sequence" on page 388

#### TRIGger<Ch>[:SEQuence]:MULTiple:HOLDoff <MeasSequence>[, <DelayTime>]

Sets a delay time between the trigger event and the start of the measurement ("Trigger Delay") in multiple trigger mode.

<b>Suffix:</b> <ch></ch>	Channel number	
Parameters: <meassequence></meassequence>	SWEep   SEGMent   POINt   PPOint Triggered measurement sequence, PPOint denotes "partial mea- surement"; see TRIGger <ch>[:SEQuence]:LINK.</ch>	
<delaytime></delaytime>	Delay time Range: 0 s to 13680 s Increment: 10 ms *RST: 0 s Default unit: s	
Example:	See TRIGger <ch>[:SEQuence]:MULTiple:SOURce</ch>	
Manual control:	See "Source / Slope / Level / Delay" on page 391	

#### TRIGger<Ch>[:SEQuence]:MULTiple:SLOPe<Num> <MeasSequence>[, <Slope>]

Qualifies whether the multiple trigger events occur on the rising or on the falling edge or on the beginning of the high / low level periods of the external TTL trigger signal <Num>.

<b>Suffix:</b> <ch></ch>	Channel number
<num></num>	Number of trigger signal (1 or 2)
Parameters: <meassequence></meassequence>	SWEep   SEGMent   POINt   PPOint Triggered measurement sequence, PPOint denotes "partial mea- surement"; see TRIGger <ch>[:SEQuence]:LINK.</ch>
<slope></slope>	POSitive   NEGative   HIGH   LOW Trigger slope for the triggered measurement sequence: POSitive   NEGative - rising or falling edge HIGH   LOW - high or low level
Example:	See TRIGger <ch>[:SEQuence]:MULTiple:SOURce</ch>
Manual control:	See "Source / Slope / Level / Delay" on page 391

User Manual 1173.9163.02 - 13

### TRIGger<Ch>[:SEQuence]:MULTiple:SOURce <Sequence>[, <TrigSource>]

Selects the source of the trigger events that the analyzer uses to start a measurement sequence in multiple trigger mode.

Suffix: <ch></ch>	Channel number
Parameters: <sequence></sequence>	SWEep   SEGMent   POINt   PPOint Triggered measurement sequence, PPOint denotes "partial mea- surement"; see TRIGger <ch>[:SEQuence]:LINK.</ch>
<trigsource></trigsource>	<ul> <li>IMMediate   EXT1   EXT2   E1A2   E1O2   MANual</li> <li>Trigger source for the triggered measurement sequence:</li> <li>IMMediate - free run measurement (untriggered).</li> <li>EXT1, EXT2 - external trigger 1, 2.</li> <li>E1A2, E1O2 - external trigger 1 and 2, 1 or 2.</li> <li>MANual - trigger event generated by pressing the "Manual Trigger" softkey.</li> </ul>
Example:	TRIG:MULT:SOUR SWE, EXT1; SOUR POIN, EXT2 Select external trigger 1 as a trigger source for the entire sweep, external trigger 2 as a trigger source for each point. TRIG:MULT:SLOP1 SWE, POS; SLOP2 POIN, POS Trigger on the rising edges of the external trigger signals 1 and 2. TRIG:MULT:HOLD POIN, 1ms Define a trigger delay of 1 ms before each sweep point.
Manual control:	See "Source / Slope / Level / Delay" on page 391

# TRIGger<Ch>[:SEQuence]:SLOPe <Slope>

Qualifies whether the trigger event occurs on the rising or on the falling edge or on the beginning of the high / low level periods of the external TTL trigger signal.

Suffix: <ch></ch>	Channel number
Parameters: <slope></slope>	POSitive   NEGative   HIGH   LOW Trigger slope for the triggered measurement sequence: POSitive   NEGative - rising or falling edge HIGH   LOW - high or low level
Example:	TRIG: SOUR EXT Activate external signal as trigger source. TRIG: SLOP NEG Trigger on the negative edge of the (external TTL) trigger signal.
Manual control:	See "Slope / Level" on page 389

#### TRIGger<Ch>[:SEQuence]:SOURce <TrigSource>

Selects the source of the trigger events that the analyzer uses to start a measurement sequence.

Suffix: <ch></ch>	Channel number
Parameters: <trigsource></trigsource>	IMMediate   EXTernal   MANual   MULTiple IMMediate - free run measurement (untriggered). EXTernal - trigger by external signal applied to the EXT TRIGGER connector or pin 2 of the USER PORT on the rear panel. MANual - trigger event generated by pressing the "Manual Trig- ger" softkey. MULTiple - multiple trigger mode, configured by the TRIGger <ch>[:SEQuence]:MULTiple commands.</ch>
Example:	TRIG: SOUR MAN Activate manual trigger mode. The analyzer starts the next mea- surement sequence when the "Manual Trigger" button is pressed.
Manual control:	See "Free Run / External / Manual / Multiple Triggers" on page 388

# 6.4 R&S ZVR/ZVAB Compatible Commands

The commands in this chapter are supported for compatibility with analyzers of the R&S ZVR and R&S ZVAB family; they do not introduce any new functionality. For new programs, it is recommended to use the commands in chapter chapter 6.3, "SCPI Command Reference", on page 495.

CALCulate <chn>:LIMit:CONTrol:DOMain</chn>	864
CALCulate <chn>:LIMit:RDOMain:COMPlex</chn>	865
CALCulate <chn>:LIMit:RDOMain:FORMat</chn>	865
CALCulate <chn>:LIMit:RDOMain:SPACing</chn>	866
CALCulate <chn>:LIMit:LOWer:STATe</chn>	866
CALCulate <chn>:LIMit:UPPer:STATe</chn>	866
CALCulate <ch>:PARameter:DEFine</ch>	867
CALCulate <chn>:MARKer<mk>:FUNCtion:BWIDth</mk></chn>	868
CALCulate <chn>:MARKer<mk>:FUNCtion:DELTa:STATe</mk></chn>	869
CALCulate <chn>:MARKer<mk>:FUNCtion:TARGet</mk></chn>	869
CALCulate <chn>:MARKer<mk>:FUNCtion[:SELect]</mk></chn>	869
CALCulate <chn>:MARKer<mk>:MAXimum</mk></chn>	870
CALCulate <chn>:MARKer<mk>:MINimum</mk></chn>	870
CALCulate <chn>:MARKer<mk>:SEARch:LEFT</mk></chn>	871
CALCulate <chn>:MARKer<mk>:SEARch:NEXT</mk></chn>	871
CALCulate <chn>:MARKer<mk>:SEARch:RIGHt</mk></chn>	871
CALCulate <chn>:MARKer<mk>:SEARch[:IMMediate]</mk></chn>	871
CALCulate <chn>:MATH[:EXPRession][:DEFine]</chn>	

DIAGnostic:SERVice:FUNCtion	872
FORMat:DEXPort:SOURce	872
INPut <phypt>:ATTenuation</phypt>	
INSTrument[:SELect]	
OUTPut <chn>:DPORt</chn>	
[SENSe <ch>:]CORRection:CKIT:<conntype>:<standardtype></standardtype></conntype></ch>	
[SENSe:]CORRection:CKIT:INSTall	
[SENSe <ch>:]CORRection:COLLect[:ACQuire]</ch>	
[SENSe <ch>:]CORRection:COLLect:METHod</ch>	
[SENSe <ch>:]CORRection:COLLect:SAVE:DEFault</ch>	
[SENSe <ch>:]CORRection:COLLect:SAVE[:DUMMy]</ch>	
[SENSe <ch>:]CORRection:DATA</ch>	
[SENSe <ch>:]CORRection:OFFSet<phypt>:MAGNitude</phypt></ch>	
[SENSe <ch>:]FREQuency:MODE</ch>	
[SENSe <ch>:]SEGMent<seg>:CLEar</seg></ch>	
[SENSe <ch>:]SEGMent<seg>:OVERlap</seg></ch>	
[SENSe <ch>:]SWEep:SPACing</ch>	
[SENSe <chn>:]FUNCtion[:ON]</chn>	
SOURce <ch>:POWer<phypt>:CORRection:COLLect[:ACQuire]</phypt></ch>	
TRACe:CLEar	
TRACe[:DATA][:RESPonse][:ALL]?	
TRACe[:DATA]:STIMulus[:ALL]?	

# CALCulate<Chn>:LIMit:CONTrol:DOMain <SweepType>

Deletes the existing limit line and (re-)defines the physical units of the stimulus values of the limit line. The units of the response values and the scaling of the y-axis can be defined via CALCulate<Ch>:LIMit:RDOMain:...

# Suffix:

<Chn> Channel number used to identify the active trace.

#### Setting parameters:

ootting paramotoror	
<sweeptype></sweeptype>	FLIN   FLOG   FSEG   FSINgle   TLIN   TLOG   PLIN   PLOG   PSINgle
	Keywords for the units of the stimulus values. The selected unit must be compatible with the sweep type ([SENSe <ch>:</ch>
	] SWEep: TYPE); otherwise the limit line can not be displayed and no limit check is possible.
	The parameters form three groups: FLIN, FLOG, FSEG, and FSINgle select frequency units for the limit line. TLIN and TLOG select time units, PLIN, PLOG and PSINgle select power units.
	*RST: FLIN Default unit: Hz (for FLIN, FLOG, FSEG, FSINGle); s (for TLIN, TLOG), dBm (for PLIN, PLOG, PSINgle).

Example:	SWE:TYPE POW Select a power sweep. CALC:LIM:CONT:DOM PLIN Delete all existing limit line segments and select level units for the limit line of the active trace. CALC:LIM:CONT -20 DBM, -10 DBM Define a limit line segment in the stimulus range between -20 dBm and -10 dBm.
Usage:	Setting only

#### CALCulate<Chn>:LIMit:RDOMain:COMPlex <UnitRef>

Deletes the existing limit line and (re-)defines the physical units of the response values of the limit line. The units of the stimulus values are defined via CALCulate<Chn>: LIMit:CONTrol:DOMain.

**Tip:** This command is complemented by CALCulate<Chn>:LIMit:RDOMain: FORMat and CALCulate<Chn>:LIMit:RDOMain:SPACing.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Setting parameters: <unitref></unitref>	S   SINV   Y   Z   YREL   ZREL
	Keyword for the physical unit of the response values. The parameters form four groups: S and SINV select relative units (dB) for the limit line. Y selects admittance units (S/Siemens). Z selects impedance units ( $\Omega$ ). YREL and ZREL select dimensionless numbers (U).
Usage:	Setting only

#### CALCulate<Chn>:LIMit:RDOMain:FORMat <UnitRef>

Deletes the existing limit line and (re-)defines the physical units of the response values of the limit line. The units of the stimulus values are defined via CALCulate<Chn>: LIMit:CONTrol:DOMain.

**Tip:** This command is complemented by CALCulate<Chn>:LIMit:RDOMain: COMPlex and CALCulate<Chn>:LIMit:RDOMain:SPACing.

Suffix: <Chn>

Channel number used to identify the active trace.

Setting	parameters:
---------	-------------

<unitref></unitref>	COMPlex   MAGNitude   PHASe   REAL   IMAGinary   SWR   GDELay   L   C
	Keyword for the physical unit of the response values. The param- eters form four groups: COMPlex, REAL, IMAGinary, and SWR select dimensionless numbers (U) for the limit line. MAGNitude selects relative units (dB). PHASe selects phase units (deg). GDE- Lay selects time units (s). L selects inductance units (H/Henry). C selects capacitance units (F/Farad).
Usage:	Setting only

### CALCulate<Chn>:LIMit:RDOMain:SPACing <Format>

Deletes the existing limit line and (re-)defines the physical units of the response values of the limit line. The units of the stimulus values are defined via CALCulate<Chn>: LIMit:CONTrol:DOMain.

**Tip:** This command is complemented by CALCulate<Chn>:LIMit:RDOMain: COMPlex and CALCulate<Chn>:LIMit:RDOMain:FORMat.

Suffix: <chn></chn>	Channel number used to identify the active trace.
Setting parameters: < Format>	LINear   LOGarithmic   DB   SIC
	Keyword for the physical unit of the response values. Default unit: dB (irrespective of the parameter selected)
Usage:	Setting only

# CALCulate<Chn>:LIMit:LOWer:STATe <Boolean> CALCulate<Chn>:LIMit:UPPer:STATe <Boolean>

These commands switch the lower and upper limit check on or off. Lower limit line segments are assigned even numbers; upper limit line segments are assigned odd numbers; see CALCulate<Chn>:LIMit:LOWer[:DATA] and CALCulate<Chn>:LIMit: UPPer[:DATA]. CALCulate<Chn>:LIMit:LOWer:STATe does not affect segments with odd numbers; CALCulate<Chn>:LIMit:UPPer:STATe does not affect segments with even numbers.

**Note:** Use CALCulate<Chn>:LIMit:STATe to switch on or off the entire limit check, including upper and lower limit lines.

Suffix: <chn></chn>	Channel number used to identify the active trace.
<b>Parameters:</b> <boolean></boolean>	ON   OFF - switch limit check on or off.
	*RST: OFF

Example:	<ul> <li>CALC:LIM:LOW -10, 0, 0, -10</li> <li>Define two limit line segments covering the entire sweep range.</li> <li>Two upper limit line segments with default response values are created in addition.</li> <li>CALC:LIM:UPP 0, 5, 5, 0</li> <li>Change the response values of the upper limit line segments.</li> <li>CALC:LIM:LOW:STAT ON; :CALC:LIM:UPP:STAT ON; : CALC:LIM:FAIL?</li> <li>Switch the limit check on and query the result.</li> </ul>
Manual control:	See "Limit Check" on page 225

CALCulate<Ch>:PARameter:DEFine <TraceName>, <Result>[, <TestPortNum>]

Creates a trace and assigns a channel number, a name and a measurement parameter to it. The trace is not displayed. To display a trace defined via CALCulate<Ch>: PARameter: DEFine, a window must be created (DISPlay[: WINDow<Wnd>]:STATEON) and the trace must be assigned to this window ( DISPlay[:WINDow<Wnd>]:TRACe<WndTr>:FEED); see example below.

Traces must be selected to become active traces; see CALCulate<Ch>: PARameter:SELect.

**Note:** The parameter names in this command differ from R&S ZNB conventions; moreover the parameter list is not complete. The alternative command CALCulate<Ch>: PARameter:SDEFine uses a complete parameter list with compatible names.

#### Suffix:

<Ch>

Channel number.  $<\!\!\mathrm{Ch}\!\!>$  may be used to reference a previously defined channel. If  $<\!\!\mathrm{Ch}\!\!>$  does not exist, it is generated with default channel settings.

# Setting parameters:

<tracename></tracename>	Trace name, e.g. 'Trc4'. See "Rules for trace names" in "Trace Manager Table" on page 194.	
<result></result>	S11   S12   S13   S14   S21   S22   S23   S24   S31   S32   S33           S34   S41   S42   S43   S44   A   B   C   D   R1   R2   R3   R4   AB           AC   AD   BA   BC   BD   CA   CB   CD   DA   DB   DC   AR1   AR2           AR3   AR4   BR1   BR2   BR3   BR4   CR1   CR2   CR3   CR4           DR1   DR2   DR3   DR4   R1A   R1B   R1C   R1D   R2A   R2B           R2C   R2D   R3A   R3B   R3C   R3D   R4A   R4B   R4C   R4D           R1R2   R1R3   R1R4   R2R1   R2R3   R2R4   R3R1   R3R2   R3R4           R4R1   R4R2   R4R3         Measurement parameter; see list of parameters below.	
<testportnum></testportnum>	Test port number, drive port for wave quantities and ratios, ignored for S-parameters.	
	Range: 1 to 4 (depending on instrument model)	

 Example:
 CALC4:PAR:DEF 'Ch4Tr1', S11

 Create channel 4 and a trace named Ch4Tr1 to measure the input reflection coefficient S11.

 DISP:WIND:STAT ON

 Create diagram area no. 1.

 DISP:WIND:TRAC2:FEED 'CH4TR1'

 Display the generated trace in diagram area no. 1, assigning a trace number 2.

 Usage:
 Setting only

The measurement parameter is selected by means of the following keywords (the selection depends on the number of test ports of the analyzer, e.g. S44 is not available on 2-port analyzers):

S11   S12   S13   S14   S21   S22   S23   S24   S31   S32   S33   S34   S41   S42   S43   S44	S-parameters
A B C D	Wave quantities $b_1$ , $b_2$ , $b_3$ , $b_4$ (received waves)
R1   R2   R3   R4	Wave quantities $a_1$ , $a_2$ , $a_3$ , $a_4$ (reference waves)
AB   AC   AD   BA   BC   BD   CA   CB   CD   DA   dB   DC	Ratio of wave quantities $b_1/b_2$ , $b_1/b_3$ , , $b_4/b_3$ (received waves only)
AR1   AR2   AR3   AR4   BR1   BR2   BR3   BR4   CR1   CR2   CR3   CR4   DR1   DR2   DR3   DR4   R1A   R1B   R1C   R1D   R2A   R2B   R2C   R2D   R3A   R3B   R3C   R3D   R4A   R4B   R4C   R4D	Ratio of wave quantities $b_1/a_1$ , $b_1/a_2$ ,, $b_4/a_4$ , $a_1/b_1$ , $a_1/b_2$ ,, $A_4/B_4$ (received waves to reference waves or reference waves to received waves)
R1R2   R1R3   R1R4   R2R1   R2R3   R2R4   R3R1   R3R2   R3R4   R4R1   R4R2   R4R3	Ratio of wave quantities $a_1/a_2$ , $a_1/a_3$ , , $a_4/a_3$ (reference waves only)

#### CALCulate<Chn>:MARKer<Mk>:FUNCtion:BWIDth <Bandwidth>

Defines the bandfilter level, i.e. the minimum excursion for the bandpass and bandstop peaks.

**Tip:** Use CALCulate<Chn>:MARKer<Mk>:BWIDth to set the bandwidth and query the results of a bandfilter search. Note the sign convention for input values.

Suffix: <chn></chn>	Channel number used to identify the active trace.	
<mk></mk>	Marker number in the range 1 to 10. This numeric suffix is ignored and may be set to any value because the bandfilter search func- tions always use markers M1 to M4.	
Parameters:		
<bandwidth></bandwidth>	Range:-100 dB to 100 dBIncrement:0.03 dB*RST:3 dBDefault unit:dB	
Example:	See CALCulate <chn>:MARKer<mk>:BWIDth</mk></chn>	

User Manual 1173.9163.02 - 13

#### CALCulate<Chn>:MARKer<Mk>:FUNCtion:DELTa:STATe <Boolean>

Switches the delta mode for marker <Mk> on trace no. <Chn> on or off.

**Note:** This command is the ZVR-compatible equivalent of CALCulate<Chn>: MARKer<Mk>:DELTa[:STATe].

Suffix: <chn></chn>	Channel number used to identify the active trace.		
<mk></mk>	Marker number in the range 1 to 10.		
<b>Parameters:</b> <boolean></boolean>	ON   OFF - enable or disable the delta mode. *RST: OFF		

#### CALCulate<Chn>:MARKer<Mk>:FUNCtion:TARGet <SearchValue>

Defines the target value for the target search of marker no. <Mk>, which can be activated using CALCulate<Chn>:MARKer<Mk>:FUNCtion:EXECute TARGet.

**Note:** This command is the ZVR-compatible equivalent of CALCulate<Chn>: MARKer<Mk>: TARGet.

Suffix: <chn></chn>	Channel number used to identify the active trace.	
<mk></mk>	Marker number in the range 1 to 10.	
Parameters: <searchvalue></searchvalue>	Target searce Range: Increment: *RST: Default unit:	ch value of marker no. <mk>. Depending on the format of the active trace. For a dB Mag trace the range is -200 dB to +200 dB. 0.1 dB Depending on the trace format; 0 dB for a dB Mag trace. dB</mk>

#### CALCulate<Chn>:MARKer<Mk>:FUNCtion[:SELect] <Mode>

Selects a search mode for marker no. <Mk>, which can then be initiated using one of the CALCulate<Ch>:MARKer<Mk>:SEARch..., CALCulate<Ch>:MARKer<Mk>:MAXimum Or CALCulate<Ch>:MARKer<Mk>:MINimum functions. The marker must be created before using CALCulate<Chn>:MARKer<Mk>[:STATe] ON.

Note: This command is not needed except for compatibility with ZVR programs. Use CALCulate<Chn>:MARKer<Mk>: FUNCtion:EXECute to select a search mode and at the same time initiate the search. The CALCulate<Ch>:MARKer<Mk>:SEARch..., CALCulate<Ch>:MARKer<Mk>:MAXimum or

CALCulate<Ch>:MARKer<Mk>:MINimum functions also select the search mode.

Suffix: <chn></chn>	Channel number used to identify the active trace.	
<mk></mk>	Marker number in the range 1 to 10. For a bandfilter search (BFILter) this numeric suffix is ignored and may be set to any value because the bandfilter search functions always use markers M1 to M4.	
Parameters:		
<mode></mode>	MAXimum   MINimum   RPEak   LPEak   NPEak   TARGet   LTARget   RTARget   BFILter	
	See list of parameters below.	

The analyzer provides the following search modes:

Mode	Selected search mode	
MAXimum	Absolute maximum in the search range (see CALCulate <chn>:MARKer<mk>: FUNCtion:DOMain:USER)</mk></chn>	
MINimum	Absolute maximum in the search range	
RPEak	Next valid peak to the right of the current marker position	
LPEak	Next valid peak to the left	
NPEak	Next highest value among the valid peaks	
TARGet	Target value (see CALCulate <chn>:MARKer<mk>:TARGet)</mk></chn>	
RTARget	Next target value to the right of the current marker position	
LTARget	Next target value to the left	
BFILter	Bandfilter search. The results are queried using CALCulate <chn>:MARKer<mk>: BWIDth?</mk></chn>	

### CALCulate<Chn>:MARKer<Mk>:MAXimum CALCulate<Chn>:MARKer<Mk>:MINimum

These commands select a search mode for marker no. <Mk> and initiate a maximum and minimum search, respectively. The marker must be created before using CALCulate<Chn>:MARKer<Mk>[:STATe]ON.

**Note:** This commands are the ZVR-compatible equivalent of CALCulate<Chn>: MARKer<Mk>:FUNCtion:EXECuteMINimum | MAXimum.

#### Suffix:

<chn></chn>	Channel number used to identify the active trace
<mk></mk>	Marker number in the range 1 to 10.
Usage:	Event

# CALCulate<Chn>:MARKer<Mk>:SEARch:LEFT CALCulate<Chn>:MARKer<Mk>:SEARch:NEXT CALCulate<Chn>:MARKer<Mk>:SEARch:RIGHt

These commands selects a search mode for marker no. <Mk> and initiate a search for the next valid peak to the left, the next highest or lowest value among the valid peaks, and the next valid peak to the right. The marker must be created before using CALCulate<Chn>:MARKer<Mk>[:STATe]ON.

**Note:** These commands are the ZVR-compatible equivalents of CALCulate<Chn>: MARKer<Mk>:FUNCtion:EXECuteLPEak | NPEak | RPEak.

Suffix: <chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10.
Usage:	Event

#### CALCulate<Chn>:MARKer<Mk>:SEARch[:IMMediate]

Initiates a search according to the search function selected with CALCulate<Chn>:
MARKer<Mk>:FUNCtion[:SELect]. The marker must be created before using
CALCulate<Chn>:MARKer<Mk>[:STATe]ON.

Note: Together with CALCulate<Chn>:MARKer<Mk>:FUNCtion[:SELect] this command is the ZVR-compatible equivalent of CALCulate<Chn>:MARKer<Mk>: FUNCtion:EXECute.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.
<mk></mk>	Marker number in the range 1 to 10. For a bandfilter search (BFILter) this numeric suffix is ignored and may be set to any value because the bandfilter search functions always use markers M1 to M4.
Usage:	Event

#### CALCulate<Chn>:MATH[:EXPRession][:DEFine] <Expression>

Defines a simple mathematical relation between traces. To calculate and display the new mathematical trace, the mathematical mode must be switched on (CALCulate<Chn>: MARKer<Mk>[:STATe] ON).

**Note:** This command places some restrictions on the mathematical expression and the operands. Use CALCulate<Chn>:MATH[:EXPRession]:SDEFine to define general expressions.

Suffix: <Chn>

Channel number used to identify the active trace.

<b>Parameters:</b> <expression></expression>	<list></list>
	<pre>(<operand1><operator1><operand2>[<operator2> <operand3>]) The expression must be enclosed in brackets. Operands: See list of trace names in chapter 6.3.18, "TRACe Commands", on page 854. Operators: +, -, *, /</operand3></operator2></operand2></operator1></operand1></pre>
Example:	<ul> <li>*RST; CALC:MATH:MEM</li> <li>Copy the current state of the default trace Trc1 to a memory trace named "Mem2[Trc1]". The memory trace is not displayed.</li> <li>CALC:MATH (CH1DATA / MDATA2)</li> <li>Define a mathematical trace, dividing the data trace by the stored memory trace. The mathematical trace is not displayed CALC:MATH:STAT ON</li> <li>Display the mathematical trace instead of the active data trace.</li> </ul>

DIAGnostic:SERVice:FUNCtion <SFId1>, <SFId2>...

Activates a service function (mainly for internal use). Service functions are identified by groups of numbers, separated by dots.

#### Parameters:

<SFId1>

Manual control:	See "Password" on page 429
	SFUNction.
	allowed at maximum. See also DIAGnostic:SERVice:
<sfid2></sfid2>	Service function identifier entered as a (pseudo-)numeric value, the dots being replaced by commas. Five groups of numbers are

#### FORMat:DEXPort:SOURce <Format>

Defines the format for traces retrieved with the R&S ZVR-compatible command TRACe [:DATA] [:RESPONSE] [:ALL]?.

This command is not relevant for results read with the <code>CALCulate<Chn>:DATA...</code> commands.

#### **Parameters:**

<format></format>	FDATa   S	FDATa   SDATa   MDATa See list of parameters below. The unit is the default unit of the measured parameter; see CALCulate <ch>: PARameter:</ch>		
	SDEFine			
	Range: *RST:	Depending on the measured parameter and format. SDATa		
Example:	See TRAC	See TRACe[:DATA][:RESPonse][:ALL]?		

The following parameters are related to trace data:

FDATa	Formatted trace data, according to the selected trace format (CALCulate <chn>: FORMat). 1 value per trace point for Cartesian diagrams, 2 values for polar diagrams.</chn>
SDATa	Unformatted trace data: Real and imaginary part of each measurement point. 2 values per trace point irrespective of the selected trace format. The trace mathematics is not taken into account.
MDATa	Unformatted trace data (see SDATa) after evaluation of the trace mathematics.

#### INPut<PhyPt>:ATTenuation < Attenuation>

Sets the attenuation for the received waves.

**Note:**INPut<PhyPt>:ATTenuation is not channel-specific; the value is valid for all channels. Use [SENSe<Ch>:]POWer:ATTenuation to set or query a channel-specific attenuation value.

# Suffix:

<phypt></phypt>	Test port number of the analyzer, 1 to 2, 3 or 4, depending on the analyzer model. If unspecified the numeric suffix is set to 1.	
Parameters:		
<attenuation></attenuation>	Attenuation factor for the received wave.	
	Range: *RST: Default uni	0 dB, 10 dB, 20 dB, 30 dB. UP and DOWN increment/ decrement the attenuation in 10 dB steps. The ana- lyzer rounds any entered value below the maximum attenuation to the closest step. 0 dB t: dB
Example:	<pre>INP2:ATT 10 Set the step attenuator for the wave received at port 2 and for all channels to 10 dB. The waves at the other test ports are not affec- ted. SENS1:POW:ATT? BREC Query the receiver step attenuator setting at port 2 and for channel no. 1. The response is 10.</pre>	

## INSTrument[:SELect] <Channel>

Selects a channel <Ch> as active channel. To select a channel number > 4 use the generalized command INSTrument:NSELect.

Parameters:			
<channel></channel>	CHANnel1   CHANnel2   CHANnel3   CHANnel4		
	Number of the channel to be activated. The channel must be created before using CONFigure:CHANnel <ch>[:STATe] ON.</ch>		
	Range: *RST:	CHANNEL1, CHANNEL2, CHANNEL3, CHANNEL4 CHANNEL1	
Example:	CONF: CHAN2: STAT ON; : INST CHANNEL2 Create channel no. 2 and select it as the active channel.		

#### OUTPut<Chn>:DPORt <Port>

Selects a source port for the stimulus signal (drive port). The setting acts on the active trace. The effect of the drive port selection depends on the measurement parameter associated to the active trace:

- If an S-parameter S<sub><out><in></sub> is measured, the second port number index <in> (input port of the DUT = drive port of the analyzer) is set equal to the selected drive port: Drive port selection affects the measured quantity.
- If a wave quantity or a ratio is measured, the drive port is independent from the measured quantity:

Note: This command is equivalent to [SENSe<Chn>:]SWEep:SRCPort.

<b>Suffix:</b> <chn></chn>	Channel number used to identify the active trace.
Parameters: <port></port>	PORT1   PORT2   PORT3   PORT4 Test port number of the analyzer, 1 to 2, 3 or 4, depending on the analyzer model. *RST: PORT1
Example:	CALC4: PAR: SDEF 'Ch4Tr1', 'A1' Create channel 4 and a trace named "Ch4Tr1" to measure the wave quantity a <sub>1</sub> . The trace automatically becomes the active trace. OUTP4: DPOR PORT2 Select drive port 2 for the active trace.

[SENSe<Ch>:]CORRection:CKIT:<ConnType>:<StandardType> <CalkitName>, <Standard>, <MinFreq>, <MaxFreq>, <ElLength>, <Loss>, <C0>, <L0>, <C1>, <L1>, <C2>, <L2>, <C3>, <L3>, OPEN | SHORt

Defines the parameters of a calibration standard <StandardType> for a specified connector type <ConnType>. A particular physical standard can be selected by specifying the name of the calibration kit and its serial number. Depending on the standard type, only a subset of the parameters may be used; see Standard types and their parameters .

**Note:** If the specified cal kit does not exist, it is created with the specified calibration standard.

# Suffix:

<Ch>

Channel number. This suffix is ignored because calibration kits are channel-independent.

# **Parameters:** <ConnType> Connector type, one of the following identifiers: N50, N75: N 50 $\Omega$ or N 75 $\Omega$ connectors PC7, PC35, PC292: PC 7, PC 3.5 or 2.92 mm connectors USER<no>: User-defined connectors UserConn1, UserConn2 SMA: User-defined connector type SMA ... **Note:** This command only supports ZVR-compatible connector types. For general definitions use [SENSe:]CORRection: CKIT:<StandardType>. <StandardType> Standard type. For reflection standards, the first character denotes the gender, e.g.: FOPEN, MOPEN: Open (f) or Open (m) standard. For transmission standards, the first two characters denotes the genders on both ends, e.g.: FFSNetwork, MFSNetwork, MMSNetwork: Symm. network (ff), symm. network (mf) or symm. network (mm) standard. For a complete list of standard types refer to Standard types and their parameters . Parameter list String parameters to specify the configured standard (<CalkitName>, <Standard>) and numeric parameters defining its properties. See Parameter list. \*RST: n/a Example: CORR:CKIT:N50:FOPEN 'ZV-Z21','', 0,1.8E+010,0.0151,0,0,0.22,-0.22,0.0022 Define the properties of the open (f) standard for the N 50 $\Omega$ connector type contained in the ZV-Z21 calibration kit: Assign a valid frequency range of 0 Hz to 18 GHz, an electrical length of 15.1 mm, 0 dB loss and define the polynomial coefficients of the fringing capacitance as 0 fF, 0.22 fF/GHz, -0.22 fF/(GHz)<sup>2</sup>, 0.0022 fF/ (GHz)<sup>3</sup>.

#### [SENSe:]CORRection:CKIT:INSTall <CalKitFile>

Loads cal kit data from a specified R&S ZVR cal kit file.

#### Setting parameters:

String parameter to specify the name and directory of the cal kit
file to be loaded.
Note: The loaded file must be a R&S ZVR-specific cal kit file with
the extension *.ck. VNA cal kit files (*.calkit) can be imported
using the MMEMory: LOAD: CKIT command. Agilent cal kit files
can be imported manually and converted into *.calkit files.

Example:	CORR:CKIT:INST 'C:\Users\Public\Documents \Rohde-Schwarz\Vna\Calibration\Kits\ZCAN.ck' Load the previously created R&S ZVR cal kit file ZCAN.ck from the default cal kit directory. MMEM:STOR:CKIT 'ZCAN', 'C: \Users\Public\Documents \Rohde-Schwarz\Vna\Calibration\Kits\ZCAN.calkit' Store the imported cal kit data to a VNA cal kit file ZCAN.calkit (assuming that the cal kit name stored in ZCAN.ck reads "ZCAN").
Usage:	Setting only

# [SENSe<Ch>:]CORRection:COLLect[:ACQuire] <Standard>[, <Dispersion>, <Delay>]

Starts a calibration measurement in order to acquire measurement data for the selected standards. The standards are reflection or transmission standards and must be connected to port 1 or 2 of the analyzer.

**Tip:** Use the generalized command [SENSe<Ch>:]CORRection:COLLect[: ACQuire]:SELected to obtain measurement data at arbitrary analyzer ports.

# Suffix:

<Ch>

Channel number of the calibrated channel.

# Setting parameters:

<standard></standard>	THRough   OPEN1   OPEN2   OPEN12   SHORt1   SHORt2   SHORt12   MATCh1   MATCh2   MATCh12   NET   ATT   IMATch12   REFL1   REFL2   SLIDe1   SLIDe2   SLIDe12   LINe1   LINe2   LINe3   M1O2   O1M2   OSHort1   OSHort11   OSHort12   OSHort13   OSHort2   OSHort21   OSHort22   OSHort23   M1S2   S1M2   UTHRough
	Standard types: Through (between port 1 and 2), Open, Short, Match (MATCh12 and IMATch12 are synonymous), Symmetric Network (NET), Attenuation (ATT), Reflect, Sliding Match (SLIDe), Line1 (LINe1 and LINE are synonymous), Line2 and Line3 (esp. for TRL calibration), Match/Open (M1O2, O1M2), Match/Short (M1S2, S1M2), Offset Short (OSHort), Unknown Through (UTHRough), ISOLation (optional, between port 1 and 2). The numbers in the parameter names denote the analyzer ports. Two numbers 12 mean that two separate calibrations are per- formed at ports 1 and 2. For Offset Short standards, the first num- ber denotes the port (1 or 2), the second number denotes the number of the standard (1 to 3).
	*RST: ON
<dispersion></dispersion>	Optional status parameter for UTHRough standard: OFF - unknown through standard is non-dispersive. ON - unknown through standard is dispersive. *RST: OFF

<delay></delay>	Optional entry of delay time or phase for UTHRough standard: <numeric> - entry of the delay time in ps (for non-dispersive stand- ards) or of an estimate of the phase at the start frequency of the sweep in deg (for dispersive standards). See also background information for [SENSe<ch>:]CORRection:COLLect[:</ch></numeric>
	ACQuire]:SELected. AUTO - the analyzer determines the delay time or phase during the calibration sweep. *RST: AUTO
Example:	See [SENSe <ch>:]CORRection:COLLect:SAVE[:DUMMy]</ch>
Usage:	Setting only

#### [SENSe<Ch>:]CORRection:COLLect:METHod <CalType>

Selects a one-port or two-port calibration type for channel <Ch> at ports 1/2.

**Tip:** Use the generalized command [SENSe<Ch>:]CORRection:COLLect: METHod:DEFine to select the calibration type for arbitrary analyzer ports or a multiport calibration type.

Suffix: <ch></ch>	Channel number of the calibrated channel.
Parameters: <caltype></caltype>	FRTRans   FTRans   RTRans   TOM   TSM   TRM   TRL   TNA   TOSM   ETOM   ETSM   FOPort1   FOPort2   FOPort12   FOPTport   ROPTport   REFL1   REFL2   REFL12   TPORt   UOSM
	Calibration types, TOM, TRM, TRL, TNA, TOSM, Full One Port, One Path Two Port, Normalization (REFL1, REFL2 and REFL12 for one-port, FRTRans, FTRans, RTRans, and TPORT for two- port), TOSM with unknown through. The numbers in the parameters denote the analyzer ports. Param- eters for two-port calibration types contain no numbers because the command is only valid for ports 1 and 2.
Example:	See [SENSe <ch>:]CORRection:COLLect:SAVE[:DUMMy]</ch>

#### [SENSe<Ch>:]CORRection:COLLect:SAVE:DEFault

Generates a set of default system error correction data for the selected ports and calibration type. The default data set corresponds to a test setup which does not introduce any systematic errors; none of the measurement results acquired previously ( [SENSe<Ch>:]CORRection:COLLect[:ACQuire]) is taken into account.

**Tip:** The main purpose of the default correction data set is to provide a dummy system error correction which you can replace with your own, external correction data. You may have acquired the external data in a previous session or even on an other instrument. If you want to use the external correction data on the analyzer, simply generate the default data set corresponding to your port configuration and calibration type and overwrite the default data. For details refer to the program example below.

Note: This command must be used in combination with the R&S ZVR-compatible commands [SENSe<Ch>:]CORRection:COLLect:METHod and [SENSe<Ch>: ]CORRection:DATA. Use [SENSe<Ch>:]CORRection:COLLect:SAVE: SELected:DEFault if you want to use R&S ZNB-specific calibration commands or if you want to calibrate more than 2 ports.

# Suffix:

Channel number of the calibrated channel <Ch> Example: CORR:COLL:METH REFL1 Select a one-port normalization at port 1 with an open standard as calibration type. CORR:COLL:SAVE:DEF Calculate a dummy system error correction for the normalization at port 1. The dummy system error correction provides the reflection tracking error term SCORR3. INIT:CONT OFF; :INIT; \*WAI Stop the sweep to ensure correct transfer of calibration data. CORR:DATA? 'SCORR3' Query the dummy system error correction term. The response is a 1 (written as 1, 0 for the real and imaginary part) for each sweep point (no attenuation and no phase shift between the analyzer and the calibration plane). CORR:DATA 'SCORR3', <ASCII data> Replace the dummy system error correction term with your own correction data. transferred in ASCII format. INIT:CONT ON Restart the sweep in continuous mode. Usage: Event

#### [SENSe<Ch>:]CORRection:COLLect:SAVE[:DUMMy]

Calculates the system error correction data from the acquired one or two-port measurement results ([SENSe<Ch>:]CORRection:COLLect[:ACQuire]), stores them and applies them to the calibrated channel <Ch>. To avoid incompatibilities, older system error correction data is deleted unless it has been transferred into a cal pool ( MMEMory:STORe:CORRection).

This command is the R&S ZVR-compatible equivalent of [SENSe<Ch>:]CORRection:COLLect:SAVE:SELected[:DUMMy]. It must be used in combination with the R&S ZVR-compatible commands for calibration method and standard selection; see example below.

Suffix: <ch></ch>	Channel number of the calibrated channel.
Example:	CORR:COLL:METH REFL1 Select a one-port normalization at port 1 as calibration type. CORR:COLL OPEN1 Measure an open standard connected to port 1 and store the measurement results of this standard. CORR:COLL:SAVE
	Calculate the system error correction data and apply it to the active channel.
Usage:	Event

[SENSe<Ch>:]CORRection:DATA <ErrorTerm>, <Parameter>...

Writes or reads system error correction data for a specific channel <Ch> and calibration method ([SENSe<Ch>:]CORRection:COLLect:METHod). The analyzer test ports 1 or 2 are implicitly specified with the correction terms. The setting command can be used to transfer user-defined correction data to the analyzer; the query returns the current correction data set. ASCII or block data can be transferred, depending on the selected data transfer format (FORMat[:DATA])

The sweep must be stopped to transfer calibration data; see program example for [SENSe<Ch>:]CORRection:COLLect:SAVE:DEFault.

**Note:** This command affects the active calibration of channel no. <Ch> or the factory calibration (if no channel calibration is active). For the factory calibration, the query form is allowed only (no change of factory calibration data).

**Tip:** Use the generalized command [SENSe<Ch>:]CORRection:CDATa to transfer calibration data for arbitrary analyzer ports. The analyzer provides a default calibration corresponding to a test setup which does not introduce any systematic errors; see [SENSe<Ch>:]CORRection:COLLect:SAVE:DEFault.

#### G and H matrices

The 7-term calibration types named Txx (e.g. TOM, TSM, TRM, TRL, TNA) are based on a network analyzer with two ports i and j, each equipped with a test receiver and a reference receiver. The system errors are described in terms of two "error two-ports"  $P_G$  and  $P_H$ :

The error two-port P<sub>G</sub> is assigned to port i of the analyzer. Its transmission matrix G describes how the system errors modify the outgoing and incident waves at port i:

[b <sub>i</sub> ]	_	<b>G</b> <sub>11</sub>	<b>G</b> <sub>12</sub>	*	m <sub>iref</sub>
_a,		<b>G</b> <sub>21</sub>	$\mathbf{G}_{22}$		_m <sub>i test</sub> _

The error two-port P<sub>H</sub> is assigned to port j of the analyzer. Its transmission matrix H describes how the system errors modify the measured incident and outgoing waves at port j:

$$\begin{bmatrix} \mathbf{a}_{j} \\ \mathbf{b}_{j} \end{bmatrix} = \begin{bmatrix} \mathbf{H}_{11} & \mathbf{H}_{12} \\ \mathbf{H}_{21} & \mathbf{H}_{22} \end{bmatrix} * \begin{bmatrix} \mathbf{m}_{j \text{ test}} \\ \mathbf{m}_{j \text{ ref}} \end{bmatrix}$$

In the two equations above, a and b denote the waves at the calibrated reference plane i and j (e.g. the input and output of the 2-port DUT). The m waves are the raw measured waves of test port i and j. The subscripts "ref" and "test" refer to the reference and test receivers, respectively. During the calibration the network analyzer acquires ratios of wave quantities, which leaves one of non-diagonal matrix elements of G or H as a free normalization factor. The network analyzer uses the normalization  $H_{21} = 1$ .

#### Suffix:

<Ch>

Channel number of the calibrated channel

#### Parameters:

Farameters.	
<errorterm></errorterm>	String parameters describing the different error terms, depending on the current calibration method; see table below. Each term contains one complex value (real and imaginary part) for each sweep point. The parameters must be transferred in full length. The following strings are allowed: 'SCORR1' - directivity at port 1 'SCORR2' - source match at port 1 'SCORR3' - reflection tracking at port 1 'SCORR4' - reserved for future extensions 'SCORR5' - load match at port 2 'SCORR6' - forward transmission tracking between port 1 and port 2 'SCORR7' - directivity at port 2 'SCORR8' - source match at port 2 'SCORR8' - source match at port 2 'SCORR8' - reflection tracking at port 2 'SCORR9' - reflection tracking at port 2 'SCORR9' - reflection tracking at port 2 'SCORR10' - reserved for future extensions 'SCORR11' - load match at port 1 'SCORR12' - reverse transmission tracking between port 2 and port 1 'G11' 'G22' - G matrix elements; see above 'H22' - H matrix elements; see above The error terms are dimensionless complex numbers. *RST: n/a
<parameter></parameter>	not used
Example:	See [SENSe <ch>:]CORRection:COLLect:SAVE:DEFault</ch>

The different calibration types of the analyzer provide the following error terms:

Calibration type	Parameter in [SENSe <ch>:]CORRec- tion:COLLect:METHod</ch>	Available error terms (depending on port numbers)
One-port normalization	REFL1	'SCORR3'
(reflection) using an open standard	REFL2	'SCORR9'
	REFL12	'SCORR3' and 'SCORR9'
Full one port	FOPort1	'SCORR1' to 'SCORR3'
	FOPort2	'SCORR7' to 'SCORR9'
	FOPort12	'SCORR1' to 'SCORR3' and 'SCORR7' to 'SCORR9'
Two-port normalization	FTRans	'SCORR6'
	RTRans	'SCORR12'
	FRTRans	'SCORR6' and 'SCORR12'
One path two port	FOPTport	'SCORR1' to 'SCORR3', 'SCORR6'
	ROPTport	'SCORR7' to 'SCORR9', 'SCORR12'
TOSM	TOSM	'SCORR1' to 'SCORR12'
		(at present the isolation terms 'SCORR4' and 'SCORR10' are not included)
TOM, TSM, TRM, TRL, TNA	TOM   TRM   TRL   TNA	'DIRECTIVITY', 'SRCMATCH', 'REFLTRACK', 'LOADMATCH', 'TRANSTRACK' (for reading and writing)
		'G11''G22' and 'H11', 'H12', 'H22' (for reading only; the 'H21' matrix elements are normalized to 1)

## [SENSe<Ch>:]CORRection:OFFSet<PhyPt>:MAGNitude <OffsetLoss>

Defines the frequency-independent part (DC value) of the offset loss.

**Tip:** Use the [SENSe<Ch>:]CORRection:LOSS<PhyPt>... commands to define the complete set of loss offset parameters.

[SENSe<Ch>:]CORRection:OFFSet<PhyPt>:MAGNitude is equivalent to
[SENSe<Ch>:]CORRection:LOSS<PhyPt>:OFFSet.

#### Suffix:

<ch></ch>	Channel number of the offset-corrected channel
<phypt></phypt>	Port number of the analyzer
Parameters:	
<offsetloss></offsetloss>	Frequency-independent part of the offset loss

Range:-200 dB to +200 dBIncrement:0.0001 dB\*RST:0 dBDefault unit:dB

### [SENSe<Ch>:]FREQuency:MODE <FreqSweep>

Selects the sweep type and defines which set of commands controls the stimulus frequency.

**Tip:** The command [SENSe<Ch>:]SWEep:TYPE provides a complete list of sweep types.

Suffix: <ch></ch>	Channel number
<b>Parameters:</b> <freqsweep></freqsweep>	CW   FIXed   SWEep   SEGMent Linear or logarithmic frequency sweep, depending on the selected spacing ([SENSe <ch>:]SWEep:SPACing LINear   LOGarithmic). The frequency range is set via [SENSe<ch>: ]FREQuency:STARt etc.</ch></ch>
Example:	FREQ:MODE CW Activate a time sweep. FREQ:CW 100MHz Set the CW frequency to 100 MHz.

#### [SENSe<Ch>:]SEGMent<Seg>:CLEar

Deletes all sweep segments in the channel. The command is equivalent to [SENSe<Ch>:]SEGMent<Seg>:DELete:ALL.

Suffix: <ch></ch>	Channel number
<seg></seg>	Sweep segment number. This suffix is ignored; the command deletes all segments.
Usage:	Event

#### [SENSe<Ch>:]SEGMent<Seg>:OVERlap <Boolean>

Queries whether the analyzer supports overlapping sweep segments.

Suffix: <ch></ch>	Channel nur ment-specifi	mber. This suffix is ignored; the command is instru-
<seg></seg>	Sweep segr instrument-s	nent number. This suffix is ignored; the command is specific.
<b>Parameters:</b> <boolean></boolean>	ON   OFF: N	lo effect.
	*RST:	ON. If used as a query, the command returns the information that overlapping sweep segments are supported (ON).

#### [SENSe<Ch>:]SWEep:SPACing <StimulusFreq>

Defines the frequency vs. time characteristics of a frequency sweep ("Lin Frequency" or "Log Frequency"). The command has no effect on segmented frequency, power or time sweeps.

**Note:** Use [SENSe<Ch>:] SWEep:TYPE to select sweep types other than "Lin Frequency" or "Log Frequency".

# Suffix: <Ch>

Channel number

# Parameters:

<pre>StimulusFreq&gt;</pre>	LINear   LOGarithmic The stimulus frequency is swept in equidistant steps over the fre- quency range. In a Cartesian diagram, the x-axis is a linear fre- quency axis.
Example:	FUNC "XFR: POW: S12" Activate a frequency sweep and select the S-parameter $S_{12}$ as measured parameter for channel and trace no. 1. SWE: SPAC LOG Change to sweep type "Log Frequency".

# [SENSe<Chn>:]FUNCtion[:ON] <SweepType>

Defines the sweep type and the measurement parameter in a single string.

**Note:** To select a measurement parameter without changing the sweep type, use CALCulate<Ch>: PARameter:MEASure. Use the other commands in the CALCulate<Ch>: PARameter... subsystem to create or delete traces and select measurement parameters.

#### Suffix:

Channel number used to identify the active trace. If [SENSe <chn>:]FUNCtion[:ON] is not used as a query, the number must be 1.</chn>
<pre>Single string parameter defining the sweep type and the parame- ter to be measured:</pre>
Range:See list of strings below.*RST:"XFR:S21"
CALC4: PAR: SDEF "Ch4Tr1", "S11" Create channel 4 and a trace named "Ch4Tr1" to measure the input reflection coefficient S <sub>11</sub> . The trace automatically becomes the active trace. SENS4: FUNC? Check (query) the sweep type and measurement parameter of the active trace. The result is 'XFR: POW: S11'.

User Manual 1173.9163.02 - 13

The following keywords define the sweep type (see SCPI command reference: presentation layer):

XFRequency	Frequency sweep (Lin. Frequency/Log. Frequency/ Segmented Frequency)
XPOWer	Power sweep
XTIMe	Time sweep
XCW?	CW Mode sweep (output variable for query only)

The following keywords define the measurement parameter (see SCPI command reference: function name):

POWer:S <ptout><ptin></ptin></ptout>	S-parameter with output and input port number of the DUT, e.g. S11, $S_{21}$ .
POWer:RATio A <ptout>   B<ptin>, A<ptout>   B<ptin></ptin></ptout></ptin></ptout>	Ratio, e.g. B2, A1 for $b_2/a_1$ drive Port 1
Output: A <ptout>/B<ptin></ptin></ptout>	
POWer:A <ptout></ptout>	Wave quantity with stimulus port number of the analyzer, e.g. a <sub>1</sub> .
POWer:B <ptin></ptin>	Wave quantity with receive port number of the ana- lyzer, e.g. b <sub>2</sub> .
POWer:Z <ptout><ptin></ptin></ptout>	Matched-circuit impedance (converted Z-parameter) with output and input port number of the DUT, e.g. $Z_{11}, Z_{21}$ .
POWer:Y <ptout><ptin></ptin></ptout>	Matched-circuit admittance (converted Y-parameter) with output and input port number of the DUT, e.g. $Y_{11}, Y_{21}$ .
POWer:KFACtor	Stability factor K
POWer:MUFactor <lev></lev>	Stability factors $\mu_1$ or $\mu_2$

Note: The mnemonics POWer: and VOLTage: are not used in output strings.

#### SOURce<Ch>:POWer<PhyPt>:CORRection:COLLect[:ACQuire] <Sensor>

Initiates a source power calibration for the source port <PhyPt> using an external power meter no. 1 or 2. To initiate a source power calibration for arbitrary power meters, use the alternative commands listed in the program example below.

**Note:** The command cannot be used unless a power meter is connected via GPIB bus, USB or LAN interface and configured in the "External Power Meters" dialog.

 Suffix:

 <Ch>

 Calibrated channel number

 <PhyPt>

 Calibrated port number

R&S ZVR/ZVAB Compatible Commands

Setting parameters <sensor></sensor>	: ASENsor   BSENsor ASENsor – external power meter Pmtr 1. BSENsor – external power meter Pmtr 2. *RST: ASENsor
Example:	SOUR: POW3: CORR: COLL BSEN Perform a source power calibration for port 3 using power meter no. 2. SOUR: POW: CORR: PMET: ID 2 Select power meter no. 2. SOUR: POW: CORR: ACQ PORT, 3 Perform a source power calibration for port 3 using the previously selected power meter no. 2.
Usage:	Setting only
Manual control:	See "Start Cal Sweep" on page 307

#### TRACe:CLEar <MemTrace>

Deletes one of the memory traces Mem < n > [Trc < m >], where n = 1, ... 8.

Parameters: <memtrace></memtrace>	MDATa1   MDATa2   MDATa3   MDATa4   MDATa5   MDATa6   MDATa7   MDATa8 Identifier for the memory trace; see table 6-10. Range: MDATA <n> where <n> = 1 to 8.</n></n>
Example:	<ul> <li>SWE: POIN 20</li> <li>Create a trace with 20 sweep points, making the created trace the active trace of channel 1 (omitted optional mnemonic SENSe1).</li> <li>TRAC: COPY "Mem_Pt20", CH1DATA</li> <li>Copy the current state of the created trace to a memory trace named "Mem_Pt20". The memory trace is not displayed.</li> <li>DISP: WIND: TRAC2: FEED "MEM_PT20"</li> <li>Display the created memory trace in the active diagram area (diagram area no. 1).</li> </ul>
Usage:	Setting only

#### TRACe[:DATA][:RESPonse][:ALL]? <Response>

Returns the response values of the active data trace or memory trace (see table 6-10).

Note: To read the response values of an arbitrary data or memory trace, use CALCulate<Chn>:DATA. To read the response values of a trace acquired in single sweep mode (INITiate<Ch>:CONTinuousOFF), use CALCulate<Ch>:DATA: NSWeep:FIRSt?.

R&S ZVR/ZVAB Compatible Commands

Query parameters: <response></response>	CH1Data   CH2Data   CH3Data   CH4Data   CH1Mem   CH2Mem   CH3Mem   CH4Mem   MDATa1   MDATa2   MDATa3   MDATa4
	MDATa5   MDATa6   MDATa7   MDATa8 Response data of the selected trace, see table 6-10. The data is transferred in the data format defined via FORMat [: DATA] and FORMat: DEXPort: SOURce. The unit is the default unit of the measured parameter; see CALCulate <ch>:</ch>
	PARameter:SDEFine.
Example:	<ul> <li>SWE: POIN 20</li> <li>Create a trace with 20 sweep points, making the created trace the active trace of channel 1 (omitted optional mnemonic SENSe1).</li> <li>CALC: FORM MLIN; : FORM ASCII; FORM: DEXP: SOUR FDAT</li> <li>Select the trace data format: linear magnitude values, ASCII format and formatted trace data (1 value per sweep point).</li> <li>TRAC? CH1DATA</li> <li>Query the 20 response values of the created trace according to the previous format settings.</li> </ul>
Usage:	Query only

#### TRACe[:DATA]:STIMulus[:ALL]? <Stimulus>

Returns the stimulus values of the active data trace or memory trace (see table 6-10).

**Note:** To read the stimulus values of an arbitrary data or memory trace, use CALCulate<Chn>:DATA:STIMulus?

#### Query parameters:

<stimulus></stimulus>	CH1Data   CH2Data   CH3Data   CH4Data   CH1Mem   CH2Mem   CH3Mem   CH4Mem   MDATa1   MDATa2   MDATa3   MDATa4   MDATa5   MDATa6   MDATa7   MDATa8 Stimulus data of the selected trace, see table 6-10.
	The data is transferred in the data format defined via FORMat [: DATA].
Example:	SWE: POIN 20 Create a trace with 20 sweep points, making the created trace the active trace of channel 1 (omitted optional mnemonic SENSe1). TRAC:STIM? CH1DATA Query the 20 stimulus values of the created trace. In the default format setting, the data is returned as a comma-separated list of 10-digit ASCII values.
Usage:	Query only

User Manual 1173.9163.02 - 13

# 7 Programming Examples

This chapter contains detailed programming examples on various tasks.

The syntax and use of all SCPI commands is described in chapter 6, "Command Reference", on page 492, where you will also find additional examples. For a general introduction to remote control of the analyzer refer to chapter 5, "Remote Control", on page 453. For an overview of special remote control features of the network analyzers refer to chapter 5.3, "Basic Remote Control Concepts", on page 465.

## 7.1 Basic Tasks

This section presents detailed examples for programming tasks that almost every user will encounter when working with the R&S ZNB.

### 7.1.1 Typical Stages of a Remote Control Program

A typical remote control program comprises the following stages:

- 1. Performing the basic instrument settings
- 2. Adjusting the test setup
- 3. Initiating the measurement, command synchronization
- 4. Retrieving measurement results

Very often, steps 3 and 4 (or steps 2 to 4) must be repeated several times.



All example programs in this section have been developed and tested by means of the GPIB Explorer provided with the network analyzer. No extra programming environment is needed.

#### 7.1.1.1 Basic Instrument Settings

**Programming task:** Adjust the basic network analyzer settings to your measurement tasks, optimizing the instrument for fast measurements.



#### Considerations for high measurement speed

The measurement speed depends on the sweep time but also on an efficient preparation of the instrument and on proper command synchronization. The following items should be kept in mind:

- For maximum speed the basic channel settings should be set while the sweep is stopped and with a minimum of sweep points. It is advisable to increase the number of points after all instrument settings have been performed, and to initiate the sweep after the test setup has been completed.
- Execution of the INITiate[:IMMediate] command is fastest in synchronized mode. Insertion of fixed waiting periods into the command sequence is possible but generally less efficient.
- The sweep time depends on several parameters; see below. In particular it is recommended to select the best set of sweep points, e.g. using the segmented sweep.

```
// Reset the instrument, switch off the measurement (after one sweep),
// reduce the number of sweep points.
*RST
INITiate1:CONTinuous OFF
SENSel:SWEep:POINts 2
11
// Avoid a delay time between different partial measurements and before the
// start of the sweeps (is default setting).
SENSel:SWEep:TIME:AUTO ON
TRIGger1:SEQuence:SOURce IMMediate
11
// Select the widest bandwidth compatible with your measurement.
SENSel:BANDwidth:RESolution 10
11
// Adjust your sweep points to your measurement task, e.g. using a segmented sweep.
SENSel:SEGMent...
```

#### 7.1.1.2 Adjusting the Test Setup

In general the preparatives described above can be used for a series of measurements. In-between the measurements it is often necessary to change the test setup, e.g. in order to replace the DUT, change the connected ports, connect external devices etc.

#### 7.1.1.3 Start of the Measurement and Command Synchronization

Programming task: Start a measurement in single sweep mode. Wait until all single sweep data has been acquired before you proceed to the next stage of the measurement.

 $\label{eq:interm} \begin{array}{l} \mbox{INITiate<Ch>[:IMMediate][:DUMMy] or INITiate<Ch>[:IMMediate]:ALL} \\ \mbox{are used to start a single sweep or a group of single sweeps. This commands have been implemented for overlapped execution. The advantage of overlapped commands is that they allow the program to do other tasks while being executed. \\ \end{array}$ 

User Manual 1173.9163.02 - 13

In the present example the sweep must be completed before measurement results can be retrieved. To prevent wrong results (e.g. a mix-up of results from consecutive sweeps) the controller must synchronize its operation to the execution of INITiate<Ch>[:IMMediate]. IEEE 488.2 defines three common commands (\*WAI, \*OPC?, \*OPC) for synchronization.

#### // 1. Start single sweep, use \*WAI

```
// *WAI is the easiest method of synchronization. It has no effect when sent
// after sequential commands.
// If *WAI follows INITiate<Ch>[:IMMediate]... (overlapped commands), the analyzer
// executes no further commands or queries until the sweep is terminated.
// *WAI does prevent the controller from sending other commands to the analyzer
// or other devices
```

// Start single sweep in channel no. 1, wait until the end of the sweep
INITiate1:IMMediate; \*WAI
<Continue program sequence>

#### // 2. Start single sweep, use \*OPC?

```
// If *OPC follows INITiate<Ch>[:IMMediate]..., it places a 1 into the
// output queue when the sweep is terminated.
// An appropriate condition in the remote control program must cause the
// controller to wait until *OPC? returns one.
// The controller is stopped from the moment when the condition is set.
// Start single sweep in channel no. 1, indicate the end of the sweep
// by a 1 in the output queue.
INITiate1:IMMediate; *OPC?
// So far the controller may still send messages to other connected devices.
// Stop the controller until *OPC? returns one (program syntax depends
// on your programming environment).
<Condition OPC=1>
<Continue program sequence>
```

#### // 3. Start single sweep, use \*OPC

```
// If *OPC follows INITiate<Ch>[:IMMediate]..., it sets the OPC bit in the ESR
// after the sweep is terminated.
// This event can be polled or used to trigger a service request of the analyzer.
// The advantage of *OPC synchronization is that both the controller and the
// analyzer can continue processing commands while the sweep is in progress.
// Enable a service request for the ESR
*SRE 32
// Set event enable bit for operation complete bit
*ESE 1
// Start single sweep in channel no. 1, set the OPC bit in the ESR
// after the sweep is terminated.
```

```
User Manual 1173.9163.02 - 13
```

Basic Tasks

```
// The controller may still send messages, the analyzer continues to parse
// and execute commands.
INITiate1:IMMediate; *OPC
// Controller waits for service request from the analyzer
// (program syntax depends on your programming environment).
<Wait for service request>
<Continue program sequence>
```

#### 7.1.1.4 Retrieving Measurement Results

Programming task: Read the results acquired in a single sweep.

#### // 1. Read single values (-> Markers)

```
// Markers are the most convenient tool for determining and retrieving single
// values on traces.
// The analyzer provides up to ten markers; see Markers and Limit Lines.
```

#### // 2. Read complete trace

```
// Select a trace format and read formatted trace data.
CALCulate1:FORMat MLINear / Calculate the linear magnitude of z
CALCulate1:DATA? FDATa / Read the formatted trace data
```



Use CALCulate<Chn>:DATA:NSWeep:FIRSt? to retrieve a particular trace within a group of sweeps.

#### 7.1.2 Channel, Trace and Diagram Handling

The following examples show you how to perform basic tasks related to channel and trace definition and to the display of traces in diagrams.



All example programs in this section have been developed and tested by means of the GPIB Explorer provided with the network analyzer. No extra programming environment is needed.

#### 7.1.2.1 Several Traces with Equal Channel Settings

**Programming task:** Create up to four different traces with equal channel settings, assign the four 2-port standard S-parameters to the traces and display them in up to four diagrams.

User Manual 1173.9163.02 - 13

#### Important remote control features for this program example

The following command sequence illustrates the structure of the remote commands discussed in section Basic Remote Control Concepts. In particular it shows that:

- A trace can be created and handled without being displayed.
- Traces are referenced by trace names. The active trace of a channel is often referenced by the channel suffix.
- Diagrams are referenced by a window suffix <Wnd>. An additional suffix <WndTr> in the DISPlay:WINDow<Wnd>:TRACe<WndTr>... commands numbers the different traces in a diagram.
- In remote control, it is possible to display the same trace in several diagrams.
- The analyzer provides several commands allowing a smooth transition between remote and manual control.

#### // 1. One channel, two traces, one diagram

```
// Reset the instrument, creating the default trace Trcl in channel 1.
// The default measured quantity is the forward transmission S-parameter S21.
// The default format is dB Mag.
*RST
// Create a second trace in channel 1, assign the format Phase,
// and display the new trace in the same diagram.
// the trace becomes the active trace but is not displayed
CALCulate1:PARameter:SDEFine 'Trc2', 'S21'
// the trace is referenced by the channel suffix 1
CALCulate1:FORMat PHASe
```

```
// display the second trace, numbering it the second trace in diagram no. 1
DISPlay:WINDow1:TRACe2:FEED 'Trc2'
```

#### // Check the result on the local screen

```
// Go to local
SYSTem:DISPlay:UPDate ONCE
```

#### // 2. One channel, two traces, two diagrams

```
// Create a second diagram, assign Trc2 to the new area, and remove it
// from the first area.
DISPlay:WINDow2:STATE ON
DISPlay:WINDow2:TRACe2:FEED 'Trc2'
// Trc2 is now displayed in both diagrams
DISPlay:WINDow1:TRACe2:DELete
```

#### // Check the result on the local screen

```
// Go to local
SYSTem:DISPlay:UPDate ONCE
```

User Manual 1173.9163.02 – 13

**Basic Tasks** 

#### // 3. One channel, four traces, four diagrams

```
// Reset the instrument, add diagrams no. 2, 3, 4.
*RST; :DISPlay:WINDow2:STATE ON
DISPlay:WINDow3:STATe ON
DISPlay:WINDow4:STATe ON
// Assign the reflection parameter S11 to the default trace.
:CALCulate1:PARameter:MEASure 'Trc1', 'S11'
// Assign the remaining S-parameters to new traces Trc2, Trc3, Tr4;
// select the Smith chart format for the reflection parameters.
CALCulate1:FORMat SMITh // Smith chart for the active trace Trc1
CALCulate1:PARameter:SDEFine 'Trc2', 'S21'
CALCulate1:PARameter:SDEFine 'Trc3', 'S12'
CALCulate1:PARameter:SDEFine 'Trc4', 'S22'
// Smith chart for the active trace Trc4, referenced by the channel number
CALCulate1:FORMat SMITh
// Display the new traces in diagrams no. 2 to 4.
DISPlay:WINDow2:TRACe2:FEED 'Trc2'
DISPlay:WINDow3:TRACe3:FEED 'Trc3'
```

#### // Check the result on the local screen

DISPlay:WINDow4:TRACe4:FEED 'Trc4'

// Go to local
SYSTem:DISPlay:UPDate ONCE

#### 7.1.2.2 Several Traces with Different Channel Settings...

**Programming task:** Create three channels with 3, 1 and 2 traces, respectively, and display the traces in two diagrams.

#### Important remote control features for this program example

The following command sequence illustrates the structure of the remote commands discussed in section Basic Remote Control Concepts. In particular it shows that:

- 1. Channels are always referenced by a channel suffix.
- Traces are referenced by trace names. The active trace of a channel is often referenced by the channel suffix.
- 3. Diagrams are referenced by a window suffix <Wnd>. An additional suffix <WndTr> in the DISPlay:WINDow<Wnd>:TRACe<WndTr>... commands numbers the different traces in a diagram.
- 4. The analyzer provides several commands allowing a smooth transition between remote and manual control.

User Manual 1173.9163.02 - 13

#### // 1. Create all channels and traces

```
// Reset the instrument, creating the default trace Trc1 in channel 1.
// The default measured quantity is the forward transmission S-parameter S21.
// The default format is dB Mag.
*RST
// Create two more traces in channel 1, assigning a trace name and a measured
// quantity to each of them. Choose descriptive trace names (instead of the
// short default names used above).
CALCulate1:PARameter:SDEFine 'Impedance trace', 'Z-S21'
\ensuremath{{\prime\prime}}\xspace // the trace becomes the active trace for channel 1 but is not displayed
CALCulate1:PARameter:SDEFine 'Admittance trace', 'Y-S21'
// the trace becomes the active trace for channel 1
// Create channel 2 with one new trace, channel 3 with two new traces.
CALCulate2:PARameter:SDEFine 'Ratio trace', 'B1/B2'
CALCulate3:PARameter:SDEFine 'Z trace', 'Z21'
CALCulate3:PARameter:SDEFine 'Y trace', 'Y21'
CALCulate3:PARameter:SELect 'Z trace'
// the trace created previously becomes the active trace for channel 3
// So far, only the default trace is displayed.
```

#### // Check the result on the local screen

// Go to local
SYSTem:DISPlay:UPDate ONCE

#### // 2. Create second diagram and display traces

```
DISPlay:WINDow2:STATE ON
DISPlay:WINDow1:TRACe2:FEED 'Admittance_trace'
DISPlay:WINDow1:TRACe3:FEED 'Y_trace'
DISPlay:WINDow2:TRACe1:FEED 'Impedance_trace'
DISPlay:WINDow2:TRACe2:FEED 'Ratio_trace'
DISPlay:WINDow2:TRACe3:FEED 'Z trace'
```

#### // Check the result on the local screen

```
// Go to local
SYSTem:DISPlay:UPDate ONCE
```

#### // 3. Check and modify your configuration

```
// Query the traces in channel 1.
CALCulate1:PARameter:CATalog?
// The response is 'Trc1,S21,Impedance_trace,Z-S21,Admittance_trace,Y-S21'
// Query the reference level for the 'Z_trace'.
// The trace is referenced by its number in diagram no. 2.
DISPlay:WINDow2:TRACe3:Y:RLEVel?
```

```
Basic Tasks
```

```
// Change the display format for the 'Z_trace'. The trace is the active trace
// in channel 3, so it is referenced by the channel suffix 3.
// Update the display
CALCulate3:FORMat PHASe
// Update the display
SYSTem:DISPlay:UPDate ONCE
```

#### 7.1.2.3 Markers and Limit Lines...

**Programming task:** Display two traces in a single diagram ares, use markers to read results, and perform a limit check.

#### Important remote control features for this program example

The following command sequence illustrates the structure of the remote commands discussed in section Basic Remote Control Concepts. In particular it shows that:

- 1. Traces are referenced by trace names. The active trace of a channel is often referenced by the channel suffix. This simplifies the program syntax, e.g. in the commands for marker settings and for the limit check.
- Diagrams are referenced by a window suffix <Wnd>. An additional suffix <WndTr> in the DISPlay:WINDow<Wnd>:TRACe<WndTr>... commands numbers the different traces in a diagram.
- 3. The analyzer provides several commands allowing a smooth transition between remote and manual control.

#### // 1. Create one channel, two traces, one diagram

```
// Reset the instrument, creating the default trace Trcl in channel 1.
// The default measured quantity is the forward transmission S-parameter S21.
// The default format is dB Mag.
*RST
// Create a second trace in channel 1, assign the format Phase,
// and display the new trace in the same diagram.
// the trace becomes the active trace but is not displayed
CALCulate1:PARameter:SDEFine 'Trc2', 'S21'
// the trace is referenced by the channel suffix 1
CALCulate1:FORMat PHASe
// display the second trace, numbering it the second trace in diagram no. 1
DISPlay:WINDow1:TRACe2:FEED 'Trc2'
```

#### // Check the result on the local screen

```
// Go to local
SYSTem:DISPlay:UPDate ONCE
```

User Manual 1173.9163.02 - 13

#### // 2. Marker settings

```
// Adjust the sweep range to consider an interesting segment of the trace and
// re-scale the diagram.
SENSel:FREQuency:STARt 4.5 GHz; STOP 5.5 GHz
// in the autoscale command the trace is referenced by its number in the diagram
DISPlay:WINDow1:TRACe1:Y:SCALe:AUTO ONCE
// Select trace Trcl as the active trace of the channel, define a reference
// marker and a delta marker.
// In the marker commands the active trace is referenced by the channel suffix.
CALCulate1:PARameter:SELect 'Trc1'
// the marker is set to the center of the sweep range
CALCulate1:MARKer1:STATe ON
// this command also creates the reference marker
CALCulate1:MARKer1:DELTa:STATe ON
// set the reference marker to the beginning of the sweep range
CALCulate1:MARKer1:REFerence:X 4.5 GHz
// Use the delta marker to search for the minimum of the trace and query the result.
// the query returns the stimulus and the response value at the marker position
CALCulate1:MARKer1:FUNCtion:EXECute MIN; RES?
```

#### // Check the result on the local screen

```
// Go to local
SYSTem:DISPlay:UPDate ONCE
```



Use the CALCulate<Chn>: DATA... commands to retrieve the complete trace; see Retrieving Measurement Results.

#### // 3. Limit lines and limit check

```
// Remove all markers and define a limit line for the active trace.
CALCulate1:MARKer1:AOFF
// define an upper limit line across the entire sweep range
CALCulate1:LIMit:DATA 1, 450000000, 5500000000, -5, -5
CALCulate1:LIMit:DATA 2, 450000000, 500000000, -10, -15
// define two segments for the lower limit line
CALCulate1:LIMit:DATA 2, 500000000, 5500000000, -15, -10
// Display the limit line and perform the limit check.
CALCulate1:LIMit:DISPlay:STATE ON
CALCulate1:LIMit:STATE ON; FAIL?
// if the trace failed the limit check; the response is 1
```

#### // Check the result on the local screen


```
// Go to local
SYSTem:DISPlay:UPDate ONCE
```

### 7.2 Condensed Programming Examples

This section contains short program examples for select issues. The comments have been commented in concise style; for more detailed information on the commands refer to chapter 6.3, "SCPI Command Reference", on page 495.

If the example you are looking for is not in this section, we suggest you to refer to the short command sequences in the reference chapter. Proceed as follows:

1. Find your subject in the help system, preferably using context-sensitivity (of the help system on your network analyzer) or the index:

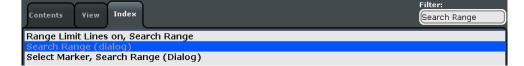

2. Activate the link to the command description:


```
SCPI command:

<u>CALCulate<Ch>: MARKer<Mk>: FUNCtion: DOMain: USER</u>

<u>CALCulate<Ch>: MARKer<Mk>: FUNCtion: DOMain: USER: STARt</u>

<u>CALCulate<Ch>: MARKer<Mk>: FUNCtion: DOMain: USER: STOP</u>
```

3. A short example appears at the end of each command description:

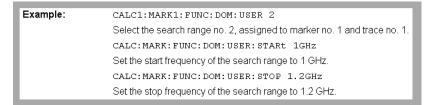



The command SYSTem: DISPlay: UPDate precedes some of the command scripts so that you can watch the progress of the script on the screen. For maximum performance, simply omit this command.

#### 7.2.1 Path Independent RC Programs

The default directory for R&S ZNB user data is C:\Users\Public\Documents\Rohde-Schwarz\Vna. Other instruments may use different default directories. To make remote control programs compatible, it is recom-

mended to define all paths relative to the default directory, to be set via MMEMory:CDIRectory DEFault.

#### // Select default directory, change to sub-directory (relative to default directory)

```
MMEMory:CDIRectory DEFault
MMEMory:CDIRectory 'Traces'
MMEMory:STORe:TRACe 'Trcl', 'S21.slp'
MMEMory:LOAD:TRACe 'Trcl', 'S21.slp'
```

#### // Alternative, more compact definition

MMEMory:CDIRectory DEFault
MMEMory:STORe:TRACe 'Trc1', 'Traces\S21.s1p'

You may also read the default path (MMEMory: CDIRectory?) and use the external RC program to build the complete paths.

#### 7.2.2 Trace and Diagram Handling

The following sections provide examples for efficient channel and trace definition and convenient diagram handling.

#### 7.2.2.1 Assigning Channels, Traces, and Diagrams

The following example is a short version of chapter 7.1.2, "Channel, Trace and Diagram Handling", on page 890.

#### // Reset the analyzer

```
*RST
:SYSTEM:DISPLAY:UPDATE ON
```

#### // Create a new trace for S21 with the name TrcDisp

```
:CALCULATE1:PARAMETER:SDEFINE "TrcDisp","S21"
// Display the trace in the display area 1
:DISPLAY:WINDOW1:TRACE9:FEED 'TrcDisp'
:DISPLAY:WINDOW1:TRACE9:DELETE
```

#### // List the traces, assigned to a certain Channel

```
// format "<trace name>,<meas param>[,<trace name>,<meas param>...]"
:CALCULATE1:PARAMETER:CATALOG?
```

#### // Channel 4 does not exist, a new channel and trace is created

```
:CALCULATE4:PARAMETER:SDEFINE "Ch4Trc2","S22"
:CALCULATE4:PARAMETER:SDEFINE "Ch4Trc3","S33"
:CALCULATE4:PARAMETER:CATALOG?
```

User Manual 1173.9163.02 - 13

#### // Select active traces for channel 4

```
:CALCULATE4:PARAMETER:SELECT "Ch4Trc2"
:CALCULATE4:PARAMETER:SELECT?
//:CALCULATE4:FORMAT POLAR
:CALCULATE4:PARAMETER:SELECT "Ch4Trc3"
//:CALCULATE4:FORMAT DB_LIN
:CALCULATE4:PARAMETER:SELECT?
:CALCULATE4:FORMAT?
:CALCULATE4:FORMAT?
```

#### // Create trace

```
:CALCULATE1:PARAMETER:SDEFINE "Trc2","S21"
:CALCULATE1:PARAMETER:SDEFINE "Trc3","S31"
:CALCULATE1:PARAMETER:CATALOG?
```

#### // Delete trace

```
:CALCULATE1:PARAMETER:DELETE "Trc2"
:CALCULATE1:PARAMETER:CATALOG?
```

#### // Assign a trace to a window = diagram, diagram 1 always exists

```
:DISPLAY:WINDOW1:TRACE2:FEED 'TrcDisp'
```

#### // Create diagram 2

```
:DISPLAY:WINDOW2:STATE?
:DISPLAY:WINDOW2:STATE ON
:DISPLAY:WINDOW2:STATE?
:DISPLAY:WINDOW2:TRACE6:FEED 'Ch4Trc2'
:DISPLAY:WINDOW2:TRACE2:FEED 'Trc1'
:DISPLAY:WINDOW2:TRACE3:FEED 'Ch4Trc3'
```

#### // Create traces: trace names are not case sensitive

```
:CALCULATE4:PARAMETER:SELECT "Ch4Trc2"
:CALCULATE4:PARAMETER:SELECT?
:CALCULATE4:PARAMETER:SELECT "Ch4TRC3"
:CALCULATE4:PARAMETER:SELECT?
:CALCULATE4:PARAMETER:SELECT "ch4trc2"
:CALCULATE4:PARAMETER:SELECT?
```

#### 7.2.2.2 Memory Traces

The following example shows how to save data to memory and work with memory traces.

#### // Reset the analyzer

```
*RST
:SYSTEM:DISPLAY:UPDATE ON
:SENSE1:SWEEP:POINTS 20
```

#### // Create memory trace of the "active" trace (active for the parser !)

```
// the name of the created memory trace is "Mem2[Trc1]"
:TRACE:COPY MDATA2,CH1DATA
:SENSE1:FUNCTION:ON 'XFREQUENCY:POWER:S11'
:CALCULATE1:PARAMETER:CATALOG?
```

```
// Assign the memory trace to a window = diagram, diagram 1 always exists
:DISPLAY:WINDOW1:TRACE2:FEED 'Mem2[Trc1]'
```

#### // Create further memory traces and assign them to a window

```
:TRACE:COPY 'Mem3x[Trc1]',CH1DATA // mixed parameters String, Char
:DISPLAY:WINDOW1:TRACE3:FEED 'Mem3x[Trc1]'
:TRACE:COPY MDATA4,CH1DATA
:DISPLAY:WINDOW1:TRACE4:FEED 'Mem4[Trc1]'
```

#### // Create new normal trace on channel 1, assign it to a window

```
:CALCULATE1:PARAMETER:SDEFINE "Trc2","S22"
:DISPLAY:WINDOW1:TRACE5:FEED 'Trc2'
:CALCULATE1:PARAMETER:SELECT 'Trc2' // now active for channel 1
:CALCULATE1:PARAMETER:SELECT?
:CALCULATE1:PARAMETER:CATALOG?
```

#### // Create memory trace for 'Trc2',

```
// The memory trace can be assigned to the diagram of the mother trace only
// (diagram 1)
:TRACE:COPY MDATA6,CH1DATA
:DISPLAY:WINDOW1:TRACE6:FEED 'Mem6[Trc2]'
```

#### // Create new diagram 2 and new channel and trace

```
:DISPLAY:WINDOW2:STATE ON

:CALCULATE2:PARAMETER:SDEFINE "Ch2Trc1","S22"

:CALCULATE2:PARAMETER:SELECT 'Ch2Trc1' // now active for channel 2

:SENSE1:SWEEP:POINTS 21

:TRACE:COPY MDATA1,CH2DATA

:DISPLAY:WINDOW2:TRACE7:FEED 'Mem1[Ch2Trc1]'

:TRACE:DATA:STIMULUS? CH1DATA

:TRACE:DATA:RESPONSE? MDATA6
```

User Manual 1173.9163.02 – 13

#### // Create new channel 3 and new trace

```
:CALCULATE3:PARAMETER:SDEFINE "Ch3Trc1","S21"
:CALCULATE3:PARAMETER:SELECT 'Ch3Trc1' // now active for channel 3
:CALCULATE3:PARAMETER:SELECT? %'Ch3Trc1'
:SENSE1:SWEEF:POINTS 22
:TRACE:COPY MDATA8,CH3DATA
:TRACE:COPY MDATA7,CH3DATA
:DISPLAY:WINDOW2:TRACE1:FEED 'Mem8[Ch3Trc1]'
:TRACE:DATA:RESPONSE? MDATA7 // assigned to no diagram
```

#### // Copy with arbitrary trace names, no blanks in trace names !!!

```
:TRACE:COPY 'Trace_Name','Ch3Trc1'
:DISPLAY:WINDOW2:TRACE2:FEED 'Trace_Name'
:CALCULATE3:PARAMETER:SELECT 'Trace_Name'
:CALCULATE3:PARAMETER:SELECT?
:TRACE:COPY 'XYZ','Ch2Trc1'
:DISPLAY:WINDOW2:TRACE3:FEED 'XYZ'
:CALCULATE2:PARAMETER:SELECT 'XYZ'
:CALCULATE2:PARAMETER:SELECT?
:TRACE:COPY MDATA4 ,'Ch3Trc1' // mixed parameters Char, String
:DISPLAY:WINDOW2:TRACE4:FEED 'Mem4[Ch3Trc1]'
```

#### // Copy to existing memory traces = update trace data

```
:TRACE:COPY MDATA6,CH1DATA
:TRACE:COPY 'XYZ','Ch2Trc1'
:CALCULATE1:PARAMETER:CATALOG?
:CALCULATE2:PARAMETER:CATALOG?
:CALCULATE3:PARAMETER:CATALOG?
```

#### 7.2.2.3 Trace Mathematics

The following script shows how to define mathematical relations between traces.

#### // Reset the analyzer

```
*RST
:SYSTEM:DISPLAY:UPDATE ON
```

#### // Create memory trace on active trace of channel 1,

```
// assign the memory trace to a diagram
:CALCULATE1:MATH:MEMORIZE
:DISPLAY:WINDOW1:TRACE2:FEED 'Mem2[Trc1]'
```

#### // Define simple trace mathematics

```
:CALCULATE1:MATH:FUNCTION ADD
:CALCULATE1:MATH:FUNCTION?
// Trace mathematics off
```

User Manual 1173.9163.02 - 13

```
:CALCULATE1:MATH:FUNCTION NORMAL
:CALCULATE1:MATH:FUNCTION?
*RST
```

#### // Create Trc2 in channel 1 and display it in diagram 1

```
:CALCULATE1:PARAMETER:SDEFINE "Trc2","S11"
:DISPLAY:WINDOW1:TRACE2:FEED 'Trc2'
```

#### // Create diagram 2 and Trc3 in new channel

```
:DISPLAY:WINDOW2:STATE ON
:CALCULATE2:PARAMETER:SDEFINE "Trc3","S11"
:DISPLAY:WINDOW2:TRACE1:FEED 'Trc3'
```

#### // Select active traces for channels 1 and 2

```
:CALCULATE1:PARAMETER:SELECT "Trc1"
:CALCULATE2:PARAMETER:SELECT "Trc3"
```

#### // Create memory trace on Trc1 and assign it to a diagram, same for TRC3

```
:TRACE:COPY MDATA7,CH1DATA
:DISPLAY:WINDOW1:TRACE3:FEED 'Mem7[Trc1]'
:TRACE:COPY MDATA8,CH2DATA
:DISPLAY:WINDOW2:TRACE2:FEED 'Mem8[Trc3]'
```

#### // Examples for Trace Mathematics

```
// Special operands Data and Mem
:CALCULATE1:MATH:SDEFINE "Data * Mem"
:CALCULATE1:MATH:STATE ON
// Constants
:CALCULATE1:MATH:SDEFINE "Pi * e * j"
// Functions
:CALCULATE1:MATH:SDEFINE "linMag (1) + dBMag (2) + Arg (3) + Re (4) + Im (5j)"
:CALCULATE1:MATH:SDEFINE "log (2) * ln (3) * Min (1, 2) * Max (2, 3)"
:CALCULATE1:MATH:SDEFINE "StimVal + asin (sin (3)) + acos (cos (4))
    + atan (tan (4))"
:CALCULATE1:MATH:SDEFINE "(Trc1 + 2) * 1.1"
:CALCULATE1:MATH:SDEFINE "(tRC1 + e) * Pi + STIMVAL - sin (1) + Min (TRC1, Trc1)"
// Imaginary unit j = sqrt (-1)
// j is no ordinary operand: 1j not 1 * j
// magnitude: 1, phase: 60 degrees
:CALCULATE1:MATH:SDEFINE "(1 + 3 ^ (1 / 2) * 1j) / 2"
:CALCULATE1:MATH:SDEFINE "sin (1) + ACOS (0.5)"
// 2 periods for sin (), ... when stop frequency 8 GHz = 8e9 Hz
:CALCULATE1:MATH:SDEFINE "sin (2 * 2 * Pi * StimVal / 8e9) "
:CALCULATE1:MATH:SDEFINE "cos (2 * 2 * Pi * StimVal / 8e9) "
:CALCULATE1:MATH:SDEFINE "tan (2 * 2 * Pi * StimVal / 8e9) "
:CALCULATE1:MATH:SDEFINE "Min (sin (6 * Pi * StimVal / 8e9),
    cos (6 * Pi * StimVal / 8e9))"
```

#### 7.2.2.4 Trace Statistics

The following script shows how to create a trace, select an evaluation range and retrieve statistical results.

#### // Reset the analyzer

```
*RST
:SYSTEM:DISPLAY:UPDATE ON
```

#### // Create new channel and trace

```
:CALCULATE2:PARAMETER:SDEFINE 'Trc2', 'S11'
:CALCULATE2:PARAMETER:SELECT 'Trc2'
:DISPLAY:WINDOW2:STATE ON
:DISPLAY:WINDOW2:TRACE1:FEED 'Trc2'
:SENSE1:SWEEP:TIME:AUTO ON
:SENSE2:SWEEP:TIME:AUTO ON
```

#### // Search full-span evaluation range, display statistical results

```
:CALCulate1:STATistics:DOMain:USER 0
:CALCulate2:STATistics:DOMain:USER 0
:CALCULATE1:STATISTICS ON
:CALCULATE2:STATISTICS ON
```

#### // Single sweep, global scope

```
:INITIATE:CONTINUOUS OFF
:INITIATE:IMMEDIATE:SCOPE ALL
:SENSE:SWEEP:COUNT 4
:INITIATE:IMMEDIATE; *WAI
```

#### // Calculate statistical results (also possible if info field is switched off)

```
:CALCULATE1:STATISTICS:RESULT? MEAN
:CALCulate1:STATistics:RESult? ELENgth
:CALCULATE1:STATISTICS:RESULT? ALL
```

#### // Modify evaluation range (is automatically confined to sweep range)

```
:CALCulate1:STATistics:DOMain:USER 1
:CALCulate1:STATistics:DOMain:USER:STARt 0 HZ
```

```
:CALCulate1:STATistics:DOMain:USER:STOP 100 GHZ
:CALCULATE1:STATISTICS:RESULT? MEAN
:CALCULATE1:STATISTICS:RESULT? MAX
```

#### 7.2.2.5 Bandfilter Search

The following example shows how to use markers for a bandpass or bandstop search.

#### // Reset the analyzer

```
*RST
:SYSTEM:DISPLAY:UPDATE ON
:SENSe1:FREQuency:STARt 1 GHZ
:SENSe1:FREQuency:STOP 6 GHZ
```

#### // Bandpass search ref. to max.

```
:CALCulate1:MARKer:FUNCtion:BWIDth:MODE BPASS
:CALCulate1:MARKer:FUNCtion:BWIDth:MODE? %BPAS
// Measure single sweep, wait until complete sweep is finished
:INITiate:CONTinuous OFF
:INITiate; *WAI;
:CALCulate1:MARKer:FUNCtion:EXECute BFILter
```

// All markers OFF
:CALCulate1:MARKer:AOFF

#### // Bandpass search ref. to marker

```
:CALCulate1:MARKer1:STATE ON
:CALCulate1:MARKer1:X 3.0 GHz
:CALCulate1:MARKer:FUNCtion:BWIDth:MODE BPRMarker
:CALCulate1:MARKer:FUNCtion:BWIDth:MODE? %BPRM
:INITiate; *WAI;
:CALCulate1:MARKer:FUNCtion:EXECute BFILter
:CALCulate1:MARKer:AOFF
```

#### // Bandstop search ref. to max.

```
:CALCulate1:MARKer:FUNCtion:BWIDth:MODE BSTop
:CALCulate1:MARKer:FUNCtion:BWIDth:MODE? %BST
:INITiate; *WAI;
:CALCulate1:MARKer:FUNCtion:EXECute BFILter
:CALCulate1:MARKer:AOFF
```

#### // Bandstop search ref. to marker

```
:CALCulate1:MARKer1:STATE ON
:CALCulate1:MARKer1:X 1.7 GHz
:CALCulate1:MARKer:FUNCtion:BWIDth:MODE BsRMarker
```

```
:CALCulate1:MARKer:FUNCtion:BWIDth:MODE? %BsRM
:INITiate; *WAI;
:CALCulate1:MARKer:FUNCtion:EXECute BFILter
```

#### 7.2.2.6 Creating Diagrams


In the following example, remote control commands are used to position several diagrams on the screen. The remote control commands presented here extend the functionality of the "Display > Diagram" and "Display > Split" softtool tabs.

#### // Reset the analyzer

```
*RST
:SYSTEM:DISPLAY:UPDATE ON
```


#### // Define and display a simple horizontal layout (two diagrams side by side)

```
:DISPlay:LAYout:DEFine 1, Horizontal, '1.00,0.30,0.70'
:DISPlay:LAYout:APPLy 1
Trcl S21 1 Trcz S21 dB Mag 10 dB/ Ref 0 dB 2
```

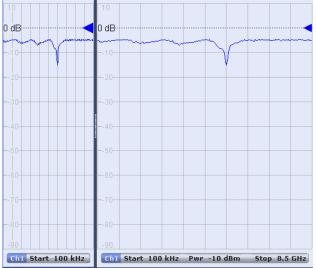



:DISPlay:LAYout:DEFine 2, Vertical, '1.00,0.50,0.50' :DISPlay:LAYout:APPLy 2

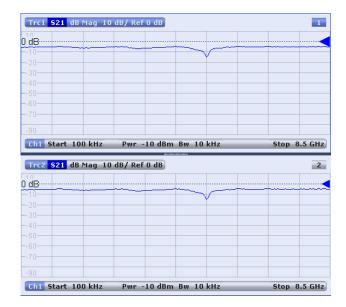

#### // Check the executable formats of the generated layouts

:DISPlay:LAYout:DEFine? 1 %(1,1,0.00,0.00,(1,2,1.00,1.00,[0.30,1.00],[0.70,1.00])) :DISPlay:LAYout:DEFine? 2 %(1,1,0.00,0.00,(2,1,1.00,1.00,[1.00,0.50],[1.00,0.50]))

#### // Join the 2 layouts, display the nested layout

```
:DISPlay:LAYout:JOIN 1,2,2
:DISPlay:LAYout:APPLy 1
```



#### // Check the last applied (i.e. the joined) layout for the correct format

```
:DISPlay:LAYout:EXECute?
  %(1,1,0.00,0.00,(1,2,1.00,1.00,[0.30,1.00],
  %(1,1,0.70,1.00,(2,1,1.00,1.00,[1.00,0.50],[1.00,0.50]))))
```

#### // Set the layout format directly (horizontal, joined layout)

```
:DISPlay:LAYout:EXECute
'(1,1,0.00,0.00,(1,2,1.00,1.00,[0.30,1.00],
(1,1,0.70,1.00,(2,1,1.00,1.00,[1.00,0.50],[1.00,0.50]))))'
```

#### // Alternative direct definition of the joined layout as a vertical layout

#### 7.2.3 Using Markers

The following example shows you how to define markers and use them to read trace values.

#### // Reset the analyzer

```
*RST
:SYSTEM:DISPLAY:UPDATE ON
```

#### // Initiate a single sweep

:INITiate1:CONTinuous OFF :INITiate1:IMMediate;\*WAI

```
// The following marker commands have the channel no. as a numeric suffix.
// The parameter belongs to a trace, the assignment channel -> trace
// is done via a "active" trace for each channel
:CALCULATE1:PARAMETER:SELECT 'Trc1'
```

#### // Marker ON / OFF

:CALCULATE1:MARKER1 ON :CALCULATE1:MARKER1:STATE?

#### // Coupled Markers

// All markers belonging to channels with the same sweep type
// (FREQUENCY, TIME, POWER, CW FREQUENCY) are coupled/decoupled
:CALCULATE1:MARKER:COUPLED ON

#### // Marker Continous / Discrete

:CALCULATE1:MARKER1:MODE CONTINUOUS

#### // Normal / Delta / Reference / Fixed Marker

```
:CALCULATE1:MARKER:AOFF // all markers off
:CALCULATE1:MARKER1 ON
:CALCULATE1:MARKER1:X 1GHZ
```

User Manual 1173.9163.02 - 13

```
:CALCULATE1:MARKER2 ON
:CALCULATE1:MARKER2:X 2GHZ
:CALCULATE1:MARKER3 ON
:CALCULATE1:MARKER3:X 3GHZ
:CALCULATE1:MARKER4:DELTA:STATE ON
:CALCULATE1:MARKER:REFERENCE ON
:CALCULATE1:MARKER:REFERENCE:X 5GHZ
:CALCULATE1:MARKER1:TYPE FIXED
```

#### // Query marker response values

```
:CALCULATE1:FORMAT MLINEAR
:CALCULATE1:MARKER1 ON
:CALCULATE1:MARKER1:X DEF
:CALCULATE1:MARKER1:FORMAT MLINEAR
// DataBase EMarkerFormat::LIN_MAG
:CALCULATE1:MARKER1:Y?
:CALCULATE1:MARKER1:Y?
```

#### 7.2.3.1 Marker Search Functions

The following example shows how to search for particular measurement points using markers.

#### // Reset the analyzer

\*RST :DISPlay:WINDow1:TITLe:DATA 'Max Hold Function Emulation'

#### // Define marker and stimulus range

```
:CALCULATE1:MARKER1 ON
:SENSE1:FREQUENCY:START 1GHZ
:SENSE1:FREQUENCY:STOP 2GHZ
// Do the marker search in the format DB Magnitude
:CALCULATE1:FORMAT MLOGARITHMIC
```

#### // Define marker search ranges (stimulus range of the marker search)

```
// Range 0 is always the stimulus range of the trace (can't be changed)
:CALCULATE1:MARKER1:FUNCTION:DOMAIN:USER 0
:CALCulate1:MARKer1:FUNCtion:DOMain:USER:START?
:CALCulate1:MARKer1:FUNCtion:DOMain:USER:STOP?
```

```
// Range 1 (within the stimulus range)
:CALCULATE1:MARKER1:FUNCTION:DOMAIN:USER 1
:CALCulate1:MARKer1:FUNCtion:DOMain:USER:START 1.2GHZ
:CALCulate1:MARKer1:FUNCtion:DOMain:USER:STOP 1.8GHZ
```

User Manual 1173.9163.02 - 13

```
// Range 2 (includes the stimulus range)
:CALCULATE1:MARKER1:FUNCTION:DOMAIN:USER 2
:CALCulate1:MARKer1:FUNCtion:DOMain:USER:START 0.8GHZ
:CALCulate1:MARKer1:FUNCtion:DOMain:USER:STOP 2.2GHZ
// Use range 0 (stimulus range of the trace)
:CALCULATE1:MARKER1:FUNCTION:DOMAIN:USER 0
```

#### // Select linear magnitude scale for diagram

:CALCULATE1:FORMAT MLINEAR

#### // Search for global minimum and maximum (MIN, MAX)

```
// (initial marker value may be inside or outside the marker search range)
:CALCULATE1:MARKER1:X 1.5GHZ
:CALCULATE1:MARKER1:X?
:CALCULATE1:MARKER1:X 1.5GHZ
:CALCULATE1:MARKER:MAX
:CALCULATE1:MARKER1:X?
```

#### // Minimum peak search functions

```
:CALCULATE1:MARKER1:FUNCTION:SELECT MINIMUM
:CALCULATE1:MARKER1:FUNCTION:SELECT?
// NEXT PEAK
:CALCULATE1:MARKER1:X 1.5GHZ
:CALCULATE1:MARKER1:X?
// PEAK RIGHT
:CALCULATE1:MARKER1:X 1.5GHZ
:CALCULATE1:MARKER1:X?
// PEAK LEFT
:CALCULATE1:MARKER1:X 1.5GHZ
:CALCULATE1:MARKER1:X 1.5GHZ
:CALCULATE1:MARKER1:X 1.5GHZ
:CALCULATE1:MARKER1:X 1.5GHZ
```

#### // Maximum peak search functions

```
:CALCULATE1:MARKER1:FUNCTION:SELECT MAXIMUM // Proceed as for minimum search
```

#### 7.2.4 Data Handling

The following sections provide examples for efficient sweep definition and data handling. Part of the functionality is not available in manual control.

#### 7.2.4.1 Single Sweep Mode

The commands CALCulate<Ch>:DATA:NSWeep...? SDATa, <Trace\_Hist\_Count> retrieve the results of any sweep within a previously defined single sweep group. This means that, in single sweep mode, you can first measure a specified number of sweeps (SENSe<Ch>:SWEep:COUNt <sweeps>) and then read any of the data traces acquired.

This feature has no equivalent in manual control where always the last data trace is displayed.

```
// Reset the analyzer
*RST
:SYSTEM:DISPLAY:UPDATE ON
// Create a second and third channel with new diagrams and traces.
:CALCULATE2:PARAMETER:SDEFINE "Trc2","S11"
:CALCULATE2:PARAMETER:SELECT "Trc2"
:DISPLAY:WINDOW2:STATE ON
:DISPLAY:WINDOW2:TRACE1:FEED 'Trc2'
:CALCULATE3:PARAMETER:SDEFINE "Trc3","S11"
:CALCULATE3:PARAMETER:SELECT "Trc3"
:DISPLAY:WINDOW3:STATE ON
:DISPLAY:WINDOW3:TRACE1:FEED 'Trc3'
// Select sweep time for the channels.
:SENSE1:SWEEP:TIME 1 S
:SENSE2:SWEEP:TIME 1 S
:SENSE3:SWEEP:TIME 1 S
// Enable single sweep mode for all channels so that channel-specific
// sweep count settings are used
:INITIATE:CONTINUOUS:ALL OFF
// Select single swep mode with channel-specific sweep count settings
// Set sweep counts and start measurement in all channels
:SENSE1:SWEEP:COUNT 1
:SENSE2:SWEEP:COUNT 2
:SENSE3:SWEEP:COUNT 3
:INITIATE1:IMMEDIATE; *WAI
:INITIATE2:IMMEDIATE; *WAI
:INITIATE3:IMMEDIATE; *WAI
// Select single swep mode with global sweep count settings
:SENSE:SWEEP:COUNT:ALL 2
:INITIATE1:IMMEDIATE; *WAI
:INITIATE2:IMMEDIATE; *WAI
:INITIATE3:IMMEDIATE; *WAI
```

User Manual 1173.9163.02 - 13

#### 7.2.4.2 Modeling a Max Hold Function

The following example shows you how to emulate a max hold function.

#### // Reset the analyzer

```
*RST
:DISPlay:WINDow1:TITLe:DATA 'Max Hold Function Emulation'
```

#### // Create a trace with the last extremum as memory trace.

```
:TRACe:COPY 'LastExtr', 'Trc1'
// Display this last extremum trace.
// Because it's a memory trace it must be displayed in the same diagram
// as the mother trace.
:DISPlay:WINDow1:TRACe2:FEED 'LastExtr'
:CALCulate1:MATH:SDEFine 'Max (Data, Mem)'
:CALCulate1:MATH:STATE ON
```

#### // Single sweep mode

:INITIATE:CONTINUOUS OFF

```
// Do a single sweep and update trace with the current extremum.
// This is the last extremum for the next sweep
:INITIATE:IMMEDIATE; *WAI
:TRACe:COPY:MATH 'LastExtr', 'Trc1'
```

```
// Loop over these 2 commands
:INITIATE:IMMEDIATE; *WAI
:TRACe:COPY:MATH 'LastExtr', 'Trcl'
:INITIATE:IMMEDIATE; *WAI
:TRACe:COPY:MATH 'LastExtr', 'Trcl'
```

#### // Continuous sweep mode

:INITIATE:CONTINUOUS ON

#### 7.2.4.3 Retrieving the Results of Previous Sweeps

The commands CALCulate<Ch>:DATA:NSWeep...? SDATa,

<Trace\_Hist\_Count> retrieve the results of any sweep within a previously defined single sweep group. This means that, in single sweep mode, you can first measure a specified number of sweeps (SENSe<Ch>:SWEep:COUNt <sweeps>) and then read any of the data traces acquired.

This feature has no equivalent in manual control where always the last data trace is displayed.

#### // Reset the analyzer

```
*RST
:SYSTEM:DISPLAY:UPDATE ON
```

#### // Create a second channel with a second trace

```
:CALCULATE2:PARAMETER:SDEFINE "Trc2","S11"
:CALCULATE2:PARAMETER:SELECT "Trc2"
:DISPLAY:WINDOW2:STATE ON
:DISPLAY:WINDOW2:TRACE1:FEED 'Trc2'
```

#### // Select active trace for the created channel 2. Adjust the number of sweep points.

```
:CALCULATE2:PARAMETER:SELECT "Trc2"
:SENSE1:SWEEP:POINTS 3
:SENSE2:SWEEP:POINTS 4
```

#### // Set sweep time and sweep count for the channels

(3 traces per single sweep in channel 1, 4 traces in channel 2)

```
:SENSE1:SWEEP:TIME 1 S
:SENSE2:SWEEP:TIME 1 S
:SENSE1:SWEEP:COUNT 3
:SENSE2:SWEEP:COUNT 4
```

#### // 1st Alternative: Reverse reading with command synchronization

Select single sweep mode and measure a single sweep group for channels no. 1 and 2

```
:INITIATE:CONTinuous:ALL OFF
:INITIATE:IMMEDIATE:ALL; *WAI
```

Read trace data (without history, i.e. the last trace acquired in each channel)

```
:CALCULATE1:DATA? SDATA
:CALCULATE2:DATA? SDATA
```

Read last and previous trace data in channels 1 and 2

```
:CALCULATE1:DATA:NSWEEP? SDATA, 1 // last trace data
:CALCULATE1:DATA:NSWEEP? SDATA, 3 // previous trace data
:CALCULATE2:DATA:NSWEEP? SDATA, 1 // last trace data
:CALCULATE2:DATA:NSWEEP? SDATA, 4 // previous trace data
```

#### // 2nd Alternative: Forward reading (no command synchronization necessary)

Select single sweep mode and measure a single sweep group for channels no. 1

:INITIATE1:CONTinuous OFF :INITIATE1:IMMEDIATE

Read the first and the following trace data in channel 1

```
if (CALCULATE1:DATA:NSWEEP:COUNT? > 2)
:CALCULATE1:DATA:NSWEEP:FIRST? SDATA, 1 // first trace data
:CALCULATE1:DATA:NSWEEP:FIRST? SDATA, 3 // third trace data
```

#### 7.2.4.4 Exporting S-Parameters

The calibration defines which S-Parameters are allowed to be exported to a Touchstone file. In the following example a default (TOSM) calibration is created to make all S-Parameters available.

#### // Reset the analyzer

```
*RST
:SYSTEM:DISPLAY:UPDATE ON
:SENSel:CORRection:COLLect:METHod:DEFine 'Test', TOSM, 1, 2, 3, 4
:SENSel:CORRection:COLLect:SAVE:SELected:DEFault
```

#### // Initiate a complete sweep

```
:INITiate1:CONTinuous OFF; :INITiate:IMMediate;*WAI
:MMEMory:STORe:TRACe:PORTs 1, 'ParserTouchstonePorts.s1p', COMPlex, 2
:MMEMory:STORe:TRACe:PORTs 1, 'ParserTouchstonePorts.s2p', COMPlex, 3, 2
:MMEMory:STORe:TRACe:PORTs 1, 'ParserTouchstonePorts.s4p', COMPlex, 1, 4, 3, 2
```

#### 7.2.5 Calibration

The following programming examples are related to system error correction and power calibration.

#### 7.2.5.1 One and Two-Port Calibration

The following example calibrates one or two analyzer ports.

#### // Reset the analyzer

```
*RST
:SYSTEM:DISPLAY:UPDATE ON
```

#### // Set cal kit as active kit for N50

:SENSE:CORRECTION:CKIT:N50:SELECT 'ZV-Z121'

#### // Select connectors for the ports

:SENSE1:CORRECTION:COLLECT:CONNECTION1 N50MALE :SENSE1:CORRECTION:COLLECT:CONNECTION2 N50MALE

// Don't save the cal standard measurements with apply cal, i.e. with the commands

- // :SENSE1:CORRECTION:COLLECT:SAVE or
- // :SENSe1:CORRection:COLLect:SAVE:SELected

User Manual 1173.9163.02 - 13

// Instead, use the global, channel-independent setting: :SENSe:CORRection:COLLect:ACQuire:RSAVe:DEFault OFF

#### // Full one port = OSM

// Select cal procedure	
:SENSe1:CORRection:COLLect:METHod:DEFine	'Test SFK OSM 1', FOPORT, 1
// Measure Standards	
:SENSel:CORRection:COLLect:ACQuire:SELected	OPEN, 1
:SENSe1:CORRection:COLLect:ACQuire:SELected	SHORT, 1
:SENSel:CORRection:COLLect:ACQuire:SELected	MATCH, 1
// Apply cal	
:SENSe1:CORRection:COLLect:SAVE:SELected	

#### // 2 port TOSM

```
// Select cal procedure
:SENSel:CORRection:COLLect:METHod:DEFine 'Test SFK TOSM 12', TOSM, 1, 2
// Measure Standards
:SENSel:CORRection:COLLect:ACQuire:SELected THROUGH, 1, 2
:SENSel:CORRection:COLLect:ACQuire:SELected OPEN, 1
:SENSel:CORRection:COLLect:ACQuire:SELected SHORT, 1
:SENSel:CORRection:COLLect:ACQuire:SELected MATCH, 1
:SENSel:CORRection:COLLect:ACQuire:SELected OPEN, 2
:SENSel:CORRection:COLLect:ACQuire:SELected SHORT, 2
:SENSel:CORRection:COLLect:ACQuire:SELected SHORT, 2
:SENSel:CORRection:COLLect:ACQuire:SELected MATCH, 2
// Apply calibration
```

:SENSel:CORRection:COLLect:SAVE:SELected

#### // Save / load cal files

// Save calibration in calibration file pool

#### // the file name in the commands must not contain the path !

:MMEMORY:STORE:CORRection 1, 'OSM1 TOSM12.cal'

// load cal file from calibration file pool
:MMEMORY:LOAD:CORRection 1, 'OSM1 TOSM12.cal'

#### 7.2.5.2 Saving and Recalling Error Terms

The following examples show you how to perform a system error correction, save the acquired system error correction data to a file and re-load them.

#### Performing a Calibration, Saving the Error Terms

#### // Reset the analyzer

\*RST

#### // Set frequency range

```
:SENSel:FREQuency1:STARt 1GHz
:SENSel:FREQuency1:STOP 4GHz
:SENSel:SWEep:POINts 6
```

#### // Select calibration type: TOSM at ports 1 and 2

:SENSel:CORRection:COLLect:METHod:DEFine 'Test SFK TOSM 12', TOSM, 1, 2

```
// Measure Standards
:SENSel:CORRection:COLLect:ACQuire:SELected THROUGH, 1, 2
:SENSel:CORRection:COLLect:ACQuire:SELected OPEN, 1
:SENSel:CORRection:COLLect:ACQuire:SELected MATCH, 1
:SENSel:CORRection:COLLect:ACQuire:SELected OPEN, 2
:SENSel:CORRection:COLLect:ACQuire:SELected SHORT, 2
:SENSel:CORRection:COLLect:ACQuire:SELected MATCH, 2
```

#### // Apply calibration

SENSel:CORRection:COLLect:SAVE:SELected

#### // Save error terms

```
:FORMAT REAL, 32
@TRACEFILE:scorr1.dat
:CALCulate1:DATA? SCORr1
@TRACEFILE:scorr2.dat
:CALCulate1:DATA? SCORr2
@TRACEFILE:scorr3.dat
:CALCulate1:DATA? SCORr3
// We are omitting the isolation term, as it is not implemented
// @TRACEFILE:scorr4.dat
// :CALCulate1:DATA? SCORr4
@TRACEFILE:scorr5.dat
:CALCulate1:DATA? SCORr5
@TRACEFILE:scorr6.dat
:CALCulate1:DATA? SCORr6
@TRACEFILE:scorr7.dat
:CALCulate1:DATA? SCORr7
@TRACEFILE:scorr8.dat
:CALCulate1:DATA? SCORr8
@TRACEFILE:scorr9.dat
:CALCulate1:DATA? SCORr9
// We are omitting the isolation term, as it is not implemented
```

User Manual 1173.9163.02 - 13

```
// @TRACEFILE:scorr10.dat
// :CALCulate1:DATA? SCORr10
@TRACEFILE:scorr11.dat
:CALCulate1:DATA? SCORr11
@TRACEFILE:scorr12.dat
:CALCulate1:DATA? SCORr1
```

#### Performing a New Calibration, Recalling the Error Terms

#### // Reset the analyzer

\*RST

#### // Set frequency range

```
:SENSe1:FREQuency1:STARt 1GHz
:SENSe1:FREQuency1:STOP 4GHz
:SENSe1:SWEep:POINts 6
```

#### // Select calibration type: TOSM at ports 1 and 2

:SENSe1:CORRection:COLLect:METHod:DEFine 'XYZ', TOSM, 1, 2

#### // Generate a set of default correction data, switch on user calibration

```
:SENSe1:CORRection:COLLect:SAVE:SELected:DEFault
SENSE1:CORRECTION:STATE ON
\ensuremath{//} In the previous section, the following error terms were saved:
// SCORR1 Forward Directivity
// SCORR2 Forward Source Match
// SCORR3 Forward Reflection Tracking
// SCORR4 Forward Isolation
// SCORR5 Forward Load Match
// SCORR6 Forward Transmission Tracking
// SCORR7 Reverse Directivity
// SCORR8 Reverse Source Match
// SCORR9 Reverse Reflection Tracking
// SCORR10 Reverse Isolation
// SCORR11 Reverse Load Match
// SCORR12 Reverse Transmission Tracking
// Equivalences between the first parameter of CALculate:DATA
// and the first 3 Parameters of SENSe:CORRection:CDATa
// 'SCORR1' 'DIRECTIVITY', 1, 0 <Port 2> = 0 ignored
// 'SCORR2' 'SRCMATCH', 1, 0 <Port 2> = 0 ignored
// 'SCORR3' 'REFLTRACK', 1, 0 <Port 2> = 0 ignored
// 'SCORR4' 'ISOLATION', 1, 2
// 'SCORR5' 'LOADMATCH', 1, 2
// 'SCORR6' 'TRANSTRACK', 1, 2
```

// 'SCORR7' 'DIRECTIVITY', 2, 0 <Port 2> = 0 ignored

User Manual 1173.9163.02 - 13

```
// 'SCORR8' 'SRCMATCH', 2, 0 <Port 2> = 0 ignored
// 'SCORR9' 'REFLTRACK', 2, 0 <Port 2> = 0 ignored
// 'SCORR10' 'ISOLATION', 2, 1
// 'SCORR11' 'LOADMATCH', 2, 1
// 'SCORR12' 'TRANSTRACK', 2, 1
```

#### // Set format for data transfer

:FORMAT REAL, 32

#### // !!! Important !!! Stop sweep when loading error terms

:INITiate:CONTinuous OFF

#### // Recall error terms

```
// CALCulate:DATA is suitable for 2-port terms;
// use SENSe:CORRection:CDATa for more than 2 ports
:CALCulate1:DATA SCORR1,#@scorr1.dat
:CALCulate1:DATA SCORR2,#@scorr2.dat
:CALCulate1:DATA SCORR3,#@scorr3.dat
\ensuremath{\prime\prime}\xspace // We are omitting the isolation term, as it is not implemented on the ZVAB
//:CALCulate1:DATA SCORR4,#@scorr4.dat
:CALCulate1:DATA SCORR5,#@scorr5.dat
:CALCulate1:DATA SCORR6,#@scorr6.dat
:CALCulate1:DATA SCORR7,#@scorr7.dat
:CALCulate1:DATA SCORR8,#@scorr8.dat
:CALCulate1:DATA SCORR9,#@scorr9.dat
// We are omitting the isolation term, as it is not implemented on the ZVAB
//:CALCulate1:DATA SCORR10,#@scorr10.dat
:CALCulate1:DATA SCORR11,#@scorr11.dat
:CALCulate1:DATA SCORR12,#@scorr12.dat
:INITiate:CONTinuous ON
```

#### Using a Calibration Data Recorded Previously

You can re-use any set of correction data that you acquired in earlier sessions on your analyzer. In general you have to carry out the following steps:

- 1. Create a dummy correction data set and store it to a file.
- Replace the dummy data with your correction data.
- 3. Re-import the correction data file and apply it to a channel.

See also the program examples for the following commands:

- [SENSe<Ch>:]CORRection:COLLect:SAVE:SELected:DEFault (dummy system error correction)
- SOURce<Ch>: POWer<Pt>: CORRection: DEFault (dummy source power calibration without external power meter)

Errors during Firmware Operation

# 8 Error Messages and Troubleshooting

### 8.1 Errors during Firmware Operation

An error generally causes the analyzer to display a tooltip across the lower part of the screen. The tooltip provides a textual description of the error, e.g.:

Remote Error : -222,"Data out of range;FREQ:STAR 1"

The errors can be divided into three categories:

- Remote errors (SCPI errors) may occur during the execution of a remote control program. They include an error code, followed by the short description of the error. Remote errors are specified and described in the SCPI standard; they are cleared upon \*CLS.
- Software errors (setting errors) can occur e.g. if numeric entries in an analyzer dialog
  are incompatible with each other or with the current analyzer state. These errors are
  generally self-explanatory and easy to correct.
- Hardware errors indicate an incorrect hardware state. Some of the hardware errors cause the instrument to be switched off in order to avoid damage. Hardware errors with possible causes and remedies are listed in the following sections.



#### **Troubleshooting SCPI errors**

A misspelled command header causes SCPI error -113, "Undefined header;..."; a misspelled parameter causes SCPI error -141, "Invalid character data;...". The GPIB explorer provides a list of all supported commands and their character data parameters; see chapter 5.1.2, "GPIB Explorer", on page 454.

#### Hardware error categories

Hardware errors can be detected at various stages of the start-up or measurement procedure.

- Configuration errors occur on start-up of the analyzer, e.g. if a hardware module or configuration file cannot be detected. Configuration errors cause an entry in the error log ("SYSTEM > SETUP > Setup > Info... > Error Log").
- Asynchronous errors can occur any time while the analyzer is operating. The analyzer is checked periodically for asynchronous errors.
- Measurement errors are due to inadmissible hardware settings and states during the measurement process.

User Manual 1173.9163.02 - 13

### 8.1.1 Asynchronous Errors

Asynchronous errors can occur any time while the analyzer is operating. The analyzer is checked periodically for asynchronous errors. Many of these errors also cause an entry in the status reporting system.

Error	Description	Remedy	Bit no.*)
Instrument tempera- ture is too high	The analyzer detects that the instrument tempera- ture is too high. After three warnings, the analyzer is shut down.	Reduce ambient temperature, keep ventilation holes of the casing unob- structed.	7
Receiver overload protection tripped	The analyzer detects an excessive input level at one of the ports. If this condition persists, all internal and external generators are switched off (Channel – Power Bandwidth Average – RF Off).	Reduce RF input level at the port. Check amplifiers in the external test setup.	3
Reference frequency lock failure	With external reference signal (System – External Reference active) or option ZVAB-B4 (oven quartz), the reference oscillator is phase locked to a 10 MHz signal. The message appears when this phase locked loop (PLL) fails.	For external reference: check fre- quency and level of the supplied ref- erence signal.	1
Converter clock fre- quency lock failure	The clock generator for the AD converter clock is phase locked to the reference oscillator. The mes- sage appears when this PLL fails.	-	-
Oven cold	With option R&S ZVAB-B4, oven quartz: The oven temperature is too low.	Wait until the oven has been heated up	8

\*) The following bits in the STATUS:QUEStionable:INTegrity:HARDware register are set when the error occurs.

#### 8.1.2 Errors during Measurement

The following errors are due to inadmissible hardware settings and states during the measurement process. Some of the errors also cause an entry in the status reporting system.

Error	Description	Remedy	Bit no.*)
Unstable level con- trol at port <i></i>	The analyzer detects an excessive source level at one of the ports. The signal is turned off and the sweep halted.	Check signal path for the wave ai, especially check external components. Then press "Channel > Sweep > Sweep Control > Restart Sweep".	9
Problem concern- ing external gener- ator Gen <i></i>	An external generator has been configured, however, it cannot be controlled or provides error messages. If several generators cause problems, the lowest num- ber is indicated.	Check whether the generator is prop- erly connected and switched on. Check the GPIB address; exclude address conflicts when using several external generators or other equip- ment.	10

User Manual 1173.9163.02 - 13

Errors during Firmware Operation

Error	Description	Remedy	Bit no.*)
Problem concern- ing external power meter Pmet <i></i>	An external power meter has been configured, how- ever, it cannot be controlled or provides error mes- sages. If several power meters cause problems, the lowest number is indicated.	Check whether the power meter is properly connected and switched on. Check the GPIB address; exclude address conflicts when using several external power meters or other equip- ment.	11
Time grid too close	The sweep points for a time sweep are too close, the analyzer cannot process the measurement data until the next sweep point starts.	Increase stop time, reduce no. of points, increase IF bandwidth. If possi- ble reduce number of partial measure- ments, e.g. by restricting the number of ports measured.	12
Overload at DC MEAS <range></range>	The input voltage at one of the DC input connectors on the rear panel is too high.	Reduce input voltage.	13
Port <i> output power unleveled</i>	The level control is unsettled or unstable, possibly due to an external disturbing signal.	Change generator level at the port; check external components.	2

\*) The following bits in the STATUS:QUEStionable:INTegrity:HARDware register are set when the error occurs.

### 8.1.3 Obtaining Technical Support

The instrument generates error messages which in most cases will be sufficient for you to detect the cause of an error and find a remedy. Error message types are described in chapter 8, "Error Messages and Troubleshooting", on page 917.

In addition, our customer support centers are there to assist you in solving any problems that you may encounter with your network analyzer. We will find solutions more quickly and efficiently if you provide us with the information listed below. Simply open the relevant dialogs in the "Info" dialog, select "Save...", and send us the file.

- Setup Info: The instrument setup information ("Info > Setup Info") contains your instrument settings. You can also send us the VNA recall set file (\*.znx) that you generate after the fault occurs ("File > Recall Sets > Save...").
- Option Info: The option info ("Info > Option Info") informs us about the status of all software and hardware options of your analyzer.
- **Hardware Info:** The hardware info ("Info > Hardware Info") shows us the installed options and hardware assemblies.
- Error Log: The error log ("Info > Error Log") contains a chronological record of errors.
- Save Report: The system report command ("Info > Save Report") collects the setup, option, and hardware information as well as the error log and the current selftest results and writes everything to a \*.zip file. The \*.zip file also contains the current eeprom data and a screenshot of the VNA display. It is written to the report directory C:\Users\Public\Documents\Vna\Report. The file name contains the current date and time, e.g. report\_20110125\_1658.zip. "Save Report" provides the most comprehensive information, comprising all other "Info" files.

See also chapter 4.6.3, "Info (Dialog)", on page 427.

Errors during Firmware Installation/Update

# 8.2 Errors during Firmware Installation/Update

During firmware installation or update, if the installer encounters an error, the update is cancelled and the analyzer firmware is rolled back to its previous state.

Currently there is only one exception to this rule, which was implemented to gracefully recover from a failed FPGA update:

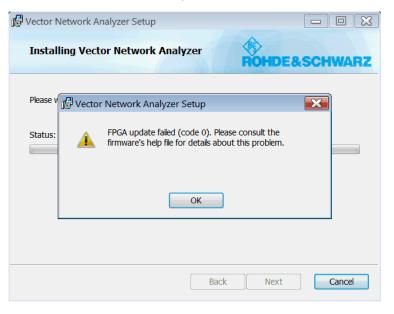


Fig. 8-1: FPGA update failure

In this case the installation proceeds but requires additional steps to be taken in order to perform the failed FPGA update manually.



No matter if the manual FPGA update described below is successful or not, write down the error code and contact our support.

- 1. Reboot the analyzer.
- 2. Exit the firmware.
- 3. Run the flash utility located at C:\Program Files\Rohde-Schwarz\Vector Network Analyzer\Bin\flash.exe and wait until the process has completed.

Errors during Firmware Installation/Update

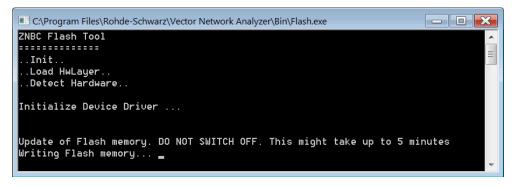


Fig. 8-2: FPGA flash tool

4. Turn off the analyzer (a reboot is not sufficient).

If successful, this procedure should bring the analyzer back to working condition.

# 9 Annexes

The following sections cover mostly hardware and service-related topics.

## 9.1 Interfaces and Connectors

This chapter provides a detailed description of the rear panel connectors of the R&S ZNB. For an overview of the rear panel connectors refer to section "Rear Panel Tour" in the Help or in the Getting Started guide. The front panel is described in section "Front Panel Tour".

### 9.1.1 Rear Panel Connectors

The rear panel of the R&S ZNB provides various connectors for external devices and control signals.

### 9.1.1.1 USER PORT

25-pole D-Sub connector used as an input and output for low-voltage (3.3 V) TTL control signals. Some of the USER PORT lines can be controlled via GPIB bus (see CONTrol Commands and OUTPut Commands).



Pin No.	Name	Input (I) or	Function
		Output (O)	
1	GNDD	-	Digital ground
2	EXT TRG	I	External trigger signal, 5 V tolerant *)
3	GNDD	-	Digital ground
4	BUSY	0	Measurement running
5	GNDD	-	Digital ground
6	READY FOR TRIG- GER	0	Measurement terminated, ready for trigger (not available for pulsed measurements)
7	GNDD	-	Digital ground
8	CHANNEL BIT 0	0	Channel-specific bit 0; see CONTrol:AUXiliary:C[:DATA] and OUTPut <ch>: UPORt[:VALue]</ch>
9	CHANNEL BIT 1	0	Channel-specific bit 1
10	CHANNEL BIT 2	0	Channel-specific bit 2

User Manual 1173.9163.02 - 13

Pin No.	Name	Input (I) or Output (O)	Function
11	CHANNEL BIT 3	0	Channel-specific bit 3
12	GNDD	-	Digital ground
13	PASS 1	0	Pass/fail result of limit check; TTL Out Pass 1 (see TTL 1 / 2 Pass )
14	PASS 2	0	Pass/fail result of limit check TTL Out Pass 2
15	GNDD	-	Digital ground
16	DRIVE PORT 1	0	Test port 1 is source port (drive port); see OUTPut <ch>: UPORt [:VALue]</ch>
17	DRIVE PORT 2	0	Test port 2 is source port (drive port)
18	DRIVE PORT 3	0	Test port 3 is source port (drive port)
19	DRIVE PORT 4	0	Test port 4 is source port (drive port)
20	GNDD	-	Digital ground
21	EXT GEN TRG	0	Control signal for external generator
22	EXT GEN BLANK	I	Handshake signal from external generator
23	GNDD	-	Digital ground
24	FOOT SWITCH 1	I	Control input A, 5 V tolerant
25	EXT TRG 2	I	External trigger 2 signal, 5 V tolerant

\*) Feeding in the external trigger signal via the BNC connector EXT TRIG IN is equivalent. The minimum pulse width of the trigger signals is 1  $\mu$ s.



### **EMI Suppression**

Use only double shielded cables or disconnect the input pins of the USER PORT connector in order to avoid spurious input signals which may cause undesirable events.

#### 9.1.1.2 USB



Double Universal Serial Bus connector of type A (master USB), used to connect e.g a keyboard, mouse or other pointing devices, the Calibration Unit (accessory R&S ZV-Z5x), a printer or external storage devices (USB stick, CD-ROM drive etc.).



### **USB** Connection

The length of passive connecting USB cables should not exceed 1 m. The maximum current per USB port is 500 mA. See also chapter "EMI Suppression" in the Help or in the Getting Started guide.

### 9.1.1.3 EXT TRIG OUT / IN



Two BNC female connectors for external trigger input or output signals; see "Free Run / External / Manual / Multiple Triggers" on page 388.

**Input signal:** The external trigger input signal must be a 3.3 V or 5 V TTL signal with a minimum pulse width of 1  $\mu$ s. The trigger input has a high input impedance (> 10 k $\Omega$ ).

**Output signal:** The R&S ZNB trigger output provides a configurable 5 V TTL trigger signal. The output impedance is approximately 50 Ohm.



### Trigger cables

Be aware that long trigger cables may cause signal reflections!

### 9.1.2 LAN Interface

To be integrated in a LAN, the instrument is equipped with a LAN interface, consisting of a RJ-45 connector, a network interface card and protocols. The network interface card supports IEEE 802.3 for a 10 Mbps Ethernet and IEEE 802.3u for a 100 Mbps Ethernet.

Instrument access is possible via the VXI-11 protocol. It is usually achieved from high level programming platforms by using the Virtual Instrument Software Architecture (VISA) library as an intermediate abstraction layer. VISA encapsulates the low level function calls and thus makes the transport interface transparent for the user. See also chapter 5.1, "Introduction to Remote Control", on page 453.

#### 9.1.2.1 VXI-11 Interface Messages

The following VXI-11 interface messages (also termed low-level control messages) are also supported by the GPIB Explorer.

Command	Meaning	Effect on the instrument
@DCL	Device Clear	Aborts the processing of the commands just received and sets the command processing software to a defined initial state. Does not change the instrument settings.
@GET	Group Execute Trigger	Triggers the active measurement sequence (e.g. a sweep). The effect of the command is the same as with that of a pulse at the external trigger signal input.
@LOC	Go to Local	Transition to the "local" state (manual control).
@REM	Go to Remote	Transition to the "remote" state (remote control).

### 9.1.3 GPIB Interface

The R&S ZNB can be equipped with a GPIB (IEC/IEEE) bus interface (option R&S ZNB-B10. The interface connector labeled "GPIB" is located on the rear panel of the instrument. The GPIB bus interface is intended for remote control of the R&S ZNB from a controller.




To be compliant with EMC regulations open IEEE cables should be avoided. IEEE cables must be connected on both sides.

### Characteristics of the interface

- 8-bit parallel data transfer
- Bidirectional data transfer
- Three-line handshake
- High data transfer rate of max. 1 MByte/s
- Up to 15 devices can be connected
- Maximum length of the connecting cables 15 m. The length of a single connecting cable should not exceed 2 m, if many devices are used, it should not exceed 1 m.
- Wired OR if several instruments are connected in parallel

#### Pin assignment

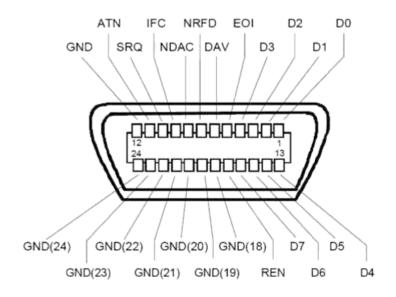

### **Bus lines**

- Data bus with 8 lines D0 to D7: The transmission is bit-parallel and byte-serial in the ASCII/ISO code. D0 is the least significant bit, D7 the most significant bit.
- Control bus with five lines:

**IFC** (Interface Clear): active LOW resets the interfaces of the instruments connected to the default setting.

**ATN** (Attention): active LOW signals the transmission of interface messages, inactive HIGH signals the transmission of device messages.

**SRQ** (Service Request): active LOW enables the connected device to send a service request to the controller.

**REN** (Remote Enable): active LOW permits switchover to remote control. **EOI** (End or Identify): has two functions in connection with ATN:

- ATN=HIGH active LOW marks the end of data transmission.
- ATN=LOW active LOW triggers a parallel poll.
- Handshake bus with three lines:

**DAV** (Data Valid): active LOW signals a valid data byte on the data bus. **NRFD** (Not Ready For Data): active LOW signals that one of the connected devices is not ready for data transfer.

**NDAC** (Not Data Accepted): active LOW signals that the instrument connected is accepting the data on the data bus.

The R&S ZNB provides several functions to communicate via GPIB bus. They are described in the following sections.

### 9.1.3.1 Interface Functions

Instruments which can be controlled via GPIB bus can be equipped with different interface functions. The interface function for the R&S ZNB are listed in the following table.

Control character	Interface function
SH1	Handshake source function (source handshake), full capability
AH1	Handshake sink function (acceptor handshake), full capability
L4	Listener function, full capability, de-addressed by MTA.
Т6	Talker function, full capability, ability to respond to serial poll, deaddressed by MLA
SR1	Service request function (Service Request), full capability
PP1	Parallel poll function, full capability
RL1	Remote/Local switch over function, full capability
DC1	Reset function (Device Clear), full capability
DT1	Trigger function (Device Trigger), full capability

### 9.1.3.2 Interface Messages

Interface messages are transmitted to the instrument on the data lines, with the attention line being active (LOW). They serve to communicate between controller and instrument.

#### Universal commands

Universal commands are encoded in the range 10 through 1F hex. They are effective for all instruments connected to the bus without previous addressing.

Command	QuickBASIC com- mand	Effect on the instrument
DCL (Device Clear)	IBCMD (controller %, CHR\$(20))	Aborts the processing of the commands just received and sets the command processing software to a defined initial state. Does not change the instrument settings.
IFC (Interface Clear)	IBSIC (controller%)	Resets the interfaces to the default setting.
LLO (Local Lockout)	IBCMD (controller %, CHR\$(17))	The LOC/IEC ADDR key is disabled.
SPE (Serial Poll Enable)	IBCMD (controller %, CHR\$(24))	Ready for serial poll
SPD (Serial Poll Disable)	IBCMD (controller %, CHR\$(25))	End of serial poll
PPU (Parallel Poll Unconfigure)	IBCMD (controller %, CHR\$(21))	End of the parallel-poll state

### Addressed commands

Addressed commands are encoded in the range 00 through 0F hex. They are only effective for instruments addressed as listeners.

Command	QuickBASIC com- mand	Effect on the instrument
GET (Group Execute Trigger)	IBTRG (device%)	Triggers a previously active device function (e.g. a sweep). The effect of the command is the same as with that of a pulse at the external trigger signal input.
GTL (Go to Local)	IBLOC (device%)	Transition to the "Local" state (manual control)
PPC (Parallel Poll Con- figure)	IBPPC (device%, data%)	Configures the instrument for parallel poll. Additionally, the QuickBASIC command executes PPE/PPD.
SDC (Selected Device Clear)	IBCLR (device%)	Aborts the processing of the commands just received and sets the command processing software to a defined initial state. Does not change the instrument setting.

### 9.1.3.3 Instrument Messages

Instrument messages (commands) are transferred on the data lines of the GPIB bus while the ATN line is not active. ASCII code is used.

Structure and syntax of the instrument messages are described in chapter 6, "Command Reference", on page 492. The chapter also provides a detailed description of all messages implemented by the analyzer.

### 9.1.4 Universal Interface

A network analyzer which is equipped with option R&S ZN-B14, Handler I/O (Universal Interface), can interact with an external part handler. The digital control signals on the interface connector indicate the possible start and the end of a measurement, as well as a global limit check result. Typically, the handler will insert the device to be tested into a test fixture, provide a trigger pulse to initiate the measurement, remove and replace the device after the measurement is complete and sort it into pass/fail bins. A sample flow diagram for this process is shown below.

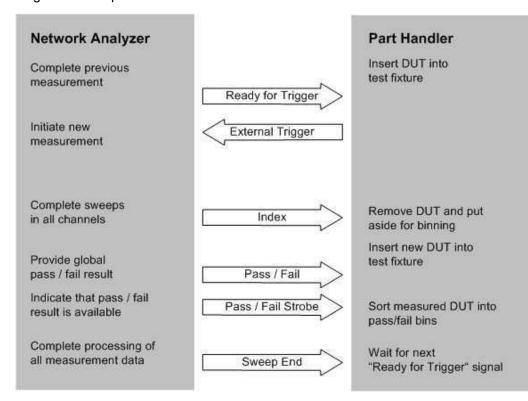


Fig. 9-1: Possible stages of an automated test

### Preparation of the network analyzer and the part handler

The network analyzer configuration depends on the measurement to be made. Starting from the preset state, you will usually have to adjust the following settings:

- 1. Enable external trigger: "CHANNEL > TRIGGER > Trigger > External"
- (Optional:) Select single sweep mode: "CHANNEL > SWEEP > Sweep Control > Single"
- 3. Define limit lines and enable the limit check: "TRACE > LINES > Limit Test > ..."

The Universal Interface connector must be connected to the part handler using an appropriate cable. If required, configure the data ports to ensure that the network analyzer and the part handler are compatible.

### 9.1.4.1 Control Signals

Most of the signals in the figure below are controlled by the measurement. It is possible though to query the transitions of the "Input 1" signal, to configure the "Output 1", "Output 2", "Sweep End", and "Pass/Fail" signals and to route the "Index" and "Ready for Trigger " signals using SCPI commands.

- CONTrol:HANDler:INPut? queries the high to low transitions of the "Input 1" signal.
- The CONTrol:HANDler:OUTPut<Pt>... commands set the output signals to a definite state and specify whether this state will change to "Low" when the Input 1 signal goes to "Low". This mechanism provides either static output signals or output signals which are controlled by Input 1.
- The "Index" and "Ready for Trigger" signals can be routed to pins 20 and 21 of the Universal Interface connector, where they replace the PORT B6 and PORT B7 input/ output signals. See chapter 9.1.4.2, "Data Ports", on page 929.
- The CONTrol: HANDler: PASSfail... commands configure the "Pass/Fail" signal and query the global pass/fail status of the last measurement.

CONTrol:HANDler:INPut?	Input 1	
CONTrol:HANDler:OUTPut1[:DATA]? CONTrol:HANDler:OUTPut1:USER?	Output 1	CONTrol:HANDler:OUTPut1[:DATA] 0   1 CONTrol:HANDler:OUTPut1:USER 0   1
CONTrol:HANDler:OUTPut2[:DATA]? CONTrol:HANDler:OUTPut2:USER?	Output 2	CONTrol:HANDler:OUTPut2[:DATA] 0   1 CONTrol:HANDler:OUTPut2:USER 0   1
		CONTrol:HANDler[:EXTension]:INDex:STATe ON CONTrol:HANDler:RESet
	Ready for Trigger	CONTrol:HANDler[:EXTension]:RTRigger:STATe ON CONTrol:HANDler:RESet
	Sweep End	CONTrol:HANDler:SWEepend
	Pass / Fail	CONTrol:HANDler:PASSfail:LOGic CONTrol:HANDler:PASSfail:MODE CONTrol:HANDler:PASSfail:POLicy
	Pass / Fail Strobe	CONTrol:HANDler:PASSfail:SCOPe CONTrol:HANDler:PASSfail:STATus?
	+5 V, max. 0.1 A	

Fig. 9-2: Control signals and power supply

SCPI commands: See chapter 6.3.3, "CONTrol Commands", on page 598

### 9.1.4.2 Data Ports

In addition to the control signals, the Universal Interface provides four bi-directional data ports A, B, C, D. The data ports must be configured explicitly using SCPI commands; they are not controlled by the measurement.

- With an output data port you can configure the part handler or other devices used in testing from the network analyzer.
- With an input data port you can configure the network analyzer using external signals and an appropriate control program.

Device configurations via data port signals are usually performed in a preliminary stage, prior to the actual measurement sequence. If the "Index" and "Ready for Trigger" signals are enabled at this stage (see chapter 9.1.4.1, "Control Signals", on page 929), they replace the PORT B6 and PORT B7 signals. Port B can still be used as a 6-bit parallel input/output port.

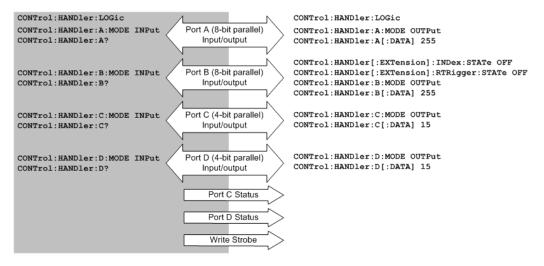


Fig. 9-3: Data ports and related signals

### Combined ports (ports E, F, G, H)

A combination of ports A / B and ports C /D provides two additional 16-bit and 8-bit-wide bidirectional ports. The combined ports are termed ports E and F, respectively. A combination of ports A / B / C and ports A / B / C / D provides two 20-bit and 24-bit-wide bidirectional ports. These combined ports are termed ports G and H.

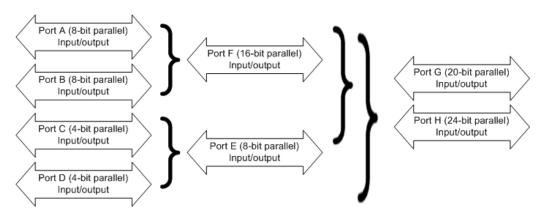


Fig. 9-4: Definition of ports E, F, G, H

The properties of the combined ports are as follows:

 The signal direction (input or output) is according to the configuration of ports A, B, C, and D. E.g. to write data to port G (H), ports A, B, and C (A, B, C, and D) must be configured as output ports.

User Manual 1173.9163.02 - 13

- Data can be read and written using the CONTrol:HANDler:E|F|G|H[:DATA] commands.
- The bit order is D3 ... D0 C3 ... C0 (port E), B7 ... B0 A7 ... A0 (port F), C3 ... C0 B7 ... B0 A7 ... A0 (port G), and D3 ... D0 C3 ... C0 B7 ... B0 A7 ... A0 (port H).

SCPI commands: See chapter 6.3.3, "CONTrol Commands", on page 598

### 9.1.4.3 Universal Interface Connector

Option R&S ZN-B14, Handler I/O (Universal Interface), must be installed by an R&S service representative. The option includes a Centronics 36 input/output connector which is placed in the right-hand part of the network analyzer's rear panel. The pin assignment of the connector is shown below. A slash (/) at the beginning of the signal name indicates that it is an active low (negative logic) signal.

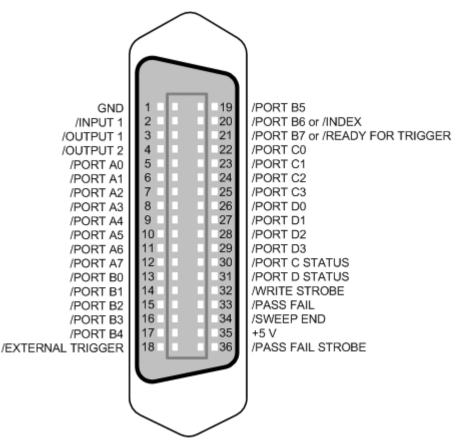


Fig. 9-5: Pin assignment of the Universal Interface connector

The input and output signals at the connector are described below.

Interfaces and Connectors

Pin No.	Signal	Input (I) or Output (O)	Description
1	GND	-	Ground
2	/INPUT 1	I	When a negative pulse is fed to this port, the /OUTPUT 1 and /OUTPUT 2 signals (pins no. 3 and 4) change to "Low".
3	/OUTPUT 1	0	Changes to "Low" when the /INPUT 1 (pin no. 2) receives a negative pulse.
4	/OUTPUT 2	0	Changes to "Low" when the /INPUT 1 (pin no. 2) receives a negative pulse.
5	/PORT A0	l or O	Port A, bit no. 0 (8-bit parallel input or output port)
6	/PORT A1	l or O	Port A, bit no. 1
7	/PORT A2	l or O	Port A, bit no. 2
8	/PORT A3	l or O	Port A, bit no. 3
9	/PORT A4	l or O	Port A, bit no. 4
10	/PORT A5	l or O	Port A, bit no. 5
11	/PORT A6	l or O	Port A, bit no. 6
12	/PORT A7	l or O	Port A, bit no. 7
13	/PORT B0	l or O	Port B, bit no. 0 (8-bit parallel input or output port)
14	/PORT B1	l or O	Port B, bit no. 1
15	/PORT B2	l or O	Port B, bit no. 2
16	/PORT B3	l or O	Port B, bit no. 3
17	/PORT B4	l or O	Port B, bit no. 4
18	/EXTERNAL TRIGGER	I	External trigger signal
19	/PORT B5	l or O	Port B, bit no. 5
20	/PORT B6 or	l or O	Port B, bit no. 6
	/INDEX	0	The /INDEX signal changes to "Low" when a measurement is complete (all sweeps in all channels have been performed; the DUT can be removed, but the measurement results may not be valid yet).
21	/PORT B7 or	l or O	Port B, bit no. 7
	/READY FOR TRIGGER	0	The /READY FOR TRIGGER signal changes to "Low" when the analyzer is ready to receive a trigger for a new measurement.
22	/PORT C0	l or O	Port C, bit no. 0 (4-bit parallel input or output port)
23	/PORT C1	l or O	Port C, bit no. 1
24	/PORT C2	l or O	Port C, bit no. 2
25	/PORT C3	l or O	Port C, bit no. 3
26	/PORT D0	l or O	Port D, bit no. 0 (4-bit parallel input or output port)
27	/PORT D1	l or O	Port D, bit no. 1
28	/PORT D2	l or O	Port D, bit no. 2

User Manual 1173.9163.02 - 13

Pin No.	Signal	Input (I) or Output (O)	Description
29	/PORT D3	l or O	Port D, bit no. 3
30	/PORT C STA- TUS	0	Indicates the status of port C: • Low: port C is an input port • High: port C is an output port
31	/PORT D STA- TUS	0	Indicates the status of port D: • Low: port D is an input port • High: port D is an output port
32	/WRITE STROBE	0	Changes to "Low" when valid data is present at any of the output ports (i.e. when the output level at any port changes).
33	/PASS FAIL	0	<ul> <li>Indicates the status of the global limit check for the last measurement:</li> <li>Low: global limit check failed</li> <li>High: global limit check passed</li> <li>Other configurations are possible; see CONTrol:HANDler:PASSfail commands.</li> </ul>
34	/SWEEP END	0	Indicates the end of the measurement. Changes to "Low" after all sweeps in all channels have been completed and the measurement data has been processed. Alternative configurations: see CONTrol:HANDler:SWEepend.
35	+5 V DC	0	DC power supply for external devices; +5 V $\pm$ 250 mV, max. 0.1 A
36	/PASS FAIL STROBE	0	Changes to "Low" when limit check results are present on /PASS FAIL (pin no. 33).

All digital input signals must be TTL compatible with an allowed input voltage range between -0.5 V and +5.5 V. The circuit diagram of the input path is shown below.

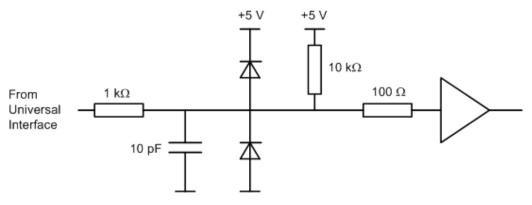


Fig. 9-6: Circuit diagram of the input path

Digital output signals are low-voltage TTL compatible with output voltages between 0 V and +3.3 V. The circuit diagram of the output path is shown below.

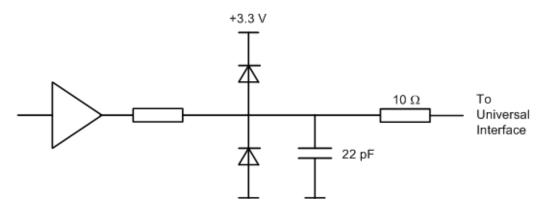


Fig. 9-7: Circuit diagram of the output path

The default configuration of the signals is listed below. Notice that \*RST or "Preset" do not change the configuration of the Universal Interface. Use CONTrol:HANDler: RESet to restore default values.

Signal	*RST Configuration
Port A, Port B	Output ports, all bits "High" (decimal 0)
Port C, Port D	Input ports
/PORT C STATUS, /PORT D STATUS	"Low"
/OUTPUT 1, /OUTPUT 2	"High"
/SWEEP END	"High"
/PASS_FAIL	"High"

SCPI commands: CONTrol: HANDler: RESet (resets all configurable signals)

### 9.1.4.4 Timing of Control Signals

The timing of the essential measurement control signals is shown in the figure below. The duration of the shaded time intervals depends on the measurement settings.

#### Annexes

Maintenance

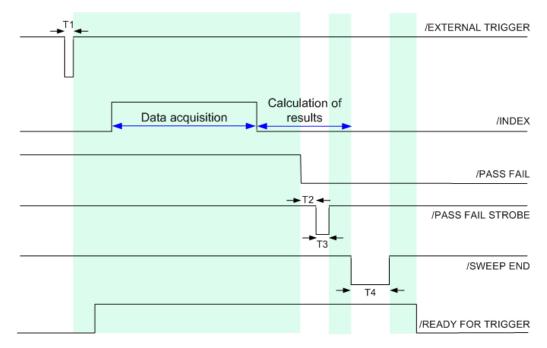


Fig. 9-8: Timing of measurement control signals

The figure above corresponds to the default configuration of the /PASS FAIL signal. For alternative configurations refer to the documentation of the

CONTrol:HANDler:PASSfail... commands in chapter 6.3.3, "CONTrol Commands", on page 598. The figure contains the following pulse durations and response times.

Time	Description	Value
T1	Pulse duration of /EXTERNAL TRIGGER	Minimum value: 1 µs
T2	Response time of /PASS FAIL STROBE	1 µs
ТЗ	Pulse duration of /PASS FAIL STROBE	1 µs
T4	Pulse duration of /SWEEP END	12 µs

The timing of the data port signals and the input/output signals is as follows:

- The low pulse of the /WRITE STROBE signal occurs approx. 0.1 µs after a value is written to the output ports A to D. The pulse duration of the /WRITE STROBE signal is 1 µs.
- The low pulse of the /OUTPUT 1 or /OUTPUT 2 signals (if enabled) occur approx.
   0.6 µs after the falling edge of the /INPUT 1 signal.

## 9.2 Maintenance

The R&S ZNB vector network analyzer does not require any special maintenance.

For our support center address and a list of useful R&S contact addresses refer to the documentation CD-ROM or the "Contact" page at the beginning of the Help system.

### 9.2.1 Storing and Packing the Instrument

The vector network analyzer can be stored at the temperature range quoted in the data sheet. When it is stored for a longer period of time the unit should be protected against dust.

### 9.2.2 Replacing Fuses

The optional DC inputs BIAS <no> at the rear panel (option R&S ZNB-B1) are each protected by a fuse (0.250 A, F IEC60127-2/2, stock no. 0020.7246.00).

### A WARNING

### Shock hazard

Before replacing a fuse, make sure that the instrument is switched off and disconnected from all power supplies.

Always use fuses supplied by Rohde & Schwarz as spare parts, or fuses of the same type and rating.

▶ To replace the fuses open the fuse holder by slightly turning the lid counterclockwise.

## 9.3 Showroom Mode

In "Showroom Mode" the R&S ZNB uses a configurable recall set whenever the device is (re-)started or the PRESET key is pressed. However, it can only be enabled by directly editing the Windows registry.

- 1. Run the R&S ZNB and configure it as required for the intended showroom operation.
- Save the configuration as described in chapter 4.1.1, "File > Recall Sets", on page 142. If necessary, move the recall set (\*.znx file) to the appropriate location.
- Under the registry key HKEY\_LOCAL\_MACHINE/SOFTWARE/Rohde-Schwarz/Vna create a new subkey ShowroomMode.
- 4. Within the ShowroomMode-subkey, create the string value ShowroomSetup.
- Modify the value ShowroomSetup: set its value data to the full path of the recall set. Use forward slashes as path separators, e.g. "C:/Documents and Settings/All Users/ Rohde-Schwarz/Vna/RecallSets/ShowroomSet1.znx".

After the analyzer is restarted or "Preset", the specfied recall set is loaded.

User Manual 1173.9163.02 - 13

# **Glossary: Frequently Used Terms**

A

Active channel: Channel belonging to the active trace. The active channel is highlighted in the channel list below the diagram. The active channel is not relevant in remote control where each channel can contain an active trace.

Active marker: Marker that can be changed using the settings of the Marker menu (Delta Mode, Ref. Mkr -> Mkr, Mkr Format). The active marker is also used for the Marker Functions. It appears in the diagram with an enlarged marker symbol and font size and with a dot placed in front of the marker line in the info field.

Active menu: The menu containing the last executed command. If the softkey bar is displayed (Display - Config./View - Softkey Labels on), then the active menu is indicated on top of the softkey bar.

Active trace (manual control): Trace that is selected to apply the settings in the Trace menu. The active trace is highlighted in the trace list of the active diagram area. It can be different from the active trace in remote control.

Active trace (remote control): One trace of each channel that has been selected as the active trace (CALCulate<Ch>: PARameter:SELect <trace name>). Many commands (e.g. TRACE...) act on the active trace. It can be different from the active trace in manual control.

### С

**Calibration:** The process of removing systematic errors from the measurement (system error correction). See also TOSM, TOM, TRM, TRL, TNA...

Calibration kit: Set of physical calibration standards for a particular connector family.

**Calibration standard:** Physical device that has a known or predictable magnitude and phase response within a given frequency range. Calibration standards are grouped into several types (open, through, match,...) corresponding to the different input quantities for the analyzer's error models.

**Calibration unit:** Integrated solution for automatic calibration of 1 to 4 ports (accessory R&S ZV-Zxx). The unit contains calibration standards that are electronically switched when a calibration is performed.

**Cal pool:** The cal pool is a collection of correction data sets (cal groups) that the analyzer stores in a common directory. Cal groups in the pool can be applied to different channels and recall sets.

**Channel:** A channel contains hardware-related settings to specify how the network analyzer collects data. Each channel is stored in an independent data set. The channel set-

tings complement the definitions of the Trace menu; they apply to all traces assigned to the channel.

**Compression point:** The x-dB compression point of an S-parameter or ratio is the stimulus signal level where the magnitude of the measured quantity has dropped by x dB compared to its value at small stimulus signal levels (small-signal value).

**Confirmation dialog box:** Standard dialog box that pops up to display an error message or a warning. The current action can be either continued (OK) or cancelled (Cancel) on closing the dialog box.

**Crosstalk:** The occurrence of a signal at the receive port of the analyzer which did not travel through the test setup and the DUT but leaks through other internal paths. Crosstalk causes an isolation error in the measurement which can be corrected by means of a calibration.

**CW frequency:** Continuous Wave frequency; fixed stimulus frequency used in Power, CW Time and CW Mode sweeps.

#### D

**Data trace:** Trace filled with measurement data and updated after each sweep (dynamic trace).

**Diagram area:** Rectangular portion of the screen used to display traces. Diagram areas are arranged in windows; they are independent of trace and channel settings.

**Directivity error:** Measurement error caused by a coupler or bridge in the analyzer's source port causing part of the generated signal to leak through the forward path into the receive path instead of being transmitted towards the DUT. The directivity error can be corrected by means of a full one port calibration or one of the two-port calibration methods (except normalization).

**Discrete marker:** The stimulus value of a discrete marker always coincides with a sweep point so that the marker does not show interpolated measurement values.

**DUT:** Device under test; generic term for any electrical device or circuit which the vector network analyzer can measure. Typical DUTs are filters, amplifiers, or mixers.

### Ε

**Excursion:** Difference between the response values at a local maximum (minimum) of the trace and at the two closest local minima (maxima) to the left and to the right.

**Extrapolation:** Calculation of a numeric value for a new sweep point outside the original sweep range from the numeric values of the existing sweep points. The analyzer can extrapolate calibration data, transmission coefficients etc. in order to extend the sweep range. If not otherwise stated, the numeric value of the first (last) sweep point is assigned to all new points below (above) the original sweep range. See also --> interpolation.

F

**Forward:** A measurement on a two-port DUT is said to be in forward direction if the source signal (stimulus) is applied to port 1 of the DUT.

Η

**Harmonic:** Integer multiple of the fundamental frequency. The fundamental is the first harmonic, the nth harmonic is n times the frequency of the fundamental.

**Harmonic distortion:** The production of harmonic frequencies (harmonics) by an electronic system when a signal is applied at the input.

**Harmonic grid:** A set of equidistant frequency points  $f_i$  (I = 1...n) with spacing Delta(f) and the additional condition that  $f_1$  = Delta(f). A harmonic grid is required for low pass time domain transforms.

### I

**Intercept point:** Fictitious lower-tone DUT input/output level where the intermodulation suppression (-->) for a given intermodulation product reaches 0 dB.

**Intermodulation measurement:** Measurement where the DUT is supplied with two RF signals of equal power but different frequencies termed the upper and lower tone. The analyzer measures the frequency-converting behavior of the DUT (--> intermodulation product).

**Intermodulation product:** Special type of emissions of a nonlinear DUT that is supplied with a two-tone RF signal (--> intermodulation measurement). The intermodulation products occur at frequencies which correspond to sums and differences of the upper and lower tone frequencies and their integer multiples.

**Intermodulation suppression:** The ratio of the power of an --> intermodulation product to the power of the lower tone fundamental wave.

**Interpolation:** Calculation of a numeric value for a specific sweep point from the numeric values of the adjacent points. The analyzer can interpolate calibration data, transmission coefficients etc. in order to account for a modified set of sweep points. If not otherwise stated, linear interpolation is used. See also --> extrapolation.

**Isolation error:** Measurement error caused by a crosstalk between the source and receive port of the analyzer.

L

**Limit check:** Comparison of the measurement results with the limit lines and display of a pass/fail indication. An acoustic warning can be generated in addition if a limit is exceeded.

**Limit line:** A limit line is a set of data to specify the allowed range for some or all points of a trace. Typically, limit lines are used to check whether a DUT conforms to the rated specifications (conformance testing).

**Load match error:** Measurement error caused by a mismatch of the analyzer's receive (load) port causing part of the signal transmitted through the DUT to be reflected off the receive port so that it is not measured there. The load match error can be corrected by means of a two-port calibration (except normalization).

Μ

**Marker:** Tool for selecting points on the trace and for numerical readout of measured data. A marker is displayed with a symbol (a triangle, a crossbar or a line) on the trace; its coordinates are shown in the marker info field.

**Mathematical trace:** Trace that is calculated according to a mathematical expression, e.g. the one defined in the Define Math dialog. The expression is a mathematical relation between constants and the data or memory traces of the active recall set.

**Measurement point:** Result of the measurement at a specified stimulus value (frequency/power/time).

**Measurement result:** Set of all measurement points acquired in a measurement (e.g. a sweep). The measurement result is displayed in a diagram area and forms a trace.

**Memory trace:** Trace that is associated to a data trace and stored in the memory. Data traces and the associated memory traces share the same channel and scale settings. Alternatively, memory traces can be imported from a file.

**Mixer:** Device that converts an RF signal at one frequency into a signal at another frequency. The frequency that is to be shifted is applied at the RF input and the frequency shifting signal (from a local oscillator, LO) is applied to the RF mixer's LO port, resulting in an output signal at the mixer's Intermediate Frequency (IF) port.

Ρ

**Partial measurement:** Measurement at a specified stimulus value maintaining definite hardware settings. Depending on the measurement type, several partial measurements may be needed to obtain a measurement point. A full n-port S-parameter measurement requires n partial measurements with n different drive ports.

**Peak:** Local maximum or local minimum (dip) on the trace. In the Trace - Search menu, it is possible to define a minimum excursion that both types of peaks must have to be considered valid.

R

**Recall Set:** A recall set comprises a set of diagram areas with all displayed information that can be stored to a VNA recall set file (\*.znx). Each recall set is displayed in an independent tab.

**Reflection tracking error:** Frequency-dependent variation of the ratio of the reflected wave to the reference wave at a test port when an ideal reflection coefficient (= 1) is measured. The reflection tracking error can be corrected by means of a reflection normalization or one of the more sophisticated calibration methods.

**Reverse:** A measurement on a two-port DUT is said to be in reverse direction if the source signal (stimulus) is applied to port 2 of the DUT.

S

**Source match error**: Measurement error caused by a mismatch of the analyzer's source port causing part of the signal reflected off the DUT to be reflected again off the source port so that it is not measured there. The source match error can be corrected by means of a full one-port calibration or a two-port calibration (except normalization).

**Stimulus value:** Value of the sweep variable (frequency/power/time/point number) where a measurement is taken. Also termed sweep point.

**Sweep:** Series of consecutive measurements taken at a specified sequence of stimulus values = series of consecutive measurement points.

**Sweep point:** Value of the sweep variable (stimulus value: frequency/power/time) where a measurement is taken.

**Sweep range:** Continuous range of the sweep variable (frequency/power/time) containing the sweep points where the analyzer takes measurements. In a Segmented Frequency sweep the sweep range can be composed of several parameter ranges or single points.

**Sweep segment:** Continuous frequency range or single frequency point where the analyzer measures at specified instrument settings (generator power, IF bandwidth etc.). In the Segmented Frequency sweep type the entire sweep range can be composed of several sweep segments.

Т

**TNA:** A calibration type using a Through, a symmetric Network and an Attenuation standard. The properties of the Network and the Attenuation don't have to be known exactly. Like TRL and TRM, TNA is especially useful for DUTs in planar line technology.

**TOM:** A calibration type using three fully known standards (Through, Open, Match), recommended for 2-port measurements on coaxial systems.

**Topology:** Assignment of the physical ports of the VNA to the logical ports used for the measurement of mixed mode S-parameters (balance-unbalance conversion).

**TOSM:** A calibration type using a Through plus the one-port standards Open, Short, Match, to be connected to each calibrated port. Classical 12-term error model, also referred to as SOLT. See also UOSM.

**TRL:** A calibration type using the two-port standards Through and Line, which are both assumed to be ideally matched. Beyond that, the through must be lossless, and its length must be exactly known. Especially useful for DUTs in planar line technology.

**TRM:** A calibration type which requires a low-reflection, low-loss Through standard with an electrical length that may be different from zero, a Reflect, and a Match. Especially useful for DUTs in test fixtures.

**TSM:** A calibration type using three fully known standards (Through, Short, Match), recommended for 2-port measurements on coaxial systems.

U

**UOSM:** A variant of TOSM calibration using an unknown but reciprocal Through standard. Especially for port combinations with different connector types.

V

VNA: (Vector) Network Analyzer, in particular the R&S ZNB.

# List of Commands

CALCulate:CLIMits:FAIL?	496
CALCulate:DATA:ALL?	499
CALCulate:DATA:DALL?	500
CALCulate:DATA:TRACe?	503
CALCulate:FILTer[:GATE]:TIME:AOFFset	505
CALCulate:PARameter:DELete:ALL	549
CALCulate <ch>:DATA:CALL:CATalog?</ch>	500
CALCulate <ch>:DATA:CALL?</ch>	500
CALCulate <ch>:DATA:SGRoup?</ch>	503
CALCulate <ch>:PARameter:CATalog?</ch>	546
CALCulate <ch>:PARameter:DEFine</ch>	867
CALCulate <ch>:PARameter:DEFine:SGRoup</ch>	547
CALCulate <ch>:PARameter:DELete</ch>	549
CALCulate <ch>:PARameter:DELete:CALL</ch>	549
CALCulate <ch>:PARameter:DELete:SGRoup</ch>	550
CALCulate <ch>:PARameter:MEASure</ch>	550
CALCulate <ch>:PARameter:SDEFine</ch>	551
CALCulate <ch>:PARameter:SELect</ch>	553
CALCulate <ch>:TRANsform:VNETworks:BALanced:DEEMbedding<logpt>:PARameters:C<cmp></cmp></logpt></ch>	579
CALCulate <ch>:TRANsform:VNETworks:BALanced:DEEMbedding<logpt>:PARameters:L<cmp></cmp></logpt></ch>	580
CALCulate <ch>:TRANsform:VNETworks:BALanced:DEEMbedding<logpt>:PARameters:R<cmp></cmp></logpt></ch>	580
CALCulate <ch>:TRANsform:VNETworks:BALanced:DEEMbedding<logpt>:TNDefinition</logpt></ch>	582
CALCulate <ch>:TRANsform:VNETworks:BALanced:DEEMbedding<logpt>[:STATe]</logpt></ch>	581
CALCulate <ch>:TRANsform:VNETworks:BALanced:EMBedding<logpt>:PARameters:C<cmp></cmp></logpt></ch>	582
CALCulate <ch>:TRANsform:VNETworks:BALanced:EMBedding<logpt>:PARameters:L<cmp></cmp></logpt></ch>	583
CALCulate <ch>:TRANsform:VNETworks:BALanced:EMBedding<logpt>:PARameters:R<cmp></cmp></logpt></ch>	583
CALCulate <ch>:TRANsform:VNETworks:BALanced:EMBedding<logpt>:TNDefinition</logpt></ch>	585
CALCulate <ch>:TRANsform:VNETworks:BALanced:EMBedding<logpt>[:STATe]</logpt></ch>	584
CALCulate <ch>:TRANsform:VNETworks:SENDed:DEEMbedding<phypt>:PARameters:C<cmp></cmp></phypt></ch>	585
CALCulate <ch>:TRANsform:VNETworks:SENDed:DEEMbedding<phypt>:PARameters:L<cmp></cmp></phypt></ch>	586
CALCulate <ch>:TRANsform:VNETworks:SENDed:DEEMbedding<phypt>:PARameters:R<cmp></cmp></phypt></ch>	
CALCulate <ch>:TRANsform:VNETworks:SENDed:DEEMbedding<phypt>:TNDefinition</phypt></ch>	
CALCulate <ch>:TRANsform:VNETworks:SENDed:DEEMbedding<phypt>[:STATe]</phypt></ch>	
CALCulate <ch>:TRANsform:VNETworks:SENDed:EMBedding<phypt>:PARameters:C<cmp></cmp></phypt></ch>	
CALCulate <ch>:TRANsform:VNETworks:SENDed:EMBedding<phypt>:PARameters:L<cmp></cmp></phypt></ch>	
CALCulate <ch>:TRANsform:VNETworks:SENDed:EMBedding<phypt>:PARameters:R<cmp></cmp></phypt></ch>	
CALCulate <ch>:TRANsform:VNETworks:SENDed:EMBedding<phypt>:TNDefinition</phypt></ch>	
CALCulate <ch>:TRANsform:VNETworks:SENDed:EMBedding<phypt>[:STATe]</phypt></ch>	
CALCulate <chn>:DATA</chn>	
CALCulate <chn>:DATA:NSWeep:COUNt?</chn>	
CALCulate <chn>:DATA:NSWeep:FIRSt?</chn>	
CALCulate <chn>:DATA:NSWeep[:LAST]?</chn>	
CALCulate <chn>:DATA:STIMulus?</chn>	
CALCulate <chn>:DLINe</chn>	
CALCulate <chn>:DLINe:STATe</chn>	504

CALCulate <chn>:FILTer[:GATE]:TIME:CENTer</chn>	505
CALCulate <chn>:FILTer[:GATE]:TIME:DCHebyshev</chn>	506
CALCulate <chn>:FILTer[:GATE]:TIME:SHAPe</chn>	506
CALCulate <chn>:FILTer[:GATE]:TIME:SHOW</chn>	507
CALCulate <chn>:FILTer[:GATE]:TIME:SPAN</chn>	507
CALCulate <chn>:FILTer[:GATE]:TIME:STARt</chn>	
CALCulate <chn>:FILTer[:GATE]:TIME:STATe</chn>	
CALCulate <chn>:FILTer[:GATE]:TIME:STOP</chn>	
CALCulate <chn>:FILTer[:GATE]:TIME:WINDow</chn>	
CALCulate <chn>:FILTer[:GATE]:TIME[:TYPE]</chn>	
CALCulate <chn>:FORMat</chn>	
CALCulate <chn>:FORMat:WQUType</chn>	
CALCulate <chn>:GDAPerture:SCOunt</chn>	
CALCulate <chn>:LIMit:CIRCle:CLEar</chn>	
CALCulate <chn>:LIMit:CIRCle:DATA</chn>	
CALCulate <chn>:LIMit:CIRCle:DISPlay[:STATe]</chn>	
CALCulate <chn>:LIMit:CIRCle:FAIL?</chn>	
CALCulate <chn>:LIMit:CIRCle:SOUNd[:STATe]</chn>	
CALCulate <chn>:LIMit:CIRCle[:STATe]</chn>	
CALCulate <chn>:LIMit:CLEar</chn>	
CALCulate <chn>:LIMit:CONTrol:DOMain</chn>	
CALCulate <chn>:LIMit:CONTrol:SHIFt</chn>	
CALCulate <chn>:LIMit:CONTrol[:DATA]</chn>	
CALCulate <chn>:LIMit:DATA</chn>	
CALCulate <chn>:LIMit:DELete:ALL</chn>	
CALCulate <chn>:LIMit:DISPlay[:STATe]</chn>	
CALCulate <chn>:LIMit:FAIL?</chn>	
CALCulate <chn>:LIMit:LOWer</chn>	
CALCulate <chn>:LIMit:LOWer:FEED</chn>	
CALCulate <chn>:LIMit:LOWer:SHIFt</chn>	
CALCulate <chn>:LIMit:LOWer:STATe</chn>	
CALCulate <chn>:LIMit:LOWer[:DATA]</chn>	
CALCulate <chn>:LIMit:RDOMain:COMPlex</chn>	
CALCulate <chn>:LIMit:RDOMain:FORMat</chn>	
CALCulate <chn>:LIMit:RDOMain:SPACing</chn>	
CALCulate <chn>:LIMit:SEGMent:COUNt?</chn>	
CALCulate <chn>:LIMit:SEGMent<seg>:AMPLitude:STARt</seg></chn>	
CALCulate <chn>:LIMit:SEGMent<seg>:AMPLitude:STOP</seg></chn>	
CALCulate <chn>:LIMit:SEGMent<seg>:STIMulus:STARt</seg></chn>	
CALCulate <chn>:LIMit:SEGMent<seg>:STIMulus:STOP</seg></chn>	
CALCulate <chn>:LIMit:SEGMent<seg>:TYPE</seg></chn>	
CALCulate <chn>:LIMit:SOUNd[:STATe]</chn>	
CALCulate <chn>:LIMit:STATe</chn>	
CALCulate <chn>:LIMit:STATe:AREA</chn>	
CALCulate <chn>:LIMit:TTLout<pt>[:STATe]</pt></chn>	
CALCulate <chn>:LIMit:UPPer:FEED</chn>	
CALCulate <chn>:LIMit:UPPer:SHIFt</chn>	
CALCulate <chn>:LIMit:UPPer:STATe</chn>	866

CALCulate <chn>:LIMit:UPPer[:DATA]</chn>	
CALCulate <chn>:MARKer:SEARch:BFILter:RESult[:STATe]</chn>	
CALCulate <chn>:MARKer:SEARch:BFILter:RESult[:STATe]:AREA</chn>	538
CALCulate <chn>:MARKer<mk>:AOFF</mk></chn>	
CALCulate <chn>:MARKer<mk>:BWIDth</mk></chn>	
CALCulate <chn>:MARKer<mk>:COUPled[:STATe]</mk></chn>	
CALCulate <chn>:MARKer<mk>:DELTa[:STATe]</mk></chn>	
CALCulate <chn>:MARKer<mk>:FORMat</mk></chn>	
CALCulate <chn>:MARKer<mk>:FUNCtion:BWIDth</mk></chn>	
CALCulate <chn>:MARKer<mk>:FUNCtion:BWIDth:MODE</mk></chn>	
CALCulate <chn>:MARKer<mk>:FUNCtion:CENTer</mk></chn>	
CALCulate <chn>:MARKer<mk>:FUNCtion:DELTa:STATe</mk></chn>	
CALCulate <chn>:MARKer<mk>:FUNCtion:DOMain:USER</mk></chn>	
CALCulate <chn>:MARKer<mk>:FUNCtion:DOMain:USER:SHOW</mk></chn>	
CALCulate <chn>:MARKer<mk>:FUNCtion:DOMain:USER:STARt</mk></chn>	
CALCulate <chn>:MARKer<mk>:FUNCtion:DOMain:USER:STOP</mk></chn>	
CALCulate <chn>:MARKer<mk>:FUNCtion:EXECute</mk></chn>	
CALCulate <chn>:MARKer<mk>:FUNCtion:RESult?</mk></chn>	
CALCulate <chn>:MARKer<mk>:FUNCtion:SPAN</mk></chn>	
CALCulate <chn>:MARKer<mk>:FUNCtion:STARt</mk></chn>	
CALCulate <chn>:MARKer<mk>:FUNCtion:STOP</mk></chn>	
CALCulate <chn>:MARKer<mk>:FUNCtion:TARGet</mk></chn>	
CALCulate <chn>:MARKer<mk>:FUNCtion[:SELect]</mk></chn>	
CALCulate <chn>:MARKer<mk>:MAXimum</mk></chn>	
CALCulate <chn>:MARKer<mk>:MINimum</mk></chn>	
CALCulate <chn>:MARKer<mk>:MODE</mk></chn>	
CALCulate <chn>:MARKer<mk>:NAME</mk></chn>	
CALCulate <chn>:MARKer<mk>:REFerence:MODE</mk></chn>	
CALCulate <chn>:MARKer<mk>:REFerence:NAME</mk></chn>	
CALCulate <chn>:MARKer<mk>:REFerence:TYPE</mk></chn>	
CALCulate <chn>:MARKer<mk>:REFerence:X</mk></chn>	
CALCulate <chn>:MARKer<mk>:REFerence:Y?</mk></chn>	
CALCulate <chn>:MARKer<mk>:REFerence[:STATe]</mk></chn>	
CALCulate <chn>:MARKer<mk>:SEARch:LEFT</mk></chn>	
CALCulate <chn>:MARKer<mk>:SEARch:NEXT</mk></chn>	
CALCulate <chn>:MARKer<mk>:SEARch:RIGHt</mk></chn>	
CALCulate <chn>:MARKer<mk>:SEARch:TRACking</mk></chn>	
CALCulate <chn>:MARKer<mk>:SEARch[:IMMediate]</mk></chn>	
CALCulate <chn>:MARKer<mk>:TARGet</mk></chn>	
CALCulate <chn>:MARKer<mk>:TYPE</mk></chn>	
CALCulate <chn>:MARKer<mk>:X</mk></chn>	
CALCulate <chn>:MARKer<mk>:Y?</mk></chn>	
CALCulate <chn>:MARKer<mk>[:STATe]</mk></chn>	
CALCulate <chn>:MARKer[:STATe]:AREA</chn>	
CALCulate <chn>:MATH:FUNCtion</chn>	
CALCulate <chn>:MATH:MEMorize</chn>	
CALCulate <chn>:MATH:STATe</chn>	
CALCulate <chn>:MATH:WUNit[:STATe]</chn>	
• •	

CALCulate <chn>:MATH[:EXPRession]:SDEFine</chn>	542
CALCulate <chn>:MATH[:EXPRession][:DEFine]</chn>	
CALCulate <chn>:PHOLd</chn>	554
CALCulate <chn>:RIPPle:CLEar</chn>	
CALCulate <chn>:RIPPle:CONTrol:DOMain</chn>	555
CALCulate <chn>:RIPPle:DATA</chn>	555
CALCulate <chn>:RIPPle:DELete:ALL</chn>	556
CALCulate <chn>:RIPPle:DISPlay[:STATe]</chn>	
CALCulate <chn>:RIPPle:FAIL?</chn>	557
CALCulate <chn>:RIPPle:RDOMain:FORMat</chn>	558
CALCulate <chn>:RIPPle:SEGMent:COUNt?</chn>	558
CALCulate <chn>:RIPPle:SEGMent<seg>:LIMit</seg></chn>	559
CALCulate <chn>:RIPPle:SEGMent<seg>:RESult?</seg></chn>	
CALCulate <chn>:RIPPle:SEGMent<seg>:STIMulus:STARt</seg></chn>	
CALCulate <chn>:RIPPle:SEGMent<seg>:STIMulus:STOP</seg></chn>	
CALCulate <chn>:RIPPle:SEGMent<seg>[:STATe]</seg></chn>	
CALCulate <chn>:RIPPle:SOUNd[:STATe]</chn>	
CALCulate <chn>:RIPPle:STATe</chn>	
CALCulate <chn>:RIPPle:STATe:AREA</chn>	
CALCulate <chn>:SMOothing:APERture</chn>	
CALCulate <chn>:SMOothing[:STATe]</chn>	
CALCulate <chn>:STATistics:DOMain:USER</chn>	
CALCulate <chn>:STATistics:DOMain:USER:SHOW</chn>	
CALCulate <chn>:STATistics:DOMain:USER:STARt</chn>	
CALCulate <chn>:STATistics:DOMain:USER:STOP</chn>	
CALCulate <chn>:STATistics:EPDelay[:STATe]</chn>	
CALCulate <chn>:STATistics:MMPTpeak[:STATe]</chn>	
CALCulate <chn>:STATistics:MSTDdev[:STATe]</chn>	
CALCulate <chn>:STATistics:NLINear:COMP:LEVel</chn>	
CALCulate <chn>:STATistics:NLINear:COMP:RESult?</chn>	
CALCulate <chn>:STATistics:NLINear:COMP[:STATe]</chn>	
CALCulate <chn>:STATistics:RESult?</chn>	
CALCulate <chn>:STATistics:RMS[:STATe]</chn>	
CALCulate <chn>:STATistics:SFLatness[:STATe]</chn>	
CALCulate <chn>:STATistics[:STATe]</chn>	
CALCulate <chn>:STATistics[:STATe]:AREA</chn>	568
CALCulate <chn>:TRANsform:COMPlex</chn>	569
CALCulate <chn>:TRANsform:IMPedance:RNORmal</chn>	570
CALCulate <chn>:TRANsform:TIME:CENTer</chn>	
CALCulate <chn>:TRANsform:TIME:DCHebyshev</chn>	
CALCulate <chn>:TRANsform:TIME:LPASs</chn>	
CALCulate <chn>:TRANsform:TIME:LPASs:DCSParam</chn>	
CALCulate <chn>:TRANsform:TIME:LPASs:DCSParam:CONTinuous</chn>	572
CALCulate <chn>:TRANsform:TIME:LPASs:DCSParam:EXTRapolate</chn>	573
CALCulate <chn>:TRANsform:TIME:LPFRequency</chn>	573
CALCulate <chn>:TRANsform:TIME:RESolution:EFACtor</chn>	573
CALCulate <chn>:TRANsform:TIME:SPAN</chn>	574
CALCulate <chn>:TRANsform:TIME:STARt</chn>	574

CALCulate <chn>:TRANsform:TIME:STATe</chn>	575
CALCulate <chn>:TRANsform:TIME:STIMulus</chn>	575
CALCulate <chn>:TRANsform:TIME:STOP</chn>	575
CALCulate <chn>:TRANsform:TIME:WINDow</chn>	576
CALCulate <chn>:TRANsform:TIME:XAXis</chn>	577
CALCulate <chn>:TRANsform:TIME[:TYPE]</chn>	576
CONFigure:CHANnel:CATalog?	592
CONFigure:CHANnel:MEASure:ALL[:STATe]	592
CONFigure:CHANnel <ch>:MEASure[:STATe]</ch>	592
CONFigure:CHANnel <ch>:NAME</ch>	593
CONFigure:CHANnel <ch>:NAME:ID?</ch>	593
CONFigure:CHANnel <ch>:TRACe:CATalog?</ch>	594
CONFigure:CHANnel <ch>:TRACe:REName</ch>	594
CONFigure:CHANnel <ch>[:STATe]</ch>	594
CONFigure:TRACe:CATalog?	595
CONFigure:TRACe:WINDow:TRACe?	597
CONFigure:TRACe:WINDow?	
CONFigure:TRACe <trc>:CHANnel:NAME:ID?</trc>	596
CONFigure:TRACe <trc>:CHANnel:NAME?</trc>	595
CONFigure:TRACe <trc>:NAME</trc>	
CONFigure:TRACe <trc>:NAME:ID?</trc>	596
CONFigure:TRACe <trc>:REName</trc>	597
CONTrol:AUXiliary:C[:DATA]	599
CONTrol:HANDler:A:MODE	601
CONTrol:HANDler:A[:DATA]	600
CONTrol:HANDler:B:MODE	
CONTrol:HANDler:B[:DATA]	
CONTrol:HANDler:C:MODE	
CONTrol:HANDler:C[:DATA]	600
CONTrol:HANDler:D:MODE	
CONTrol:HANDler:D[:DATA]	
CONTrol:HANDler:E[:DATA]	
CONTrol:HANDler:F[:DATA]	
CONTrol:HANDler:G[:DATA]	
CONTrol:HANDler:H[:DATA]	
CONTrol:HANDler:INPut?	
CONTrol:HANDler:LOGic	603
CONTrol:HANDler:OUTPut <pt>:USER</pt>	
CONTrol:HANDler:OUTPut <pt>[:DATA]</pt>	
CONTrol:HANDler:PASSfail:LOGic	604
CONTrol:HANDler:PASSfail:MODE	
CONTrol:HANDler:PASSfail:POLicy	605
CONTrol:HANDler:PASSfail:SCOPe	
CONTrol:HANDler:PASSfail:STATus?	606
CONTrol:HANDler:RESet	606
CONTrol:HANDler:SWEepend	
CONTrol:HANDler[:EXTension]:INDex:STATe	602
CONTrol:HANDler[:EXTension]:RTRigger:STATe	602

DIAGnostic:DEVice:STATe	607
DIAGnostic:SERVice:FUNCtion	872
DIAGnostic:SERVice:RFPower	608
DIAGnostic:SERVice:SFUNction	608
DISPlay:ANNotation:CHANnel[:STATe]	610
DISPlay:ANNotation:FREQuency[:STATe]	610
DISPlay:ANNotation:TRACe[:STATe]	
DISPlay:CMAP:LIMit:FCOLorize[:STATe]	
DISPlay:CMAP:LIMit:FSYMbol[:STATe]	
DISPlay:CMAP:LIMit[:STATe]	
DISPlay:CMAP:MARKer[:STATe]	
DISPlay:CMAP:TRACe:COLor[:STATe]	
DISPlay:CMAP:TRACe:RGB	
DISPlay:CMAP <dispel>:RGB</dispel>	
DISPlay:LAYout	
DISPlay:LATout. DISPlay:LAYout:APPLy	
DISPlay:LATout.AFFLy	
DISPlay:LAYout:EXECute	
DISPlay:LAYout:GRID	
-	
DISPlay:LAYout:JOIN	
DISPlay:RFSize	
DISPlay[:WINDow <wnd>]:CATalog?</wnd>	
DISPlay[:WINDow <wnd>]:MAXimize</wnd>	
DISPlay[:WINDow <wnd>]:NAME</wnd>	
DISPlay[:WINDow <wnd>]:OVERview[:STATe]</wnd>	
DISPlay[:WINDow <wnd>]:STATe</wnd>	
DISPlay[:WINDow <wnd>]:TITLe:DATA</wnd>	
DISPlay[:WINDow <wnd>]:TITLe[:STATe]</wnd>	
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:CATalog?</wndtr></wnd>	
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:DELete</wndtr></wnd>	
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:EFEed</wndtr></wnd>	
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:FEED</wndtr></wnd>	
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:SHOW</wndtr></wnd>	
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:X:OFFSet</wndtr></wnd>	624
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:Y:OFFSet</wndtr></wnd>	624
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:Y[:SCALe]:AUTO</wndtr></wnd>	625
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:Y[:SCALe]:BOTTom</wndtr></wnd>	628
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:Y[:SCALe]:PDIVision</wndtr></wnd>	626
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:Y[:SCALe]:RLEVel</wndtr></wnd>	626
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:Y[:SCALe]:RPOSition</wndtr></wnd>	627
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:Y[:SCALe]:TOP</wndtr></wnd>	628
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:ZOOM:BOTTom</wndtr></wnd>	631
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:ZOOM:STARt</wndtr></wnd>	630
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:ZOOM:STOP</wndtr></wnd>	630
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:ZOOM:TOP</wndtr></wnd>	631
DISPlay[:WINDow <wnd>]:TRACe<wndtr>:ZOOM[:STATe]</wndtr></wnd>	629
FORMat:BORDer	
FORMat:DEXPort:SOURce	

FORMat[:DATA]	632
HCOPy:DESTination	633
HCOPy:DEVice:LANGuage	633
HCOPy:ITEM:ALL	634
HCOPy:ITEM:LOGO[:STATe]	634
HCOPy:ITEM:MLISt[:STATe]	634
HCOPy:ITEM:TIME[:STATe]	635
HCOPy:PAGE:COLor	635
HCOPy:PAGE:MARGin:BOTTom	635
HCOPy:PAGE:MARGin:LEFT	
HCOPy:PAGE:MARGin:RIGHt	636
HCOPy:PAGE:MARGin:TOP	636
HCOPy:PAGE:ORIentation	636
HCOPy:PAGE:WINDow	637
HCOPy[:IMMediate]	
INITiate:CONTinuous:ALL	638
INITiate <ch>:CONTinuous</ch>	
INITiate <ch>[:IMMediate]:SCOPe</ch>	640
INITiate <ch>[:IMMediate][:DUMMy]</ch>	639
INITiate[:IMMediate]:ALL	639
INPut <phypt>:ATTenuation</phypt>	
INSTrument:NSELect	
INSTrument:PORT:COUNt?	
INSTrument:SMATrix	
INSTrument:TPORt:COUNt?	
INSTrument[:SELect]	
MEMory:CATalog?	
MEMory:DEFine	642
MEMory:DELete:ALL	
MEMory:DELete[:NAME]	
MEMory:SELect	
MMEMory:AKAL:FACTory:CONVersion	
MMEMory:AKAL:USER:CONVersion	
MMEMory:CATalog:ALL?	
MMEMory:CATalog?	
MMEMory:CDIRectory	
MMEMory:COPY	
MMEMory:DATA	
MMEMory:DELete	
MMEMory:DELete:CORRection	
MMEMory:LOAD:CKIT	
MMEMory:LOAD:CKIT:SDATa	
MMEMory:LOAD:CKIT:UDIRectory	
MMEMory:LOAD:CMAP	
MMEMory:LOAD:CORRection	
MMEMory:LOAD:CORRection:MERGe	
MMEMory:LOAD:CORRection:RESolve	
MMEMory:LOAD:CORRection:TCOefficient	654

MMEMory:LOAD:LIMit	654
MMEMory:LOAD:RIPPIe	656
MMEMory:LOAD:SEGMent	657
MMEMory:LOAD:STATe	658
MMEMory:LOAD:TRACe	658
MMEMory:LOAD:VNETworks <ch>:BALanced:DEEMbedding<logpt></logpt></ch>	659
MMEMory:LOAD:VNETworks <ch>:BALanced:EMBedding<logpt></logpt></ch>	660
MMEMory:LOAD:VNETworks <ch>:SENDed:DEEMbedding<phypt></phypt></ch>	661
MMEMory:LOAD:VNETworks <ch>:SENDed:EMBedding<phypt></phypt></ch>	662
MMEMory:MDIRectory	662
MMEMory:MOVE	663
MMEMory:NAME	663
MMEMory:RDIRectory	663
MMEMory:STORe:CKIT	664
MMEMory:STORe:CKIT:WLABel	664
MMEMory:STORe:CMAP	665
MMEMory:STORe:CORRection	665
MMEMory:STORe:CORRection:TCOefficient	665
MMEMory:STORe:LIMit	666
MMEMory:STORe:MARKer	666
MMEMory:STORe:RIPPIe	667
MMEMory:STORe:SEGMent	667
MMEMory:STORe:STATe	667
MMEMory:STORe:TRACe	668
MMEMory:STORe:TRACe:CHANnel	669
MMEMory:STORe:TRACe:PORTs	
OUTPut:UPORt:ECBits	672
OUTPut <ch>:UPORt[:VALue]</ch>	672
OUTPut <ch>[:STATe]</ch>	672
OUTPut <chn>:DPORt</chn>	
PROGram[:SELected]:EXECute	
PROGram[:SELected]:INIMessage	675
PROGram[:SELected]:INIParameter	675
PROGram[:SELected]:NAME	676
SOURce:POWer:CORRection:PMETer:ID	805
SOURce <ch>:FREQuency:CONVersion:MIXer:PMFixed</ch>	
SOURce <ch>:FREQuency:CONVersion:MIXer:PMODe</ch>	791
SOURce <ch>:FREQuency<phypt>:CONVersion:ARBitrary:EFRequency<gen></gen></phypt></ch>	788
SOURce <ch>:FREQuency<phypt>:CONVersion:ARBitrary:IFRequency</phypt></ch>	789
SOURce <ch>:FREQuency<phypt>:FIXed</phypt></ch>	792
SOURce <ch>:FREQuency<phypt>[:CW]</phypt></ch>	792
SOURce <ch>:GROup<grp></grp></ch>	795
SOURce <ch>:GROup<grp>:CLEar</grp></ch>	795
SOURce <ch>:LPORt<logpt></logpt></ch>	793
SOURce <ch>:LPORt<logpt>:CLEar</logpt></ch>	794
SOURce <ch>:POWer:CORRection:DATA</ch>	
SOURce <ch>:POWer:CORRection:DATA:PARameter<wv>?</wv></ch>	812
SOURce <ch>:POWer:CORRection:DATA:PORT<phypt></phypt></ch>	801

SOURce <ch>:POWer:CORRection:IMODulation:PORT SOURce<ch>:POWer<phypt>:CORRection:COLLect:AVERage:NTOLerance</phypt></ch></ch>	
	803
SOURce <ch>:POWer<phypt>:CORRection:COLLect:AVERage[:COUNt]</phypt></ch>	
SOURce <ch>:POWer<phypt>:CORRection:COLLect:CFACtor</phypt></ch>	800
SOURce <ch>:POWer<phypt>:CORRection:COLLect:PMReadings</phypt></ch>	800
SOURce <ch>:POWer<phypt>:CORRection:COLLect[:ACQuire]</phypt></ch>	
SOURce <ch>:POWer<phypt>:CORRection:DATA:PARameter<wv>:COUNt?</wv></phypt></ch>	811
SOURce <ch>:POWer<phypt>:CORRection:GENerator<gen>:LEVel:OFFSet</gen></phypt></ch>	813
SOURce <ch>:POWer<phypt>:CORRection:GENerator<gen>[:STATe]</gen></phypt></ch>	
SOURce <ch>:POWer<phypt>:CORRection:IMODulation:LTONe[:ACQuire]</phypt></ch>	802
SOURce <ch>:POWer<phypt>:CORRection:IMODulation:UTONe[:ACQuire]</phypt></ch>	804
SOURce <ch>:POWer<phypt>:CORRection:LEVel:OFFSet</phypt></ch>	814
SOURce <ch>:POWer<phypt>:CORRection:NREadings</phypt></ch>	804
SOURce <ch>:POWer<phypt>:CORRection:OSOurces[:STATe]</phypt></ch>	
SOURce <ch>:POWer<phypt>:CORRection:PPOWer</phypt></ch>	
SOURce <ch>:POWer<phypt>:CORRection:PSELect</phypt></ch>	
SOURce <ch>:POWer<phypt>:CORRection:STATe</phypt></ch>	
SOURce <ch>:POWer<phypt>:CORRection:TCOefficient:CALibration</phypt></ch>	
SOURce <ch>:POWer<phypt>:CORRection:TCOefficient:COUNt?</phypt></ch>	
SOURce <ch>:POWer<phypt>:CORRection:TCOefficient:DEFine<listno></listno></phypt></ch>	
SOURce <ch>:POWer<phypt>:CORRection:TCOefficient:DELete<listno>:ALL</listno></phypt></ch>	
SOURce <ch>:POWer<phypt>:CORRection:TCOefficient:DELete<listno>[:DUMMy]</listno></phypt></ch>	
SOURce <ch>:POWer<phypt>:CORRection:TCOefficient:FEED</phypt></ch>	
SOURce <ch>:POWer<phypt>:CORRection:TCOefficient:INSert<listno></listno></phypt></ch>	
SOURce <ch>:POWer<phypt>:CORRection:TCOefficient[:STATe]</phypt></ch>	
SOURce <ch>:POWer<phypt>:CORRection[:ACQuire]</phypt></ch>	
SOURce <ch>:POWer<phypt>:CORRection[:ACQuire]:VERification:RESult?</phypt></ch>	
SOURce <ch>:POWer<phypt>:GENerator<gen>:OFFSet</gen></phypt></ch>	
SOURce <ch>:POWer<phypt>:GENerator<gen>:PERManent[:STATe]</gen></phypt></ch>	
SOURce <ch>:POWer<phypt>:GENerator<gen>:STATe</gen></phypt></ch>	
SOURce <ch>:POWer<phypt>:PERManent[:STATe]</phypt></ch>	
SOURce <ch>:POWer<phypt>:STARt</phypt></ch>	
SOURce <ch>:POWer<phypt>:STATe</phypt></ch>	
SOURce <ch>:POWer<phypt>:STOP</phypt></ch>	
SOURce <ch>:POWer<phypt>[:LEVel][:IMMediate]:OFFSet</phypt></ch>	817
SOURce <ch>:POWer<phypt>[:LEVe]][:IMMediate]:SLOPe</phypt></ch>	
	821
SOURce <ch>:POWer<phypt>[:LEVel][:IMMediate]:SLOPe SOURce<ch>:POWer<phypt>[:LEVel][:IMMediate][:AMPLitude] STATus:PRESet</phypt></ch></phypt></ch>	
SOURce <ch>:POWer<phypt>[:LEVel][:IMMediate]:SLOPe SOURce<ch>:POWer<phypt>[:LEVel][:IMMediate][:AMPLitude]</phypt></ch></phypt></ch>	821
SOURce <ch>:POWer<phypt>[:LEVel][:IMMediate]:SLOPe SOURce<ch>:POWer<phypt>[:LEVel][:IMMediate][:AMPLitude] STATus:PRESet STATus:QUEStionable:CONDition? STATus:QUEStionable:ENABle.</phypt></ch></phypt></ch>	821 821
SOURce <ch>:POWer<phypt>[:LEVel][:IMMediate]:SLOPe SOURce<ch>:POWer<phypt>[:LEVel][:IMMediate][:AMPLitude] STATus:PRESet STATus:QUEStionable:CONDition? STATus:QUEStionable:ENABle STATus:QUEStionable:INTegrity:CONDition?</phypt></ch></phypt></ch>	821 821 821
SOURce <ch>:POWer<phypt>[:LEVel][:IMMediate]:SLOPe SOURce<ch>:POWer<phypt>[:LEVel][:IMMediate][:AMPLitude] STATus:PRESet. STATus:QUEStionable:CONDition? STATus:QUEStionable:ENABle. STATus:QUEStionable:INTegrity:CONDition? STATus:QUEStionable:INTegrity:ENABle.</phypt></ch></phypt></ch>	821 821 821 821
SOURce <ch>:POWer<phypt>[:LEVel][:IMMediate]:SLOPe SOURce<ch>:POWer<phypt>[:LEVel][:IMMediate][:AMPLitude] STATus:PRESet STATus:QUEStionable:CONDition? STATus:QUEStionable:ENABle. STATus:QUEStionable:INTegrity:CONDition? STATus:QUEStionable:INTegrity:ENABle. STATus:QUEStionable:INTegrity:HARDware:CONDition?</phypt></ch></phypt></ch>	
SOURce <ch>:POWer<phypt>[:LEVel][:IMMediate]:SLOPe SOURce<ch>:POWer<phypt>[:LEVel][:IMMediate]]:AMPLitude] STATus:PRESet STATus:QUEStionable:CONDition? STATus:QUEStionable:ENABle STATus:QUEStionable:INTegrity:CONDition? STATus:QUEStionable:INTegrity:ENABle STATus:QUEStionable:INTegrity:HARDware:CONDition? STATus:QUEStionable:INTegrity:HARDware:ENABle</phypt></ch></phypt></ch>	
SOURce <ch>:POWer<phypt>[:LEVel][:IMMediate]:SLOPe SOURce<ch>:POWer<phypt>[:LEVel][:IMMediate]]:AMPLitude] STATus:PRESet. STATus:QUEStionable:CONDition? STATus:QUEStionable:ENABle. STATus:QUEStionable:INTegrity:CONDition? STATus:QUEStionable:INTegrity:ENABle. STATus:QUEStionable:INTegrity:HARDware:CONDition? STATus:QUEStionable:INTegrity:HARDware:ENABle. STATus:QUEStionable:INTegrity:HARDware:ENABle. STATus:QUEStionable:INTegrity:HARDware:ENABle.</phypt></ch></phypt></ch>	
SOURce <ch>:POWer<phypt>[:LEVel][:IMMediate]:SLOPe SOURce<ch>:POWer<phypt>[:LEVel][:IMMediate][:AMPLitude] STATus:PRESet STATus:QUEStionable:CONDition? STATus:QUEStionable:ENABle. STATus:QUEStionable:INTegrity:CONDition? STATus:QUEStionable:INTegrity:ENABle STATus:QUEStionable:INTegrity:HARDware:CONDition? STATus:QUEStionable:INTegrity:HARDware:ENABle STATus:QUEStionable:INTegrity:HARDware:NTRansition STATus:QUEStionable:INTegrity:HARDware:PTRansition</phypt></ch></phypt></ch>	
SOURce <ch>:POWer<phypt>[:LEVel][:IMMediate]:SLOPe SOURce<ch>:POWer<phypt>[:LEVel][:IMMediate]]:AMPLitude] STATus:PRESet. STATus:QUEStionable:CONDition? STATus:QUEStionable:ENABle. STATus:QUEStionable:INTegrity:CONDition? STATus:QUEStionable:INTegrity:ENABle. STATus:QUEStionable:INTegrity:HARDware:CONDition? STATus:QUEStionable:INTegrity:HARDware:ENABle. STATus:QUEStionable:INTegrity:HARDware:ENABle. STATus:QUEStionable:INTegrity:HARDware:ENABle.</phypt></ch></phypt></ch>	

STATus:QUEStionable:INTegrity:PTRansition	822
STATus:QUEStionable:INTegrity[:EVENt]?	823
STATus:QUEStionable:LIMit <lev>:CONDition?</lev>	821
STATus:QUEStionable:LIMit <lev>:ENABle</lev>	821
STATus:QUEStionable:LIMit <lev>:NTRansition</lev>	822
STATus:QUEStionable:LIMit <lev>:PTRansition</lev>	822
STATus:QUEStionable:LIMit <lev>[:EVENt]?</lev>	823
-	
SYSTem:COMMunicate:RDEVice:SMATrix:DELete	
-	
-	
-	
SYSTem:COMMunicate:RDEVice:SMATrix <matr>:CONFigure:MTESt</matr>	841
	STATus:QUEStionable:INIt <lev>:CONDItion? STATus:QUEStionable:LIMIt<lev>:CONDItion? STATus:QUEStionable:LIMIt<lev>:ENABle STATus:QUEStionable:LIMIt<lev>:PTRansition. STATus:QUEStionable:LIMIt<lev>:PTRansition. STATus:QUEStionable:LIMIt<lev>:PTRansition. STATus:QUEStionable:INIt<lev>:FTRANSITION. STATus:QUEStionable:INIt<lev>:FTRANSITION. STATus:QUEStionable:INIt<lev>:FTRANSITION. STATus:QUEStionable:INIt<lev>:FTRANSITION. STATus:QUEStionable:INIt<lev>:FTRANSITION. STATus:QUEStionable:FTRANSITION. STATUS:QUEStionable:FTRANSITION. STATUS:QUEStionable:FTRANSITION. STATUS:QUEStionable:FTRANSITION. STATUS:QUEStionable:FTRANSITION. STATUS:QUEStionable:FTRANSITION. STATUS:QUEStionable:FTRANSITION. STATUS:QUEStionable:FTRANSITION. STATUS:QUEStionable:FTRANSITION. STATUS:QUMunicate:FTRANSITION. STATUS:QUEStionable:FTRANSITION. STATUS:QUEStionable:FTRANSITION. STATUS:QUEStionable:FTRANSITION. STATUS:QUEStionable:FTRANSITION. STATUS:QUEStionable:FTRANSITION. STATUS:QUEStionable:FTRANSITION:STATE]. STATUS:QUEStionable:FTRANSITION: STATUS:QUEStionable:FTRANSITION:QUEStATE]. STATUS:QUEStionable:FTRANSITICONFigure:STATE]. STATUS:QUEStATATUS:QUEStATATUS:QUESTATE]. STATUS:QUEStATATUS:QUEStATATUS:QUESTATE]. STATUS:QUEStATATUS:QUESTATE:QUESTATE:QUESTATE: STATUS:QUEStATATUS:QUESTATE:QUES</lev></lev></lev></lev></lev></lev></lev></lev></lev></lev></lev>

SYSTem:COMMunicate:RDEVice:SMATrix <matr>:CONFigure:MVNA</matr>	
SYSTem:COMMunicate:RDEVice:SMATrix <matr>:DEFine</matr>	
SYSTem:DATE	
SYSTem:DISPlay:BAR:HKEY[:STATe].	
SYSTem:DISPlay:BAR:MENU[:STATe]	
SYSTem:DISPlay:BAR:STATus[:STATe]	
SYSTem:DISPlay:BAR:STOols[:STATe]	
SYSTem:DISPlay:BAR:TITLe[:STATe]	
SYSTem:DISPlay:BAR:TOOLs[:STATe]	
SYSTem:DISPlay:COLor	
SYSTem:DISPlay:DIALogs:SETup:MCAL[:STATe]	
SYSTem:DISPlay:UPDate	
SYSTem:ERRor:ALL?	
SYSTem:ERRor:DISPlay	
SYSTem:ERRor[:NEXT]?	
SYSTem:FIRMware:UPDate	
SYSTem:FPReset	846
SYSTem:FREQuency?	
SYSTem:IDENtify:FACTory	847
SYSTem:IDENtify[:STRing]	847
SYSTem:KLOCk	847
SYSTem:LANGuage	847
SYSTem:LOGGing:REMote[:STATe]	848
SYSTem:OPTions:FACTory	848
SYSTem:OPTions[:STRing]	848
SYSTem:PASSword[:CENable]	849
SYSTem:PRESet:SCOPe	849
SYSTem:PRESet:USER:CAL	850
SYSTem:PRESet:USER:NAME	
SYSTem:PRESet:USER[:STATe]	850
SYSTem:PRESet[:DUMMy]	851
SYSTem:SETTings:UPDate	851
SYSTem:SHUTdown	851
SYSTem:SMATrix:OPTimization	854
SYSTem:SOUNd:ALARm[:STATe]	852
SYSTem:SOUNd:STATus[:STATe]	852
SYSTem:TIME	852
SYSTem:TSLock	852
SYSTem:USER:KEY	853
SYSTem:VERSion?	853
TRACe:CLEar	
TRACe:COPY	855
TRACe:COPY:MATH	856
TRACe[:DATA]:STIMulus[:ALL]?	
TRACe[:DATA][:RESPonse][:ALL]?	
TRIGger:CHANnel <ch>:AUXiliary<n>:DURation</n></ch>	
TRIGger:CHANnel <ch>:AUXiliary<n>:INTerval</n></ch>	

TRIGger:CHANnel <ch>:AUXiliary<n>:OPOLarity</n></ch>	859
TRIGger:CHANnel <ch>:AUXiliary<n>:POSition</n></ch>	859
TRIGger:CHANnel <ch>:AUXiliary<n>[:ENABle]</n></ch>	858
TRIGger <ch>[:SEQuence]:HOLDoff</ch>	860
TRIGger <ch>[:SEQuence]:LINK</ch>	860
TRIGger <ch>[:SEQuence]:MULTiple:HOLDoff</ch>	861
TRIGger <ch>[:SEQuence]:MULTiple:SLOPe<num></num></ch>	861
TRIGger <ch>[:SEQuence]:MULTiple:SOURce</ch>	
TRIGger <ch>[:SEQuence]:SLOPe</ch>	
TRIGger <ch>[:SEQuence]:SOURce</ch>	
[SENSe:]CORRection:CKIT: <conntype>:LSELect</conntype>	
[SENSe:]CORRection:CKIT: <conntype>:SELect</conntype>	
[SENSe:]CORRection:CKIT: <standardtype></standardtype>	
[SENSe:]CORRection:CKIT: <standardtype>:WLABel</standardtype>	
[SENSe:]CORRection:CKIT:CATalog?	
[SENSe:]CORRection:CKIT:DELete	
[SENSe:]CORRection:CKIT:INSTall	
[SENSe:]CORRection:CKIT:LABel	
[SENSe:]CORRection:CKIT:LCATalog?	
[SENSe:]CORRection:CKIT:LDELete	
[SENSe:]CORRection:CKIT:LLABel	
[SENSe:]CORRection:CKIT:LSELect	
[SENSe]CORRection:CKIT:SELect	
[SENSe:]CORRection:CKIT:SELect	
[SENSe:]CORRection:CKIT:STANdard:LCATalog?	
[SENSe:]CORRection:COLLect:AUTO:CKIT	
[SENSe:]CORRection:COLLect:AUTO:CKIT:PASSword	
[SENSe:]CORRection:COLLect:AUTO:CKIT:PORTs	
[SENSe:]CORRection:COLLect:AUTO:PORTs:CONNection?	
[SENSe:]CORRection:COLLect:CHANnels:ALL	
[SENSe:]CORRection:COLLect:PMETer:ID.	
[SENSe:]SWEep:COUNt:ALL	
[SENSe <ch>:]AVERage:CLEar</ch>	
[SENSe <ch>:]AVERage:COUNt</ch>	
[SENSe <ch>:]AVERage:MODE</ch>	
[SENSe <ch>:]AVERage[:STATe]</ch>	
[SENSe <ch>:]BANDwidth[:RESolution]</ch>	
[SENSe <ch>:]BANDwidth[:RESolution]:SELect</ch>	
[SENSe <ch>:]BWIDth[:RESolution]</ch>	
[SENSe <ch>:]BWIDth[:RESolution]:SELect</ch>	
[SENSe <ch>:]CORRection:CDATa</ch>	
[SENSe <ch>:]CORRection:CDATa:PORT<phypt></phypt></ch>	
[SENSe <ch>:]CORRection:CKIT:<conntype>:<standardtype></standardtype></conntype></ch>	874
[SENSe <ch>:]CORRection:COLLect:AUTO</ch>	
[SENSe <ch>:]CORRection:COLLect:AUTO:ASSignment:COUNt?</ch>	
[SENSe <ch>:]CORRection:COLLect:AUTO:ASSignment:DEFine:DEFault</ch>	731
[SENSe <ch>:]CORRection:COLLect:AUTO:ASSignment:DELete:ALL</ch>	731
[SENSe <ch>:]CORRection:COLLect:AUTO:ASSignment<asg>:ACQuire</asg></ch>	734

[SENSe <ch>:]CORRection:COLLect:AUTO:ASSignment<asg>:DEFine</asg></ch>	732
[SENSe <ch>:]CORRection:COLLect:AUTO:ASSignment<asg>:DEFine:TPORt</asg></ch>	733
[SENSe <ch>:]CORRection:COLLect:AUTO:CONFigure</ch>	730
[SENSe <ch>:]CORRection:COLLect:AUTO:PORTs</ch>	700
[SENSe <ch>:]CORRection:COLLect:AUTO:PORTs:TYPE</ch>	701
[SENSe <ch>:]CORRection:COLLect:AUTO:POWer</ch>	702
[SENSe <ch>:]CORRection:COLLect:AUTO:SAVE</ch>	734
[SENSe <ch>:]CORRection:COLLect:AUTO:TYPE</ch>	703
[SENSe <ch>:]CORRection:COLLect:CONNection:GENDers</ch>	705
[SENSe <ch>:]CORRection:COLLect:CONNection:PORTs</ch>	706
[SENSe <ch>:]CORRection:COLLect:CONNection<phypt></phypt></ch>	704
[SENSe <ch>:]CORRection:COLLect:DELete</ch>	706
[SENSe <ch>:]CORRection:COLLect:FIXTure:LMParameter:LOSS[:STATe]</ch>	708
[SENSe <ch>:]CORRection:COLLect:FIXTure:LMParameter[:STATe]</ch>	709
[SENSe <ch>:]CORRection:COLLect:FIXTure:SAVE</ch>	709
[SENSe <ch>:]CORRection:COLLect:FIXTure:STARt</ch>	709
[SENSe <ch>:]CORRection:COLLect:FIXTure[:ACQuire]</ch>	
[SENSe <ch>:]CORRection:COLLect:LOAD:SELected</ch>	710
- [SENSe <ch>:]CORRection:COLLect:METHod</ch>	
[SENSe <ch>:]CORRection:COLLect:METHod:DEFine</ch>	
[SENSe <ch>:]CORRection:COLLect:SAVE:DEFault</ch>	
[SENSe <ch>:]CORRection:COLLect:SAVE:SELected:DEFault</ch>	712
[SENSe <ch>:]CORRection:COLLect:SAVE:SELected[:DUMMy]</ch>	
[SENSe <ch>:]CORRection:COLLect:SAVE[:DUMMy]</ch>	
[SENSe <ch>:]CORRection:COLLect:SCONnection<phypt></phypt></ch>	714
[SENSe <ch>:]CORRection:COLLect[:ACQuire]</ch>	
[SENSe <ch>:]CORRection:COLLect[:ACQuire]:RSAVe</ch>	695
[SENSe <ch>:]CORRection:COLLect[:ACQuire]:RSAVe:DEFault</ch>	
[SENSe <ch>:]CORRection:COLLect[:ACQuire]:SELected</ch>	696
[SENSe <ch>:]CORRection:CONNection</ch>	714
[SENSe <ch>:]CORRection:CONNection:CATalog?</ch>	715
[SENSe <ch>:]CORRection:CONNection:DELete</ch>	716
[SENSe <ch>:]CORRection:DATA</ch>	879
[SENSe <ch>:]CORRection:DATA:PARameter:COUNt?</ch>	719
[SENSe <ch>:]CORRection:DATA:PARameter<sfk>:PORT<phypt>?</phypt></sfk></ch>	717
[SENSe <ch>:]CORRection:DATA:PARameter<sfk>?</sfk></ch>	717
[SENSe <ch>:]CORRection:DATE?</ch>	719
[SENSe <ch>:]CORRection:EDELay<phypt>:AUTO</phypt></ch>	720
[SENSe <ch>:]CORRection:EDELay<phypt>:DIELectric</phypt></ch>	720
[SENSe <ch>:]CORRection:EDELay<phypt>:DISTance</phypt></ch>	720
[SENSe <ch>:]CORRection:EDELay<phypt>:ELENgth</phypt></ch>	721
[SENSe <ch>:]CORRection:EDELay<phypt>[:TIME]</phypt></ch>	721
[SENSe <ch>:]CORRection:LOSS<phypt></phypt></ch>	722
[SENSe <ch>:]CORRection:LOSS<phypt>:AUTO</phypt></ch>	722
[SENSe <ch>:]CORRection:LOSS<phypt>:FREQuency</phypt></ch>	723
[SENSe <ch>:]CORRection:LOSS<phypt>:OFFSet</phypt></ch>	723
[SENSe <ch>:]CORRection:OFFSet<phypt>:MAGNitude</phypt></ch>	881
[SENSe <ch>:]CORRection:OFFSet<phypt>[:STATe]</phypt></ch>	723

[SENSe <ch>:]CORRection:PCAL</ch>	725
[SENSe <ch>:]CORRection:POWer:DATA</ch>	726
[SENSe <ch>:]CORRection:POWer:DATA:PORT<phypt></phypt></ch>	726
[SENSe <ch>:]CORRection:POWer<phypt>:ACQuire</phypt></ch>	724
[SENSe <ch>:]CORRection:POWer<phypt>:AWAVe[:STATe]</phypt></ch>	726
[SENSe <ch>:]CORRection:POWer<phypt>:IMODulation:ACQuire</phypt></ch>	727
[SENSe <ch>:]CORRection:POWer<phypt>[:STATe]</phypt></ch>	728
[SENSe <ch>:]CORRection:SMATrix:CDATa</ch>	682
[SENSe <ch>:]CORRection:SMATrix:CDATa:PORT<phypt></phypt></ch>	682
[SENSe <ch>:]CORRection:SSTate?</ch>	728
[SENSe <ch>:]CORRection:STIMulus:PORT<phypt>?</phypt></ch>	729
[SENSe <ch>:]CORRection:STIMulus?</ch>	729
[SENSe <ch>:]CORRection[:STATe]</ch>	729
[SENSe <ch>:]COUPle</ch>	735
[SENSe <ch>:]DC<dcinp>:RANGe</dcinp></ch>	736
[SENSe <ch>:]FREQuency:CENTer</ch>	737
[SENSe <ch>:]FREQuency:CONVersion</ch>	738
[SENSe <ch>:]FREQuency:CONVersion:ARBitrary</ch>	738
[SENSe <ch>:]FREQuency:CONVersion:ARBitrary:PMETer<pmtr></pmtr></ch>	739
[SENSe <ch>:]FREQuency:CONVersion:GAIN:LMCorrection</ch>	740
[SENSe <ch>:]FREQuency:CONVersion:MIXer:FIXed<stg></stg></ch>	741
[SENSe <ch>:]FREQuency:CONVersion:MIXer:FUNDamental</ch>	
[SENSe <ch>:]FREQuency:CONVersion:MIXer:IFPort</ch>	742
[SENSe <ch>:]FREQuency:CONVersion:MIXer:LOMultiplier<stg></stg></ch>	742
[SENSe <ch>:]FREQuency:CONVersion:MIXer:LOPort<stg></stg></ch>	
[SENSe <ch>:]FREQuency:CONVersion:MIXer:MFFixed</ch>	743
[SENSe <ch>:]FREQuency:CONVersion:MIXer:RFMultiplier</ch>	744
[SENSe <ch>:]FREQuency:CONVersion:MIXer:RFPort</ch>	745
[SENSe <ch>:]FREQuency:CONVersion:MIXer:STAGes</ch>	745
[SENSe <ch>:]FREQuency:CONVersion:MIXer:TFRequency<stg></stg></ch>	
[SENSe <ch>:]FREQuency:FIXed</ch>	
[SENSe <ch>:]FREQuency:IMODulation:CONVersion</ch>	
[SENSe <ch>:]FREQuency:IMODulation:LTONe</ch>	
[SENSe <ch>:]FREQuency:IMODulation:ORDer<im>[:STATe]</im></ch>	
[SENSe <ch>:]FREQuency:IMODulation:RECeiver</ch>	
[SENSe <ch>:]FREQuency:IMODulation:SPECtrum:MORDer</ch>	
[SENSe <ch>:]FREQuency:IMODulation:SPECtrum[:STATe]</ch>	
[SENSe <ch>:]FREQuency:IMODulation:TDIStance</ch>	
[SENSe <ch>:]FREQuency:IMODulation:UTONe</ch>	
[SENSe <ch>:]FREQuency:MODE</ch>	
[SENSe <ch>:]FREQuency:SBANd</ch>	
[SENSe <ch>:]FREQuency:SEGMent:AXIS</ch>	
[SENSe <ch>:]FREQuency:SPAN</ch>	
[SENSe <ch>:]FREQuency:STARt</ch>	
[SENSe <ch>:]FREQuency:STOP</ch>	
[SENSe <ch>:]FREQuency[:CW]</ch>	
[SENSe <ch>:]LPORt<logpt>:ZCOMmon</logpt></ch>	
[SENSe <ch>:]LPORt<logpt>:ZDIFferent</logpt></ch>	754

[SENSe <ch>:]PAE:DCINput:MAIN</ch>	755
[SENSe <ch>:]PAE:DCINput:SECondary</ch>	755
[SENSe <ch>:]PAE:PARameters:I</ch>	755
[SENSe <ch>:]PAE:PARameters:R</ch>	756
[SENSe <ch>:]PAE:PARameters:U</ch>	756
[SENSe <ch>:]PAE:TYPE</ch>	756
[SENSe <ch>:]PORT<phypt>:ZREFerence</phypt></ch>	757
[SENSe <ch>:]POWer:AGCMode<phypt>:MEASure</phypt></ch>	760
[SENSe <ch>:]POWer:ATTenuation</ch>	758
[SENSe <ch>:]POWer:GAINcontrol</ch>	759
[SENSe <ch>:]POWer:GAINcontrol:GLOBal</ch>	760
[SENSe <ch>:]POWer:IFGain<phypt>:MEASure</phypt></ch>	760
[SENSe <ch>:]ROSCillator:EXTernal:FREQuency</ch>	761
[SENSe <ch>:]ROSCillator[:SOURce]</ch>	761
[SENSe <ch>:]SEGMent:COUNt?</ch>	765
[SENSe <ch>:]SEGMent<seg>:ADD</seg></ch>	763
[SENSe <ch>:]SEGMent<seg>:BWIDth[:RESolution]</seg></ch>	763
[SENSe <ch>:]SEGMent<seg>:BWIDth[:RESolution]:CONTrol</seg></ch>	764
[SENSe <ch>:]SEGMent<seg>:BWIDth[:RESolution]:SELect</seg></ch>	764
[SENSe <ch>:]SEGMent<seg>:BWIDth[:RESolution]:SELect:CONTrol</seg></ch>	765
[SENSe <ch>:]SEGMent<seg>:CLEar</seg></ch>	882
[SENSe <ch>:]SEGMent<seg>:DEFine</seg></ch>	766
[SENSe <ch>:]SEGMent<seg>:DEFine:SELect</seg></ch>	767
[SENSe <ch>:]SEGMent<seg>:DELete:ALL</seg></ch>	768
[SENSe <ch>:]SEGMent<seg>:DELete[:DUMMy]</seg></ch>	768
[SENSe <ch>:]SEGMent<seg>:FREQuency:CENTer?</seg></ch>	769
[SENSe <ch>:]SEGMent<seg>:FREQuency:SPAN?</seg></ch>	769
[SENSe <ch>:]SEGMent<seg>:FREQuency:STARt</seg></ch>	769
[SENSe <ch>:]SEGMent<seg>:FREQuency:STOP</seg></ch>	769
[SENSe <ch>:]SEGMent<seg>:INSert</seg></ch>	770
[SENSe <ch>:]SEGMent<seg>:INSert:SELect</seg></ch>	772
[SENSe <ch>:]SEGMent<seg>:OVERlap</seg></ch>	882
[SENSe <ch>:]SEGMent<seg>:POWer:GAINcontrol</seg></ch>	773
[SENSe <ch>:]SEGMent<seg>:POWer:GAINcontrol:CONTrol</seg></ch>	773
[SENSe <ch>:]SEGMent<seg>:POWer[:LEVel]</seg></ch>	772
[SENSe <ch>:]SEGMent<seg>:POWer[:LEVel]:CONTrol</seg></ch>	774
[SENSe <ch>:]SEGMent<seg>:SWEep:DWELI</seg></ch>	775
[SENSe <ch>:]SEGMent<seg>:SWEep:DWELI:CONTrol</seg></ch>	776
[SENSe <ch>:]SEGMent<seg>:SWEep:POINts</seg></ch>	777
[SENSe <ch>:]SEGMent<seg>:SWEep:TIME</seg></ch>	777
[SENSe <ch>:]SEGMent<seg>:SWEep:TIME:CONTrol</seg></ch>	778
[SENSe <ch>:]SEGMent<seg>:SWEep:TIME:SUM?</seg></ch>	779
[SENSe <ch>:]SEGMent<seg>[:STATe]</seg></ch>	775
[SENSe <ch>:]SWEep:AXIS:FREQuency</ch>	779
[SENSe <ch>:]SWEep:AXIS:POWer</ch>	780
[SENSe <ch>:]SWEep:COUNt</ch>	781
[SENSe <ch>:]SWEep:DETector:TIME</ch>	
[SENSe <ch>:]SWEep:DWELI</ch>	782

[SENSe <ch>:]SWEep:DWELI:IPOint</ch>	
[SENSe <ch>:]SWEep:POINts</ch>	
[SENSe <ch>:]SWEep:SPACing</ch>	
[SENSe <ch>:]SWEep:STEP</ch>	
[SENSe <ch>:]SWEep:TIME</ch>	
[SENSe <ch>:]SWEep:TIME:AUTO</ch>	
[SENSe <ch>:]SWEep:TYPE</ch>	
[SENSe <chn>:]CORRection:PSTate?</chn>	735
[SENSe <chn>:]FUNCtion[:ON]</chn>	
[SENSe <chn>:]SWEep:SRCPort</chn>	

#### Index

# Index

## Symbols

2nd Mixer	386
*.csv file format	68
*.limit	65
*.ripple	65
*.s <n>p file format</n>	66
*CLS	494
*ESE	494
*ESR?	494
*IDN?	494
*IST?	494
*OPC	494
*OPC (use)	483
*OPT?	494
*PCB	495
*PRE	495
*PSC	495
*RST	495
*SRE	495
*STB?	495
*TRG	495
*WAI	495
<channel> Properties</channel>	358
@DCL	924
@GET	924
@LOC	924
@REM	924
µ1 21 (softkey)	177
µ2 21 (softkey)	177

# Α

a1 Source Port 1	163
a2 Source Port 2	163
About	451
Active Channel (softkey) 193,	359
Active Diagram	
Active Diagram (softkey)	193
Active Power Cals (dialog)	356
Active Trace (softkey)	193
Add Ch + Tr + Diag	
Add Ch + Trace	
Add Device	
external generators	441
external power meters 437,	443
Add Ref Impedances	221
Addressed command 459,	926
Add Tr+Diag	409
Add Trace	
Add Trace + Diag	193
Adjust Time Gate	394
Admittance	. 48
AGC manual configuration	371
AGC Mode	371
AGC sweep segments	372
All Data & Func to Mem	203
All Data to Mem	
All Markers Off	239
All Power Cals On / Off	
All S-Params	152
Alternated (driving mode)	369
Annexes	922

Aperture	216
Aperture (softkey)	184
Applic Menu	
Apply	
SMARTerCal 317, 326,	334
System Error Correction 295,	303
Apply (calibration)	305
Arbitrary port settings	117
Arbitrary Power (Define Port Settings)	365
ASCII (*.csv) file	68
Ask before Overwriting	221
ATN	
Attention	925
Attenuation	
Authentication (cal unit characterization)	
Auto Config NRP-Zxx	
Auto Length	
Auto Length and Loss	
Automatic calibration	
Auto Power Reduction for Cal Unit	
Auto Scale Diagram	
Auto Scale Trace	
Auto Zero 178,	
Axis Pair	209

#### В

b1 / a1 Source Port 1	160
b1 / a2 Source Port 2	160
b1 Source Port 1	163
b1 Source Port 2	163
b2 / a1 Source Port 1	160
b2 / a2 Source Port 2	160
b2 Source Port 1	163
b2 Source Port 2	163
Balanced port	
Balanced Ports (dialog)	154
Bandfilter search	
Bandpass	
Bandpass (time gate)	209
Band pass impulse	112
Bandpass Ref to Max	249
Bandpass Ref to Mkr	250
Bandstop	32
Bandstop Ref to Max	250
Bandwidth	261
Bandwidth (bandfilter)	32
Banwidth (bandfilter search)	249
Basic instrument concepts	12
Black White Scheme	
Block data format	463
Boolean parameter	
Buffered Sweep	910

# С

Cal Connector Types (dialog)	
Cal group	53
Calibrate all Channels	
manual calibration 282, 289, 297, 312, 321, 32	28
Calibration 69, 278, 91	12
Cal Devices	35
Intermodulation 38	31

Manual (multiple)		295
Ports		281, 289, 298
Ports and Standards		294, 302
	orts 292, 3	
same gender all ports	; 292, 3	300, 323, 332
	l)	
Source port		289, 298
Start Cal		279
Sweep Diagrams		293, 302, 324
	·	
Calibration (System Confi		
Calibration kit		
Calibration Kits (dialog)		338
Calibration labels		
scalar power calibrati	on	95
SMARTerCal		
	on	
Calibration Manager (dial		
Calibration pool	· · ·	03
Calibration Presetting (dia		
SMARTerCal		327
Calibration Presetting Wiz	zard	287, 318
Calibration (multiple)		301
Connectors and Cal	Kits	290
Calibration Presetting Wiz	zard (MultiCal)	
Connectors and Cal k	Kits	
Connectors and Cal k		
Connectors and Cal P Define Calibration	Kits	297
Connectors and Cal P Define Calibration	(its	297 296
Connectors and Cal H Define Calibration Ports and Type Calibration standard	(its	297 296
Connectors and Cal Define Calibration Ports and Type Calibration standard Calibration sweep diagram	(its n	
Connectors and Cal Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration	(its	
Connectors and Cal Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type	(its n	
Connectors and Cal Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal	(its n	
Connectors and Cal Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) .	(its n	
Connectors and Cal Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration types	(its n	
Connectors and Cal Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) .	(its n	
Connectors and Cal Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration types Calibration unit	(its n	
Connectors and Cal I Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration types Calibration unit Calibration Unit	(its n	
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal Calibration types Calibration unit Calibration Unit	(its n	297 296 78 304 320, 329 312 70 84 344 280
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration unit Calibration Unit Calibration Unit Calibration Unit	(its n	297 296 78 304 320, 329 312 70 84 344 280
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration unit Calibration Unit Calibration Unit Calibration Unit (dialog) SMARTerCal Cal Kit	(itsn	297 296 78 304 320, 329 312 70 84 344 280 309
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration unit Calibration Unit Calibration Unit Calibration Unit Calibration Unit Calibration Unit Calibration Unit Calibration Unit	(its	297 296 78 304 320, 329 312 70 84 280 309 300, 323, 332
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration unit Calibration Unit SMARTerCal	<pre>(its</pre>	297 296 78 304 320, 329 312 70 84 344 280 309 300, 323, 332 300, 323, 331
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration unit Calibration Unit Calibration Unit Calibration Unit Calibration Unit Calibration Unit Calibration Unit Calibration Unit	<pre>(its</pre>	297 296 78 304 320, 329 312 70 84 344 280 309 300, 323, 332 300, 323, 331
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration types Calibration unit Calibration Unit Cal Kit Import Selection Cal Kits	(its	297 296 78 304 320, 329 312 70 84 344 280 309 300, 323, 332 300, 323, 331 82
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration types Calibration unit Calibration Unit Cal Kit Import Selection Cal Kits	(its	297 296 78 304 320, 329 312 70 84 344 280 309 300, 323, 332 300, 323, 331 82
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal (Auto) . Calibration types Calibration unit Calibration Unit Calibration Unit Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) Selection Cal Kits Calibration Presetting	(its	297 296 78 304 320, 329 312 70 84 344 280 309 300, 323, 332 300, 323, 331 82 290
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal (Auto) . Calibration types Calibration types Calibration Unit Calibration Unit Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Presetting Calibration Presetting	(its	297 296 78 304 320, 329 312 70 84 344 280 309 300, 323, 332 300, 323, 331 82 290 299
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration types Calibration Unit Calibration Unit Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Presetting Calibration Presetting SMARTerCal (Manua	(its	297 296 78 304 320, 329 312 70 84 344 280 309 300, 323, 332 300, 323, 331 2290 299 321
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration types Calibration Unit Calibration Unit Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Presetting Calibration Presetting Calibration Presetting SMARTerCal (Manua SMARTerCal (Manua	(its	297 296 78 304 320, 329 312 70 84 344 280 309 300, 323, 332 300, 323, 331 82 290 299 321 330
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration types Calibration Unit Calibration Unit Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Presetting Calibration Presetting Calibration Presetting SMARTerCal (Manua SMARTerCal (Manua SMARTerCal (Manua	(its	297 296 78 304 320, 329 312 70 84 344 280 309 300, 323, 332 300, 323, 331 82 290 299 321 330
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration unit Calibration Unit Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Presetting Calibration Presetting SMARTerCal (Manua SMARTerCal (Manua SMARTerCal (Manua Cal Power Offset Cal Unit	(its	297 296 78 304 320, 329 312 70 84 344 280 309 300, 323, 332 300, 323, 331 82 290 299 321 330 3351
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration unit Calibration Unit Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Cal Kit Import Selection Cal kit file Cal kit file Calibration Presetting SMARTerCal (Manua SMARTerCal (Manua SMARTerCal (Manua Cal Power Offset Cal Unit Characterization	(its	297 296 78 304 320, 329 312 70 84 344 280 309 300, 323, 332 300, 323, 332 300, 323, 331 82 290 299 321 330 330 351
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration unit Calibration Unit Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Presetting Calibration Presetting SMARTerCal (Manua SMARTerCal (Manua SMARTerCal (Manua Cal Power Offset Cal Unit Characterization Ports	(its	
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration unit Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Presetting Calibration Presetting Calibration Presetting SMARTerCal (Manua SMARTerCal (Manua SMARTerCal (Manua Cal Vits Cal Unit Characterization Ports SMARTerCal	(its	297 296 78 304 320, 329 312 70 84 344 280 309 300, 323, 332 300, 323, 331 300, 323, 331 290 299 321 330 321 330 351 282, 312 284, 314 281, 311
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration unit Calibration Unit Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Presetting Calibration Presetting SMARTerCal (Manua SMARTerCal (Manua SMARTerCal (Manua Cal Power Offset Cal Unit Characterization Ports	(its	297 296 78 304 320, 329 312 70 84 344 280 309 300, 323, 332 300, 323, 331 300, 323, 331 290 299 321 330 321 330 351 282, 312 284, 314 281, 311
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration unit Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Presetting Calibration Presetting Calibration Presetting SMARTerCal (Manua SMARTerCal (Manua SMARTerCal (Manua Cal Vits Cal Unit Characterization Ports SMARTerCal	(its	297 296 78 304 320, 329 312 70 84 344 280 309 300, 323, 332 300, 323, 331 82 300, 323, 331 290 300, 323, 331 300 323, 331 290 321 330 351 282, 312 284, 314 281, 311 37
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal (Auto) . Calibration unit Calibration Unit (dialog) SMARTerCal (Auto) . Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Presetting Calibration Presetting Calibration Presetting SMARTerCal (Manua SMARTerCal (Manua SMARTerCal (Manua SMARTerCal Cal Unit Characterization Ports SMARTerCal Cartesian diagram CD-ROM	(its	297 296 78 304 320, 329 312 70 84 344 280 309 300, 323, 332 300, 323, 331 300, 323, 331 290 299 321 330 351 282, 312 284, 314 281, 311 37 9
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration unit Calibration Unit Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Presetting Calibration Presetting Calibration Presetting SMARTerCal (Manua SMARTerCal (Manua SMARTerCal (Manua SMARTerCal (Manua SMARTerCal Cal Unit Characterization Ports SMARTerCal Cartesian diagram CD-ROM CENTER	(its	297 296 78 304 320, 329 312 70 84 344 280 309 300, 323, 332 300, 323, 331 300, 321, 311 300, 311 300
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration unit Calibration Unit Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Presetting Calibration Presetting Calibration Presetting Calibration Presetting SMARTerCal (Manua SMARTerCal (Manua SMARTerCal (Manua SMARTerCal (Manua SMARTerCal Cal Unit Characterization Ports SMARTerCal Cartesian diagram CD-ROM Center (bandfilter)	(its	297 296 78 304 320, 329 312 70 84 344 280 309 300, 323, 332 300, 323, 331 300, 321, 321 300, 321, 321, 321 300, 321, 321, 321 300, 321, 321, 321, 321, 321, 321, 321, 321
Connectors and Cal H Define Calibration Ports and Type Calibration standard Calibration sweep diagrar power calibration Calibration Type SMARTerCal SMARTerCal (Auto) . Calibration unit Calibration Unit Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Unit (dialog) SMARTerCal Calibration Presetting Calibration Presetting Calibration Presetting SMARTerCal (Manua SMARTerCal (Manua SMARTerCal (Manua SMARTerCal (Manua SMARTerCal Cal Unit Characterization Ports SMARTerCal Cartesian diagram CD-ROM CENTER	(its	297 296 78 304 320, 329 312 70 84 344 280 309 300, 323, 332 300, 323, 332 300, 323, 331 300, 323, 321 300, 321, 321 300, 321, 321 300, 322, 321 300, 323, 321 300, 321, 321 300, 322, 322, 322, 322, 322, 322, 322,

Channel programming examples	
	. 13
Channel Bits	
	420
Channel Bits (System Configuration)	426
Channel Config	359
Channels	359
Intermod	
Mixer Mode	
Mode	369
Port Config	362
Pwr Cal Settings	381
Channel Info	
Channel Manager (dialog)	261
Channel settings 33,	260
Channel State	357
Characteristic impedance	336
Characterization	
Cal Unit	212
Characterization Data	344
Characterization wizard	345
Characterize Cal Unit (dialog)	343
Chirp z-transformation	112
Chopped (driving mode)	260
Circle limit	
Circle Test	234
Clear Test	
Circle	236
Limit Line	
Ripple	
Close	452
Colorize Trace when Failed	417
Color Scheme	415
	415
Command	
common	
device-specific	459
processing	
	409
recognition	469
recognitionsequence	469 469
recognition	469 469
recognition sequence stucture and syntax	469 469 459
recognition sequence stucture and syntax synchronization	469 469 459 469
recognition sequence stucture and syntax synchronization Command reference	469 469 459 469 495
recognition sequence stucture and syntax synchronization Command reference	469 469 459 469 495 494
recognition sequence	469 469 459 469 495 494 5, 55
recognition sequence stucture and syntax synchronization Command reference	469 469 459 469 495 494 5, 55
recognition	469 469 459 469 495 494 5, 55 159
recognition	469 469 459 495 494 5,55 159 213
recognition	469 469 469 495 494 5, 55 159 213 213
recognition	469 469 469 495 494 5, 55 159 213 213
recognition	469 469 469 495 494 3, 55 159 213 213 475
recognition	469 469 469 495 494 5,55 159 213 213 475 439
recognition	469 469 469 495 494 5,55 159 213 213 475 439
recognition	469 469 459 469 495 494 3, 55 159 213 213 475 439 437
recognition	469 469 459 469 495 494 5, 55 159 213 213 213 475 439 437 443
recognition	469 469 459 469 495 494 5,55 159 213 475 439 437 443 922
recognition	469 469 459 469 495 494 3, 55 159 213 213 475 439 437 443 922 290
recognition	469 469 469 495 494 495 494 495 494 213 213 213 475 437 437 437 2290 299
recognition	469 469 469 495 494 495 494 495 494 213 213 213 475 437 437 437 2290 299
recognition	469 469 469 495 494 495 494 495 494 495 213 213 475 439 437 443 922 290 299 321
recognition	469 469 469 495 494 495 494 495 494 3, 55 159 213 475 439 437 443 922 290 299 321 330
recognition	469 469 469 495 494 3,55 159 213 213 475 439 437 439 2290 299 321 330 451
recognition	469 469 469 495 494 3, 55 159 213 213 475 437 443 922 290 299 321 330 451 221
recognition	469 469 469 495 495 495 495 213 213 213 213 213 475 439 437 443 922290 299 321 330 451 221 330
recognition	469 469 469 495 495 495 495 213 213 213 213 213 475 439 437 443 922290 299 321 330 451 221 330
recognition	469 469 469 469 495 495 495 495 213 213 213 213 213 475 439 437 443 9229 290 229 321 330 451 2213 330 451 2213 320 299 321 330 451 2213 320 229 2213 320 229 2213 2213 2213 2213 2213 2213 2213
recognition	469 469 469 495 494 495 494 495 159 213 213 475 439 437 443 922 299 321 330 451 2213 330 451 2213 320 925
recognition	469 469 469 495 494 495 159 213 213 475 439 437 443 922 290 321 330 451 221 . 34 276 925 . 20
recognition	469 469 469 495 494 495 494 495 495 159 213 213 475 439 437 2999 321 330 451 221 330 451 221 330 451 221 330 451 221 330 451 221 330 451 221 330 451 229 925 . 209 924
recognition	469 469 469 495 494 495 494 495 159 213 213 213 475 439 437 2999 321 330 451 221 . 34 25 20 925 . 20 924
recognition	469 469 469 495 494 495 494 495 159 213 213 213 475 439 437 2999 321 330 451 221 . 34 25 20 925 . 20 924
recognition	469 469 469 495 495 495 495 495 495 495 495 495 49

## D

Data & Func to <destination></destination>	
Data base	469
Data bus (GPIB)	
Data flow	
Data to <destination></destination>	
Data Valid	
DAV	925
dB Mag (softkey)	182
DC (menu)	178
DC1 (softkey)	179
DC2 (softkey)	
DC3 (softkey)	
DC4 (softkey)	
DC INPUT 1 4	178
DC Inputs	
DCL	4 926
DCL,SDC	
DC Value	
Decimal Separator	
Decouple Active Trace	
Decouple All Traces	
DEFault	
Default file locations	
Default Port Assignment	5, 315
Define *IDN? + *OPT?	432
Define Limit Lines (dialog)	227
Define Port Settings (dialog)	363
Define Ripple Test (dialog)	232
Define Segments (dialog)	271
Define Lleen Celen Cehenne (dielen)	440
Define User Color Scheme (dialog)	
Delay	0, 342
Delay	0, 342
Delay	), 342 3, 394
Delay	0, 342 3, 394 183
Delay	0, 342 3, 394 183 389
Delay	0, 342 3, 394 183 389 424
Delay	0, 342 3, 394 183 389 424 204
Delay	0, 342 3, 394 183 389 424 204 424
Delay	0, 342 3, 394 183 389 424 204 424 360
Delay	0, 342 3, 394 183 389 424 204 424 360 409
Delay	0, 342 3, 394 183 389 424 204 424 360 409 194
Delay       6         Delay (Offset Embed)       39         Delay (softkey)       9         Delay (trigger)       9         Delay (trigger)       9         Delete All Cal Kits       9         Delete all Mem       9         Delete Cal Pool       9         Delete Channel       9         Delete Diagram       9         Delete Trace       9         Delta Mode       9	0, 342 3, 394 183 389 424 204 424 360 409 194 239
Delay       6         Delay (Offset Embed)       39         Delay (softkey)       9         Delay (trigger)       9         Delete All Cal Kits       9         Delete all Mem       9         Delete Cal Pool       9         Delete Channel       9         Delete Trace       9         Delata Mode       9         Denominator       9	0, 342 3, 394 183 389 424 204 424 360 409 194 239 161
Delay	0, 342 3, 394 183 389 424 204 424 360 409 194 239 161 203
Delay	0, 342 3, 394 183 389 424 204 424 360 409 194 239 161 203 196
Delay	0, 342 3, 394 183 389 424 204 424 360 409 194 239 161 203 196 52
Delay       60         Delay (Offset Embed)       390         Delay (softkey)       390         Delay (trigger)       Delay (trigger)         Delete All Cal Kits       Delete all Mem         Delete Cal Pool       Delete Channel         Delete Diagram       Delete Trace         Delete Trace       Delate Mode         Destination       Destination         Destination (memory trace)       Detector         Detect Port Assignment       284, 284	0, 342 3, 394 183 389 424 204 424 360 409 194 239 161 203 196 52 6, 316
Delay       60         Delay (Offset Embed)       390         Delay (softkey)       390         Delay (trigger)       Delay (trigger)         Delete All Cal Kits       Delete all Mem         Delete Cal Pool       Delete Channel         Delete Diagram       Delete Trace         Delete Trace       Delay Mode         Denominator       Destination         Destination (memory trace)       Detector         Detect Port Assignment       284, 280         Device address       284, 280	0, 342 3, 394 183 389 424 204 424 360 409 194 239 161 203 196 52 6, 316 458
Delay       60         Delay (Offset Embed)       390         Delay (softkey)       390         Delay (trigger)       Delay         Delay (trigger)       Delete All Cal Kits         Delete All Cal Kits       Delete Cal Pool         Delete Cal Pool       Delete Channel         Delete Diagram       Delete Trace         Delete Trace       Delate Mode         Destination       Destination         Destination (memory trace)       Detect Port Assignment         Device address       Device message	0, 342 3, 394 183 389 424 204 424 360 499 194 239 196 239 196 52 5, 316 458 459
Delay       60         Delay (Offset Embed)       390         Delay (softkey)       390         Delay (trigger)       Delay (trigger)         Delete All Cal Kits       Delete All Cal Kits         Delete all Mem       Delete Cal Pool         Delete Channel       Delete Diagram         Delete Trace       Delete Trace         Delta Mode       Destination         Destination (memory trace)       Detector         Detect Port Assignment       284, 280         Device address       Device message         Device response       Device response	0, 342 3, 394 183 389 424 204 424 360 499 194 239 196 52 5, 316 458 459 459
Delay       60         Delay (Offset Embed)       390         Delay (softkey)       390         Delay (trigger)       Delay         Delay (trigger)       Delay         Delete All Cal Kits       Delete All Cal Kits         Delete Cal Pool       Delete Channel         Delete Diagram       Delete Trace         Delete Trace       Delay         Delay Mode       Destination         Destination (memory trace)       Detector         Detect Port Assignment       284, 280         Device address       Device message         Device response       Diagram	0, 342 3, 394 183 389 424 204 424 360 429 194 239 196 52 5, 316 458 459 13
Delay       60         Delay (Offset Embed)       390         Delay (softkey)       390         Delay (trigger)       Delay (trigger)         Delete All Cal Kits       Delete All Cal Kits         Delete all Mem       Delete Cal Pool         Delete Channel       Delete Diagram         Delete Trace       Delete Trace         Delta Mode       Destination         Destination (memory trace)       Detector         Detect Port Assignment       284, 280         Device address       Device message         Device response       Device response	0, 342 3, 394 183 389 424 204 424 360 429 194 239 196 52 5, 316 458 459 13
Delay       60         Delay (Offset Embed)       390         Delay (softkey)       390         Delay (trigger)       Delay         Delay (trigger)       Delay         Delete All Cal Kits       Delete All Cal Kits         Delete Cal Pool       Delete Channel         Delete Diagram       Delete Trace         Delete Trace       Delay         Delay Mode       Destination         Destination (memory trace)       Detector         Detect Port Assignment       284, 280         Device address       Device message         Device response       Diagram	0, 342 3, 394 183 389 424 204 424 204 424 360 499 194 239 194 203 194 203 194 203 458 459 13 890
Delay       60         Delay (Offset Embed)       390         Delay (softkey)       390         Delay (trigger)       Delay         Delay (trigger)       Delay         Delete All Cal Kits       Delete All Cal Kits         Delete Cal Pool       Delete Channel         Delete Channel       Delete Trace         Delete Trace       Delay         Delay Mode       Destination         Destination (memory trace)       Detector         Detect Port Assignment       284, 280         Device address       Device message         Device response       Diagram         programming examples       Diagram	0, 342 3, 394 183 389 424 204 424 204 424 409 194 239 194 203 194 458 459 459 13 890 35
Delay       6         Delay (Offset Embed)       39         Delay (softkey)       39         Delay (trigger)       Delay         Delay (trigger)       Delay         Delete All Cal Kits       Delete All Cal Kits         Delete Cal Pool       Delete Channel         Delete Channel       Delete Trace         Delete Trace       Delete Trace         Delat Mode       Destination         Destination       Destination         Destination       284, 28         Device address       Device message         Device response       Diagram         programming examples       Dialog	0, 342 3, 394 183 389 424 204 424 204 424 409 194 239 194 239 194 239 194 458 459 459 13 890 35 53, 55
Delay       6i         Delay (Offset Embed)       39i         Delay (softkey)       39i         Delay (trigger)       Delay         Delay (trigger)       Delay         Delete All Cal Kits       Delete All Cal Kits         Delete Cal Pool       Delete Channel         Delete Channel       Delete Trace         Delete Trace       Delete Trace         Delat Mode       Denominator         Destination       Destination         Destination (memory trace)       Detector         Detect Port Assignment       284, 280         Device address       Device response         Diagram       programming examples         Dialog       Differential mode         Discrete       Discrete	0, 342 3, 394 183 389 424 204 424 204 424 409 194 239 194 239 194 239 194 458 459 459 13 890 35 53, 55
Delay       6         Delay (Offset Embed)       39         Delay (softkey)       39         Delay (trigger)       Delay         Delay (trigger)       Delay         Delete All Cal Kits       Delete All Cal Kits         Delete all Mem       Delete Cal Pool         Delete Cal Pool       Delete Channel         Delete Trace       Delete Trace         Delta Mode       Denominator         Destination       Destination         Destination (memory trace)       Detector         Detect Port Assignment       284, 28         Device address       Device response         Diagram       programming examples         Dialog       Differential mode         Display       Display	0, 342 3, 394 183 389 424 204 424 204 424 360 409 194 239 194 239 195 203 458 459 13 890 35 53, 55 241
Delay       60         Delay (Offset Embed)       393         Delay (softkey)       393         Delay (trigger)       0         Delete All Cal Kits       0         Delete all Mem       0         Delete Cal Pool       0         Delete Diagram       0         Delete Trace       0         Delta Mode       0         Destination       0         Destination (memory trace)       0         Detect Port Assignment       284, 280         Device address       0         Device response       0         Diagram       0         programming examples       0         Dialog       0         Display       Config	0, 342 3, 394 183 389 424 204 424 360 409 194 239 161 203 196 52 6, 316 458 459 13 890 35 53, 55 241 414
Delay       6         Delay (Offset Embed)       39         Delay (softkey)       39         Delay (trigger)       Delay         Delay (trigger)       Delay         Delete All Cal Kits       Delete All Cal Kits         Delete all Mem       Delete Cal Pool         Delete Cal Pool       Delete Channel         Delete Trace       Delete Trace         Delta Mode       Denominator         Destination       Destination         Destination (memory trace)       Detector         Detect Port Assignment       284, 28         Device address       Device response         Diagram       programming examples         Dialog       Differential mode         Display       Display	0, 342 3, 394 183 389 424 204 424 360 409 196 52 6, 316 459 459 459 459 35 53, 55 241 414 408

User Manual	1173.9163.02 - 13

TouchScreen	420
View Bar	419
Displayed Columns (dialog)	274
Display elements	25
Display formats	
Display settings	407
Documentation map	
DOWN	463
Driver (remote control)	454
Driving Mode	369
Dual Split	412

### Е

Electrical Length		
Electrical Length (calibration standard)	 	342
ENABle	 472,	474
EOI	 	925
Error Log	 	429
Error message	 	917
Error queue	 472,	485
Errors	 	917
Asynchronous		
During firmware update	 	920
During measurement	 	918
FPGA update	 	920
ESB	 	477
ESE	 472,	478
ESR		
Evaluation Range (dialog)	 	214
EVENt register		
Execution (command)		
overlapping	 	469
sequential	 	469
Export		
sweep segments	 	273
Export (trace data)	 	219
Export Data (dialog)	 	220
Export Markers	 	242
External generator	 	131
External Generators (dialog)	 	438
External Matrices (dialog)	 	441
External power meter		
External Power Meters (dialog)	 	436
External reference	 	430
Ext Frequency	 	430
EXT TRIG OUT / IN	 	924

#### F

Factor (average)	262
Field Separator	222
File settings	142
Fit Frequency Range	380
Fixed (marker)	242
Fixture Compensation	395
Flatness / Gain / Slope	
Flatness calibration	93
Flatten Noise	263
Font Size	416
Format settings	181
Formatted Values (trace export)	221
Formula (PAE)	181
FPGA update failure	
Free Run / External / Manual / Multiple Triggers	
Freq for Loss	
Freq Step Size	264

# Frequency (mixer)384Frequency conversion measurements (R&S ZNB-K4)117Frequency Info415Frequency Span256Fuse replacement936

#### G

#### Н

Handler I/O (Universal Interface) 92	28
Handshake bus	24
Hardkey panel 2	24
Hardware	28
Hardware (connectors)	22
Harmonic grid 114, 20	
Help Menu 45	51
Help system	9
Hide All Data 20	
Hide All Mem 20	)4
HiSLIP	53
Hold	17
Horizontal Line 23	37

#### I

Ideal (cal kit)	81
IEC/IEEE Bus Interface	
IECWIN32	454
IEEE 488 CH 1	
IEEE 488 CH 2	
IFC	
Imag (softkey)	
Image Suppr.	
Imb12 (softkey)	
Imb21 (softkey)	175
Imbalance (menu)	174
Imbalance (softkey)	
Imbalance parameters	
Impedance	
Import	
Cal Kit	292, 300, 323, 332
sweep segments	
Import (trace data)	
Import Complex Data (dialog)	219
Import Data to New Mem	
Import File	
Import Trace	
Impulse Response	205
Increased Bandwidth (option)	678
Index (help)	
· · /	

INFintiy	. 463
Info (dialog)	
Info Table	. 416
Instrument-control commands	. 459
Instrument hardware	. 469
Instrument Messages	
Interface	, •=.
functions (GPIB bus)	926
Interface Clear	
Interface message	
Interface messages	. 433
0	000
GPIB	
VXI-11	
Interfaces	
Intermodulation	
define	. 376
Intermodulation measurements (R&S ZNB-K14)	. 122
results	. 124
Internal reference	. 430
Inverted Smith chart	
Inv Smith (softkey)	. 186
IP Address	
IST flag	

#### Κ

K 21 (softkey)	177
Keyword (SCPI command)	
Kit Standards (dialog)	
Known devices	
external generators	439
external power meters	437
switch matrices	442

#### L

LAN Config Initialize	433
Language	421
Light Scheme	419
Limit Check (softkey)	225
Limit Fail Beep	
Limit line	61
files	65
Lines	
Horizontal Line	237
Limit Test	224
Ripple Test	230
Lines settings	223
Line Styles Scheme	419
Line Type	337
Lin Freq	6, 267
Lin Mag (softkey)	186
LLO	926
Load Match Correction	355
Load parameters (calibration standard)	342
LOC	
Lock Diagrams	420
Lock Screen	420
Log Errors	436
Logical Port	
Deembed Balanced	406
Embed Balanced	404
Logical Port Config	
Balanced ports	157
Loss	342
Loss (bandfilter)	32
Loss at DC	398

Loss at Freq	398
Loss parameters	
definition	101
Low Distortion	
Lower edge (bandfilter)	32
Lower limit	61
Lower Tone (intermodulation)	377
Low Noise	371
Low pass impulse	112
Low Pass Settings (dialog)	
Low pass step	112
LXI	
browser interface	487
classes	486
configuration	486
LXI Status Enabled	434

#### Μ

Maintenance		
Manual Config (AGC)		371
Manual Trigger		
Marker		. 28
Bandfilter Search		248
Info Field		254
Marker Props		
Markers		
Marker Search		
Set by Marker		
Target Search		
Marker coupling		
Marker Format		
Marker Info		
Marker info field		
Marker Name		
Marker search functions		31
Marker settings		
Marker Style		
Max (marker search)		
Max (softkey, trace scale)		
Max = Marker		
Max Hold		
Maximize		
MAXIMIZE MAXIMUM		
Mean/Std Dev / RMS		
Meas		211
Admittance		171
DC		
Imbalance		
Impedance		
Intermodulation		
Power Sensor		
Ratios		
S-params		
Stability		
Wave		
Y-Z-Params		
Meas Delay		
Meas settings		
Measure Fixture		
Measure Fixture Terminated Type		
Measurement receiver calibration		080
Measurement results		
Measurement Type (PAE)		
Medaurement Type (PAE)	302	100
Menu bar		
Menus		. 23

Min/Max Peak-Peak	. 211
Min (marker search)	. 243
Min (softkey, trace scale)	
Min = Marker	253
Min Hold	. 217
Minimize	. 451
MINimum	. 463
Mixed mode parameters	55
Mixer Meas (dialog)	. 382
Mixer Mode	. 382
Mkr 1 Mkr 10	239
Mkr Stimulus	239
Mode conversion factor	55
Modify Cal Power (dialog) 349	, 368
Modify Frequency Conversion (dialog)	. 367
More Ratios	. 160
More Ratios (dialog)	
More Wave Quantities	. 163
More Wave Quantities (dialog)	. 164
Move	. 451
Multiple Calibration Presetting Wizard	. 295
Multiplication (mixer)	. 385

#### Ν

NAN (not a number)	463
Navigation tools	20
NDAC	925
New (recall set)	143
Next Peak	244
NINF (negative infinity)	463
Notch (time gate)	
NRFD	925
NTR	472
NTRansition 474	4, 475
Number of Points	. 264
Numerator	161
Numeric Suffix (remote control)	493

#### 0

Offset Correction	395
Offset Embed	
Balanced Ports	403
Deembed Balanced	405
Deembed Single	401
Embed Balanced	404
Embed Single	399
Offset	392
One Way Loss	397
Physical Ports	399
Offset Loss	342
Offset model	337
Offset parameters	100
application	105
balanced ports	106
definition	100
Offset parameters (calibration standard)	342
Open Recall	143
Operation Complete	478
OPERation register 472,	
Options	
R&S ZN-B14	
R&S ZNB-B81	
R&S ZNB-K17	
R&S ZNB-K2	
R&S ZVAB-B44	435

#### Ρ

PAE				
Parallel Poll				
Parameter (remote control)				
Partial measurement				. 16
Password				429
cal unit characterization				344
Peak Left / Right				244
Peak Type				
Permittivity				
Persistent settings				
Phase / El Length				
Phase (softkey)				
Pin 16 - 19				
Polar (softkey)				
Polar diagram				
Port				. 50
Connector	201	200	200	221
Embed Single				400
Gender				
Offset				
Port (Offset Embed)				
Port Assign				
Port Power Offset				350
Ports				
Calibration		281,	289,	298
Cal Unit			284,	314
SMARTerCal (Manual)		311.	320.	329
Ports and Type		- ,	,	
Calibration Presetting Wizard (MultiC	al)			296
SMARTerCal (Manual) Wizard				
Port settings (mixer)				
Port State				
Power				
Bower (miyer)				201
Power (mixer)				
Power (sweep)				268
Power (sweep) Power Added Efficiency (dialog)				268 179
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE)			·····	268 179 127
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings			·····	268 179 127
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings Power Bw Avg				268 179 127 260
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings Power Bw Avg Average				268 179 127 260 261
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings Power Bw Avg Average Bandwidth				268 179 127 260 261 260
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings Power Bw Avg Average Bandwidth Power				268 179 127 260 261 260
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings Power Bw Avg Average Bandwidth Power Cal				268 179 127 260 261 260 260
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings Power Bw Avg Average Bandwidth Power				268 179 127 260 261 260 260
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings Power Bw Avg Average Bandwidth Power Cal				268 179 127 260 261 260 260 304
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings Power Bw Avg Average Bandwidth Power Cal Screen				268 179 127 260 261 260 260 304 . 92
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings Power Bw Avg Average Bandwidth Power Cal Screen Power calibration				268 179 127 260 261 260 260 260 304 . 92 . 94
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings Power Bw Avg Average Bandwidth Power Cal Screen Power calibration measurement receiver				268 179 127 260 261 260 260 260 304 . 92 . 94 . 93
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings Power Bw Avg Average Bandwidth Power Power Cal Screen Power calibration measurement receiver reference receiver source				268 179 127 260 261 260 260 260 304 92 94 93 93
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings Power Bw Avg Average Bandwidth Power cal Screen Power cal Screen Power calibration measurement receiver reference receiver source Power Cal – Meas. Receiver (dialog)				268 179 127 260 261 260 260 260 304 . 92 . 94 . 93 308
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings Power Bw Avg Average Bandwidth Power Cal Screen Power calibration measurement receiver reference receiver source Power Cal – Meas. Receiver (dialog) Power Cal – Power (dialog)				268 179 127 260 261 260 260 304 . 92 . 94 . 93 308 308 306
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings Power Bw Avg Average Bandwidth Power cal Screen Power calibration measurement receiver reference receiver source Power Cal – Meas. Receiver (dialog) Power Cal – Power (dialog)				268 179 127 260 261 260 260 304 . 92 . 94 . 93 308 306 366
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings Power Bw Avg Average Bandwidth Power Cal Screen Power calibration measurement receiver reference receiver source Power Cal – Meas. Receiver (dialog) Power Cal – Power (dialog) Power Conversion Power loss list				268 179 127 260 261 260 260 304 . 92 . 94 . 93 308 306 366
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings Power Bw Avg Average Bandwidth Power Cal Screen Power Cal Screen Power calibration reference receiver reference receiver source Power Cal – Meas. Receiver (dialog) Power Cal – Power (dialog) Power Cal – Power (dialog) Power loss list Power Meter				268 179 127 260 261 260 260 260 260 304 . 92 . 94 308 308 306 353
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings Power Bw Avg Average Bandwidth Power Cal Screen Power Cal Screen Power calibration measurement receiver reference receiver source Power Cal – Meas. Receiver (dialog) Power Cal – Power (dialog) Power Conversion Power loss list Power Meter SMARTerCal		312,	320,	268 179 127 260 261 260 260 260 304 . 92 . 94 . 93 308 306 353 330
Power (sweep) Power Added Efficiency (dialog) Power added efficiency (PAE) Power Bandwidth Average settings Power Bw Avg Average Bandwidth Power Cal Screen Power Cal Screen Power calibration reference receiver reference receiver source Power Cal – Meas. Receiver (dialog) Power Cal – Power (dialog) Power Cal – Power (dialog) Power loss list Power Meter		312,	320,	268 179 127 260 261 260 260 260 304 . 92 . 94 . 93 308 306 353 330

Power Port	040,000
SMARTerCal	
Power Sensor (menu)	
PPC	
PPE	472, 478
PPU	926
Predefined Configs	
Balanced ports	155
Prepare Measurement of IM Order	378
Preset	
Preset Configuration	423
Presets (System Configuration)	
Preset Scope	
Print	
Program example	912
calibration	
Programming examples	
PTŇA	
РТОМ	
PTOSM	
PTR	475
PTRansition	
PTRL	
PTRM	
PTSM	
Public folder	
PUOSM	

# Q

Quad Split	
Quality factor (bandfilter)	32
Query	459
QUEStionable:INTegrity register	480
QUEStionable:LIMit register	479
QUEStionable register	472, 479
Summary bit	477

# R

R&S ZN-B14 (Handler I/O)	928
R&S ZNB-B81 (option)	178
R&S ZNB-K14 (intermodulation measurements)	122
R&S ZNB-K17 (Increased Bandwidth)	678
R&S ZNB-K2	
R&S ZNB-K2 (option)	204
R&S ZNB-K4 (frequency conversion measurements)	
	117
R&S ZVAB-B44 (option)	
R&S ZVR compatible commands	863
R&S ZV-Zxx	84
Range Limit Lines on	
Evaluation Range	215
Search Range	246
Ranges (DC inputs)	179
Ratio	51
Ratios (menu)	159
Read .s1p File	341
Read .s2p File	341
Read-only folder	644
Real (softkey)	
Recall Last Cal Set	356
Recall Limit Line	229
Recall Ripple Test	234
Recall set	13
Recall Sets	
Receiver Level (Define Port Settings)	366

User Manual 1173.9163.02 - 13

Receiving Port (intermodulation)	
Recent Files	
Reduced Through calibration	
Reduce Noise	
Reference impedance	57
Reference Impedance	
Balanced ports	158
Reference Receiver Cal Power	351
Ref Mkr	
Ref Mkr -> Mkr	242
Ref Position	189
Ref Val = Marker	
Ref Value	
Relative Permittivity	
Release notes	
REM	
Remote control	
activation	
basic concepts	
introduction	
Remote Control combine with manual control	450
combine with manual control	
Remote Language	
Remote LXI (dialog)	
Remote Preset Configuration	
REN	
Renormalization (of port impedances)	
Renormalization according to Theory of	159
Replacing fuses	
Reset Colors	
Reset Dialogs	
Reset Frequency Conversion	
Reset Frequency Conv Intermod	373
Reset Offsets	395, 399
Reset Port Settings	
Reset Values	
Status Reporting System	485
Resolution Enh(ancement)	206
Resolve Pool Link	
Response (to queries)	
Response Value (horizontal line)	
Restart Manager (dialog)	
Restart Sweep	
Restart Sweep on Std Meas	5 303 326 334
Restore	
Result is Wave Quantity	
Result Off	
Revision	
RF Off (port configuration)	
RF Off All Channels	
Ripple Check (softkey)	
Ripple Fail Beep	
Ripple limit	
files	

# S

Scalar Mixer Mode Scalar power calibration Scale	382 . 92
Scale Coupling	190
Scale Values	
Zooming	
Scale/Div	
Scale settings	
-	107
Scan Instruments external generators	440
external power meters	
SCPI commands	
SCPI command structure	
SCPI Status Register	
event status register	
IST flag	
parallel poll enable register	
service request enable register	
STATus:OPERation register	
STATus:QUEStionable:INTegrity	480
STATus:QUEStionable:LIMit	
STATus:QUEStionable register	
status byte	
Structure	472
Screen elements	. 20
Screen Keyboard	450
SDC	926
Search functions	. 31
Search Left (target)	247
Search Mode 244,	
Search Path for Additional Cal Kits	
Search Range (dialog)	
Search Right (target)	
Segmented (sweep)	
Segmented AGC	
Seg x-Axis	
Selectivity	
Select Marker	
Select Parameters (dialog)	
Select Ports (dialog)	
Selftest	
Sequence (trigger)	
Sequential command execution	160
Serial Poll	
Service Function (dialog)	
Service request	403
Service Request Enable	4//
Setup	404
External Devices	
Reference	
Remote Settings 430,	
Setup	
Setup (Info)	427
Shift trace	
response	
stimulus	
Show <data></data>	
Show All Data	
Show All Mem	
Show as	
Show Errors	
Show Limit Fail Symbols	417
Show Limit Line	224
Show Mem	198
Show Point List	273
Show Range Limits	209
Show Results All Traces	232

Show Ripple Limits Show Sweep Symbols Side Lobe Level		425
frequency window		206
time gate		
Single-ended mode		
Single sweep		
Size		451
Sliding Match		82
Slope / Level		
Slope (arbitrary power)		366
SMARTerCal		. 98
Ports, Standards and Power	325.	333
Power Meter		
Power Port		
Power Sweep Diagram		
Туре		
SMARTerCal (Manual) Ports	320	320
SMARTerCal (Manual) Wizard	320,	529
Calibration		224
		324
Connectors and Cal Kits		
Ports and Type	319,	327
SMARTerCal (Manual) Wizard(MultiCal)		
Connectors and Cal Kits		
Smarter calibration		
SMARTerCal with Cal Unit		
Smith (softkey)		183
Smith chart		39
Smoothing		216
Softtool panel		22
Sounds		
Source (calibration)		
Source Port		
Source power calibration		
SPAN		
Span = Marker		
S-parameter		
multiport		
S-Parameter (softkey)		
S-Parameter Wizard		
SPD		
SPE		
Split All		
Split Type		
Split Type		270
SRE		
SRQ	,	
Stability (menu)		
Stability (softkey)		
Stability factors		
START		
Start = Marker		
Start Cal Sweep	,	
Start Frequency		
Start Power		
Status bar		
Status Registers		472
Status reporting system		
common commands		
Error queue		
Parallel poll		
Queries		
Reset Values		
Serial poll		
Service request		483
STB	472,	477

Step Attenuators	258
Power	257
Stimulus	
Time Domain X-Axis	
Stimulus Axis	
Stimulus settings	
STOP	
Stop = Marker	
Stop Frequency	
Stop Power	
Stop Time	
Storing	
String	463
Support	
Sweep	
Sweep Control	276
Sweep Params	
Sweep Type	266
Sweep Active Channel	
Sweep All Channels	278
Sweep History	910
Sweeps (sweep control)	277
Sweep settings	
Sweep Time	265
Sweep type	266
Switch Matrices	
Add Switch Matrix (dialog)	445
Delete Switch Matrix (dialog)	446
Switch Matrix RF Connections (dialog)	444
SWR (softkey)	
Syntax elements (SCPI, overview)	463
System Configuration (dialog)	421

System settings ...... 420

#### Т

Target Search	247
Target Value	247
Test Port Assignment	346
Text parameter	463
Time / Distance	259
Time (sweep)	269
Time Center	
Time Domain	205
Time domain (R&S ZNB-K2)	112
Time domain analysis	204
Time Domain Transform	
Time Gate	209
Time Span	259
Time Start	259
Time Stop	259
Title (diagram)	26, 409
Title Bar	21
Title Bar Task Bar	450
Tolerance (flatness cal)	349
Tone Distance (intermodulation)	378
Tool 2 Tool 8	450
Toolbar	
Total readings (flatness cal)	349
Touchstone (*.s <n>p) file</n>	66
Trace	13, 26
programming examples	890
Trace Colors per Diagram	418
Trace Config	
All Mem All Data	202
Mem Math	196

Smooth Shift Hold	215
Time Domain	204
Time Gate	208
Trace Data	218
Traces	192
Trace Statistics	210
Trace Config settings	192
Trace files	
Trace Info	415
Trace list	. 27
Trace Manager (dialog)	194
Trace Math	198
Trace settings	150
Tracking	
bandfilter	252
marker search, target search	244
Transmission coefficients	353
Transparent Info Fields	425
Trigger	387
Sweep Control	391
Trigger	387
Trigger Manager (dialog)	390
Triple Split	412
Troubleshooting	917
TTL 1 / 2 Pass	226
Two Port Configuration (dialog)	352
Type (calibration)	
Typical (cal kit)	. 81

#### U

Unbalance-balance conversion	53
Universal command	
Universal Interface	
Unwrapped Phase (softkey)	
UP	
Upper/lower case (remote control)	493
Upper edge (bandfilter)	
Upper limit	
Upper Tone (intermodulation)	377
USB-to-IEC/IEEE Adapter	435
User Cal Active	355
User Configs	
Balanced ports	156
User Defined	199
User Def Math (dialog)	
User Interface (System Configuration)	424
User manual	
USER PORT	922
Use Trc Color for Limit Lines	418

#### ۷

Velocity Factor	394
View / Modify Cal Kit Standards (dialog)	341
Virtual differential mode	53
VISA	453
VNA Port Assignment	346
VXI-11	453

#### W

Wave (menu) Wave Quantity Wave quantity Windows Explorer	164 51
Windows Explorer	450

## Y

Y/Z-Parameter (softkey) 173
Y <- (softkey) 171
Y<-S11 (softkey) 172
Y<-S12 (softkey) 172
Y<-S21 (softkey) 172
Y<-S22 (softkey) 172
Y < Sij (menu) 171
Y11 (softkey) 173
Y12 (softkey) 173
Y21 (softkey) 173
Y22 (softkey) 173
Y-parameter 50
Y-Z-Params (menu) 172

#### Ζ

Z <- (softkey)	170
Z<-S11 (softkey)	
Z<-S12 (softkey)	
Z<-S21 (softkey)	170
Z<-S22 (softkey)	
Z < Sij (menu)	169
Z11 (softkey)	174
Z12 (softkey)	
Z21 (softkey)	
Z22 (softkey)	174
Zero Delay at Marker	254
Zoom	
softtool panel	191
Zoom Select	191
Zoom Stimulus	
Zoom window	191
Z-parameter	48

**C**ompliments of



Email our TM Sales Team www.conres.com/test-equipment

User Manual 1173.9163.02 - 13