


## Up to 105 channels\*

\*When used with LR8510 or LR8511 measurement units.

## Wireless

# Data Collection

Featuring Bluetooth® wireless technology, faster wiring of multichannel input, and easy distributed setup.

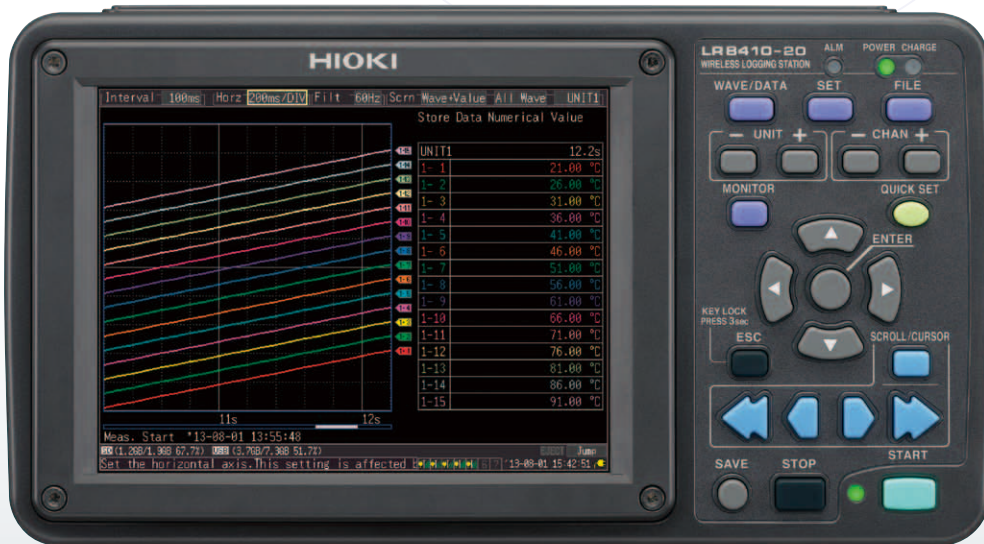

Built in Bluetooth® wireless technology

Please see [www.hioki.com](http://www.hioki.com) for list of supported regions.

# Easy expansion with an extensive selection of measurement units and loggers

Data is sent wirelessly to the wireless logging station from measurement units and wireless loggers.

## Wireless loggers

WIRELESS PULSE LOGGER  
LR8512




WIRELESS CLAMP LOGGER  
LR8513



WIRELESS HUMIDITY LOGGER  
LR8514



WIRELESS VOLTAGE/TEMP LOGGER  
LR8515

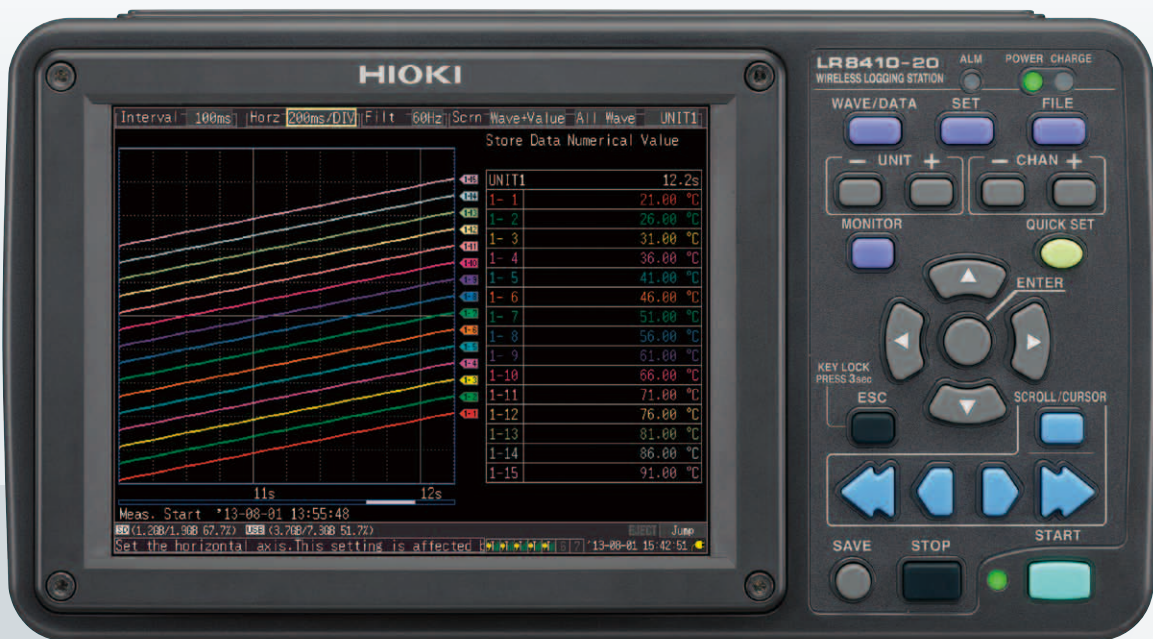


## Measurement units

WIRELESS VOLTAGE/TEMP UNIT LR8510



WIRELESS UNIVERSAL UNIT LR8511

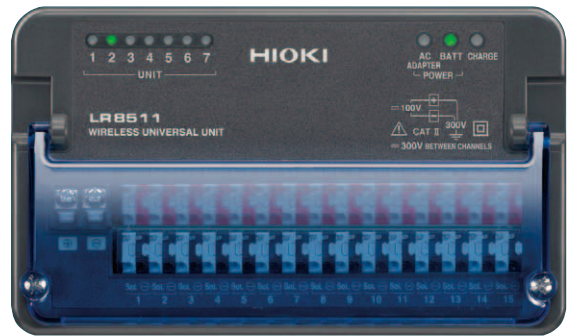

Communication range: 30 m, line of sight

Number of units: Up to 7  
(including mixture of measurement units and wireless loggers)

### Measurement units and wireless loggers

|                       |             | LR8510 | LR8511 | LR8512 | LR8513 | LR8514 | LR8515 |
|-----------------------|-------------|--------|--------|--------|--------|--------|--------|
| No. of input channels |             | 15     | 15     | 2      | 2      | 2      | 2      |
| Input type            | Voltage     | ✓      | ✓      |        |        |        | ✓      |
|                       | Temperature | ✓      | ✓      |        |        | ✓      | ✓      |
|                       | Humidity    |        | ✓      |        |        | ✓      |        |
|                       | Resistance  |        | ✓      |        |        |        |        |
|                       | Pulse       |        |        | ✓      |        |        |        |
|                       | Current     |        |        |        | ✓      |        |        |

LR8510/LR8511

#### Voltage

##### Fully isolated input channels

Maximum rated voltage to earth: 300 VAC, DC  
Max. inter-channel voltage: 300 VDC

LR8510/LR8511

#### Thermocouple

##### K, J, E, T, N, R, S, B, W

Measurement range varies with thermocouple type (see specifications page).

LR8511

#### Pt100/ JPt100

**Pt100** :-100 to 800°C  
**JPt100** :-100 to 500°C  
3-wired/ 4-wired, 1mA testing current

LR8511

#### Resistance

**0 to 200 Ω**  
Measurement ranges:  
10/20/100/200 Ω

LR8511

#### Humidity

**5.0 to 95.0 %rh**  
Requires Humidity Sensor  
Z2000 (option).

LR8512

#### Pulse

##### Flow rate·No. of revolutions

Non-voltage "a" contact  
Open collector, or voltage input (0 to 50 V)

LR8513

#### Current using sensors

**AC and DC load current and  
AC leak current**  
Measurement range varies with  
clamp type (see option page).

LR8514

#### Temperature, humidity

**Dedicated temperature and  
humidity sensor (optional)**  
Z2010 (50 mm long, including sensor)  
Z2011 (cable length: 1.5 m)

LR8515

#### Voltage

**0 to 50V**  
Measurement range:  
50 m/500 m/5/50 V

LR8515

#### Thermocouple

**K, T**  
Requires thermocouple



# Wireless data transmission for superior ease of use



The communications range between the LR8410 and measurement units/wireless loggers is 30 m (line of sight). The communications range may be reduced if there are obstructions (such as walls or metallic shielding) between the devices. In addition, radio wave intensities, which are indicated with the antenna-like indicators, vary depending on units even while these units are operating in the same environment.


## 1. Making the wiring process faster while minimizing costs

**Have you dealt with problems like these?**

Recording a large number of channels means you'll have to deal with a mess of wires. In addition to increasing the cost of connection cables and thermocouples, long wires make setup more time-consuming.

**Resolved with wireless data transmission**

The lack of wiring around the instrument makes for a clean installation. Minimal wiring means lower costs and faster setup.

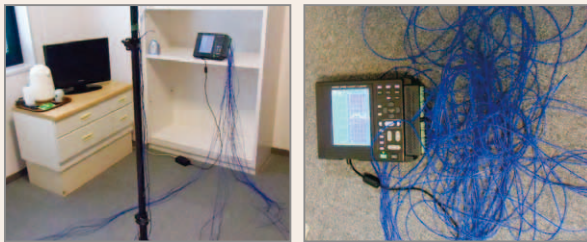

Long wires are used to connect the instrument to the measurement locations.



Data is sent wirelessly from measurement units to the LR8410.


## 2. Make measurements where it would not be practical to wire equipment directly.

**Have you dealt with problems like these?**

Running a large number of thermocouples from a logger to the ceiling or crawlspace would mean a wiring nightmare. Data can't be viewed during measurement, and data download is virtually impossible. Logging for extended periods requires extra power, something traditional loggers can't support.

**Resolved with wireless data transmission**

There's no need to connect measurement units to the Wireless Logging Station LR8410 with long wires. Instead, you can install the logging module in an attic or crawlspace and check data from the LR8410's screen while measurement is ongoing.

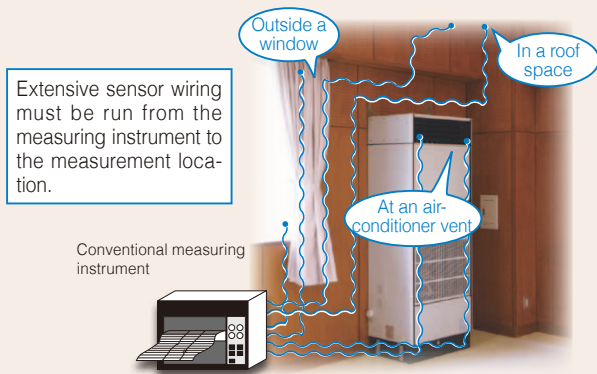

Monitoring the temperature near wall-mounted air-conditioners, in high places such as roof spaces, or in crawl spaces



Measurement units can operate on batteries in locations where power is not available.  
LR8510/LR8511: Battery pack  
LR8512 to LR8515: LR6 alkaline batteries




## Easy wireless setup


The LR8410 features Hioki's Quick Set function. Since measurement units can be registered simply by following the Unit Registration Guide, even first-time users can start measurement right away. It's also easy to configure settings when adding measurement units later.



QUICK SET easy setup screen (shown when the Wireless Logging Station is turned on)

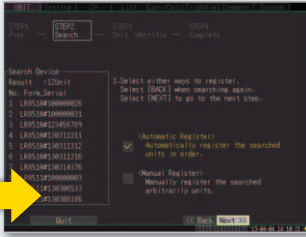

Logging modules within wireless range are automatically detected.

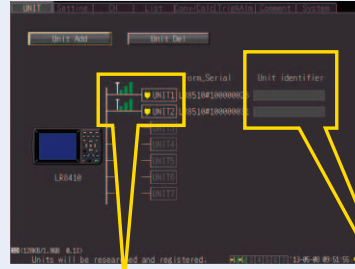

You can verify if the communications state between the LR8410 and detected units is good.

You can also assign a name to each unit for ID purposes. This feature helps you recognize where units are located when registering multiple units.

## 3. Make measurements of interior conditions from the outside, with the door closed.

### Have you dealt with problems like these?

We can't close the windows or doors due to all the wires. As a result, there's a gap in the gasket, and the vehicle cannot be sealed.



Long wires are used to connect the instrument to the measurement locations.

### Resolved with wireless data transmission

Wires do not protrude outside the vehicle, allowing the windows and doors to be closed so that the vehicle can be tested under airtight conditions.




Data is sent wirelessly from measurement units and wireless loggers to the LR8410.

## 4. Synchronize measurement data

### Have you dealt with problems like these?

Installing individual loggers on test equipment means each set of measured data is on its own time line, making it hard to compare the data with respect to a single time axis.

Conventional data loggers are sometimes too bulky and difficult to fit into test equipment.

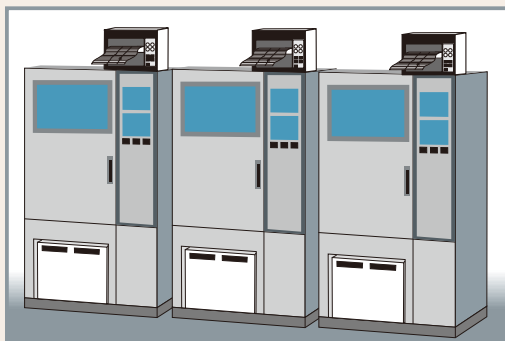

Traditionally, data loggers are installed on each device

### Resolved with wireless data transmission

You can observe measurement results from multiple pieces of experimental equipment as part of the same time series. Logging modules are small enough to fit almost anywhere.

Install the compact logging modules on each test equipment

A single Wireless Logging Station can capture measurement data from multiple locations.

Confined spaces are no longer a problem

Batch collection and management with the logging station

Data can be viewed and analyzed as part of a single time-series

Check the logged data on the central display while measuring

# Applications in diverse fields

## Introducing three-way power, including extended measurement on battery power!

### AC adapter, battery, or DC power supply

Measurement units or wireless loggers can operate on a rechargeable battery pack or alkaline batteries, respectively, close to the measurement target, enabling their use even in locations where AC power is not available.



Continuous operating time (LR6 Alkaline battery)

| Recording intervals | LR8512          | LR8513          | LR8514          | LR8515          |
|---------------------|-----------------|-----------------|-----------------|-----------------|
| 0.1 sec *1          | Approx. 5 day   | Approx. 5 day   | Approx. 5 day   | Approx. 2 day   |
| 1 sec               | Approx. 7 days  | Approx. 7 days  | Approx. 7 days  | Approx. 4 days  |
| 1 min               | Approx. 10 days | Approx. 10 days | Approx. 10 days | Approx. 10 days |

\*1 LR8513, LR8514: 0.5 sec

Continuous operating time (BATTERY PACK Z1007)

| Recording intervals | LR8510/LR8511     |
|---------------------|-------------------|
| 100 ms              | Approx. 24 hours  |
| 1 min               | Approx. 120 hours |

\*Use of the AC adapter is recommended when recording data over an extended period of time.  
(The Wireless Logging Station LR8410 operates using an AC adapter.)

## Measurement units and wireless loggers have an operating temperature range of -20°C to 60°C.

Measurement units and wireless loggers can be used with confidence and peace of mind in hot environments such as the interior of a car during the summer as well as in cold-weather testing in the subzero temperatures of winter.



\*The temperature range for recharging the Z1007 Battery Pack is 5°C to 35°C.  
For the operating temperature of the battery pack, batteries or current sensors, please refer to the specifications of each respective device.

## Ensuring a safe measuring environment by closing doors

Distribution panels and control panels can be measured and data recorded safely by placing a measurement unit inside the enclosure, closing the door, and placing the LR8410 outside the enclosure.



Measurement unit:  
Inside the distribution panel



LR8410:  
Outside the distribution panel

Ensure peace of mind even in the event of a power outage or signal disruption.

## Data is protected by a battery and backup function!

### If the power goes out during measurement

#### If the Wireless Logging Station loses power


If the start backup setting is enabled, the instrument will resume measurement automatically when power is restored. If data is saved in real time to the SD memory card, the instrument's built-in high-capacity capacitor will maintain power until all data has been downloaded, making it extremely unlikely that data will be lost or the file system corrupted. Additionally, if a battery is installed while operating with the AC adapter, the logging station will automatically switch to battery power in the event of an outage.

#### If the measurement unit or wireless logger loses power

When power is restored, measurement will pick up where it left off. (Data for the outage period is assumed to have been lost.) The device will automatically switch power supplies if you install a battery pack (LR8510/LR8511) or LR6 alkaline batteries (LR8512 to LR8515) while using an AC adapter.

### If communication is temporarily interrupted

Measurement units and wireless loggers have built-in buffer memory so that measurement data can be saved if communication is temporarily disrupted. This data is resent once communication is restored, allowing the measurement data to be stored in the Wireless Logging Station. For example, if 15 channels of data are measured at a recording interval of 1 second, data integrity can be preserved throughout a communication outage of up to about 72 minutes. Additionally, alarms can be output and emails sent to notify the operator in the event that communication is interrupted or the logging module's remaining battery life is low.

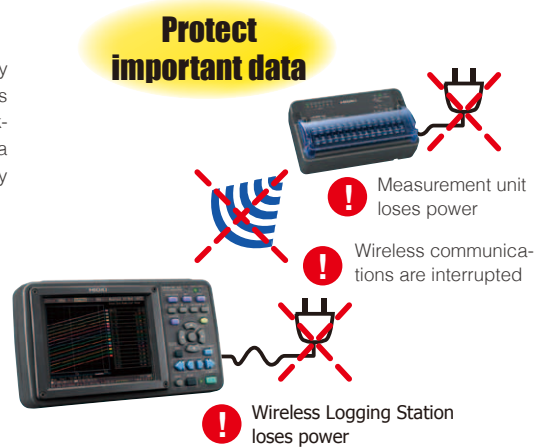

\*Number of data points that can be stored in the internal memory: When recording  $n$  channels,  $(65,536/n)$  data points

\*Data collected using the logger utility is not restored during measurement. Load restored data that has been saved to an SD memory card or other media with the instrument.



## Remote control from a computer via the HTTP/FTP server function



Download and automatically send data files and control instrument operation remotely without the need to install special application software on the computer.

|   |   |
|---|---|
| Data acquisition via FTP                    | Download data files from the instrument's internal buffer memory, SD memory card, and USB memory stick to a computer.<br><i>Note: Waveform data cannot be downloaded from internal memory while measuring.</i>  |
| Data transfer via FTP                       | Data files stored on the Wireless Logging Station's SD memory card or USB memory stick are automatically sent to an FTP server regularly while measurement is in progress or after measurement is complete.   |
| Get notifications via E-mail                | The Wireless Logging Station can send an e-mail message to a network-connected computer or mobile phone when a communications error occurs, when the any of the device's remaining battery life runs low, when the media or the internal memory is full, when a stop trigger occurs, and when an alarm occurs. E-mail messages can also be sent on a regular basis. |
| Remote control through HTTP server function | Using a Web browser, you can monitor screens and operate the instrument remotely, including to configure settings and download data. You can also perform configuration and measurement tasks using communications commands.<br><i>Note: Waveform data cannot be downloaded from internal memory while measuring.</i>   |



## Recording data in real time on a computer Data collection software "Logger Utility"

By connecting a computer to the LR8410 using the instrument's USB or LAN interface, you can observe data in real time as it is recorded and scroll backwards through past waveform data.

## Recording data in real time on an SD memory card

Waveform data collected wirelessly from measurement units and wireless loggers is recorded by the LR8410 on an SD memory card or USB flash drive at an interval of about 1 minute. (If the recording interval is longer than 1 minute, data is saved at the recording interval.)

### Replace storage media during real-time recording

Storage media can be switched without stopping measurement. When the new media is inserted, any data remaining in the instrument's internal buffer memory is saved as a separate file.

*Note: Although USB memory devices enable real-time saving of data, for more reliable data protection we recommend use of Hioki SD Memory Cards, which are guaranteed to work with the instrument, for real-time saving of data.*

Maximum recording time Recording 2 units (30 analog) (no alarm output or waveform processing)

| Recording intervals           | 100 ms      | 200 ms      | 500 ms     | 1 s       | 2 s        | 5 s        | 10 s       |
|-------------------------------|-------------|-------------|------------|-----------|------------|------------|------------|
| LR8410 Internal memory(16 MB) | 7h 46m      | 15h 32m     | 1d 14h 50m | 3d 5h 40m | 6d 11h 20m | 16d 4h 21m | 32d 8h 43m |
| SD Memory Card Z4001(2 GB)    | 41d 10h 12m | 82d 20h 24m | 207d 3h 1m | "★"       | "★"        | "★"        | "★"        |

\*Use only Hioki SD Memory Cards that are guaranteed to operate with the Wireless Logging Station for continuous long-term recording.

\*Maximum recording time is inversely proportional to number of recording channels.

\*Because the header portion of waveform files is not included in capacity calculations, expect actual maximum times to be about 90% of those in the table.

\*★ exceeds 1 year.

### New function

# LR8410 Link

Use the Wireless Logging Station LR8410 to collect data from LR8410 Link-compatible products in real time.

## Easy scaling

The setup process is simple: just search for and pair LR8410 Link-compatible products. Since the settings on paired devices are automatically received by the LR8410, there's no need to manually configure troublesome scaling settings. And since this process occurs wirelessly, you spend less time on wiring work.

## No degradation in accuracy caused by D/A output

Since measured values are sent as data, there is no degradation in accuracy.



## Simultaneous measurement of power, temperature, and other data

The LR8410 can be used with a broad range of modules and LR8410 Link-compatible products. Since you can pair it with up to seven devices, you can measure a large number of channels and parameters along with power meter data.



### LR8410 Link-compatible products

A Bluetooth serial adapter (purchased separately; recommended model: Parani-SD1000) is required.

|  |  |  |   |
|--|--|--|---|
|  <p><b>POWER ANALYZER PW6001</b><br/><small>Ver. 2.0 and later</small></p> <p style="font-size: x-small;">A dedicated connection cable (purchased separately) is required.</p> |  <p><b>POWER ANALYZER PW3390</b><br/><small>Ver. 1.1 and later</small></p> <p style="font-size: x-small;">An AC/DC power supply adapter (purchased separately; recommended model: OPA-G01) is required.</p> |  <p><b>POWER METER PW3335</b><br/><small>Ver. 1.1 and later</small></p> <p style="font-size: x-small;">The PW335-01 is not supported.</p> |  <p><b>POWER QUALITY ANALYZER PQ3100</b><br/><small>Ver. 2.0 and later</small></p> |
|--|--|--|---|

\*Contact HIOKI for more information.

# WIRELESS LOGGING STATION LR8410 (Accuracy guaranteed for 1 year, Post-adjustment accuracy guaranteed for 1 year)

| General specifications                                    |   |
|---|---|
| Controllable devices                                      | LR8510, LR8511, LR8512, LR8513, LR8514, LR8515  |
| No. of controllable devices                               | Max. 7 units (up to 105 channels when used with the LR8510 or LR8511)   |
| Control and communications (Between instrument and units) | Bluetooth® 2.1 + EDR (between Wireless Logging Station and logging modules); communication range: 30 m (line of sight), SSP security  |
| Internal buffer memory                                    | 8 MWords volatile RAM (SDRAM)   |
| Clock functions   | Auto calendar, clock accuracy: $\pm 3$ s/day (@23°C, 73.4°F)  |
| Timebase accuracy   | $\pm 0.2$ s/day while measuring (@23°C, 73.4°F)   |
| Backup battery life                                       | At least five years for clock and settings (@23°C, 73.4°F)  |
| Operating temp. & humidity                                | -10 to 50°C (14 to 122°F), 30 to 80% rh or less (non-condensating)  |
| Storage temp. & humidity                                  | -20 to 60°C (-4 to 140°F), 80% rh or less (noncondensating)   |
| Applicable standards                                      | Safety: EN61010<br>EMC: EN61326 classA, EN61000-3-2, EN61000-3-3<br>Wireless certification:<br>Japan (type : Incorporates a wireless module that has been certified certification) as compliant with applicable technical standards.<br>US(FCC) : Part 15.247 (Contains FCC ID: QOQWT111A)<br>Canada(IC) : RSS-210 (Contains IC: 5123A-BGTWT111A)<br>EU : EN 300 328, EN 301 489-1, EN 301 489-17   |
| Vibration endurance                                       | JIS D 1601:1995 5.3(1), Category 1: Vehicle, Condition: Category A equiv.   |
| External control terminal                                 | External trigger input, trigger output, four alarm channel outputs, ground  |
| Dimensions and Mass                                       | 230mm (9.06in)W × 125mm (4.92in)H × 36mm (1.42in)D, 700 g (24.7oz.) (excluding Battery Pack)  |
| Accessories   | Instruction manual ×1, Measurement guide ×1, SD Memory Card (2GB) Z4001 ×1, CD-R (data collection software "Logger Utility") ×1, USB cable ×1, AC Adapter Z1008 ×1  |
| Data storage media  |   |
| SD memory card  | SD standard-compliant ×1, Hioki Z4001 (2 GB), Data format: FAT16, FAT32   |
| USB memory  | Series A receptacle   |
| Communication functions                                   |   |
| LAN Interface   | IEEE802.3 Ethernet 100BASE-TX DHCP, DNS<br>•Data acquisition and measurement criteria setting with the Logger Utility<br>•Setting and measurement by communications commands<br>•Manual file transfer by FTP server (from the instrument memory or removable storage).<br>•Auto sending files by FTP client<br>•Remote control by HTTP server<br>•E-Mailing   |
| USB Interface   | USB2.0 compliant High Speed, Series-mini B receptacle<br>• Data acquisition, condition settings used with the Logger Utility software (supplied as standard)<br>• Configure the unit and measure using communication commands<br>• Transfer data from the SD memory card to a PC via USB drive mode (data transfer not possible from USB memory sticks)   |
| Display section   |   |
| Display   | 5.7 inch TFT color liquid crystal display (640 × 480 pixel), horizontal 16 division, vertical 10 division, selectable between English and Japanese displays, back light saver available   |
| LCD Brightness  | Selectable from 100, 70, 40, or 25 %  |
| Power supplies  |   |
| AC adapter  | Using the AC Adapter Z1008 (supplied as standard, 100 to 240 VAC, 50/60 Hz), Power consumption: 8 VA (with battery pack removed and maximum brightness)   |
| Battery   | Using the Battery Pack Z1007 (Li-ion 7.2V 2170mAh) (optional accessory, AC adapter has priority when used in combination with battery pack), continuous operation time: 3 hours (at 23 °C, LCD brightness 25 %) Fast recharging time: 7 hours (the AC Adapter or a 10 to 28 V DC external power supply can be connected while the Battery Pack Z1007 is installed.)   |
| External power  | 10 to 28 VDC (Please contact your HIOKI distributor for connection cord) 15 VA (when battery is charged, and w/LCD max. blightness)   |
| Trigger functions   |   |
| Trigger mode, timing                                      | Modes : Single / Repeat, Timing : Start / Stop / Start & Stop, Logical sum (OR) and product (AND) of each trigger source, selectable for each channel   |
| Analog signal source                                      | Up to 105 channels, depending on how many Wireless Voltage/Temp Units LR8510 and Wireless Universal Units LR8511 are connected (U1-1 to U7-15).<br>[Level trigger] Triggers when rising or falling through preset level<br>[Window] Triggers when entering or exiting range defined by preset upper and lower limit values<br>[Pattern trigger] Applies the trigger when a pattern defined in terms of 1, 0, ×, and values is matched (Setting only available when using logic measurement with the LR8512) |
| Interval trigger  | Set year, month, date, hour, minute and second (triggers when specified measurement interval is passed)   |
| Trigger output  | Open-drain output, Trigger output terminal: Push-button type terminal block (5 V voltage output, active low, pulse width: at least 100 ms) Output response time: Recording interval + 3 sec. or less (with 1 measurement unit, good communications) Recording interval + 5 sec. or less (with 7 measurement units, good communications)   |

| Alarm output                          |   |
|---------------------------------------|---|
| Number of channels                    | 4 channels, non-isolated (common ground with chassis)   |
| Alarm source                          | Analog input: Up to 105 channels, depending on how many Wireless Voltage/Temp Units LR8510 and Wireless Universal Units LR8511 are connected (U1-1 to U7-15).<br>When thermocouple burn-out detection is enabled, when the Wireless Voltage/Temp Unit LR8510 or Wireless Universal Unit LR8511 battery is low, or when a communications error occurs  |
| Alarm type                            | Level, window, output latch/ no latch, cancel alarm while measuring   |
| Alarm sound                           | Buzzer, ON/OFF possible   |
| Alarm output                          | Open drain output (with 5 V pull-up, active low), output response time: Recording interval + 3 sec. or less (with 1 measurement unit, good communications) Recording interval + 5 sec. or less (with 7 measurement units, good communications)  |
| Output sink current                   | 200 mA at 5 V to 30 VDC   |
| Measurement settings                  |   |
| Recording intervals (sampling period) | *1, *2 100 ms, *2 200 ms, 500 ms, 1 s, 2 s, 5 s, 10 s, 20 s, 30 s, 1 min, 2 min, 5 min, 10 min, 20 min, 30 min, 1 h (16 selections)<br>All input channels are scanned at high speed during every recording interval<br>*1 Setting not available when the thermocouple burnout detection setting is on.<br>*2 The data update rate of the LR8513 and LR8514 is 500ms.  |
| Recording length (time span)          | Enable continuous recording ON (records until the Stop key is pressed), or continuous recording OFF (enable a specified time span)  |
| Repeat measurement recording          | Set Off or On.<br>When On, measurement repeats at the set recording interval.   |
| Display                               |   |
| Time axis                             | 200 ms to 1 day/divisions   |
| Voltage axis                          | Select by position (magnification can be $\times 100$ to $\times 1/2$ , 0 Position : Set between -50 to 150%) or upper/ lower limits  |
| Waveform scrolling                    | Time-axis scrolling is available by left/right arrow keys while measuring and when measurement stops (waveform drawing period).   |
| Jump function                         | Selects the displayed span of the waveform.   |
| Monitor function                      | Confirm instantaneous values and waveforms without recording data.  |
| Unit battery life remaining display   | Displays the remaining battery life for wirelessly connected units as 1 of 3 levels.  |
| Signal strength display               | Displays the signal strength for wirelessly connected units as 1 of 3 levels.   |
| Data saving                           |   |
| Save destination                      | Select a SD memory card or USB memory (use only SD memory cards sold by Hioki).   |
| Storage operation                     | Auto: Save waveform data or time divided calculation results in real time<br>Manual: Push the save key (operation select: item choose/ directly save)   |
| Real-time saving                      | Possible: Waveforms are saved approximately every one minute as binary or text data to the SD memory card or the USB memory (if sampling rate is slower than 1 minute, waveforms are saved at each interval)<br>To the PC: Waveforms are saved to the HDD in the PC via LAN or USB communication when used with the Logger Utility Software. Data can be saved in real time to the SD memory card or USB memory at the same time. |
| Split save                            | Simple divide: Save waveform data at pre-set times into separate files from the time measurement starts.<br>On schedule: Designate a reference time within 24 hours and save data into separate files at every set time interval starting from the reference time.  |
| Overwriting save                      | Endless loop saving: New file overwrites the oldest file when the SD memory card or USB memory capacity runs short  |
| Remove external media                 | Storage media may be removed during real-time save after message confirmation. Upon inserting the storage media again, data saved in internal memory during that time will be saved as a separate file in the media.  |
| Data protection                       | If a power outage occurs or the battery runs out during real-time saving, power is cut off after the file is closed (protection becomes possible approximately 10 min. or more after the instrument is turned on).  |
| Save types                            | Setting condition, waveform data (binary or text style), calculation of numerical value, screen data (compressed BMP), reservation settings   |
| Reloading data                        | Stored binary data can be recalled by the logging station in 8 MB quantities  |
| Calculation functions                 |   |
| Numerical value calculations          | Six calculations are available at the same time<br>Average value, peak value, maximum value, time to maximum value, minimum value, time to minimum value  |
| Data range of calculation             | During measurement or after stopping: Applies calculations to all data in internal buffer memory, or to the time-span specified by A/B cursors.<br>Interval calculation: Calculate values at pre-determined 1 sec to 1 day intervals and display the latest value   |
| Calculation value save                | Possible: After measuring the last calculated value is automatically saved to the SD memory card or USB memory as a text file<br>Timed save: Save calculated data at pre-determined 1 sec to 1 day intervals as text data to the SD memory card or USB memory in real time.   |
| Waveform calculations                 | Calculate sum, difference, product, and quotient between channels, with calculated results displayed as channels W1 to W30 (valid only while measuring, saved in real time with a channel's waveform data.).  |
| Other functions                       |   |
| Event marking                         | Search: Move to the event number entered and display the waveforms appearing before and after event<br>Number of events: Maximum 1000 per measurement   |
| A-B cursor                            | Measurement: Time difference between A/B cursors, measured value difference, cursor measured value, time<br>Types: Select trace, vertical, or horizontal  |
| Scaling                               | Convert and display the measurement value of each channel as a scaled value   |
| Rate adjustment function              | Scaling can be set for a channel so that its value is the same as that for UNIT1-CH1  |
| Comment entry                         | Enter a title or a comment for each channel   |
| Others                                | Start backup, save 5 types setting conditions into main unit, auto set up, start/stop key lock, key-lock, beep sound, schedule, Quick Set function  |



# WIRELESS VOLTAGE/TEMP UNIT LR8510 / WIRELESS UNIVERSAL UNIT LR8511

## Basic specifications

|                                    |   |
|------------------------------------|---|
| No. of input channels              | 15 channels (select voltage or thermocouple for each channel)<br>(Pt100/JPt100, resistance, and humidity are also selectable for each channel with the model LR8511)  |
| Input terminals                    | [LR8510] M3 screw type terminal block (2 terminals per channel)<br>[LR8511] Push-button terminals (4 terminals per channel)   |
| Measurement objects                | [LR8510] Voltage/ Thermocouple<br>[LR8511] Voltage/ Thermocouple/ RTDs/ Resistance/ Humidity  |
| Supported device                   | Wireless Logging Station LR8410-20  |
| Control and communications         | Bluetooth® 2.1+EDR<br>(Communications range: 30 m, line of sight, security: SSP)  |
| Backup memory                      | When recording n channels: (65,536/n) data points<br>Data is maintained in the event of a communications error and resent when communications are restored.   |
| Operating temperature and humidity | Temperature: -20°C to 60°C (-4 to 140°F)<br>Humidity: -20°C to 40°C (-4 to 140°F) 80%RH or less (noncondensating)<br>40°C to 45°C (140 to 113°F) 60%RH or less (noncondensating)<br>45°C to 50°C (113 to 122°F) 50%RH or less (noncondensating)<br>50°C to 60°C (122 to 140°F) 30%RH or less (noncondensating)<br>(temperature variation range is 5 to 35°C (41 to 95°F)) |
| Storage temperature and humidity   | Temperature: -20°C to 60°C (-4 to 140°F)<br>Humidity: -20°C to 40°C (-4 to 140°F) 80%RH or less (noncondensating)<br>40°C to 45°C (140 to 113°F) 60%RH or less (noncondensating)<br>45°C to 50°C (113 to 122°F) 50%RH or less (noncondensating)<br>50°C to 60°C (122 to 140°F) 30%RH or less (noncondensating)  |
| Input resistance                   | 1 MΩ±5% (voltage and thermocouple measurement)<br>2 MΩ±5% (RTD and resistance measurement)  |
| Maximum input voltage              | ±100 VDC  |
| Max. inter-channel voltage         | 300 VDC (Channels are not isolated during resistance bulb, resistance, or humidity measurement.)  |
| Maximum rated voltage to earth     | 300 VAC, DC   |
| Digital filter                     | Select OFF/ 50 Hz/ 60 Hz (In order to remove harmonic components, during analog input the cut-off frequency is automatically set according to the sampling rate)  |
| Applicable standards               | Safety: EN61010   |
|                                    | EMC: EN61326 Class A, EN61000-3-2, EN61000-3-3  |
|                                    | Wireless certification<br>Japan (type : Incorporates a wireless module that has been certified certification) as compliant with applicable technical standards.<br>US(FCC) : Part 15.247 (Contains FCC ID: QOQWT111A)<br>Canada(IC) : RSS-210 (Contains IC: 5123A-BGTWT111A)<br>EU : EN 300 328<br>EN 301 489-1<br>EN 301 489-17  |
|                                    |   |
| Vibration endurance                | JIS D 1601:1995 5.3(I), Category I: Vehicle, Condition: Category A equiv.   |
| Dimensions and mass                | Approx.150W×90H×56D mm (5.91"W × 3.54"H × 2.2"D)<br>(including cover), [LR8510] approx. 340 g (12.0 oz.),<br>[LR8511] approx. 320 g (11.3 oz.)  |
| Accessories                        | Instruction Manual× 1, AC Adapter Z1008 × 1, Bracket × 1  |

## LR8511 input specifications

Temperature Resistance Temperature Detector (RTD): Pt 100/JPt 100; connection: 3-wire/4-wire; measurement current: 1 mA  
Ratings: JIS C1604-1997 and IEC 751 (Pt 100), JIS C1604-1989 (JPt 100)

| Type    | Range        | Max. Resolution | Measurable Range | Measurement Accuracy |
|---------|--------------|-----------------|------------------|----------------------|
| Pt 100  | 100 °C f.s.  | 0.01 °C         | -100 to 100 °C   | ±0.6 °C              |
|         | 500 °C f.s.  | 0.05 °C         | -200 to 500 °C   | ±0.8 °C              |
|         | 2000 °C f.s. | 0.1 °C          | -200 to 800 °C   | ±1.0 °C              |
| JPt 100 | 100 °C f.s.  | 0.01 °C         | -100 to 100 °C   | ±0.6 °C              |
|         | 500 °C f.s.  | 0.05 °C         | -200 to 500 °C   | ±0.8 °C              |
|         | 2000 °C f.s. | 0.1 °C          | -200 to 500 °C   | ±1.0 °C              |

Resistance Connection: 4-wire; measurement current: 1 mA

| Range      | Max. Resolution | Measurable Range | Measurement Accuracy |
|------------|-----------------|------------------|----------------------|
| 10 Ω f.s.  | 0.5 mΩ          | 0 to 10 Ω        | ±10 mΩ               |
| 20 Ω f.s.  | 1 mΩ            | 0 to 20 Ω        | ±20 mΩ               |
| 100 Ω f.s. | 5 mΩ            | 0 to 100 Ω       | ±100 mΩ              |
| 200 Ω f.s. | 10 mΩ           | 0 to 200 Ω       | ±200 mΩ              |

Humidity

| Range        | Max. Resolution | Measurable Range | Measurement Accuracy          |
|--------------|-----------------|------------------|-------------------------------|
| 100 %rh f.s. | 0.1 %rh         | 5.0 to 95.0 %rh  | (See Humidity Accuracy Table) |

## Analog input section

(@ 23±5°C /73±9°F, 80% rh or less, Defined after zero-adjustment has been performed. The 50/60 Hz cut-off setting is selected)

### Voltage


| Range        | Max. Resolution | Measurable Range  | Measurement Accuracy |
|--------------|-----------------|-------------------|----------------------|
| 10 mV f.s.   | 500 nV          | -10 mV to 10 mV   | ±10 μV               |
| 20 mV f.s.   | 1 μV            | -20 mV to 20 mV   | ±20 μV               |
| 100 mV f.s.  | 5 μV            | -100 mV to 100 mV | ±100 μV              |
| 200 mV f.s.  | 10 μV           | -200 mV to 200 mV | ±200 μV              |
| 1 V f.s.     | 50 μV           | -1 V to 1 V       | ±1 mV                |
| 2 V f.s.     | 100 μV          | -2 V to 2 V       | ±2 mV                |
| 10 V f.s.    | 500 μV          | -10 V to 10 V     | ±10 mV               |
| 20 V f.s.    | 1 mV            | -20 V to 20 V     | ±20 mV               |
| 100 V f.s.   | 5 mV            | -100 V to 100 V   | ±100 mV              |
| 1 - 5 V f.s. | 500 μV          | 1 V to 5 V        | ±10 mV               |

### Temperature(Thermocouples)

| Type | Range        | Max. Resolution | Measurable Range   | Measurement Accuracy          |
|------|--------------|-----------------|--|-------------------------------|
| K    | 100 °C f.s.  | 0.01 °C         | -100 to 0 °C or less<br>0 to 100 °C                                | ±0.8 °C<br>±0.6 °C            |
|      | 500 °C f.s.  | 0.05 °C         | -200 to -100 °C or less<br>-100 to 0 °C or less<br>0 to 500 °C     | ±1.5 °C<br>±0.8 °C<br>±0.6 °C |
|      | 2000 °C f.s. | 0.1 °C          | -200 to -100 °C or less<br>-100 to 1350 °C                         | ±1.5 °C<br>±0.8 °C            |
| J    | 100 °C f.s.  | 0.01 °C         | -100 to 0 °C or less<br>0 to 100 °C                                | ±0.8 °C<br>±0.6 °C            |
|      | 500 °C f.s.  | 0.05 °C         | -200 to -100 °C or less<br>-100 to 0 °C or less<br>0 to 500 °C     | ±1.0 °C<br>±0.8 °C<br>±0.6 °C |
|      | 2000 °C f.s. | 0.1 °C          | -200 to -100 °C or less<br>-100 to 0 °C or less<br>0 to 1200 °C    | ±1.0 °C<br>±0.8 °C<br>±0.6 °C |
| E    | 100 °C f.s.  | 0.01 °C         | -100 to 0 °C or less<br>0 to 100 °C                                | ±0.8 °C<br>±0.6 °C            |
|      | 500 °C f.s.  | 0.05 °C         | -200 to -100 °C or less<br>-100 to 0 °C or less<br>0 to 500 °C     | ±1.0 °C<br>±0.8 °C<br>±0.6 °C |
|      | 2000 °C f.s. | 0.1 °C          | -200 to -100 °C or less<br>-100 to 0 °C or less<br>0 to 1000 °C    | ±1.0 °C<br>±0.8 °C<br>±0.6 °C |
| T    | 100 °C f.s.  | 0.01 °C         | -100 to 0 °C or less<br>0 to 100 °C                                | ±0.8 °C<br>±0.6 °C            |
|      | 500 °C f.s.  | 0.05 °C         | -200 to -100 °C or less<br>-100 to 0 °C or less<br>0 to 400 °C     | ±1.5 °C<br>±0.8 °C<br>±0.6 °C |
|      | 2000 °C f.s. | 0.1 °C          | -200 to -100 °C or less<br>-100 to 0 °C or less<br>0 to 400 °C     | ±1.5 °C<br>±0.8 °C<br>±0.6 °C |
| N    | 100 °C f.s.  | 0.01 °C         | -100 to 0 °C or less<br>0 to 100 °C                                | ±1.2 °C<br>±1.0 °C            |
|      | 500 °C f.s.  | 0.05 °C         | -200 to -100 °C or less<br>-100 to 0 °C or less<br>0 to 500 °C     | ±2.2 °C<br>±1.2 °C<br>±1.0 °C |
|      | 2000 °C f.s. | 0.1 °C          | -200 to -100 °C or less<br>-100 to 0 °C or less<br>0 to 1300 °C    | ±2.2 °C<br>±1.2 °C<br>±1.0 °C |
| R    | 100 °C f.s.  | 0.01 °C         | 0 to 100 °C  | ±4.5 °C                       |
|      | 500 °C f.s.  | 0.05 °C         | 100 to 300 °C or less<br>300 to 500 °C<br>300 to 1700 °C           | ±4.5 °C<br>±3.0 °C<br>±2.2 °C |
|      | 2000 °C f.s. | 0.1 °C          | 0 to 100 °C or less<br>100 to 300 °C or less<br>300 to 1700 °C     | ±4.5 °C<br>±3.0 °C<br>±2.2 °C |
| S    | 100 °C f.s.  | 0.01 °C         | 0 to 100 °C  | ±4.5 °C                       |
|      | 500 °C f.s.  | 0.05 °C         | 0 to 100 °C or less<br>100 to 300 °C or less<br>300 to 500 °C      | ±4.5 °C<br>±3.0 °C<br>±2.2 °C |
|      | 2000 °C f.s. | 0.1 °C          | 0 to 100 °C or less<br>100 to 300 °C or less<br>300 to 1700 °C     | ±4.5 °C<br>±3.0 °C<br>±2.2 °C |
| B    | 2000 °C f.s. | 0.1 °C          | 400 to 600 °C or less<br>600 to 1000 °C or less<br>1000 to 1800 °C | ±5.5 °C<br>±3.8 °C<br>±2.5 °C |
|      | 100 °C f.s.  | 0.01 °C         | 0 to 100 °C  | ±1.8 °C                       |
|      | 500 °C f.s.  | 0.05 °C         | 0 to 500 °C  | ±1.8 °C                       |
| W    | 2000 °C f.s. | 0.1 °C          | 0 to 2000 °C   | ±1.8 °C                       |

Reference junction compensation: Internal/ External, at INT RJC, total accuracy = add ± 0.5 °C  
Thermocouple burn-out detection: Enable/disable thermocouple burn-out detection at each recording interval.(The burnout detection setting cannot be used with a recording interval of 100 ms.)

### ■ Humidity Sensor Z2000 accuracy

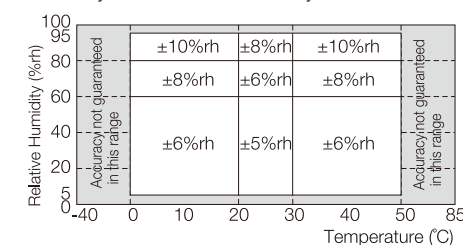

### ■ Option

HUMIDITY SENSOR Z2000



## Wireless Loggers LR8512, LR8513, LR8514, LR8515

### Shared specifications

|                                    |   |
|------------------------------------|---|
| Control and communications         | Bluetooth® 2.1+EDR<br>(Communications range: 30 m, line of sight, security: SSP)  |
| Internal memory                    | Nonvolatile memory (Flash memory)   |
| Storage capacity                   | 500,000 data items for each channel   |
| Standard compliance                | Same as Wireless Logging Station LR8410   |
| Functions                          | Alarm, Scaling, Recording operation hold function, Erroneous operation prevention, Comment recording function, Energy saving function, Authentication function, Free Run (excluding LR8512)                 |
| Vibration endurance                | JIS D 1601:1995 5.3(1), Category 1: Vehicle, Condition: Category A equiv.   |
| Operating temperature and humidity | Temperature: -20 to 60 °C (-4 to 140 °F),<br>Humidity: 80% rh or less (non-condensing)<br>(Depends on battery and current sensor specifications when they are in use)                                       |
| Power supplies                     | AC Adapter Z2003 (sold as a separate option),<br>LR6 alkaline batteries × 2, 5 to 13.5 VDC external power source  |
| Accessories                        | CD-R (Instruction Manual, Logger Utility) × 1, Measurement Guide × 1, Caution for Using Radio Waves × 1, AA alkaline batteries (LR6) × 2<br>Note: Only included with the LR8512: Connection Cable L1010 × 2 |

## WIRELESS PULSE LOGGER LR8512

### Basic specifications (Accuracy guaranteed for 1 year, Post-adjustment accuracy guaranteed for 1 year)

|                                 |  |
|---------------------------------|--|
| No. of input channels           | 2 channels (common GND)  |
| Measurement modes               | Integrating (cumulative/Instant), Revolution, Logic (Records an I/O for each recording interval)   |
| Measurement ranges (Resolution) | Totalization: 1000M pulse f.s. (1 pulse)<br>No. of revolutions: 5000/n[r/s]f.s. (1/n[r/s])<br>*n is the number of pulses, 1 to 1000, per revolution. |
| Supported input format          | Non-voltage "a" contact (always-open contact point), open collector, or voltage input (DC 0 V to 50 V)   |
| Recording intervals             | 0.1 to 30 sec, 1 to 60 min, 16 selections  |
| Recording modes                 | Instantaneous value  |
| Dimensions                      | 85W×61H×31D mm (3.35W×2.40H×1.22D in)  |
| Mass                            | 95 g (Not including the battery)   |

## WIRELESS CLAMP LOGGER LR8513

### Basic specifications (Accuracy guaranteed for 1 year, Post-adjustment accuracy guaranteed for 1 year)

|                             |  |
|-----------------------------|--|
| No. of input channels       | 2 channels (common GND)  |
| Measurement items           | AC load current, DC load current<br>AC leak current (using current sensor)   |
| Effective value calculation | Software calculates the true RMS value   |
| Measurement ranges          | AC500.0 mA to 2000 A (By current sensor)<br>DC10.00 A to 2000 A (By current sensor)<br>*Current and leak current that occur intermittently cannot be measured. |
| Measurement accuracy        | ±0.5% rdg. ±5 dgt. (DC, AC 50/60 Hz)<br>*Add the sensor's accuracy when the current sensor is connected (Page 12)  |
| Recording intervals         | 0.5 to 30 sec, 1 to 60 min, 14 selections  |
| Recording modes             | Instantaneous value, average value, Maximum value recording  |
| Dimensions                  | 85W×75H×38D mm (3.35W×2.95H×1.50D in)  |
| Mass                        | 130 g (Not including the battery)  |

| Sensor used                  | Range    | Max. Resolution | Measurable Range                                |
|------------------------------|----------|-----------------|---|
| 9675                         | 500.0 mA | 0.1 mA          | AC 1.0 mA to 500.0 mA                           |
|                              | 5.000 A  | 0.001 A         | AC 0.010 A to 5.000 A                           |
| 9657-10                      | 500.0 mA | 0.1 mA          | AC 1.0 mA to 500.0 mA                           |
|                              | 5.000 A  | 0.001 A         | AC 0.010 A to 5.000 A                           |
| 9695-02                      | 5.000 A  | 0.001 A         | AC 0.010 A to 5.000 A                           |
|                              | 50.00 A  | 0.01 A          | AC 0.10 A to 50.00 A                            |
| CT6500                       | 50.00 A  | 0.01 A          | AC 0.10 A to 50.00 A                            |
|                              | 500.0 A  | 0.1 A           | AC 1.0 A to 500.0 A                             |
| 9669                         | 1000 A   | 1 A             | AC 10 A to 1000 A                               |
| CT7631/<br>CT7731            | 10.00 A  | 0.01 A          | AC 0.10 A to 10.00 A<br>DC± (0.10 A to 10.00 A) |
|                              | 100.0 A  | 0.1 A           | AC 1.0 A to 100.0 A<br>DC± (1.0 A to 100.0 A)   |
| CT7636/<br>CT7736            | 20.00 A  | 0.01 A          | AC 0.10 A to 20.00 A<br>DC± (0.10 A to 20.00 A) |
|                              | 200.0 A  | 0.1 A           | AC 1.0 A to 200.0 A<br>DC± (1.0 A to 200.0 A)   |
| CT7642/<br>CT7742            | 200.0 A  | 0.1 A           | AC 1.0 A to 200.0 A<br>DC± (1.0 A to 200.0 A)   |
|                              | 2000 A   | 1 A             | AC 10 A to 2000 A<br>DC± (10 A to 2000 A)       |
| CT9667-01/-02/-03            | 500.0 A  | 0.1 A           | AC 1.0 A to 500.0 A                             |
|                              | 5000 A   | 1 A             | AC 10 A to 5000 A                               |
| CT7044/<br>CT7045/<br>CT7046 | 50.00 A  | 0.01 A          | AC 0.10 A to 50.00 A                            |
|                              | 500.0 A  | 0.1 A           | AC 1.0 A to 500.0 A                             |
|                              | 5000 A   | 1 A             | AC 10 A to 5000 A                               |

## WIRELESS HUMIDITY LOGGER LR8514


### Basic specifications

\*Only the temperature and humidity sensors affect the measurement accuracy and are subject to calibration. The LR8514 logger does not require calibration.

|                                  |  |
|----------------------------------|--|
| No. of input channels            | 2 ch for temperature + 2 ch for humidity (2 sensors can be attached)   |
| Measurement items                | Temperature, humidity  |
| Temperature measurement accuracy | ±0.5°C (10°C to 60°C), using Z2010/Z2011<br>If outside above temperature range:<br>Add 0.015°C/°C (-40°C to 10°C) or 0.02°C/°C (60°C to 80°C)      |
| Humidity measurement accuracy    | ±3% rh (20 °C to 30 °C, 20% to 90% rh)<br>If outside above range, see Figure 1.<br>Hysteresis: ±1% rh (Added to the humidity measurement accuracy) |
| Recording intervals              | 0.5 to 30 sec, 1 to 60 min, 14 selections  |
| Recording modes                  | Instantaneous value  |
| Dimensions                       | 85W×61H×31D mm (3.35W×2.40H×1.22D in)  |
| Mass                             | 95 g (Not including the battery)   |

| Measurement objects | Range       | Max. Resolution | Measurable Range |
|---------------------|-------------|-----------------|------------------|
| Temperature         | 100 °C f.s. | 0.1 °C          | -40 °C to 80 °C  |
| Humidity            | 100%rh f.s. | 0.1 %rh         | 0 to 100 %rh     |

### ■ Humidity measurement accuracy (fig. 1)

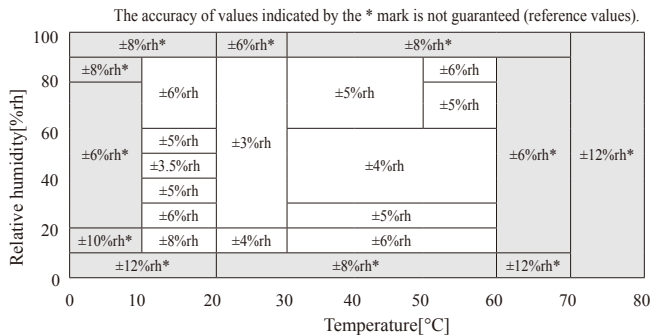

## WIRELESS VOLTAGE/TEMP LOGGER LR8515

### Basic specifications (Accuracy guaranteed for 1 year, Post-adjustment accuracy guaranteed for 1 year)

|                            |  |
|----------------------------|--|
| No. of input channels      | 2 ch (isolated; select voltage of thermocouple for each channel) |
| Measurement items          | Voltage/Thermocouple (K, T)                                      |
| Input terminals            | M3 screw type terminal block (2 terminals per channel)           |
| Measurement ranges         | Voltage: 50 mV/500 mV/5 V/50 V<br>Thermocouple: 1000°C (1832°F)  |
| Maximum input voltage      | DC±50 V  |
| Max. inter-channel voltage | DC 60 V  |
| Recording intervals        | 0.1 to 30 sec, 1 to 60 min, 16 selections                        |
| Recording modes            | Instantaneous value  |
| Dimensions                 | 85W×75H×38D mm (3.35W×2.95H×1.50D in)                            |
| Mass                       | 126 g (Not including the battery)                                |

| Measurement objects | Type | Range        | Max. Resolution | Measurable Range    | Measurement Accuracy |
|---------------------|------|--------------|-----------------|---------------------|----------------------|
| Voltage             |      | 50 mV f.s.   | 0.01 mV         | -50 mV to 50 mV     | ±0.05 mV             |
|                     |      | 500 mV f.s.  | 0.1 mV          | -500 mV to 500 mV   | ±0.5 mV              |
|                     |      | 5 V f.s.     | 1 mV            | -5 V to 5 V         | ±5 mV                |
|                     |      | 50 V f.s.    | 10 mV           | -50 V to 50 V       | ±50 mV               |
| Thermocouples       | K    | 1000 °C f.s. | 0.1 °C          | -200 °C to -100 °C  | ±1.5 °C              |
|                     |      |              |                 | -100 °C to 999.9 °C | ±0.8 °C              |
|                     | T    | 1000 °C f.s. | 0.1 °C          | -200 °C to -100 °C  | ±1.5 °C              |
|                     |      |              |                 | -100 °C to 0 °C     | ±0.8 °C              |
|                     |      |              |                 | 0 °C to 400 °C      | ±0.6 °C              |

Reference contact compensation: Switchable between internal and external  
Reference contact compensation accuracy: ±0.5°C (When using internal compensation, add to thermocouple measurement accuracy.)  
Temperature characteristics: Add (measurement accuracy × 0.1)/°C to measurement accuracy.



# Logger Utility specifications

Bundled application software(CD-R)

|                                   |   |                               |   |
|-----------------------------------|---|-------------------------------|---|
| <b>Supported units</b>            | Model 8423, 8430, LR8431, LR8432, LR8400, LR8401, LR8402, and LR8410  | <b>Data conversion</b>        | Target data: Real-time data acquisition file (LUW format), record to internal memory data (MEM format)<br>Converted sections: All data, designation section<br>Format: CSV format (separate by comma, space, tab), transfer to Excel spreadsheet, arbitrary data thinning   |
| <b>Operating environment</b>      | Windows 10/8/7 (32bit/64bit), Vista (32bit/64bit), XP SP2 or later (32bit)  | <b>Waveform processing</b>    | Processing items: Four arithmetic operations<br>Number of processing channels: 60 channels  |
| <b>Real-time data acquisition</b> | Measurements on multiple loggers connected by LAN or USB can be controlled to sequentially acquire, display and save waveform data (for recording up to 10 million samples)<br>Number of controllable instruments: up to 5 units (This software is compatible only with the LR8410, LR8400 series, LR8431, 8423, and 8430)<br>Display: Waveforms (time-axis divided display possible), numerical values (logging), and alarm status can be displayed at the same time<br>Numerical value display: Can be monitored in a separate window<br>Scroll: Waveform scroll while measuring<br>Data saving destination: Real-time data transfer to Excel, or Real-time data acquisition file (LUW format)<br>Event marks: Can be set while measuring | <b>Parameter calculations</b> | Target data: Real-time data acquisition file (LUW format), record to internal memory data (MEM format), data acquired in real time, waveform processing data<br>Calculation items: Average, peak, maximum values, time to maximum values, minimum values, time to minimum values, ON time, OFF time, count the number of ON time and OFF time, standard deviation, integration, area values, totalization |
| <b>Data acquisition settings</b>  | Data acquisition settings for the logger or logging station<br>Saving: The setting for multiple loggers or logging stations can be saved together in one file (LUS format); Instrument configuration settings can be sent and received  | <b>Search functions</b>       | Target data: Real-time data acquisition file (LUW format), record to internal memory data (MEM format)<br>Search mode: Event mark, time and date, maximum position, minimum position, maximum pole, minimum pole, alarm position, level, window, amount of change   |
| <b>Waveform display</b>           | Processed data file: Real-time data acquisition file (LUW format), Record to internal memory data (MEM format)<br>Display format: Simultaneously display waveform and numerical value, (time-axis divided display possible)<br>Maximum number of channels: 675 channels (measurement data) + 60 channels (waveform processing data)<br>Others: Display each channel's waveform on 10 sheets, scroll, record event mark, cursor, screen hard copy, numerical value display   | <b>Print functions</b>        | Supported printer: Printer compatible with the OS<br>Target data: Real-time data acquisition file (LUW format), record to internal memory data (MEM format)<br>Print format: Waveform image, report format, list print (channel settings, event, cursor value)<br>Print area: The entire area, area between cursors A and B<br>Print preview: Supported   |



## Model : WIRELESS LOGGING STATION LR8410

Model No. (Order Code) (Note)

**LR8410-20** (English model, main unit only)

Accessories: Instruction manual ×1, Measurement guide ×1, SD Memory Card (2GB) Z4001 ×1, CD-R (data collection software "Logger Utility") ×1, USB cable ×1, AC Adapter Z1008 ×1

*Measurement cannot be performed using the LR8410 alone. Measurement requires an LR8510/LR8511 measurement unit or an LR8512 or other wireless logger series. (One LR8410 can control from one to seven units [different models can be mixed].)*

## Measurement units



### Model : WIRELESS VOLTAGE/TEMP UNIT LR8510

Model No. (Order Code) (Note)

**LR8510** (For the LR8410)

Model LR8510/ LR8511/ LR8410 Shared bundled accessory: AC ADAPTER Z1008



### Model : WIRELESS UNIVERSAL UNIT LR8511

Model No. (Order Code) (Note)

**LR8511** (For the LR8410)

An optional AC adapter for the LR8512 to LR8520 is available for separate purchase.

## Wireless loggers



### Model : WIRELESS PULSE LOGGER LR8512

Model No. (Order Code) (Note)

**LR8512** (2 ch)

For pulse count, rotation, 1/0 signal measurement, L1010 cable bundled



### Model : WIRELESS CLAMP LOGGER LR8513

Model No. (Order Code) (Note)

**LR8513** (2 ch)

For AC/DC load current, AC leak current measurement, sensor is sold separately



### Model : WIRELESS HUMIDITY LOGGER LR8514

Model No. (Order Code) (Note)

**LR8514** (2 ch)

2 ch Temperature/ 2 ch Humidity measurement, sensor is sold separately



### Model : WIRELESS VOLTAGE/TEMP LOGGER LR8515

Model No. (Order Code) (Note)

**LR8515** (2 ch)

Voltage / Thermocouple (K, T) measurement, sensor is sold separately



### Model : WIRELESS FUNGAL LOGGER LR8520

Model No. (Order Code) (Note)

**LR8520**

Record fungal index, growth prediction, alarm 1 channel, temperature measurement, humidity sensor is sold separately

Collect data on your tablet!

Use your tablet\*, smart-phone\*, or PC via Bluetooth® to collect data from Wireless Mini Loggers. (\*Android™ only)  
Transfer data even during recording, or check data and fluctuating waveforms on the spot.



## Options for the Wireless Logging Station LR8410

|                   |  |   |   |
|-------------------|--|---|---|
| Bundled Accessory | <br>AC ADAPTER Z1008<br>100 V to 240 V AC                                 | <br>SD MEMORY CARD 2GB<br>Z4001<br>For storing measurement data        | <br>SD MEMORY CARD 8GB<br>Z4003<br>For storing measurement data      |
|                   | <br>BATTERY PACK Z1007<br>Li-ion, Charges while installed, 7.2 V/2170 mAh | <br>CARRYING CASE C1007<br>Holds one LR8410 and four measurement units | <br>FIXED STAND Z1009<br>For wall hanging and slanted bench mounting |

## Shared options for the LR8510/ LR8511

|                   |  |  |
|-------------------|--|--|
| Bundled Accessory | <br>AC ADAPTER Z1008<br>100 V to 240 V AC                       | <br>BATTERY PACK Z1007<br>Li-ion, Charges while installed, 7.2 V/2170 mAh |
|                   | <br>Thermocouple<br>For reference only. Please purchase locally. |   |

## Shared options for the LR8512/ LR8520

\*L1010 is bundled with the LR8512/8520

Bundled Accessory





CONNECTION CABLE L1010  
1.5 m (4.92 ft) length

## Shared options for the LR8514/ LR8520

|  |   |
|--|---|
| <br>HUMIDITY SENSOR Z2010<br>50 mm (1.97 in) length | <br>HUMIDITY SENSOR Z2011<br>1.5 m (4.92 ft) cord length |
|--|---|

## Options for the LR8515










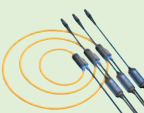

|  |   |
|--|---|
| <br>Thermocouple<br>For reference only. Please purchase locally. |  |
|--|---|

## Options for the LR8511

|  |
|--|
| <br>HUMIDITY SENSOR Z2000<br>3 m (9.84 ft) length |
|--|

## Current Sensor Options for the LR8513

\* Maximum measurable current when used with the LR8513


|  |  |  |  |  |  |   |
|--|--|--|--|--|--|---|
| <br>CLAMP ON SENSOR CT6500<br>500 A AC, $\phi$ 46 mm (1.81 in)  | <br>CLAMP ON SENSOR 9669<br>1000 A AC, $\phi$ 55 mm (2.17 in)   | <br>CLAMP ON LEAK SENSOR 9657-10<br>* 5 A AC, $\phi$ 40 mm (1.57 in)  | <br>CLAMP ON LEAK SENSOR 9675<br>* 5 A AC, $\phi$ 30 mm (1.18 in)                                     | <br>AC FLEXIBLE CURRENT SENSOR CT9667-01/-02/-03<br>$\phi$ 100/ 180/ 254 mm (3.94/ 7.09/ 10.00 in) | <br>CLAMP ON SENSOR 9695-02<br>50 A AC, $\phi$ 15 mm (0.59 in), Not CE marked | <br>CONNECTION CABLE 9219<br>The 9219 is required to connect the 9695-02 |
| <br>AC/DC AUTO-ZERO CURRENT SENSOR CT7731<br>100 A AC/DC, $\phi$ 33 mm (1.30 in)<br>CT7736<br>* 200 A AC/DC, $\phi$ 33 mm (1.30 in)<br>CT7742<br>2000 A AC/DC, $\phi$ 55 mm (2.17 in) | <br>AC/DC CURRENT SENSOR CT7631<br>100 A AC/DC, $\phi$ 33 mm (1.30 in)<br>CT7636<br>* 200 A AC/DC, $\phi$ 33 mm (1.30 in)<br>CT7642<br>2000 A AC/DC, $\phi$ 55 mm (2.17 in) | <br>AC FLEXIBLE CURRENT SENSOR CT7044<br>* 5000 A AC, $\phi$ 100 mm (3.94 in)<br>CT7045<br>* 5000 A AC, $\phi$ 180 mm (7.09 in)<br>CT7046<br>* 5000 A AC, $\phi$ 254 mm (10.00 in) | <br>OUTPUT CORD L9095<br>Connect to BNC terminal, 1.5 m (4.92 ft) length, for the CM7290 or other |  |  |   |

Make measurements over extended periods of time without the need to perform zero-adjustment, even in locations with temperature variations.

Even in locations without temperature variations.

Caution: The CT7000 series Current Sensor cannot be connected directly to the Wireless Clamp Logger LR8513. The Display Unit CM7290 and Output Cord L9095 is required to connect those sensors to the LR8513.

DISPLAY UNIT CM7290  
For the CT7000 series



### Shared Options for the LR8512 to LR8520

|   |   |   |
|---|---|---|
| <br>AC ADAPTER Z2003<br>100 V to 240 V AC | <br>MAGNETIC STRAP Z5004 | <br>MAGNETIC STRAP Z5020<br>Extra strength |
|---|---|---|

## Use of the Wireless Logging Station

The LR8510/ LR8511 measurement units, the LR8512/ LR8513/ LR8514/ LR8515/ LR8520 wireless loggers, and the LR8410 Wireless Logging Station use the 2.4 GHz band. No radio station license is required in order to use these products, but the following precautions should be observed:

- Do not use with systems required to exhibit a high level of safety or reliability.
- Do not use in proximity to pacemakers or other medical devices.
- The communications range between the Wireless Voltage/ Temp Unit, Wireless Universal Unit, and Wireless Logging Station is 30 meters (line-of-sight distance). The presence of obstructions (such as walls or metal shielding) may compromise the reliability of communications or shorten the communications range. In addition, radio wave intensities, which are indicated with the antenna-like indicators, vary depending on units even while these units are operating in the same environment.
- When used in proximity to other devices that use the same frequency band, for example wireless networking devices, transmission and reception of data may become unreliable, and product operation may be affected by the other devices.
- Although communications with the LR8510/ LR8511 measurement units, the LR8512/ LR8513/ LR8514/ LR8515/ LR8520 wireless loggers, and the LR8410 Wireless Logging Station are encrypted using SSP, the confidentiality of information sent and received in this manner is not guaranteed. Hioki is not liable for any damage sustained due to the interception of measured values sent using wireless communications.
- The LR8510/ LR8511 measurement units, the LR8512/ LR8513/ LR8514/ LR8515/ LR8520 wireless loggers, and the LR8410 Wireless Logging Station emit radio waves. Use of radio waves is subject to licensing requirements in certain countries. Use in countries or regions other than those listed above may constitute a violation of law, exposing the operator to legal penalties.

\*The Bluetooth® word mark and logos are registered trademarks owned by Bluetooth SIG, Inc. and any use of such marks by HIOKI E.E. CORPORATION is under license.  
Note: Company names and Product names appearing in this catalog are trademarks or registered trademarks of various companies.

# HIOKI

HIOKI E. E. CORPORATION

HEADQUARTERS  
81 Koizumi,  
Ueda, Nagano 386-1192 Japan  
<https://www.hioki.com/>



Our regional contact information

DISTRIBUTED BY