MOM2

Micro-ohmmeter



- Up to 240 A
- Bluetooth® headset for audible pass/fail testing against adjustable limits
- Battery powered
- Handheld, lightweight 2.2 lb (1 kg)
- Safe test DualGround™
- Auto range: 1 μΩ to 1000 mΩ
- Ultra capacitor technology (patent pending)

DESCRIPTION

The MOM2 Micro-ohmmeter is a lightweight, handheld unit designed to deliver up to 240 Amps and measure the resistance of circuit breaker contacts, bus-bar joints, and other high-current links. This product is designed with safety, ease of use and versatility in mind.

The MOM2 can be used anywhere to measure a low resistance value with high accuracy. With the MOM2, it is possible to make measurements according to the DualGround™ method. This means that the test object will be grounded on both sides throughout the test giving a safer, faster and easier workflow.

Its ruggedness and light weight make the MOM2 very suitable for field work, such as in substations. The unit comes with a strong rubber holster accessory which makes it extra durable. The MOM2 is capable of testing for a full day without recharge. It can store 190 test values and transfer test data to a PC via Bluetooth.

The Bluetooth feature can also be used in conjunction with the wireless headset to provide an audible pass/fail signal against user-adjustable limits as tests are performed.

High Current Generation Using Ultra Capacitor

The MOM2 uses an ultra capacitor to generate the highoutput current. Ultra capacitors are able to store huge amounts of energy compared to conventional capacitors. In addition, they can deliver very high currents during discharge as a result of their very low internal resistance. While testing, the capacitor is discharged through the test object. The voltage drop across and the current flow through the test object are continuously and synchronously sampled. The resistances calculated from the individual samples are then averaged to obtain the final value.

APPLICATIONS

The MOM2 test system is designed to serve a number of applications. The most common are contact resistance measurements of low-, medium- and high-voltage breakers and also at bus-bar joints, and other high current links.

If the contact resistance is too high, this will lead to power loss and temperature rise, which often leads to serious trouble. To avoid such problems, it is necessary to check the resistance at regular intervals.

The following table demonstrates how important low resistance is at high currents:

Current	Contact resistance	Power loss
10 kA	1 mΩ	100 kW
10 kA	0.1 mΩ	10 kW
1 kA	1 mΩ	1 kW
1 kA	0.1 mΩ	100 W

At 10 kA a contact with the resistance 0.1 m Ω gives a power loss of 10 kW. This power loss in one single point will definitely confer a temperature rise, which may result in overheating and possibly premature failure.

INSTRUMENT FRONT VIEW


- 1. Current output terminal (-)
- 2. Current output terminal (+)
- 3. Display
 - The display offers a combination of analog arc and a dual digital readout:
 - Analog arc: Indicates level of the capacitor charge.
 - Dual digital display: Large main digital readout for good visibility of all main measurement results Second digital display for additional data.
- 4. Ground (earth) terminal
- 5. Keys for navigation and to make settings in the display
- 6. TEST-button
- Stand-by/Wake up (Press shortly to toggle) Clear log (Press and hold for 5 seconds)
- 8. Function selector

OFF			
011			
I > I min	0.1 s	Measurement time with	
	0.6 s	minimum current guarantee	
	3 s		
I = I max	0.1 s	Measurement time with max. charg	
	0.6 s		
	3 s		
SET	*	Bluetooth "pair units"	
	CLK	Set date and time	
		Set volume for the internal loudspeaker	
		Discharge the MOM2 internal capacitor	
	I min	Minimum current guarantee setting	
	LOG	Data log settings	
	P/F	Pass/Fail settings	
PC COM		PC communication (dump data to PC)	
USER	1	Stored settings. Set from PC, MOM2 Win	
	2		
	3		

- 9. Connector for the voltage (–) sense lead
- 10. Connector for the voltage sense (+) lead and the trig function
- 11. Connector for the battery charger
- 12. Battery charger indicator



4 wire Kelvin test

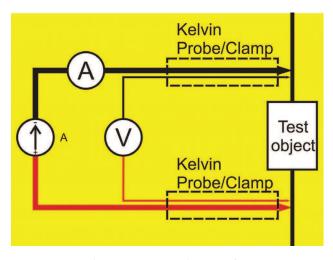

The Kelvin probes (included in BD-59090) are used for a 4-wire Kelvin test. This is a way of measuring continuity resistances ensuring all contact and lead resistances are compensated for, allowing a much greater accuracy in measurements. Each Kelvin probe assembly has two probe tips: one tip is for the current generated; the other will measure the very small voltage present. The Kelvin clamps (included in BD-59092) use the same principle.



The "double" probe tip showing the springy center tip

APPLICATION EXAMPLES

Circuit Breaker testing

- Test of circuit breaker contacts
- Test of the connections to the breaker

Testing of Bus-bar


- Test of Bus-bar joints
- Test of connections

Everywhere you need to test a low resistance/ high current connection

- Switches
- Disconnecting devices
- Safety ground connections
- Welding points
- Fuses
- Cables



Hold probes / attach Kelvin clamps to CB and press trig / TEST button. A signal indicates whether test was pass or fail and result is logged in unit for later dump to PC.

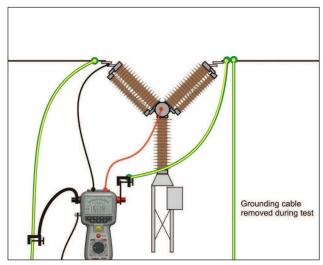

Traditional measurement from ground. Injection is done through existing grounding cable (earthing). Optional cable kit is needed. Available kits have 5, 10 or 15 m cables.

BOTH SIDES GROUNDED


Within electrical power utilities, switchgear owners and service companies, there is an increased emphasis on efficiency of operations, maintenance and service levels. There is an increased emphasis on health, safety, and environmental compliance. Experience has also shown demands for shorter time periods for testing, while the switchgear is less and less available to be taken out of service.

Many utilities require safety grounds to remain in place during station outages, and the MOM2 was designed with this field safety constraint in mind. DualGround means that the test object will be grounded on both sides throughout the test giving a safer, faster and easier workflow. Minimum time is spent in the substation and focus is on the test rather than the equipment.

Conventional vs. DualGround				
Site preparation (isolate work area, apply safety ground, issue permit to work)	Site preparation (isolate work area, apply safety ground, issue permit to work)			
Hook up test equipment. Issue sanction for test	Hook up test equipment. Issue sanction for test			
Authorized person removes the ground	Risky step left out			
Perform testing	Safe testing with both sides grounded			
Authorized person applies ground	Risky step left out			
Cancel sanction for test. Disconnect test equipment	Cancel sanction for test. Disconnect test equipment			
Site closing (cancel permit to work, disconnect ground)	Site closing (cancel permit to work, disconnect ground)			



Equipment and methods that supports
DualGround™ testing are associated with the
DualGround symbol. This symbol certifies the use
of groundbreaking technology and methods that
enables a safe, fast and easy workflow with both
sides grounded throughout the test.

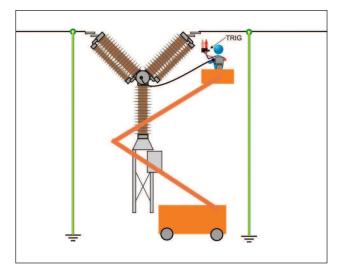

Megger. Mom2

SPECIFICATIONS

Specifications are valid at fully charged batteries and an ambient temperature of +25°C, (77°F). Specifications are subject to change without notice.

Environment

Application field For use in high-voltage substations

and industrial environments.

Temperature

Operation* -20°C to $+50^{\circ}\text{C}$ (- 4°F to $+122^{\circ}\text{F}$)
Storage -40°C to $+70^{\circ}\text{C}$ (- 40°F to $+158^{\circ}\text{F}$)
Relative humidity %RH 5°-95 %, non condensing

Pollution degree 2

Shock IEC 60068-2-27
Vibration IEC 60068-2-6
Transport ISTA 2A

*Battery operation temperature 0°C to +50° (32°F to +122°F)

*Battery charging temperature +10°C to +40° (50°F to +104°F)

General

Battery power Five AA (HR6) 2700 mAh NiMH cells

Recharge time < 12 h
Typical recharge time 3 h

at 25°C

Battery charger

Mains voltage 100 - 250 V AC, 50 / 60 Hz

Power consumption 60 W

Protection Against wrong battery type, low/high

temperature ≥10 years

Real time clock battery

Audible feedback

lite

Different buzzer sounds

User presets 3
Field calibration Yes
Encapsulation IP54

Dimensions 217 x 104 x 72 mm (excl. binding posts) 8.5 x 4.1 x 2.8 in.

Dimensions 395 x 300 x 190 mm Carrying case 15.6 x 11.8 x 7.5 in.

Weight 2.2 lbs (1.0 kg) instrument only

11 lbs (5.0 kg) with accessories and

carrying case

CE-marking

EMC 2004/108/EC LVD 2006/95/EC

Measurement section

 $\begin{array}{ll} \mbox{Minimum current} & \mbox{Selectable 50 A / 100 A} \\ \mbox{guarantee} & \mbox{Valid at resistance} \leq 2 m \Omega \\ \mbox{Pass / Fail} & \mbox{Settable from 1 } \mu \Omega \mbox{ to 1999 } m \Omega \\ \mbox{Number of} & \mbox{typ. 2200 at I min = 50 A and 0.1 s} \\ \mbox{measurements on fully} & \mbox{typ. 800 at I min = 100 A and 0.1 s} \\ \end{array}$

charged batteries

Interference suppression Yes

Range $0 - 1000 \text{ m}\Omega$

Range selection Auto

Resolution

 $\begin{array}{lll} 0 - 999 \; \mu\Omega & & 1 \; \mu\Omega \\ 1.0 - 9.99 \; m\Omega & & 0.01 \; m\Omega \\ 10.0 - 99.9 \; m\Omega & & 0.1 \; m\Omega \\ 100 - 1000 \; m\Omega & & 1 \; m\Omega \end{array}$

Accuracy

 $\begin{array}{ll} 0-1999 \; \mu\Omega & \qquad \pm 1 \; \% \; \text{of reading } \pm 1 \; \text{digit} \\ 2-1000 \; m\Omega & \qquad \pm 2 \; \% \; \text{of reading } \pm 1 \; \text{digit} \end{array}$

Outputs + / -

Range $> 100 \text{ A DC } (R < 2 \text{ m}\Omega)$

Output voltage (max) 2.5 V DC

Generation duration Selectable: 0.1 s, 0.6 s, 3 s

	Recovery time at I min set to 100 A and load 100 $\mu\Omega$	
Generation time	Max	Тур
0.1 s	10 s	8 s
0.6 s	20 s	16 s
3 s	130 s	100 s

Handheld High Current Micro-ohmmeter

Inputs

SENSE + / -

Connector 4 mm banana jack

Voltage ±3 V DC

Trigger input Threshold 8 V DC DC IN 12 – 24 V DC, 2 A max

Logger

Labeling schemes

Logger, Data Label. Timestamp, I max, I min, I Limit,

Resistance, Meas.time, P/F limit Circuit breaker oriented or diary

number

Capacity 190 measurements

Wireless communication

Headset Bluetooth PC communication Bluetooth

INCLUDED ACCESSORIES



MOM2 shown with transport case, charger, Kelvin clamps, rubber holster, carrying strap, belt clip, MOM2 Win.



Kelvin probes (incl. in BD-59090)

OPTIONAL ACCESSORIES





Bluetooth kit



Calibration kit







Soft carrying case

ORDERING INFORMATION	
Item	Cat. No.
MOM2 Micro-ohmmeter including: 2 x 1.3 m (4 ft) test cables Kelvin probes (one with trig button) transport case, charger, rubber holster, carrying strap, belt clip, MOM2 Win	BD-59090
MOM2 Micro-ohmmeter including: 1.3 m (4 ft) test cable red with Kelvin clamp 3 m (10 ft) test cable black with Kelvin clamp, transport case, charger, rubber holster, carrying strap, belt clip, MOM2 Win	BD-59092
MOM2 Micro-ohmmeter including: 1.3 m (4 ft) test cable red with Kelvin clamp 5 m (16 ft) test cable black with Kelvin clamp, transport case, charger, rubber holster, carrying strap, belt clip, MOM2 Win	BD-59093
Optional Accessories	
Test cables with Kelvin probes 2 x 1.3 m (4 ft) (one with trig button)	GA-90000
Test cables with Kelvin clamps 1.3 m (4 ft) red, 3 m (10 ft) black	GA-90001
Test cables with Kelvin clamps 3 m (10 ft) black	GA-00372
Test cables with Kelvin clamps 1.3 m (4 ft) black, 16 mm ²	GA-00373
Test cables with Kelvin clamps 5 m (16 ft) black	GA-00374
Test cables with Kelvin clamps 10 m (33 ft) black, 16 mm ²	GA-00376
Cable kit 5 m Current cable 0.5 m (1.6 ft), connection plate and sense cables 5 m (16 ft), ground cable	GA-00380
Cable kit 10 m Current cable 0.5 m (1.6 ft), connection plate and sense cables 10 m (33 ft), ground cable	GA-00382
Cable kit 15 m Current cable 0.5 m (1.6 ft), connection plate and sense cables 15 m (49 ft), ground cable	GA-00384
Bluetooth headset and dongle for PC	XC-06000
Calibration kit	BD-90002
Soft carrying case for MOM2, charger & cables	GD-00620

SALES OFFICE

Megger USA -Valley Forge Corporate Center 2621 Van Buren Avenue, Norristown, Pennsylvania, 19403, USA T. 1-610 676 8500 F. 1-610-676-8610

MOM2_DS_US_V16

www.megger.com

